Part 573 Safety Recall Report

Manufacturer Name :DENSO International America, Inc.Submission Date :APR 27, 2020NHTSA Recall No. :20E-026Manufacturer Recall No. :NR



Manufacturer Name : DENSO International America, Inc. Address : 24777 DENSO Drive Southfield MI 48033 Company phone : 999

Population :

Number of potentially involved : 2,020,000 Estimated percentage with defect : NR

云 🔨 🗛 🖈

NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION

20E-026

company priorie i com

Equipment Information :

| Brand / Trade 1: | DENSO |
|---------------------------|---|
| Model : | Fuel Pump |
| Part No. : | Various Part Numbers |
| Size : | N/A |
| Function : | Fuel Supply |
| Descriptive Information : | The low-pressure fuel pump is located in the fuel tank and supplies fuel pressure to the fuel injection system. |
| Production Dates : | SEP 01, 2017 - OCT 06, 2018 |

Description of Defect :

| Description of the Defect : | An impeller in some low pressure fuel pumps may become deformed under certain conditions which could render the fuel pump inoperable. |
|----------------------------------|---|
| FMVSS 1 : | NR |
| FMVSS 2 : | NR |
| Description of the Safety Risk : | If an impeller deforms to a point that creates sufficient interference with the fuel pump body, the fuel pump becomes inoperative. According to vehicle manufacturer's system evaluation, an inoperative fuel pump may result in the illumination of the check engine light and/or master warning indicators, rough engine running, engine no start and/or vehicle stall while driving at low speed and, in rare instances, a vehicle stall could occur while driving at higher speeds, increasing the risk of a crash. |
| Description of the Cause : | Under current knowledge, if an impeller is manufactured with a lower density, and contains a lower surface strength or is exposed to production solvent drying for a longer period of time, higher levels of surface cracking may occur which, when excessive fuel absorption occurs, may result in impeller |
| | |

The information contained in this report was submitted pursuant to 49 CFR §573

| art 575 Safety r | Recall Report | 20E-026 | Page |
|--|---|-----------------------------------|-----------|
| | eformation. Geographic location and otential for deformation resulting in | | e |
| that can Occur: p | ccording to vehicle manufacturer's sy ump results in the illumination of the varning indicators, rough running, or ervice is required. | e check engine light and/or maste | er |
| nvolved Components : | | | |
| Component Name : NR | | | |
| Component Description : NR | | | |
| Component Part Number : NR | | | |
| | | | |
| | | | |
| Component Manufacturer Name : DENSO International Address : 24777 Denso Drive Southfield MICHIGAN Country : United States Chronology : Please see attached DIR report for | N 48086 | | |
| Component Manufacturer Name : DENSO International Address : 24777 Denso Drive Southfield MICHIGAN Country : United States Chronology : Please see attached DIR report for Description of Remedy : | v 48086 | l he determined by vobiolo monu | facturors |
| Address : 24777 Denso Drive Southfield MICHIGAN United States Country : United States Chronology : Please see attached DIR report for Description of Remedy : Description of Remedy Program | N 48086 or detail m : The remedy program, if any, wil ers The impeller of fuel pumps utiliz | · | |

The information contained in this report was submitted pursuant to 49 CFR \$573

Part 573 Safety Recall Report

Recall Schedule :

Description of Recall Schedule : The recall schedule will be decided by vehicle manufacturers.

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

| | Ford Motor Company 1 American Rd Dearborn MI 48126 |
|------------------------------|---|
| Country : Company Phone : | US |
| | American Honda Motor Co., Inc. 1919 Torrance Blvd. Torrance CA 90501-2746 |
| Country : Company Phone : | |
| | Ford Motor Company 1 American Rd Dearborn MI 48126 |
| Country : Company Phone : | US |
| | Mazda North American Operations 1025 Connecticut Avenue, NW Washington DC 20036 US |
| Company Phone : | NR |
| Address : | Ventura CA 93003 |
| Country : Company Phone : | |

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

Address : 6565 Headquarters Drive Plano TX 75024

Address: 4015 Aspen Grove Dr

Franklin TN 37067

Name: Mitsubishi Motors North America, Inc.

| Name · | Subaru of America, Inc. |
|-----------------|---------------------------------|
| | One Subaru Drive |
| | Camden NJ 08103 |
| Country : | |
| Company Phone : | |
| 2 0 | |
| Name : | Toyota Motor North America,Inc. |

* NR - Not Reported

Country : US Company Phone : 4692924000

Country : US Company Phone : 8654414166

The information contained in this report was submitted pursuant to 49 CFR \$573