

To whom it may concern, Administrator, National Highway traffic safety Administration, I am submitting this complaint in regards to my 2000 Dae Woo Nebria my sensor light kept coming on I first took it carvaneue motors where the agent name willie got my sensor light off but since I move to Monticello ar. My light started coming back on auto zone would get the light off some times for me but I was driving the car I wasn;t too far out of town before my car started smoking I though it was just running hot until smoke started coming into the car on me it was night the car went dead I jumped out the car the next day I had the car towed the wires were burned I am requesting some help in the replacement of my car or repair of

please contact [redacted] says we need [redacted] rights

Daewoo Nebria
Vin no. klajc52 [redacted]

10161577

6/27/03
6/27/03 10:10
6/27/03 10:10

2006 JUN 27 AM 10:03

Anna M. [redacted] 6/27/03



Daewoo Motor America, Inc.
1055 W. Victoria St.
Compton, CA 90220-9709

May, 2006
(ii)

Safety Recall Notice Lanos, Nubira, Leganza

SECOND NOTICE

Dear Lanos, Nubira, and Leganza Owner,

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. We are writing as a follow-up to an earlier communication regarding this important subject. Our records indicate that you have not yet made your Daewoo vehicle available to your Daewoo Dealer or Authorized Service Center (ASC) allowing them to perform this important inspection procedure.

Daewoo has decided that a defect which relates to motor vehicle safety exists in certain Lanos, Nubira and Leganza model vehicles.

The problem is with the Camshaft Position (CMP) Sensor that may be installed in your Daewoo vehicle. The CMP sensor sends a CMP sensor signal to the engine control module (ECM). The ECM uses this signal as "sync pulse" to trigger the fuel injectors in the proper sequence. In rare instances, due to a possible crack in the C2 capacitor attached to the CMP Sensor PC board, CMP Sensor may malfunction, which will cause the check engine warning light in your instrument panel to illuminate. Additionally, the Camshaft Position Sensor and wiring may melt resulting in a burning smell and/or visible smoke and possibly an underhood fire.

If you have taken your Daewoo in for service since October 2001 because the Check Engine Warning Light was illuminated on your instrument panel, contact your Daewoo Dealer or Authorized Service Center (ASC) immediately to arrange for your vehicle to be inspected, because your CMP Sensor may have been replaced with one that is subject to this recall. Your dealer or ASC will inspect your vehicle and, if your CMP Sensor needs to be replaced, will replace the sensor and add an in-line fuse to the CMP Sensor wiring. If you are not the first owner of your Daewoo vehicle and/or are not sure if your vehicle has been serviced because of an illuminated Check Engine Warning Light, you should also immediately contact your Daewoo Dealer or Authorized Service Center (ASC) to arrange for your vehicle to be inspected.

If your vehicle has not been serviced since October of 2001 to address an illuminated Check Engine Light, or your vehicle's VIN* is not within the following VIN range, your vehicle is not subject to this recall campaign, and you need take no further action at this time.

- Lanos (VIN* numbers: 159465 to 715060)
- Nubira (VIN* numbers: 157058 to 778128, 998142 to [REDACTED])
- Leganza (VIN* numbers: 105594 to 331911)

*VIN=Vehicle Identification Number

SALES
SERVICE
RECALL