



U.S. Department
of Transportation
**National Highway
Traffic Safety
Administration**

DOT Auto Safety Hotline
Vehicle Owner's Questionnaire
To Report Vehicle Safety Defects
1-888-DASH-2-DOT
(1-888-327-4236)
INTERNET: www.nhtsa.dot.gov/hotline

FOR AGENCY USE ONLY 100148

Date Received

2007 APR 23
15-MAR-2007

Repository ☐

Reference No.
10185183

OWNER INFORMATION (Type or Print)

Name **[REDACTED]**
Address **[REDACTED]**
City **LOS VANOS S/B (LOS BANOS)** State **CA** Zip Code **[REDACTED]**

Daytime Telephone Number

E-mail Address

Evening Telephone Number

Do you authorize NHTSA to provide a copy of this report to the manufacturer of your vehicle?
In the absence of an authorization, NHTSA WILL NOT provide your name or address to the vehicle manufacturer.
Signature of Owner **[REDACTED]** Date **4/4/07** ☒ YES ☐ NO

VEHICLE INFORMATION

17 digit Vehicle Identification Number Located at bottom of windshield on driver's side
2GCEC19T01 [REDACTED] Make **CHEVROLET** Model **SILVERADO 1500** Model Year **2001**

Date Purchased
03-FEB-01

Dealer's Name and Telephone Number
LOS BANOS MOTORS
LOSEANOS MOTORS UNKNOWN S/B 1209 6TH ST.

Engine:
No. Cylinders **8**

Fuel Type:
Gas

Original Owner
☒

Dealer's City
S/B LOS BANOS

State
CA

Zip Code
93635

Transmission Type
AUTOMATIC

☒ Antilock Brakes
☒ Cruise Control

Powertrain
REAR WHEEL DRIVE

Vehicle Component Code
050000 PARKING BRAKE

Multiple Failure: **1**

FAILED COMPONENT(S)/PART(S) INFORMATION

Incident Date(s)
01-AUG-2006

Failure Mileage
52000

Failure Speed

ADDITIONAL ITEMS TO BE COMPLETED WHEN REPORTING A TIRE FAILURE

Tire Make

Tire Model (Name or Number)

Tire Size (Example P215/65R15)

DOT No. (Example: DOTM19ABC036)

☐ Original Equipment
☐ Prior Repair

Failure Location:

Tire Component Code

Tire Failure Type

ADDITIONAL ITEMS TO BE COMPLETED WHEN REPORTING A CHILD SEAT FAILURE

Make:

Date Manufactured:

Model No./Name:

Seat Type:

Installation System:

Child Seat Component Code:

Failed Part:

APPLICABLE INCIDENT INFORMATION

Crash

☐ Yes ☒ No

Fire

☐ Yes ☒ No

Number of Persons Injured

0

Number of Deaths

0

Reported to Police

N

Narrative Description of Incident(s), Crash(es), and Injury(ies).

Please describe (1) events leading up to the failure, (2) failure and its consequences, and (3) what was done to correct the failure; i.e. parts repaired or replaced (and if old part is available).

TL* THE CONTACT OWNS A 2001 CHEVROLET SILVERADO 1500. THE CONTACT HEARD A SCRAPPING NOISE IN THE VEHICLE. RECALL CAMPAIGN# 05V161000 WAS RELATED TO THE PARKING BRAKE FAILURE. THE FAILURE MILEAGE WAS 52000. IN OCTOBER 2006 THE DEALER STATED THAT THE RECALL WAS NOT RELATED TO THIS VEHICLE DUE TO THE BRAKE PADS AND ROTORS BEING WORN. *AK THE CURRENT MILFAGE WAS 61610.

Include, if available: Police/Fire Department Report, Photos, and Repair Invoice.

ATTACH ADDITIONAL SHEETS IF NECESSARY

The Privacy Act of 1974-Public Law 93-579 This information is requested pursuant to authority vested in the National Highway Traffic Safety Act and subsequent amendments. You are under no obligation to respond to this questionnaire. Your response may be used to assist the NHTSA in determining whether a Manufacturer should take appropriate action to correct a safety defect. If the NHTSA proceeds with administrative enforcement or litigation against a manufacturer, your response, or a statistical summary thereof, may be used in support of the agency's action.

Narrative Description of Incident(s), Failure(s), Crash(es), and Injury(ies)

I FIRMLY BELIEVE THAT THE FAILURE OF THE PARKING
BRAKE IS RELATED TO THE RECALL. THIS RECALL IS LISTED
ON THE NHTSA WEB PAGE AND IS LISTED ON THE G.M.
SERVICE WEB PAGE WHICH LISTS THE YEAR OF MY PICKUP.
SEE ATTACHMENTS
CORRECTIONS HI LINED ON ADDRESSES

ATTACH ADDITIONAL SHEETS IF NECESSARY

DOT
NATIONAL HIGHWAY
TRAFFIC SAFETY ADM
400 7TH ST SW
WASHINGTON DC 20590
OFFICIAL BUSINESS




NO POSTAGE
NECESSARY
IF MAILED
IN THE
UNITED STATES

BUSINESS REPLY MAIL

FIRST-CLASS MAIL PERMIT NO 1888 WASHINGTON DC

POSTAGE WILL BE PAID BY ADDRESSEE

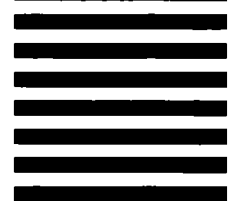

US DEPARTMENT OF TRANSPORTATION
NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION
OFFICE OF DEFECTS INVESTIGATION, NVS-210
400 7TH ST SW
WASHINGTON DC 20077-8214



Think your vehicle
has a safety defect?



If so:

Use the enclosed
form to file a report.

or visit:

www.safercar.gov

or call:

Vehicle Safety Hotline
888-327-4236

www.nhtsa.gov
NHTSA

Vehicle Owner's Questionnaire (VOQ)
U.S. Department of Transportation
National Highway Traffic Safety Administration



Subject: Scraping Noise From Rear of Vehicle (Replace Parking Brake Shoe Kit and Clean Drum in Hat Rotor) #02-05-26-002A - (01/28/2003)



Models: 2002-2003 Cadillac Escalade, Escalade EXT
1999-2003 Chevrolet Silverado 1500 Series Pickups
2000-2003 Chevrolet Suburban, Tahoe 1500 Series Models
2002-2003 Chevrolet Avalanche 1500 Series Models
1999-2003 GMC Sierra 1500 Series Pickups
2000-2003 GMC Yukon, Yukon XL 1500 Series Models

This bulletin is being revised to add Suburban and Yukon XL models. Please discard Corporate Bulletin Number 02-05-26-002 (Section 05 - Brakes).

Condition

Some customers may comment on a scraping noise from the rear of the vehicle while driving. The noise may be intermittent.

Cause

Condition may due to the parking brake shoe contacting the drum in hat rotor without the parking brake being applied, causing premature wear on the shoe lining.

Correction

Replace the parking brake shoe and install a new designed spring clip retainer. Follow the service procedure below to correct this condition.

1. Raise and support the vehicle. Refer to Lifting and Jacking the Vehicle in the General Information sub-section of the Service Information (SI Document ID #639546).
2. Remove the tire and the wheel. Refer to Tire and Wheel Removal and Installation in the Tires and Wheels sub-section of the Service Information (SI Document ID #656965).
3. Relieve the tension on the park brake cables by loosening the nut at the equalizer.
4. Mark the relationship of the rotor to the hub.
5. Remove the brake caliper bracket mounting bolts.

Notice: Support the brake caliper with heavy mechanic's wire, or equivalent, whenever it is separated from it's mount and the hydraulic flexible brake hose is still connected. Failure to support the caliper in this manner will cause the flexible brake hose to bear the weight of the caliper, which may cause damage to the brake hose and in turn may cause a brake fluid leak.

6. Remove the brake caliper and brake caliper bracket as an assembly and support with heavy mechanic's wire or



Office of Defects Investigation

Recalls - Search Results

71-5483
634 086

Report Date : February 15, 2007 at 11:32 PM

SEARCH TYPE : VEHICLE

Make : CHEVROLET

Model : SILVERADO

Make : CHEVROLET

Model : SILVERADO

Year : 2001

Manufacturer : GENERAL MOTORS CORP.

NHTSA CAMPAIGN ID Number : 05V161000

Recall Date : APR 20, 2005

Component: PARKING BRAKE

Potential Number Of Units Affected : 90242

Summary:

ON CERTAIN PICKUP TRUCKS EQUIPPED WITH MANUAL TRANSMISSIONS AND BUILT WITH EITHER PBR PARKING BRAKE SYSTEMS OR TRW PARKING BRAKE SYSTEMS, THE PARKING BRAKE FRICTION LININGS MAY WEAR TO AN EXTENT WHERE THE PARKING BRAKE CAN BECOME INEFFECTIVE IN IMMOBILIZING A PARKED VEHICLE.

Consequence:

IF THE PARKING BRAKE DOES NOT HOLD, UNINTENDED VEHICLE MOVEMENT COULD OCCUR, WHICH COULD RESULT IN A CRASH.

Remedy:

DEALERS WILL INSTALL A LOW-FORCE SPRING CLIP RETAINER FOR VEHICLES EQUIPPED WITH A PBR PARKING BRAKE SYSTEM. ON VEHICLES EQUIPPED WITH THE TRW PARKING BRAKE SYSTEM, DEALERS WILL INSTALL A REDESIGNED PARKING BRAKE CABLE ASSEMBLY. THE RECALL BEGAN ON JULY 29, 2005. OWNERS MAY CONTACT CHEVROLET AT 1-800-630-2438 OR GMC AT 1-866-996-9463.

Notes:

GM RECALL NO. 05042. CUSTOMERS MAY ALSO CONTACT THE NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION'S VEHICLE SAFETY HOTLINE AT 1-888-327-4236 (TTY 1-800-424-9153), OR GO TO [HTTP://WWW.SAFERCAR.GOV](http://www.safercar.gov).