



Anchor

MOTOR COMPANY, INC.

"A Full Line Ford and Mercury Dealership Serving South Central Iowa"

21-10859749-2187

1120 Jeffreys Dr.
Osceola, IA 50213
Phone (641) 342-2537
Toll Free 800-632-2734
Fax (641) 342-6464

VIN: 1D7HU18N35S		INFORMATION Redacted PURSUANT TO THE FREEDOM OF INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6)		DATE: 05/12/14
YEAR: 2005	MAKE: DODGE	MODEL: RAM 1500	COLOR: O	TIME IN: 13:51
MILES: 100843	MILES: 100843	FIRST USE: 00/00/00	LIB: IA	14:20
C: [REDACTED]			CLOCK: 05/12/14	
H: () - W: () -			WRITER: ADAM	

(1) REPLACE ANY NECESSARY BRAKE COMPONENTS.

FOUND FRONT ROTORS GOOD, BUT PADS WORN UNEVEN	Labor	T22	155.22
. REPLACED PADS.	D9AZ852	(PARKING BRAKE) 1	60.41
REAR PADS AND ROTORS BAD, REPLACED ALL. ALSO	Total Labor		155.22
FOUND DRIVERS SIDE PARKING BRAKE COMPLETED U	Total Parts		60.41
SED UP. REPLACED WITH NEW.			
(Tech:22) A	Total Repair (Customer)		215.63

97.75

77.50 HR - Labor

77.50
77.50
155.00

Next Service	Lube-Oil-Filter	W/C	INT.	CUSTOMER
DISCLAIMER OF WARRANTIES Any warranties on the product sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either expressed or implied, including any implied warranty of merchantability of fitness for a particular purpose, and neither assumes nor authorizes any person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.		Labor		155.22
		Parts		60.41
X CUSTOMER SIGNATURE		Sublet		.00
		Shop Supplies		10.78
Page 1 of 1 Job [REDACTED]		Oil/Grease		.00
		Sub Total		226.41
[REDACTED] [Barcode]		Tax		15.09
		Total (Cash)		241.50

Customer Copy

PP
4/14/16
SAD



Anchor

MOTOR COMPANY, INC.

"A Full Line Ford and Mercury Dealership Serving South Central Iowa"

1120 Jeffreys Dr.
Osceola, IA 50213
Phone (641) 342-2537
Toll Free 800-632-2734
Fax (641) 342-6464

VIN 1 D 7 H U 1 8 N 3 5 S		DATE IN 06/26/14	
YEAR 2005	MAKE DODGE	MODEL RAM 1500	COLOR O
MILES IN 102636	MILES OUT 102636	FIRST USE 00/00/00	LISC IA
SEE ALSO		C: [REDACTED] H: [REDACTED] W: () -	TIME IN 08:24 CLOSED 14:23 06/26/14 WRITER ADAM

(1) LUBE OIL AND FILTER SERVICE

COURTESY CHECK
CHANGED OIL/FILTER. COOLANT TESTED -34. TIRE
PRESSURE @ SPEC. BRAKES/BELT/HOSES/AIR FILTER
GOOD.

Labor	T10	10.98
D9AZR1085 (OIL FILTER)	1	5.98
Bulk Oil	7	22.61
Total Labor		10.98
Total Parts		5.98
Total Lubricants		22.61
Total Repair (Customer)		39.57

(Tech:10) A

(2) REPLACE TRANSMISSION FILTER/FLUID

REMOVED TRANSMISSION PAN, DRAINED FLUID. REPL
ACED FILTER WITH NEW, NOTHING OUT OF THE ORDI
NARY PRESENT IN PAN WHEN REMOVED, INTERNALS L
OOK GOOD. REPLACED PAN WITH NEW GASKET. REFI
LLED FLUID TO PROPER LEVEL. TEST DROVE. TRAN
SMISSION SUBJECT TO FREQUENT DOWNSHIFT DUE TO
MUCH LARGER THAN STOCK TIRE SIZE.

Labor	T10	87.30
D9AZ18594 (TRANS FILTER)	1	21.55
Atf+4	8	44.40
Total Labor		87.30
Total Parts		21.55
Total Lubricants		44.40
Total Repair (Customer)		153.25

(Tech:10) A

(3) LH RUNNING BOARD LOOSE, TIGHTEN IF POSSIBLE

REMOVED LH RUNNING BOARD AND STRAIGHTENED MOUN
TING BRACKET. REINSTALLED RUNNING BOARD. BRA
CKET DESIGN IS WEAK AND WILL MOST LIKELY BEND
UNDER HEAVY WEIGHT AGAIN.

Labor	T10	29.10
Total Labor		29.10

Total Repair (Customer) 29.10

(Tech:10) A

(4) REPLACE BAD U-JOINT FOUND AFTER TRANS WORK

REPLACED BAD U-JOINT WITH NEW, VIBRATION NOW
GONE.

Labor	T10	48.50
D9AZ354 (U-JOINT)	1	11.95
Total Labor		48.50
Total Parts		11.95
Total Repair (Customer)		60.45

(Tech:10) A

Next Service	Lube-Oil-Filter	W/C	INT.	CUSTOMER
DISCLAIMER OF WARRANTIES		Labor 175.88		
Any warranties on the product sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either expressed or implied, including any implied warranty of merchantability of fitness for a particular purpose, and neither assumes nor authorizes any person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.		Parts 39.48		
X CUSTOMER SIGNATURE		Sublet .00		
Page 1 of 1 Reprint (1)		Shop Supplies 10.77		
Job [REDACTED]		Oil/Grease 67.01		
[REDACTED]		Sub Total 293.14		
[REDACTED]		Tax 19.77		
[REDACTED]		Total (Cash) 312.91		
[REDACTED]		Total (Cash) 312.91		

Customer Copy



OFFICE P.O. BOX 1156, SPRINGFIELD, MO. 65801
PHONE (417) 862-3333



STORE PHONE # 641 782-7046
ADDRESS: 404 WEST TAYLOR
CRESTON IA 50801-3667
REMIT TO: PO BOX 9464
SPRINGFIELD MO 65801-9464

BILL TO

85005

SHIP TO

BURLINGTON NORTHERN

201 N 7TH ST
LINCOLN

NE 68508-1309

INVOICE
NUMBER

INVOICE
TYPE

INVOICE
DATE

DBT. CARD SALE

7/18/14

COUNTER NO.	SPECIAL INSTRUCTIONS	SHIP VIA	CUSTOMER ORDER NO.	TIME OF ORDER	FILLED BY	CHECKED BY							
8425				12:17:42									
TAX	R	QTY.	LINE	ITEM NUMBER	UNIT MEAS.	CD.	DESCRIPTION	LIST PRICE	NET PRICE	DISC %	CORE PRICE	EXTENDED PRICE	
				--> Enroll today for the new Q3 Parts Payoff program									
		1	IDD	M18137	EA		NEW CV AXLE	125.41	62.64			62.64	
				LIMITED LIFETIME WARRANTY									
				DEBIT CARD REF#: AUTH CD:									
				Debit PIN Entry - No Signature Required									
TOTALS		1		CUSTOMER COPY "We appreciate your business"					125.41	62.64			SUB-TOTAL 62.64
													MISC.
													TAX/FEES 4.38
													TOTAL 67.02

CASH TEND.
CHANGE
CUSTOMER SIGNATURE
CASH TEND.
CHANGE

ALL MERCHANDISE RETURNED MUST BE ACCOMPANIED BY THIS INVOICE

Visit Us At: www.oreillyauto.com



Anchor

MOTOR COMPANY, INC.

"A Full Line Ford and Mercury Dealership Serving South Central Iowa"

1120 Jeffreys Dr.
Osceola, IA 50213
Phone (641) 342-2537
Toll Free 800-632-2734
Fax (641) 342-6464

VIN		ID7HU18N35S		DATE IN		12/30/14	
YEAR	MAKE	MODEL	COLOR	TIME IN		15:14	
2005	DODGE	RAM 1500 Q	O	CLOSED		17:13	
MILES IN	MILES OUT	FIRST USE	LISC	WRITER		ADAM\60	
108730	108730	00/00/00	IA	C:		H:	
SEE ALSO				W:			

- 1) VEHICLE BROUGHT IN WITH SEVERE MISFIRE
CONFIRMED #8 MISFIRE, FOUND PLUG GAPPED .10"
OVER, REPLACED ALL 8 PLUGS WITH CUSTOMER APPR
OVAL, MISFIRE STILL PRESENT. REPLACED SUSPECT
COIL WITH NEW, MISFIRE NOW GONE.

(Tech:77) A

Labor	T77	97.00
D9AZE232	(IGNITION COIL) 1	32.00
D9AZAP5224	(SPARK PLUG) 8	34.00
Total Labor		97.00
Total Parts		66.00
Total Repair (Customer)		163.00

Next Service Lube-Oil-Filter

DISCLAIMER OF WARRANTIES

Any warranties on the product sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either expressed or implied, including any implied warranty of merchantability of fitness for a particular purpose, and neither assumes nor authorizes any person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

X CUSTOMER SIGNATURE

Page 1 of 1

Job

Customer Copy

W/C	INT.	CUSTOMER
		Labor 97.00
		Parts 66.00
		Sublet .00
		Shop Supplies 8.15
		Oil/Grease .00
		Sub Total 171.15
	.00	Tax 11.41
		Total (Cash) 182.56

HOOD'S AUTOMOTIVE & TOWING
 198 NW INDUSTRIAL CT.
 Bridgeton, MO. 63044
 Phone: 314-739-4611 Fax: 314-739-4794

INVOICE

INVOICE

Print Date: 12/03/2015

Bridgeton, MO

Fax : UNKNOWN :

Cust ID :

2005 Dodge - Pickup R1500 - 4.7L, V8 (287CI) VIN(N)

Lic # :

Odometer In : 0

VIN # : 1D7HU18N3 5S

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
Parking Brake Cable - Left Rear 96116	1.00	53.54	53.54	EMERGENCY BRAKE IS NOT WORKING. LIGHT IS ON. ***Vehicle Memo***	
Shop Supplies			1.61	MURRAY IA PARKING BRAKE CABLE - Remove & Replace - Rear, Left,w/o Dual Rear Wheels - [Includes: Adjustment]	139.10

Org. Estimate 0.00 Revisions 0.00 Current Estimate 0.00

Labor: 139.10
Parts: 55.15

Sub: 194.25
Tax: 4.61
Total: 198.86
Bal Due: \$0.00

[Payments - Visa - \$198.86]

I hereby authorize the above repair work to be done along with the necessary parts. I grant Hood's employees permission to operate the vehicle herein described on street, highways or elsewhere for the purpose of testing/inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. Warranty on parts/labor is 12 months or 12,000 miles whichever comes first. Customer supplied parts void all warranties. Warranty work must be performed in our shop & cannot exceed the original repair cost.

Signature _____ Date _____ Time _____

Written By: GRIESHABER, AMBER - Technicians : Please Select, Technician; MEIEF



Alaska Spring
600 E. 48th Avenue, Anchorage, AK 99503
Phone: 907.563.3802

RO#: [REDACTED]
Estimate

Page: 1

Customer:

[REDACTED]
Elmendorf Afb, AK [REDACTED]
Pn: [REDACTED]

Vehicle:

2005 Dodge Ram 1500 Pickup 4WD
Eng: V8-287 4.7L SOHC Tran:
VIN: 1D7HU18N35S [REDACTED]
Mileage In: Out:
P Date: Clr:
Lic: [REDACTED] St: IA

Repair Order:

Service Writer: D Wigles
PO Number:
Date In: 01/23/2016
Date Out:
Driver: [REDACTED]
Key Tag: [REDACTED]

Courtesy Inspection

Customer Concern: 32 Point Visual Courtesy Inspection

Diagnosis:

Items found during inspection:
-2 front hub assemblies are very bad
-both rear drive line u-joints are bad
-front differential stub shafts have damaged splines
-front drive line CV boot broken
-front CV axles have a lot of play and the drivers side is missing
-LF upper ball joint is bad(recommend replacing in pairs)
-lower ball joints are worn and have play
-RF shock damaged and all 4 shocks have worn out bushings
-Transfer case output shaft seal leaking
-Rear differential pinion seal leaking.
-loose bolts on front compensation brackets(tech tightened all loose bolts on the brackets)
-4 wheel alignment
-front caliper/rotors wearing unevenly.

Recommendation:

Safety issues:
-front hub assemblies
-rear drive line u-joints (both)

Other issues:
-rebuild front drive line
-replace front differential stub shafts and perform fluid flush
-replace front CV axles
-replace front upper control arms (upper ball joints)
-replace lower ball joints
-replace all 4 shocks
-replace transfer case output shaft seal and perform a fluid flush
-replace rear differential pinion seal and perform a fluid flush
-perform a 4 wheel alignment
-replace front brake calipers, rotors, and pads.

Labor:

Description

32 Point Visual Courtesy Inspection

Parts:

No parts on job

Misc:

Description

Shop Supplies
Hazmat

Labor Sub Total:

Sold Price Qty Ext

Misc Sub Total:

Job Sub Total:

ded

.00

.00

ded

.00

.00

.00

.00

necessary
icle herein
ES DO NOT
s they are
d parts will
requested
ce) will not
dent or any
ar, truck or
ion can be
oth parties
lect for the
reasonable

Parts:	3701.71
Labor:	2068.50
Sublets:	0.00
Misc:	40.00

Subtotal:	5810.21
Tax1:	0.00
Tax2:	0.00
TOTAL:	5810.21
Balance:	5810.21

ivetrain

Customer Concern: Look over lift kit, has some issues
BDS lift. (see provided notes)

Labor:	Description	Extended
	inspect suspension and lift kit components determine what needs altered.	52.50
Labor Sub Total:		52.50
Parts:	No parts on job	
Job Sub Total:		52.50

ivetrain

Customer Concern: Per inspection remove and replace front wheel hub assemblies both sides.

Recommendation: Replace axle bearing(s) and seal(s) as required, top off fluid. Inspect balance of related components.

Labor:	Description				Extended
	Remove & Replace Wheel Bearing - Front, Both Sides				105.00
		Labor Sub Total:			105.00
Parts:	Cond Description	Price Ea.	Qty	Extended	
	N Front Hub Assembly	184.10	2.00	368.20	
		Parts Sub Total:			368.20
		Job Sub Total:			473.20

ivetrain

Customer Concern: Per inspection remove and replace both rear drive line u-joints.

Recommendation: Replace all driveshaft universal joints as required. Inspect balance of related components.

Recommendation:		Replace all driveshaft universal joints		Extended	
Labor:	Description				
	Remove & Install Front & Rear Universal Joints - Rear Propeller Shaft.			115.50	
	Labor Sub Total:			115.50	
Parts:	Cond	Description	Price Ea.	Qty	Extended
			52.08	1.00	52.08
	N	Universal Joint	46.88	1.00	46.88
	N	Universal Joint			
	Parts Sub Total:				98.96
	Job Sub Total:				214.46

ivetrain

Customer Concern: Per inspection remove and replace both front CV axles.

Recommendation: Replace CV Axle Shaft
Replace CV Axle Shaft

Recommendation:		Replace CV Axle Shaft		Extended
Labor:	Description			
	Remove & Replace F Axle Shaft Assembly (COMPLETE) - Both Sides			0.
Labor Sub Total:				0.
Parts:	Cond	Description	Price Ea.	Qty
				Extended
	N	Left New CV Complete Assembly	166.20	1.00
		Right New CV Complete Assembly	166.20	1.00

Job Sub Total: 332.40

Differential / Transfer Case**Customer Concern:** Per inspection remove and replace front differential stub shafts.**Recommendation:** Remove and replace front differential stub shafts.

Labor:	Description	Extended
	Remove and inspect front differential.	535.50
	Road test vehicle to warm fluids. Remove drain plug and drain fluid or remove fill plug and evacuate fluid through suction method. Inspect fluid for debris and advise customer of any debris noted. Refill to proper level with manufacturer specified type and weight fluid. Road test and check for leaks.	63.00

Labor Sub Total: 598.50

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	BG Ultra-Guard™ is the first "true" multi-purpose gear oil available in the automotive market. It is a synthetic (Polyalphaolefin) gear oil blended to SAE 75W-90 viscosity and can be used in all car and truck axle applications calling for a GL-5 gear oil.	15.92	3.00	47.76
	N	52069886AE Inner shaft	206.75	1.00	206.75
	N	52069887AE Inner shaft	123.95	1.00	123.95
	N	Axle snap ring	12.80	4.00	51.20
	N	Axle o-ring	21.87	4.00	87.48
	N	C8 0 Axle Seal	60.24	2.00	120.48
	N	C8 0 Bearing Kit	233.32	1.00	233.32
	N	Diff Shim Kit	22.40	1.00	22.40
	N	Shims	72.15	1.00	72.15

Parts Sub Total: 965.49

Job Sub Total: 1563.99

Suspension and Steering**Customer Concern:** Per inspection remove and replace upper control arms w/ Ball joints**Recommendation:** Replace control arm as required. Inspect balance of related components.

Labor:	Description	Extended
	Remove & Replace F Control Arm - Upper, Both Sides	210.00

Labor Sub Total: 210.00

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	Control Arm With Ball Joint	193.06	2.00	386.12

Parts Sub Total: 386.12

Job Sub Total: 596.12

Suspension and Steering**Customer Concern:** Per inspection remove and replace lower ball joints.**Recommendation:** Replace ball joint as required. Inspect balance of related components.

Labor:	Description	Extended
	Remove & Replace F Ball Joint - Lower, Both	157.50

Labor Sub Total: 157.50

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	Lower Ball Joint	136.78	2.00	273.56

Parts Sub Total: 273.56

Differential / Transfer Case

Customer Concern: Per inspection remove and replace rear pinion seal.

Recommendation: Replace pinion seal, top off fluid. Inspect balance of related components.

Labor:	Description	Extended
	remove and replace rear pinion seal	105.00
	Road test vehicle to warm fluids. Remove drain plug and drain fluid or remove fill plug and evacuate fluid through suction method. Inspect fluid for debris and advise customer of any debris noted. Refill to proper level with manufacturer specified type and weight fluid. Road test and check for leaks.	63.00
Labor Sub Total:		168.00

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	Pinion Seal	36.48	1.00	36.48
	N	BG Ultra-Guard™ is the first "true" multi-purpose gear oil available in the automotive market. It is a synthetic (Polyalphaolefin) gear oil blended to SAE 75W-90 viscosity and can be used in all car and truck axle applications calling for a GL-5 gear oil.	15.92	3.00	47.76
Parts Sub Total:					84.24
Job Sub Total:					252.24

Differential / Transfer Case

Customer Concern: Per inspection remove and replace transfer case rear output shaft seal.

Recommendation: Remove & Replace Transfer Case Output Shaft Seal. - Rear

Labor:	Description	Extended
	Remove & Replace Transfer Case Output Shaft Seal. - Rear	126.00
	Remove Transfer Case drain plug and drain transfer case fluids. Check fluids for debris and advise customer of any noted. Refill to proper level with manufacturer specified type and weight fluid. Road test and check for leaks.	52.50
Labor Sub Total:		178.50

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	T-case output shaft seal	26.28	1.00	26.28
	N	BG Syncro Shift® II is a gear lubricant specially formulated for front wheel drive manual transmissions and Transfer Case. It does not sacrifice any performance as does engine oil, ATF or conventional gear oil. It provides required thermal stability, low-temperature fluid	15.45	2.50	38.63
Parts Sub Total:					64.91
Job Sub Total:					243.41

Alignment

Customer Concern: 4 Wheel Alignment

Labor:	Description	Extended
	Road test vehicle and rack vehicle. Install alignment equipment and check 4 wheel Caster, camber and toe settings. Advise of any needed adjustments to caster, camber. If caster and camber are within manufactures specifications, set toe in front, if possible adjust toe in rear. If caster and / or camber are out of manufactures specifications, prepare estimate to install correct adjustment devices. Remove alignment equipment. Road test vehicle.	157.00
Labor Sub Total:		157.00

Parts: No parts on job

Job Sub Total: 157.50

brakes

Customer Concern: per inspection remove and replace front brake calipers, rotors and pads. and brake fluid flush

Recommendation: Includes replace front brake pads / linings, resurface or replace rotors / drums, repack wheel bearings (where applicable), top off brake fluid, adjustments as required. Inspect balance of brake system and related components.

Labor:	Description	Extended
	Remove & Replace Caliper	147.00
	Road test. Inspect brake hydraulic system for leaks. Flush brake hydraulic system as recommended by manufacturers process until clear, fresh brake fluid pours from each bleeder screw. Fill to proper level with fresh brake fluid. Road test.	105.00
Labor Sub Total:		252.00

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	Front Ceramic Pads	83.28	1.00	83.28
	N	Front Disc Brake Rotor	110.08	2.00	220.16
	N	Front Left Rebuilt Caliper With Hardware	138.60	1.00	138.60
	N	Front Right Rebuilt Caliper With Hardware	138.60	1.00	138.60
	N	BG Dot 3 Brake Fluid Flush Kit. BG DOT 3 Brake Fluid is a premium grade fluid for vehicles that require DOT 3 fluid only. This formula exceeds the minimum DOT specifications for DOT 3 fluid and makes an excellent flush because of its dryness and heavy dut	48.23	1.00	48.23
Parts Sub Total:					628.87
Job Sub Total:					880.87

Drivetrain

Customer Concern: Replace front drive shaft

Recommendation: Replace driveshaft(s) assembly as required. Inspect balance of related components.

Labor:	Description	Extended
	Remove & Install Propeller Shaft	73.50
Labor Sub Total:		73.50

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	Front drive shaft	498.96	1.00	498.96
Parts Sub Total:					498.96
Job Sub Total:					572.46

Estimate Only - Subject to Inspection

Vehicle:

2005 Dodge Ram 1500 Pickup 4WD

Eng: V8-287 4.7L SOHC Tran:

VIN: 1D7HU18N35S

Mileage In: Out:

P Date: Clr:

Lic: St: IA

MAR 30 2016

Courtesy Inspection

Customer Concern:

32 Point Visual Courtesy Inspection

Diagnosis:

Items found during inspection:

- 2 front hub assemblies are very bad
- both rear drive line u-joints are bad
- front differential stub shafts have damaged splines
- front drive line CV boot broken
- front CV axles have a lot of play and the drivers side is
- LF upper ball joint is bad(recommend replacing in pairs)
- lower ball joints are warn and have play
- RF shock damaged and all 4 shocks have warn out bushings
- Transfer case output shaft seal leaking
- Rear differential pinion seal leaking.
- loose bolts on front compensation brackets(tech tightene
- 4 wheel alignment
- front caliper/rotors wearing unevenly.

Recommendation:

Safety issues:

- front hub assemblies
- rear drive line u-joints (both)

Other issues:

- rebuild front drive line
- replace front differential stub shafts and perform fl
- replace front CV axles
- replace front upper control arms (upper ball joints)
- replace lower ball joints
- replace all 4 shocks
- replace transfer case output shaft seal and perform
- replace rear differential pinion seal and perform a
- perform a 4 wheel alignment
- replace front brake calipers, rotors, and pads.

bor:

Description

32 Point Visual Courtesy Inspection

ts:

No parts on job

c:

Description

Shop Supplies

Differential / Transfer Case

Customer Concern: Per inspection remove and replace rear pinion seal.

Recommendation: Replace pinion seal, top off fluid. Inspect balance of related components.

Labor:	Description	Extended
	remove and replace rear pinion seal	105.00
	Road test vehicle to warm fluids. Remove drain plug and drain fluid or remove fill plug and evacuate fluid through suction method. Inspect fluid for debris and advise customer of any debris noted. Refill to proper level with manufacturer specified type and weight fluid. Road test and check for leaks.	63.00
Labor Sub Total:		168.00

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	Pinion Seal	36.48	1.00	36.48
	N	BG Ultra-Guard™ is the first "true" multi-purpose gear oil available in the automotive market. It is a synthetic (Polyalphaolefin) gear oil blended to SAE 75W-90 viscosity and can be used in all car and truck axle applications calling for a GL-5 gear oil.	15.92	3.00	47.76
Parts Sub Total:					84.24
Job Sub Total:					252.24

Differential / Transfer Case

Customer Concern: Per inspection remove and replace transfer case rear output shaft seal.

Recommendation: Remove & Replace Transfer Case Output Shaft Seal. - Rear

Labor:	Description	Extended
	Remove & Replace Transfer Case Output Shaft Seal. - Rear	126.00
	Remove Transfer Case drain plug and drain transfer case fluids. Check fluids for debris and advise customer of any noted. Refill to proper level with manufacturer specified type and weight fluid. Road test and check for leaks.	52.50
Labor Sub Total:		178.50

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	T-case output shaft seal	26.28	1.00	26.28
	N	BG Syncro Shift® II is a gear lubricant specially formulated for front wheel drive manual transmissions and Transfer Case. It does not sacrifice any performance as does engine oil, ATF or conventional gear oil. It provides required thermal stability, low-temperature fluidity	15.45	2.50	38.63
Parts Sub Total:					64.91
Job Sub Total:					243.41

Alignment

Customer Concern: 4 Wheel Alignment

Labor:	Description	Extended
	Road test vehicle and rack vehicle. Install alignment equipment and check 4 wheel Caster, camber and toe settings. Advise of any needed adjustments to caster, camber. If caster and camber are within manufactures specifications, set toe in front, if possible adjust toe in rear. If caster and / or camber are out of manufactures specifications, prepare estimate to install correct adjustment devices. Remove alignment equipment. Road test vehicle.	157.00
Labor Sub Total:		157.00

Job Sub Total: 431.06

Differential / Transfer Case**Customer Concern:** Per inspection remove and replace rear pinion seal.**Recommendation:** Replace pinion seal, top off fluid. Inspect balance of related components.

Labor:	Description	Extended
	remove and replace rear pinion seal	105.00
	Road test vehicle to warm fluids. Remove drain plug and drain fluid or remove fill plug and evacuate fluid through suction method. Inspect fluid for debris and advise customer of any debris noted. Refill to proper level with manufacturer specified type and weight fluid. Road test and check for leaks.	63.00

Labor Sub Total: 168.00

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	Pinion Seal	36.48	1.00	36.48
	N	BG Ultra-Guard™ is the first "true" multi-purpose gear oil available in the automotive market. It is a synthetic (Polyalphaolefin) gear oil blended to SAE 75W-90 viscosity and can be used in all car and truck axle applications calling for a GL-5 gear oil.	15.92	3.00	47.76

Parts Sub Total: 84.24

Job Sub Total: 252.24

Differential / Transfer Case**Customer Concern:** Per inspection remove and replace transfer case rear output shaft seal.**Recommendation:** Remove & Replace Transfer Case Output Shaft Seal. - Rear

Labor:	Description	Extended
	Remove & Replace Transfer Case Output Shaft Seal. - Rear	126.00
	Remove Transfer Case drain plug and drain transfer case fluids. Check fluids for debris and advise customer of any noted. Refill to proper level with manufacturer specified type and weight fluid. Road test and check for leaks.	52.50

Labor Sub Total: 178.50

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	T-case output shaft seal	26.28	1.00	26.28
	N	BG Syncro Shift® II is a gear lubricant specially formulated for front wheel drive manual transmissions and Transfer Case. It does not sacrifice any performance as does engine oil, ATF or conventional gear oil. It provides required thermal stability, low-temperature fluid	15.45	2.50	38.63

Parts Sub Total: 64.91

Job Sub Total: 243.41

Alignment**Customer Concern:** 4 Wheel Alignment

Labor:	Description	Extended
	Road test vehicle and rack vehicle. Install alignment equipment and check 4 wheel Caster, camber and toe settings. Advise of any needed adjustments to caster, camber. If caster and camber are within manufactures specifications, set toe in front, if possible adjust toe in rear. If caster and / or camber are out of manufactures specifications, prepare estimate to install correct adjustment devices. Remove alignment equipment. Road test vehicle.	157.00

Labor Sub Total: 157.00

136.78 2.00 273.56
 Parts Sub Total: 273.56

Parts: No parts on job

Job Sub Total: 157.50

Notes

Customer Concern: per inspection remove and replace front brake calipers, rotors and pads, and brake fluid flush

Recommendation: Includes replace front brake pads / linings, resurface or replace rotors / drums, repack wheel bearings (where applicable), top off brake fluid, adjustments as required. Inspect balance of brake system and related components.

Labor:	Description	Extended
	Remove & Replace Caliper	147.00
	Road test. Inspect brake hydraulic system for leaks. Flush brake hydraulic system as recommended by manufacturers process until clear, fresh brake fluid pours from each bleeder screw. Fill to proper level with fresh brake fluid. Road test.	105.00
Labor Sub Total:		252.00

Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	Front Ceramic Pads	83.28	1.00	83.28
	N	Front Disc Brake Rotor	110.08	2.00	220.16
	N	Front Left Rebuilt Caliper With Hardware	138.60	1.00	138.60
	N	Front Right Rebuilt Caliper With Hardware	138.60	1.00	138.60
	N	BG Dot 3 Brake Fluid Flush Kit. BG DOT 3 Brake Fluid is a premium grade fluid for vehicles that require DOT 3 fluid only. This formula exceeds the minimum DOT specifications for DOT 3 fluid and makes an excellent flush because of its dryness and heavy duty	48.23	1.00	48.23
Parts Sub Total:					628.87
Job Sub Total:					880.87

vetrain

Customer Concern: Replace front drive shaft


Recommendation: Replace driveshaft(s) assembly as required. Inspect balance of related components.

Labor:	Description	Extended
	Remove & Install Propeller Shaft	73.50
Labor Sub Total:		73.50


Parts:	Cond	Description	Price Ea.	Qty	Extended
	N	Front drive shaft	498.96	1.00	498.96
Parts Sub Total:					498.96
Job Sub Total:					572.46

Estimate Only - Subject to Inspection

 MURRAY IA



1000

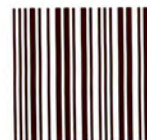

20590

U.S. POSTAGE
PAID
CRESTON, IA
50801
MAR 18, 16
AMOUNT

\$1.42

R2304W119603-12

U.S. Dept of Transportation
National Highway Traffic Safety Administration
1200 New Jersey Ave
SE West Building
Washington, DC 20590