



U.S. Department
of Transportation
**National Highway
Traffic Safety
Administration**

Auto Safety Hotline

Vehicle Owner's Questionnaire

NATIONWIDE 1-800-424-9393
DC METRO AREA (202) 366-0123
INTERNET: <http://www.nhtsa.dot.gov>

FOR AGENCY USE ONLY 258

Date Received

07-SEP-2001

Ord. or
rt. dt
pd. rt
rp. ltr

Reference No.

751866

Do you authorize NHTSA to provide a copy of report to the manufacturer of your vehicle? ☐ YES ☐ NO
In the absence of an authorization, NHTSA WILL NOT provide your name and address to the vehicle manufacturer.

Signature of Owner _____ Date ____/____/____

VEHICLE INFORMATION

Vehicle Ident. No. (VIN) (Location at bottom of windshield and driver's side door)	Vehicle Make	Vehicle Model	Vehicle Year	Current Odometer Reading
2FMZA5148WBD19104	FORD TRUCK	WINDSTAR	1998	
Purchase Date 01-AUG-1998	Dealer's Name _____		Engine Size (CID/CC/L) 3.8	☐ Turbo ☐ Diesel ☐ Gas ☒ Fuel Injection
☒ New ☐ Used	City _____ State _____ Zip Code _____		No Cylinders _____	
Transmission Type ☐ Manual ☐ Automatic	Antilock Brakes ☒ Yes ☐ No	Restraint System ☐ 3-Point Belt ☐ Motorbelt ☐ Driverside Airbag ☐ 2-Point Bel ☐ Passengerside Airbag	Cruise Control ☒ Yes ☐ No	Drive Train ☒ Front ☐ Rear ☐ 4-Wheel
Vehicle Type ☐ Car ☐ Sport Util ☒ Van ☐ Truck ☐ Minivan ☐ Motorcycle ☐ Other _____		Body Style ☐ 2-Door ☐ 4-Door ☐ Stationwagon ☐ Pick Up Truck ☐ Other _____		

FAILED COMPONENT(S)/PART(S) INFORMATION

Component 08420000	Part Name(s) ELECTRICAL SYSTEM:FUSE AND RECEPTICLE:CIRCUIT BREAKER	Location ☐ Left ☐ Right ☐ Front ☐ Rear	Failed Part(s) ☐ Original ☐ Replacement
No of Failure 2	Date(s) of Failure(s) 15-SEP-1998 8200 Mileage at Failure(s) 0	Failed Part(s) ☐ Yes ☐ No	NHTSA Previously ☐ Yes ☐ No

APPLICATION INCIDENT INFORMATION

(Please describe in detail the incident(s), Failure(s), Crash(es), and Injury(ies) on the back of this form)

Crash ☐ Yes ☐ No	Fire ☐ Yes ☒ No	Number of Persons Injured 0	Number of Fatalities 0	Estimated Property Damage	Reported to Police ☐ Yes ☒ No
---	---	--------------------------------	---------------------------	---------------------------	---

NARRATIVE DESCRIPTION OF FAILURE(S), INCIDENT(S), INJURY(IES)

WHEN VEHICLE RECEIVED FROM DEALER, THE REAR A/C -HEATER UNIT FAN INOP. DEALER REPORTED "REPLACED FUSE". 4 WEEKS LATER REAR HEATER, A/C UNIT AGAIN INOP. DUE TO LACK OF FAITH IN DEALER ABILITIES, OWNER REPAIRED FAULT. FOUND 60 AMP CURRENT LIMITER BLOWN. TRACED FAULT TO MAIN POWER WIRE BETWEEN FUSE BLOCK AND A/C CONTROL PANEL CHAFED/BURNED TO CHASSIS WELD POINT LOCATED UNDER CARPET BY DRIVERS LEFT FOOT REST. WIRING REPAIRED, WELD POINT GROUND FLUSH, 60 AMP CURRENT LIMITER REPLACED.*AK

CONTINUE ON REVERSE

The Privacy Act of 1974-Public Law 93-579 This information is requested pursuant to authority vested in the National Highway Traffic Safety Act and subsequent amendments. You are under no obligation to respond to this questionnaire. Your response may be used to assist the NHTSA in determining whether a manufacturer should take appropriate action to correct a safety defect. If the NHTSA proceeds with administrative enforcement or litigation against a manufacturer, your response, or a statistical summary thereof, may be used in support of the agency's action.