

U.S. Department
of TransportationNational Highway
Traffic Safety
Administration

DOT Auto Safety Hotline

Vehicle Owner's Questionnaire (VOQ)

NATIONWIDE 1-888-DASH-2-DOT

1-888-327-4236

www.nhtsa.dot.gov/hotline

FOR AGENCY USE ONLY 118

Date Received

30-MAY-2000

Oid_or _____
rt_dt _____
od_rt _____
up_ltr _____

Reference No.

862679

Do you authorize NHTSA to provide a copy of report to the manufacturer of your vehicle? YES NO
In the absence of an authorization, NHTSA WILL NOT provide your name and address to the vehicle manufacturer.

Signature of Owner _____ Date ____/____/____

VEHICLE INFORMATION

Vehicle Ident. No. (VIN.) <small>(Listed at front of windshield or drivers side)</small>	Vehicle Make	Vehicle Model	Vehicle Year	Current Odometer Reading
3B7KF23D7VG799702	DODGE TRUCK	RAM	1997	

Purchase Date	Dealer's Name _____	Engine Size (CID/CC/L) _____	<input type="checkbox"/> Turbo <input type="checkbox"/> Diesel <input type="checkbox"/> Gas <input type="checkbox"/> Fuel Injection
<input type="checkbox"/> New <input checked="" type="checkbox"/> Used	City _____ State _____ Zip Code _____	No. Cylinders _____	

Transmission Type	Antilock Brakes	Restraint System	Cruise Control	Drive Train	Vehicle Type	Body Style
<input type="checkbox"/> Manual <input type="checkbox"/> Automatic	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	<input checked="" type="checkbox"/> 3-Point Belt <input type="checkbox"/> Driverside Airbag <input type="checkbox"/> Passengerside Airbag <input type="checkbox"/> Motorbell <input type="checkbox"/> 2-Point Belt	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	<input type="checkbox"/> Front <input type="checkbox"/> Rear <input type="checkbox"/> 4-Wheel	<input type="checkbox"/> Car <input type="checkbox"/> Van <input type="checkbox"/> Minivan <input type="checkbox"/> Other _____	<input type="checkbox"/> Sport Ult <input type="checkbox"/> Truck <input type="checkbox"/> Motorcycle <input type="checkbox"/> 2-Door <input type="checkbox"/> 4-Door <input type="checkbox"/> Stationwagon <input type="checkbox"/> Pick Up Truck <input type="checkbox"/> Other _____

FAILED COMPONENT(S)/PART(S) INFORMATION

Component 03250000	Part Name(s) BRAKES:HYDRAULIC:ANTI-SKID SYSTEM	Location <input type="checkbox"/> Left <input type="checkbox"/> Right <input type="checkbox"/> Front <input type="checkbox"/> Rear	Failed Part(s) <input type="checkbox"/> Original <input type="checkbox"/> Replacement
-----------------------	---	--	---

No. of Failures	Date(s) of Failure(s) <u>28-MAY-2000</u> Mileage at Failure(s) <u>39672</u> Vehicle Speed at Failure(s) _____	Failed Part(s) Available? <input type="checkbox"/> Yes <input type="checkbox"/> No	NHTSA Previously Contacted? <input type="checkbox"/> Yes <input type="checkbox"/> No
-----------------	---	---	---

APPLICATION INCIDENT INFORMATION

(Please describe in detail the incident(s), failure(s), crash(es), and injury(ies) on the back of this form.)


Crash <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Fire <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Number of Persons Injured	Number of Fatalities	Estimated Property Damage	Reported to Police <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
--	---	---------------------------	----------------------	---------------------------	---

NARRATIVE DESCRIPTION OF FAILURE(S), INCIDENT(S), INJURY(IES)

WHILE DRIVING ABOUT 65 MPH, BARELY TOUCHING THE BRAKES TO SLOW DOWN, ALL FOUR WHEELS LOCKED UP. THE TRUCK WAS TOWED TO THE DEALERSHIP. PLEASE PROVIDE ANY FURTHER INFORMATION.

CONTINUED ON BACK PLEASE

The Privacy Act of 1974-Public Law 93-579 This information is requested pursuant to authority vested in the National Highway Traffic Safety Act and subsequent amendments. You are under no obligation to respond to this questionnaire. Your response may be used to assist the NHTSA in determining whether a manufacturer should take appropriate action to correct a safety defect. If the NHTSA proceeds with administrative enforcement or litigation against a manufacturer, your response, or a statistical summary thereof, may be used in support of the agency's action.

DOT Auto Safety Hotline		FOR AGENCY USE ONLY 118	
 U.S. Department of Transportation National Highway Traffic Safety Administration		Vehicle Owner's Questionnaire (VOQ) NATIONWIDE 1-888-DASH-2-DOT 1-888-327-4236 www.nhtsa.dot.gov/hotline	
OWNER INFORMATION (Type or Print) [Redacted] 611398		DEFECT INVESTIGATION 00 JUN 22 AM 9:53 30-MAY-2000 OFFICE:	
Do you authorize NHTSA to provide a copy of report to the manufacturer of your vehicle? In the absence of [Redacted] name and address to the vehicle manufacturer.		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO Date <u>6/16/00</u>	
VEHICLE INFORMATION			
Vehicle Ident. No. (VIN) (Located at bottom of windshield on driver's side)	Vehicle Make	Vehicle Model	Vehicle Year
3B7KF23D7VG799702	DODGE TRUCK	RAM	1997
Current Odometer Reading			
39652			
Purchase Date	Dealer's Name	Engine Size (CID/GC/L)	<input type="checkbox"/> Turbo
8-30-98	Castle Rock Chevrolet	5.9	<input checked="" type="checkbox"/> Diesel
<input type="checkbox"/> New <input checked="" type="checkbox"/> Used	City <u>Evinston</u> State <u>WY</u> Zip Code <u>82930</u>	No Cylinders <u>6</u>	<input type="checkbox"/> Gas
			<input type="checkbox"/> Fuel Injection
Transmission Type	Antilock Brakes	Restraint System	Cruise Control
<input type="checkbox"/> Manual <input checked="" type="checkbox"/> Automatic	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	<input checked="" type="checkbox"/> 3-Point Belt <input type="checkbox"/> Motorbelt <input type="checkbox"/> Driverside Airbag <input type="checkbox"/> 2-Point Belt <input type="checkbox"/> Passengerside Airbag	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
Drive Train	Vehicle Type		Body Style
<input type="checkbox"/> Front <input type="checkbox"/> Rear <input checked="" type="checkbox"/> 4-Wheel	<input type="checkbox"/> Car <input type="checkbox"/> Van <input type="checkbox"/> Minivan <input type="checkbox"/> Other		<input type="checkbox"/> Sport Util <input checked="" type="checkbox"/> Truck <input type="checkbox"/> Motorcycle <input type="checkbox"/> 2-Door <input type="checkbox"/> 4-Door <input type="checkbox"/> Stationwagon <input type="checkbox"/> Pick Up Truck <input type="checkbox"/> Other
FAILED COMPONENT(S)/PART(S) INFORMATION			
Component	Part Name(s)	Location	Failed Part(s)
03250000	BRAKES:HYDRAULIC:ANTI-SKID-SYSTEM Power brake Boost Control valve	<input type="checkbox"/> Left <input checked="" type="checkbox"/> Front <input type="checkbox"/> Right <input type="checkbox"/> Rear	<input checked="" type="checkbox"/> Original <input type="checkbox"/> Replacement
No of Failures	Date(s) of Failure(s)	Failed Part(s) Available?	NHTSA Previously Contacted?
4	29-MAY-2000 Mileage at Failure(s) <u>39672 39628</u> Vehicle Speed at Failure(s) <u>65 MPH</u>	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No
APPLICATION INCIDENT INFORMATION (Please describe in detail the incident(s), failure(s), crash(es), and injury(ies) on the back of this form)			
Crash	Fire	Number of Persons Injured	Number of Fatalities
<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	0	0
Estimated Property Damage		Reported to Police	
15,000 ⁰⁰		<input checked="" type="checkbox"/> Yes <input checked="" type="checkbox"/> No	
NARRATIVE DESCRIPTION OF FAILURE(S), INCIDENT(S), INJURY(IES)			
<p>WHILE DRIVING ABOUT 65 MPH AND BARELY TOUCHING THE BRAKES TO SLOW DOWN, ALL FOUR WHEELS LOCKED UP. TRUCK WAS TOWED TO THE DEALERSHIP. PLEASE PROVIDE ANY FURTHER INFORMATION. *AK Truck brakes stayed locked up couldn't move vehicle off freeway. Called 911 and was assisted by Randy Anglin Arizona Highway Patrol. C45 Towing removed truck off freeway to Earnhart Dodge in Gilbert Arizona. They couldn't find any problem other than cleaned rust off brakes. Drove truck to Page Arizona, where they locked up again. *Ford dealer has seen this problem before.</p>			
CONTINUE ON BACK IF NEEDED			
The Privacy Act of 1974-Public Law 93-579 This information is requested pursuant to authority vested in the National Highway Traffic Safety Act and subsequent amendments. You are under no obligation to respond to this questionnaire. Your response may be used to assist the NHTSA in determining whether a manufacturer should take appropriate action to correct a safety defect. If the NHTSA proceeds with administrative enforcement or litigation against a manufacturer, your response, or a statistical summary thereof, may be used in support of the agency's action.			

205341

488474



NO BULL SINCE 1951

DODGE • HYUNDAI

1301 N. ARIZONA AVENUE
GILBERT, ARIZONA 85233
(602) 497-5995

INVOICE

PAGE 1

SERVICE ADVISOR: 1630 MARC RAY

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
	97	DODGE D250 2WD	3B7KF23D7VG799702	19729AEWY	39628/39652	T3037	
IN SVC. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN1997			17:00 01JUN00			CASH	02JUN2000

R.O. OPENED	DATE	CUST. NOTIFIED	OPTIONS:
09:28 30MAY00	12:37	02JUN00	DLR:43389 ENG:5.9_Turbo_Diesel_Intercooler

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A VEHICLE TOWED IN - C/S. THE BRAKES LOCKED UP AFTER APPLIED - FINALLY RELEASES WHEN PLACING ON TOW TRUCK - ADVISE TO62 MISC BRAKES							
PARTS:	4262	C				523.47	523.47
	0.00	LABOR:	523.47	OTHER:	0.00	TOTAL LINE A:	523.47

39639 T6.2 C/S VEHICLE HAS NO BRAKES/LOCKED UP. FOUND THE FRONT AND REAR AXLES TO HAVE BEEN UNDER WATER FOR SOME TIME. THE REAR BRAKE SHOES WERE RUSTED TO THE DRUMS AND THE FRONT ROTORS ARE VERY RUSTY. RESURFACED BOTH FRONT AND REAR BRAKES, REAR BRAKE DRUMS ARE RESURFACED. RESURFACED FRONT ROTORS WITH THE ON THE VEHICLE BRAKE LATHE. CLEANED AND ADJUSTED REAR SHOES. LUBED REAR BACKING PLATES. LUBED FRONT CALIPER PIN SLIDES AND REMOVED ALL THE RUST OFF THE CALIPER SLIDES. DROVE THE VEHICLE, BRAKES ARE PERFORMING NORMAL NOW. ***SHOP FORMAN AND SERVICE MANAGER INSPECTED FRONT AND REAR BRAKES** INSPECT FRONT END REAR DIFF. FLUID, NO WATER SEEMS TO BE IN THE FLUID. THANK-YOU FOR ALLOWING US HERE AT EARNHARDT DODGE TO SERVICE YOUR VEHICLE. HAVE A GREAT WEEKEND!

B** QC TO RD. TEST 30 MILES AFTER LINE A REPAIRED - QC QUALITY CONTROL

PARTS:	700	ISE					(N/C)
	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE B:	0.00

39652 ROAD TESTED VEH. AFTER REPAIR - BRAKE OPERATION NORMAL AND GOOD.

CUSTOMER PAY SUPPLIES FOR REPAIR ORDER 25.00

PAID

CASH _____ CHECK _____

CR. CARDS *MC*

DATE *6/20* INITIAL *RF*

THANK YOU FOR ALLOWING US TO SERVE YOU!
FOR YOUR CONVENIENCE WE HAVE A DIRECT LINE TO
OUR SERVICE DEPARTMENT
PLEASE CALL 497-5995
WE APPRECIATE YOUR BUSINESS !!!

EARNHARDT'S GILBERT DODGE & HYUNDAI

TERMS OF SALE	DESCRIPTION	TOTALS
DETAILS AND LIMITATIONS OF WARRANTIES, DISCLAIMER OF WARRANTIES AND EXPLANATIONS OF SUPPLY CHARGES ARE ON THE REVERSE SIDE HEREOF.	LABOR AMOUNT	523.47
BUYER AND SELLER MUTUALLY AGREE THAT ANY DISPUTE ARISING AS A RESULT OF THIS SALE WILL BE ARBITRATED UNDER THE RULES OF THE AMERICAN ARBITRATION ASSOCIATION AND THAT THE DECISION MADE WILL BE FINAL. IT IS FURTHER AGREED THAT IN THE EVENT THIS IS A CHARGE SALE OR A SALE PAID BY CHECK THAT ANY COSTS INCURRED BY SELLER TO SECURE PAYMENT WILL BE PAID BY BUYER.	PARTS AMOUNT	0.00
I AGREE FURTHER THAT I AM RESPONSIBLE FOR ALL CHARGES NOT COVERED BY MANUFACTURER'S WARRANTY.	GAS, OIL, LUBE	0.00
	SUBLET AMOUNT	0.00
	MISC. CHARGES	25.00
	TOTAL CHARGES	548.47
	ADJUSTMENTS	0.00
	SALES TAX	1.68
	PLEASE PAY THIS AMOUNT	550.15



CUSTOMER COPY

DIAGNOSIS AND TESTING (Continued)**ACCUMULATOR LEAKDOWN**

(1) Start the engine, apply the brakes and turn the steering wheel from lock to lock. This will ensure the accumulator is charged. Turn off the engine and let the vehicle sit for one hour. After one hour there should be at least two power assisted brake application with the engine off. If the system does not retain a charge the booster must be replaced.

(2) With the engine off depress the brake pedal several times to discharge the accumulator. Grasp the accumulator and see if it wobbles or turns. If it does the accumulator has lost a gas charge and the booster must be replaced.

SEAL LEAKAGE

If the booster leaks from any of the seals the complete unit must be replaced (Fig. 10).

- **INPUT ROD SEAL:** Fluid leakage from rear end of the booster.
- **PISTON SEAL:** Fluid leakage from vent at front of booster.
- **HOUSING SEAL:** Fluid leakage between housing and housing cover.
- **SPOOL VALVE SEAL:** Fluid leakage near spool plug.
- **RETURN PORT FITTING SEAL:** Fluid leakage from port fitting.

COMBINATION VALVE**Metering Valve**

Metering valve operation can be checked visually with the aid of a helper. Observe the metering valve stem while a helper applies and releases the brakes. If the valve is operating correctly, the stem will extend slightly when the brakes are applied and retract when the brakes are released. If the valve is faulty, replace the entire combination valve as an assembly.

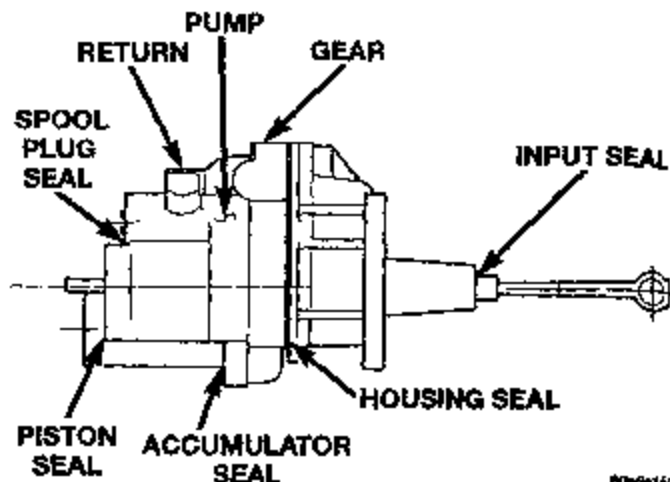


Fig. 10 Hydraulic Booster Seals

Pressure Differential Switch

- (1) Have helper sit in drivers seat to apply brake pedal and observe red brake warning light.
- (2) Raise vehicle on hoist.
- (3) Connect bleed hose to a rear wheel cylinder and immerse hose end in container partially filled with brake fluid.
- (4) Have helper press and hold brake pedal to floor and observe warning light.
 - (a) If warning light illuminates, switch is operating correctly.
 - (b) If light fails to illuminate, check circuit fuse, bulb, and wiring. The parking brake switch can be used to aid in identifying whether or not the brake light bulb and fuse is functional. Repair or replace parts as necessary and test differential pressure switch operation again.
- (5) If warning light still does not illuminate, switch is faulty. Replace combination valve assembly, bleed brake system and verify proper switch and valve operation.

HYDRAULIC BOOSTER SYSTEM DIAGNOSIS CHART

CONDITION	POSSIBLE CAUSES	CORRECTION
Slow Brake Pedal Return	<ol style="list-style-type: none"> 1. Excessive seal friction in booster. 2. Faulty spool action. 3. Restriction in booster return hose. 4. Damaged input rod. 	<ol style="list-style-type: none"> 1. Replace booster. 2. Replace booster. 3. Replace hose. 4. Replace booster.
Excessive Brake Pedal Effort.	<ol style="list-style-type: none"> 1. Internal or external seal leakage. 2. Faulty steering pump. 	<ol style="list-style-type: none"> 1. Replace booster. 2. Replace pump.
Brakes Self Apply	<ol style="list-style-type: none"> 1. Dump valve faulty. 2. Contamination in hydraulic system. 3. Restriction in booster return hose. 	<ol style="list-style-type: none"> 1. Replace booster. 2. Flush hydraulic system and replace booster. 3. Replace hose.

Page Ford Inc.

619 S. Lake Powell Boulevard • Page, Arizona 86040
 P.O. Box 4900 • Page, Arizona 86040-4900
 (520) 645-5450

0201EPOCS12467

0201EFOCS12467
 0201EFOCS12487

CUSTOMER NO. 11371	ADVISOR ROBERT 51	FACTOR 1815	INVOICE DATE 08/14/00	INVOICE NO. FOCS12467
	LABOR RATE 85.00	LICENSE NO.	MILEAGE 3	COLOR SILVER
	YEAR / MAKE / MODEL 97/DODGE TRUCK/2500		DELIVERY DATE	DELIVERY MILES
	VEHICLE I.D. NO. 3B7KF23D7VG788702		SELLING DEALER NO.	PRODUCTION DATE
	F. T. E. NO.	P. O. NO.	R. O. DATE 08/05/00	REPRINT # 1
BUSINESS PHONE	COMMENTS			

JOB# 1 CHARGES

LABOR	J# 1 40FOZ		BRAKES	HOURS: 2.10	TECH(S): 8	126.00
			POWER BRAKE BOOSTER STICKING			
			BRADING HYD BOOST CONTROL VALVE			
			REPLACE BOOSTER BLEED BRAKES			
			RECK OK			
PARTS	QTY	FP NUMBER	DESCRIPTION	UNIT PRICE		
	1	BL-9644	BOOSTER	512.50		512.50
					TOTAL - PARTS	512.50
G.O.B. & SUPPLIES			FREIGHT (PARTS)			51.00
					TOTAL - GOB	51.00

JOB# 1 TOTALS

LABOR	126.00
PARTS	512.50
G.O.B.	51.00

JOB# 1 JOURNAL PREFIX FOCs JOB# 1 TOTAL 689.50

MISC	CODE	DESCRIPTION	CONTROL NO.	
JOB # A		SHOP SUPPLIES		6.30
				TOTAL - MISC 6.30

ESTIMATED	DATE	RECEIVED	
08/14/00			
PAGE FORD			
TOTAL			736.28
TOTAL MISC			6.30
TOTAL TAX			40.48
TOTAL INVOICE \$			736.28

CUSTOMER SIGNATURE

Mastercard

AS IS: The only warranties applying to this part(s) are those which may be offered by the manufacturer. The selling dealer hereby expressly disclaims all warranties, either express or implied, including any implied warranties of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this part(s) and/or service. Buyer shall not be entitled to recover from the selling dealer any consequential damages, damages to property, damages for loss of use, loss of time, loss of profit, or income, or any other incidental damages.

TERMS: STRICTLY CASH OR ACCEPTABLE CREDIT CARD

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. In the event legal action is necessary to enforce this contract, I will pay reasonable attorneys fees and court costs.

1% per month (ANNUAL PERCENTAGE RATE 18%) interest charged on past due accounts.

LABOR CHARGES ARE BASED ON LABOR TIME GUIDES USED IN THE INDUSTRY. RATES RANGE FROM \$25.00 PER HOUR TO \$60.00 PER HOUR DEPENDING ON REPAIRS AND SERVICES PERFORMED.

X



ARIZONA
DEPARTMENT OF
PUBLIC SAFETY

RANDY ANGLIN #4567
PATROLMAN
ARIZONA HIGHWAY PATROL
DISTRICT 14
11101 W. DEORIA AVE.
YOUNGTOWN, AZ 85363
(602) 223-2531 974-9500

SUITE #3

(602) 374-5380

623

C&S
TOWING
24 HOUR SERVICE

HARMIL PLAZA P.O. BOX 609

BLACK CANYON CITY, AZ 86022

Prices So Low

520-645-5450

800-697-7051

NEW

PAGE FORD

619 S. Lake Powell Blvd.
Page, AZ 86040

Bill Brooks
Parts & Service Director

Page, Arizona



HINKLEYS BODY SHOP
 2775 SOUTH 300 WEST
 Salt Lake City, UT 84115-2725
 (801) 484-8755
 FAX (801) 484-8435

"Oldest Dodge Dealership
 in the country"

R/O Order Date	R/O Number
11/02/99	2004018/4
R/O Issue Date	Status
1/14/00	Pre-Invoice
Mileage In	Mileage Out
35052	
Sales Advisor / Tag #	
Body Shop/8716	
Vehicle Identification Number	
3B7KF23D7VG799702	
Delivery Date	In-Service Date
Year	Model
1997	DODGE
Body	Color
EXT CAB	SILVER
License Number	
	729AE

Year	Model	Body	Color	License Number
1997	DODGE	RAM	EXT CAB	SILVER

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
Work performed by TR (29)	64.00
Installed 56028150 :SENSOR: SPEED ABS FRT RT 1@113.53	113.53
REPLACED DAMAGED R/P SPEED SENSOR	
Sub-Total Labor:	64.00
Sub-Total Parts:	113.53

#8 - Customer Reports: REPLACE PLUG FOR BLOCK HEATER	
Work performed by TR (29)	32.00
Installed 4798889 :CABLE/OTH: ENGINE BLOCK HEATER 1@26.75	26.75
REPLACED BLOCK HEATER CORD	
Sub-Total Labor:	32.00
Sub-Total Parts:	26.75

#9 - Customer Reports: CHECK FRONT BRAKES (POSSIBLE PULL TO RIGHT)	
Work performed by TR (29)	
FRONT PADS EQUAL THICKNESS, NO PULL FELT	

#10 -RT: ROTATE TIRES	
Work performed by TR (29)*	10.00
Sub-Total Labor:	10.00

#11 -Customer Reports: REPLACE GRAPHICS (20083)	
Work performed by 9194 : 16857	125.00
Sub-Total Sublet:	125.00

Paint & Materials	240.80

I did mention that it pulled to the right but I told him that they also locked up before the accident

TERMS. STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.	LABOR	3349.75
	PARTS	8109.50
	DEDUCTIBLE	.00
	SUBLET	125.00
	SHOP SUPPLIES	.00
	HAZARDOUS MATERIALS	.00
	SALES TAX OR TAX I.D.	725.44
	SPECIAL ORDER DEPOSIT	.00
	DISCOUNTS	.00
	MANUF / DEALERSHIP	12309.69
	TOTAL DUE	
	ACCOUNT #	METHOD
		RECEIPT #

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

Thank You!

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.
 X