

FIELD TECHNICAL REPORT



| | | | | | | |
|---|-------------------------|-------------------------|--------------------------------|---------------------|--|--------------------|
| TQCN DOC# FTR-80N129671 | Affiliate TMS | Dept. QA-Vehicle and | Source FTS | Location TMS-GST | Ref 43351-1 | Date 10/24/2007 |
| Problem Area PPO/DIO | Primary Model Tacoma | Model Year 2006 | Production Date 01-Aug-2006 | Odometer 7176 mi | VIN (confirm 17 characters): 5TEKU72N06Z [REDACTED] | |
| Condition Title FLOOR MAT ALL WEATHER - REF# 58525 | | | | | | |

Do not type in YELLOW shaded fields - Input data from Web page or RDM:

| | | |
|-----------------------------------|---------------|-------------------|
| Repair Date 09-JAN-2007 | Optional Ref. | Optional Approval |
|-----------------------------------|---------------|-------------------|

Condition Description

Left front all weather floor mat interferes with the proper operation of the accelerator pedal when the mat is not properly installed.

Diagnostic Steps:

1. Road test vehicle and verified the interference between the accelerator pedal and the all weather floor mat.
2. Next removed the all weather floor mat and road tested the vehicle and found that the operation of the accelerator pedal was normal.

Probable Cause

Improper installation of all- weather floor mat.

| | | | | |
|---------------------------|-----------|-----------|---|-------------------------------------|
| Part # 1: PT9083505D02 | Part # 2: | Part # 3: | Parts Disposition: No part available | Parts Shipping Destination: 3500 |
|---------------------------|-----------|-----------|---|-------------------------------------|

Repair Process

Cut flashing off of the rear portion of the mat and reinstalled into the vehicle with the retainer clips installed and the interference with the accelerator pedal was no longer evident.

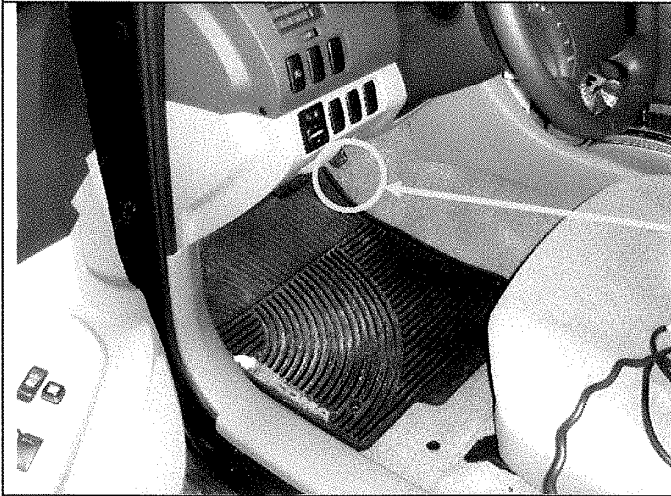


Photo showing location of the accelerator pedal interference with floor mat.