

NISSAN

NISSAN NORTH AMERICA, INC.

Corporate Headquarters
One Nissan Way
Franklin, TN 37068

Mailing Address: P.O. Box 685001
Franklin, TN 37068-5001

Telephone: 615.725.1000

June 9, 2016

Associate Administrator for Safety Assurance
National Highway Traffic Safety Administration
Attention: Early Warning Division (NVS-217)
Room 217
1200 New Jersey Avenue, SE
Washington, D.C. 20590

Dear Associate Administrator:

We are transmitting the enclosed Report of a Defect in a Vehicle in a Foreign Country.

Very truly,

Signed for Derek Latta by David Gilliam:

A handwritten signature in black ink, appearing to read 'David Gilliam', with a long horizontal stroke extending to the right.

Derek Latta
Manager
Technical Compliance

Encl.

REPORT OF A SAFETY RECALL OR OTHER SAFETY CAMPAIGN IN A FOREIGN COUNTRY

1. Manufacturer

Nissan Motor Company, Ltd., Japan.

2. Vehicles Potentially Involved

Nissan Note vehicles produced from July 25, 2012 to November 10, 2015 at Nissan Motor Kyushu Co., Ltd. in Japan. No vehicles sold in the United States are affected because they do not use the subject engine mounting bracket, which is unique to the 1.2L engine that is not offered in the United States.

3. Total Number of Vehicles Potentially Involved

Approximately 230,532.

4. Description of the Defect

On certain vehicles, the fixing bolt of the left-hand engine mounting bracket may come loose. The threading shape of the tapped hole on the engine mounting bracket was incorrect due to the inappropriate operation in the manufacturing process of the engine mounting bracket at the supplier. If the vehicle continues to be driven in this condition, the bolt may break and the left side of the transmission can fall off. In an extreme case the drive shaft may come out of the transmission and the vehicle cannot be driven.

5. Foreign Country in which the Safety Recall or Other Safety Campaign is Being Conducted

Japan, Hong Kong, Singapore, Australia and Malaysia.

6. Date of Determination

June 2, 2016

7. Determination Made By

Manufacturer

8. Date the Recall or Other Campaign will Commence

June 10, 2016

9. Descriptive of Corrective Action

Owners of potentially affected vehicles will be notified to take their vehicle to a dealer. The tapped hole for the fixing bolt of the left-hand engine mounting bracket will be inspected. If the threaded shape of the tapped hole is inappropriate, the left-hand engine mounting bracket assembly will be replaced with a correct one.

10. Vehicles in the United States (If known)

Model year 2012-2016 Nissan Versa Sedan vehicles and model year 2014-2016 Nissan Versa Note vehicles sold in the U.S. are substantially similar to the Nissan Note vehicles subject to this notice. However, they use a different engine mounting bracket. The bracket that is the subject of this foreign recall is unique to the 1.2L engine that is not offered in the United States