

VOLKSWAGEN

GROUP OF AMERICA

Mr. Gregory K. Rea
Associate Administrator for Enforcement
National Highway Traffic Safety Administration
Attention: Recall Management Division (NVS-215)
1200 New Jersey Avenue, S.E.
Washington, DC 20590

Christopher T. Sandvig NAME
General Manager Compliance/TREAD Title
Product Compliance Department
248-754-5000 Phone
248-754-5093 Fax
June 10, 2016 Date

Subject: Notification of Recall Pursuant to 49 CFR Part 579.11 (c)
2010-2011 Model Year Volkswagen Golf Wagon (Canada) - Fuse (Plug-in Position F16)

VOLKSWAGEN GROUP OF AMERICA, INC
3800 HAMLIN ROAD
AUBURN HILLS, MI 48326
PHONE +1 248 754 5000

Dear Mr. Rea:

Pursuant to 49 CFR 579.11(c), Volkswagen Group of America, Inc. ("VWGoA") hereby submits the following recall that was conducted overseas.

- (1) Manufacturer Name
Volkswagen AG
- (2) Date of Determination by the Manufacturer
June 03, 2016
- (3) Identification of Vehicles, Basis of Determination and How Vehicles Differ from Identical or Substantially Similar Vehicles Not Included in Recall

Make: Volkswagen

Line: Golf Wagon

Model Year: 2010-2011

Date of Production: TBD

Basis for Determination: Field data analysis

Reason U.S. Vehicles Are Not Affected: This issue could impact the Daytime Running Lamp (DRL) system on affected vehicles. DRL are a regulatory requirement in the Canadian market but not in the U.S. market. Volkswagen will conduct a service action campaign with customer notification in the United States.

- (4) Description of Defective Component(s) and Manufacturer
Factory-installed 30-amp fuse (plug-in position F-16) manufactured by Audiohm and/or Littlefuse.
- (5) Total Number of Vehicles Affected
Volkswagen has identified approximately 10,200 vehicles in Canada only.

- (6) Description of Noncompliance
The F16 position fuse could fail prematurely due to possible degradation of the fuse's coating material. If this happens, it could cause a partial loss (but not a complete failure) of vehicle lighting, including the loss of DRL illumination on one side of the vehicle, which in turn could render the vehicle less visible to other motorists and pedestrians during daylight hours.
- (7) Affected Countries
Canada
- (8) Type of Campaign
Service Action (Notice of Defect provided to Transport Canada)
- (9) Determination made by:
Volkswagen AG
- (10) Manufacturers Program of Remedy
Dealers will replace the existing F16 position fuse with a new, optimized hard-coated fuse.
- (11) Start of Campaign
Anticipated August 2016.
- (12) Identification of Identical or Substantially Similar Vehicles to U.S. Market
2010-2011 model year Volkswagen Jetta SportWagen.

Sincerely,



Christopher T. Sandvig
General Manager Compliance/TREAD