

TEXAS INSTRUMENTS, INC.'S

09/10/03

REQUEST 6

BOX 7

PART A-P

PART J



OWENS FORENSIC ENGINEERING, INC.



OWENS FORENSIC ENGINEERING, INC.

ROGER L. OWENS, P.E.
Phone: 713-782-1211

January 13, 2003

Mr. Jeff Seely
Susman Godfrey, L.L.P.
1000 Louisiana
Suite 5100
Houston, TX 77002

Re: [REDACTED]
Our File No. 2022.11

Dear Mr. Seely:

Enclosed are indexed photos taken during our recent inspection of the vehicle. The switch was removed and had a date code of AA 2263. Further, we found that the #7 fuse for the switch had been replaced with a 30 amp fuse rather than a 15 amp fuse as required in the manual for the vehicle.

Please give me a call if you have any questions.

Sincerely yours,



Roger L. Owens, P.E.

RLO/jr
Via First Class Mail
OFE/owens/2022.11

Photographic Index
Series 0749

TI-NHTSA 10697

PHOTOGRAPHIC INDEX

OUR FILE NO. 2022.11

SERIES NO. 0749

Figure #	Description
1	Front left of vehicle
2	Front right of vehicle
3	Drivers side hood damage
4	Wire harness
5	Fuse block
6	Fuse block
7	Fuses with cover removed
8	Fuses with cover removed
9	VIN 2FALP74W7PX149118
10	Dash area
11	Engine compartment with hood raised
12	Engine compartment with hood raised
13	Battery
14	Melted battery straps
15	Melted battery straps
16	Melted battery straps
17	Melted battery straps
18	Pressure switch
19	Pressure switch
20	Pressure switch
21	Arcing in wire harness
22	Arcing in wire harness
23	Arcing in wire harness

TI-NHTSA 10698



Figure 1



Figure 2



Figure 3

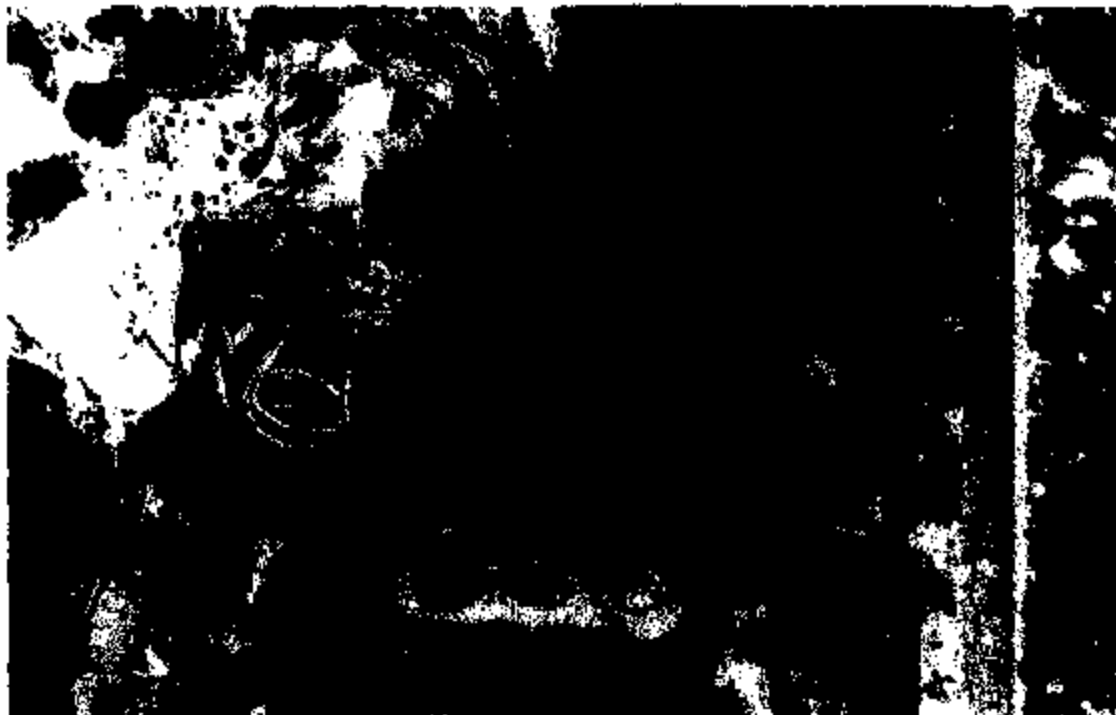


Figure 4



Figure 5



Figure 6



Figure 7



Figure 8



Figure 9



Figure 10



Figure 11



Figure 12



Figure 13

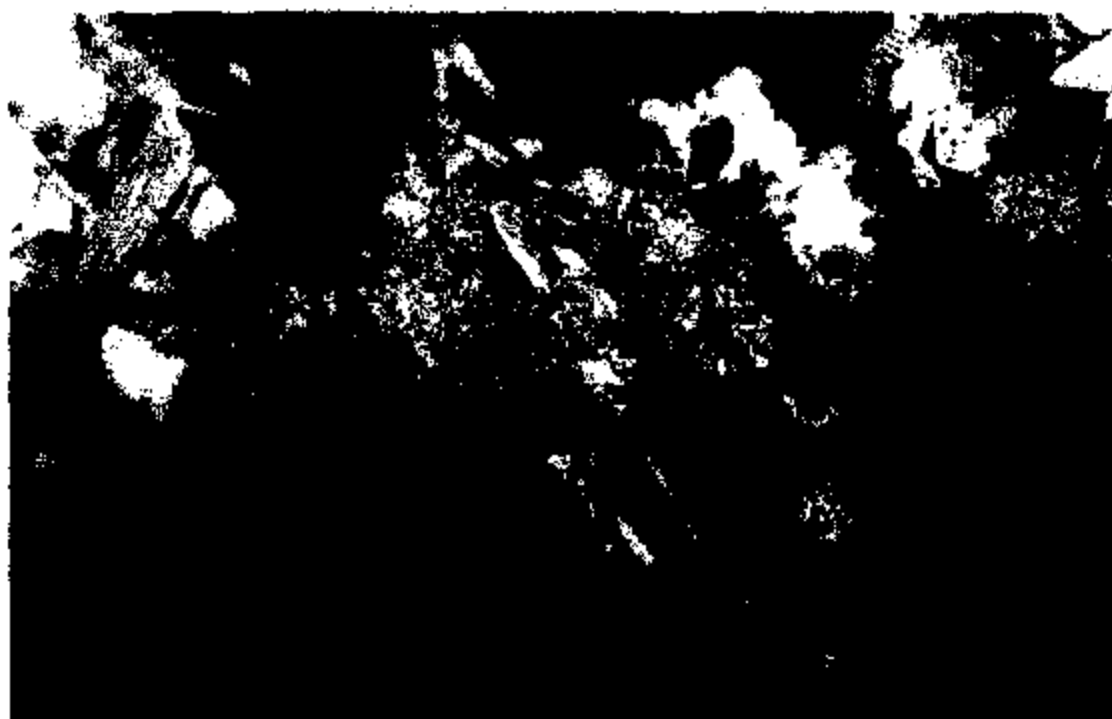


Figure 14

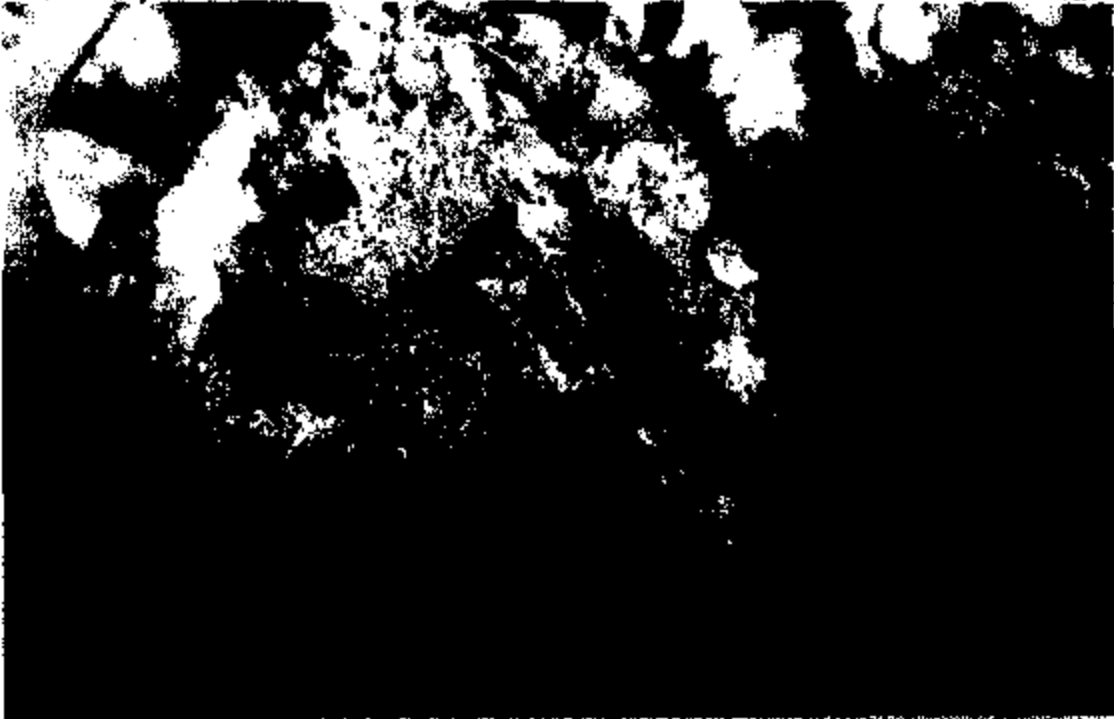


Figure 15



Figure 16



Figure 17

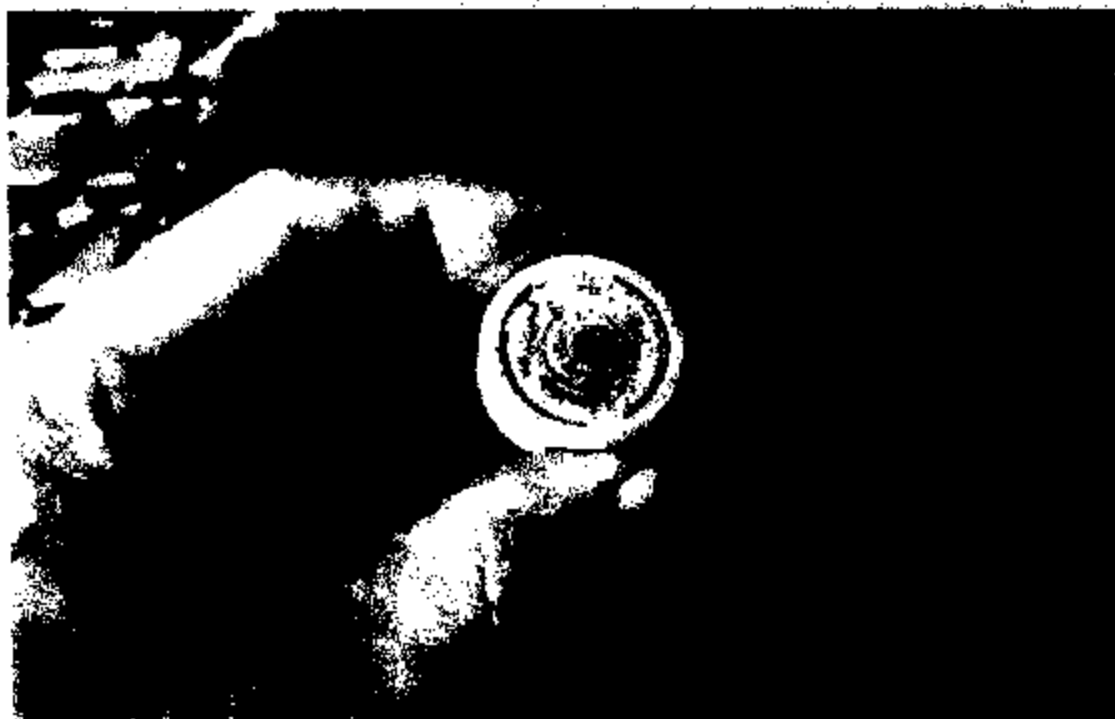


Figure 18



Figure 19



Figure 20



Figure 21



Figure 22

File No.: 2022.11
Client: Sealy

Series: 0749
Roll: 1



Figure 23

Photographic Index
Series 0750

TI-NHTSA 10811

PHOTOGRAPHIC INDEX

OUR FILE NO. 2022.11
SERIES NO. 0750

Figure #	Description
1	Front left wheel area
2	Front left wheel area
3	Frame damage
4	Wire harness
5	Wire harness
6	Wheel damage
7	Overall view of fire wall
8	Left front under carriage



Figure 1



Figure 2



Figure 3



Figure 4



Figure 5



Figure 6



Figure 7



Figure 8



OWENS FORENSIC ENGINEERING, INC.

TI-NHTSA 10617



OWENS FORENSIC ENGINEERING, INC.

ROGER L OWENS, P.E.
Phone: 713-782-1212

December 20, 2002

Mr. Jeffrey Seely, Esq.
Susman Godfrey, L.L.P.
1000 Louisiana
Suite 500
Houston, TX 77002-5096

Re: [REDACTED]
Our File No. 2022.12

Mr. Seely:

Enclosed please find indexed photographs taken during the most recent evidence inspection.

Please contact me with any questions.

Best regards,

Roger L. Owens, P.E.

RLO:js
By First Class Mail
OFE/cases/2022.12

TI-NHTSA 10018

Series: 7502

TI-NHTSA 10619

PHOTOGRAPHIC INDEX

FILE NO. 2022.12

SERIES NO. 7502

Figure #	Description
1	Front view of residence
2	Garage where fire occurred
3	Automobile in garage
4	Panoramic view of interior of garage
5	Panoramic view of interior of garage
6	Panoramic view of interior of garage
7	Panoramic view of interior of garage
8	Electric hot water heater
9	Rafter areas of garage
10	Rafter areas of garage
11	Rafter areas of garage
12	Rafter areas of garage
13	Automobile in garage
14	Automobile in garage
15	Floor plan of residence
16	Evidence identification sheet
17	X-Rays of evidence
18	Evidence "Brake Pressure Switch"
19	Evidence "Brake Pressure Switch"
20	Evidence "Brake Pressure Switch"
21	Exterior view of automobile
22	Exterior view of automobile
23	Exterior view of automobile
24	Exterior view of automobile
25	Exterior view of automobile

Owens Forensic Engineering, Inc.

TI-NHTSA 10620



Figure 1



Figure 2



Figure 3



Figure 4



Figure 5



Figure 6

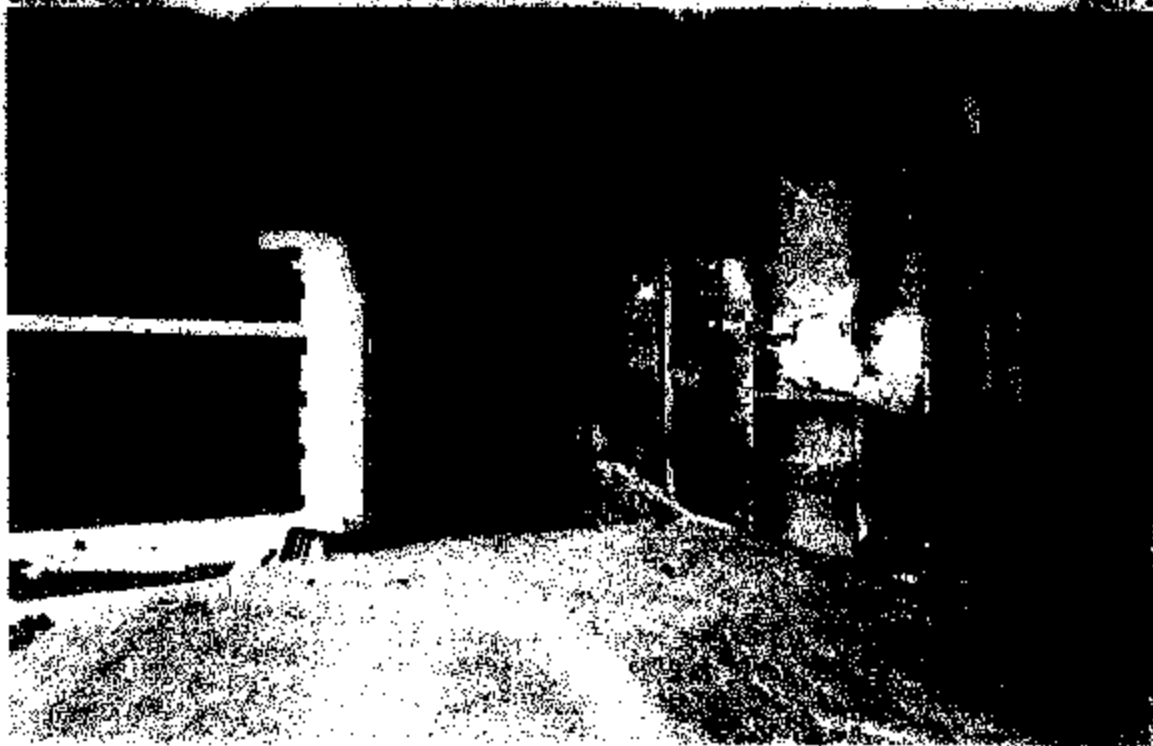


Figure 7



Figure 8



Figure 9



Figure 10



Figure 11



Figure 12



Figure 13



Figure 14



Figure 15

EVIDENCE FORM

Veritec Forensic Engineering, LLC
 1032A First St.
 Humble, TX 77338 281-345-0304 281-345-3882 FAX

VFE File: 021108
 Date Received: 8 Nov 2022
 VFE Associate: David Risher
 Received By: David Risher
 Evidence Location: 2A

EVIDENCE DESCRIPTION:
 - remains of switch from speed control deactivation switch

Client Name and Address
 [REDACTED]

Figure 16

File No.: 2022.12
Client: Seely

Series: 7502
Roll: 1

RADIOGRAPHS

Customer: [REDACTED]

WFO No. [REDACTED]

Date: 12/15/22

Unit: Boiler Pressure Switch

Prints: 3P

**SOUTHWESTERN
LABORATORIES**
PHOTOGRAPHY DEPARTMENT

Figure 17



Figure 18

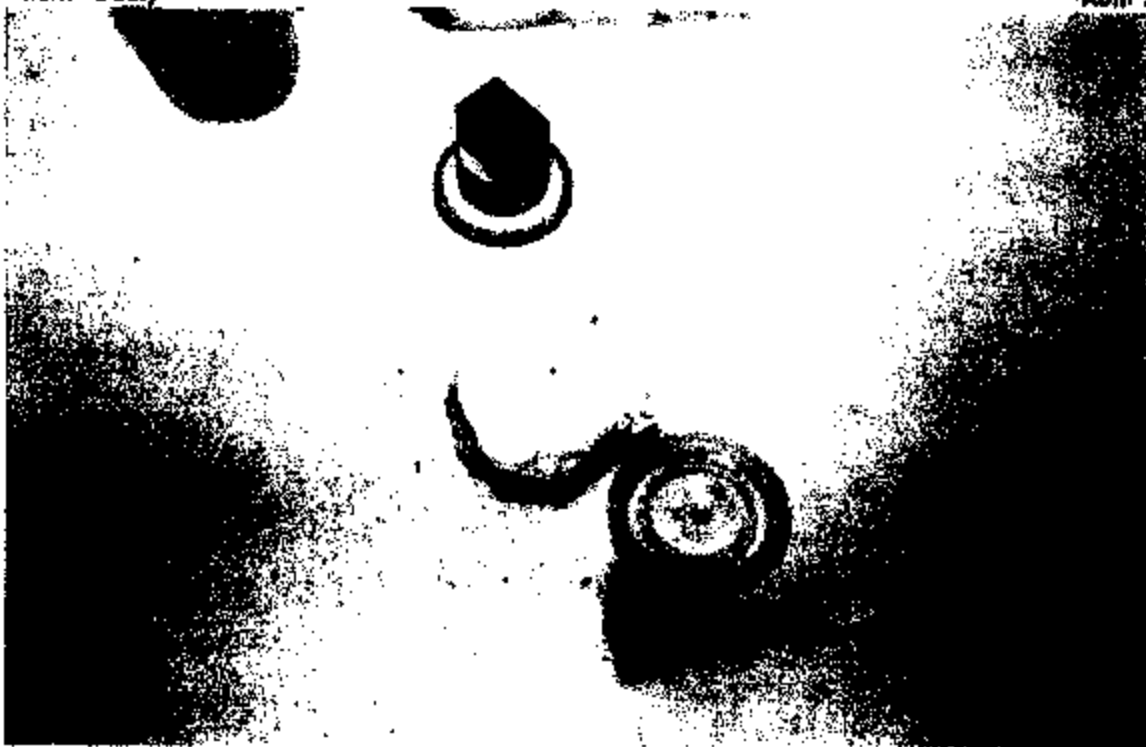


Figure 19

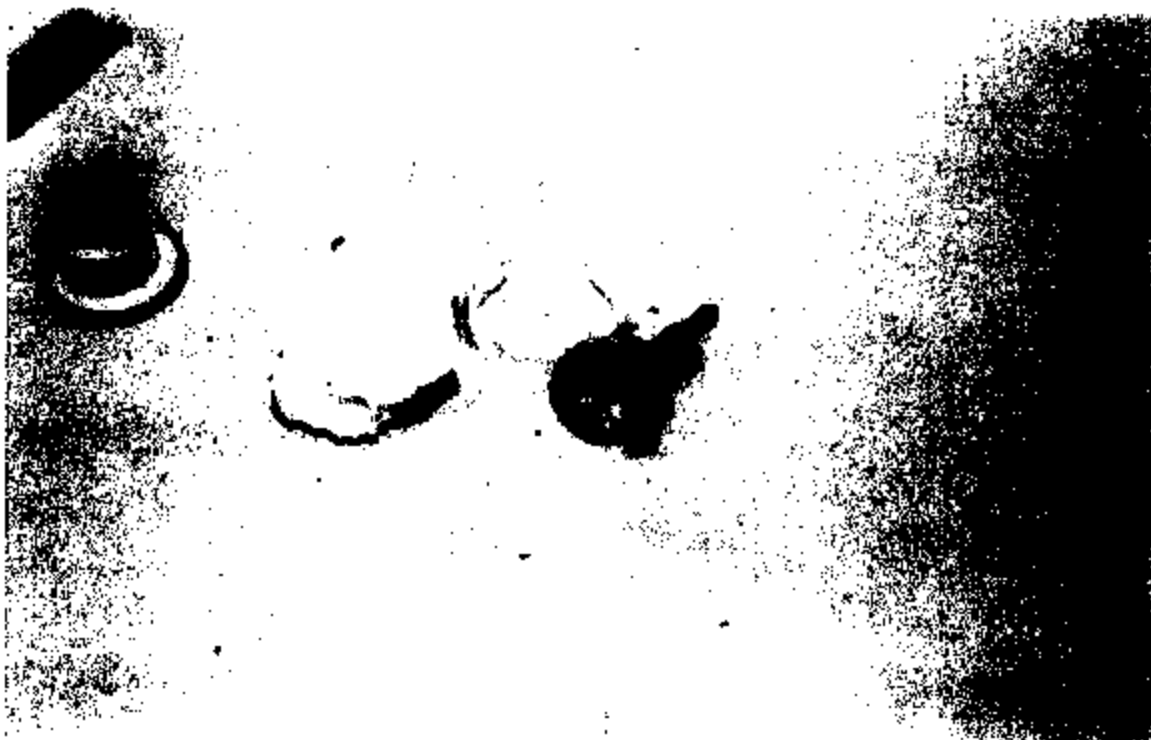


Figure 20



Figure 21



Figure 22

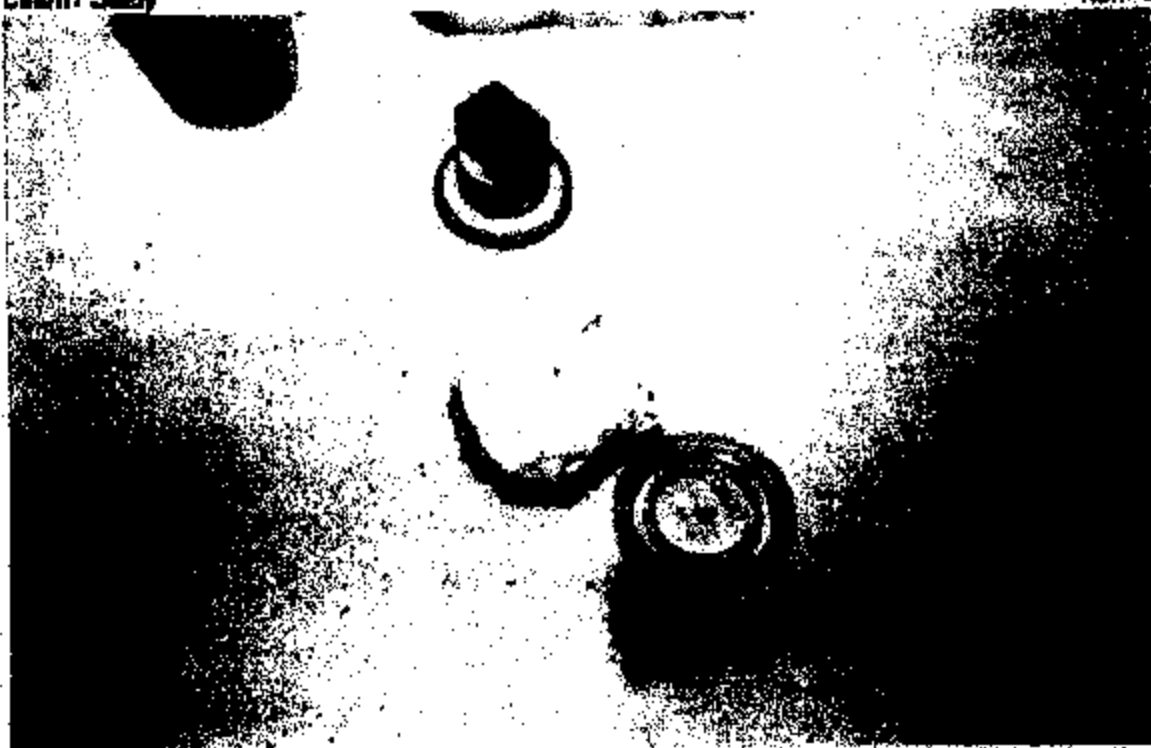


Figure 19



Figure 20

Series: 7503

TI-NHTSA 10634

PHOTOGRAPHIC INDEX

FILE NO. 2022.12
SERIES NO. 7503

Figure #	Description
1	Driver's side of automobile
2	Driver's side of automobile
3	Engine Compartment: Driver's side
4	Engine Compartment: Driver's side
5	View of brake booster area
6	View of brake booster area
7	Engine Compartment: Passenger side
8	Engine Compartment: Passenger side
9	Engine Compartment: Driver's side
10	Passenger seat area
11	Auto tag laying in auto
12	Engine Compartment: Primary wiring area
13	Engine Compartment: Primary wiring area
14	Engine Compartment: Primary wiring area
15	Engine Compartment: Primary wiring area
16	Engine Compartment: Primary wiring area
17	Engine Compartment: Primary wiring area
18	Engine Compartment: Primary wiring area
19	Engine Compartment
20	Fire wall
21	Passenger compartment
22	Side of auto
23	Side of auto
24	House circuit breaker panel
25	House circuit breaker panel

Owens Forensic Engineering, Inc.

TI-NHTSA 10835



Figure 1



Figure 2

Owens Forensic Engineering, Inc.

TI-NHTSA 10638



Figure 3



Figure 4

Owens Forensic Engineering, Inc.

TI-NHTSA 10637



Figure 5



Figure 6

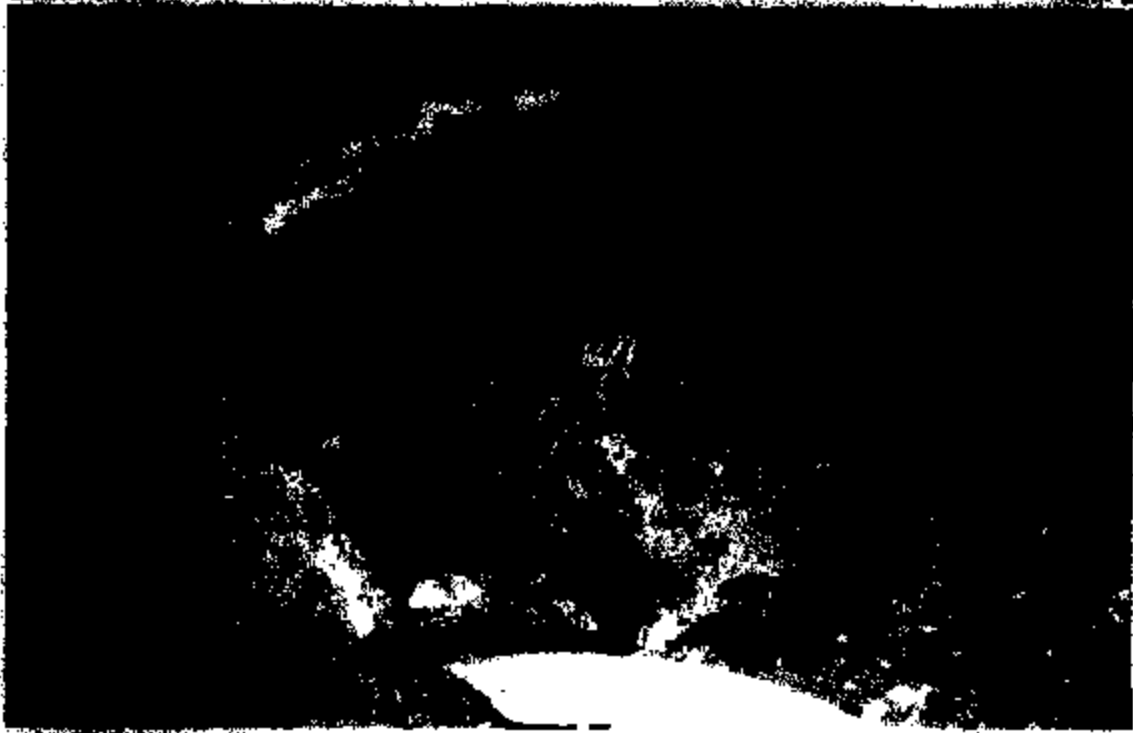


Figure 7



Figure 8

Owens Forensic Engineering, Inc.



Figure 9



Figure 10



Figure 11



Figure 12



Figure 13



Figure 14



Figure 15



Figure 16

File No.: 2022.12

Client: Seely

Series: 7503

Roll: 2



Figure 17



Figure 18

Owens Forensic Engineering, Inc.

TI-NHTSA 10644



Figure 19



Figure 20



Figure 21



Figure 22

File No: 2022.12

Client: Sealy

Series: 7503

Roll: 2



Figure 23

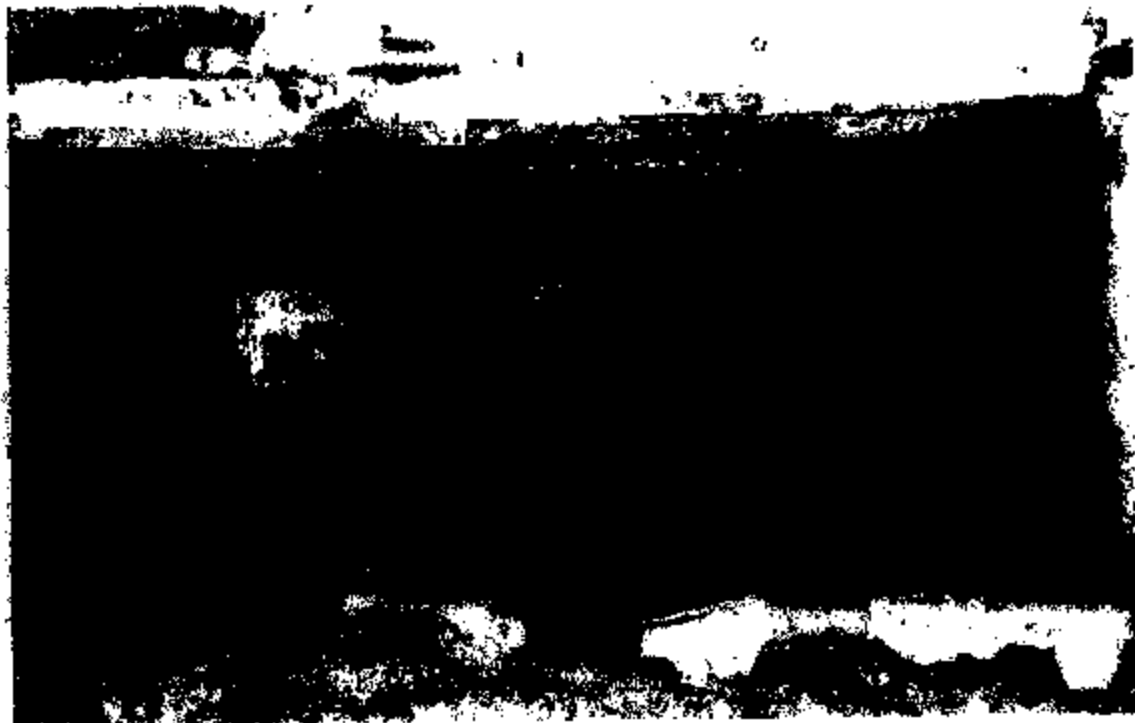


Figure 24

Owens Forensic Engineering, Inc.

TI-NHTSA 10647

File No: 2022.12

Client: Seab

Serial: 7803

Roll: 2

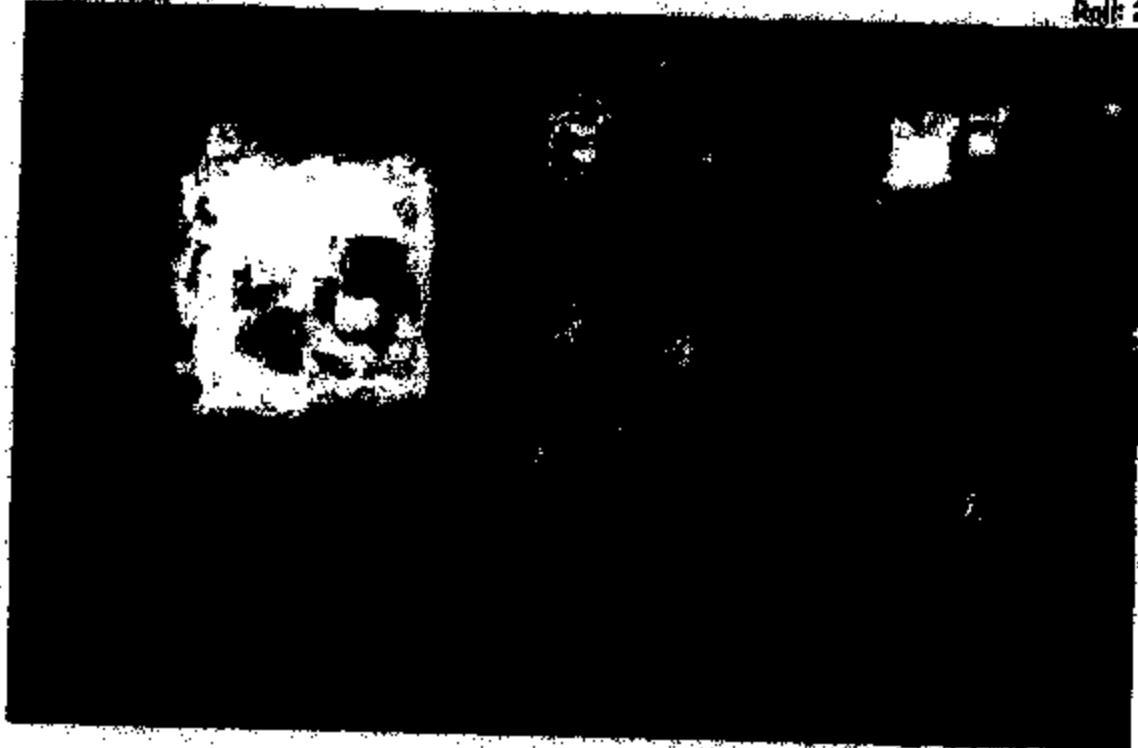


Figure 25

Owens Forensic Engineering, Inc.

TI-NHTSA 10648