EA02-031

February 6, 2004

04V-060 Oat

Mr. K. N. Weinstein
Associate Administrator for Safety Assurance
National Highway Traffic Safety Administration
400 Seventh Street, S.W., Room 5321
Weshington, D.C. 20580

Dear Mr. Weinstein:

The following information is automitted pursuant to the requirements of 49 CFR 573.6 as keeplies to a determination by General Motors of a safety defect involving certain 1897-2004—model year Chevrolet Corvette model vehicles.

573.5(o)(1): Chevrolet Division of General Motors Corporation

573.6(c)(2)(3)(4): This information is shown on the stiached sheet.

573.8(o)(6): General Motors has decided that a defect, which relates to motor vehicle safety, exists in certain 1997-2004 model year Chevrolet Convette vehicles with electronic column look (ECL). When the ignition switch is turned to "lock," the ECL prevents turning of the steering system. The vehicle is started, the ECL unlocks the steering system. The vehicle is designed so that if the column falls to unlock when the vehicle is started and the outstomer tries to drive, the fuel supply will be shut off so that the vehicle carnot move when the vehicle cannot be steered. If voltage at the Powertrain Control Module (PCM) is low or interrupted, however, the fuel shut off may not occur and the vehicle can be accelerated while the steering system is looked. If this occurs, a cresh could occur without warning.

Note: The ECL was standard production content for U.S. Corvettes with automatic transmissions for model years 1997, 1998, 1999 and 2000. In May 2001, General Motors began a customer eatisfaction program covering 1996-2000 Corvettes built from 04/01/98 through 12/31/99 because of manufacturing problems that could cause the ECL to fall to unlock (recall #01044). The service procedure for the automatic transmission vehicles was to cleable the ECL. The same procedure was performed on some additional automatic transmission vehicles under a service bulletin. Automatic transmission Corvettes sold in the United States after the 2000 model year, do not have an ECL. All manual transmission Corvettes, model years 1997-2004, have an ECL.

573.8(c)(6): During vehicle testing in December 2003, it was observed that while the steering system was locked, the fuel inhibit function was not operating in a vehicle and the cause was traced to an intermittent battery connection. Additional testing and investigation continued during December 2003 and January 2004. On Jenuary 22, 2004, Engineering interviewed an employee from the Bowling Green essembly plant who had reported that an ECL falled to unlook and that fuel was not inhibited in a 2004 Corvette. On Jenuary 23, 2004, the vehicle was inspected and it was concluded that the condition resulted from resetting of the PCM as a result of low battery voltage. Because of the PCM reast, the message from the body control module about the ECL status is not processed.

On January 29, 2004 Product Investigations presented the issue to the FPE Director. The FPE Director reviewed the issue with the GMNA Senior Management Committee. On February 2, 2004 GM made the decision to conduct a safety recall.

Product Investigations
Mail Code: 480-108-304 = 30500 Nound Road = Warren, MI 48000-0088
1710106: (180) 950-5029 = Pape (586) 647-2816
110-4004.59444



573.6(c)(8): For manual transmission vehicles, dealers will reprogram the PCM. For automatic transmission vehicles, dealers will disable the ECL. Additional information will be included in the service procedure of the final dealer buildin.

General Motors will provide reimbursement to owners for repairs completed on or before ten days after the final owner mailing is completed, according to the plan submitted on January 15, 2003.

673.8(a)(9); Draft copies of the dealer bulletin and owner notification are attached. Final copies of the dealer bulletin and owner notification will be forwarded when available. General Motors plans to begin this safety recall in the second quarter of 2004.

Sincerely,

Gay P. Kent Director

Product Investigations

2129 - 04006 Attachments 573.6(0)(2)(3)(4)

VEHICLES POTENTIALLY AFFECTED BY MAKE, MODEL, AND MODEL YEAR PLUS INCLUSIVE DATES OF MANUFACTURE

04V-060 (3) of (3)

MAKE	MODEL SERVES	MODEL YEAR	NUMBER INVOLVED	INCLUS MANUFACTUI IFROM		DESCRIPTIVE INFO. TO PROPERLY IDENT: VEH.	EST. NO. WACONDITION
100.0.00	200-1304K			- · ·			<u> </u>
Chevrolet	Y Car	1997	9,006	09/96	Q7/97	Corvette	" Unknown
Chevrolet	Y Car	1998	24,429	03/97	06/98	Corvette	•
Chevrolet	Y Car	1999	18,121	03/98	08/99	Corveille	•
Chevrolet	Y Car	2000	23,104	08/98	06/00	Corvette	•
Chevrolet	Y Car	2001	14,959	03/00	06/01	Corvette	•
Chevrolet	Y Car	2002	15,822	03/01	08/02	Corvelle	•
	Y Car	2003	16,123	02/02	08/03	Corvette	•
Chevrolet Chevrolet	Y Cer	2004	7.066	02/03	01/04	Corvette	•

Grand Total: 126,624

2129/04009

^{*} All involved vehicles will be corrected.

File in Section: Product Recalls

Bulletin No.:

Date: Draft: #1



Recall Bulletin







04V-060 ⊕ or ⊕

PRODUCT SAFETY RECALL

SUBJECT: .

ELECTRONIC COLUMN LOCK SYSTEM

MODELS:

1997-2004 CHEVROLET CORVETTE EQUIPPED WITH A MANUAL

TRANSMISSION

1997-2000 CHEVROLET CORVETTE EQUIPPED WITH AN AUTOMATIC

TRANSMISSION

2001-2004 CHEVROLET CORVETTE EQUIPPED WITH AUTOMATIC

TRANSMISSION - EXPORT ONLY

DRAFT A FINAL VERSION OF THIS DRAFT WILL BE USED IF THERE IS A DECISION TO RECALL

CONDITION

General Motors has decided that a defect, which relates to motor vehicle safety, exists in certain 1997-2004 model year Chevrolet Corvette vehicles with electronic column lock (ECL) systems. When you turn your ignition switch to "lock," the system prevents turning of the steering system. When you start your vehicle, it unlooks the steering system. Your vehicle is designed so that if the column falls to unlock when you start your car, the fuel supply will be shut off if you try to move your vehicle. If voltage at the Powertrain Control Module is low or interrupted, however, the fuel shut off may not occur and the vehicle can be accelerated while the electing system is locked. If this occurs, a clash could occur without warning.

CORRECTION

Dealers are to remove the column look plate on U.S. and Canadian vehicles equipped with an automatic transmission. On vehicles equipped with a manual transmission, and IPC vehicles equipped with an automatic transmission, dealers are to reprogram the PCM.

VEHICLES INVOLVED

involved are <ail or certain> 20## <use body style designation (F-Car, W-Car, Etc.) or specific model & division if not all involveds model vahicles equipped with dist special equipment with RPO's)> and built within these VIN breekpoints:

Copyright 2004 General Motors Corporation. All Rights Reserved.

YEAR	DIVISION	MODEL	FROM	HOUGHHT
20##				_#####
20##			 	

Month, 200#

IMPORTANT: Dealers should confirm vehicle eligibility through *GMVIS* (GM Vehicle Inquiry System) prior to beginning recall repairs. [Not all vehicles within the above breakpoints may be involved.]

For dealers with involved vehicles, a Campaign Initiation Detail Report containing the complete Vehicle Identification Number, customer name and address data has been prepared and will be loaded to the GM DealerWorld, Recall Information website. The customer name and address data furnished will enable dealers to follow up with customers involved in this recall.

The Campaign Initiation Detail Report may contain customer names and addresses obtained from Motor Vehicle Registration Records. The use of such motor vehicle registration data for any other purpose is a violation of law in several states/provinces/countries. Accordingly, you are urged to limit the use of this report to the follow-up necessary to complete this recall.

PARTS INFORMATION

[ALL DEVIATIONS FROM THE FOLLOWING VERBIAGE MUST BE CLEARED THROUGH GMSPO (I.E. VIP ORDERS, SPAC CASES, ETC.)]

For Standard Recall Parts Distribution Use:

Parts required to complete this recall are to be obtained from General Motors Service Parts Operations (GMSPO). Please refer to your "involved vehicles listing" before ordering parts. Normal orders should be placed on a DRO = Daily Replenishment Order. In an amergency situation, parts should be ordered on a CSO = Customer Special Order.

Part Number	Description	Quantity/Vehicle
########		

<u>if Pre-shipping Use:</u> (NOT FOR IPC)

Parts Pre-Ship Information - For US and Canada

Important: An initial supply of spart name> required to complete this recall will be pre-shipped to involved dealers of record. This pre-shipment is scheduled to begin the week of ##% of each dealer's involved vehicles.

Pre-shipped parts will be charged to dealer's open parts account.

Additional parts, if required, are to be obtained from General Motors Service Parts Operations (GMSPO). Please refer to your "involved vehicles listing" before ordering parts. Normal orders should be placed on a DRO = Dally Replenishment Order. In an emergency situation, parts should be ordered on a CSO = Customer Special Order.

Part Number	Description Quantity/Vehicle
*****	#

Common Optional Special Parts Information Statements Which May Be Needed:

important: Due to the small number of vehicles involved and due to limited initial parts availability, dealers are encouraged not to order recall parts for use as shelf

Month, 200#

Bulletin No.: 040##

stock. Parts should only be ordered when inspection determines that it is necessary to <insert description of inspected condition that requires parts.

Important: It is estimated that only #9% of involved vehicles will require chartreplacement. Please order parts accordingly.

For leuzu models: [Include This Section Only if Needed]

Parts required to complete this recall are to be obtained from American lauzu Parts Distribution Network (AIPDN). Please refer to your "involved vehicles listing" prior to ordering requirements.

Part Number	 Description	Quantity/Vehicle	
*******	 -	#	╗

.Beginning t	he week of .	##, 200)#, each de	ejer will	be ship;	oed e		
#####, for	use in this	recall. This	tool/video t	ape/kit (e being	furnished	at n	o charce.
Additional	toole/video	tapes/kite, if	required,	may	be pu	rchased	bv	contacting
	at	1-800-###-####	¥.>		•.			

SERVICE PROCEDURE

Include one of the following only if applicable

Category - Recall Service Procedure is Different Than Service Manual Information.

iMPORTANT: The service procedure contained in this recall is different from the service procedure found in the appropriate service manual(s). In the near future the service manual(s) will be updated with this new service procedure: Please be advised that the labor time allowance listed in the labor time guide is not affected by this new service procedure.

(OA)

<u>Category</u> - Recall Service Procedure and Labor Time Allowance is Different Than Service Manual Information and Labor Time Guide.

MPORTANT: The service procedure contained in this recall is different from the service procedure found in the appropriate service manual. As a result, the labor time allowance has been revised to correspond with this new service procedure. In the near future the service manual and labor time guide will be updated with this new information.

(OR)

Category - Recall Labor Time Allowance is Different Than the Labor Time Guide.

IMPORTANT: The labor time allowance listed in this recall is different than that currently published in the labor time guide for performing the same operation. In the near future, the labor time guide will be updated with this new information.

<Detail per individual recall>

Bulletin No.: 040

CUSTOMER REIMBURSEMENT For US [Include This Section Only If Needed]

All customer requests for reimburgement for previous repairs for the recall condition will be handled by the Customer Assistance Center, not by dealers.

A General Motors Product Recall Customer Reimbursement Procedure Form is included with the customer letter.

IMPORTANT: Refer to the GM Service Policies and Procedures Manual, section 6.1.12, for specific procedures regarding customer reimbursement and the form.

CUSTOMER REIMBURSEMENT For Canada [Include Thie Section Only If Needed]

Customer requests for reimbursement of previously paid repairs to correct _____ are to be submitted by _____#, 200#.

All reasonable customer paid receipts should be considered for reimbursement. The amount to be reimbursed will be limited to the amount the repair would have cost if completed by an authorized General Motors dealer.

When a customer requests reimbursement, they must provide the following:

- · Proof of ownership at time of repair.
- Original paid receipt confirming the amount of repair expense(s) that were not reimbursed, a description of the repair, and the person or entity performing the repair.

Claims for customer reimbursement on previously paid repairs are to be submitted as required by WINS.

IMPORTANT: Refer to the GM Service Policies and Procedures Manual, section 1.6.2, for specific procedures regarding customer reimbursement verification.

FLOOR PLAN REIMBURSEMENT

Dealers in possession of vehicles included in the Stop Delivery are eligible for reimbursement of floor plan expense upon completion of this recall. This reimbursement is limited to the number of days from the Stop Delivery measage to receipt of the recall parts and/or repair procedures. Floor plan reimbursement beyond these dates is not allowed. The amount of reimbursement should be charged as a net amount expense using the recall labor operation provided.

COURTESY TRANSPORTATION [Include This Section Only if Needed]

The General Motors Courteey Transportation program is intended to minimize customer inconvenience when a vehicle requires a repair that is covered by the New Vehicle Limited Warranty. The availability of courteey transportation to customers whose vehicles are within the warranty coverage period and involved in a product recall is very important in maintaining customer satisfaction. Dealers are to ensure that these customers understand that shuttle service or some other form of courteey transportation is available and will be provided at no charge. Dealers should refer to the General Motors Service Policies and Procedures Manual for Courteey Transportation guidelines.

CLAIM INFORMATION

Submit a Product Recall Claim with the information indicated below:

REPAIR PRRFORMED	PART COUNT	PART NO.	PARTS ALLOW	CC-FC	LABOR OP	LABOR HOURS	MET
	* #	******	**	MA-96	y —	##	201
Courtesy Transportation	N/A	N/A	NA	MA-98	PMA .		****
Floor Plan Reimbursement				MA-66	V		******
Customer Heimbursement (Canadian Dealers ONLY)				MA-96	V	0.2	******

For Recall Administrative Allowance, add 0.1 hours to the "Labor Houra".

- The "Parts Allowance" should be the sum total of the current GMSPO Dealer net price plus applicable Mark-Up or Landed Cost Mark-Up (for IPC) for <ist parts required>needed to complete the repair.
- [Remove this item and corresponding column above if not applicable to recall] The amount identified in the "Net Item" column should represent the sum total of the current GMSPO Dealer not price plus applicable Mark-Up or Landed Cost Mark-Up (for IPC) for <ist parts required> needed to perform the required repairs.
- [Remove this line if majority of vehicles are out of warranty] Submit courtesy transportation using normal labor operations for courtesy transportation as indicated in the GM Service Policies and Procedures Manual.
- The amount identified in the "Net item" column should represent the actual dollar amount for courtesy transportation.
- """" [Remove this item and corresponding column above if not applicable to recall] The amount identified in the "Net Item" column should represent the dollar amount shown below:

Vehicle	Reimburgement Amount
	\$ #.##

[Remove this item and corresponding column above if not applicable to recall] The amount identified in the "Not item" column should represent the dollar amount reimbursed to the customer.

Refer to the General Motors WINS Claims Processing Manual for details on Product Recall Claim Submission.

CUSTOMER NOTIFICATION - For US and CANADA

General Motors will notify customers of this recall on their vehicle (see copy of customer letter included with this bulletin). <Explain any special customer contacts being made (phone calls, etc.)>

CUSTOMER NOTIFICATION - For IPC

Letters will be sent to known owners of record located within areas covered by the US National Traffic and Motor Vehicle Safety Act. For owners outside these areas, dealers should notify customers using the attached sample letter.

<u>DEALER RECALL RESPONSIBILITY</u> – For US and IPC (US States, Territories, and Possessions)

The US National Traffic and Meter Vehicle Safety Act provides that each vehicle that is subject to a recall of this type must be adequately repaired within a reasonable time after the customer has tendered it for repair. A failure to repair within sixty days after tender of a vehicle is prima facte evidence of fallure to repair within a reasonable time. If the condition is not adequately repaired within a reasonable time, the customer may be entitled to an identical or reasonably equivalent vehicle at no charge or to a refund of the purchase price less a reasonable allowance for depreciation. To avoid having to provide these burdensome remedies, every effort must be made to promptly schedule an appointment with each customer and to repair their vehicle as soon as possible. In the recall notification letters, customers are told how to contact the US National Highway Traffic Safety Administration if the recall is not completed within a reasonable time.

DEALER RECALL RESPONSIBILITY - ALL

 
All unsold new vehicles in dealers' possession and subject to this recall <u>must</u> be held and inspected/repaired per the service procedure of this recall bulletin <u>before</u> customers take possession of these vehicles.

Dealers are to service all vehicles subject to this recall at no charge to customers, regardless of mileage, age of vehicle, or ownership, from this time forward.

Customers who have recently purchased vehicles sold from your vehicle inventory, and for which there is no austomer information indicated on the dealer fisting, are to be contacted by the dealer. Arrangements are to be made to make the required correction according to the instructions contained in this bulletin. A copy of the customer letter is provided in this bulletin for your use in contacting customers. Recall follow-up cards should not be used for this purpose, since the customer may not as yet have received the notification letter.

In summary, whenever a vehicle subject to this recall enters your vehicle inventory, or is in your dealership for service in the future, you must take the steps necessary to be sure the recall correction has been made before salling or releasing the vehicle.

things in a second of the principles of pickets and a single-content. The in section is not a single-content a single-content at most weight will be a part of the proper state of section. Leading a single-content in many page which, or the leaf weight will be a part of the proper state of section. The many extent sections is not a page which, or the leaf weight will be a part of the page state of the proper state. The page of the page of the page page which or the leaf with the page of the



040##-8

<Month Of Malling>, 200#

Dear General Motors Customer:

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Federal regulation requires that any vehicle lessor receiving this recall notice must forward a copy of this notice to the lessoe within ten days.

Reason For This Recall: General Motors has decided that a defect, which relates to motor vehicle safety, exists in certain 1897-2004 model year Chevrolet Corvette vehicles with electronic column lock systems. When you turn your ignition switch to "lock," the system prevents turning of the steering system. When you start your vehicle, it unlocks the steering system. Your vehicle is designed so that if the column fails to unlock when you start your car, the fuel supply will be shut off if you try to move your vehicle, if voltage at the powertrain control module is low or interrupted, however, the fuel shut off may not occur and the vehicle can be accelerated while the steering system is locked. If this occurs, a grash could occur without warning.

What WIII Be Done: On U.S. and Canadian vehicles equipped with an automatic transmission, your GM dealer will disable the steering column lock by removing the column lock plate. When you remove the ignition key, the transmission shifter will lock but the steering column will not lock. On vehicles equipped with a manual transmission, and on export vehicles equipped with an automatic transmission, your dealer will reprogram the powertrain control module. The steering column on these vehicles will continue to lock when the key is removed. This service will be performed for your at no charge.

Contacting Your Dealer: To limit any possible inconvenience, we recommend that you contact your <Divisions as soon as possible to schedule an appointment for this repair. By scheduling an appointment, your dealer can ensure that the necessary parts will be available on your scheduled appointment date. Should your dealer be unable to schedule a service date within a reasonable time, you should contact the appropriate Customer Assistance Center at the listed number below:

Division	Number	Text Telephonee (TTY
Bulck Bulck	1-865-808-8080	1-800-882-8425
Cadillac	1-886-982-2339	1-800-833-2622
Chevrolet	1-800-630-2438	1-900-833-2438
GMC	1-868-996-9463	1-800-462-8583
Pontlac	1-800-820-7868	1-800-833-7668
Oldernobile	1-800-630-6537	1-800-833-6537
Hummar	1-866-964-8663	1-000-033-0837

Puerto Rico - English		Bulletin No.
	1-800-496-9992	
Virgin (alassis	1-800-496-9993	
GMOT INIGIOS	1-600-496-0994	
	1-800-862-4389	
97 Contacting the		

If, after contacting the appropriate Customer Assistance Center, you are still not satisfied that we have done our best to remedy this condition without charge and within a reasonable time, you may wish to write the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, SW, Washington, DC 20590 or call 1-888-327-4236.

Customer Reply Card: The attached oustomer raply card identifies your vehicle. Presentation of this card to your dealer will assist in making the necessary correction in the shortest possible time. If you no longer own this vehicle, please let us know by completing the attached and mailing it in the postage paid envelope.

Customer Reimbursement: The enclosed form explains what reimbursement is available and how to request reimbursement if you have paid for repairs for the recall condition.

Courteey Transportation: <Use this section only when applicable> if your vehicle is within the New Vehicle Limited Warranty your dealer may provide you with shuttle service or some other form of courtesy transportation while your vehicle is at the dealership for this repair. Please refer to your Owner's Manual and your dealer for details on Courtesy Transportation.

We are sorry to cause you this inconvenience; however, we have taken this action in the interest of your safety and continued satisfaction with our products.

General Motors Corporation

Enclosure