

RQ03-008

FORD

**FORD 12/12/03 LETTER
TO ODI 4 BOOKS**

ATTACHMENT L

**PART 3 OF 4
BOOK 4 OF 4**

From: Heath, David (D.E.)
Sent: Thursday, May 30, 2002 11:56 AM
To: Paluzzi, Felicia (F.F.)
Subject: FW: D186 Buybacks for Stop lamp Switch - 1A639765- Sticking Stop lamp switch

Felicia,
See note below, this is a different VIN!! than your Virginia car.

David Heath
Taurus/ Sable PVT
NAC Family E/E Systems
Ph: 404-669-1382
Fax: 404-669-1873
Pager: 888-517-9535

-----Original Message-----

From: Hyun, Kathy (K.)
Sent: Monday, March 25, 2002 10:33 AM
To: Heath, David (D.E.)
Cc: Beard, Dave (D.F.); Stollsteimer, Dale (D.O.); Paluzzi, Felicia (F.F.)
Subject: RE: D186 Buybacks for Stop lamp Switch - 1A639765- Sticking Stop lamp switch

David,
Could you please provide me with an address to which we can ship this unit?

Also wanted to let you know that since the vehicle will be coming from Florida it will therefore need to be returned to Florida when evaluations are complete.

Please let me know.

-----Original Message-----

From: Heath, David (D.E.)
Sent: Monday, March 25, 2002 8:06 AM
To: Hyun, Kathy (K.)
Cc: Beard, Dave (D.F.); Stollsteimer, Dale (D.O.); Paluzzi, Felicia (F.F.)
Subject: RE: D186 Buybacks for Stop lamp Switch - 1A639765- Sticking Stop lamp switch

Kathy,
I think the switch and chassis folks in Dearborn will want to look at this. Felicia, please forward to the right brake pedal design engineers in Dearborn.

David Heath
Taurus/ Sable PVT
NAC Family E/E Systems
Ph: 404-669-1382
Fax: 404-669-1873
Pager: 888-517-9535

-----Original Message-----

RO63-668 8588

From: Hyun, Kathy (K.)
Sent: Tuesday, March 19, 2002 9:11 AM
To: Heath, David (D.E.)
Subject: RE: D186 Buybacks for Stop lamp Switch - 1A639765.

David,

I wanted to inform you that this transaction has FINALLY been completed. Are you still interested in examining the unit?

Please let me know.

-----Original Message-----

From: Heath, David (D.E.)
Sent: Thursday, January 24, 2002 7:06 AM
To: 'Javery, MaryJo'
Cc: Palmer, Neal (N.M.); Lal, David (D.); Bryer, Robert (R.J.); Hyun, Kathy (K.); Steiger, Robert (R.A.); Paluzzi, Felicia (F.F.); Dobiesz, Kenneth; Cerdan, Grace
Subject: RE: D186 Buybacks for Stop lamp Switch - 1A639765

Mary Jo,

He has more than one of these vehicles, so we need to see if he intends to service these by replacing the 14a005s.

David Heath
Taurus/ Sable FVT
NAC Family E/E Systems
Ph: 404-669-1382
Fax: 404-669-1873
Pager: 888-517-9535

-----Original Message-----

From: Javery, MaryJo [mailto:MJavery@Lear.com]
Sent: Wednesday, January 23, 2002 5:28 PM
To: 'Heath, David (D.E.)'; Stollsteimer, Dale (D.O.)
Cc: Javery, MaryJo; Palmer, Neal (N.M.); Lal, David (D.); Bryer, Robert (R.J.); Hyun, Kathy (K.); Steiger, Robert (R.A.); Paluzzi, Felicia (F.F.); Dobiesz, Kenneth; Cerdan, Grace
Subject: RE: D186 Buybacks for Stop lamp Switch - 1A639765

Good Afternoon Dave,

Right after we received your email, we contacted the service manager (Jim Hancock) to request the harness be direct shipped to us. According to Jim after he researched the claim, the harness unfortunately was scrapped. We pulled the vehicle history to review the past repairs. Ken Dobiesz and team will follow up tomorrow (1-24-02) with the Ford Motor technician in regard to those repairs. We will update you with our findings.

Regards,

Mary Jo Javery
Lear Warranty Supervisor
(313) 593-9061
mjavery@lear.com

> -----Original Message-----

> From: Heath, David (D.E.) [SMTP:dheath@ford.com]
> Sent: Wednesday, January 23, 2002 10:59 AM
> To: Stollsteimer, Dale (D.O.)
> Cc: Jo Javery Mary (E-mail); Palmer, Neal (N.M.); Lal, David (D.);
> Bryer, Robert (R.J.); Hyun, Kathy (K.); Steiger, Robert (R.A.); Paluzzi,
> Felicia (F.F.)
> Subject: FW: D186 Buybacks for Stop lamp Switch - 1A639765

>
> I talked to Jim Brady, the service technician, who repaired this vehicle.
> This apparently is a vehicle with a stop lamp switch bind due to the brake
> pedal being skewed (I think to the right). This puts the booster rod at
> angle to the stop lamp switch causing stop lamps to stay on. Rust is also
> prevalent on this pedal, but probably is not the root cause for this
> failure, based on analysis of in plant cases that I have examined at AAP.
> We are in the process of buying back this vehicle and we may not be able
> to fully examine it for about 3 weeks to confirm the conclusion above.
> This vehicle had other issues with climate control not working in which he
> replaced the ICP, RCC, and finally the 14a005 harness. I have asked our
> wiring harness supplier, Lear to follow-up on analyzing the harness for
> the Climate Control working on full heat. This is a separate
> investigation.
> Dale, the question arose as to what packaging stack up study was done in
> the package of this stop lamp switch, when adjustable pedals were added to
> D186, to quantify worse case angle to the stop lamp switch, and how does
> that relate to the sky bolt, booster, pedal attaching hole locations and
> tolerance? If you don't have this info, please forward the name and number
> of who does. Thanks.

>
> David Heath
> Taurus/ Sable FVT
> NAC Family E/E Systems
> Ph: 404-669-1382
> Fax: 404-669-1873
> Pager: 888-517-9535

> > -----Original Message-----

> > From: Hyun, Kathy (K.)
> > Sent: Wednesday, January 23, 2002 8:54 AM
> > To: Heath, David (D.E.)
> > Cc: Steiger, Robert (R.A.); Nguyen, Tuan (T.A.); Paluzzi, Felicia
> > (F.F.); Shelton, Jeff (J.C.)
> > Subject: RE: Buybacks in Process Week Ending 1/18/02 - 1A639765

> > The service manager's name is Jim Hancock at Scarritt Ford (727)
> > 327-3700 and the customer's name that you will want to reference is Earl
> > [REDACTED]

> > -----Original Message-----

> > From: Heath, David (D.E.)
> > Sent: Wednesday, January 23, 2002 6:53 AM
> > To: Hyun, Kathy (K.)
> > Cc: Steiger, Robert (R.A.); Nguyen, Tuan (T.A.); Paluzzi, Felicia
> > (F.F.); Shelton, Jeff (J.C.)
> > Subject: RE: Buybacks in Process Week Ending 1/18/02 - 1A639765

> > Sorry I missed you, but I would like to talk to the service manager and

> we need to look at the vehicle. After I talk to the Service manger, we
> can then determine how urgent this investigation is.

> >
> > David Heath
> > Taurus/ Sable FVT
> > NAC Family E/E Systems
> > Ph: 404-669-1382
> > Fax: 404-669-1873
> > Pager: 888-517-9535

> > -----Original Message-----

> > From: Hyun, Kathy (K.)
> > Sent: Tuesday, January 22, 2002 4:11 PM
> > To: Heath, David (D.E.)
> > Cc: Steiger, Robert (R.A.); Nguyen, Tuan (T.A.); Paluzzi, Felicia
> > (F.F.); Shelton, Jeff (J.C.)
> > Subject: RE: Buybacks in Process Week Ending 1/18/02 - 1A639765

> > David,
> > Since we seem to be playing phone tag, I thought I would communicate the
> dealer's finding in an email. According to the service manager, the last
> repair to replace a wiring harness was performed on 1/16/02 and although
> it was to address the A/C concern, he believes that it also ties into the
> lamp switch. To date, the customer has not brought the vehicle back in
> for service but since these concerns (A/C and switch lamp) are
> intermittent problems, the service manager cannot tell yet if the wiring
> harness is a final fix. The dealership has replaced switch for the switch
> lamp 4 times (last time 12/26/01). Apparently, the customer has
> experienced problems with the vehicle from the time he took delivery of
> the unit.

> >
> > The customer has opted for a replacement transaction and will continue
> to drive his current vehicle until his replacement unit is delivered,
> which is part of the reason this vehicle will not be available for at
> least 2 - 3 weeks.

> >
> > If you would like to speak with the service manager directly, please let
> me know. Also, please let me know if you would still like to evaluate the
> unit. >

> > -----Original Message-----

> > From: Heath, David (D.E.)
> > Sent: Tuesday, January 22, 2002 12:17 PM
> > To: Hyun, Kathy (K.)
> > Cc: Steiger, Robert (R.A.); Nguyen, Tuan (T.A.); Paluzzi, Felicia
> > (F.F.); Shelton, Jeff (J.C.)
> > Subject: RE: Buybacks in Process Week Ending 1/18/02

> > Kathy,
> > We would like to see this vehicle as soon as possible, before its
> repaired. We would like to see it, preferably before 3 weeks, but if
> that's impossible, we understand. I'm just waiting on approval from Bob
> Steiger to authorize a trip.

> >
> > David Heath
> > Taurus/ Sable FVT
> > NAC Family E/E Systems
> > Ph: 404-669-1382
> > Fax: 404-669-1873

> > Pager: 888-517-9535

> > -----Original Message-----

> > From: Hyun, Kathy (K.)
> > Sent: Tuesday, January 22, 2002 10:31 AM
> > To: Heath, David (D.E.)
> > Cc: Steiger, Robert (R.A.); Nguyen, Tuan (T.A.); Paluzzi, Felicia
> > (F.F.); Shelton, Jeff (J.C.)
> > Subject: RE: Buybacks in Process Week Ending 1/18/02

> > David,
> > Yes, I think we could arrange for you to take a look at it in Florida.
> > The buyback process generally takes 3 weeks to complete and after that, we
> > take the unit to a repairing dealer in the area. It would be easiest to
> > arrange for you to evaluate the vehicle at that time. If you could let me
> > know if in fact you will be able to send someone to the repairing dealer,
> > I can notify the appropriate parties to hold off on repairs until then.
> > Please let me know.

> > -----Original Message-----

> > From: Heath, David (D.E.)
> > Sent: Tuesday, January 22, 2002 9:56 AM
> > To: Hyun, Kathy (K.)
> > Cc: Steiger, Robert (R.A.); Nguyen, Tuan (T.A.); Paluzzi, Felicia
> > (F.F.); Shelton, Jeff (J.C.)
> > Subject: RE: Buybacks in Process Week Ending 1/18/02

> > Kathy,
> > Is there any way we can look at it in Florida? Is it still at the
> > dealership? If you can let us know, we are in Atlanta and could drive
> > there, assuming we get mgmt approval (shouldn't be a problem).

> > David Heath
> > Taurus/ Sable FVT
> > NAC Family E/E Systems
> > Ph: 404-669-1382
> > Fax: 404-669-1873
> > Pager: 888-517-9535

> > -----Original Message-----

> > From: Hyun, Kathy (K.)
> > Sent: Tuesday, January 22, 2002 9:52 AM
> > To: Heath, David (D.E.)
> > Subject: RE: Buybacks in Process Week Ending 1/18/02

> > David, the vehicle is currently in Florida. As such, if we transport
> > the unit here to Dearborn, after you are done evaluating, we will need to
> > transport the unit back to Florida due to the title branding process.
> > Please let me know if you need this one or if we might be able to wait for
> > a unit that is located in a non-title branding state.

> > -----Original Message-----

> > From: Heath, David (D.E.)
> > Sent: Tuesday, January 22, 2002 9:41 AM
> > To: Hyun, Kathy (K.)
> > Subject: FW: Buybacks in Process Week Ending 1/18/02

> > Kathy,
> > We need to get a look at 2001 Sable, VIN # 1MEHM55841A639765. Can you
> > tell me where this vehicle is, and can we look at the brake pedal assy and

> stoplamp switch?

> >

> > David Heath
> > Taurus/ Sable PVT
> > NAC Family E/E Systems
> > Ph: 404-669-1382
> > Fax: 404-669-1973
> > Pager: 888-517-9535

> >

> > -----Original Message-----

> > From: Konyha, Andrew (A.D.)
> > Sent: Tuesday, January 22, 2002 9:08 AM
> > To: Heath, David (D.E.)
> > Subject: FW: Buybacks in Process Week Ending 1/18/02

> >

> > Here is the file again. I spoke to one of the people here and they said
> > that if you want find where the vehicle is contact Kathy Hyun. It may no
> > longer be at the dealer and may be at the RAV lot. (The alternator concern
> > we spoke about earlier was on a 2000 and had to do with reman parts).

> >

> > -----Original Message-----

> > From: Jurkiewicz, Michele (M.)
> > Sent: Monday, January 21, 2002 8:50 AM
> > To: > Abramowski, Dave (D.); Adams, Cher'ie (C.M.); Allen, Tatiana (T.);
> > Armstead Sr., Ken (K.W.); Barr, Jay; Bell, Tim (.); Bergeron, Matthew
> > (M.C.); Black, Paul (P.R.); Bretschneider-Hurley, Annett (.); Broadhead,
> > Jeff (J.); Bryer, Robert (R.J.); Celentino, Michael (M.F.); Choate, Fred
> > (F.); Corrigan, Kevin; Cotton, Dean (D.L.); Croom, Vincent (> VC.); Cue,
> > David (D.W.); Davison, Lynn (L.E.); Demers, Michele (M.A.); DeTone,
> > Jeffrey (J.A.); Dillon, Geoff; Dripps, David (D.S.); Durfy, Rick (R.);
> > Eckert, Kenneth (K.H.); Elwell, Thomas (T.J.); Franklin, Jerry (G.M.);
> > Garrison, Brett (B.); Godlewski, Ed (E.V.); Granza, Marie (M.E.);
> > Guttenberger, John (J.B.); Hamernik, Dave (D.C.); Hammer, Richard (R.M.);
> > Heath, David (D.E.); Hegde, Amber (A.R.); Heider, John (J.W.); Henderson,
> > Donald (D.L.); Hinich, Dana; Hoen, Tim (T.M.); Hoffrichter, Joe (J.G.);
> > Humayun, Saleem (S.); Ingram, Eric (E.L.); James, Russ (R.D.); Johnson,
> > Buster (A.T.); Jurkiewicz, Michele (M.); Kamph III, John
> > (J.G.); Kelley, Michael (M.C.); Khatiwala, Sandy (S.X.); Kim, Peter
> > (P.K.); Klockow, Scott (S.A.); 'kmcguinn@viateon.com'; Konyha, Andrew
> > (A.D.); Kornosky, Dale (.); Kosior, Robert (R.E.); Kraus, Mike; Laden,
> > Gary (G.J.); Lal, David (D.); Lemm, Pamela (P.J.); LePla, Leonard (L.B.);
> > Lewis, Bob (R.B.); Livernois, Stephen (S.M.); Louie, Jennifer (J.J.);
> > Macpherson, Barb (B.M.); Martin, Mike (M.S.); Marzoni Jr., Ted (T.J.);
> > McCargo, Edward (E.); McCoy, Kris (K.); Moser, Steve (S.R.); Nguyen, Tuan
> > (T.A.); Ostrosky, James (J.P.); Paluzzi, Felicia (F.F.); Parikh,
> > Dipakkumar (D.C.); Petrauskas, John (J.P.); Pinter, Wendy (W.L.); Polaski,
> > Mike (M.S.); Raggio, Karen (K.A.); Ramp, Jim; Rappuhn, Chris (C.); Reaves,
> > Ron (R.); Reitz, Kay (K.M.); Riley, Tracy (A.); Rodgers, Chuck (C.L.);
> > Ruthinowski, Edward (E.A.); Sarber, Susan (S.); Schmidt, Lisa (L.M.);
> > Sethi, Subhash (S.C.); Shelton, Jeff (J.C.); Sichmaller, Scott (S.T.);
> > Sims, Ken (K.A.); Skikun, Steve (S.T.); Steiger, Robert (R.A.)
> > Taylor, John (J.H.); Thomson, Rob (R.A.); Truett, Melani (M;
> > .L.); Urbina, Christopher (C.); Valentine, Todd (T.R.); Vargo, Jeffrey
> > (J.J.); Vought, Brian (B.K.); Bell, Mike (M.L.); Cochran, Jerry (J.F.);
> > Coker, Robert (R.H.); Cole, Anthony (A.D.); Daniel, Larry (L.); Daniels,
> > Yvonne (Y.); Farr, Richard (R.A.); Ferrell, Douglas (D.E.); Fierro, Todd
> > (T.S.); Grant, Richard (R.); Holcomb, Terry (T.); Keith, Wayne (W.L.);
> > Lavender, Gloria (G.A.); Love, Bob (B.); Mann, James (A.); McClure, Joe
> > (J.H.); Mote, Wayne (W.G.); Musson, Yvonne (Y.M.); Payne, Buddy (B.L.);
> > Reed, Dennis (D.L.); Slonaker, James (J.R.); Spence, Patrick (P.K.);

> Stewart, Ty (J.T.); Whitted, Arthur (A.); Williams, Marvin (M.L.); Woods,
> Craig (C.P.)
> > Subject: Buybacks in Process Week Ending 1/18/02
> >
> > Attached is the buyback file which will be reviewed in tomorrow's CMT
> meeting.
> >
> > << File: 2001 Buybacks 01-18-02.xls >>
> >
> > << OLE Object: Picture (Metafile) >> Michele Jurkiewicz
> > PVT - Atlanta Assembly Plant
> > Tel: 404-669-4366 / Ford Net 769-4366
> > Fax: 404-669-1873 / Ford Net 769-1873
> >

From: Heath, David (D.E.)
Sent: Wednesday, June 27, 2001 1:12 PM
To: Steiger, Robert (R.A.); Paluzzi, Felicia (F.F.)
Cc: Hollingsworth, Paul (P.); Whitted, Arthur (A.); Ferrel, Douglas (D.E.)
Subject: Pictures of Brake Booster Rod, Stoplamp switch Alignment

Attached are photos looking directly vertical from the driver's floorboard toward the booster rod, brake stoplamp switch on vehicles with brake lights stuck on. Note the rod switch alignment on the production vehicle. One photo shows the skew of the sky bolt attaching weld nuts relative to the up holes.



Production.JPG



Skyboltout.JPG



AllBoltsInStart.JPG



Cowskybolt.JPG


David Heath
8888 POJ

Treas/Schlt

Ph: 404-669-1382

Fax: 404-669-1873

Pager: 888-517-9535

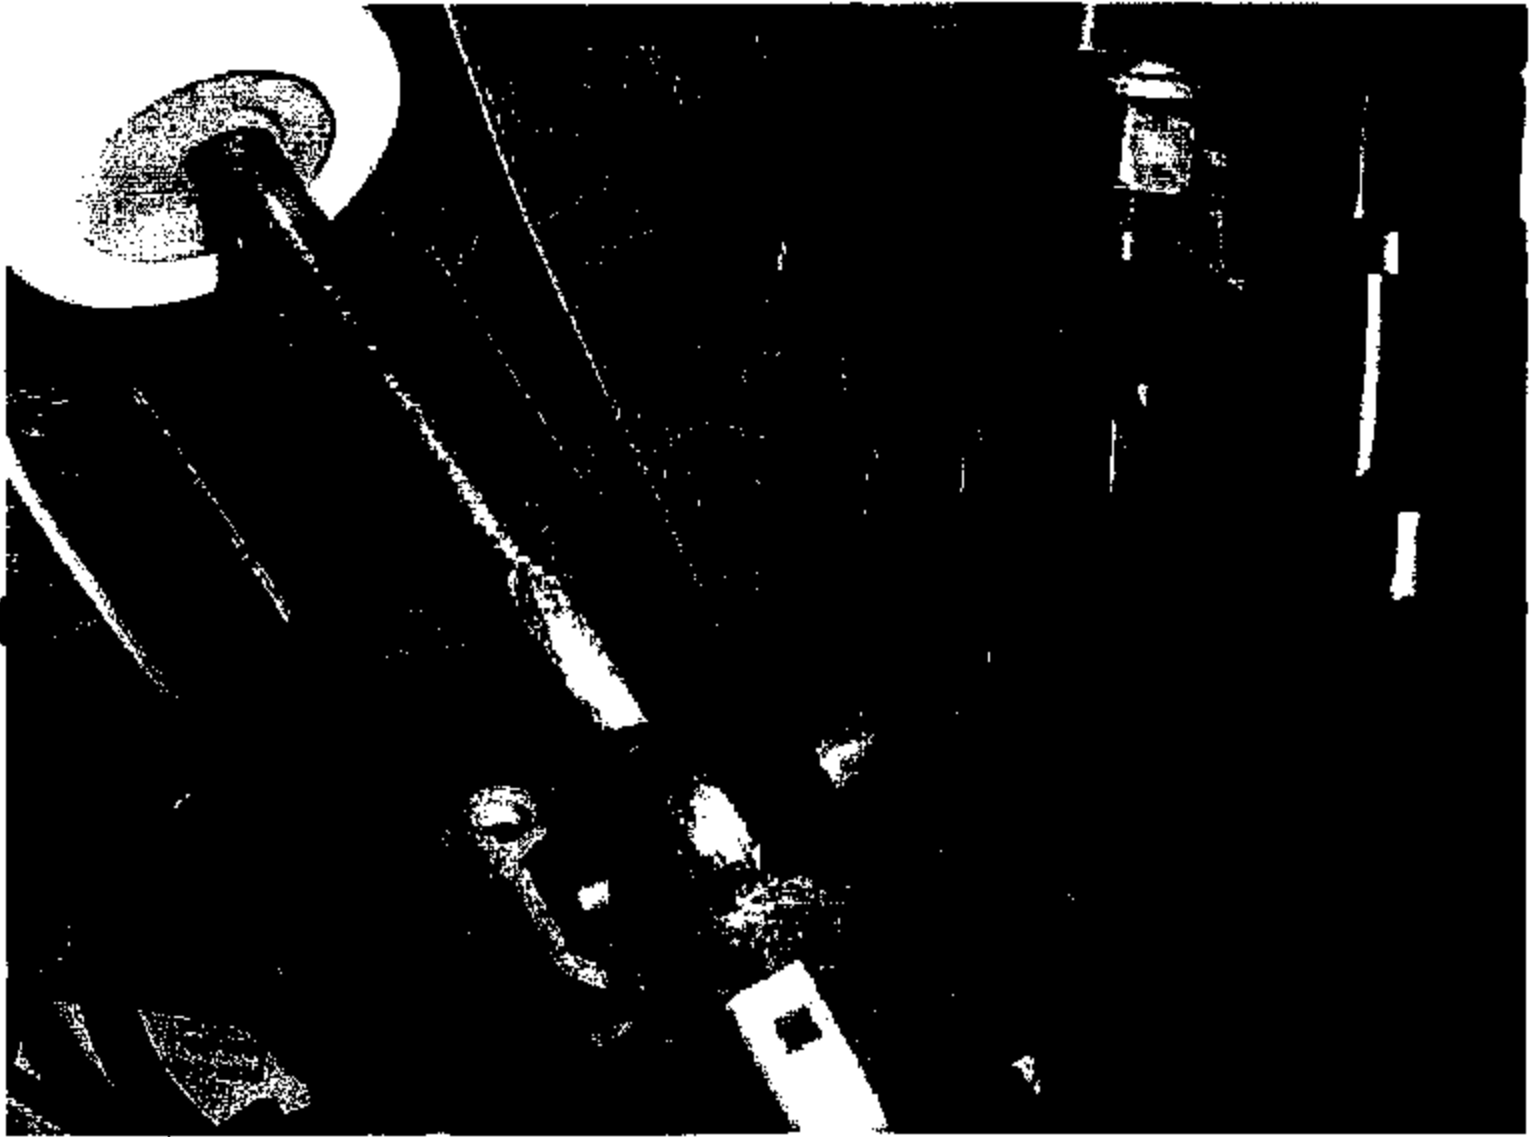


R283-885 8880



R003-000 0001



ROB-886 8882

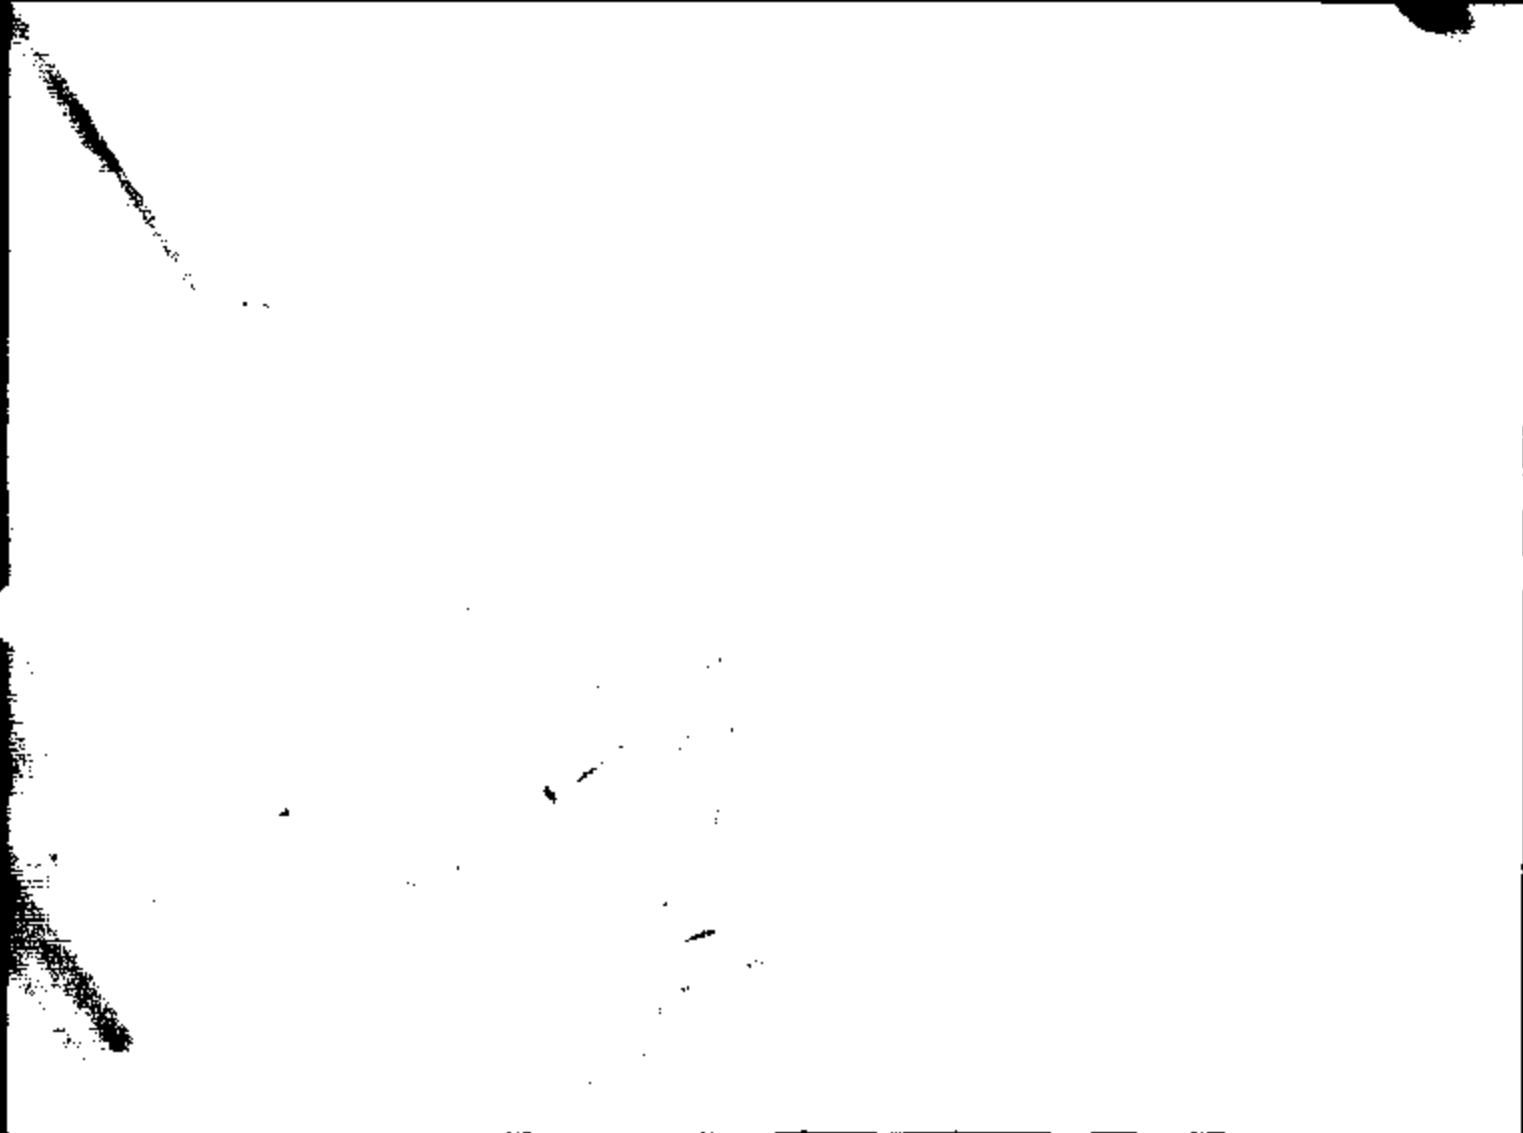

From: rob blotkamp [rblotkam@tfxauto.com]
Sent: Thursday, December 19, 2002 4:30 PM
To: Felicia Paluzzi
Cc: Greg Blise; Greg Braniff
Subject: Cable ties on Daewoo motor wire harness

Sorry it's taken so long for me to get back to you. The "tail" of the cable tie that we are cutting off measures 1 5/16". The process we installed was to apply the cable tie by hand with a pencil inserted under the tie for clearance like you indicated in the photo you sent me. An automatic type cable tensioner was not readily available in the area until the later part of this week. All personnel applying the cable ties were trained, work instructions were written and a visual aid was installed showing the proper application.

Bob Blotkamp
(260) 349-1985 Ext. 3378
(260) 349-1983 (FAX)
rblotkam@tfxauto.com

From: Smith, Dave (D.L.)
Sent: Monday, April 02, 2001 1:12 PM
To: Houston, Daniel (D.R.)
Cc: 'bteller@tfxauto.com'; Paluzzi, Felicia (F.F.); Corpe, Dale (D.E.)
Subject: Taurus/Sable Adjustable Brake Recall (01808)

Dan,

There has been concern expressed by the chassis engineer (Felicia Paluzzi) at Atlanta Assembly that there may be defective parts on hand in the PDC system relative to the subject recall. The issue is that over time, the grease used in these assemblies will break down and drip, therefore compromising the performance of the integral switch.

The part numbers involved are 1F1Z-2C434-AA (40 on hand at NPD) and 1F1Z-2C434-BA (50 on hand at NPD). Engineering levels are 1F12-2C434-AA & 1F12-2C434-BA respectively. Later engineering levels are not affected.

I am requesting that these parts be placed under stop sales until engineering levels on these parts can be confirmed as saleable.

Per Felicia Paluzzi, the fix for this will be to either: A) return to supplier (Teleflex - T0710) for rework, or B) have supplier representative on site at NPD for re-work. Option B would be preferable from a customer service standpoint as the rework only involves wiping off the old grease and replacing with new. However, I would assume the engineering level would also need changing at that point.

I am copying the Teleflex engineer on this note, his name is Bill Teller (248-616-3843) if you need to contact him.

Thanks in advance for your assistance.

Best Regards,

Dave Smith
Ford Customer Service Division
Parts Analysis - Chassis Department
National Parts Dist. Center - 1103B
(734) 523-5471 fax (734) 458-0059
e-mail dsmith22@ford.com

From: Steiger, Robert (R.A.)
Sent: Friday, June 14, 2002 3:29 PM
To: Johnson, Ron (R.K.)
Cc: Paluzzi, Felicia (F.F.); Malmn, David (D.L.)
Subject: FW: Recall 01a08

Importance: High

Here is the recall issue for grease in the switch which causes the switch to fall in the open position.

Since then we have also discovered that there is a design misalignment between the Adjustable Pedal Assy and booster rod that is not on fixed pedals. We have verified with the brake switch supplier that this misalignment may cause the switch to be partially activated without braking input. We are trialing a fix that has recently passed DV testing and (if we get Dearborn brake engineering on board) should have it released in production soon.

-----Original Message-----

From: Konyha, Andrew (A.D.)
Sent: Friday, June 14, 2002 2:36 PM
To: Steiger, Robert (R.A.)
Subject: Recall 01a08
Importance: High


r01a08.pdf


r01a083.pdf


r01a0803.pdf

Dave is sitting here on my phone. I hope this helps you.

Andrew D. Konyha
Taurus/Sable Home Office Product Concern Engineer
PVT and Field Support, VS&P
Diagnostic Service Center Building 2 Cube 566
1800 Fairlane Drive Allen Park, MI 48101
Phone (313) 594-8941 Fax (313) 337-8337
akonyha@ford.com

Ford Motor Company

March 2001

TO: All Ford and Lincoln Mercury Dealers

SUBJECT: Safety Recall 01S08: Certain 2000 and 2001 Model Year Taurus and Sable Vehicles with Power Adjustable Foot Pedals – Brake Lamp Switch Replacement

AFFECTED VEHICLES

- ◆ 2000 through 2001 Model Year Taurus and Sable vehicles equipped with Power Adjustable Foot Pedals and built at the Atlanta Assembly Plant from May 3, 1999 through August 14, 2000
- ◆ 2000 Model Year Taurus vehicles equipped with Power Adjustable Foot Pedals and built at the Chicago Assembly Plant from June 2, 1999 through August 4, 2000

SAFETY CONCERN

Grease used on the Power Adjustable Foot Pedal assembly may enter the brake lamp switch and contaminate the contacts. Over time, this contamination may cause a build-up of carbon on the contacts, and in some cases, a short. This could result in one or more of the following symptoms:

- Brake lights remain illuminated
- Shift Interlock disabled
- Speed Control disabled
- ABS Warning light illuminates (if equipped with ABS)
- Battery discharged

A smaller number of switches may also fail in the open position. This type of failure will result in inoperative brake lights and the inability to shift the vehicle out of park. Loss of brake lamp function could potentially increase the risk of an accident.

SERVICE ACTION

On all affected vehicles, the dealer is to wipe excess grease from the Power Adjustable Foot Pedal assembly, and install a new brake lamp switch.

PLEASE NOTE

Correct all vehicles in stock before delivery. Federal law requires dealers to complete any outstanding safety recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to \$5,000 per vehicle.

ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Customer Notification Letter

QUESTIONS?

Claims Information: 1-800-423-8851
Other (Dealer Only) Recall Questions: 1-800-325-5821

Sincerely,



Ann O'Neill
Director
Vehicle Service and Programs

Safety Recall 01905
Certain 2000 and 2001 Model Year Taurus and Sable Vehicles with
Power Adjustable Foot Pedals – Brake Lamp Switch Replacement

OASIS

You must use OASIS to determine if a vehicle is eligible for this recall.

PROMPTLY CORRECT

Promptly correct all affected vehicles on your dealer Recall/ONP Involved Unit Listings available on QCDealer.com. Also, correct other eligible vehicles which are brought to your dealership.

DEALER-OWNER CONTACT

Immediately contact any affected owner whose name is not on the list. Give the owner a copy of the Owner Letter and schedule a service date.

REGIONAL CONTACT

Advise regional office if an owner:

- cannot be contacted.
- does not make a service date.

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using DWE.
- Refer to ACESII manual for claims preparation and submission information.

OWNER REFUNDS

Ford Motor Company will only refund owner-paid brake lamp switch replacements made before the date of the Owner Letter (or after the date of the Owner Letter if an emergency repair was made away from the servicing dealer). Refer to ACESII manual for refund information.

RENTAL CARS

Rental cars are not authorized for this program.

Safety Recall 01S08
Certain 2000 and 2001 Model Year Taurus and Sable Vehicles with
Power Adjustable Foot Pedals – Brake Lamp Switch Replacement

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Remove Excess Grease and Replace Brake Lamp Switch	01S08B	0.4 Hour
Administrative Allowance	Misc. Expense Code "ADMIN"	0.1 Hour

PARTS REQUIREMENTS

Parts Ordering Information

Parts will not be direct shipped for this recall. Order your parts requirement through normal order processing channels as noted below.

Stock & Interim Orders	Effective Immediately	Normal order process
Emergency Orders	First 30 days after launch	Call 1-800-325-5621
Emergency Orders	31 days after launch	Normal order process

Part Number	Description	Quantity
YF1Z-13480-AA	Brake Lamp Switch (Sedan)	1
YF1Z-13480-BA	Brake Lamp Switch (Wagon)	1

DOR/COR

DOR/COR number 50224 identifies parts ordered for this campaign through the Recall Hotline (1-800-325-5621).

DEALER PRICE

For latest prices, refer to:

- DOES II
- Updated Price Book

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

Ford Motor Company

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

March 2001

01S08

Mr. John Sample
123 Main Street
Anywhere, USA 12345

Your Vehicle Identification Number: 12345678901234567

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Ford Motor Company has decided that a defect which relates to motor vehicle safety exists in certain 2000 and 2001 model year Taurus and Sable vehicles built with Power Adjustable Foot Pedals.

What the safety issue is ...

Grease used on the adjustable pedal assembly may enter the brake lamp switch and contaminate the contacts. This may cause one or more of the following symptoms to occur:

- Brake lights stay illuminated or are inoperative
- Shift Interlock disabled (will be able to shift out of "PARK" position without depressing the brakes)
- Speed Control will not activate
- Cannot shift the vehicle out of "PARK"
- ABS Warning light illuminates (on vehicles with ABS)
- Battery Discharged

Loss of brake light function could potentially increase the risk of an accident.

What Ford Motor Company and your dealer will do ...

Ford Motor Company will repair your vehicle free of charge (parts and labor). Owners affected by this recall are requested to return their vehicle to their dealer for replacement of the brake lamp switch and to have excess grease wiped off of the adjustable pedal assembly.

How long will it take?

The time needed for this repair is less than one-half day. However, due to service scheduling issues, your dealer may need your vehicle for a longer period of time.

**What we are asking
you to do ...**

Call your dealer without delay. Ask for a service date and whether parts are in stock for Safety Recall 01S08.

If your dealer does not have the parts in stock, they can be ordered before scheduling your service date. Parts would be expected to arrive within a week after ordering.

When you bring your vehicle in, show the dealer this letter. If you misplace this letter, your dealer will still do the work, free of charge.

**If you've already paid
for this service ...**

If you paid to have this service done before the date of this letter, Ford is offering a full refund. For the refund, please give your paid original receipt to your dealer. To avoid delays, do not send receipts to Ford Motor Company.

**If you've changed
address or sold the
vehicle ...**

Please fill out the enclosed prepaid postcard and mail it to us if you have changed address or sold the vehicle.

**If you have
concerns ...**

If you have trouble getting your vehicle repaired promptly and without charge, please contact your dealership's Service Manager. If you still need assistance, please contact the Ford Motor Company Customer Relationship Center and one of our representatives will be happy to assist you:

CALL: (800) 392-3673
(800) 232-5952 (TDD for the Hearing Impaired)

Office Hours: (Eastern Standard Time)

Monday-Friday: 8am - 11pm
Saturday: 9am - 6pm

or you may contact us through the Internet at:

www.ownersconnection.com

Our current response time to Internet inquiries is three business days.

You also may send a complaint to the Administrator, National Highway Traffic Safety Administration, 400 Seventh Street, S. W., Washington, D. C. 20590 or call the toll free Auto Safety Hotline at 1-888-327-4236 or 1-800-424-8393.

**Quality Care service
is there for you all
year round.**



Quality Care is the commitment of Ford Motor Company and its dealerships to provide you with a superior service and ownership experience. While we regret the inconvenience caused by this program, we stand committed with our dealers to assist you with all of your automotive service needs. With our nationwide dealer network, we are here to ensure you receive Quality Care service so that your vehicle maintains peak performance throughout your ownership experience.

We pride ourselves on becoming the world's leading consumer company for automotive products and services. Thank you for your attention to this important matter.

Sincerely,

A handwritten signature in black ink that reads "Ann O'Neill". The signature is fluid and cursive, written in a professional style.

Ann O'Neill
Director
Vehicle Service and Programs

BRAKE LAMP SWITCH REPLACEMENT

AFFECTED VEHICLES: CERTAIN 2000 AND 2001 MODEL YEAR TAURUS/SABLE
EQUIPPED WITH POWER ADJUSTABLE FOOT PEDALS

OVERVIEW

The brake lamp switch on the affected vehicles must be replaced. Lubricating grease applied to the power adjustable foot pedal assembly may have contaminated the brake lamp switch. Excess lubricating grease from the outer surfaces of the pedal assembly will be removed before a new switch is installed. This procedure will give the details for cleaning of the pedal assembly and replacement of the brake lamp switch.

SERVICE PROCEDURE

1. Note the position of the power adjustable foot pedals then move the pedals to the full upward position.
2. Install a memory saver, then disconnect the battery negative cable.
3. Disconnect the electrical connector from the brake lamp switch. See Figure 1.
4. Remove the retaining clip, then remove and discard the brake lamp switch. See Figure 1.

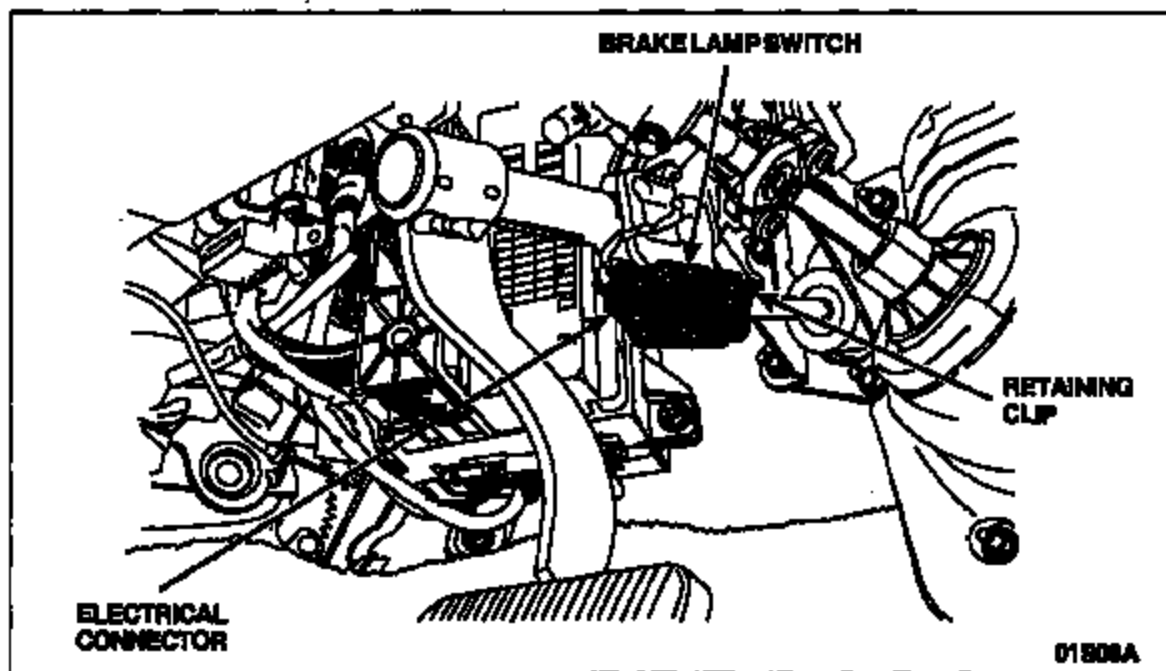


FIGURE 1

Ford Motor Company

© 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
0001

5. NOTE: Do not use solvents when removing the lubricating grease from the brake pedal assembly. Use a shop cloth to remove any lubricating grease from the outer surfaces of the following brake pedal assembly components. See Figure 2.

- Cable connection
- Pivot spring
- Guide rod
- Guide bracket
- Booster pin

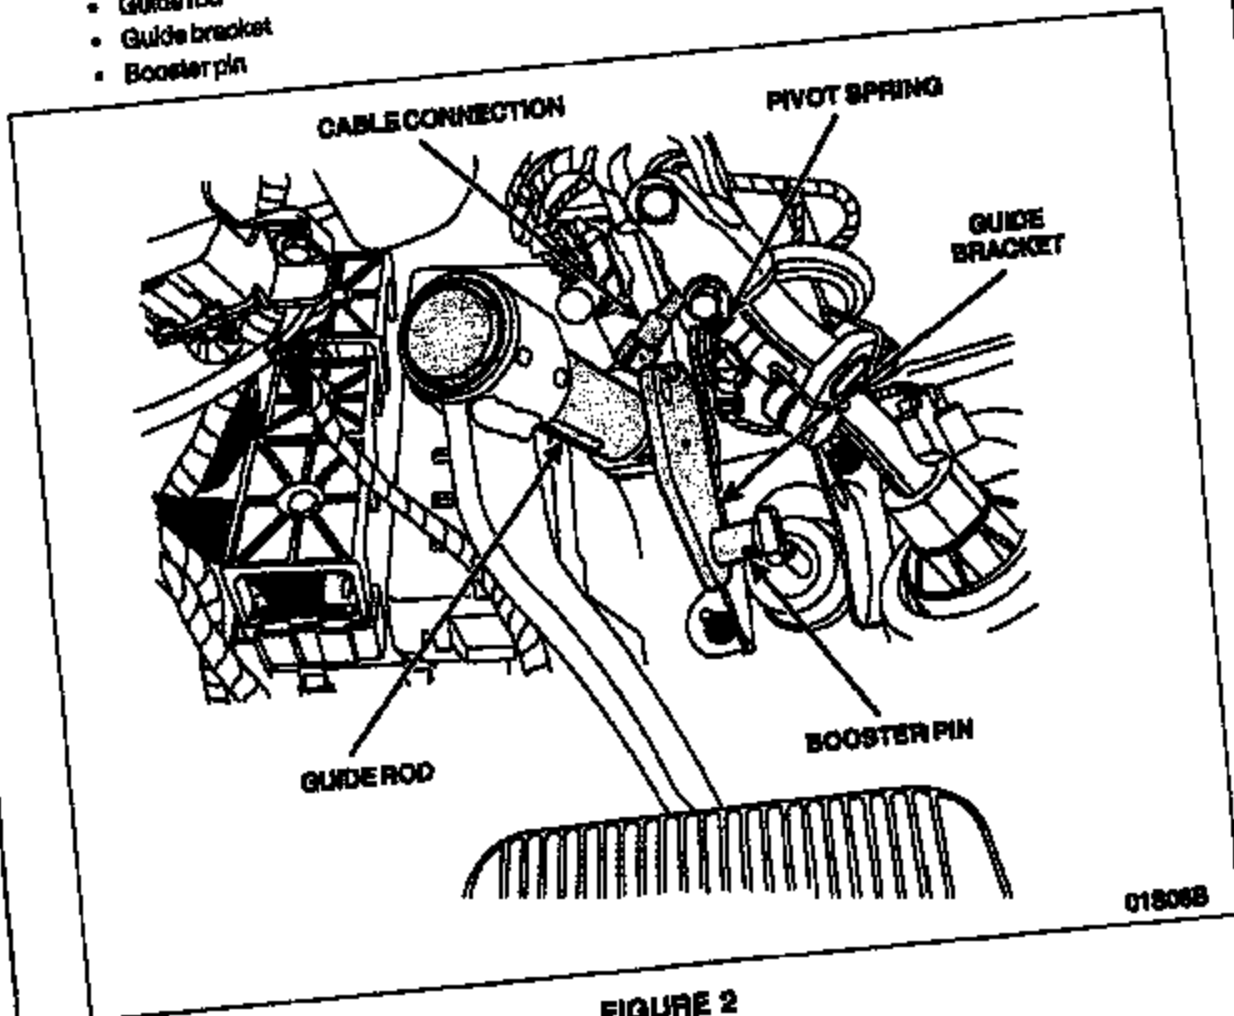


FIGURE 2

6. Install a new brake lamp switch, then install the retaining clip.
7. Connect the electrical connector to the brake lamp switch.
8. Connect the battery negative cable, then remove the memory saver.
9. Move the pedals to their original position.
10. Verify proper brake lamp operation.

Ford Motor Company
© 2001 FORD MOTOR COMPANY
DEARBORN, MICHIGAN 48121
0201

ROE3-006 002

Ford Motor Company

James P. Vondra, Director
Automotive Safety Office
Environmental & Safety Engineering

March 2, 2001

Mr. Kenneth N. Weinstein
Associate Administrator for Safety Assurance
National Highway Traffic Safety Administration
400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Mr. Weinstein:

Re: Ford Recall No. 01808 – 2000-2001 Model Year Taurus/Sable Adjustable Pedal Stop Lamp Switch Grease Contamination

Summary

- Ford Action – Ford is conducting a voluntary safety recall involving 2000-2001 model year Ford Taurus and Mercury Sable Passenger Cars equipped with adjustable pedals. These vehicles were built from May 1999 through August 2000.
- Number of Vehicles Involved – Approximately 157,000 vehicles.
- Affect on Vehicle Operation – If the grease from the adjustable pedal assembly enters the stop lamp switch, it can contaminate the contacts, leading to carbon build up, and potentially, a short circuit. A short circuit could lead to either the brake lamps staying on, or to a loss of brake lamp function. Malfunctioning stop lamps could increase the risk of a vehicle crash.
- Service Procedure – Dealers will replace the brake lamp switch and wipe down the adjustable pedal assembly to remove excess grease.

Attached is the detailed information required by the applicable portions of 49 CFR Part 573 – Defect and Non-Compliance Information Report.

Sincerely,


James P. Vondra

Attachment
01808 5d/rjw/ee/tab



ATTACHMENT

49 CFR Part 573 – DEFECT INFORMATION REPORT
01808 – 2000-2001 MODEL YEAR TAURUS/SABLE ADJUSTABLE PEDAL
STOP LAMP SWITCH GREASE CONTAMINATION

Pursuant to Part 573 of Title 49 of the Code of Federal Regulations, Defect and Noncompliance Reports, Ford Motor Company submits the following information concerning a safety recall action that it is voluntarily initiating.

573.5 (c) (2) – Potentially Affected Vehicles

Certain 2000-2001 model year Ford Taurus and Mercury Sable passenger cars with the adjustable pedal option and built at the Chicago and Atlanta Assembly Plants from May 3, 1999 through August 14, 2000 are potentially affected.

Because these vehicles are not produced in VIN order, information as to the applicability of this action to specific vehicles can best be obtained by either calling Ford's toll-free line (1-800-392-3873) or contacting a local Ford dealer, who can obtain specific information regarding the vehicles from the Ford On-line Automotive Service Information System (OASIS) database.

573.5 (c) (3) – Estimated Population of Vehicles Potentially Affected

Approximately 157,000 vehicles.

573.5 (c) (4) – Estimated Percentage of Affected Vehicles with the Defect Condition

Unknown.

573.5 (c) (5) – Description of the Defect

The adjustable pedal assembly on the subject vehicles may have excess grease that could potentially enter the stop lamp switch and contaminate the contacts. This could lead to a build up of carbon, and potentially, a short circuit. A short circuit could either cause the stop lamps to remain on, or to a loss of stop lamp function. Malfunctioning stop lamps could increase the risk of a vehicle crash.

Ford is aware of approximately 9,000 warranty reports on adjustable pedal vehicles for replacement of the stop lamp switch. A review of reports did not locate any that alleged that an accident or injury occurred.

March 2, 2001

R003-006 0023

573.5 (c) (6) -- Chronology of Events

Ford first became aware of this condition and began investigating it during the summer of 2000. The initial investigation determined that the adjustable pedal assemblies used a different, lower temperature grease than the fixed pedal assemblies. During August, 2000 the grease on the adjustable pedal assemblies was revised and an operation was added to wipe excess grease from the assemblies. Testing was initiated to establish the link between the grease and the malfunctioning stop lamp switches. In addition, field and warranty reports were monitored during late 2000 and early 2001 to establish whether the condition was a low mileage concern on a small number of vehicles, or whether the condition would continue to occur on additional vehicles built with the low temperature grease. Ford has recently concluded that there is evidence of a defect trend and on February 23, 2001 decided to take this action.

573.5 (c) (8) -- Service Program

Ford will notify owners of record of affected vehicles to return vehicles to dealers for replacement of the brake lamp switch and to have excess grease wiped off of the adjustable pedal assembly. This service will be performed at no charge to owners. Ford currently anticipates that owner notification will occur on or before the week of March 26, 2001.

573.5 (c) (9) -- Press statement and Dealer/Owner Letters

Ford does not plan to make a public statement concerning this action. Notices to dealers and owners from Ford Customer Service Division will be forwarded when available.

573.5 (c) (11) -- Recall Number

Ford has assigned recall number 01S06 to this action.

March 2, 2001

8003-005 0024

From: Jendrusch, Tam (T.D.)
Sent: Thursday, May 02, 2002 2:58 PM
To: Patel, Bharat (B.J.)
Subject: Declined: 2000-2001 Taurus/Sable Brake Light Switch - Grease Contamination

We had a meeting ~ three weeks ago and discussed this matter to everyone's satisfaction. All that needs to be done now is to update the concern. There is no need for another meeting; please see Norm Schmidt/Dale Komoosky for status.

From: Jendrusch, Tom (T.D.)
Sent: Friday, March 08, 2002 7:18 AM
To: Schramek, Joseph (J.E.)
Subject: FW: Prevent Action Closure Papers

Please see my comments on the attached file.

"It is a capital mistake to theorise before one has data" -- Arthur Conan Doyle

Tom Jendrusch, 313-317-7389
GCE Braking Control Campaign Prevent Specialist
Visit the Brake RVT Website at www.detroit.ford.com/bvdocs.

-----Original Message-----

From: Schramek, Joseph (J.E.)
Sent: Thursday, March 07, 2002 9:49 AM
To: Jendrusch, Tom (T.D.)
Subject: Prevent Action Closure Papers



Brake Stop Lamp
Switch Prevent...

Here are the two sets of papers for the Brake Top Lamp Switch-Grease for Taurus/Sable Adjustable Brake Pedals and the Parking Brake Rubs on the Wheel for Windstar Export vehicles. You mentioned that you would update the matrix of prevent actions for the Brake Stop Lamp Switch concern for Monday's meeting. You might want to double check the detail prevent action sheet for this concern as well. Thanks.

Joe Schramek, EXT 31979, FAX: (313) 621-6675

Subject: Brake Switch Contamination Closure Meeting
Location: Burt's ofc., PDC 1UC45, 1st Floor-East Wing

Start: Thu 7/5/2001 1:30 PM
End: Thu 7/5/2001 2:30 PM
Show Time As: Out of Office

Recurrence: (none)

Meeting Status: Not yet responded

Required Attendees: Skinner, Sandra (S.A.); McNeal, Burton (B.E.); Newell, Sean (S.M.); Rossi, Roberto (R.A.); Schmidt, Norm (N.G.); Jendrusch, Tom (T.D.); Patel, Bharat (B.J.); Rodgers, Chuck (C.L.); Summers, Priscilla (P.L.)

Subject: Brake Switch Contamination Closure Meeting
Location: Burf's ofc., PDC 1UC45, 1st Floor-East Wing

Start: Thu 7/5/2001 1:30 PM
End: Thu 7/5/2001 2:30 PM
Show Time As: Out of Office

Recurrence: (none)

Meeting Status: Not yet responded

Required Attendees: Skinner, Sandra (S.A.); McNeal, Burton (B.E.); Newell, Sean (S.M.); Rossi, Roberto (R.A.); Schmidt, Norm (N.G.); Jendrusch, Tom (T.D.); Patel, Bharat (B.J.); Rodgers, Chuck (C.L.); Summers, Priscilla (P.L.)

From: Gelven, Rob (R.W.)
Sent: Tuesday, September 30, 2003 7:25 AM
To: Patel, Bharat (B.J.)
Cc: Dookstader, Bob (Robert G.)
Subject: FW: 2000-01 Taurus/Sable Brake Light Contamination w/ Brake Pedal Grease

Bharat, Bob Wertanen and Norm Schmidt will working together to update the 14D.

R. W. Gelven

NAE Brake Systems - Integration Manager
☎: (313)84-58103 Text Pager: (313)795-8883
✉: rgelven@ford.com
SC 1 - 1AE01

-----Original Message-----

From: Haberstroh, Robert (R.W.)
Sent: Tuesday, September 30, 2003 6:54 AM
To: Gelven, Rob (R.W.)
Cc: Fash, James Jay (J.W.); Schmidt, Norm (N.G.)
Subject: RE: 2000-01 Taurus/Sable Brake Light Contamination w/ Brake Pedal Grease

I agree

Sincerely,

Robert W. Haberstroh

Brake Design Supervisor, Actuation & Pedals
North American Engineering - Core Brake Design
Schoefer Court X, Room: 1AJ02
✉ <mailto:mhb@ford.com>
☎ (313) 84 55882

-----Original Message-----

From: Gelven, Rob (R.W.)
Sent: Tuesday, September 30, 2003 6:49 AM
To: Haberstroh, Robert (R.W.)
Cc: Fash, James Jay (J.W.); Schmidt, Norm (N.G.)
Subject: RE: 2000-01 Taurus/Sable Brake Light Contamination w/ Brake Pedal Grease

As we discussed in the design review, please have Bob Wertanen update the 14D with Norm's assistance. Please review this with Jay and I before they schedule the technical review.

R. W. Gelven

NAE Brake Systems - Integration Manager
☎: (313)84-58103 Text Pager: (313)795-8883
✉: rgelven@ford.com
SC 1 - 1AE01

-----Original Message-----

From: Haberstroh, Robert (R.W.)
Sent: Thursday, September 25, 2003 6:28 AM
To: Fash, James Jay (J.W.); Gelven, Rob (R.W.)
Subject: FW: 2000-01 Taurus/Sable Brake Light Contamination w/ Brake Pedal Grease

ROB-885 8882

This is a issue that Norm worked on (and closed) last year..

Sincerely,

Robert W. Haberstroh

Brake Design Supervisor, Actuation & Pedals
North American Engineering - Core Brake Design
Schaefer Court I, Room: 1A702
✉ mallo;rhaberst@ford.com
☎ (313) 64 55862

—Original Message—

From: Patel, Bharat (B.J.)
Sent: Wednesday, September 24, 2003 6:41 PM
To: Gelven, Rob (R.W.); Haberstroh, Robert (R.W.); Fash, James Jay (J.W.)
Cc: Brown, Len (L.M.); Dockstader, Bob (Robert G.); McNeal, Burton (B.E.)
Subject: 2000-01 Taurus/Sable Brake Light Contamination w/ Brake Pedal Grease

Rob, I need immediate help on the following:

- 1.) assigning a key contact person (LL6 & LL5) to participate in future discussions of the subject issue and
- 2.) LL6 that will help in authoring the 14D that is required.

We had a review with Burt McNeal and Taurus Chassis/Electrical team earlier today and the team consensus was that we need to have a 14D drafted to support a Tech Review. My plan for this tech review is 2 weeks from today. Team consensus was that the 14D needs to be drafted jointly between the electrical and brake team. Norm Schmidt and Bob Dockstader represented the Brake/Chassis team respectively. They can provide some additional insight if needed, but in the meantime I simply need the key contact names and I will contact them directly. Your help would be greatly appreciated.

Zandra: pls schedule TR for 2 weeks from now. Thank you.

Bharat J. Patel

Critical Concerns Manager - NAC
Phone: 313-248-6312; Fax: 313-390-6002
Text Pager: 313-795-3457 or bpatel7@ford.com

The information contained herein is FORD PROPRIETARY information and may include FORD CONFIDENTIAL information as defined in Ford's Global Information Standard II. Reproduction of this document, disclosure of the information, and use for any purpose other than the conduct of business with Ford is expressly prohibited.

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN:1FAFP5SL8YG141148 2000 TAURUS Asm:CHI Odom 14723 Built: 02-DEC-99 WSD: 08-MAR-00	Tag #: 0124731376 R.O.#: 2937001 Dealer #: 13315 Phone: 718-657-5222 Repaired: 05-JUL-02	A85 OTHER ELECTRICAL ACCESSORY TROUBLES 48 BURNED OUT	CHECK CUSTOMER CONCERN. CONFIRM BRAKE LIGHT SWITCH AND CONNECTOR IS DEFECTIVE. CHECK OPASIS & FOUND TSB 02-5-1. INSTALL BRAKE LIGHT SWITCH & CONNECTOR. RECHECK FOUND OK
Enter Global ID # Here: <input type="text"/>	Comments: <i>A</i>			
Enter Corrective Action Date: <input type="text"/>				
Srvcl: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN:1MEFM53U3YAB21618 2000 SABLE Asm:ATL Odom 21418 Built: 01-MAR-00 WSD: 16-MAR-00	Tag #: 0124735162 R.O.#: 91751A Dealer #: 00960 Phone: 256-773-7242 Repaired: 09-JUL-02	L29 OTHER LIGHTING TROUBLES (INCL LEAKS/CONDENSATION) 28 OPEN CIRCUIT	RAN CIRCUIT TEST FOUND BAD STOP LAMP SWITCH NEEDED TO REPLACE STOP LAMP SWITCH
Enter Global ID # Here: <input type="text"/>	Comments: <i>A</i>			
Enter Corrective Action Date: <input type="text"/>				
Srvcl: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN:1FAFP6888YG183213 2000 TAURUS Asm:CHI Odom 22870 Built: 20-MAR-00 WSD: 25-AUG-00	Tag #: 0124748561 R.O.#: 32071001 Dealer #: Phone: Repaired: 11-JUL-02	H18	REPL BRAKE LIGHT SWITCH AND CONNECTOR
Enter Global ID # Here: <input type="text"/>	Comments: <i>ALL PRESENT</i> <i>A</i>			
Enter Corrective Action Date: <input type="text"/>				

1083-003 1A387

U.S. WPRC
Box Packing List

Job: 9197433
Loc: C17B03

RAC:BAD NV

26-SEP-02

NEMESIO VILLARROEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Eagr: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM63U0Y0633760 2000 SABLE Asm:CHI Odom 10968 Bult: 02-MAY-00 WSD: 21-JUN-00	Tag #: 0124750584 R.O.#: 6442101 Dealer #: 10940 Phone: 248-354-4800 Repaired: 24-JUN-02	P88 TRANSMISSION SHIFTS ROUGH OR JERKY FROM PARK 42 DOES NOT OPERATE PROPERLY	1 REPLACED BRAKE LAMP SWITCH. SERVICE PART WARRANTY.
Enter Global SD # Here: <input type="text"/>	Comments: CONTACTS SHOR... - CIL INSIDE			
Enter Corrective Action Date: <input type="text"/>	(A)			
Srvcl: YF1Z 13480BA Eagr: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP58S3YB227717 2000 TAURUS Asm:CHI Odom 35782 Bult: 05-MAY-00 WSD: 31-JUL-00	Tag #: 0124778978 R.O.#: 14060201 Dealer #: 03881 Phone: Repaired: 08-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	REMOVE AND REPLACE BRAKE LAMP SWITCH RE TEST OK
Enter Global SD # Here: <input type="text"/>	Comments: (A)			
Enter Corrective Action Date: <input type="text"/>				
Srvcl: YF1Z 13480BA Eagr: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP58S0YG178023 2000 TAURUS Asm:CHI Odom 28888 Bult: 28-FEB-00 WSD: 01-MAY-00	Tag #: 0124880473 R.O.#: 377102A Dealer #: 07877 Phone: 415-583-4400 Repaired: 08-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS B4 PINCHED/DAMAGED WIRE	REPLACE SWITCH ASY
Enter Global SD # Here: <input type="text"/>	Comments: (A)			
Enter Corrective Action Date: <input type="text"/>				

FORM 908 14388

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC:BAD NV

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480BA Engrl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM5D66YAG21054 2000 SABLE Asm: ATL Odom 24044 Bult: 24-FEB-00 WBD: 13-APR-00	Tag #: 0124007084 R.O.#: 12432301 Dealer #: 10000 Phone: 703-362-5540 Repaired: 12-JUL-02	L26 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	VERIFIED CUSTOMER COMPLAINT. NECESSARY TO REPLACE STOP LAMP SWITCH
Enter Global SD # Here: <input type="text"/>	Comments: <i>A</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engrl: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP58U62A212369 ✓ 2002 TAURUS Asm: ATL Odom 5235 Bult: 05-APR-02 WBD: 30-MAY-02	Tag #: 0125030327 R.O.#: 151895A Dealer #: 02707 Phone: 810-227-1171 Repaired: 12-JUL-02	L26 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	5235 REPLACED BRAKE PEDAL SWITCH FOR CONTINUOUS BRAKE LIGHT CONDITION. CAR OK, CC#2
Enter Global SD # Here: <input type="text"/>	Comments: <i>NC 216</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engrl: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP58U32G214125 ✓ 2002 TAURUS Asm: CHI Odom 4788 Bult: 21-MAR-02 WBD: 23-MAR-02	Tag #: 0125321375 R.O.#: 421510A Dealer #: 02257 Phone: 215-655-2121 Repaired: 16-JUL-02	H10 BRAKE-ABS WARNING LIGHT TROUBLES 41 STICKS/ENDS/GRABS	4788 CUST STATES BRAKE LIGHTS STAYING ON. CONFIRMED COMPLAINT. FOUND BRAKE LIGHT SWITCH STICKING. REMOVED AND REPLACED BRAKE LIGHT SWITCH. RETEST, OK
Enter Global SD # Here: <input type="text"/>	Comments: <i>A 1 116</i>			
Enter Corrective Action Date <input type="text"/>				

NO3-001 14388

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC:RAD NV

26-SEP-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP50DC2G135081 2002 TAURUS Asm: CHI Odom 6300 Built: 06-OCT-01 WSD: 23-OCT-01	Tag #: 0128468257 R.O.#: 4727701 Dealer #: 02361 Phone: Repaired: 25-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS B0 FROZEN/SEIZED/BINDING	CG30, 14M111 NO BRAKE LIGHTS FOUND BROKEN WIRE AT BRAKE SWITCH CONNECTOR INSTALLED PIG TAIL AND NEW SWITCH TESTED WORKS FINE
Enter Global SD # Here: <input type="text"/>	Comments <i>INS - 12 - SURT - 010113</i>			
Enter Corrective Action Date <input type="text"/>	<input type="text"/>			
Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP50G02A202998 2002 TAURUS Asm: ATL Odom 3777 Built: 20-MAR-02 WSD: 08-APR-02	Tag #: 0128543744 R.O.#: 284882A Dealer #: 05702 Phone: 502-448-1861 Repaired: 26-JUL-02	H19 BRAKE-ABS WARNING LIGHT TROUBLES 42 DOES NOT OPERATE PROPERLY	3777 W REPL BRAKE LIGHT SWITCH FOR STICKING CODE 38 6128
Enter Global SD # Here: <input type="text"/>	Comments <i>NO OIL</i>			
Enter Corrective Action Date <input type="text"/>	<input type="text"/>			
Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP55222G218378 2002 TAURUS Asm: CHI Odom 6430 Built: 28-MAR-02 WSD: 12-APR-02	Tag #: 0128588082 R.O.#: 21882401 Dealer #: 03686 Phone: Repaired: 01-AUG-02	D02 ENGINE WOULD NOT START 42 DOES NOT OPERATE PROPERLY	FOUND STICKING BRAKE LIGHT SWITCH. REPLACED SWITCH.
Enter Global SD # Here: <input type="text"/>	Comments <i>NS 112</i>			
Enter Corrective Action Date <input type="text"/>	<input type="text"/>			

9193-008 14496

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC: BAD NV

26-SEP-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcd: 2F1Z 13480AA Egnr: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP66S82A200184 ✓ 2002 TAURUS Asm: ATL Odom: 1207 Bult: 27-MAR-02 WSD: 27-APR-02	Tag #: 0128909184 R.O.#: 1824151 Dealer #: 03804 Phone: 732-891-8111 Repaired: 03-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	INOP BODY - CHASSIS- ELECTRICAL (BCE) - TEST
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				
Srvcd: 2F1Z 13480AA Egnr: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP53U12G250190 ✓ 2002 TAURUS Asm: CHI Odom: 7373 Bult: 21-MAY-02 WSD: 03-JUN-02	Tag #: 0128909354 R.O.#: 1528801 Dealer #: 06224 Phone: 816-605-1368 Repaired: 07-AUG-02	H20 OTHER BRAKE TROUBLES (INCLUDING AIR BRAKES) 28 OPEN CIRCUIT	1 DIAGNOSE, PINPOINT TEST, MONITOR PIDS, REPLACE BRAKE LIGHT SWITCH AND RETEST OK
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				
Srvcd: 2F1Z 13480AA Egnr: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP52U32G230590 ✓ 2002 TAURUS Asm: CHI Odom: 31 Bult: 29-APR-02 WSD: 01-JAN-01	Tag #: 0128909282 R.O.#: 2008298 Dealer #: 03334 Phone: 515-270-9092 Repaired: 08-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	36 BRAKE LIGHTS STAY ON WIGGLE SWITCH LIGHTS GO OUT REPLACED SWITCH WORKS NOW
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				

RCR3-008 1481

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvct#: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP56S12A207021 ✓ 2002 TAURUS Asst: ATL Odom 4350 Bult: 12-APR-02 WSD: 26-APR-02	Tag #: 0126839018 R.O.#: 55741901 Dealer #: 03130 Phone: 305-832-2277 Repaired: 06-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	1 DIAGNOSED AND REPLACED BRAKE LIGHT SWITCH
Enter Global ID # Here: <input type="text"/>	Comments: <i>MS CL</i> (A)			
Enter Corrective Action Date <input type="text"/>				
Srvct#: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP55U62A179408 L 2002 TAURUS Asst: ATL Odom 20078 Bult: 08-FEB-02 WSD: 23-FEB-02	Tag #: 0126860289 R.O.#: 197122A Dealer #: 08130 Phone: 617-782-4200 Repaired: 05-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	20078 BRAKE LIGHT STICKS ON ORDER BRAKE LIGHT SWITCH REPLACE SWITCH AND RECHECK OK
Enter Global ID # Here: <input type="text"/>	Comments: <i>MS CL</i> (A)			
Enter Corrective Action Date <input type="text"/>				
Srvct#: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP53U72G200095 L 2002 TAURUS Asst: CH Odom 3789 Bult: 28-FEB-02 WSD: 13-MAR-02	Tag #: 0126887901 R.O.#: 16302401 Dealer #: 05224 Phone: 818-505-1368 Repaired: 12-AUG-02	L29 OTHER LIGHTING TROUBLES (INCL LEAKS/CONDENSATION) 42 DOES NOT OPERATE PROPERLY	NGS BCE TEST AND BCE PINPOINT TESTS REPLACED STOP LAMP SWITCH AND STOP LAMP FUSE AND RETESTED
Enter Global ID # Here: <input type="text"/>	Comments: <i>MS CL</i> (A)			
Enter Corrective Action Date <input type="text"/>				

FORM 808 14492

U.S. WPRC
Box Packing List




Box: 9197433
Loc: C17B03

RAC: BAD NV

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: 2F1Z 13480AA Engr: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP60U42A176881 2002 TAURUS Asm: ATL Odom 5585 Bult: 30-JAN-02 WSD: 22-APR-02	Tag #: 0128940307 R.O.S: 18295401 Dealer #: Phone: Repaired: 08-AUG-02	L28	FOUND BRAKE LIGHTS STAY ON ALL THE TIME, REPLACED BRAKE LIGHT SWITCH, LIGHTS STILL ON, TRACED CIRCUIT AND FOUND WIRE LOOM
Enter Global SD # Here: <input type="text"/>	Comments: <u>NO CL</u>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engr: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP65242A201433 2002 TAURUS Asm: ATL Odom 5028 Bult: 26-MAR-02 WSD: 26-APR-02	Tag #: 0128994730 R.O.S: 75874B Dealer #: 08017 Phone: 618-234-0330 Repaired: 18-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	5028 BRAKE LIGHTS STAY ON ALL OF THE TIME BRAKE LIGHT SWITCH FAILED R/R SWITCH AND RETEST OK
Enter Global SD # Here: <input type="text"/>	Comments: <u>NO CL</u>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engr: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP33U9YA104712 2000 TAURUS Asm: ATL Odom 16841 Bult: 12-OCT-99 WSD: 30-NOV-99	Tag #: 0127018852 R.O.S: 9415451 Dealer #: Phone: Repaired: 30-JUL-02	L65	OIL PAN GASKET LEAKS - DIAGNOSIS ENGINE OIL
Enter Global SD # Here: <input type="text"/>	Comments: <u>F</u>			
Enter Corrective Action Date <input type="text"/>				

RC03-038 14423

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC:BAD NV

26-SEP-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: 2F1Z 13480AA Engr: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP53U52A217626 2002 TAURUS Assoc: ATL Odom: 4172 Built: 11-APR-02 WSD: 30-APR-02	Tag #: 0127125724 R.O.#: 7720001 Dealer #: 00085 Phone: 301-627-6600 Repaired: 14-AUG-02	L20 OTHER LIGHTING TROUBLES (INCL. LEAKS/CONDENSATION) 42 DOES NOT OPERATE PROPERLY	DIAGNOSE AND REPLACE BRAKE LIGHT SWITCH
Enter Global SD # Here:	Comments	NO OIL		
Enter Corrective Action Date				
Srvcl: 2F1Z 13480AA Engr: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP5592A201806 2002 TAURUS Assoc: ATL Odom: 1718 Built: 22-MAR-02 WSD: 06-APR-02	Tag #: 0127172701 R.O.#: 84636A Dealer #: 04369 Phone: Repaired: 15-AUG-02	A86 OTHER ELECTRICAL ACCESSORY TROUBLES 28 OPEN CIRCUIT	1719 MOS INSP VERIFIED CUST CONCERN ELECT TEST PM POINT TEST TRACED WIRES DIAG AND REPLACED BRAKE SWITC H NOTE INSTALLED FREV' YEAR SWITCH PART# RECK OPERATION PASS
Enter Global SD # Here:	Comments	NO OIL		
Enter Corrective Action Date				
Srvcl: 2F1Z 13480AA Engr: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP53U42G102984 2002 TAURUS Assoc: CHI Odom: 25118 Built: 24-AUG-01 WSD: 31-JAN-02	Tag #: 0127162283 R.O.#: 16338201 Dealer #: 06224 Phone: 816-605-1308 Repaired: 15-AUG-02	L15 OTHER LOCKMECHANISM TROUBLES 28 OPEN CIRCUIT	BRAKE LIGHT SWITCH STUCK ON BLOWN FUSE DIAGNOSE, REPLACED BLOWN FUSE, BRAKE LIGHTS STUCK ON, REPLACED BRAKE LIGHT SWITCH, VERIFIED PROPER OPERATION
Enter Global SD # Here:	Comments	NO OIL		
Enter Corrective Action Date				

ROSC-005 14484

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC:BAD NV

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: 2F1Z 13480AA Engrk: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP53UK2G218391 2002 TAURUS Asm: CHI Odom 7819 Bult: 02-APR-02 WSD: 03-APR-02	Tag #: 0127203011 R.O.#: 15338403 Dealer #: 05224 Phone: 818-506-1388 Repaired: 15-AUG-02	L29 OTHER LIGHTING TROUBLES (INCL. LEAKS/CONDENSATION) 42 DOES NOT OPERATE PROPERLY	BRAKE LIGHT SWITCH DIAGNOSE, REPLACED BRAKE LIGHT SWITCH, VERIFIED PROPER BRAKE LIGHT OPERATION
Enter Global SD # Here: <input type="text"/>	Comments: <i>ALL</i>			
Enter Corrective Action Date <input type="text"/>	<i>X</i>			
Srvcl: 2F1Z 13480AA Engrk: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP58S82A177880 2002 TAURUS Asm: ATL Odom 14301 Bult: 02-FEB-02 WSD: 17-FEB-02	Tag #: 0127212371 R.O.#: 26717001 Dealer #: 00632 Phone: 704-886-2599 Repaired: 14-AUG-02	D02 ENGINE WOULD NOT START 28 OPEN CIRCUIT	TEST BATTERY CHECK CHARGING SYSTEM AND ELECTRICAL REPLACE BRAKE LIGHT SWITCH
Enter Global SD # Here: <input type="text"/>	Comments: <i>NO FILE</i>			
Enter Corrective Action Date <input type="text"/>	<i>A</i>			
Srvcl: 2F1Z 13480AA Engrk: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP53U32AZ29745 2002 TAURUS Asm: ATL Odom 4831 Bult: 01-MAY-02 WSD: 09-MAY-02	Tag #: 0127223588 R.O.#: 55408A Dealer #: 03274 Phone: Repaired: 13-AUG-02	L26 LIGHTS NOT WORKING- EXTERIOR 41 STICKS/BINDS/GRABS	REPLACE BRAKE LAMP SWITCH
Enter Global SD # Here: <input type="text"/>	Comments: <i>X</i>			
Enter Corrective Action Date <input type="text"/>	<i>X</i>			

0003-008 14498

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srv#: YF1Z 13480AA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM3U51A830309 2001 SABLE Asm: ATL Odom 13711 Bult: 06-MAR-01 WSD: 20-MAR-01	Tag #: 0127250335 R.O.#: 1836151 Dealer #: 13577 Phone: 940-498-9888 Repaired: 15-AUG-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 28 OPEN CIRCUIT	SWITCH STOP LAMP REPLACED. REPLACED BRAKE LAMP SWITCH RE TEST AND ROAD TEST O.K.
Enter Global ID # Here: <input type="text"/>	Comments A			
Enter Corrective Action Date <input type="text"/>				
Srv#: YF1Z 13480AA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP3U41A245502 2001 TAURUS Asm: ATL Odom 26203 Bult: 24-APR-01 WSD: 00-MAY-01	Tag #: 0127290602 R.O.#: 258185A Dealer #: 00367 Phone: 423-875-2058 Repaired: 15-AUG-02	D02 ENGINE WOULD NOT START X2 CONNECTION POOR/NOT MADE	CK REPAIR WIRING REPLACE SWITCH AND FUSE
Enter Global ID # Here: <input type="text"/>	Comments A			
Enter Corrective Action Date <input type="text"/>				
Srv#: YF1Z 13480AA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP3Z271G248558 2001 TAURUS Asm: CHE Odom 20069 Bult: 16-MAY-01 WSD: 01-JUN-01	Tag #: 0127308842 R.O.#: 41542C Dealer #: 06209 Phone: 608-791-8400 Repaired: 13-AUG-02	A86 OTHER ELECTRICAL ACCESSORY TROUBLES 42 DOES NOT OPERATE PROPERLY	20069 BRAKE LIGHTS ARE STAYING ON/FOUND SWITCH IS STICKING. REPLACED, OKAY.
Enter Global ID # Here: <input type="text"/>	Comments A 4			
Enter Corrective Action Date <input type="text"/>				

14426-000

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Brvcl: 2F1Z 13480AA Engn: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP56S22G208157 2002 TAURUS Assem: CHI Odorn 4890 Built: 05-APR-02 WBD: 14-JUN-02	Tag #: 0127322300 R.O.#: 113743A Dealer #: 02741 Phone: 313-255-3130 Repaired: 14-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	4833 13480, CC#2 BRAKE LIGHT SWITCH STICKING REPLACE SWITCH
Enter Global ID # Here: <input type="text"/>	Comments: <i>NO OIL</i>			
Enter Corrective Action Date <input type="text"/>				
Brvcl: YF1Z 13480AA Engn: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP55241G228265 2001 TAURUS Assem: CHI Odorn 27365 Built: 18-APR-01 WBD: 04-MAY-01	Tag #: 0127323314 R.O.#: 102521C Dealer #: 20238 Phone: 319-448-9001 Repaired: 10-AUG-02	A25 ENGAGEMENT TROUBLES 42 DOES NOT OPERATE PROPERLY	ROADTEST TO VERIFY SPEED CONTROL INOP-SCE TEST-NO CODES-PINPOINT TEST & REPLACE BRAKE LIGHT SWITCH- ROADTEST TO VERIFY SPEED CONTROL OPERATION.
Enter Global ID # Here: <input type="text"/>	Comments: <i>(F)</i>			
Enter Corrective Action Date <input type="text"/>				
Brvcl: YF1Z 13480AA Engn: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP55L1G109326 2001 TAURUS Assem: CHI Odorn 33455 Built: 17-JAN-01 WBD: 02-FEB-01	Tag #: 0127332862 R.O.#: 16381701 Dealer #: 06801 Phone: 989-631-0040 Repaired: 14-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	CC: 42 BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH
Enter Global ID # Here: <input type="text"/>	Comments: <i>(F)</i>			
Enter Corrective Action Date <input type="text"/>				

ROB-001 14487

U.S. WPRC
Box Packing List

9197433
Loc: C17B03

RAC:BAD NV
NEMESIO VILLARUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvck: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP53L42A150898 2002 TAURUS Assn: ATL Odors 18838 Bult: 27-NOV-01 WSD: 14-DEC-01	Tag #: 0127387512 R.O.#: 7728202 Dealer #: 00086 Phone: 301-627-6600 Repaired: 16-AUG-02	L29 OTHER LIGHTING TROUBLES (INCL. LEAKS/CONDENSATION) 28 OPEN CIRCUIT	DIAGNOSE AND REPLACE BRAKE LIGHT SWITCH
Enter Global ID # Here:	Comments <i>NO P.L.</i>			
Enter Corrective Action Date	<i>(F)</i>			
Srvck: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM55801G632188 2001 SABLE Assn: CHI Odors 2010 Bult: 27-MAR-01 WSD: 14-MAY-01	Tag #: 0127378188 R.O.#: 31817801 Dealer #: 10734 Phone: 412-837-4210 Repaired: 15-AUG-02	L26 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	CHECK AND VERIFY CUSTOMER CONCERNS CHECK OASIS FOR ANY TSB FOUND ONE ON IGNITION SWITCH KEY IN IGN CHIME SWITCH PERFORM TEST ON SWITCH WAS FAULTY R&R SWITCH AND REPLACE AND AND PARKING BRAKE SWITCH R&R AND REPLACE WORKING AS DESI
Enter Global ID # Here:	Comments <i>NO P.L.</i>			
Enter Corrective Action Date	<i>A</i>			
Srvck: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP53L22A144355 2002 TAURUS Assn: ATL Odors 14805 Bult: 01-NOV-01 WSD: 15-NOV-01	Tag #: 0127386160 R.O.#: 26297801 Dealer #: 00225 Phone: 205-989-3673 Repaired: 17-AUG-02	A88 WIRING TROUBLES X2 CONNECTION POOR NOT MADE	8713, CK REPL BRK LIGHT SW CC 42
Enter Global ID # Here:	Comments <i>(F)</i>			
Enter Corrective Action Date				

FORM 980-CR01

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM53U11A827018 2001 SABLE Assn: ATL Odom 22670 Buil: 10-FEB-01 WSD: 25-FEB-01	Tag #: 0127418158 R.O.#: 13828201 Dealer #: 11805 Phone: 813-443-4645 Repaired: 19-AUG-02	L29 OTHER LIGHTING TROUBLES (INCL. LEAKS/CONDENSATION) 41 STICKS/BINDS/GRABS	T.J.C. TEST BRAKE LIGH CIRCUIT PINPOINT TEST REPL BRAKE LIGH SWITCH STICK RETEST
Enter Global ID # Here:	Comments <i>A</i>			
Enter Corrective Action Date				
Srvcl: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM53U81G817678 2001 SABLE Assn: CHI Odom 13500 Buil: 13-DEC-00 WSD: 01-FEB-01	Tag #: 0127420884 R.O.#: 11108501 Dealer #: 10577 Phone: Repaired: 30-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	1 REPLACED BRAKE SWITCH 40072... WPI
Enter Global ID # Here:	Comments <i>REPAIR CONTACTS ALL...</i>			
Enter Corrective Action Date				
Srvcl: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP55U81G190223 2001 TAURUS Assn: CHI Odom 19484 Buil: 05-FEB-01 WSD: 08-MAY-01	Tag #: 0127455826 R.O.#: 8442451 Dealer #: 11234 Phone: 973-898-8710 Repaired: 20-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	DOES NOT OPERATE PROPERLY REPLACED BRAKE LAMP SWITCH
Enter Global ID # Here:	Comments <i>LIGHTS OK...</i>			
Enter Corrective Action Date				

PO83-018 14428

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC:BAD NV

26-SEP-02

NEMESIO VILLARUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srv#: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM65SX2A530335 2002 SABLE Asm: ATL Odom 3155 Bult: 21-MAR-02 WSD: 03-APR-02	Tag #: 0127458557 R.O.#: 844551 Dealer #: 10428 Phone: 855-327-3000 Repaired: 20-AUG-02	L26 LIGHTS NOT WORKING- EXTERIOR 41 STICKS/BINDS/GRABS	SWTCH-STOP BRAKE LITE ON LAMP - REPLACE
Enter Global SD # Here: <input type="text"/>	Comments: <i>NO</i>			
Enter Corrective Action Date: <input type="text"/>				
Srv#: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP63251A241821 2001 TAURUS Asm: ATL Odom 27225 Bult: 20-APR-01 WSD: 08-JUN-01	Tag #: 0127465844 R.O.#: 14751801 Dealer #: 06634 Phone: 615-794-6585 Repaired: 12-AUG-02	H20 OTHER BRAKE TROUBLES (INCLUDING AIR BRAKES) 42 DOES NOT OPERATE PROPERLY	REPLACED THE BRAKE LIGHT SWITCH
Enter Global SD # Here: <input type="text"/>	Comments: <i>A</i>			
Enter Corrective Action Date: <input type="text"/>				
Srv#: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP68U31A201729 2001 TAURUS Asm: ATL Odom 12197 Bult: 25-FEB-01 WSD: 26-MAY-01	Tag #: 0127466806 R.O.#: 1143301 Dealer #: 08198 Phone: 314-843-4431 Repaired: 10-AUG-02	N18 UNUSUAL TRANSMISSION NOISE 42 DOES NOT OPERATE PROPERLY	REPLACE BRAKE LIGHT SWITCH REPAIR CONNECTOR
Enter Global SD # Here: <input type="text"/>	Comments: <i>STOP LIGHT NOT WORKING</i>			
Enter Corrective Action Date: <input type="text"/>				

W03-008 1441B

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM83U11A628205 2001 SABLE Asm: ATL Odom 34472 Bull: 03-FEB-01 WSD: 18-FEB-01	Tag #: 0127492835 R.O.#: 3843151 Dealer #: 04735 Phone: 352-796-7371 Repaired: 10-AUG-02	L15 OTHER LOCKMECHANISM TROUBLES 42 DOES NOT OPERATE PROPERLY	SWITCH BOP LAMP - REPLACE SWITCH-STOP
Enter Global SD # Here: <input type="text"/>	Comments <i>NO OIL A</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM5592A626363 2002 SABLE Asm: ATL Odom 4578 Bull: 16-MAR-02 WSD: 26-APR-02	Tag #: 0127493884 R.O.#: 7401851 Dealer #: 10470 Phone: Repaired: 18-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	BCE TEST PINPOINT CODES REPLACED STOP LITE SWITCH AND RETEST OK
Enter Global SD # Here: <input type="text"/>	Comments <i>AC OIL A</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP55S32A216453 2002 TAURUS Asm: ATL Odom 5086 Bull: 08-APR-02 WSD: 23-APR-02	Tag #: 0127494683 R.O.#: 1997488 Dealer #: 03064 Phone: Repaired: 20-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	5086 REPLACE BRAKE LIGHT SWITCH
Enter Global SD # Here: <input type="text"/>	Comments <i>NO OIL A</i>			
Enter Corrective Action Date <input type="text"/>				

11447 898-8308 14411

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP5852G161469 ✓ 2002 TAURUS Asm: CHI Odom 10405 Bult: 16-JAN-02 WSD: 31-JAN-02	Tag #: 0127553708 R.O.#: 4472488 Dealer #: 01785 Phone: 708-589-8000 Repaired: 25-JUL-02	H10 BRAKE-ABS WARNING LIGHT TROUBLES 42 DOES NOT OPERATE PROPERLY	10405 VERIFIED CONCERN RAN PINPOINT TEST USING IADS FOUND BOO SWITCH TO BE INOP PARTS NOT IN HAVE BEEN ORDERED PARTS IN REPLACED BOO SWITCH AND CONNECTOR LET SIT AND VERIFY REPAIR
Enter Global SD # Here: <input type="text"/>	Comments: <i>10/1/02 A</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM50U12G822998 ✓ 2002 SABLE Asm: CHI Odom 10087 Bult: 25-JAN-02 WSD: 08-FEB-02	Tag #: 0127584834 R.O.#: 6278851 Dealer #: 04062 Phone: 407-846-8000 Repaired: 13-AUG-02	H20 OTHER BRAKE TROUBLES (INCLUDING AIR BRAKES) 42 DOES NOT OPERATE PROPERLY	OK-REPL BRAKE LIGHT SWITCH
Enter Global SD # Here: <input type="text"/>	Comments: <i>etc</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP5852G203122 ✓ 2002 TAURUS Asm: CHI Odom 5078 Bult: 14-MAR-02 WSD: 05-JUN-02	Tag #: 0127586711 R.O.#: 68044201 Dealer #: 08036 Phone: 573-634-4444 Repaired: 22-AUG-02	L29 OTHER LIGHTING TROUBLES (INCL LEAKS/CONDENSATION) 46 BURNED OUT	FAILED BRAKE LIGHT SWITCH
Enter Global SD # Here: <input type="text"/>	Comments: <i>10/1/02 A</i>			
Enter Corrective Action Date <input type="text"/>				

FORM-886 14412

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC: BAD NV

26-SEP-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Engrl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1NEFM60U32A806348 2002 SABLE Asm: ATL Odom 23633 Bult: 07-SEP-01 WSD: 23-SEP-01	Tag #: 0127581522 R.O.#: 4408301 Dealer #: 10838 Phone: Repaired: 13-AUG-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	WHITE WIRE-RED TRACER SCHAFFED AND GROUNDED ON STEERING COLUMN. REPAIR WIRE
Enter Global SD # Here: <input type="text"/>	Comments <i>Ne. C.T.L.</i>	<i>F</i>		
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engrl: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP59U32A198985 2002 TAUROS Asm: ATL Odom 1019 Bult: 14-MAR-02 WSD: 12-JUN-02	Tag #: 0127583328 R.O.#: 2604981 Dealer #: 01131 Phone: 338-292-8310 Repaired: 01-AUG-02	C50 OTHER STEERING/HANDLING AND RIDE TROUBLES 41 STICKS/BINDS/GRABS	SWITCH INDP LAMP - REPLACE MILEAGE IS CORRECT SWITCH-STOP THIS
Enter Global SD # Here: <input type="text"/>	Comments <i>Ne. C.T.L.</i>	<i>A</i>		
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engrl: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP59U72A127064 2002 TAUROS Asm: ATL Odom 18263 Bult: 10-OCT-01 WSD: 28-OCT-01	Tag #: 0127593822 R.O.#: 175871A Dealer #: 11838 Phone: 954-820-8010 Repaired: 17-AUG-02	D03 ENGINE DIFFICULT OR SLOW TO START 42 DOES NOT OPERATE PROPERLY	18263 BRAKE LIGHT SWITCH WBTS 42 VERIFY CONCERN BRAKE LIGHT SWITCH STEERING COLUMN TEST REPLACE 15 AMP FUSE RETEST BRAKE SWITCH BAD REPLACE BRAKE LIGHT SWITCH RETEST OK AFTER REPAIR.
Enter Global SD # Here: <input type="text"/>	Comments <i>Ne. C.T.L.</i>	<i>F</i>		
Enter Corrective Action Date <input type="text"/>				

8003-008 14413

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC:BAD NV

26-SEP-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM58S21G018234 2001 SABLE Assem: CHI Odom 35013 Built: 03-JAN-01 WBD: 19-JAN-01	Tag #: 0127801879 R.O.#: 4238201 Dealer #: 01924 Phone: 866-431-3873 Repaired: 22-AUG-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 28 OPEN CIRCUIT	NESC TO INSPECT, TESTED BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH, RETEST
Enter Global SD # Here:	Comments <i>A</i>			
Enter Corrective Action Date				
Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP55U12G221153 2002 TAURUS Assem: CHI Odom 4322 Built: 06-APR-02 WBD: 10-APR-02	Tag #: 0127835888 R.O.#: 348970A Dealer #: 01785 Phone: 708-589-8000 Repaired: 19-AUG-02	H19 BRAKE-ABS WARNING LIGHT TROUBLES 42 DOES NOT OPERATE PROPERLY	4322 VERIFIED CONCERN - CHECKED BRAKE LIGHT SWITCH - SWITCH IS SHORTED - NEEDS BRAKE LIGHT SWITCH - ORDERED PART - REPLACED BRAKE LIGHT SWITCH - RECHECKED - BRAKE LIGHTS WORK PROPERLY NOW
Enter Global SD # Here:	Comments <i>SOME ... SWITCH ... A</i>			
Enter Corrective Action Date				
Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP56812A201817 2002 TAURUS Assem: ATL Odom 3724 Built: 22-MAR-02 WBD: 04-MAY-02	Tag #: 0127840182 R.O.#: 9106651 Dealer #: 00034 Phone: 410-285-0200 Repaired: 21-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	INOPERATIVE LAMP - REPLACE SWITCH-STOP
Enter Global SD # Here:	Comments <i>NO CIL A</i>			
Enter Corrective Action Date				

FD-303-808 1414

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Brvcl: 2F1Z 1348DAA Engfr: 2F1T1348DAA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP53U72A268664 2002 TAURUS Asm: ATL Odom 1181 Bult: 21-JUN-02 WSD: 09-JUL-02	Tag #: 0127679443 R.O.#: 114063D Dealer #: 02741 Phone: 313-255-3130 Repaired: 20-AUG-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	1189 CK OUT REPL SWITCH 13480 42
Enter Global ID # Here:	Comments <i>NO CK</i>			
Enter Corrective Action Date				
Brvcl: 2F1Z 1348DAA Engfr: 2F1T1348DAA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP5872A212280 2002 TAURUS Asm: ATL Odom 8540 Bult: 11-APR-02 WSD: 30-APR-02	Tag #: 012832957D R.O.#: 303888A Dealer #: 00088 Phone: 413-788-3800 Repaired: 02-AUG-02	L26 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	8541 WARR REPLACE BRAKE LIGHT SWITCH
Enter Global ID # Here:	Comments <i>NO CK</i>			
Enter Corrective Action Date				
Brvcl: 2F1Z 1348DAA Engfr: 2F1T1348DAA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP58S32A108611 2002 TAURUS Asm: ATL Odom 11264 Bult: 16-JAN-02 WSD: 30-JAN-02	Tag #: 0128448731 R.O.#: 147737B Dealer #: 00801 Phone: 716-640-6701 Repaired: 30-AUG-02	L26 LIGHTS NOT WORKING- EXTERIOR 46 BURNED OUT	11264 SHORTED BRAKE LAMP SWITCH CHECK OUT DIAGNOSE & REPLACED BRAKE LAMP SWITCH RECHECK- OK
Enter Global ID # Here:	Comments <i>NO CK</i>			
Enter Corrective Action Date				

FORM 900 10415

U.S. WPRC
Box Packing List

Box: 9197433
Loc: C17B03

RAC:BAD NV

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480BA Engr: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEHM58681A818930 2001 SABLE Asm: ATL Odom 15072 Built: 01-DEC-00 WSD: 14-JUN-01	Tag #: 012848385B R.O.#: 5525161 Dealer #: 01249 Phone: 610-789-8300 Repaired: 03-SEP-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	BINDING SWITCH-STOP LAMP - REPLACE REPAIR WIRE REPLACE FUSE REPAIR DAMAGE TO WIRE INSTALL ALL CONNECTORS
Enter Global ID # Here: <input type="text"/>	Comments	A		
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engr: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP62UR2A235778 2002 TAURUS Asm: ATL Odom 108 Built: 14-MAY-02 WSD: 20-MAY-02	Tag #: 0128723129 R.O.#: 8572801 Dealer #: 01288 Phone: 941-643-3873 Repaired: 08-SEP-02	L29 OTHER LIGHTING TROUBLES (INCL. LEAKS/CONDENSATION) 28 OPEN CIRCUIT	VERIFY CONCERN, PINPOINT TEST AND ORDER IN AND REPLACE BRAKE LAMP SWITCH, RETEST OK
Enter Global ID # Here: <input type="text"/>	Comments	No c/l F		
Enter Corrective Action Date <input type="text"/>				

Listed Parts: 59
Unidentified Parts: 0
Total Parts: 59

RO33-008 14418

U.S. WPRC
Box Packing List

Box: 9194017
Loc: C

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

08-OCT-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srv#: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP53U82G203834 2002 TAURUS Asm CHI Odom 99 Built: 07-MAR-02 WSD: 27-JUL-02	Tag #: 0128271409 R.O.#: 5859851 Dealer #: 20303 Phone: 602-254-1611 Repaired: 29-JUL-02	L29 OTHER LIGHTING TROUBLES (INCL LEAKS/CONDENSATION) 42 DOES NOT OPERATE PROPERLY	TEST STOP LAMPS AND BULBS PINPOINT CONTACTS IN STOP LAMP SWITCH ACTIVATING WITHOUT PUSHING PEDAL REPLACE ERRATIC STOP LAMP SWITCH OPERATION NORMAL

Enter Global SD # Here:

Comments

A

Enter Corrective Action Dat

Srv#: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP55842G219072 2002 TAURUS Asm CHI Odom 4878 Built: 16-APR-02 WSD: 29-APR-02	Tag #: 0127048443 R.O.#: 5728751 Dealer #: 01810 Phone: 708-345-1576 Repaired: 13-AUG-02	L29 OTHER LIGHTING TROUBLES (INCL LEAKS/CONDENSATION) 42 DOES NOT OPERATE PROPERLY	SWITCH-STOP LAMP - REPLACE
---	---	--	--	----------------------------

Enter Global SD # Here:

Comments

A

Enter Corrective Action Dat

Srv#: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP56S92A208804 2002 TAURUS Asm ATL Odom 3287 Built: 21-MAR-02 WSD: 25-APR-02	Tag #: 0127204308 R.O.#: 11280201 Dealer #: Phone: Repaired: 14-AUG-02	L29	0135 INSPECT AND CONFIRM BRAKE LIGHTS STAY ON PINPOINT TO BRAKE SWITCH HARNESS SHORTED CAUSING FUSES TO BLOW AND DAMAGE SWITCH HARNESS NEC TO R&R HARNESS SWITCH AND FUSE REASSEMBL RECHECK OK.
---	---	--	-----	---

Enter Global SD # Here:

Comments

A

Enter Corrective Action Dat

KODJ-088 1A417

U.S. WPRC
Box Packing List

Box: 9194017
Loc: C

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

08-OCT-02

Part Information

Srvcl#: YF1Z 1348DAA
Engr#: YF1T13480BA
Part SWITCH ASY -
Name: STOP LIGHT

Vehicle Information

VIN: 1MEFM55S82A625473
2002 SABLE
Asm ATL Odom 3546
Built: 18-MAR-02 WSD: 18-JUN-02

Repair Information

Tag #: 0127299403
R.O.#: 3057001
Dealer #: 10772
Phone: 440-851-0800
Repaired: 15-AUG-02

Concern Information

L29 OTHER LIGHTING
TROUBLES (INCL.
LEAKS/CONDENSATION)
42 DOES NOT OPERATE
PROPERLY

Tech Comments

INSPECT AND REPLACE BRAKE LITE
SWITCH RETEST OK

Enter Global SD # Here:

Comments A

Enter Corrective Action Dat

Srvcl#: YF1Z 1348DAA
Engr#: YF1T13480BA
Part SWITCH ASY -
Name: STOP LIGHT

VIN: 1FAHP58SE2A180812
2002 TAURUS
Asm ATL Odom 13091
Built: 14-FEB-02 WSD: 28-MAR-02

Tag #: 0127368668
R.O.#: 284808A
Dealer #: 08932
Phone: 803-825-2540
Repaired: 12-AUG-02

H19 BRAKE-ABS WARNING
LIGHT TROUBLES
42 DOES NOT OPERATE
PROPERLY

DIAG CONCERN REPLACE BRAKE
SWITCH STICKING RETEST OK F

Enter Global SD # Here:

Comments A

Enter Corrective Action Dat

Srvcl#: 2F1Z 1348DAA
Engr#: 2F1T13480AA
Part SWITCH ASY -
Name: STOP LIGHT

VIN: 1FAPP55S32A178868
2002 TAURUS
Asm ATL Odom 1738
Built: 02-FEB-02 WSD: 13-FEB-02

Tag #: 0127413238
R.O.#: 28825301
Dealer #: 05695
Phone: 502-460-8550
Repaired: 16-AUG-02

L26 LIGHTS NOT WORKING-
INTERIOR
42 DOES NOT OPERATE
PROPERLY

TEST WAGS REPLACED BRAKE SWITCH

Enter Global SD # Here:

Comments A

Enter Corrective Action Dat

RO63-008 14418

U.S. WPRC
Box Packing List

Box: 9194017
Loc: C

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

08-OCT-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvc#: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN:1FAPP52U11A197443 2001 TAURUS Assem ATL Odom 19717 Built: 26-FEB-01 WSD: 12-APR-01	Tag #: 0127508193 R.O.#: 9112901 Dealer #: 00461 Phone: 813-752-4171 Repaired: 20-AUG-02	P09 OTHER TRANSMISSION TROUBLES 42 DOES NOT OPERATE PROPERLY	VERIFIED CONCERN, BRAKE LIGHTS ARE NOT WORKING, FOUND OPEN IN SWITCH NOT ALLOWING TO GET OUT OF PARK. REPLACED BRAKELIGHT SWITCH ON CAR AND VERIFIED CONCERN

Enter Global ID # Here:

Comments

A

Enter Corrective Action Dat

Srvc#: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN:1MEFM55S72A835475 2002 SABLE Assem ATL Odom 3154 Built: 18-APR-02 WSD: 10-MAY-02	Tag #: 0127582496 R.O.#: 11346801 Dealer #: 10831 Phone: 313-885-4000 Repaired: 18-AUG-02	L28 OTHER LIGHTING TROUBLES (INCL. LEAKS/CONDENSATION) 46 BURNED OUT	13480 SHORTED INSPECT - PINPOINT - REPLACE BRAKE LAMP SWITCH - RETEST OK
--	---	---	---	--

Enter Global ID # Here:

Comments

A

Enter Corrective Action Dat

Srvc#: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN:1FAPP65U72A151290 2002 TAURUS Assem ATL Odom 5566 Built: 10-DEC-01 WSD: 27-APR-02	Tag #: 0128218782 R.O.#: 552384A Dealer #: 04820 Phone: 854-872-7200 Repaired: 28-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 46 BURNED OUT	5566 42 W 745 VERIFIED CONCERN FOUND WIRES BURNED TO BRAKE LIGHT SWITCH AND SWITCH BAD. REPAIR WIRING GOING TO BRAKE SWITCH AND REPLACE SWITCH RETEST OK AT THIS TIME QUALITY INSPECTED BY 745 MALES OUT 5566 Y
--	--	--	---	---

Enter Global ID # Here:

Comments

F

Enter Corrective Action Dat

1000-000 14418

U.S. WPRC
Bo...cking List

Box: 9194017
Loc: C

RAC: BAD NV
NEMESIO LARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

08-OCT-02

Part Information
Srvcl: 2F1Z 13480AA
Engr#: 2F1T13480AA
Part SWITCH ASY -
Name: STOP LIGHT

Vehicle Information
VIN: 1FAFP55S72A212023
2002 TAURUS
Assem ATL Odom 4850
Built: 04-APR-02 WSD: 30-MAY-02

Repair Information
Tag #: 0128225807
R.O.#: 228478C
Dealer #: 08294
Phone:
Repaired: 28-AUG-02

Concern Information
H20 OTHER BRAKE TROUBLES
(INCLUDING AIR BRAKES)
42 DOES NOT OPERATE
PROPERLY

Tech Comments
CONFIRMED COMPLAINT. REPLACED
BRAKE LIGHT SWITCH. RETEST
OPERATION OK.

Enter Global ID # Here:

Comments

A

Enter Corrective Action Dat

Srvcl: 2F1Z 13480AA
Engr#: 2F1T13480AA
Part SWITCH ASY -
Name: STOP LIGHT

VIN: 1FAFP53U32G177889
2002 TAURUS
Assem CH Odom 1289
Built: 11-JAN-02 WSD: 25-MAY-02

Tag #: 0128458231
R.O.#: 79823A
Dealer #: 02284
Phone: 440-871-8801
Repaired: 03-SEP-02

H20 OTHER BRAKE TROUBLES
(INCLUDING AIR BRAKES)
42 DOES NOT OPERATE
PROPERLY

CHECK OPERATION BDO SWITCH
FAULTY REPLACE SWITCH OKAY

Enter Global ID # Here:

Comments

A

Enter Corrective Action Dat

Srvcl: 2F1Z 13480AA
Engr#: 2F1T13480AA
Part SWITCH ASY -
Name: STOP LIGHT

VIN: 1ME1M55882A628283
2002 SABLE
Assem ATL Odom 3301
Built: 05-MAR-02 WSD: 18-APR-02

Tag #: 0128459880
R.O.#: 850851
Dealer #: 10849
Phone:
Repaired: 03-SEP-02

L25 LIGHTS NOT WORKING-
EXTERIOR
42 DOES NOT OPERATE
PROPERLY

SWITCH STICKING BODY -
CHASSIS - ELECTRICAL (BCE) - TEST

Enter Global ID # Here:

Comments

A

Enter Corrective Action Dat

1003-935 14428

Originator : WPRC

Page 4 of 8

Date Issued : 10/08/02
Date Revised : 07/10/98

Date Revised : 07/10/98

U.S. WPRC
Box Packing List

Box: 9194017
Loc: C

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

08-OCT-02

Part Information

Srvcl#: 2F1Z 13480AA
Engr#: 2F1T13480AA
Part SWITCH ASY -
Name: STOP LIGHT

Vehicle Information

VIN: 1FAPP53U02A205548
2002 TAURUS
Assm ATL Odom 5760
Bult: 13-MAR-02 WSD: 13-MAR-02

Repair Information

Tag #: 0128821813
R.O.#: 15282801
Dealer #: 00733
Phone: 814-723-5400
Repaired: 05-SEP-02

Concern Information

H19 BRAKE-ABS WARNING
LIGHT TROUBLES

48 BURNED OUT

Tech Comments

CHECKED AND FOUND STOP LIGHT
SWITCH SHORTED, REPLACED SWITCH
L27 13480 48

Enter Global ID # Here:

Comments **A**

Enter Corrective Action Dat

Srvcl#: 2F1Z 13480AA
Engr#: 2F1T13480AA
Part SWITCH ASY -
Name: STOP LIGHT

VIN: 1FAPP55U72A145800
2002 TAURUS
Assm ATL Odom 6678
Bult: 21-NOV-01 WSD: 11-APR-02

Tag #: D128823482
R.O.#: 241772A
Dealer #: 03000
Phone: 248-333-3000
Repaired: 28-AUG-02

L26 LIGHTS NOT WORKING-
EXTERIOR

42 DOES NOT OPERATE
PROPERLY

6880 WARR...C.C...AZ. PERFORMED
PINPOINT TESTS, REPLACED BRAKE
LAMP SWITCH, INOP. RETEST AFTER
REPAIRS...O.K. AT THIS

Enter Global ID # Here:

Comments **A**

Enter Corrective Action Dat

Srvcl#: 2F1Z 13480AA
Engr#: 2F1T13480AA
Part SWITCH ASY -
Name: STOP LIGHT

VIN: 1FAPP55U42A117372
2002 TAURUS
Assm ATL Odom 14001
Bult: 19-OCT-01 WSD: 30-OCT-01

Tag #: 0128835691
R.O.#: 148881C
Dealer #: 00801
Phone: 718-849-5701
Repaired: 06-SEP-02

L28 OTHER LIGHTING
TROUBLES (INCL.
LEAKS/CONDENSATION)

42 DOES NOT OPERATE
PROPERLY

14001 VERIFIED CONCERN FOUND
BRAKE LIGHTS ALWAYS ON FOUND
BRAKE POSITION SWITCH SHORTED.
REPLACED SWITCH AND RECHECK ALL
OK

Enter Global ID # Here:

Comments **A**

Enter Corrective Action Dat

ROSC-008 14AZZ

U.S. WPRC
Box Packing List

Box: 9194017
Loc: C

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

08-OCT-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP59UX2A110669 2002 TAURUS Asm ATL Odom 12823 Built: 27-AUG-01 WSD: 05-NOV-01	Tag #: 012882863 R.O.#: 5301401 Dealer #: 03086 Phone: 863-422-1167 Repaired: 05-SEP-02	L26 LIGHTS NOT WORKING- EXTERIOR 28 OPEN CIRCUIT	BRAKE STOP LAMP SWITCH SHORTED VERIFY CONCERN AND REPLACE BRAKE STOP LAMP SWITCH
Enter Global SD # Here:				
Comments A				
Enter Corrective Action Dat				

Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP55S22G187279 2002 TAURUS Asm CHI Odom 9478 Built: 20-FEB-02 WSD: 09-MAR-02	Tag #: 0128826277 R.O.#: 76366A Dealer #: 02912 Phone: Repaired: 11-SEP-02	L26 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	CHECKED BRAKE LIGHT ON. PINPOINT TEST FOUND BAD SWITCH. REPLACED BRAKE LAMP SWITCH AND RETEST OK.
Enter Global SD # Here:				
Comments A				
Enter Corrective Action Dat				

Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP53U92G215300 2002 TAURUS Asm CHI Odom 2021 Built: 08-APR-02 WSD: 24-APR-02	Tag #: 0128900623 R.O.#: 204480A Dealer #: 02750 Phone: 900-358-2778 Repaired: 28-AUG-02	L26 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	2021 GM42 WARR, 3-36, BCE DIAG AND INSPECT, WIRING OK, REPALCE BAD BRAKE LIGHT SWITCH AND RE CK
Enter Global SD # Here:				
Comments A				
Enter Corrective Action Dat				

NOES-008 14423

U.S. WPRC
Box Packing List

Box: 9194017
Loc: C

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

13090 COMMERCE DR. N
DEARBORN MI 48120-0000

08-OCT-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP56S82A212901 2002 TAURUS Assem ATL Odom 4379 Built: 12-APR-02 WSD: 16-JUL-02	Tag #: 0129155792 R.O.#: 7494701 Dealer #: 02755 Phone: 248-544-8585 Repaired: 12-SEP-02	L26 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY 42 INTERNAL SHORT BRAKE LIGHT STUCK ON, PERFORM PIN POINT TEST. FOUND DEFT BRAKE LAMP SWITCH. REPL SWITCH AND RECHECK OP
Enter Global SD # Here:	Comments A			
Enter Corrective Action Dtl				

Srvcl: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP56291A254252 2001 TAURUS Assem ATL Odom 10301 Built: 07-MAY-01 WSD: 23-MAY-01	Tag #: 0128257254 R.O.#: 232028A Dealer #: 20839 Phone: 732-284-1840 Repaired: 18-SEP-02	A86 WIRING TROUBLES 26 OPEN CIRCUIT	10301 CHECK FOR NOT COMING OUT OF PARK FOUND STOP LIGHT SWITCH BAD AND WIRE HARNESS BROKEN REPLACE SWITCH AND HARNESS
Enter Global SD # Here:	Comments A			
Enter Corrective Action Dtl				

Listed Parts:	23
Unidentified Parts:	0
Total Parts:	23

MOB-000 14424

Taurus/Sable Switch

MATT McPARLANE

Model Year	Build Date	VIN	ODO	Switch Deflection	Switch Condition/Comments
02	11/01	1MEFM50472G 610324	15842	0.002	GAP 0.028
	07/01	1MEFM53471G 648212	21568	0.002	0.083
	09/00	1FAHP56S 91G 106286	49330	0	N/A
	08/00	1FAFP534 01G 102964	25036	0	
	09/00	1FAFP55U 71G 106331	16003	0.002	OIL ON OUTSIDE OF SWITCH
	07/00	1MEFM53467G 643187	23012	0	MAY HAVE INCORRECT PEDAL ASSY SATURATED W/OIL - BEGINNING OF MOTION Failure Replaced Switch.
	07/00	1MEFM5556Y6L46 425	30380	0.001	SAME AS ABOVE EXCEPT WITH
	06/00	1MEFM5553Y6 640582	29793	0	RESPECT TO PEDAL ASSY. OIL ON OUTSIDE
	02/02	1MEFM50472A 626179	11951	0.001	CLEAN SW
	11/01	1MEFM55512G 610746	21261	0	
00	10/00	1MEFM558XYG 628588	32451	0.001	BROKEN SW WIRES - SW IS BURNT
	08/00	1MEFM5554YG 646830	20135	0	CLOSED - REPLACED SWITCH
	07/00	1MEFM5558YG 644109	33927	0.000	REPLACED SWITCH - WLT WLT WALL
00	09/00	1MEFM55561G 606067	6132	0.001	PEDAL SPRING TOO CLOSE - CHECK FOLL REPLACED SW - FULL OK OIL
	03/00	1MEFM5554YG 625833	29693	0.001 +	SWITCH BURNED - REPLACED

K003-008 14428

veh_check
rvllan

2000-2001 TAURUS/SABLE BRAKE LIGHT SWITCH AUDIT

Model Year	Build Date	VIN	ODO	PEDAL Fbcd/Adj	BRAKE LIGHT SWITCH CONDITION	SOURCE
2001		1FAPP56U81G274889	18,516	F	No oil	Manheim
2001	Aug-01	1FAPP56U11G276786	22,733	F	No oil	Manheim
2001	Aug-01	1FAPP56U01G281102	21,804	F	No oil	Manheim
	Jul-01	1FAPP56U81G274852	25,340	F	No oil	Manheim
2001	Nov-01	1FAPP56U82G154808	28,883	F	No oil	Manheim
	Aug-01	1FAPP55U01G277437	17,078	F	No oil	Manheim
	Aug-01	1FAPP55U81G281414	24,209	F	No oil	Manheim
	Aug-01	1FAPP55U61G283686	21,521	F	No oil	Manheim
	Jul-01	1FAPP55U71G278833	23,773	F	No oil	Manheim
	Jul-01	1FAPP55U51G274842	24,540	F	No oil	Manheim
	Apr-00	1FAPP58S4YG221639	38,882	A	Oil on switch and mount pin. Removed switch for analysis. Photo #2	Manheim
	Jul-01	1MEFM53U11G648180	19,819	A	No oil -switch OK	Manheim
	Apr-00	1MEFM55S7YG827788	22,071	A	Oil on switch and mount pin. Photo #3 Asked to Hold for further investigation.	Manheim
	Apr-00	1MEFM55S7YG831081	14,028	A	Switch is full of oil and bracket has oil. SW build date 0006	Manheim
	Jun-00	1FAPP58S8YG258641	30,085	A	Some oil on switch, spring clean.	Manheim
	Aug-00	1FAPP58SX1G100820	23,889	A	Oil on switch, spring clean. Pedal wet.	Manheim
	Oct-00	1FAPP55U41G141764	29,376	A	No oil on switch. Spring dry.	Manheim
	Mar-00	1FAPP58S6YG188516	32,601	A	Oil on switch and grease is oozing out from drive cable. Request hold for review.	Manheim
	May-00	1FAPP5GS8YG246301	23,801	A	Some oil on switch, grease out of cable. Photo #4 Switch date 1D28.	Manheim
	May-00	1FAPP58SX1YG242381	17,555	A	Oil present on switch. Grease out of cable. Switch date 0L28.	Manheim
	Oct-00	1FAPP55U41G144390	19,325	A	Switch is dry. No oil on pedal.	Manheim
	Dec-99	1MEFM55S7YG808069	26,057	A	Some oil on switch. Spring covered with grease.	Manheim
	Dec-99	1MEFM55S1YG808338	23,832	A	Oil on switch, Spring has grease.	Manheim
	Dec-99	1MEFM55S7YG642383	21,887	A	Oil on switch, Spring has grease.	Manheim
	May-00	1FAPP58S5YG238528	25,728	A	Oil on switch. Minimal oil on spring.	Manheim

POSS-988 14428

brake_switch_audit
rvillar

Date Issued: 07/23/02
Revised: 09/05/2002

2000-2001 TAURUS/SABLE BRAKE LIGHT SWITCH AUDIT

Model Year	Build Date	VIN	ODO	PEDAL Fixed/Adj	BRAKE LIGHT SWITCH CONDITION	SOURCE
	Jun-00	1MEFM55S3YG637293	21,771	A	Oil on switch, some on spring. Adj. Cable OK.	Manheim
	May-00	1FAFP56S9YG238434	34,940	A	Oil on switch, heavy grease on connecting cable.	Manheim
	May-00	1MEFM55S3YG638127	17,973	A	Oil on switch	Manheim
	Jun-00	1MEFM55S0YG638501	19,989	A	Oil on switch	Manheim
	Jun-00	1MEFM55S0YG638500	23,693	A	Oil on switch	Manheim
	Jun-01	1FAFP56S8X1G288150	12,580	A	Completely dry.	Manheim
	Feb-00	1FAFP56S9YG182428	23,408	A	Oil on switch. Photo #6	Manheim
	Jun-00	1MEFM55S1YG642380	25,498	A	Oil on switch	Manheim
	Jun-00	1MEFM55S1YG641195	36,940	A	Oil on switch, dry elsewhere	Manheim
	Jun-00	1MEFM55S1YG638474	30,348	A	Oil on switch, dry elsewhere. Switch has signs of heating. Photo #6.	Manheim
	Apr-00	1FAFP56S0YG210819	23,281	A	Oil on switch and grease on cable. Replaced switch. Switch build date 0L06.	Manheim
	Apr-00	1FAFP56S5YG221988	19,280	A	Switch is slight wet. Sing column boot sprayed with foreign substance and also on switch. Cable connection oozing with grease. Photo #7	Manheim
	May-00	1FAFP56S4YG238536	18,811	A	Oil on switch. Some oil on spring.	Manheim
	Jun-00	1FAFP56S8YG261283	25,108	A	Light oil on switch. Light grease on spring.	Manheim
	Jun-00	1MEFM55S0YG640734	13,738	A	Very light oil on switch. Mod grease on spring. Tight wires.	Manheim
	Aug-00	1MEFM55S21G802105	18,824	A	Switch and spring assy are completely dry. 1/8" gap between switch and mount.	Manheim
2000	Apr-00	1MEFM56SXYA630290	3,559	A	Has oil	WPRC
2001	Aug-00	1FAFP56S71A100814	18,987	A	No oil	WPRC
2000	Feb-00	1FAFP56S7YA182235	27,808	A	No oil	WPRC
2000	Mar-00	1MEFM56S1YA622282	35,998	A	No oil	WPRC
2000	Mar-00	1MEFM56S6YA622712	28,474	A	Has oil	WPRC
2000	Mar-00	1MEFM56S8YG622673	35,543	A	No oil	WPRC
2000	Mar-00	1MEFM56S4YA625406	13,674	A	No oil	WPRC
2000	Jun-00	1FAFP56S1YA276188	25,845	F	No oil	WPRC
2002	Mar-02	1FAHP56S82A203452	2,148	A	No Oil	WPRC
2002	Oct-01	1MEFM56S02G6807937	8,041	A	No Oil	WPRC
2002	Apr-02	1FAFP56S02A214162	13,039	A	No Oil	WPRC

RM5-200 14430

2000-2001 TAURUS/SABLE BRAKE LIGHT SWITCH AUDIT

Model Year	Build Date	VIN	ODO	PEDAL Fixed/Adj	BRAKE LIGHT SWITCH CONDITION	SOURCE
2002	Jun-02	1FAHP58S22A258051	648	A	No Oil	WPRC
2002	Mar-02	1FAFP58S02A188831	8,791	A	No Oil	WPRC
2002	Apr-02	1FAFP55U82A213844	4,183	A	No Oil	WPRC
2002	Mar-02	1FAHP58S02A206488	5,490	A	No Oil	WPRC
2002	Mar-02	1FAHP58S62A199943	5,114	A	No Oil	WPRC
2002	Jul-02	1FAFP55UX2G283723	5	F	No Oil	WPRC
2002	Apr-02	1FAHP55SX2A208758	2,897	A	No Oil	WPRC
2002	Mar-02	1FAFP53U82A184280	12294	A	No Oil	WPRC
2002	Mar-02	1FAFP53U82A205411	7443	F	No Oil	WPRC
2002	Dec-02	1FAFP53U02A187489	8	F	No Oil	WPRC
2002	Apr-02	1FAFP55S42A207233	2110	A	No Oil	WPRC
2002	Apr-02	1FAFP53U12A218348	8500	A	No Oil	WPRC
2002	Mar-02	1FAFP53U82G203801	9900	A	No Oil	WPRC
2002	Jan-02	1FAFP53U82A170778	3230	A	No Oil	WPRC
2002	Apr-02	1FAHP56U82G232318	9474	F	No Oil	WPRC
2002	Apr-02	1FAFP53UX2G216407	4101	A	No Oil	WPRC
2002	Mar-02	1FAFP55UX2G206891	5489	A	No Oil	WPRC
2002	Mar-02	1FAHP58S72A199892	1497	A	Slight oil film	WPRC
2002	Jan-02	1FAFP55U72G182195	8948	A	No Oil	WPRC

ROSC-005 14431

brake_switch_audit
mwillarr

U.S. WPRC
Box Packing List

Box: 9197362
Loc: C17B03

RAC: BAD NV

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

05-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srv#: YF1Z 13480BA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFMERSKYA830290 2000 SABLE Assoc: ATL Odom 3650 Built: 06-APR-00 WSD: 21-MAY-00	Tag #: 0124725486 R.O.#: 7088451 Dealer #: 10083 Phone: 713-629-8600 Repaired: 11-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	STOP LAMP INOP DIAG OF BODY CHASSIS AND ELECTRICAL. REPLACE BRAKE LAMP SWITCH. RETESTED SYSTEM
Enter Global SD # Here:	Comments			
Enter Corrective Action Date				
Srv#: YF1Z 13480AA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP56671A100814 2001 TAURUS Assoc: ATL Odom 18387 Built: 10-AUG-00 WSD: 14-NOV-00	Tag #: 0124728680 R.O.#: 6317351 Dealer #: 00247 Phone: 770-490-8545 Repaired: 10-JUL-02	L25 LIGHTS NOT WORKING- INTERIOR 42 DOES NOT OPERATE PROPERLY	C -REPLACE SWITCH-STOP LAMP
Enter Global SD # Here:	Comments			
Enter Corrective Action Date				
Srv#: YF1Z 13480BA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP58E7YA182235 2000 TAURUS Assoc: ATL Odom 27808 Built: 23-FEB-00 WSD: 07-JUL-00	Tag #: 0124739453 R.O.#: 301836A Dealer #: 00088 Phone: 410-768-3000 Repaired: 10-JUL-02	L25 LIGHTS NOT WORKING- EXTERIOR 69 FROZEN/SEIZED/BINDING	27808 BRAKES STAY ON WARR REPLACED BRAKE LIGHT SWITCH
Enter Global SD # Here:	Comments			
Enter Corrective Action Date				

RO83-086 14432

U.S. WPRC
Box Packing List

Box: 9197362
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

05-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Engl: YFTT13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM55S1YA622282 2000 SABLE Asm: ATL Odom 35885 Bult: 01-MAR-00 WSD: 20-APR-00	Tag #: 0124738702 R.O.S: 14851301 Dealer #: Phone: Repaired: 10-JUL-02	L28	CHECK TEST REPLACE BRAKE LIGHT SWITCH AND REPAIR ELECTRICAL CONNECTOR TO SWITCH-RETEST OPERATION
Enter Global SD # Here: <input type="text"/>	Comments <i>NO OIL</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Engl: YFTT13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM55S8YA822712 2000 SABLE Asm: ATL Odom 28474 Bult: 03-MAR-00 WSD: 16-MAY-00	Tag #: 0124743248 R.O.S: 8276302 Dealer #: 02406 Phone: 972-841-1334 Repaired: 10-JUL-02	A85 OTHER ELECTRICAL ACCESSORY TROUBLES 28 OPEN CIRCUIT	SWITCH OPEN CC28 MO28474 BCE TEST SWITCH AND PIN POINT TEST AND FOUND SWITCH AND TERMINAL OPEN REPLACED SWITCH ASSY AND REPAIRED WIRING
Enter Global SD # Here: <input type="text"/>	Comments <i>OIL TRACE</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480BA Engl: YFTT13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM88S8YG822673 2000 SABLE Asm: CH Odom 36543 Bult: 09-MAR-00 WSD: 10-JUN-00	Tag #: 0124822512 R.O.S: 33806701 Dealer #: 10818 Phone: 847-387-1700 Repaired: 13-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 28 OPEN CIRCUIT	INSPECT AND REPL BRK LT SWITCH, WIRING AND CONNECTOR-OK
Enter Global SD # Here: <input type="text"/>	Comments <i>OK NO OIL</i>			
Enter Corrective Action Date <input type="text"/>				

FORM 998 10-93

U.S. WPRC
Box Packing List

Box: 9197362
Loc: C17B03

RAC: BAD NV
NIBMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

05-SEP-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Brvcl: YF1Z 13480BA Engcl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM5084YA625408 2000 GABLE Asm: ATL Odom 13574 Bult: 14-MAR-00 WSD: 05-APR-00	Tag #: 0124949836 R.O.#: 51083A Dealer #: 12711 Phone: 925-882-3150 Repaired: 11-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 41 STICKS/SHINDS/GRABS	TECH REPLACED THE BRAKE LAMP SWITCH AS NEEDED TO REPAIR, RD TEST OK GEAR SELECTOR OPWERASTES OK
Enter Global SD # Here: <input type="text"/>	Comments <u>NO OIL</u>			
Enter Corrective Action Date: <input type="text"/>				
Brvcl: YF1Z 13480BA Engcl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP58S1YA270168 2000 TAURUS Asm: ATL Odom 28845 Bult: 30-JUN-00 WSD: 17-AUG-00	Tag #: 0124957262 R.O.#: 10170502 Dealer #: 03010 Phone: 718-417-8083 Repaired: 11-JUL-02	H10 BRAKE-ABS WARNING LIGHT TROUBLES 42 DOES NOT OPERATE PROPERLY	VERIFY CONCERN FOUND BRAKES SWITCH INOP REMOVE AND REPLACE BRAKES SWITCH RECHECK OPERATION
Enter Global SD # Here: <input type="text"/>	Comments <u>SLIGHT TRACE OF OIL</u>			
Enter Corrective Action Date: <input type="text"/>				
Brvcl: 2F1Z 13480AA Engcl: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP53U02A137480 2002 TAURUS Asm: ATL Odom 8 Bult: 07-DEC-01 WSD: 01-JAN-01	Tag #: 0128257715 R.O.#: 25087401 Dealer #: 00128 Phone: 301-400-2360 Repaired: 15-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 45 BURNED OUT	WIRE BROKEN ON BRAKE LIGHT SWITCH CONNECTOR AND OPEN/SHORT IN BRAKE LIGHT SWITCH, R/R BRAKE LIGHT SWITCH AND R/R CONNECTOR
Enter Global SD # Here: <input type="text"/>	Comments <u>NO OIL</u> <u>FIXED PEDAL</u>			
Enter Corrective Action Date: <input type="text"/>				

7003-085 14434

U.S. WPRC
Box Packing List

Box: 9197362
Loc: C17B03

RAC:BAD NV

05-SEP-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: 2F1Z 13480AA Engn: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP95842A207233 2002 TAURUS Assoc: ATL Odom 2110 Buil: 13-APR-02 WSD: 17-MAY-02	Tag #: 0128291678 R.O.#: 1808168 Dealer #: 00605 Phone: 338-724-5821 Repaired: 29-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	2178 REPLACED BRAKE LIGHT SWITCH. CC 42.
Enter Global ID # Here: <input type="text"/>	Comments <i>No oil</i> <i>Adj Pedal</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engn: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP93U12A215345 2002 TAURUS Assoc: ATL Odom 3500 Buil: 04-APR-02 WSD: 04-APR-02	Tag #: 0128380236 R.O.#: 15182101 Dealer #: 00733 Phone: 814-723-5400 Repaired: 01-AUG-02	L28 LIGHTS NOT WORKING- EXTERIOR 28 OPEN CIRCUIT	CHECKED AND FOUND STOP LIGHT SWITCH BAD REPLACED SWITCH L28 13480 28
Enter Global ID # Here: <input type="text"/>	Comments <i>No oil</i> <i>Adj Pedal</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engn: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP93U62G203801 2002 TAURUS Assoc: CHI Odom 8900 Buil: 07-MAR-02 WSD: 22-APR-02	Tag #: 0128430708 R.O.#: 80479802 Dealer #: 02988 Phone: Repaired: 06-AUG-02	A85 OTHER ELECTRICAL ACCESSORY TROUBLES 42 DOES NOT OPERATE PROPERLY	BRAKE LIGHT SWITCH SHUTTING OF CRUISE. CHECK CRUISE SYSTEM,PIDS TEST BOD SWITCH,REPLACE SWITCH & ROAD TEST.QCDC
Enter Global ID # Here: <input type="text"/>	Comments <i>No oil</i> <i>Adj Pedal</i>			
Enter Corrective Action Date <input type="text"/>				

ROSC-088 14435

U.S. WPRC
Box Packing List

Box: 9197362
Loc: C17B03

RAC:BAD NV

05-SEP-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: 2F1Z 13480AA Eng#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP33U32A170778 2002 TAURUS Assem: ATL Odom 3230 Bult: 16-JAN-02 WSD: 18-APR-02	Tag #: 0128527817 R.O.#: 16217401 Dealer #: 00505 Phone: Repaired: 02-AUG-02	L29 OTHER LIGHTING TROUBLES (INCL LEAKS/CONDENSATION) 42 DOES NOT OPERATE PROPERLY	FOUND AT TIMES SWITCH WOULD STICK REPLACE SWITCH OK NOW
Enter Global SD # Here: <input type="text"/>	Comments: <u>NO OIL</u> <u>Adjustable Pedal</u>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Eng#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP66U62G222318 2002 TAURUS Assem: CHI Odom 9474 Bult: 23-APR-02 WSD: 08-MAY-02	Tag #: 0128538894 R.O.#: 3904051 Dealer #: 07188 Phone: 516-223-1800 Repaired: 02-AUG-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	FAULTY BRAKE LAMP SWITCH SWITCH-STOP LAMP - REPLACE
Enter Global SD # Here: <input type="text"/>	Comments: <u>NO OIL</u> <u>FIXED</u>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Eng#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP63UG2G218407 2002 TAURUS Assem: CHI Odom 4101 Bult: 10-APR-02 WSD: 11-APR-02	Tag #: 0128505215 R.O.#: 16241402 Dealer #: 05224 Phone: 816-505-1305 Repaired: 03-AUG-02	L29 OTHER LIGHTING TROUBLES (INCL LEAKS/CONDENSATION) 28 OPEN CIRCUIT	BRAKE LIGHT SW CK FOR INTERMITTENT BRAKE LIGHT CONCERN. FOUND BRAKE LIGHT SW STICKING INTERMITTENTLY. INSTALL NEW SW & RETEST.
Enter Global SD # Here: <input type="text"/>	Comments: <u>NO OIL</u> <u>Adjustable Pedal</u>			
Enter Corrective Action Date <input type="text"/>				

ROB-898 14438

U.S. WPRC
Box Packing List

Box: 9197362
Loc: C17B03

RAC:BAD NV

05-SEP-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Svc#: 2F1Z 13480AA Engr#: 2FTT13480AA Part: SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP55L02G200001 2002 TAURUS Assoc: CHI Odon 5490 Buil: 14-MAR-02 WSD: 02-APR-02	Tag #: 0127337222 R.O.#: 17458002 Dealer #: 08413 Phone: 408-886-1104 Repaired: 19-JUL-02	H10 BRAKE-ABS WARNING LIGHT TROUBLES 42 DOES NOT OPERATE PROPERLY	SWITCH REPLACED BRAKE SWITCH
Enter Global ID # Here: <input type="text"/>	Comments: <i>NO OIL</i> <i>Adjustable Pedal</i>			
Enter Corrective Action Date: <input type="text"/>				
Svc#: 2F1Z 13480AA Engr#: 2F1T13480AA Part: SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP06S72A180062 2002 TAURUS Assoc: ATL Odon 1487 Buil: 28-MAR-02 WSD: 10-APR-02	Tag #: 0127436634 R.O.#: 28688101 Dealer #: 00125 Phone: 703-256-5000 Repaired: 18-JUL-02	L26 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	DIAGNOSE, VERIFIED REAR BRAKE LIGHT BEING ON, PERFORM PIN POINT TEST, FOUND BRAKE LIGHT SWITCH TO BE SHORTED, REPLACE STOP LIGHT SWITCH, RETEST, FOUND VEHICLE WOULD NOT START, CHECK ALTERNATOR, TEST BATTERY, FOUND IT TO BE NO GOOD, REPLACE BATTERY, RE
Enter Global ID # Here: <input type="text"/>	Comments: <i>OIL FILM</i> <i>Adjustable Pedal</i>			
Enter Corrective Action Date: <input type="text"/>				

2002 TAURUS 1FAFP55L72G182195
 16 JAN 2002 Adjustable Pedal

000 8949

Listed Parts: 17
 Unidentified Parts: 1
 Total Parts: 18

1000-008 1A437

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC:BAD NV

26-AUG-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Engn: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM55S6YA630034 2000 SABLE Assem: ATL Odom 28273 Built: 08-APR-00 WSD: 30-MAY-00	Tag #: 0124723561 R.O.#: 60242A Dealer #: 03825 Phone: Repaired: 02-JUL-02	L28 OTHER LIGHTING TROUBLES (INCL LEAKS/CONDENSATION) 28 OPEN CIRCUIT	REPALCED BRAKE SWITCH
Enter Global SD # Here: <input type="text" value="0150B"/> Enter Corrective Action Date <input type="text"/>	Comments <i>ADJ. PEDAL - RECALLED PERF. 23 MAR 01</i> <i>REPLACED BRAKE SWITCH - 02 JUL 02</i>			<i>Column 59</i> <i>BLANK = FIXED</i>
Srvcl: YF1Z 13480BA Engn: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP68S2YA280336 2000 TAURUS Assem: ATL Odom 17411 Built: 14-JUN-00 WSD: 10-AUG-00	Tag #: 0124725880 R.O.#: 34471A Dealer #: 03762 Phone: 814-967-6300 Repaired: 28-JUN-02	L28 OTHER LIGHTING TROUBLES (INCL LEAKS/CONDENSATION) 28 OPEN CIRCUIT	TEST AND REPLACE STOP LIGHT SWITCH
Enter Global SD # Here: <input type="text"/> Enter Corrective Action Date <input type="text"/>	Comments			
Srvcl: YF1Z 13480AA Engn: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP68S1YG210418 2000 TAURUS Assem: CHI Odom 6889 Built: 12-APR-00 WSD: 28-APR-00 <i>RAKE CODE: FEAB</i>	Tag #: 0124725513 R.O.#: 128388B Dealer #: 01528 Phone: 708-403-0300 Repaired: 09-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 41 STICKS/BINDS/GRABS	REPL BRAKE LIGHT SWITCH CLOSED BY MPI ADD ON AUTH BY 2134
Enter Global SD # Here: <input type="text"/> Enter Corrective Action Date <input type="text"/>	Comments <i>- 0150B PERFORMED 11 APR 2001</i> <i>- BRAKE LIGHT SWITCH REPLACED 09 JUL 02</i>			

ROB-808 14438

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Engl: YF1T13480BA Part: SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM6698YG630476 2000 SABLE Asm: CHI Odsm 20298 Bult: 19-APR-00 WSD: 22-JUL-00	Tag #: 0124728744 R.O.#: 11382101 Dealer #: 13354 Phone: 516-627-5910 Repaired: 19-JUL-02	L26 LIGHTS NOT WORKING- EXTERIOR 48 BURNED OUT	CONFIRM AND REPLACE BRAKE LAMP SWITCH
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				
Srvcl: YF1Z 13480AA Engl: YF1T13480BA Part: SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM5DU0Y6640002 2000 SABLE Asm: CHI Odsm 34311 Bult: 15-JUN-00 WSD: 11-OCT-00	Tag #: 0124728938 R.O.#: 221634A Dealer #: 10770 Phone: 814-471-6980 Repaired: 09-JUL-02	G29 OTHER WARNING LIGHT/GAUGE TROUBLES (VOLT/AMP) 42 DOES NOT OPERATE PROPERLY	34311 REPLACED BRAKE LAMP SWITCH
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				
Srvcl: YF1Z 13480AA Engl: YF1T13480BA Part: SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM6661YG610676 2000 SABLE Asm: CHI Odsm 28114 Bult: 22-DEC-99 WSD: 31-JAN-00	Tag #: 0124727821 R.O.#: 6006DA Dealer #: 10801 Phone: 215-524-0770 Repaired: 13-JUN-02	H2D OTHER BRAKE TROUBLES (INCLUDING AIR BRAKES) B4 PINCHED/DAMAGED WIRE	28114 PIN POINT DIAGS FOUND 2 BURNT PLACES IN THE HARNESS-ONE AT THE BRAKELAMP SWITCH AND THE OTHER AT THE CRUISE SWITCH-REPAIRED BOTH HARNESES AND REPLACED SWITCH
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				

FORM 908 1A31B

U.S. WFR
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARUEL
FORD MOTOR CO.

15080 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIC: 1MEFMS396YG630583 2000 SABLE Asm: CH Odom 33210 Bult: 20-APR-00 WSD: 05-MAY-00	Tag #: 0124727857 R.O.#: 132D14A Dealer #: 06003 Phone: Repaired: 10-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	DIAGNOSED AND INSPECTED VEHICLE FOR CUSTOMER CONCERN. INSPECTED BRAKE LAMP, FOUND THEM TO BE INOP. TRACED CAUSE OF CONCERN TO BAD BRAKE LAMP SWITCH. REMOVED AND REPLACED BRAKE LAMP SWITCH. CLEANED GREASE FROM BRAKE PEDAL.
Enter Global ID # Here: <input type="text"/>	Comments			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIC: 1FAFP3220YG230801 2000 TAURUS Asm: CH Odom 35157 Bult: 10-MAY-00 WSD: 09-JUN-00	Tag #: 0124727803 R.O.#: 164B0701 Dealer #: Phone: Repaired: 05-JUL-02	D02	DIAGNOSIS AND REPLACED BRAKE LIGHT SWITCH AND BATTERY
Enter Global ID # Here: <input type="text"/>	Comments			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIC: 1FAFP3222YA180814 2000 TAURUS Asm: ATL Odom 26306 Bult: 22-JAN-00 WSD: 05-FEB-00	Tag #: 0124727806 R.O.#: 12389802 Dealer #: 01452 Phone: 609-845-6600 Repaired: 09-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	1 L28 42 (13480) VERIFIED CONCERN DID PINPOINT TEST CK FUSES AND WIRE HARNES PASSED REPLACED BRAKE SWITCH ON PEDAL CK OPERATION WHEN DONE
Enter Global ID # Here: <input type="text"/>	Comments			
Enter Corrective Action Date <input type="text"/>				

FORM 608 14448

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC:BAD NV

26-AUG-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Brvc#: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEPM6633YG640842 2000 SABLE Assoc: CHI Odom 13505 Built: 19-JUN-00 WSD: 02-APR-01	Tag #: 0124729150 R.O.#: 819851 Dealer #: 10089 Phone: 714-533-5100 Repaired: 10-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 48 BURNED OUT	CAR DOESNT SHIFT OUT OF PARK SWITCH-STOP LAMP - REPLACE
Enter Global SD # Here:	Comments			
Enter Corrective Action Date				
Brvc#: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP6688YG221222 2000 TAURUS Assoc: CHI Odom 8169 Built: 02-MAY-00 WSD: 05-JUN-00	Tag #: 0124731895 R.O.#: 2524001 Dealer #: Phone: Repaired: 06-JUL-02	L26	VERIFIED CONCERN, INSPECTED AND CHECKED OASIS, FOUND TECHNICAL SERVICE BULLETIN 02-05-01. REPLACED CONNECTOR END AT BRAKE PEDAL SWITCH, REASSEMBLED AND RETESTED. BRAKE LIGHTS STILL ON, PERFORMED PINPOINT TEST AND REPLACED BRAKE PEDAL SWITCH AND R
Enter Global SD # Here:	Comments			
Enter Corrective Action Date				
Brvc#: YF1Z 13480AA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP6687YG271223 2000 TAURUS Assoc: CHI Odom 21288 Built: 28-JUN-00 WSD: 26-JUL-00	Tag #: 0124732008 R.O.#: 320152 Dealer #: 05471 Phone: 805-328-3711 Repaired: 08-JUL-02	P87 SHIFTS OCCUR TOO EARLY, TOO LATE, TOO OFTEN 42 DOES NOT OPERATE PROPERLY	SWITCH INOP BRAKE LIGHT SWITCH REPLACE
Enter Global SD # Here:	Comments			
Enter Corrective Action Date				

RR03-008 14441

U.S. WPRC
Box Packing List

Box: 9197234
Lot: C17B03

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Brake: YF1Z 13480AA Eng: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP5286YA281332 2000 TAURUS Asm: ATL Odom 29767 Built: 20-JUL-00 WSD: 02-AUG-00	Tag #: 0124732902 R.O.#: 5738361 Dealer #: 01172 Phone: 407-289-8900 Repaired: 11-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 28 OPEN CIRCUIT	OPEN CIRCUIT 0
Enter Global SD # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Brake: YF1Z 13480AA Eng: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP5586YG281583 2000 TAURUS Asm: CHI Odom 21370 Built: 09-AUG-00 WSD: 12-SEP-00	Tag #: 0124734811 R.O.#: 22529703 Dealer #: 04513 Phone: 856-585-1802 Repaired: 08-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 60 FROZEN/SEIZED/BINDING	128810 JUL 02 13480A DIAG SYS CLK TST GEM NO CODES CKED B00 READING SHOWED NOT W0 RONG CKED POWER TST LIGHT PRESENT NOT COMING OUT REPL
Enter Global SD # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Brake: YF1Z 13480AA Eng: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM5585YG631589 2000 SABLE Asm: CHI Odom 25380 Built: 26-APR-00 WSD: 01-MAY-00	Tag #: 0124734859 R.O.#: 189850A Dealer #: 13107 Phone: 617-828-6400 Repaired: 01-JUL-02	L26 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	26388 CP13480 C02 TEST AND REPLACE BRAKE LIGHT SWITCH
Enter Global SD # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				

FORM-008 1444Z

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvck: YF1Z 13480AA Engn#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM53UZYG021848 2000 SABLE Asm: CHI Odom 38321 Bult: 10-MAR-00 WSD: 25-MAR-00	Tag #: 0124736774 R.O.#: 2946251 Dealer #: 02014 Phone: 502-732-8874 Repaired: 19-JUN-02	N27 VIBRATION OR SHUDDER WHILE BRAKING 42 DOES NOT OPERATE PROPERLY	VEHICLE BRAKE SYSTEM CONCERN DISC BRAKE ROTOR FRONT MACHINE ON VEHICLE - MACHINE
Enter Global SD # Here:	Comments			
Enter Corrective Action Date				
Srvck: YF1Z 13480AA Engn#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM53UZYG031878 2000 SABLE Asm: CHI Odom 32288 Bult: 29-APR-00 WSD: 14-MAY-00	Tag #: 0124736944 R.O.#: 40122C Dealer #: 03917 Phone: Repaired: 02-MAY-02	P09 OTHER TRANSMISSION TROUBLES 42 DOES NOT OPERATE PROPERLY	INSTALL STOP LAMP SWITCH PROB CORR
Enter Global SD # Here:	Comments			
Enter Corrective Action Date				
Srvck: YF1Z 13480AA Engn#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP58KXVA183038 2000 TAURUS Asm: CATL Odom 18331 Bult: 15-FEB-00 WSD: 03-MAR-00	Tag #: 0124739072 R.O.#: 0846761 Dealer #: 05593 Phone: 310-816-2843 Repaired: 01-JUL-02	G29 OTHER WARNING LIGHT/GAUGE TROUBLES (VOLT/AMP) 41 STICKS/BINDS/GRABS	CHECKED BRAKE LIGHT OPERATION. TEST SWITCH. DIAGNOSED SWITCH TO BE STICKING. REPLACED BRAKE LIGHT SWITCH. RETEST AFTER REPAIR. OK 13300-0.1 13480A-0.3
Enter Global SD # Here:	Comments			
Enter Corrective Action Date				

FORM-888 14443

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Engrl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM58S4YG832183 2000 SABLE Asm: CHI Odom 8280 Bult: 28-APR-00 WSD: 18-MAY-00	Tag #: 0124739088 R.O.#: 3742201 Dealer #: 11118 Phone: Repaired: 10-JUL-02	L28 OTHER LIGHTING TROUBLES (INCL. LEAKS/CONDENSATION) 42 DOES NOT OPERATE PROPERLY	PERFORMED SYSTEM DIAGNOSIS. REPLACED BRAKE LIGHT SWITCH
Enter Global SD # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Engrl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP5520YG302289 2000 TAURUS Asm: CHI Odom 8438 Bult: 28-MAR-00 WSD: 01-DEC-00	Tag #: 0124739088 R.O.#: 107798A Dealer #: 01422 Phone: 800-245-2888 Repaired: 08-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 01 BROKEN/CRACKED	TESTED REPALCED BRAKE LIGHT SWITCH CHECKED OPERATION
Enter Global SD # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480BA Engrl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP5889YG323834 2000 TAURUS Asm: CHI Odom 18312 Bult: 08-MAY-00 WSD: 12-JUL-00	Tag #: 0124742028 R.O.#: 45133B Dealer #: 00086 Phone: 302-853-5900 Repaired: 09-JUL-02	H20 OTHER BRAKE TROUBLES (INCLUDING AIR BRAKES) 42 DOES NOT OPERATE PROPERLY	REPLACE BRAKE LIGHT SWITCH
Enter Global SD # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				

POSS-008 14444

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC:BAD NV

26-AUG-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Engr: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP68S1YA282837 2000 TAURUS Assoc: ATL Odom 27888 Built: 01-JUN-00 WSD: 17-JUN-00	Tag #: 0124742713 R.O.#: 6100162 Dealer #: 00480 Phone: 770-383-1773 Repaired: 10-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 28 OPEN CIRCUIT	LOOSE CONNECTOR WIRING ASSEMBLY - REPAIR AT BRAKE LIGHT SWITCH
Enter Global ID # Here: <input type="text"/>	Comments			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Engr: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP63U21G112886 2001 TAURUS Assoc: CHI Odom 17714 Built: 29-AUG-00 WSD: 27-OCT-00	Tag #: 0124744424 R.O.#: 214507B Dealer #: 03183 Phone: Repaired: 08-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	DIAGNOSE SHIFTER CONCERN, REPLACED BRAKE LAMP SWITCH, REPLACED BLOWN FUSE
Enter Global ID # Here: <input type="text"/>	Comments <i>Adj. Revol</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Engr: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM56SZYG612888 2000 SABLE Assoc: CHI Odom 24210 Built: 20-JAN-00 WSD: 29-FEB-00	Tag #: 0124744000 R.O.#: 66890801 Dealer #: 11208 Phone: 516-483-7750 Repaired: 09-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	BRAKE LAMP SWITCH AND WIRING. CK FOR SHIFTER WONT COME OUT OF PARK, RR BRAKE LAMP SWITCH AND REPLACE, REPAIR BRAKE LAMP WIRING, RETEST.
Enter Global ID # Here: <input type="text"/>	Comments			
Enter Corrective Action Date <input type="text"/>				

FORD-988 14448

U.S: WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480AA Engl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP6827YG183173 2000 TAURUS Asm: CHI Odom 37201 Built: 11-JAN-00 WSD: 25-JAN-00	Tag #: 0124746306 R.O.#: 12382301 Dealer #: 01452 Phone: 800-845-6800 Repaired: 08-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	1 P01 42 (13480) PROGRAM ESP REPLACED BRAKE POSITION SWITCH
Enter Global SD # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Engl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP55U4YG233824 2000 TAURUS Asm: CHI Odom 25577 Built: 12-MAY-00 WSD: 27-MAY-00	Tag #: 0124750705 R.O.#: 214589C Dealer #: Phone: Repaired: 10-JUL-02	P01	DIAGNOSE OPERATION REPAIR SHORTED WIRE REPLACE STOP LAMP SWITCH TEST OK
Enter Global SD # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480AA Engl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM8855YA633832 2000 SABLE Asm: ATL Odom 24724 Built: 28-APR-00 WSD: 18-JUN-00	Tag #: 0124750825 R.O.#: 3054152 Dealer #: Phone: Repaired: 08-JUL-02	L26	RPL SWITCH AND HARNESS PLUG
Enter Global SD # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				

1003-006 1448

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Brvcl: YF1Z 13480BA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM59S3YAB14206 2000 SABLE Asm: ATL Odom 27828 Built: 10-JAN-00 WBD: 29-JAN-00	Tag #: 0124783371 R.O.#: 3744801 Dealer #: 11118 Phone: Repaired: 10-JUL-02	L29 OTHER LIGHTING TROUBLES (INCL. LEAKS/CONDENSATION) 42 DOES NOT OPERATE PROPERLY	PERFORMED SYSTEM DIAGNOSIS. REPLACED BRAKE LITE SWITCH.
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Brvcl: YF1Z 13480BA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM59S3YAB21400 2000 SABLE Asm: ATL Odom 31250 Built: 08-MAR-00 WBD: 18-AUG-00	Tag #: 0124754715 R.O.#: 189477A Dealer #: 13107 Phone: 017-926-5400 Repaired: 02-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	30255 CC42 13000 REPLACE BRAKE LIGHT SWITCH
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Brvcl: YF1Z 13480BA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM59S3YAB04634 2000 SABLE Asm: ATL Odom 12123 Built: 18-NOV-99 WBD: 07-DEC-99	Tag #: 0124755305 R.O.#: 4420651 Dealer #: 04223 Phone: Repaired: 09-JUL-02	L29 OTHER LIGHTING TROUBLES (INCL. LEAKS/CONDENSATION) 42 DOES NOT OPERATE PROPERLY	TESTED SWITCH REPLACED FAULTY SWITCH RECHECKED O
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				

FORM-806 14477

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480BA Engn: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP882YG164673 2000 TAURUS Asm: CHI Odom 31940 Bult: 03-JAN-00 WSD: 27-JAN-00	Tag #: 0124757959 R.O.#: 4415551 Dealer #: 04223 Phone: Repaired: 08-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	INSPECT SHIFTER OPERATION INOP CANT SHFT FROM PARK CONNECTED NGS MONITOR PIDS ON BRAKE SWITCH INOP CHECK FOR POWER GOING TO BRAKE SWITCH REPLACED
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480BA Engn: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP889YA218080 2000 TAURUS Asm: ATL Odom 10854 Bult: 05-APR-00 WSD: 05-JUN-00	Tag #: 0124756348 R.O.#: 5489351 Dealer #: 08913 Phone: 508-373-3878 Repaired: 29-JUN-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	BRAKE LIGHT SWITCH INOP SWITCH-STOP LAMP - REPLACE
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480BA Engn: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM067YA828857 2000 GABLE Asm: ATL Odom 41775 Bult: 14-MAR-00 WSD: 05-APR-00	Tag #: 0124765774 R.O.#: 16765A Dealer #: 10890 Phone: 412-893-2200 Repaired: 09-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 28 OPEN CIRCUIT	PERFORMED ELECTRICAL DIAG AND PINPOINT TEST FOUND BRAKE LAMP SWITCH TO BE DEFECTIVE REPLACE SWITCH RECHECK ALL OK AT THIS TIME
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				

800-999-1444

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480BA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN:1FAFP58S0YA200539 2000 TAURUS Asm:ATL Odom 24163 Bult:14-MAR-00 WSD:06-APR-00	Tag #: 0124811383 R.O.#: 8700401 Dealer #: 00190 Phone: 301-419-2700 Repaired: 11-JUL-02	A85 OTHER ELECTRICAL ACCESSORY TROUBLES 28 OPEN CIRCUIT	DIAGNOSE AND REPALCE BRAKE LIGHT SWITCH
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480BA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN:1FAFP58SXYG240589 2000 TAURUS Asm:CHI Odom 28568 Bult:24-MAY-00 WSD:18-AUG-00	Tag #: 0124811553 R.O.#: 14773801 Dealer #: 08048 Phone: 017-982-4545 Repaired: 12-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER,CHANGE GEARS 28 OPEN CIRCUIT	DIAGNOSE AND REPLACE BRAKE LIGHT SWITCH,RETEST O
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480BA Eng#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN:1FAFP58S0YG190781 2000 TAURUS Asm:CHI Odom 25961 Bult:06-MAR-00 WSD:29-JUN-00	Tag #: 0124813161 R.O.#: 237051 Dealer #: 03888 Phone: Repaired: 10-JUL-02	H19 BRAKE-ABS WARNING LIGHT TROUBLES 42 DOES NOT OPERATE PROPERLY	REPLACE SWITCH-STOP LAMP-
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				

8083-088 14449

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM5GSDYAG22862 2000 SABLE Asm: ATL Odom 15884 Bult: 01-MAR-00 WSD: 18-DEC-00	Tag #: 0124828357 R.O.#: 314282A Dealer #: 13150 Phone: 203-878-8485 Repaired: 10-JUL-02	L26 LIGHTS NOT WORKING- EXTERIOR 46 BURNED OUT	PERFORM DIAG ,PERFORM STSPTOM CHART. FOUND SWITCH INOP REPLACED SWITCH AND VERIFY REPAIR.
Enter Global SD # Here: <input type="text"/>	Comments			
Enter Corrective Action Date <input type="text"/>				
Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP6682A203452 2002 TAURUS Asm: ATL Odom 2148 Bult: 12-MAR-02 WSD: 28-MAR-02	Tag #: 0124831128 R.O.#: 3182851 Dealer #: 03888 Phone: 518-738-7405 Repaired: 28-JUN-02	L26 OTHER LIGHTING TROUBLES (INCL LEAKS/CONDENSATION) 28 OPEN CIRCUIT	REPLACE SHORTED STOP LIGHT SWITCHCHECK NO STOP LIGHTS
Enter Global SD # Here: <input type="text"/>	Comments <i>ADJ PEDAL</i>			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP6626YG163084 2000 TAURUS Asm: CH Odom 16880 Bult: 02-FEB-00 WSD: 17-FEB-00	Tag #: 0124834474 R.O.#: 14941701 Dealer #: 00785 Phone: 814-868-4801 Repaired: 28-JUN-02	H10 BRAKE-ABS WARNING LIGHT TROUBLES 42 DOES NOT OPERATE PROPERLY	ROAD TEST VERIFIED TESTED SYSTEM PERFORMED PINPOINT TEST LED TO FAULTY BRAKE LIGHT SWITCH REPLACED SWITCH AND RETESTED VERIFIED REPAIR
Enter Global SD # Here: <input type="text"/>	Comments			
Enter Corrective Action Date <input type="text"/>				

RO3-088 14458

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP53UE2A1B4280 2002 TAURUS Asm: ATL Odom 12294 Built: 05-MAR-02 WSD: 20-MAR-02	Tag #: 0124836465 R.O.#: 1378052 Dealer #: Phone: Repaired: 10-JUL-02	L29	INOP LAMP - REPLACE SWITCH-STOP
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP583YA214730 2000 TAURUS Asm: ATL Odom 24001 Built: 07-APR-00 WSD: 25-APR-00	Tag #: 0124838381 R.O.#: 5567001 Dealer #: 20307 Phone: 505-275-4468 Repaired: 10-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 28 OPEN CIRCUIT	BOO SWITCH COMPLETED DIAG COMPONENT TEST BOO SWITCH FOUND SWITCH SHORTED, RBR SWITCH AND RETESTED BRAKE LIGHT OPERATION
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP5861G154677 2001 TAURUS Asm: CH Odom 25430 Built: 08-NOV-00 WSD: 04-JAN-01	Tag #: 0124840780 R.O.#: 43298301 Dealer #: 20337 Phone: 620-282-3875 Repaired: 09-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	FOUND BOO SWITCH SHORTED AND BATTERY BAD CC#2 VERIFIED CONCERN FOUND BOO SWITCH SHORTED TO POWER AND HARNESS MELTED PERFORMED UNDERDASH WIRING REPAIR REPLACED
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				

RCR-000 14451

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvct: 2F1Z 13480AA Engr#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP5J62A205411 2002 TAURUS Asm: ATL Odom: 7443 Bult: 20-MAR-02 WSD: 20-MAR-02	Tag #: 0124843700 R.O.#: 107948C Dealer #: 00072 Phone: 717-867-2103 Repaired: 10-JUL-02	L26 LIGHTS NOT WORKING- EXTERIOR 41 STICKS/BINDS/GRABS	7443 FOUND STOP LIGHT STICKS AT TIMES REPLACE STOP LIGHT SWITCH
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				
Srvct: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP58G4YA207043 2000 TAURUS Asm: ATL Odom: 32947 Bult: 24-MAR-00 WSD: 16-APR-00	Tag #: 0124853988 R.O.#: 25003A Dealer #: 03218 Phone: 970-825-1880 Repaired: 12-JUL-02	H20 OTHER BRAKE TROUBLES (INCLUDING AIR BRAKES) 41 STICKS/BINDS/GRABS	DAG TO BRAKE LITE SWITCH STICKING, REPLACE COMPLETE, RECHECK OK
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				
Srvct: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP58G9YA167381 2000 TAURUS Asm: ATL Odom: 18171 Bult: 01-FEB-00 WSD: 02-APR-00	Tag #: 0124858184 R.O.#: 18124701 Dealer #: 07787 Phone: 510-528-1244 Repaired: 25-JUN-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS D4 FLAW IN MATERIAL	VERIFY CONCERN ELECT SYSTEM TEST FOUND BK LAMP SWITCH OPEN REPLACE SWITCH RETEST OK IN TIME TO GLUE LOOSE BRAKE PEDAL PAD IN PLACE
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				

RO3-08 14432

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC:BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvic: YF1Z 13480BA Engin: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM8000YA016163 2000 SABLE Assem: ATL Odom 17884 Built: 04-FEB-00 WBD: 25-FEB-00	Tag #: 0124881388 R.O.#: 16078802 Dealer #: 00400 Phone: 330-722-2593 Repaired: 06-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	CHECKED AND FOUND BAD BRAKE SWITCH REPLACED SWITCH
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvic: YF1Z 13480BA Engin: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP58S4YA198637 2000 TAURUS Assem: ATL Odom 12568 Built: 10-MAR-00 WBD: 16-SEP-00	Tag #: 0124883802 R.O.#: 48878851 Dealer #: 00144 Phone: 410-281-2875 Repaired: 11-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	BRAKE LIGHTS INOP STOP LAMP - REPLACE SWITCH-
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				
Srvic: YF1Z 13480BA Engin: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP5BU1YA249154 2000 TAURUS Assem: ATL Odom 17852 Built: 23-MAY-00 WBD: 17-JUN-00	Tag #: 0124887492 R.O.#: 734801 Dealer #: 08198 Phone: 814-843-4431 Repaired: 03-JUL-02	L28 OTHER LIGHTING TROUBLES (INCL. LEAKS/CONDENSATION) 41 STICKS/BINDS/GRABS	DIAGNOSED AND REPLACED BRAKE LIGHT SWITCH
Enter Global ID # Here: <input type="text"/>	Comments _____			
Enter Corrective Action Date <input type="text"/>				

FORM 999 1A-02

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480BA Engl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM099YAS9002 2000 SABLE Asm: ATL Odom 9001 Bult: 01-JUL-00 WSD: 05-JUL-00	Tag #: 0124871033 R.O.#: 0821351 Dealer #: 11812 Phone: 581-275-2411 Repaired: 10-JUL-02	L20 LIGHTS NOT WORKING- EXTERIOR 48 BURNED OUT	INOP LAMP - REPLACE SWITCH-STOP
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				
Srvcl: YF1Z 13480BA Engl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP8BU7YA182389 2000 TAURUS Asm: ATL Odom 14257 Bult: 03-JAN-00 WSD: 27-JAN-00	Tag #: 0124820433 R.O.#: 21708002 Dealer #: 03558 Phone: Repaired: 11-JUL-02	P68 TRANSMISSION SHIFTS ROUGH OR JERKY FROM PARK 48 BURNED OUT	DIAG AND REPLACED OPEN B-LIGHT SWITCH.
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				
Srvcl: YF1Z 13480BA Engl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM0967YG822922 2000 SABLE Asm: CHI Odom 25085 Bult: 15-MAR-00 WSD: 31-AUG-00	Tag #: 0124820310 R.O.#: 00014001 Dealer #: 11208 Phone: 518-483-7700 Repaired: 12-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	REPLACE BRAKE LIGHT SWITCH NECESSARY TO REPLACE HARNES SECTION.
Enter Global ID # Here:	Comments			
Enter Corrective Action Date				

NO. 880 1494

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFN608KYA616330 2000 SABLE Assem: ATL Odom 36800 Bult: 25-JAN-00 WSD: 25-JAN-00	Tag #: 0124968818 R.O.#: 10468802 Dealer #: 06088 Phone: 573-824-7478 Repaired: 01-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	REPLACE BRAKE LIGHT SWITCH, ADD ON APPROVED BY J
Enter Global 80 # Here:	Comments			
Enter Corrective Action Date				
Srvcl: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP684YA167011 2000 TAURUS Assem: ATL Odom 28089 Bult: 01-MAR-00 WSD: 16-MAR-00	Tag #: 0124964941 R.O.#: 8635451 Dealer #: 01019 Phone: 713-860-8800 Repaired: 13-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 28 OPEN CIRCUIT	28 CIRCUIT TEST REPLACE BRAKE SWITCH FOR OPEN RETEST OK
Enter Global 80 # Here:	Comments			
Enter Corrective Action Date				
Srvcl: YF1Z 13480BA Engr#: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAPP684YA267842 2000 TAURUS Assem: ATL Odom 11209 Bult: 23-JUN-00 WSD: 31-JUL-00	Tag #: 0124971957 R.O.#: 8458251 Dealer #: 04814 Phone: 841-747-4411 Repaired: 09-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 28 OPEN CIRCUIT	OPEN CIRCUIT LAMP - REPLACE SWITCH-STOP
Enter Global 80 # Here:	Comments			
Enter Corrective Action Date				

8003-006 14410

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvcl: YF1Z 13480BA Engrl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM58U5G617862 2000 BABLE Asm: CHI Odom 18559 Built: 15-FEB-00 WSD: 01-MAR-00	Tag #: 0124972020 R.O.#: 178383C Dealer #: 07774 Phone: 541-476-8888 Repaired: 01-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	INSPECT AND DIAG AND ORDERED BRAKE LIGHT SWITCH REPLACED BRAKE LITE SWITCH
Enter Global SD # Here: <input type="text"/>	Comments			
Enter Corrective Action Date <input type="text"/>				
Srvcl: YF1Z 13480BA Engrl: YF1T13480BA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1MEFM58U5G6007937 2002 BABLE Asm: CHI Odom 8041 Built: 17-OCT-01 WSD: 31-OCT-01	Tag #: 0124972770 R.O.#: 9061201 Dealer #: 12805 Phone: Repaired: 02-JUL-02	H19 BRAKE-ABS WARNING LIGHT TROUBLES 28 OPEN CIRCUIT	RAM ABS DIAGNOSTICS-NO CODES AND LIGHT NOT ON AT THIS TIME CALLED HOTLINE AND WAS TOLD TO CHECK IGNITION SWITCH-WAS OK CHECKED BRAKE LIGHT SWITCH-INTERNAL OPEN- REPLACED-OK
Enter Global SD # Here: <input type="text"/>	Comments			
Enter Corrective Action Date <input type="text"/>	<i>ADJ PEDAL</i>			
Srvcl: 2F1Z 13480AA Engrl: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP08902A214182 2002 TAURUS Asm: ATL Odom 13039 Built: 17-APR-02 WSD: 25-MAY-02	Tag #: 0125046724 R.O.#: 0287701 Dealer #: 02397 Phone: 215-341-8855 Repaired: 15-JUL-02	L26 LIGHTS NOT WORKING- EXTERIOR 28 OPEN CIRCUIT	REPL STOP LIGHT SWITCH
Enter Global SD # Here: <input type="text"/>	Comments			
Enter Corrective Action Date <input type="text"/>	<i>ADJ. PEDAL</i>			

RC83-085 14428

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srvck: 2F1Z 13480AA Engrk: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP58822A288081 2002 TAURUS Asm: ATL Odom 643 Bult: 12-JUN-02 WSD: 25-JUN-02	Tag #: 0125080543 R.O.#: 18031701 Dealer #: 01403 Phone: 717-248-2215 Repaired: 15-JUL-02	P01 DIFFICULT TO OPERATE SHIFT LEVER, CHANGE GEARS 42 DOES NOT OPERATE PROPERLY	CHECK AND REPLACE BRAKE LIGHT SWITCH
Enter Global ID # Here:	Comments	ADJ. PEDAL		
Enter Corrective Action Date				
Srvck: 2F1Z 13480AA Engrk: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP88902A188831 2002 TAURUS Asm: ATL Odom 8791 Bult: 15-MAR-02 WSD: 08-APR-02	Tag #: 0125082411 R.O.#: 208201A Dealer #: 00585 Phone: 716-882-8500 Repaired: 11-JUL-02	L26 LIGHTS NOT WORKING- EXTERIOR 41 STICKS/BINDS/GRABS	8791 REPLACE SWITCH STUCK ON TEST DRIVE ALSO REPAIRED LINES B D
Enter Global ID # Here:	Comments	ADJ. PEDAL		
Enter Corrective Action Date				
Srvck: 2F1Z 13480AA Engrk: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP68U92A213644 2002 TAURUS Asm: ATL Odom 4183 Bult: 11-APR-02 WSD: 11-APR-02	Tag #: 0125138337 R.O.#: 218851A Dealer #: 00977 Phone: 884-242-8000 Repaired: 11-JUL-02	D02 ENGINE WOULD NOT START 48 BURNED OUT	CK EEC SYS AND STARTING SYS. PP TEST, REPLACED SWITCH, RECHECKED
Enter Global ID # Here:	Comments	ADJ. PEDAL		
Enter Corrective Action Date				

ROSC-088 14457

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV
NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

26-AUG-02

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Srv#: 2F1Z 13480AA Eng#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP00G02A208485 2002 TAURUS Assem: ATL Odom 8490 Built: 22-MAR-02 WSD: 01-APR-02	Tag #: 0125188610 R.O.#: 6288651 Dealer #: 00149 Phone: 301-843-2400 Repaired: 05-JUL-02	L28 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	SHORTED LAMP - REPLACE SWTCH-STOP
Enter Global ID # Here: <input type="text"/>	Comments: <u>ADJUSTABLE</u>			
Enter Corrective Action Date: <input type="text"/>				
Srv#: 2F1Z 13480AA Eng#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP00G02A109943 2002 TAURUS Assem: ATL Odom 8114 Built: 27-MAR-02 WSD: 18-MAY-02	Tag #: 0128307118 R.O.#: 142280A Dealer #: 00801 Phone: 718-849-6701 Repaired: 01-AUG-02	A25 ENGAGEMENT TROUBLES 42 DOES NOT OPERATE PROPERLY	S114 BRAKE LIGHT SWITCH STICKING ROAD TEST FOR CRUISE (NOP AT TIMES AND OR FOR SHUTTING ITSELF OFF. FOUND THAT IF YOU HIT THE BRAKE PEDAL THEN PUT YOUR FOOT UNDER THE PEDAL AND PULLED IT UP HARD THE CRUISE COULD WORK AGAIN. ALSO FOUND THE BRAKE LIGHTS ON AFTER FI
Enter Global ID # Here: <input type="text"/>	Comments: <u>ADJ. PEDAL</u>			
Enter Corrective Action Date: <input type="text"/>				
Srv#: 2F1Z 13480AA Eng#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAFP00L02G283733 2002 TAURUS Assem: CH Odom 6 Built: 24-JUL-02 WSD: 01-JAN-01	Tag #: 0128548778 R.O.#: 52182B Dealer #: 02918 Phone: Repaired: 31-JUL-02	A85 OTHER ELECTRICAL ACCESSORY TROUBLES 48 BURNED OUT	
Enter Global ID # Here: <input type="text"/>	Comments: <u>FIXED PEDAL</u>			
Enter Corrective Action Date: <input type="text"/>				

ROD-008 14458

U.S. WPRC
Box Packing List

Box: 9197234
Loc: C17B03

RAC: BAD NV

26-AUG-02

NEMESIO VILLARRUEL
FORD MOTOR CO.

15090 COMMERCE DR. N
DEARBORN MI 48120-0000

Part Information	Vehicle Information	Repair Information	Concern Information	Tech Comments
Brake: 2F1Z 13480AA Engn#: 2F1T13480AA Part SWITCH ASY - Name: STOP LIGHT	VIN: 1FAHP56S22A206766 2002 TAURUS Asens: ATL Odors: 2007 Built: 12-APR-02 WBD: 20-MAY-02	Tag #: 0126837892 R.O.#: 203118A Dealer #: 02750 Phone: 800-358-2776 Repaired: 08-AUG-02	L26 LIGHTS NOT WORKING- EXTERIOR 42 DOES NOT OPERATE PROPERLY	2007 NAR PERFORM PIN POINT TEST REPLACE THE BRAKE LIGHT SWITCH AND RETETS OK POSITION...
Enter Global ID # Here:	Comments: <i>Adj Pedal</i>			
Enter Corrective Action Date:				

Listed Parts: 04
Unidentified Parts: 0
Total Parts: 04

RO03-000 14489

2000-2001 TAURUS/SABLE BRAKE LIGHT SWITCH AUDIT

Model Year	Build Date	VIN	ODO	PEDAL Fbrcd/Adj	BRAKE LIGHT SWITCH CONDITION
	Jun-00	1MEFM55S3YG837293	21,771	A	Oil on switch, some on spring. Adj. Cable OK.
	May-00	1FAFP56S8YG238434	34,940	A	Oil on switch, heavy grease on connecting cable.
	May-00	1MEFM55S3YG838127	17,973	A	Oil on switch
	Jun-00	1MEFM55S0YG838501	19,999	A	Oil on switch
	Jun-00	1MEFM55S9YG838500	23,886	A	Oil on switch
	Jun-01	1FAFP568X1G269160	12,580	A	Completely dry.
	Feb-00	1FAFP55S1YG182426	23,409	A	Oil on switch. Photo #5
	Jun-00	1MEFM55S1YG842380	25,496	A	Oil on switch
	Jun-00	1MEFM55S1YG841195	36,940	A	Oil on switch, dry elsewhere
	Jun-00	1MEFM55S1YG838474	30,348	A	Oil on switch, dry elsewhere. Switch has signs of heating. Photo #6.
	Apr-00	1FAFP56S0YG216919	23,261	A	Oil on switch and grease on cable. Replaced switch. Switch build date 0106.
	Apr-00	1FAFP56S5YG221988	19,350	A	Switch is slight wet. Strg column boot sprayed with foreign substance and also on switch. Cable connection oozing with grease. Photo. #7
	May-00	1FAFP55S4YG238536	18,511	A	Oil on switch. Some oil on spring.
	Jun-00	1FAFP56S8YG261283	26,108	A	Light oil on switch. Light grease on spring.
	Jun-00	1MEFM55S0YG840734	13,738	A	Very light oil on switch. Med grease on spring. Tight wires.
	Aug-00	1MEFM55S21G802106	18,824	A	Switch and spring assy are completely dry. 1/8" gap between switch and mount.
2002	Mar-02	1FAHP56S82A203462	2,148	A	NO OIL
2002	Oct-01	1MEHM59S02G807937	8,041	A	NO OIL
2002	Apr-02	1FAFP56S02A214182	13,039	A	NO OIL
2002	Jun-02	1FAHP56S22A258051	843	A	NO OIL
2002	Mar-02	1FAFP56S02A198831	6,791	A	NO OIL
2002	Apr-02	1FAFP55U82A213844	4,183	A	NO OIL
2002	Mar-02	1FAHP56S02A206488	5,490	A	NO OIL
2002	Mar-02	1FAHP56S32A198843	5,114	A	NO OIL
2002	Jul-02	1FAFP55LX2G283733	5	F	NO OIL
2002	Apr-02	1FAHP56S02A208756	2,697	A	NO OIL
2002	15 MAR02	1FAFP53462A194280	12,294	A	NO OIL
2002	20 MAR02	1FAFP53482A205411	7443	F	NO OIL

MOB-688 14480

2000-2001 TAURUS/SABLE BRAKE LIGHT SWITCH AUDIT

Model Year	Build Date	VIN	ODO	PEDAL Fixed/Adj	BRAKE LIGHT SWITCH CONDITION
2001		1FAPP55U91G274889	18,616	F	No oil
2001	Aug-01	1FAPP55U11G276785	22,733	F	No oil
2001	Aug-01	1FAPP55U01G281102	21,804	F	No oil
	Jul-01	1FAPP55U81G274852	25,340	F	No oil
2001	Nov-01	1FAPP55U82G154888	28,883	F	No oil
	Aug-01	1FAPP55U01G277437	17,078	F	No oil
	Aug-01	1FAPP55U81G281414	24,209	F	No oil
	Aug-01	1FAPP55U51G283596	21,521	F	No oil
	Jul-01	1FAPP55U71G276833	23,773	F	No oil
	Jul-01	1FAPP55U51G274842	24,540	F	No oil
	Apr-00	1FAPP58S4YG221539	38,892	A	Oil on switch and mount pin. Removed switch for analysis. Photo #2
	Jul-01	1MEFM53U11G848190	19,619	A	No oil -switch OK
	Apr-00	1MEFM56S7YG827788	22,071	A	Oil on switch and mount pin. Photo #3 Asked to Hold for further investigation.
	Apr-00	1MEFM55S7YG831081	14,028	A	Switch is full of oil and bracket has oil. SW build date 0D06
	Jun-00	1FAPP56S9YG258641	30,085	A	Some oil on switch, spring clean.
	Aug-00	1FAPP58SX1G100620	23,889	A	Oil on switch, spring clean. Pedal wet.
	Oct-00	1FAPP55U41G141784	29,376	A	No oil on switch. Spring dry.
	Mar-00	1FAPP55S8YG198518	32,801	A	Oil on switch and grease is oozing out from drive cable. Request hold for review.
	May-00	1FAPP5GS8YG245301	23,801	A	Some oil on switch, grease out of cable. Photo #4 Switch date 1D28.
	May-00	1FAPP55SXYG242381	17,555	A	Oil present on switch. Grease out of cable. Switch date 0L28.
	Oct-00	1FAPP55U41G144390	19,325	A	Switch is dry. No oil on pedal.
	Dec-99	1MEFM55S7YG806088	26,057	A	Some oil on switch. Spring covered with grease.
	Dec-99	1MEFM55S1YG808338	23,832	A	Oil on switch, Spring has grease.
	Dec-99	1MEFM55S7YG842383	21,687	A	Oil on switch, Spring has grease.
	May-00	1FAPP55S5YG238528	25,728	A	Oil on switch, Minimal oil on spring.

ROB-008 14481

2000-2001 TAURUS/SABLE BRAKE LIGHT SWITCH AUDIT

Model Year	Build Date	VIN	ODO	PEDAL Fixed/Adj	BRAKE LIGHT SWITCH CONDITION
	Jun-00	1MEFM55S3YG637293	21,771	A	Oil on switch, some on spring. Adj. Cable OK.
	May-00	1FAPP58S9YG238434	34,940	A	Oil on switch, heavy grease on connecting cable.
	May-00	1MEFM55S3YG636127	17,873	A	Oil on switch
	Jun-00	1MEFM55S0YG638501	18,999	A	Oil on switch
	Jun-00	1MEFM55S9YG638500	23,688	A	Oil on switch
	Jun-01	1FAPP58SX1G209150	12,660	A	Completely dry.
	Feb-00	1FAPP58S1YG182428	23,409	A	Oil on switch. Photo #5
	Jun-00	1MEFM55S1YG842380	25,496	A	Oil on switch
	Jun-00	1MEFM55S1YG841195	36,940	A	Oil on switch, dry elsewhere
	Jun-00	1MEFM55S1YG835474	30,348	A	Oil on switch, dry elsewhere. Switch has signs of heating, Photo #6.
	Apr-00	1FAPP56S0YG216919	23,261	A	Oil on switch and grease on cable. Replaced switch. Switch build date 0L06.
	Apr-00	1FAPP58S5YG221968	19,350	A	Switch is slight wet. Strg column boot sprayed with foreign substance and also on switch. Cable connection oozing with grease. Photo. #7
	May-00	1FAPP55S4YG238536	18,811	A	Oil on switch. Some oil on spring.
	Jun-00	1FAPP58S8YG261283	26,106	A	Light oil on switch. Light grease on spring.
	Jun-00	1MEFM55S0YG840734	13,738	A	Very light oil on switch. Med grease on spring. Tight wires.
	Aug-00	1MEFM55S21G802105	18,824	A	Switch and spring assy are completely dry. 1/8" gap between switch and mount.

K003-003 14482



#3




ROSS-010 14404






14401 000-0001

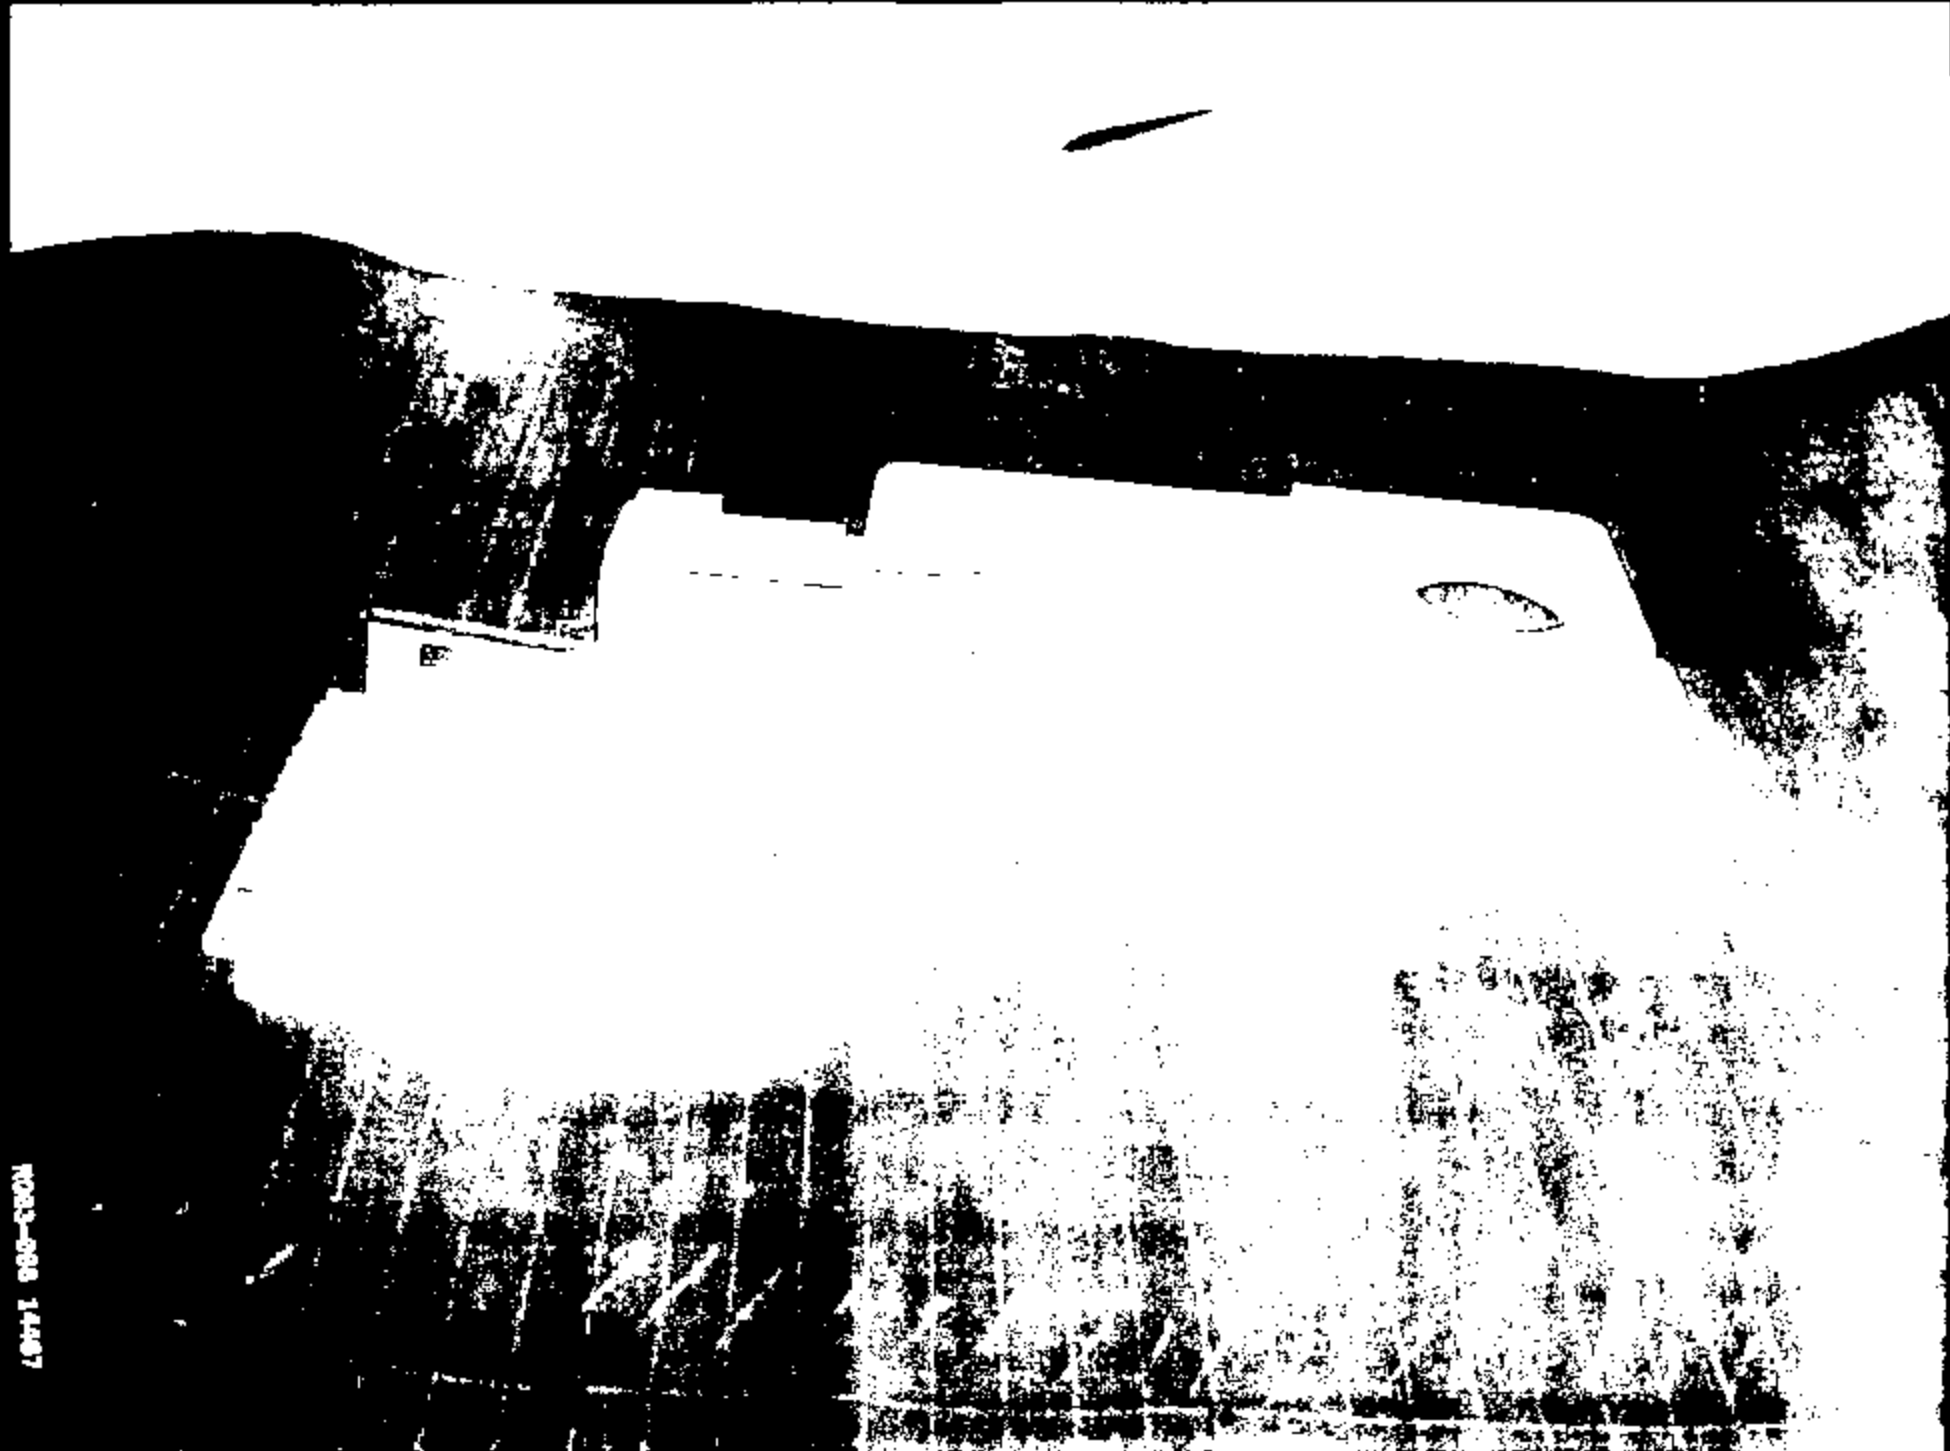

1083-898 14497

41

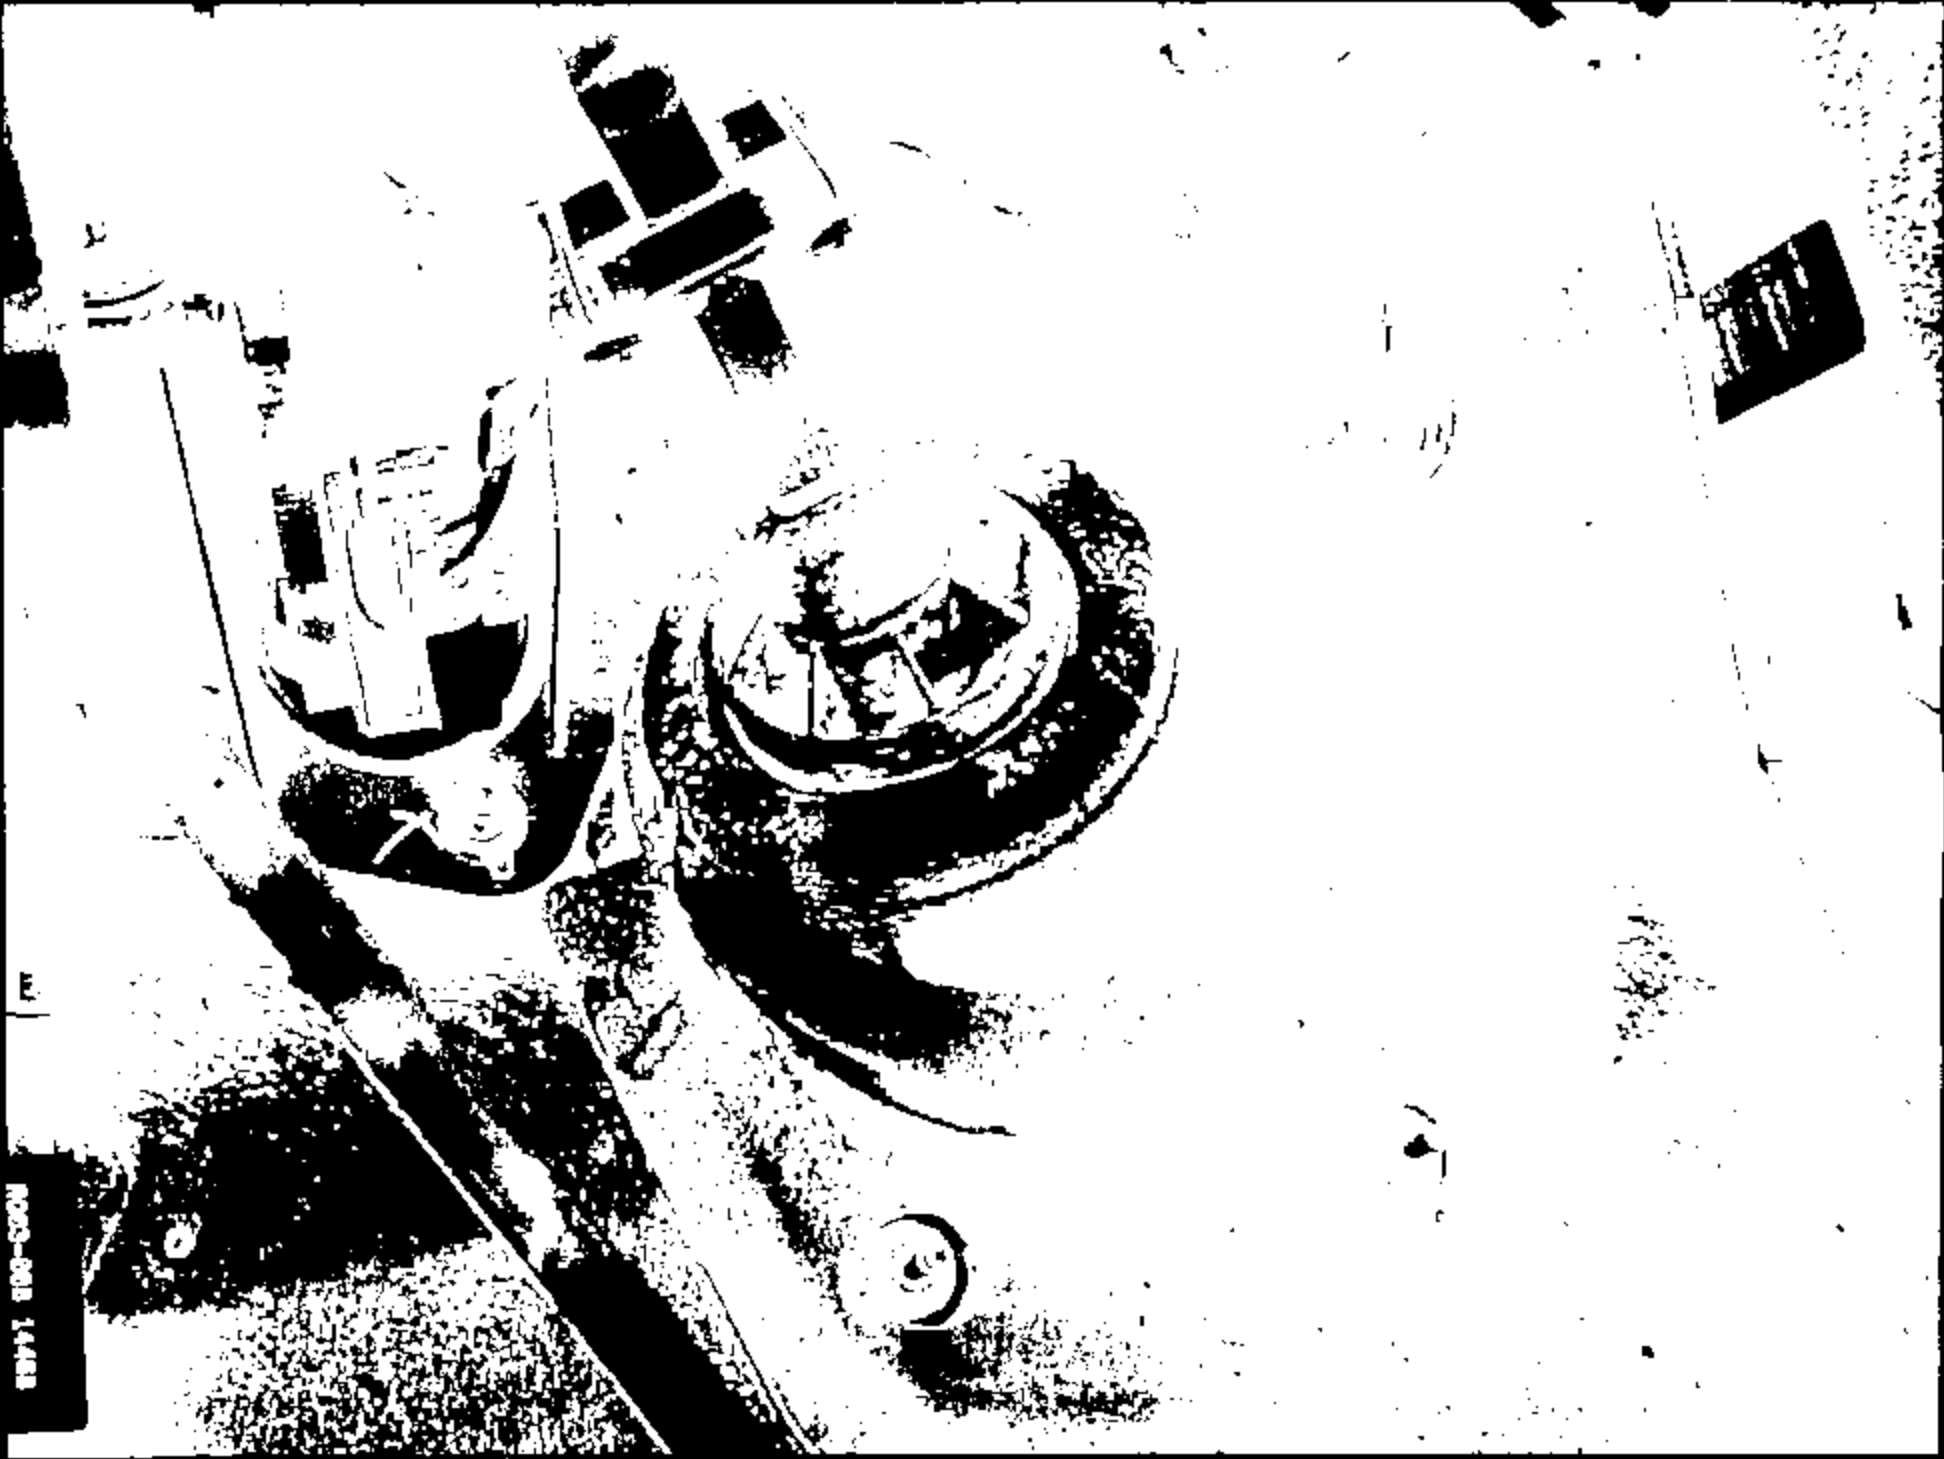

14488 808-808

2000-2002 TAURUS/SABLE BRAKE LIGHT SWITCH

MY	VIN	ODO	BRAKE LIGHT SWITCH CONDITION
2001	1FAFP55U 91G2 74889	18616	FIXED - NO OIL
4/01-01	1FAFP55U 11G276765	22733	FIXED - NO OIL
4/01 2001	1FAFP55U 01G281102	21904	" - "
7/01 2001	1FAFP55U 81G 274852	25340	" "
7/01 2001	1MEFM53U 11G 648190	19619	ADJ Pedal - NO OIL, SW-OK
11/01 2002	1FAFP55U 82G 154888	28883	FIXED - NO OIL
4/01	1FAFP55U 01G 277437	17,076	" - "
5/01	1FAFP55U 81G 281414	24,209	FIXED - "
8/01	1FAFP55U 61G 283596	21,521	FIXED - "
7/01	471G 276933	23,773	FIXED - NO OIL
7/01	451G 274842	24,540	" - " (REMOVED SW) mount #
04/00	1FAFP56Y 4G 221539	38,692	ADJ Pedal - OIL ON SW / SW
04/00	1MEFM55S 7Y 627768	22,071	" " OIL ON SW & MOUNT
04/00 *	ASK TO HOLD		pic #3
04/00	1MEFM55S 7Y 631061	14028	(SW BUND) FULL OF OIL - BRKT HAS OIL
06/00	1FAFP56Y 4G 259641	30,085	ADJ Pedal - SOME OIL, SPRING CLEAN
08/00 *	1FAFP56S 1G 100620	23,689	ADJ Pedal - SOME OIL, SPRING CLEAN (WET SWITCH) - Pedal wet
10/00	1FAFP55U 41G 141764	29,376	ADJ Pedal - SPRING DRY - SW DRY
3/00 *	1FAFP55S 6Y 196516	38,601	" " - OIL ON SWITCH & GREASE OOBING FROM DRIVE CABLE
05/00	1FAFP56S 8Y 246301	23,801	SOME OIL - GREASE OUT OF CABLES
	1FAFP55S 4Y 242381		pic #4 (SW 1D28)
5/00	1FAFP55S 4Y 242381	17,555	ADJ Pedal - GREASE OUT OF CABLES - SW OIL PRESENT SW DATE (0429)
10/00	441G 144390	19,325	ADJ Pedal - SW IS DRY NO OIL ON Pedal
12/99	1MEFM55S 7Y 608069	26,057	ADJ Pedal - SOME OIL ON SW SPRING COVERED W/GREASE
12/99	1MEFM 55S 1Y 608338	23,832	ADJ Pedal - OIL ON SWITCH, SPRING HAS GREASE
06/00	1MEFM 55S 7Y 642383	21,687	" " - " " " "
5/00	1FAFP55S 5Y 238528	25,728	ADJ Pedal - OIL ON SW, MINIMAL SPRING
6/00	1MEFM 55S 3Y 637293	21,771	" " - " " " " SOME ON SPRING, ADJ Cable OK

Villarruel, Nemesio (N.)

From: Lysik, Kevin (K.M.)
Sent: Monday, August 26, 2002 3:15 PM
To: Villarruel, Nemesio (N.)
Subject: FW: Review of 2000MY Taurus/Sable - Employee's Car (With Photos)

Nemo: FYI - Kevin Lysik

-----Original Message-----

From: Lysik, Kevin (K.M.)
Sent: Friday, August 23, 2002 12:43 PM
To: Komosky, Dale (-)
Cc: Aghill, Max (M.); Schmidt, Norm (N.G.); Schramak, Joseph (J.E.); Patel, Bharat (B.J.); Lysik, Kevin (K.M.); Stollsteimer, Dale (D.O.); McCann, Mike (M.J.); Newell, Sean (S.M.)
Subject: Review of 2000MY Taurus/Sable - Employee's Car (With Photos)

Date:

Myself and Dale Stollsteimer reviewed a 2000MY Taurus with approx 40K miles on Friday. The employee works in 6-Sigma building and had told a co-worker that she had no stop lamps or was unable to shift out of park when the pedal was pressed. The 6-sigma center mechanic replaced the switch and she was able to drive the car home on Thursday evening. Dale and I reviewed the car on Friday morning.

Some information about the situation:

Adjustable Pedals
Build date: May 12, 2000
Recall 01S08 was performed in April 2, 2001 at 14,714 miles
Switch removed from the car had oil present on the outer and inner surfaces, but NO noticeable damage - switch was functional when it was reinstalled. (See Photos)
Grease was present on spring and drive gear cable connector (See Photos)
Oil was present on extension plate
Extension plate was rusted
Inside diameter of push rod had a wear spot due to metal to metal contact with the mounting pin. The bushing had been displaced and was shifted enough to allow metal to metal contact
Bushings measured out of round
Bushings had a score mark around the entire outer circumference
Film of oil was present inside the connector
The pin "GO" gage would not fit all the way home on the pin. It looked like there was a pin finish difference (which affected the diameter) in the final 3-4 mm of engagement nearest the pin head.

The car is available for review again. We just need to give the employee notice because she does not always drive the car.

Please let me know when you and Max would like to review the car. I think it is a good example of a "No stop lamps" condition that is NOT caused by the switch.



MVC-0075.JPG



MVC-0085.JPG



MVC-0085.JPG



MVC-0103.JPG

Kevin Lysik

Electrical Campaign Prevent Specialist- NA Car

Villarruel, Nemesio (N.)

From: Villarruel, Nemesio (N.)
Sent: Friday, August 16, 2002 3:03 PM
To: Wash, Chris (C.J.)
Cc: Villarruel, Nemesio (N.); Patel, Bharat (B.J.); Lysik, Kevin (K.M.)
Subject: 2001-2002 Taurus/Sable Brake Light Switch

Chris:

Please request the following parts be returned:

Description of Part: Brake light switch

Model and MY affected: 2001-2002 Taurus/Sable (all models) built from December 2000 to present

Part Numbers affected: YF1Z-13480-AA

YF1Z-13480-BA

2F1Z-13480-AA

-Quantity 100 pcs

Tag parts with vehicle VIN.

Thanks

Nemesio Villarruel

NAC - Safety/Recall Tech Specialist

Tel: (313) 322-7986

Fax: (313) 380-8002

Pager: (313) 786-8081

Villarruel, Nemesio (N.)

From: Lysik, Kevin (K.M.)
Sent: Wednesday, July 31, 2002 9:19 AM
To: Aghili, Max (M.); Beard, Dave (D.F.); Kornosky, Dale (.); McCann, Mike (M.J.); Newell, Sean (S.M.); Patal, Bharat (B.J.); Schmidt, Norm (N.G.); Schramek, Joseph (J.E.); Setliti, Frank (F.E.); Stolsteimer, Dale (D.O.); Villarruel, Nemesio (N.); Waxer, Donald (D.D.)
Subject: FW: Stop Lamp Switches

The oil found on the switches from the Auction Yard audit is spectrally almost identical to the base fluid of the Moly Kote grease. Moly Kote is used as the lubricant for the drive gear and was used as the lubricant for the return spring.

I do not think we need to analyze any more switches for the type of oil found. - Kevin Lysik

-----Original Message-----

From: Cooper, Vicki (V.A.)
Sent: Wednesday, July 24, 2002 8:17 AM
To: Gulien, Gayle (G.D.); Lysik, Kevin (K.M.)
Subject: Stop Lamp Switches

Gayle, Kevin -

Spectra of the yellow grease submitted under Lab # 21416 (on the cotton swabs) match spectra of the "Moly Kote Grease" submitted two years ago under Lab # 02520.

The oily/greasy residue under the caps and along the mating surfaces of the stop lamp switches is spectrally almost identical to spectra of the base fluid of the yellow grease (Lab # 21416). The oily/greasy residue under the caps and along the mating surfaces of the stop lamp switches is spectrally almost identical to spectra of the base fluid of the "Moly Kote Grease" (Lab # 02520).

It is likely the base fluid is separating from the grease and causing the problem with the stop lamp switches.

I presently do not have time to write up the official Central Laboratory Report. I am currently working on several other assembly plant issues. Sorry.

Vicki Cooper
VCOOPER
(313) 594-0945

Villaruel, Nemesio (N.)

From: Dionisi, Anthony (A.J.)
Sent: Thursday, July 18, 2002 8:25 PM
To: Lysik, Kevin (K.M.); Bersuder, Lee (L.C.)
Cc: Lovelace, Maria (M.E.); Villaruel, Nemesio (N.); Dionisi, Anthony (A.J.)
Subject: RE: Assignment # 02-61 - 2000 Taurus/Sable Brake Switch Concern - CQIS # 2GOFM001

Finally received the adjustable pedal assembly today (had difficulty obtaining part from National Parts Depot). Parts replaced and adjustable pedal assembly and brake switch (attached to pedal assembly) being returned to FCSD ECI (attn. M. Lovelace). If package was picked up from dealer by Airborne Express (airbill # 2624256110) today, it should arrive Friday (7/19/02). Did not clean off any grease from parts removed and technician noted no problem with booster rod alignment. Replacement of parts resolved vehicle concern. Also, customer indicated he has not used the vehicle for any towing. FQE had technician install missing adjustable pedal assembly nut (nut that was noted missing from units that were inspected during our adjustable pedal assembly assignment (previous assignment # 02-55)).

-----Original Message-----

From: Dionisi, Anthony (A.J.)
Sent: Monday, July 15, 2002 10:22 PM
To: Lysik, Kevin (K.M.); Bersuder, Lee (L.C.)
Cc: Lovelace, Maria (M.E.); Villaruel, Nemesio (N.); Dionisi, Anthony (A.J.)
Subject: Assignment # 02-61 - 2000 Taurus/Sable Brake Switch Concern - CQIS # 2GOFM001

Please see CQIS # 2GOFM001 (copy attached) - concerns a 2000 Taurus with 11,582 miles with a concern of brake lights stay on. Recall was performed on unit over a year ago (see vehicle history in report). I discussed concern with Kevin today before any repairs were made. It was decided to order new adjustable pedal assembly and brake switch and replace both parts. Parts will be returned to Lee Bersuder at ECI. Parts will be inspected to try and determine what could have caused concern to present brake switch. Attached are photos that I attached to CQIS report. Note: vehicle build date is: 12-23-1999. If you have any questions, please let me know. If you would like me to photograph an area I might have omitted, please let me know and I will do so before we disassembly parts from unit.

CQIS # 2GOFM001:

<< File: CQIS # 2GOFM001.doc >>

Photos:

<< File: 2GOFM001a.jpg >> << File: 2GOFM001b.jpg >> << File: 2GOFM001c.jpg >>

<< File: 2GOFM001d.jpg >> << File: 2GOFM001e.jpg >> << File: 2GOFM001f.jpg >> << File: 2GOFM001g.jpg >>

Tony Dionisi
Ford Motor Company
Enhanced Concern Identification
Denver Field Quality Engineer
Office: 303-348-4788
Cell: 303-921-2517
Fax: 303-348-4788
edionisi@ford.com

Villarruel, Nemesio (N.)

From: Dionisi, Anthony (A.J.)
Sent: Thursday, July 18, 2002 8:13 PM
To: Lysik, Kevin (K.M.); Bersuder, Lee (L.C.)
Cc: Lovelace, Maria (M.E.); Villarruel, Nemesio (N.); Dionisi, Anthony (A.J.)
Subject: RE: Assignment # 02-61 - 2000 Sable Brake Switch Concern - CQIS # 2GPII001

Part shipped back to FCSD ECI (attn. M. Lovelace) - should arrive on Friday (7/19/02). Shipped by Airborne Express - airbill # 2824258014.

-----Original Message-----

From: Dionisi, Anthony (A.J.)
Sent: Tuesday, July 16, 2002 8:02 PM
To: Lysik, Kevin (K.M.); Bersuder, Lee (L.C.)
Cc: Lovelace, Maria (M.E.); Villarruel, Nemesio (N.); Dionisi, Anthony (A.J.)
Subject: Assignment # 02-61 - 2000 Sable Brake Switch Concern - CQIS # 2GPII001

Attached is a copy of CQIS # 2GPII001 - concerns a 2000 Sable with 30,588 miles where customer was complaining of "won't come out of park and stop lights do not work". After verifying concern, FQE contacted Kevin Lysik per Assignment # 02-61 requirements. Since customer was in a hurry, it was decided to replace brake switch and clean off excess grease. Recall 01908 was performed on unit at 19,025 miles in April 2001. Attached are photos that were attached to CQIS report. Part will be returned to FCSD ECI.

CQIS # 2GPII001:

<< File: CQIS # 2GPII001.doc >>

Photos:

<< File: 2GPII001a.jpg >> << File: 2GPII001b.jpg >> << File: 2GPII001c.jpg >>

<< File: 2GPII001d.jpg >> << File: 2GPII001e.jpg >> << File: 2GPII001f.jpg >>

<< File: 2GPII001g.jpg >> << File: 2GPII001h.jpg >> << File: 2GPII001i.jpg >>

Tony Dionisi
Ford Motor Company
Enhanced Concern Identification
Denver Field Quality Engineer
Office: 303-348-4788

Cell: 303-921-2517
Fax: 303-346-4798
adlonisk@ford.com

Villarruel, Nemesio (N.)

From: Myers, Dan (D.P.)
Sent: Monday, July 15, 2002 10:26 PM
To: Villarruel, Nemesio (N.)
Subject: Brake Switch Assignment

Nemo,

In my search for repeat repair vehicles I am finding vehicles that should have been included (based on build date and Assembly Plant) in the recall but were not according to OASIS. The VIN is 1FAPF5520YG180702 and the build date is 02/2000. Any reason why this vehicle wasn't part of the recall?

Thanks,

Dan Myers

Field Quality Engineer - Iowa
Enhanced Concern Identification

dmyers4@ford.com

Cell 563-505-9002
Office 563-289-9991
Fax 563-289-1364

Villarruel, Nemesio (N.)

From: Lovelace, Maria (M.E.)
Sent: Thursday, July 18, 2002 8:05 AM
To: Villarruel, Nemesio (N.)
Subject: FW: Assign. 02-81 T/S Brake Light Switch

-----Original Message-----

From: Hayduk, Mark (M.S.)
Sent: Thursday, July 18, 2002 7:56 AM
To: Lovelace, Maria (M.E.)
Cc: Hayduk, Mark (M.S.)
Subject: Assign. 02-81 T/S Brake Light Switch

Maria, attached CQIS reports are for four vehicle concerns and some photo's for this assign. Pls. forward info to Nemo Villarruel and Kevin Lysik. Parts and one tube of lube used by the tech. are being sent to you.

2GQJT008: 00 Sable. Switch replaced 3 times, last one has an oil film on it.

2GQJT006: 00 Taurus. Non-adjustable pedals. Wiring breaking to switch. Switch also changed which was dry but contacts look burnt.

2GQJT007: 01 Taurus. Switch stuck on. Switch is dry.

2GQJT005: 00 Taurus. Four switches replaced. A new switch out of the box stuck on.

Thanks.

CSQI002 CQIS Indicator Summary 07/18/02 07:31:33 1 of 1
----->-----
Rpt#: 2GQJT008 CQD Rpt: 07/17/2002 Odom: 0 M
Rvwrd: File: Folder: Images: 0 Print: Smry/Disp Detail(P/D):
Vehicle: 2000 SABLE,LS PREM,SEDAN 1MEPM5588YG615970 Bld: 01/25/2000
Engine: 3.0L EFI M Calb: ODD14NOA Trans: AX4N Axle: FWD 3.98 A/C: YES
Dealer Id: 07313 Washington Ford, Inc. Pht#: (724) 223-5100
State: Pennsylvania City: Washington Orig/Caller: MARK HAYDUK
Symptom: 2 01 2 28 ELBCT.,LIGHTING SYS,EXT. LIGHTING,STOPLAMPS
Addl Sym: Sc CCRQ/EPRC: S Rvwrd A Dt: 07/17/2002
Fix: Caus. Comp: SWITCH ASY-STOPLIGHT - RPL Condition Code: 42

Region Code: 44 Region Name: Pittsburgh - 44

CONCER CUST. STATES: BRAKE LIGHTS WILL NOT GO OFF.
REPAIR * TECH. CONFIRMED CONCERN. FOUND BRAKE LIGHT SWITCH STUCK ON. TECH.
REPLACED THE BRAKE LIGHT SWITCH WHICH CORRECTED THE CONCERN.
* AWS SHOWS 9-14-00 @ 6,442 MI. CUST. COMPLAINED THAT BRAKE
LIGHTS WERE STUCK ON, TECH REPLACED BRAKE LIGHT SWITCH. THERE ARE NO
OTHER BRAKE OR NOISE CONCERNS IN AWS PRIOR TO THIS REPAIR. ON 3-28-01
@ 11,700 MI, BRAKE LIGHT SWITCH WAS REPLACED PER OISDR. ON 4-29-02
@ 23,906 MI (THIS CONCERN) BRAKE LIGHT SWITCH WAS REPLACED FOR THE
BRAKE LIGHTS STAYING ON.
* SWITCH REPLACED ON 4-29-02 HAS A LIGHT FILM OF OIL ON IT AND ALSO

A HEAVIER LUBRICANT WHERE THE PLUNGER GOES THRU THE SWITCH BODY.
* PART BEING RETURNED TO MLOVELACB RELATED TO BCI ASSIGN. 02-61.
* MARK HAYDUK - PITTSBURGH FQE - 724-822-4342

CSQI002 CQIS Indicator Summary 07/18/02 07:32:50 1 of 1

Rpt#: 2GQJT006 CQD Rpt: 07/17/2002 Odom: 0 M
Rvw'd: File: Folder: Images: 1 Print Smry/Dirp Detail(P/D):
Vehicle: 2000 TAURUS,SE SVG,SEDAN 1FAFP55UXYA120849 Bld: 11/04/1999
Engine: 3.0L EFI Calb: ODD12N0A Trans: AX4N Axle: FWD 3.77 A/C: YES
Dealer Id: 07319 Charapp Ford South Ph#: (724) 941-5040
State: Pennsylvania City: Pittsburgh Orig/Caller: MARK HAYDUK
Symptom: 2 01 2 28 BLECT.,LIGHTING SYS,EXT. LIGHTING,STOPLAMPS
Addl Sym: Sc: CCRG/EPRC: S Rvw'd: A Dt: 07/17/2002
Fix: Caus. Comp: SWITCH ASY-STOPLIGHT - RPL Condition Code: 42

Region Code: 44 Region Name: Pittsburgh - 44

CONCER CUST. STATES: CAN NOT GET OUT OF PARK AT TIMES.
REPAIR * TECH. FOUND WIRE TO BRAKE LIGHT SWITCH WAS BREAKING. TECH REPLACED THE WIRE AND THE SWITCH TO CORRECT THE CONCERN.
* SWITCH IS COMPLETELY DRY, HAS NO SIGNS OF OIL ON IT. FQE OBSERVED THAT THE SWITCH CONTACTS HAVE SOME SIGNS OF STARTING TO BURN/MELT.
* SWITCH IS BEING RETURNED TO MLOVELA1 FOR REVIEW RELATED TO BCI ASSIGN. 02-61
* PHOTO IS AVAIL. VIA CQIS IMAGING.
* MARK HAYDUK - PITTSBURGH FQE - 724-822-4342
* NOTE: THIS VEHICLE HAS FIXED PEDALS.

CSQI002 CQIS Indicator Summary 07/18/02 07:34:16 1 of 1

Rpt#: 2GQJT007 CQD Rpt: 07/17/2002 Odom: 0 M
Rvw'd: File: Folder: Images: 2 Print Smry/Dirp Detail(P/D):
Vehicle: 2001 TAURUS,SE SVG,SEDAN 1FAFP55UX1G169861 Bld: 12/06/2000
Engine: 3.0L EFI Calb: 1DD12S0A Trans: AX4S Axle: FWD 3.77 A/C: YES
Dealer Id: 07313 Washington Ford, Inc. Ph#: (724) 223-5100
State: Pennsylvania City: Washington Orig/Caller: MARK HAYDUK
Symptom: 2 01 2 28 BLECT.,LIGHTING SYS,EXT. LIGHTING,STOPLAMPS
Addl Sym: Sc: CCRG/EPRC: S Rvw'd: A Dt: 07/17/2002
Fix: Caus. Comp: SWITCH ASY-STOPLIGHT - RPL Condition Code: 42

Region Code: 44 Region Name: Pittsburgh - 44

CONCER CUST. STATES: BRAKE LIGHTS STAY ON ALL THE TIME.
REPAIR * TECH. CONFIRMED CONCERN, FOUND BRAKE LIGHT SWITCH STUCK ON. TECH REPLACED THE BRAKE LIGHT SWITCH TO RESOLVE THE CONCERN.
* FQE REVIEWED SWITCH AND FOUND THAT THE CONTACT BLADES MELTED IN TO THE SWITCH COVER APPROX. 21 MM LONG. OUTSIDE OF COVER IS MELTED WHERE BLADE WAS IN CONTACT.
* SWITCH DOES NOT HAVE ANY OIL FILM ON IT. INSIDE OF PLUNGER AREA HAS A SLIGHT BIT OF HEAVY LUBRICANT LOOKING MATERIAL WHERE THE PLUNGER GOES THRU THE SWITCH BODY.
* VEHICLE HAS NO OTHER REPAIRS AND IS A 2001 WHICH WAS NOT RECALLED UNDER 01S08.
* SWITCH BEING RETURNED TO MLOVELA1 RELATED TO BCI ASSIGN. 02-61.
* PHOTO'S AVAIL. VIA CQIS IMAGING.
* VEHICLE HAS ADJUSTABLE PEDALS.
* MARK HAYDUK - PITTSBURGH FQE - 724-822-4342

Rpt#: 2GQJ7005 CQD Rpt: 07/17/2002 Odom: 14,925 M
 Rvwrd: File: Folder: Images: 0 Print Smry/Disp Detail(P/D):
 Vehicle: 2000 TAURUS,SE COMP,SEDAN 1FAPP568XYA176660 Bld: 02/08/2000
 Engine: 3.0L EFI M Calb: ODD14N8A Trans: AX4N Axle: FWD 3.98 A/C: YES
 Dealer Id: 07313 Washington,Ford, Inc. Ph#: (724) 223-5100
 State: Pennsylvania City: Washington Orig/Caller: MARK HAYDUK
 Symptom: 2 01 2 28 ELECT.,LIGHTING SYS,EXT. LIGHTING,STOPLAMPS
 Addl Sym: Sc CCRG/EPRC: S Rvwrd: A Dt: 07/17/2002
 Fix: Caus. Comp: SWITCH ASY-STOPLIGHT - RPL Condition Code: 42

Region Code: 44 Region Name: Pittsburgh - 44

CONCER CUST. STATES: CAN NOT GET VEHICLE OUT OF PARK.

REPAIR * TECH CONFIRMED THE CONCERN. FOUND THAT THE BRAKE SWITCH WAS STUCK OPEN AND WOULD NOT CLOSE.

* ON 11-03-00 @ 5,114 MI CUST. COMPLAINED THAT THE BRAKE LIGHTS WOULD STAY STUCK ON. DEALER CHANGED BRAKE LIGHT SWITCH. ON 6-15-01 @ 6,795 MI THE DEALER CHANGED THE BRAKE LIGHT SWITCH PER 01808. TECH THAT CHANGED SWITCH ON 6-15-01 SAID HE NORMALLY APPLIES SOME FORD CALIPER AND DIELECTRIC GREASE ON BRAKE LIGHT SWITCH PIVOT. ON 7-12-02 @ 14,925 MI THE CUST. COMPLAINED SHE CAN NOT GET VEHICLE OUT OF PARK. TECH. FOUND BRAKE LIGHT SWITCH WONT CLOSE. FQE REVIEWED THIS SWITCH AND OBSERVED A LIGHT OIL ON THE OUTSIDE OF THE BRAKE LIGHT SWITCH AND UNDER THE COVER ON THE SWITCH. TECH. INSTALLED A NEW BRAKE LIGHT SWITCH WHICH IMMEDIATELY STUCK ON. TECH. DISCONNECTED AND RECONNECTED THE CONNECTOR. LIGHT WENT OUT, BUT WHEN TECH. APPLIED THE BRAKES, THE BRAKE LIGHTS STAYED STUCK ON. TECH. CHANGED THE BRAKE SWITCH AGAIN TO RESOLVE THE CONCERN.

* BOTH BRAKE SWITCHES CHANGED ON 7-12-02 AND A TUBE OF THE BRAKE CALIPER AND DIELECTRIC GREASE THAT THE TECH. PREVIOUSLY USED ARE BEING RETURNED TO MLOVELA1 FOR BCI ASSIGN. 02-61.

* MARK HAYDUK - PITTSBURGH FQE - 724-822-4342



2GQJ7005.jpg



2GQJ7005.jpg



2GQJ7005.jpg

Mark Hayduk

Field Quality Engineer
 Global Concern Definition
 Ph: 724-941-8870
 Call: 724-822-4342
 Fax: 724-941-5154

Villarruel, Nemesio (N.)

From: Dionisi, Anthony (A.J.)
Sent: Monday, July 15, 2002 10:22 PM
To: Lysik, Kevin (K.M.); Bersuder, Lee (L.C.)
Cc: Lovelace, Maria (M.E.); Villarruel, Nemesio (N.); Dionisi, Anthony (A.J.)
Subject: Assignment # 02-81 - 2000 Taurus/Sable Brake Switch Concern - CQIS # 2GOFM001

Please see CQIS # 2GOFM001 (copy attached) - concerns a 2000 Taurus with 11,582 miles with a concern of brake lights stay on. Recall was performed on unit over a year ago (see vehicle history in report). I discussed concern with Kevin today before any repairs were made. It was decided to order new adjustable pedal assembly and brake switch and replace both parts. Parts will be returned to Lee Bersuder at ECI. Parts will be inspected to try and determine what could have caused concern to present brake switch. Attached are photos that I attached to CQIS report. Note: vehicle build date is: 12-23-1999. If you have any questions, please let me know. If you would like me to photograph an area I might have omitted, please let me know and I will do so before we disassembly parts from unit.

CQIS # 2GOFM001:



Photos:



Tony Dionisi
Ford Motor Company
Enhanced Concern Identification
Denver Field Quality Engineer

Office: 303-348-4788
Call: 303-921-2517
Fax: 303-348-4798
adlonis@ford.com