× Ser	vice Inform	nation			
💌 Hor	💌 Nun	💌 Nev	💌 Bull	💌 Fee	🔀 Heli

Document ID: 1496119

#04-08-42-004A: Tail Lamp/Brake Lamp Inoperative (Replace Bulb and Socket) - (Apr 15, 2004)

Subject: Tail Lamp/Brake Lamp Inoperative (Replace Bulb and Socket)

Models:	2003 Chevrolet Cavalier
	2003 Pontiac Sunfire

This bulletin is being revised to provide the latest parts information. Please discard Corporate Bulletin Number 04-08-42-004 (Section 08- Body & Accessories).

Condition

Some customers may comment that the left or right tail lamp, brake lamp or turn signal is inoperative.

Cause

This condition may be caused by a loose fitting bulb in the socket. This higher resistance may cause the bulb to burn out and damage the socket.

Correction

- Inspect the socket terminal to make sure it is tight against the bulb. Use a small pick to adjust the terminal if needed.
- After inspecting the socket, it may be necessary to replace it with the bulb.
- Apply dielectric lubricant or dielectric grease to the socket before installing the bulb.
- After the repair is completed, inspect the other lamp and apply dielectric lubricant or dielectric grease to the socket.

Important: If it was necessary to replace the socket, repeat the steps above.

Parts Information

Part Number Description

×

9441839	Bulb
16522273	Socket-Tail Lamp/Brake Lamp With rear Side Marker
16519904	Socket- Tail Lamp/Brake Lamp With Out Rear Side Marker

Parts are currently available from GMSPO.

Warranty Information

For vehicle repaired under warranty, use;

Labor Operation	Description	Labor Time
N0912	Socket, Lamp Exterior- Replace	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

© 2011 General Motors. All rights reserved.

