

PE05-067
HEIL TRAILER
12/19/2005
EXHIBIT 1, 2, 3, 4, & 5
PART 1 OF 3

PE05-067
HEIL TRAILER
12/19/2005
EXHIBIT 1

Beth Bennett

From: Tracy Harmon
Sent: Thursday, September 22, 2005 2:56 PM
To: David Morrow
Subject: 237-8848

237-8848 only used on air ride dolly

PE05-067
HEEL TRAILER
12/19/2005
EXHIBIT 2

TECH SERVICE FIELD REPORT

CUSTOMER:	██████████ USA Transport, Diamond Trucking, Beneto,
LOCATION:	Bakersfield, CA, Fontana, CA, Phoenix, AZ
PERSONNEL CONTACTED:	Mike Hinson at ██████ Dennis Miller - Diamond, Beall Shop, West-Mark Shop, Dale - Beneto
CALL DATE:	9/8/05 - 9/9/05
SERIAL NUMBER:	
DATE OF MANUFACTURE:	
SUBJECT:	California Pull trailer failures, USA Transport - Flo crack, Leaning trailer at Diamond, Beneto - Frame, cabinet & bumper cover cracks
Copy: Plant GM/Engineering	Tom Grein; Bernie Riggitt; Joe Robinson; Joe Calonge; Ben Ubamadu
COPY: Chattanooga	Andy Fincher; Brian Mueller; Steve Traversi; Lynn Moses; Randy Miller

Pull Trailer Failures -

Both ██████████ have had a pull trailer that the front suspension and axle separated from the frame. These separations occurred as the drivers pulled away from a stop. The ██████ driver stopped before the trailer actually dropped on the ground the Dandee driver didn't and the trailer landed on it's nose. It didn't leak but damaged the hose tubes, ladder, and the hose tube cabinet box put a deep scratch on the front head.

All of the failures have occurred on air ride California pull trailers, just to the rear of the front air ride tower. The crack started at the bottom of the frame tube and travels up.

Below is a complete list of all trailers to date with this type of failure.

Cox	
67212	In at Beall with failure
	Was in shop at Cox with crack across tube
67741	
67742	Repaired at West Mark
67745	Complete separation
67746	Full repair at West Mark

Dandee	
67750	Complete separation

Both ██████████ have both put out notifications to their locations to check this area on all trailers to see if there are others. I was only able to see a total of about four units that weren't cracked along with three of the above units. They are based out of and running all over California.

On the two complete separations we are in the process of replacing both of the frames that completely separated with new ones. On the frames that we found with cracks I have had the repair shops cut off the weld across the back side, bottom of the tube along with about 1/4" of the mounting plate going forward from the weld that was cut off. They have then added a steel plate approximately 1" wider than the tube from the suspension hanger mounting plate to the air spring mounting plate. This plate is welded to both mounting plates and along the outside edge of the frame tube but not across the tube. It is the original weld across the tube that is failing.

Serial number 67212 was reported the day after I left and I am waiting for pictures on it. Besides this unit, the others were all built at the same time. We were hoping the problem was limited to a certain run of material or a procedure not followed in the plant.

Status

Joe Calonge's research shows we have built 86 air ride pull trailers over about the last five years. If it turns out serial number 67212 has suffered the same type of failure as the rest of the units it is my opinion we should modify all of the trailers. While the percentage of trailers that have failed is small, the possible costs with the complete separation is very high.

I discussed the repair with engineering but need their blessing going forward, either continue with what I have been doing or recommend something other procedure.

Beth Bennett

From: jcavitt@west-mark.com



Sent: Friday, September 02, 2006 1:00 PM


To: David Morrow

Subject: [REDACTED] UNIT 275 HEIL SERIAL # 67750

DAVID HERE ARE THE PICTURES OF THE DANDEE UNIT



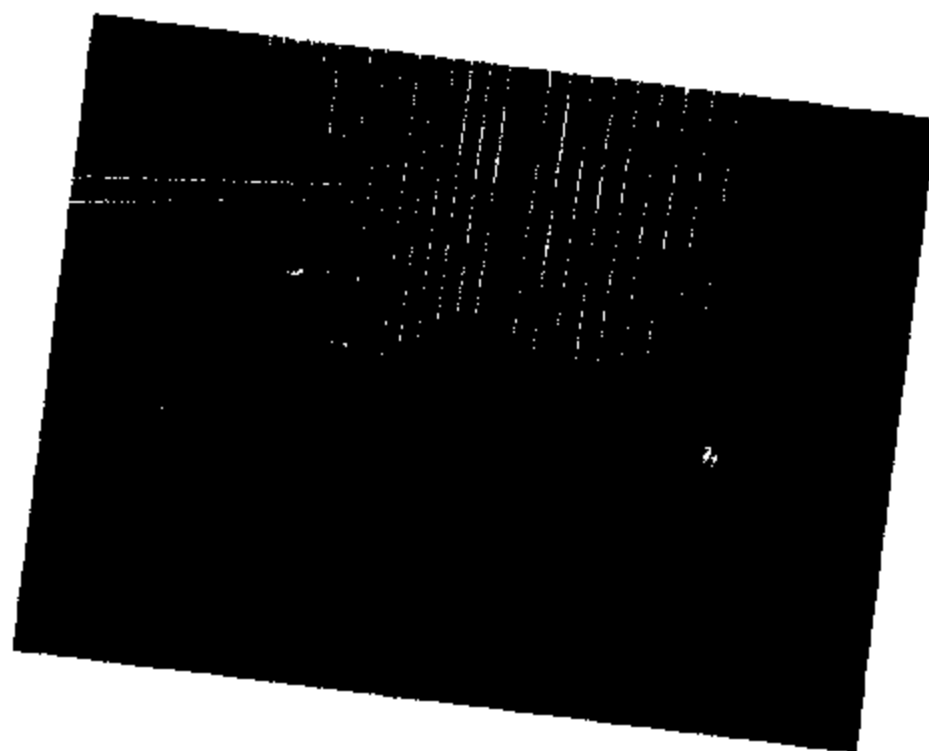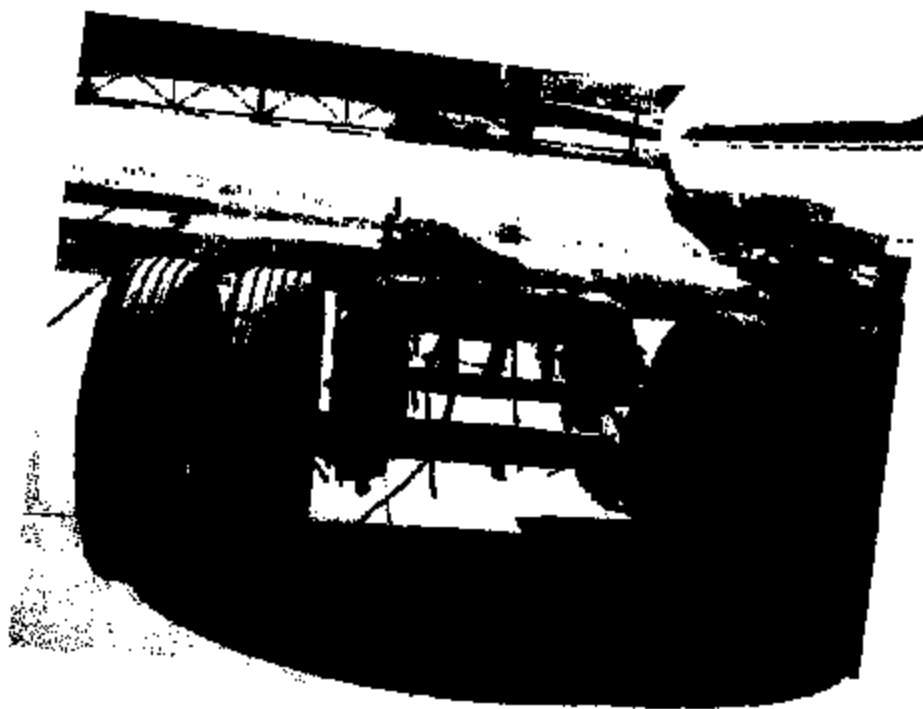

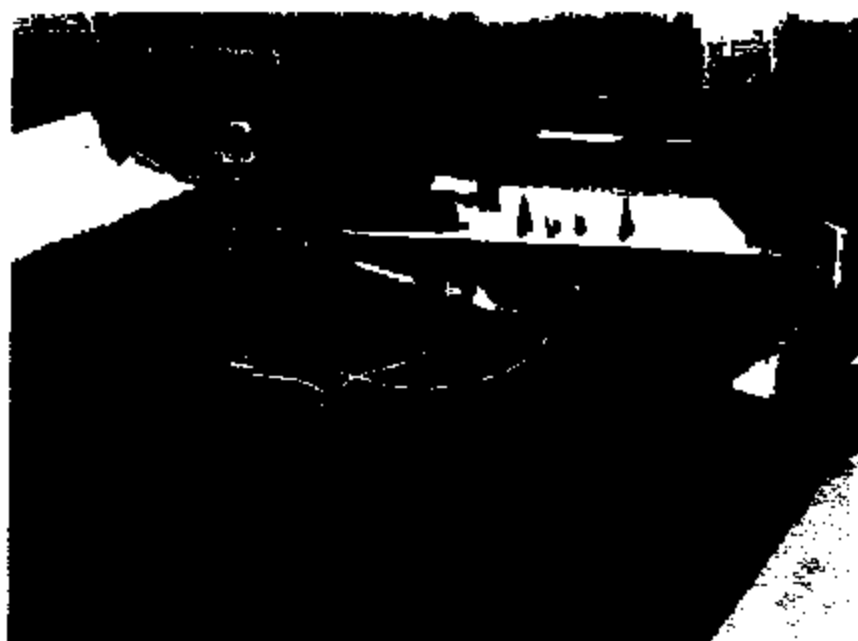



Kodak EasyShare
software

Organize, print and share your digital photos.

[Click here to get the software.](#)

How to save a picture

Simply right click on it and select "save image as." Mac users, click and drag the image to your desktop.

PE05-067
HEIL TRAILER
12/19/2005
EXHIBIT 3

Notification and Claim Status

CERT. LETTER									
Unit Count	VIN	MFG DATE	MODEL YEAR	RECEIPT		REPAIR STATUS	CLAIM #	CLAIM DATE	CLAIM STATUS
				DATE					
1	5HTAM2523Y7	4-Apr-00	2000	10/3/2005					
2	5HTAM2524Y7	22-Jun-00	2000	10/3/2005					
3	5HTAM242337	5-Aug-02	2003	10/3/2005					
4	5HTAM442537	28-Aug-02	2003	10/3/2005					
5	5HTAM252167	16-Sep-05	2006	10/3/2005					
6	5HTAM242747	25-Feb-04	2004	10/3/2005	Fixed	46795	19-Oct-05	APPROVED	
7	5HTAM242347	8-Mar-04	2004	10/3/2005	Fixed	46798	19-Oct-05	APPROVED	
8	5HTAM242927	26-Sep-01	2002	10/4/2005	Fixed	46659	30-Sep-05	CLOSED OR PAID	
9	5HTAM242027	26-Sep-01	2002	10/4/2005	Fixed	47080	19-Oct-05	CLOSED OR PAID	
10	5HTAM242227	16-Oct-01	2002	10/3/2005	Fixed	47195	19-Oct-05	APPROVED	
11	5HTAM242427	19-Nov-01	2002	10/4/2005	Fixed	47191	19-Oct-05	APPROVED	
12	5HTAM242647	12-Dec-03	2004	10/4/2005	Fixed	46663	30-Sep-05	APPROVED	
13	5HTAM242847	19-Jan-04	2004	10/4/2005					
14	5HTAM242X47	25-Feb-04	2004	10/4/2005					
15	5HTAM242147	17-Feb-04	2004	10/4/2005					
16	5HTAM242347	24-Mar-04	2004	10/4/2005	Fixed	46362	18-Aug-05	CLOSED OR PAID	
17	5HTAM242547	12-Mar-04	2004	10/4/2005	Fixed	46442	1-Sep-05	APPROVED	
18	5HTAM242747	26-Mar-04	2004	10/4/2005					
19	5HTAM242947	26-Mar-04	2004	10/4/2005	Fixed	46660	1-Sep-05	APPROVED	
20	5HTAM252557	24-Nov-04	2005	10/4/2005					
21	5HTAM252857	26-May-05	2005	10/4/2005					
22	5HTAM242937	18-Oct-02	2003	10/4/2005					
23	5HTAM252X57	26-May-05	2005	10/3/2005					
24	5HTAM252157	28-Jun-05	2005	10/3/2005					
25	5HTAM252167	15-Aug-05	2006	10/3/2005					
26	5HTAM252967	20-Sep-05	2006	10/3/2005					
27	5HTAM242037	18-Oct-02	2003	10/4/2005					
28	5HTAM242537	10-Dec-02	2003	10/4/2005					
29	5HTAM242737	14-Feb-03	2003	10/4/2005					
30	5HTAM242337	27-Mar-03	2003	10/4/2005	Fixed	46600	1-Sep-05	CLOSED OR PAID	
31	5HTAM242537	28-May-03	2003	10/4/2005					
32	5HTAM252947	25-Mar-04	2004	No Date	Fixed	46476	9-Sep-05	CLOSED OR PAID	
33	5HTAM242847	10-Nov-03	2004	No Date	Fixed	46658	30-Sep-05	CLOSED OR PAID	
34	5HTAM242X47	23-Dec-03	2004	No Date					
35	5HTAM242147	13-Jan-04	2004	No Date					
36	5HTAM252157	27-Sep-04	2005	9/30/2005					
37	5HTAM252357	27-Sep-04	2005	9/30/2005					
38	5HTAM252957	26-Jan-05	2006	9/30/2005					
39	5HTAM252057	28-Oct-04	2005	9/30/2005					
40	5HTAM252857	20-Jun-05	2005	9/30/2005					
41	5HTAM252X57	28-Jun-05	2005	9/30/2005					
42	5HTAM252X67	25-Jul-05	2006	9/30/2005					

44	5HTAM2428Y7	25-Jan-00	2000	9/30/2005				
45	5HTAM242XY7	25-Jan-00	2000	10/4/2005				
46	5HTAM242457	13-Aug-04	2005	9/30/2005				
47	5HTAM242657	17-Aug-04	2005	9/30/2005				
48	5HTAM242857	23-Aug-04	2005	9/30/2005				
49	5HTAM242X57	23-Aug-04	2005	9/30/2005				
50	5HTAM242157	27-Aug-04	2005	9/30/2005				
51	5HTAM242357	27-Aug-04	2005	9/30/2005				
52	5HTAM242557	9-Sep-04	2005	9/30/2005				
53	5HTAM242627	26-Mar-02	2002	9/30/2005				
54	5HTAM242227	21-Mar-02	2002	9/30/2005				
55	5HTAM242427	15-Mar-02	2002	9/30/2005				
56	5HTAM252X57	18-Mar-05	2005	10/6/2005				
57	5HTAM252157	29-Mar-05	2005	10/6/2005				
58	5HTAM252137	27-Jan-03	2003	9/30/2005				
59	5HTAM252037	22-Jan-03	2003	9/30/2005				
60	5HTAB212437	29-Jul-02	2003	9/30/2005	Fixed	49677	31-Oct-05	CLOSED OR PAID
61	5HTAM252347	4-Feb-04	2004	10/3/2005				
62	5HTAM252957	28-Jun-05	2005	10/3/2005				
63	5HTAM2528Y7	27-Jan-00	2000	9/30/2005				
64	5HTAM252947	5-Sep-03	2004	9/30/2005				
65	5HTAM252X47	22-Dec-03	2004	9/30/2005				
66	5HTAM252837	28-Apr-03	2003	9/30/2005				
67	5HTAM252037	28-Apr-03	2003	9/30/2005				
68	5HTAM252247	27-Apr-04	2004	10/10/2005				
69	5HTAM252757	28-Oct-04	2005	9/30/2005				
70	5HTAM252957	21-Oct-04	2005	9/30/2005				
71	5HTAM252057	15-Oct-04	2005	9/30/2005				
72	5HTAM252257	28-Oct-04	2005	9/30/2005				
73	5HTAM252457	28-Oct-04	2005	9/30/2005				
74	5HTAM252657	24-Nov-04	2005	9/30/2005				
75	5HTAM252257	24-Nov-04	2005	9/30/2005				
76	5HTAM252457	24-Nov-04	2005	9/30/2005				
77	5HTAM252657	24-Nov-04	2005	9/30/2005				
78	5HTAM252857	24-Nov-04	2005	9/30/2005				
79	5HTAM252267	29-Aug-05	2006	9/30/2005				
80	5HTAM252X17	7-Aug-00	2000	10/6/2005				
81	5HTAM252757	24-Nov-04	2005	No Date				
82	5HTAM252947	24-Sep-03	2004	10/1/2005				
83	5HTAM252547	8-Apr-04	2004	10/1/2005				
84	5HTAM252047	13-May-04	2004	10/1/2005				
85	5HTAM252957	9-Jun-05	2005	10/1/2005				
86	5HTAM252057	16-Jun-05	2005	10/1/2005				
87	5HTAM252967	29-Aug-05	2006	10/1/2005				
						47104	28-Nov-05	APPROVED

Figure 60.0

Status and Repair Information

Unit Count	VIN	MFG DATE	MODEL YR.	CLAIM #	SERVICE CENTER	ADDRESS	CITY	STATE	ZIP	PHONE
1	5HTAM2523Y7	4-Apr-00	2000							
2	5HTAM2524Y7	22-Jun-00	2000							
3	5HTAM242337	5-Aug-02	2003							
4	5HTAM442537	28-Aug-02	2003							
5	5HTAM252167	16-Sep-05	2006							
6	5HTAM242747	25-Feb-04	2004	48785	TERMINAL MANUFACTURING CO. INC		BERKLEY	CA		
7	5HTAM242347	8-Mar-04	2004	48798	TERMINAL MANUFACTURING CO. INC		BERKLEY	CA		
8	5HTAM242827	26-Sep-01	2002	48859	WEST-MARK		BAKERSFIELD	CA		
9	5HTAM242027	28-Sep-01	2002	47080	WEST-MARK		BAKERSFIELD	CA		
10	5HTAM242227	18-Oct-01	2002	47196	WEST-MARK		BAKERSFIELD	CA		
11	5HTAM242427	19-Nov-01	2002	47191	WEST-MARK		BAKERSFIELD	CA		
12	5HTAM242547	12-Dec-03	2004	48663	WEST-MARK		BAKERSFIELD	CA		
13	5HTAM242547	19-Jan-04	2004							
14	5HTAM242X47	25-Feb-04	2004							
15	5HTAM242147	17-Feb-04	2004							
16	5HTAM242347	24-Mar-04	2004	48352	WEST-MARK		BAKERSFIELD	CA		
17	5HTAM242547	12-Mar-04	2004	48442	WEST-MARK		BAKERSFIELD	CA		
18	5HTAM242747	26-Mar-04	2004							
19	5HTAM242947	28-Mar-04	2004	48660	BEALL TRAILERS OF SOCAL		BLOOMINGTON	CA		
20	5HTAM252557	24-Nov-04	2005							
21	5HTAM252857	29-May-05	2005							
22	5HTAM242837	18-Oct-02	2003							
23	5HTAM252X57	20-May-05	2005							
24	5HTAM252157	28-Jun-05	2005							
25	5HTAM252167	15-Aug-05	2006							
26	5HTAM252867	20-Sep-05	2006							
27	5HTAM242037	18-Oct-02	2003							
28	5HTAM242537	10-Dec-02	2003							
29	5HTAM242737	14-Feb-03	2003							
30	5HTAM242337	27-Mar-03	2003	48600	WEST-MARK		BAKERSFIELD	CA		
31	5HTAM242537	28-May-03	2003							
32	5HTAM252947	25-Mar-04	2004	48475	WEST-MARK		BAKERSFIELD	CA		
33	5HTAM242847	10-Nov-03	2004	48658	WEST-MARK		BAKERSFIELD	CA		
34	5HTAM242X47	23-Dec-03	2004							
35	5HTAM242147	13-Jan-04	2004							
36	5HTAM252157	27-Sep-04	2005							
37	5HTAM252357	27-Sep-04	2005							
38	5HTAM252957	28-Jan-05	2005							
39	5HTAM252067	28-Oct-04	2005							
40	5HTAM252857	20-Jun-05	2005							
41	5HTAM252X57	28-Jun-05	2005							
42	5HTAM252X87	25-Jul-05	2006							
43	5HTAM252167	27-Jul-06	2008							
44	5HTAM2428Y7	25-Jan-00	2000							
45	5HTAM242XY7	25-Jan-00	2000							
46	5HTAM242457	13-Aug-04	2005							
47	5HTAM242957	17-Aug-04	2006							
48	5HTAM242857	23-Aug-04	2006							
49	5HTAM242X57	23-Aug-04	2005							
50	5HTAM242157	27-Aug-04	2006							
51	5HTAM242357	27-Aug-04	2006							

53	5HTAM242222	20-Mar-02	2002				
54	5HTAM242222	21-Mar-02	2002				
55	5HTAM242427	15-Mar-02	2002				
56	5HTAM252X57	18-Mar-05	2005				
57	5HTAM252157	20-Mar-05	2005				
58	5HTAM252137	27-Jan-03	2003				
59	5HTAM252037	22-Jan-03	2003				
60	5HTAB212437	29-Jul-02	2003	48877	ROGERS REPAIR SERVICE	5882 ST. HELENS RD., N.W.	PORTLAND OR 97210 503-484-0135
61	5HTAM252347	4-Feb-04	2004				
62	5HTAM252957	28-Jun-05	2005				
63	5HTAM2528Y7	27-Jan-00	2000				
64	5HTAM252947	5-Sep-03	2004				
65	5HTAM252X47	22-Dec-03	2004				
66	5HTAM252937	28-Apr-03	2003				
67	5HTAM252037	28-Apr-03	2003	47104			
68	5HTAM252247	27-Apr-04	2004				
69	5HTAM252757	28-Oct-04	2005				
70	5HTAM252957	21-Oct-04	2005				
71	5HTAM252057	15-Oct-04	2005				
72	5HTAM252257	28-Oct-04	2005				
73	5HTAM252457	28-Oct-04	2005				
74	5HTAM252657	24-Nov-04	2005				
75	5HTAM252257	24-Nov-04	2005				
76	5HTAM252467	24-Nov-04	2005				
77	5HTAM252657	24-Nov-04	2005				
78	5HTAM252857	24-Nov-04	2005				
79	5HTAM252287	29-Aug-06	2006				
80	5HTAM252X17	7-Aug-00	2000				
81	5HTAM252757	24-Nov-04	2005				
82	5HTAM252947	24-Sep-03	2004				
83	5HTAM252547	8-Apr-04	2004				
84	5HTAM252047	13-May-04	2004				
85	5HTAM252957	8-Jun-05	2005				
86	5HTAM252057	10-Jun-05	2005				
87	5HTAM252987	29-Aug-05	2006				

Figure 00.8

PE05-067
HEIL TRAILER
12/19/2005
EXHIBIT 4



Date:

CERTIFIED MAIL/RETURN RECEIPT REQUESTED

Company Name
Address
City, State Zip
Owners Name

Re: Pull Trailer Frame Improvement

Heil Trailer International takes pride in manufacturing superior tank truck and trailer equipment and providing world class services to its customers that not only meet but exceed their expectations.

Confirming our prior conversations, we discovered that on some California Pull Trailers with air ride suspensions, a crack has developed behind one of the front suspension towers, and through the frame tube. The crack starts under the tube, just to the rear of the suspension tower mounting plate, at the base of the weld, and slowly moves around the tube. While the percentage of units that have failed is small, it is important that this area be looked at on all affected units immediately. **If a crack is found behind either hanger, the trailer must be taken out of service immediately and repaired with the kit referenced below before placing back in service.**

We have designed a repair kit to reinforce the area of concern to correct or prevent the possible cracks from starting. This kit should be added as soon as possible and until the kit is added the areas of concern should be examined once a week.

The repair procedure is illustrated on the two page attachment hereto.

Our records indicate that you and/or your customers and users have units listed on the following pages requiring this upgrade. If you are operating a Heil California pull trailer with air ride suspension which is not on this list, please follow the instructions above and notify us immediately. If you no longer own, operate or lease the trailers in question, please provide us with the party who does along with their contact information as soon as possible. Heil Trailer International's Technical Service Managers can be reached as follows:

David Morrow – 1-800-400-6913 ext. 353 or by e-mail at
dmorrow@heiltrailer.com

or

Mike Johnson – 1-800-400-6913 ext. 574 or by e-mail at
mjohnson@heiltrailer.com

Mike or David will make arrangements with you to get the upgrade installed on your units as quickly and conveniently as possible. They will locate the shops closest to you that have been approved to install the upgrade kit and schedule a convenient time for you. This upgrade will be done at no charge to you.

We greatly value your business and hope that you view this action as a positive demonstration of Heil's commitment to you. If you have any questions or would like additional information you can contact either of the Technical Service Managers listed, or me, Monday through Friday from 8 AM to 5 PM EDT.


Regards,

Lynn H. Moses


A handwritten signature in black ink, appearing to read "Lynn H. Moses". The signature is fluid and cursive, with the first letters of the first and last names being capitalized and prominent.

Director of Customer Services
Heil Trailer International


Attachments

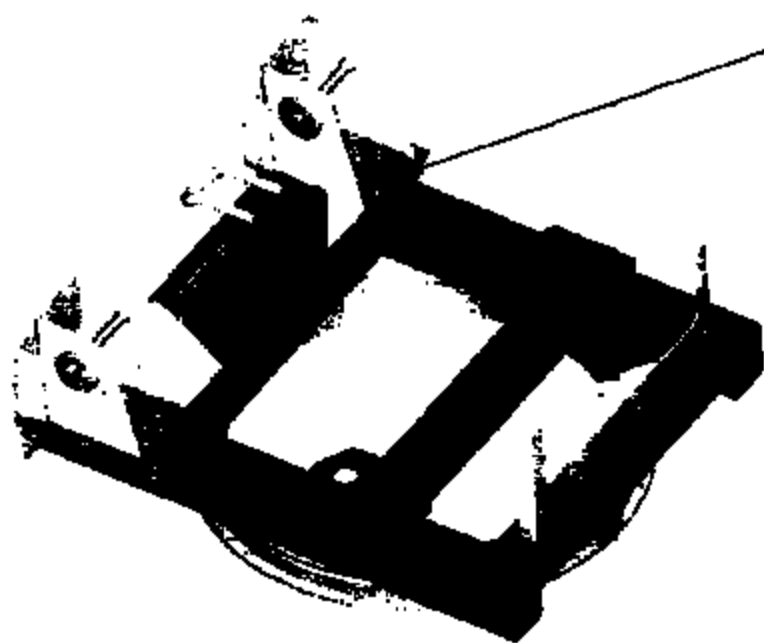


**Mark plate at
 $\frac{3}{4}$ in from end.
Both Sides.**

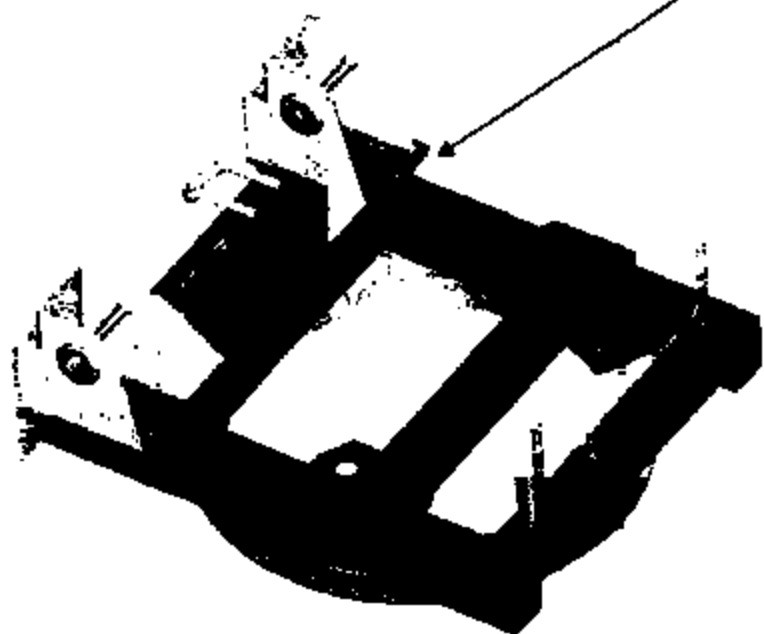

**Cut and remove end
of plate at mark.
Both Sides.
Grind off existing
weld.**

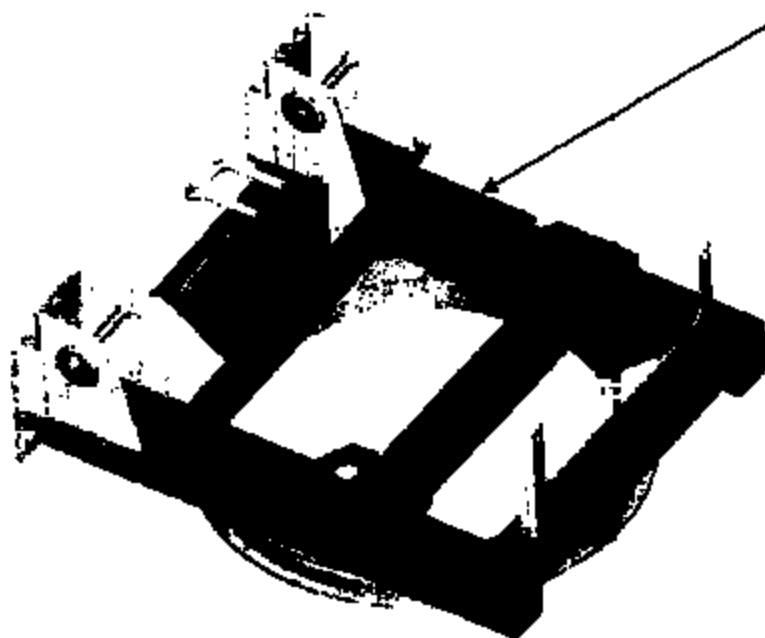

Locate 5in X 12in X
 $\frac{1}{4}$ in steel bar on
frame rails.
Both Sides.

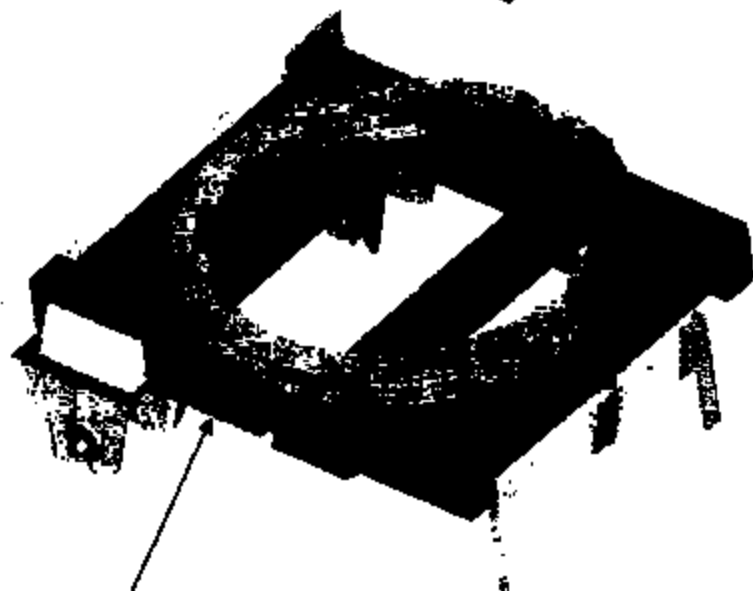

Weld, length-wise.

Both Sides.

(4) Places, total.

Weld the new plate to the existing mounting plate
for the suspension tower.

DO NOT Weld across the frame rail.

Beth Bennett

From: Randy Miller
Sent: Friday, September 02, 2005 12:12 PM
To: [REDACTED]
Cc: David Morrow; Lynn Moses; Steve Traversi
Subject: Heil Warranty
Attachments: 65866DollyCracked.JPG

Hi [REDACTED]

Please check the lower steel front turntable subframe on your new Heil pull trailers for signs of a crack behind the front suspension tower and the top plate attachment weld. We have experienced several instances of this on trailers manufactured in model runs near your seven units. This crack may be small & barely visible at first, and would occur near the bottom of the steel rectangular tube where it is attached with a weld to the top plate of the air ride suspension front tower. The attached photo shows the approximate location (look center, lower 1/3). The frame shown in the photo is cracked, but very difficult to see. This crack can sometimes be felt for with your fingernail, then be visible on closer inspection. If you find anything on these trailers, please call us at once for repair instructions.

Your warranty service manager is David Morrow. David's phone number is (800) 400-8913 ext. 353 and his email address is dmorrow@heiltrailer.com.

We appreciate your business. Call me any time if I can answer questions or be of service to you in any way.

Yours Very Truly,
Heil Trailer International
Randy Miller

12/13/2005

Beth Bennett

From: Mike Johnson
Sent: Friday, October 07, 2005 4:01 PM
To: 'w.fab@zianet.com'
Co: 'mdporter@zianet.com'; David Morrow
Subject: Pull Trailer Frame Improvement
Attachments: L-HTI re Pull Trailer Frame Improvement.pdf; epreauth.doc

John,

Here are the instructions for the repair we discussed this afternoon. Please review this information and give me a call if you have any questions. Please utilize the attached warranty pre-authorization form field template to provide me with an estimate for the labor hours you believe you will require. Once I receive your estimate I will provide you with a Warranty PO for the work. You can return it via my email address or the fax number I list in my contact information below.

If you would be so kind as to contact Martin Porter at Porter Oil and schedule this work into your shop I would be most grateful.

Best regards,



Technical Service Manager
Hell Trailer International
Toll Free 800-400-8813 Ext. 574
Direct 423-855-3487
Fax 423-744-8070

mjohnson@helltrailer.com

12/13/2005

Beth Bennett

From: Mike Johnson
Sent: Wednesday, October 19, 2006 5:25 PM
To: 'tmc@pacbell.net'
Cc: David Morrow
Subject: BP Arco Dolly Frame Modification
Attachments: CAAwGaqWt.pdf; L-HTI re Pull Trailer Frame Improvement.pdf

Attention: Kevin Cole

Kevin,

Attached above you will find my warranty authorization and our procedures for making the modification to the dolly frame. This is one of two units belonging to BP ARCO in Richmond, CA. The other unit in question also has a vessel leak. I will be sending you a separate email for that unit. If you have any questions please feel free to contact me.

Thanks,



Technical Service Manager
Hell Trailer International
Toll Free 800-400-8913 Ext. 574
Direct 423-855-3487
Fax 423-744-8070

mjohnson@helltrailer.com

12/13/2005



Heil Trailer International
4-7888888888

WARRANTY PREAUTHORIZATION

Invoice to:

5741 CORNELISON ROAD
6400 BLDG. A
CHATTANOOGA, TN 37411

Ship to:

TERMINAL MANUFACTURING CO. INC
707 GILMAN STREET
BERKLEY, CA 94710
KEVIN COLE

Date of Request 19-OCT-05**Heil Claim Number** [REDACTED]

THIS ACKNOWLEDGEMENT IS A COPY OF THE ORDER AS ENTERED AT OUR PLANT. PLEASE NOTIFY US AT ONCE OF ANY DISCREPANCIES.

Trailer Serial Number:**Unit Number:****Date of Manufacture:**

5HTAM242747 [REDACTED]

25-FEB-04

Trailer Type:**Customer (Owner):****Tank Age:**

TANK

2

Abbreviated Problem Description**Problem:**

Unit needs Heil Trailer International dolly frame improvement/modification.

Procedure:

Perform improvement/modification per attached information.

Labor: 700.00**Parts:****Other:****Total:** 700.00

Beth Bennett

From: Mike Johnson
Sent: Wednesday, October 19, 2005 5:31 PM
To: 'mci@pacbell.net'
Cc: David Morrow
Subject: BP ARCO Dolly Frame Improvement/Modification
Attachments: DAAxGaqWt.pdf, L-HTI re Pull Trailer Frame Improvement.pdf

Kevin,

Here is the second one. As I said in my earlier email this unit also has a leak that will need repair. I will be covering both under warranty.

Thanks,



Technical Service Manager
Heil Trailer International
Toll Free 800-400-6913 Ext. 574
Direct 423-855-3487
Fax 423-744-8070

mjohnson@heiltrailer.com

12/13/2005



Heil Trailer International
a TRIMCO company

WARRANTY PREAUTHORIZATION

Invoice to:

5741 CORNELISON ROAD
6400 BLDG. A
CHATTANOOGA, TN 37411

Ship to:

TERMINAL MANUFACTURING CO. INC
787 GILMAN STREET
BERKLEY, CA 94710
KEVIN COLE

Date of Request 19-OCT-05**Heil Claim Number** [REDACTED]

THIS ACKNOWLEDGEMENT IS A COPY OF THE ORDER AS ENTERED AT OUR PLANT. PLEASE NOTIFY US AT ONCE OF ANY DISCREPANCIES.

Trailer Serial Number:

5HTAM242347D67860

Unit Number:**Date of Manufacture:**

08-MAR-04

Trailer Type:

TANK

Customer (Owner):

[REDACTED]

Tank Age:

2

Abbreviated Problem Description**Problem:**

Unit requires Heil Trailer International dolly frame improvement/modification.

Unit also has a leak that needs to be repaired.

Labor: 800.00**Parts:****Other:****Total:** 800.00

Figure 5.1.b.

PE05-067
HEIL TRAILER
12/19/2005
EXHIBIT 5

