

Service Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



MAZDA

INFORMATION REDACTED PURSUANT TO THE FREEDOM
OF INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6)

Subject:

FLUID LEAKAGE FROM BRAKE RESERVOIR CAP

Bulletin No:

Last Issued: 11/15/2002

APPLICABLE MODEL(S)/VINS

2001-2002 Tributes


INFORMATION Redacted PURSUANT TO THE FREEDOM OF
INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6)

DESCRIPTION

Some vehicles may exhibit fluid leakage from the brake reservoir cap. This may be caused by the insufficient sealing of the cap.

To improve the sealing, a new brake reservoir cap is available to prevent this condition.

Customers having this concern should have their vehicle repaired using the following procedure.

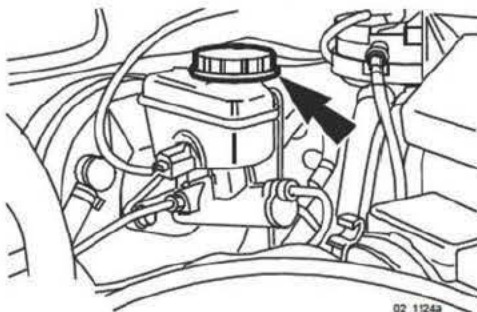

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership.

REPAIR PROCEDURE

1. Verify concern.
2. Remove the brake reservoir cap by turning counterclockwise.
3. Install a new cap and turn it clockwise to secure.

NOTE: Turn the cap until it completely stops.



4. Replace Caution Label with a new one. (You can attach the new label over the old one.)

NOTE:

- Be aware of the direction of the label: the text part faces toward the front of the vehicle.
- To prevent the label from peeling off, wipe the leaked fluid or dust completely off the tank.
- You can use brake cleaner to degrease if necessary.

PART(S) INFORMATION

Part Number		Description	Qty.	Notes
New	Old			
[REDACTED]	[REDACTED]	Cap (Brake Fluid Reservoir Tank)	1	A

A: The new part can be used in place of the former part, but the former part cannot be used in place of the new part.

Bulletin No: [REDACTED]	Last Issued: 11/15/2002
-------------------------	-------------------------

WARRANTY INFORMATION

Note: This information applies to verified customer complaints on vehicles covered under normal warranty.
Refer to the SRT microfiche for warranty term information.

Warranty Type	A
Symptom Code	76
Damage Code	97
Part Number Main Cause	[REDACTED]
Quantity	1
Operation Number / Labor Hours	XX434XRX / 0.2 (Cap replacement and label attachment)