

PE06-048

MAZDA

1-25-2007

APPENDIX 7

7A

Issued Date 2003 Yr 5 Mo 9 Day

Field Quality Information Report (FQIR)

SAID: [REDACTED]

Dist Code & Country Name M101A United States Reporter MNAO Technical Service Dept. R. Shimizugawa S. Limtiaco T. Shiba		Accessories	
		Unknown	
		Information from	Hot_Line
Subject			
ABS harness burned		Model MY	02MY TRB ES XA CBL CKD
Car Spec.	Eng. CE(DOHC/SOHC)/DE/RE	MT 3. 4. 5. 6 Gear	Differential
	Carburetor/EGI/Turbocharger/LPG/Direct Inject	AT 3. 4 Gear	W/LSD. Normal
	Steering System	Brake W/ABS. W/TCS	Suspension Type
	W/P/S. W/O P/S	Drum(Fr. Rr) Disc(Fr. Rr)	IRS. SLS
Body SDN. Coupe. Hardtop. H/B. Wagon. Van. Pick Up Truck. W-Cab. Cab-Plus		Others	
Chassis No.		Mileage	Prod. Date
1 4F2CU08162K [REDACTED]		50,684 mile	02/01/29
2		mile	
Customer Complaint		ABS harness burned	
Problem Situation	Problem Description (5W+1H)	A customer states that smoke emitted from the engine room when the vehicle was parked. It was put out by fire extinguisher.	
	Condition (When, Where)	This vehicle doesn't have any repair history related the brake parts.	
SA Result	Investigation Result	A technician was able to drive the vehicle into the service shop. It had normal brake operation. ABS harness, connector and ABS hydraulic unit were burned.	
	Possible Cause		
DLR/Dist. Disposal	Action	Replaced the harness and ABS hydraulic unit assembly.	
	Result of repair	OK	
MNAO PSE & FQS Comment	This is the first case of this concern. We are not sure if there is a harness short inside the ABS connector, but we are afraid that the cause might be made by brake fluid that coming from the reserver tank as fluid leak.		
		Parts Number	

Photo/Illustration

Ref No Y113-328

#1



#2

#3

#4

#5

#6

PE06-048

MAZDA

1-25-2007

APPENDIX 7

7B

MNAO- SN#	F/L	P/C	Warranty#	Cat	Subject	Mazda Part #	Source	Ref #	VIN 4F2*U0***1*	Build Date	Symptom	Follow up method marked indiv- duality	P/C (VAT)	P/S/ D	Root Cause	Containment Action (Dates)	Permanent Corrective Action	Open Date (MM/MTG)	Watch/ Close Date	Days Open	next Report at	Current Status
1859				P	ABS harness burnt		FCI	YU3- 328	4F2CU08162K	02/01/29	smoke emitted from the engine room when the vehicle was parked. This vehicle doesn't have any repair history related the brake parts Mileage= 50584 miles. A technician was able to drive the vehicle into the service shop. It had normal brake operation. ABS harness, connector and ABS hydraulic unit were burned.	Indivi- duality						03/05/29	NA			5/9/03 Received YU3-328 5/12/03 Requested collect concern part. 5/27/03 FQS shipped concern part to PVT. 5/29/03 PVT received the part. Looks heat came from outside of the ABS hydraulic unit.