

U.S. Department of Transportation

National Highway Traffic Safety Administration

ODI RESUME

Investigation: PE 08-071

Date Opened: 12/15/2008 Date Closed: 05/29/2009

Principal Investigator: Lee Strickland

Subject: Interior Door Handle Laceration Hazard

Manufacturer: Hyundai Motor Company Products: 2002-2003 Hyundai Sonata

Population: 154,401

Problem Description: Peeling or separation of chrome plating on interior door handle may expose

sharp edges and pose a laceration hazard.

FAILURE REPORT SUMMARY

	ODI	Manufacturer	Total
Complaints:	5	276	281
Crashes/Fires:	0	. 0	0
Injury Incidents:	8	143	151
# Injuries:	8	143	151
Fatality Incidents:		0	0
# Fatalities:	0	0	0
Other*:	0	23,463	23,463

*Description of Other: Warranty claims filed by dealers.

Action: This Preliminary Evaluation is closed. Recall No. 09V-171.

Investigator: <u>Lee Strickland</u> LHS

Div. Chief: <u>Thomas Z. Cooper</u> Office Dir.: <u>Kathleen C. DeMeter</u> Date: <u>05/29/2009</u> Date: <u>05/29/2009</u> Date: <u>05/29/2009</u>

Summary:

The manufacturer has issued a safety recall notification (09V-171) as a result of this investigation. The recall affects 91,202 MY 2002-2003 subject vehicles produced from January 28, 2002, through March 22, 2003.

The vehicle recall population was defined by the manufacturer's use of a new supplier for the chrome plating process beginning in January 2002, and a production change in March 2003 to improve adhesion of the plating to the door handle. Vehicles being recalled represent 59 percent of the total MY 2002-2003 production, but account for 91 percent of the consumer complaints received. The process change for MY 2002 vehicles resulted in a dramatic increase in complaints (1200 percent on a per unit rate basis). MY 2003 vehicles built after March 2003 production change showed a similar decline in the complaint rate.

Based on the manufacturer's action, this investigation has been closed.