

Crown Victoria / Grand Marquis Full Face Wheel Populations

Vehicle Build Date	RQ Description	Service Action	Wheel Part Number	PE03-009 Description
3/2002 - 6/2002	S1	03S05	3W73-1007-CD	Level 1
7/2002 - 9/2002	S2	03S05	3W73-1007-CD	Level 2
10/2002 - 4/2003	M	03M03	3W73-1007-CD	Level 3 & 4
5/2003 - 2/2004	CF		3W73-1007-CF	
3/2004 - Present	AA		4W73-1007-AA	

Design Change Table

EA04-034
Appendix F
6/1/2005


Steel Wheel - 16x7.0
Base Part Number: 1007

Vehicles where the part is, or could be, installed for vehicle production.	Approximate Date Incorporated into Wheel Production	Approximate Date Incorporated Into Vehicle Production	Description Of Change	Reasons For Change	Original Ford Production/ Engineering part number	Original Ford Service Part Number	New Ford Production/ Engineering part number	New Ford Service Part Number	Date original service part withdrawn from sale	Approximate Date Available for Service	Supplier
2003 Ford Crown Victoria, Mercury Grand Marquis	3/23/2002	Job #1 03/29/2002	Production start for 16x7.0 full face wheel	N/A	N/A	N/A	3W73-1007-CD	3W7Z-1007-CA (7 window)	N/A	03/26/02	Hayes - Lemmerz
2003 Ford Crown Victoria, Mercury Grand Marquis	6/17/2002	06/23/2002	Process modification of weld parameters	Robustness improvement	3W73-1007-CD	3W7Z-1007-CA	No part number change	No part number change	N/A	06/23/2002	Hayes - Lemmerz
2003 Ford Crown Victoria, Mercury Grand Marquis	9/23/2002	09/30/2002	Process modification of weld parameters	Robustness improvement	3W73-1007-CD	3W7Z-1007-CA	No part number change	No part number change	N/A	09/30/2002	Hayes - Lemmerz
2003, 2004 Ford Crown Victoria, Mercury Grand Marquis	4/23/2002	04/30/2003	Modification of rim fitment to disc, increase rim thickness and modified weld parameters	Robustness improvement	3W73-1007-CD	3W7Z-1007-CA	3W73-1007-CF	3W7Z-1007-DA (7 window)	N/A	05/01/03	Hayes - Lemmerz
2004 Ford Crown Victoria, Mercury Grand Marquis	2/6/2004	02/16/2004	Increased brake vent windows on disc	Increased brake vent	3W73-1007-CF	3W7Z-1007-DA	4W73-1007-AA	4W7Z-1007-AA (12 window)	N/A	02/13/04	Hayes - Lemmerz
2005 Ford Crown Victoria, Mercury Grand Marquis	12/6/2004	12/13/2004	Added shot-peen process	Robustness improvement	4W73-1007-AA	4W7Z-1007-AA	5W73-1007-AA	5W7Z-1007-AA (12 window)	12/24/2004	12/1/2004	Hayes - Lemmerz
2003 - 2004 Ford Crown Victoria, Mercury Grand Marquis - service only	12/1/2004	N/A - service only	Added shot-peen process	Robustness improvement	3W73-1007-CF	3W7Z-1007-DA	3W73-1007-CG	3W7Z-1007-F (7 window)	2/24/2005	12/1/2004	Hayes - Lemmerz

Point of contact information for Hayes-Lemmerz:
Chris Putz, Engineering Director
15300 Centennial Drive
Northville MI 48167
Phone: (734) 737-5438

Point of contact information for Metal Improvement Company:
Randy Randleman, Division Manager
440 N. West Rd.
Wellington, KS 67152
Phone: (620) 326-5509

Alleged Cracked Wheel R/1000 as of 8/1/03 and 8/4/04 (CF only)

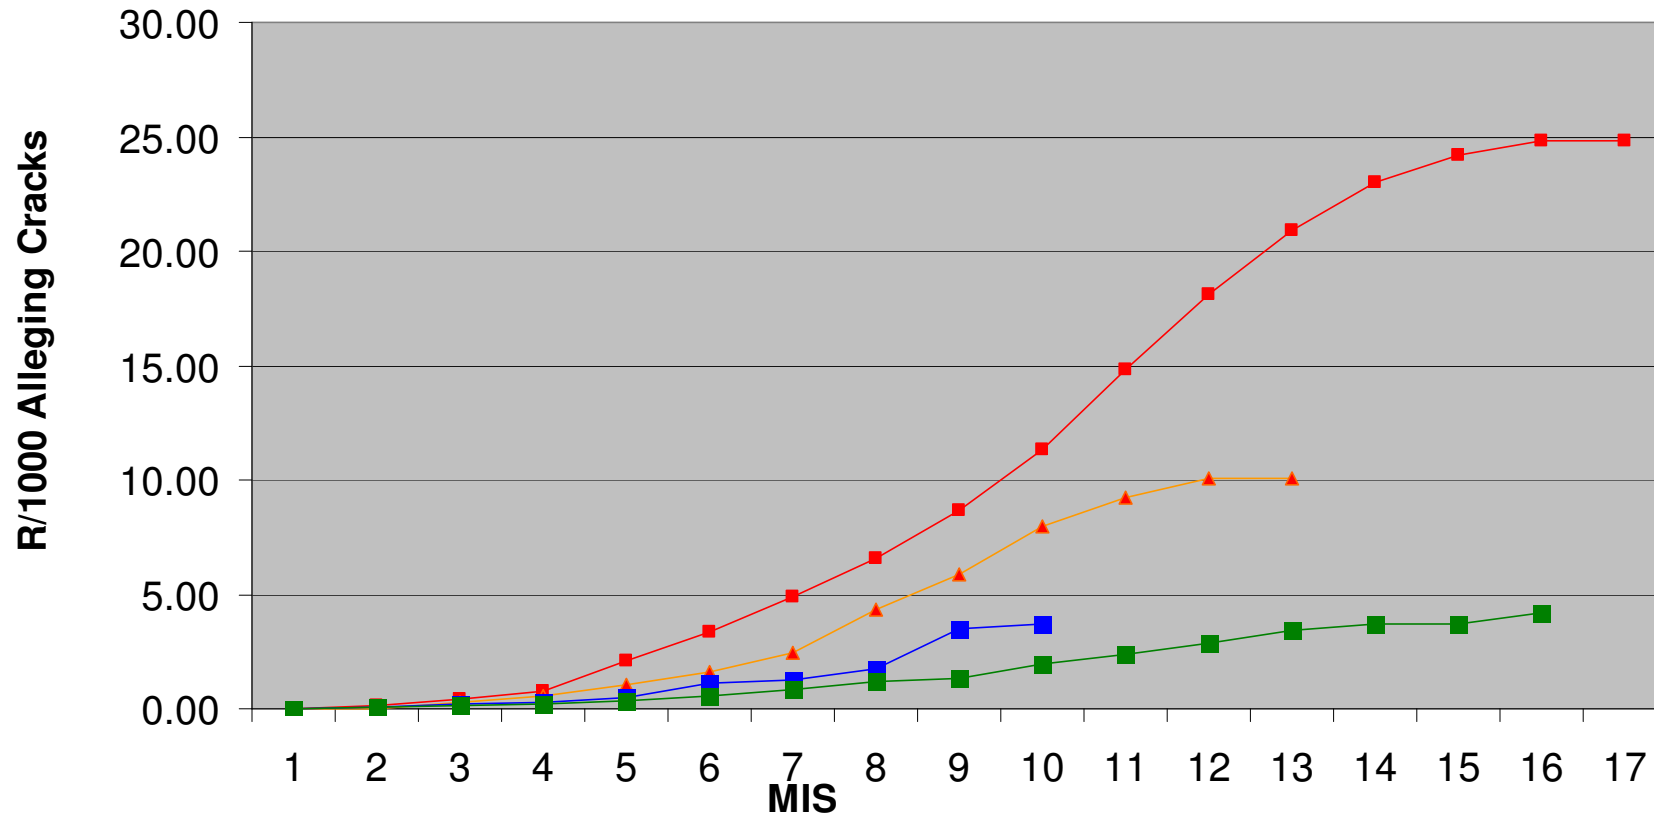

—■— S1 Fleet R/1000 —▲— S2 Fleet R/1000 —■— M Fleet R/1000 —■— CF Fleet R/1000

SSV_Rate

Inquiry PE08-070
Expedition MY2004-2006
SPECIAL SERVICES EQUIPMENT PACKAGE
R/1000 Estimation

