

Quality Information Report

Subject: Brake Switch INOP

Mark "X"	General	Early Warning	Serviceability	Port	Monitoring	VDS
QIR Type		X				

Model Code	Subject Code	Severity	HMA Report Number
(BH) Genesis	Chassis	5	QABH-
VIN	Analyst	Vendor	Causal Part Number
KMHGC46E09U [REDACTED]	Rod Maralit	Mando	938100W00
Nature Code	Mileage	Lot #	Op Code
N 94	354	8F13	93810
Cause Code	Production Date	Repair Date	Delivery Date
C15	20080620	20080924	2008

1. Issue Description

Customer Complaint: Check Engine Light On
DTC Codes: (2) P0504 – Brake Switch "A"/"B" Correlation, (1) C1513 – Brake Switch Error, (1) Will not shift out of "P" Park


2. Part Analysis

Corrosion on the main contact point.
Unknown source



3. Data Analysis

Conclusions: 93810 – All models with a brake switch issue from Jan, 2008 to present

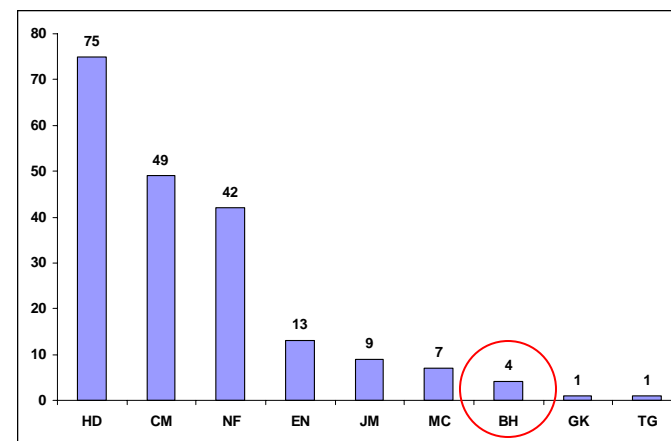

4. HMA Request

- Production C/M: None
- Port action: None – looking at average mileages – this issue take time to develop.
- Field fix: Request a field fix TSB for this issue if a countermeasure is available.
- TSB: None at this time
- C/M Part: Please provide a new p/n when issuing a C/M
- Other comment: None

HMA Request	YES	NO
C/M Part		X
Field Fix TSB		X
Port Campaign		X
Dealer Campaign		X

Item	Date
QIR Issued	20081024
Part Sent	20081024
QIS Received	2008

C/100 (Claims)	Techline	FSE	IQS	Mimic
0.11 (4)	0	1	0.0	0.0

*Current MY data ONLY

Duplicate Report	YES	NO	Prev QIR
		X	

Incident Parts Available	
Part # (s)	Qty
938100W00	2

QABH-C-081026

HYUNDAI

QUALITY INFORMATION
REPORT

CONFIDENTIAL

Model Code BH	Subject Code* CHASSIS	Severity Code 5	HMA Report Number QABH-C-081026	
Creation date/time/user: 10/24/2008 05:48:06 PM by Rhodelio Maralit		Analyst:* Rhodelio Maralit	Co-analyst(s):	Modified date/time/user: 10/24/2008 05:48:00 PM by
Distributor* HMA	Country* USA	Vendor Info Mando	Causal part No 938100W00	Attachments Yes <input type="checkbox"/> Movie <input type="checkbox"/> Photo <input type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model* BH	Engine or Transmission #* N/A	Lot # 8F13	Production Date* (MM/DD/YY) 02202008	
VIN* KMHGC46E09U [REDACTED]	Mileage* 354	Repair Date (MM/DD/YY) 09242008	Delivery Date* (MM/DD/YY) 08202008	
Subject* [B] (EARLY WARNING) BRAKE SWITCH INOP - HMC				

Types of QIR					
<input type="checkbox"/> General	<input checked="" type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date:

Report Number : QABH-C-081026

- Customer statement:
- Technician statement:
- Customer driving habit / operation condition:
- Road condition:
- Weather condition:
- Vehicle speed:
- Number of passengers:
- Region:
- Other comments:

Analysis:

Date:

Report Number : QABH-C-081026

Corrective Action:

Date:

Report Number : QABH-C-081026

- Dealer fix:
- Repair procedure:

Comments and Recommendations:

Date:

Report Number : QABH-C-081026

- Production C/M:
- Port action:
- Field fix:
- TSB:
- Other comment:

Attachments:

Date:

Report Number : QABH-C-081026



BH Brake Lamp Switch QIR.ppt

QACM-C-061107

Attachment

QUALITY INFORMATION REPORT

CONFIDENTIAL


Model Code	Subject Code*		HMA Report Number	
CM	CHASSIS			
Creation date/time/user:	Analyst:*	Co-analyst(s):	Modified date/time/user:	
	CASEY SHAH	ROB RAMOS		
Distributor*	Country*	Date	HMC Report Number	Attachments
HMA	USA	11/07/2006		<input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model*	Engine or Transmission Number*		Production Date*	
SANTA FE	G6EA6A636121		6/26/2006	
Vehicle Identification Number*	Mileage*	Delivery Date*		
5NMSG13D97H [REDACTED]	28	10/23/2006		
Subject*				
[B] STOP LAMP SWITCH INTERMITTENTLY MALFUNCTIONING (EARLY WARNING) - HMMA				

1. Condition:


- The ESC light is ON.

2. Analysis:


- The dealer technician confirmed the condition.
- The High Scan retrieved DTC C1513 (Brake Switch Error).
- Replacing the stop lamp switch, P/N: 93810-3K000, corrected the condition.
- The incident switch was sent to HMA for analysis.
- The incident switch was checked statically on the bench with a multi meter.
- The brake switch checked OK as shown.

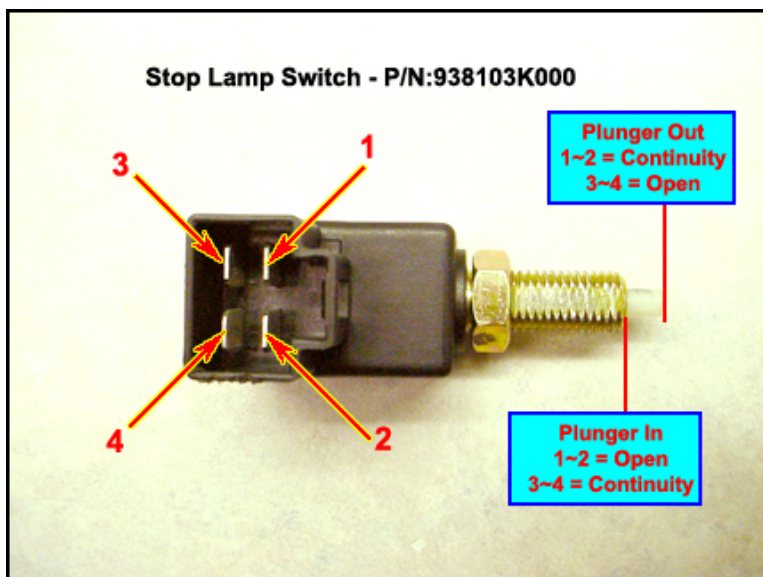

- The stop lamp switch was then installed in the vehicle as shown and operated with fingers simulating brake application.

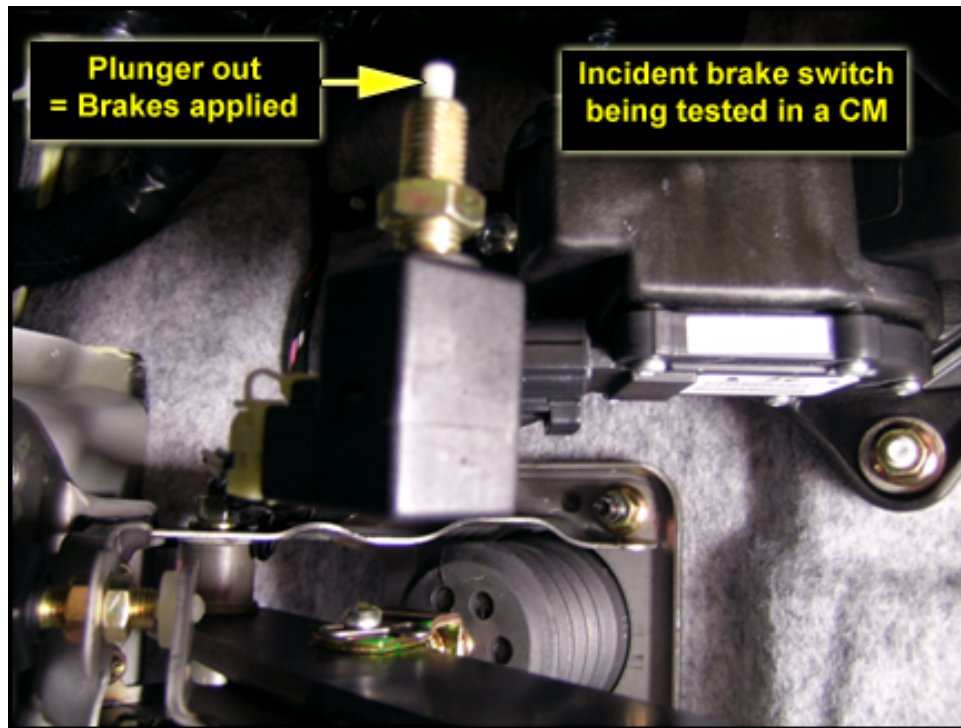


- Under voltage load, the switch got very hot on the switch surface as shown.

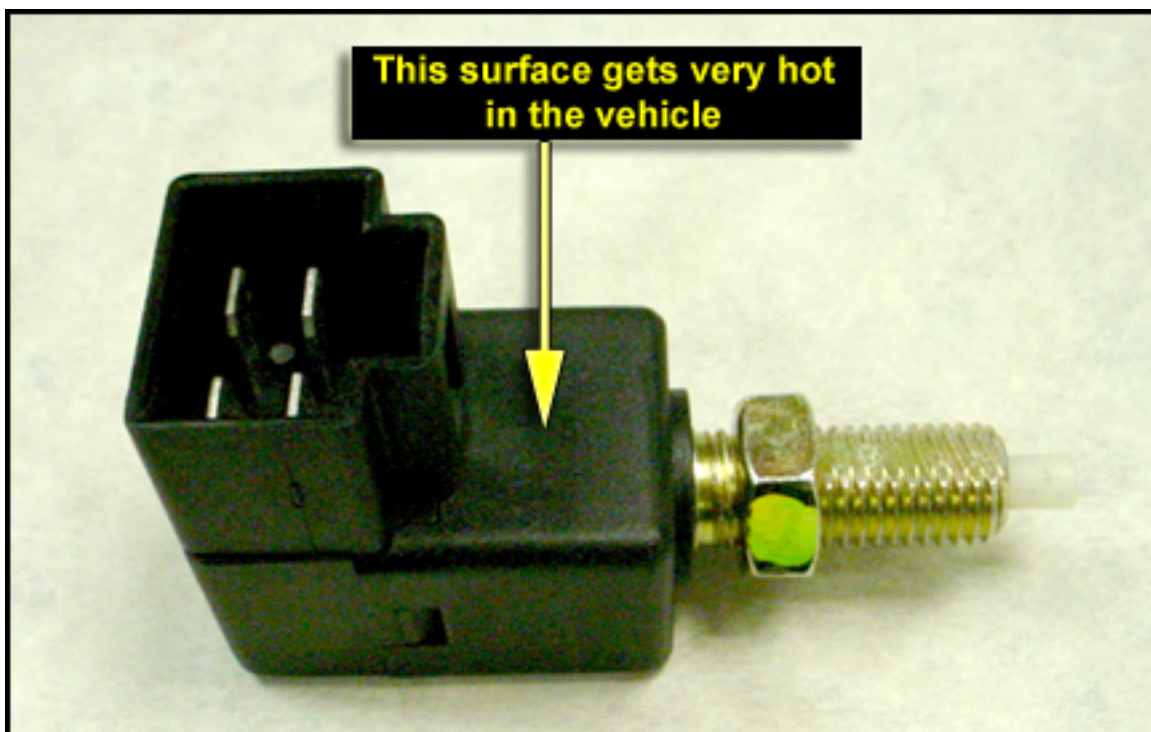


- Also the rear lamps would not turn ON intermittently with the brakes applied condition (switch plunger out) as shown.



- The switch status data was monitored with the High-Scan that also showed switch in the OFF position with the plunger out condition.

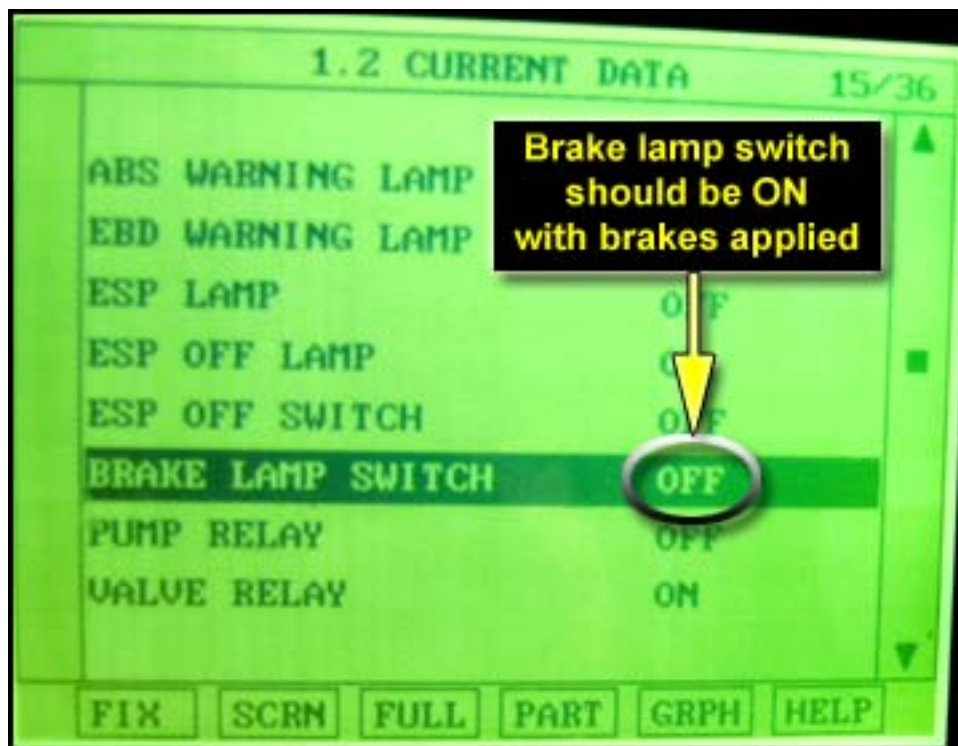

- To confirm this condition, the voltage levels were measure between the stop lamp switch terminals 1&2 and 3&4 with a voltmeter which measured to be zero volts.
- The water fall chart provides the following information.

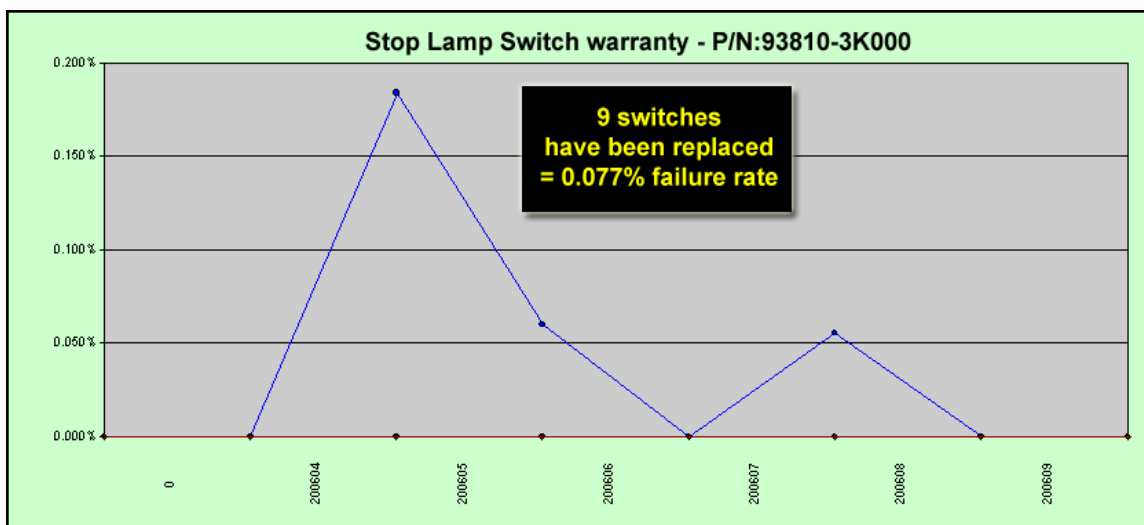

- The TABLE below shows all affected VINs.
Note: The incident vehicle was repaired again at 146 miles.

VIN Number	Prod Date	Mileage	Total Cost
5NMSH13E67H0	2006-05-20	1315	\$48.80
5NMSH13E77H0	2006-05-31	3295	\$169.70
5NMSH13E77H0	2006-08-01	1824	\$57.50
5NMSG13D97H0	2006-06-26	146	\$38.00
5NMSG73D77H0	2006-05-08	1045	\$54.50
5NMSH73E37H0	2006-05-03	1377	\$61.70
5NMSG13D77H0	2006-05-22	3298	\$32.60
5NMSH13E97H0	2006-05-25	21	\$169.70
5NMSG13D97H0	2006-06-26	28	\$32.90
			\$665.40

- The cause of the switch continuity problem under heat is not known; however, switch plate distortion and/or the plunger sticking under heat are some possibilities.

3. Action:

- Replace stop lamp switch, P/N: 93810-3K000.

4. Comment/Recommendation:

- HMMA should test the incident stop lamp switches sent with this report to confirm switch continuity problem under electrical load or test the switches to determine the root cause of the switch malfunction and apply corrections as necessary.

5. Attachments:

```
WPR008C M00021791      Hyundai Motor America      11/07/2006
CSHAH                  Claim Inquiry                15:21:44
Inquiry

Dealer Code : VA014 POHANKA HYUNDAI OF FRDRCKSBRG   Pay Percent: 100.00
Claim No    : 381219 R/O No: 381219 Version: 00     Sublet $ : .00
R/O Date Open: 10/19/2006 Close: 10/19/2006         Sublet Type:
Claim Status : A Approve Labor Rate: 72.00 Labor $ : 21.60
Claim Type  : W New Veh. LTD Warranty Parts $ : 11.30
PWA Type    : Freight $ : .00
Rental Days : 0 Rental AMT: .00 Towing $ : .00
Trans Type  : Automatic Total $ : 32.90
VIN Number  : 5NMSG13D97HI Santa Fe (CM) 2007 Month In Service: .0
Sell Dealer : VA014 POHANKA HYUNDAI OF FRDRCKSBRG Mileage : 28
Org Owner   : TONGUE, TYNESHA S
HPP Contract : HPP: HCP:
Nature: N69 WARNING LIGHT ON Cause: C15 POOR CONTACT & SHORT
Condition :
Causal Part : 938103K000 Grp: 16 Main OP: 93810R00 Hour: .3 Qty: 1
              SWITCH ASSY-STOP LAMP(4P) SWITCH ASSY-STOP LAMP
```

QACM-C-061107

HYUNDAI**QUALITY INFORMATION
REPORT****CONFIDENTIAL**

Model Code CM	Subject Code* CHASSIS	Severity Code	HMA Report Number QACM-C-061107	
Creation date/time/user: 11/07/2006 04:39:29 by Casey Shah		Analyst:* Casey Shah	Co-analyst(s):	Modified date/time/user: by
Distributor* HMA	Country* USA	Vendor Info	Causal part No	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model* SANTA FE	Engine or Transmission #* G6EA6A636121	Lot #	Production Date* (MM/DD/YY) 06-26-2006	
VIN* 5NMSG13D97H [REDACTED]	Mileage* 28	Repair Date (MM/DD/YY)	Delivery Date* (MM/DD/YY) 10-23-2006	
Subject* [B] STOP LAMP SWITCH INTERMITTENTLY MALFUNCTIONING (EARLY WARNING) - HMMA				

Types of QIR					
<input type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date: 11/07/2006

Report Number :


- The ESC light is ON.

Analysis:


Date: 11/07/2006

Report Number :


- The dealer technician confirmed the condition.
- The High Scan retrieved DTC C1513 (Brake Switch Error).
- Replacing the stop lamp switch, P/N: 93810-3K000, corrected the condition.
- The incident switch was sent to HMA for analysis.
- The incident switch was checked statically on the bench with a multi meter.
- The brake switch checked OK as shown.

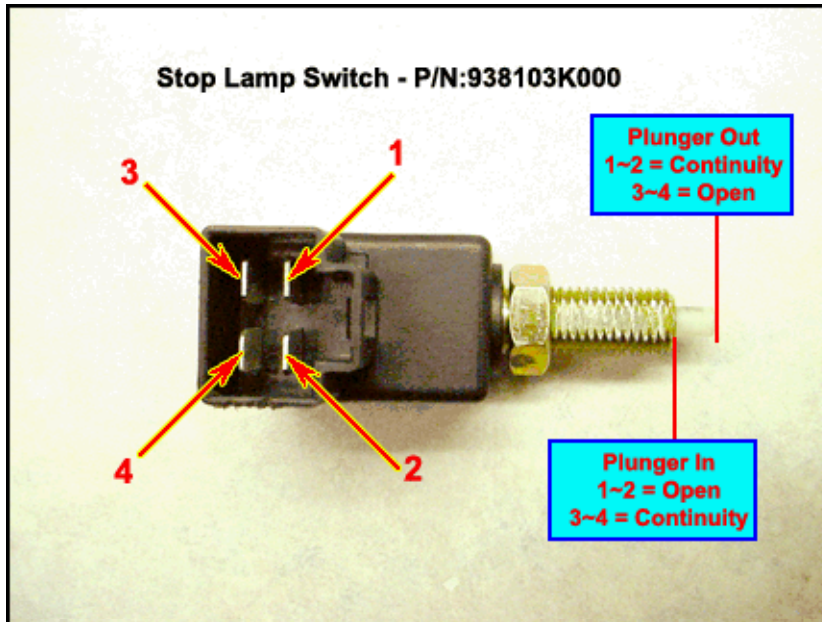

- The stop lamp switch was then installed in the vehicle as shown and operated with fingers simulating brake application.

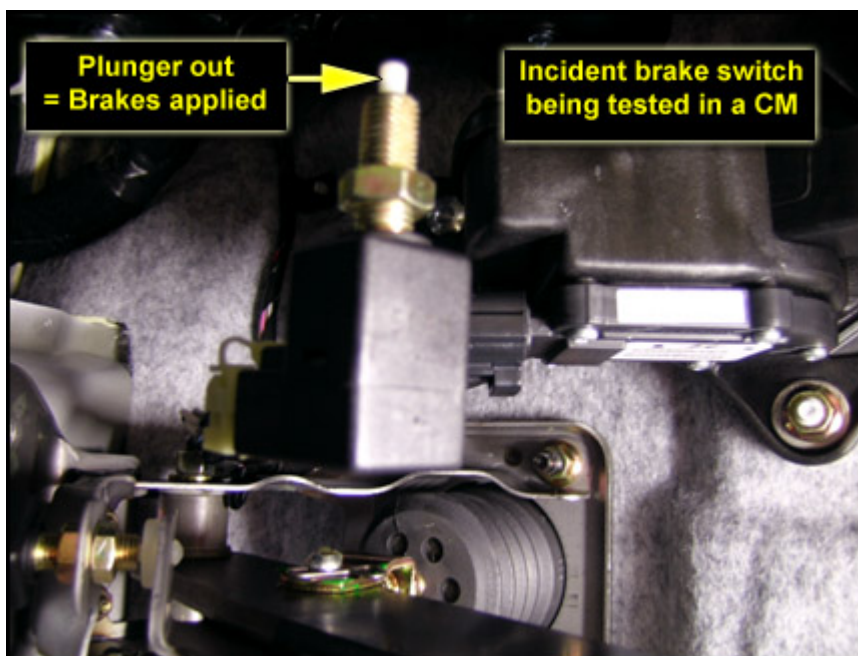


- Under voltage load, the switch got very hot on the switch surface as shown.

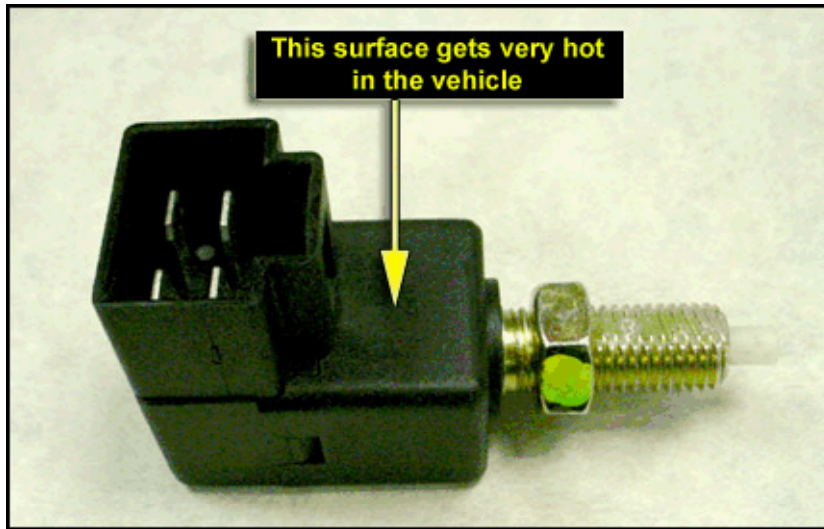


- Also the rear lamps would not turn ON intermittently with the brakes applied condition (switch plunger out) as shown.



- The switch status data was monitored with the High-Scan that also showed switch in the OFF position with the plunger out condition.

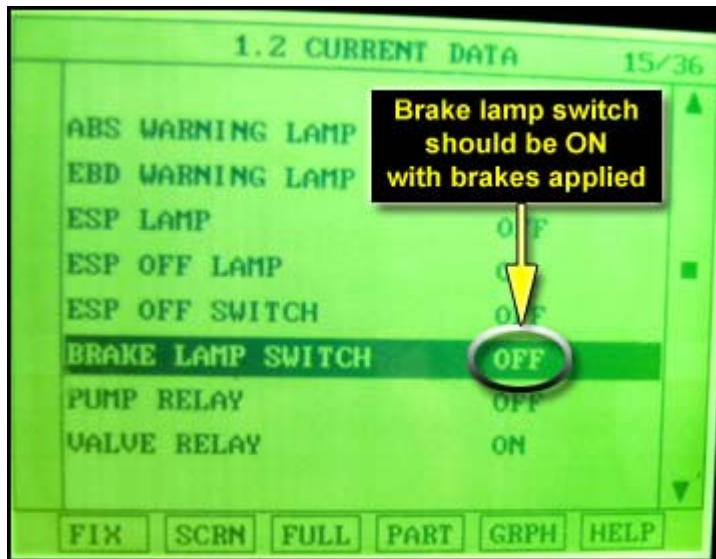

- To confirm this condition, the voltage levels were measure between the stop lamp switch terminals 1&2 and 3&4 with a voltmeter which measured to be zero volts.
- The water fall chart provides the following information.

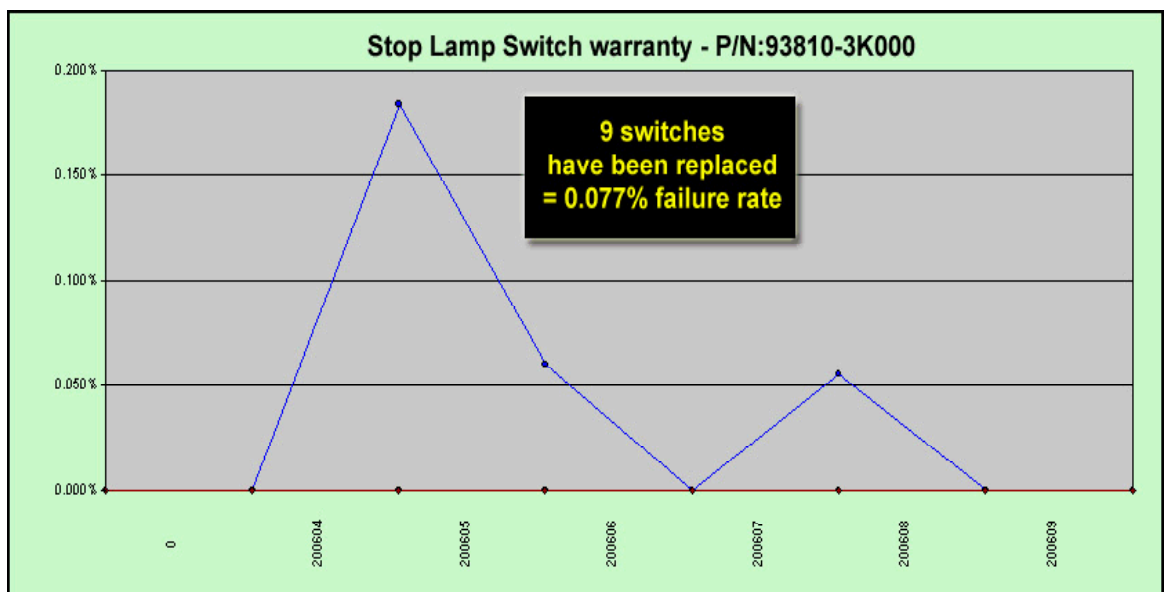

- The TABLE below shows all affected VINs.
- Note: The incident vehicle was repaired again at 146 miles.**

VIN Number	Prod Date	Mileage	Total Cost
5NMSH13E67H0	2006-05-20	1315	\$48.80
5NMSH13E77H0	2006-05-31	3295	\$169.70
5NMSH13E77H0	2006-08-01	1824	\$57.50
5NMSG13D97H0	2006-06-26	146	\$38.00
5NMSG73D77H0	2006-05-08	1045	\$54.50
5NMSH73E37H0	2006-05-03	1377	\$61.70
5NMSG13D77H0	2006-05-22	3298	\$32.60
5NMSH13E97H0	2006-05-25	21	\$169.70
5NMSG13D97H0	2006-06-26	28	\$32.90
			\$665.40

- The cause of the switch continuity problem under heat is not known; however, switch plate distortion and/or the plunger sticking under heat are some possibilities.

Corrective Action:

Date: 11/07/2006

Report Number :

- Replace stop lamp switch, P/N: 93810-3K000.

Comments and Recommendations:

Date: 11/07/2006

Report Number :

HMMA should test the incident stop lamp switches sent with this report to confirm switch continuity problem under electrical load or test the switches to determine the root cause of the switch malfunction and apply corrections as necessary.

Attachments:

Date: 11/07/2006

Report Number :



QIR 71 CM Stop SW.doc

QACM-C-070108

Attachment

QUALITY INFORMATION REPORT

CONFIDENTIAL


Model Code	Subject Code*		HMA Report Number	
CM	CHASSIS			
Creation date/time/user:	Analyst:*	Co-analyst(s):	Modified date/time/user:	
	CASEY SHAH			
Distributor*	Country*	Date	HMC Report Number	Attachments <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
HMA	USA	1/8/2007		
Model*	Engine or Transmission Number*		Production Date*	
SANTA FE	G6EA6A636121		6/26/2006	
Vehicle Identification Number*		Mileage*	Delivery Date*	
5NMSG13D97H [REDACTED]		146	10/23/2006	
Subject*				
[B] STOP LAMP SWITCH IN-OPERATIVE (EARLY WARNING) - HMMA				

1. Condition:

The customer complained that the brake light stays ON.


2. Analysis:

- The dealer technician confirmed the condition.
- The rear stop lamps stayed ON after the brake was released and the ignition was turned OFF.
- The Hi-Scan Pro retrieved the DTC P0504 (Brake switch – A/B correlation).
- Replacing the stop lamp switch, P/N: 93810-3K000, corrected the condition.
- The incident part was sent to HMA for analysis.
- The photo below shows the incident switch and the continuity check results.
- Accordingly, the stop lamp switch was determined to be OK (static condition).

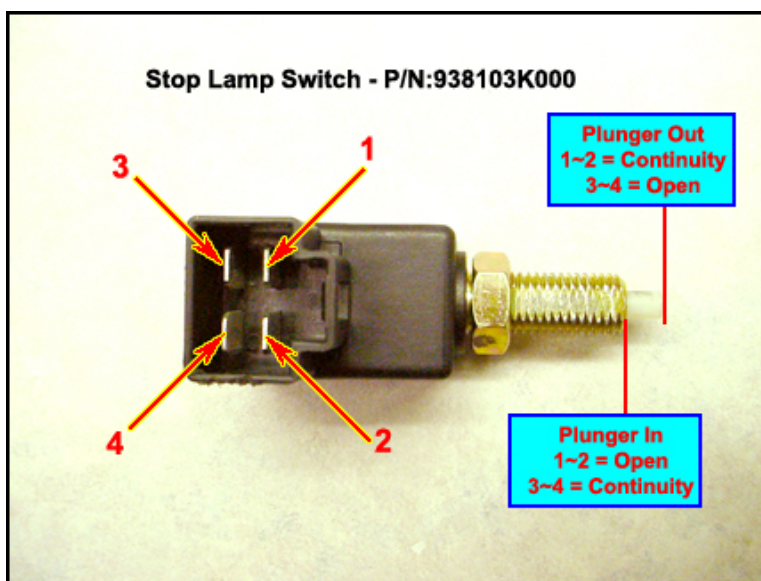

- The switch was then installed in a Santa Fe vehicle.
- The customer's condition was duplicated.
- Apparently under voltage and resistive loads, the switch got hot and the contact plate distorted enough to complete the circuit.
- The switch was removed and the resistance was measured as shown below.

Note: The resistance between the terminals 1 & 2 being close to zero Ohm, it was measured high as shown.

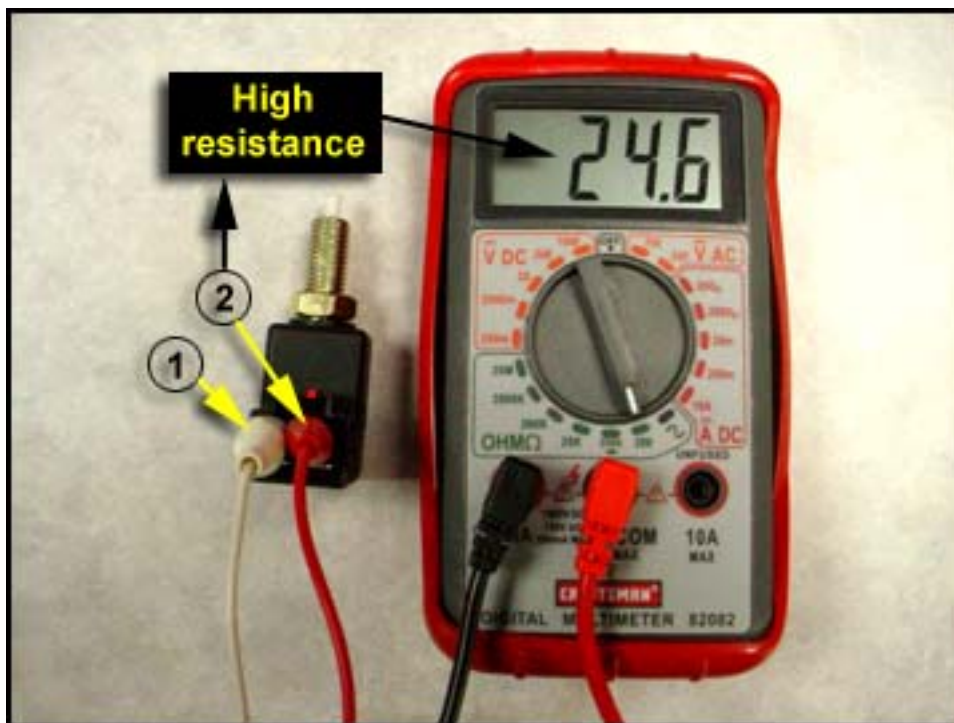


- When the stop lamp switch was in-operative, the temperature of the switch at the RED dot (shown in the photo above) was measured around 135 degrees F.
- The TABLE below provides stop lamp warranty information.

VIN Number	Prod Date	Mileage	Total Cost
5NMSH13E67H	2006-05-20	1315	\$33.80
5NMSG13D97H	2006-05-16	935	\$33.80
5NMSG13D17H	2006-06-30	3851	\$38.30
5NMSH73E67H	2006-08-29	66	\$47.30
5NMSH73E77H	2006-10-03	876	\$40.55
KM8SG73DX7U	2006-08-17	860	\$40.55
5NMSH13E77H	2006-05-31	3295	\$169.70
5NMSH73E87H	2006-05-28	1812	\$43.55
5NMSG13D27H	2006-07-24	1602	\$39.80
5NMSH13E47H	2006-07-29	5799	\$32.15
5NMSG13D97H	2006-06-26	146	\$38.00
5NMSG73D77H	2006-05-08	1045	\$54.50

VIN Number	Prod Date	Mileage	Total Cost
5NMSH13E87H	2006-08-01	729	\$38.15
5NMSH73E37H	2006-05-03	1377	\$61.70
5NMSG13D57H	2006-08-08	1176	\$52.70
KM8SG13D17U	2006-08-23	499	\$32.00
5NMSH73E37H	2006-06-20	3807	\$36.20
5NMSH13EX7H	2006-09-08	395	\$60.50
5NMSH13E97H	2006-08-31	1079	\$37.10
5NMSG13D77H	2006-05-22	3298	\$32.60
5NMSH73E47H	2006-09-06	2182	\$32.00
5NMSG13D47H	2006-04-30	515	\$98.88
5NMSG13D97H	2006-06-26	28	\$32.90
5NMSH13E37H	2006-09-11	604	\$34.10
5NMSH13E37H	2006-09-10	514	\$34.10
5NMSH73E77H	2006-06-29	4440	\$36.80
5NMSH13E27H	2006-07-19	2562	\$36.50
			\$1,268.23

- The water fall chart provides the following information.

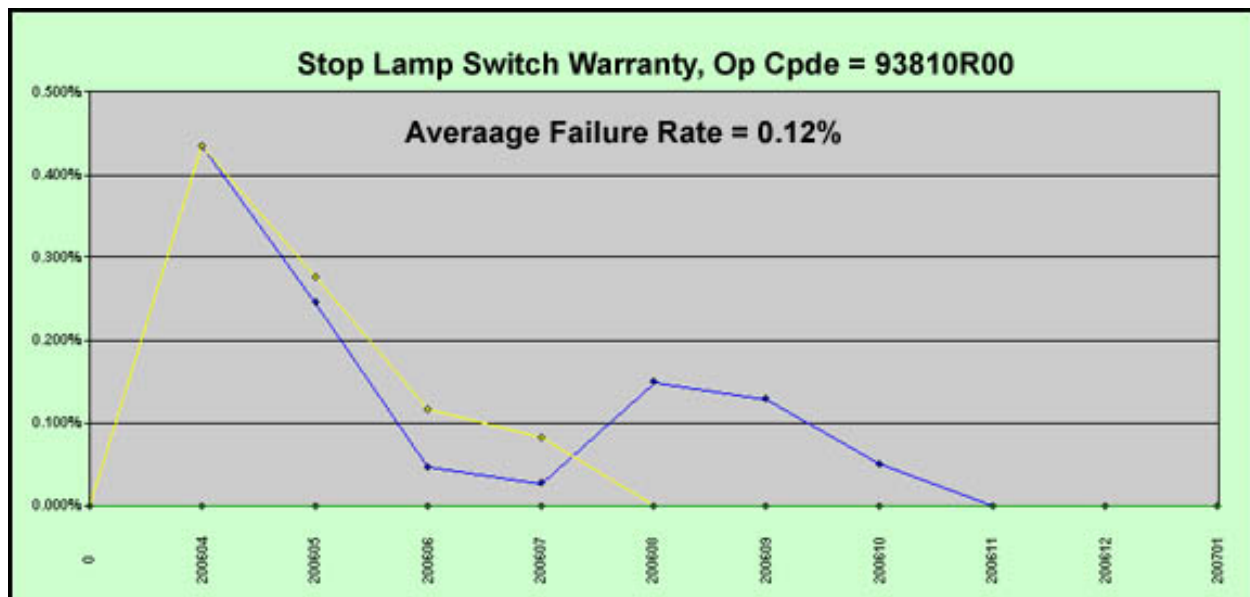

- The CHART below provides the incident part demand rate.

Note: As this part is common to many models, the demand rate shown below is for all applicable models.

PIR805	M00021791	Hyundai Motor America		1/08/2007				
CSHAH		Demand History Review		11:21:09				
				Retail :	13.02			
P/N(?):	93810 3K000	CLA: A1 S/R:	3.9	DLR Net:	8.07			
DESC :	SWITCH ASSY-STOP LAM	MC :		F.O.B :	3.67			
OLD :		ITC: VNDR:	00042600	NRC: FRZ Code:				
NEW :		ITC:		AIR: Y EDO Flag:	Y			
ANA :	760	FQP:	1 USP:	1 PROD:	03/01/2005 - 00/00/0000			
SS Kit:		Bulletin/FAX Flag:	Y	EFD:	2/22/2005			
On-Hand	On Order	DBO	Avail	AVG DMD	AVG FCST			
1,513	271	0	1,784	362	301.0			
				MOS/AVL	5.9			
DEMAND HISTORY								
A PDC St	JAN	DEC	NOV	OCT	SEP	AUG	JUL	12 Month
-----	-----	-----	-----	-----	-----	-----	-----	-----
- A01 X	47	99	88	105	151	133	65	778
- L01 X	29	76	46	66	65	53	20	453
- M01 X	47	57	72	77	100	84	45	567
- N01 X	37	90	104	120	126	116	72	770
- B01 X								
- C01 X								
TOT	180	324	312	368	444	388	202	More... 2568
Part Demand Rate								

3. Action:

Replace the stop lamp switch, P/N: 93810-3K000.

4. Comment/Recommendation:

- HMMA should inspect the incident part to determine the root cause of this condition and apply corrections as necessary.

5. Attachments:

WPR008C	M00021791	Hyundai Motor America	1/08/2007
CSHAH		Claim Inquiry	10:27:44
Inquiry			
Dealer Code :	M0032 ANTWERPEN HYUNDAI COLUMBIA	Pay Percent:	100.00
Claim No :	17110A R/O No: 217110 Version: 00	Sublet \$:	.00
R/O Date Open:	10/24/2006 Close: 10/24/2006	Sublet Type:	
Claim Status :	A Approve Labor Rate: 89.00	Labor \$:	26.70
Claim Type :	W New Veh. LTD Warranty	Parts \$:	11.30
PWA Type :		Freight \$:	.00
Rental Days :	0 Rental AMT: .00	Towing \$:	.00
Trans Type :	Automatic	Total \$:	38.00
VIN Number :	5NMSG13D97H Santa Fe (CM)	2007 Month In Service:	.0
Sell Dealer :	VA014 POHANKA HYUNDAI OF FRDRCKSBRG	Mileage :	146
Org Owner :			
HPP Contract :		HPP:	HCP:
Nature:	N69 WARNING LIGHT ON	Cause:	C15 POOR CONTACT & SHORT
Condition :			
Causal Part :	938103K000 Grp: 16 Main OP: 93810R00	Hour:	.3 Qty: 1
	SWITCH ASSY-STOP LAMP(4P)		SWITCH ASSY-STOP LAMP

QACM-C-070108

HYUNDAI**QUALITY INFORMATION
REPORT****CONFIDENTIAL**

Model Code CM	Subject Code* CHASSIS	Severity Code	HMA Report Number QACM-C-070108	
Creation date/time/user: 01/08/2007 12:33:03 by Casey Shah		Analyst:* Casey Shah	Co-analyst(s):	Modified date/time/user: by
Distributor* HMA	Country* USA	Vendor Info	Causal part No	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model* SANTA FE	Engine or Transmission #* G6EA6A636121	Lot #	Production Date* (MM/DD/YY) 06-26-2006	
VIN* 5NMSG13D97H [REDACTED]	Mileage* 146	Repair Date (MM/DD/YY)	Delivery Date* (MM/DD/YY) 10-23-2006	
Subject* [B] STOP LAMP SWITCH IN-OPERATIVE (EARLY WARNING) - HMMA				

Types of QIR					
<input type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date: 01/08/2007

Report Number :

The customer complained that the brake light stays ON.

Analysis:

Date: 01/08/2007

Report Number :

- The dealer technician confirmed the condition.
- The rear stop lamps stayed ON after the brake was released and the ignition was turned OFF.
- The Hi-Scan Pro retrieved the DTC P0504 (Brake switch – A/B correlation).
- Replacing the stop lamp switch, P/N: 93810-3K000, corrected the condition.
- The incident part was sent to HMA for analysis.
- The photo below shows the incident switch and the continuity check results.

Accordingly, the stop lamp switch was determined to be OK (static condition).

- The switch was then installed in a Santa Fe vehicle.
- The customer's condition was duplicated.
- Apparently under voltage and resistive loads, the switch got hot and the contact plate distorted enough to complete the circuit.
- The switch was removed and the resistance was measured as shown below.

Note: The resistance between the terminals 1 & 2 being close to zero Ohm, it was measured high as shown.

- When the stop lamp switch was in-operative, the temperature of the switch at the RED dot (shown in the photo above) was measured around 135 degrees F.
- The TABLE below provides stop lamp warranty information.
- The CHART below provides the incident part demand rate.

Note: As this part is common to many models, the demand rate shown below is for all applicable models.

Corrective Action:

Date: 01/08/2007

Report Number :

Replace the stop lamp switch, P/N: 93810-3K000.

Comments and Recommendations:

Date: 01/08/2007

Report Number :

HMMA should inspect the incident part to determine the root cause of this condition and apply corrections as necessary.

Attachments:

Date: 01/08/2007

Report Number :



QIR 3 CM Stop SW.doc

QACM-C-071005

Attachment

Model Code	Subject Code*	Severity Code	HMA Report Number		
CM	CHASSIS	7			
Creation date/time/user:	Analyst:*	Co-analyst(s):	Modified date/time/user:		
	JOSHUA VEDDER				
Distributor*	Country*	Vendor Info	Causal Part #	Attachments	
HMA	USA	INFAC	93810-0W000		
Model*	Engine or Transmission #*	Lot #	Production Date*	Movie	
Santa Fe	G6DB7K244424	6L27	3/26/07		
VIN*	Mileage*	Repair Date*	Delivery Date*	X	Photo
5NMSH13EX7H [REDACTED]	5,660	8/18/07	5/26/07		
Subject*				X	Part
[B] STOP LAMP SWITCH - COUNTERMEASURE NOT EFFECTIVE - HMMA					
					Other

Types of QIR

Early Warning	Serviceability	Port	Monitoring	VDS
---------------	----------------	------	------------	-----

1. Condition:

- Customer statement:

- ESC light has been coming on
- ESC and the check engine lights on and the cruise control does not work.
- Customer states check engine light on
- Can not put car in park, brake lights inop
- ESC light on brake lights not working

- Technician statement:

- P0504. Tech replaced faulted /shorted brake light switch and verified repair
- Replaced brake switch because it kept coming out of adjustment
- ABS, brake and air bag light is on, code C1513, short in stop switch, replaced stop switch
- Scan found code C1513. Then found that brake lamp switch has an internal open.

- Customer driving habit / operation condition: N/A

- Road condition: N/A

- Weather condition: N/A


- Vehicle speed: N/A

- Number of passengers: N/A

- Region:

Chart 1

- Claims by region.
- Op Code: 93810R00
- P/D: 200701 – 200710
- No indications of dealer abuse.

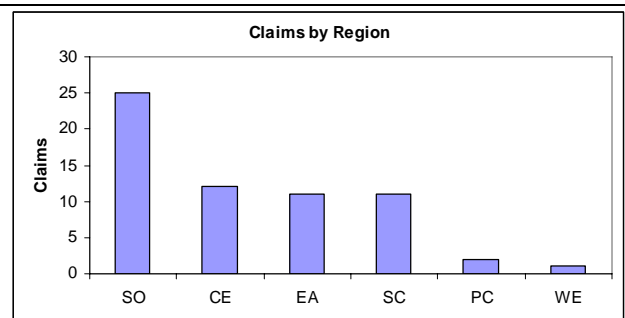


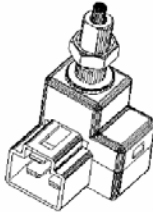
- Other comments: None

2. Analysis:

This is the 3rd CM QIR on this condition. (Last QIS)

Date	2007-03-01	QIR Issue Date	2007-01-10
Subject	(QACM-C-070108) [B] STOP LAMP SWITCH IN-OPERATIVE (EARLY WARNING) - HMMA		
Report No.	B28MM2007011053	Model	Santafe(CM)
Status	Improved	TSB No.	NULL
Attachment			
► Improvement Status			
Condition	The customer complained that the brake light stays on.		
Cause	Brake light switch is overheating , causing the brake light to remain on.		
Countermeasure	EO change was not approved by HMC. Containment at supplier is a 100% check for a set cycle to confirm functionality of the switch. Yellow dot is marked after passing test.		
	VIN 5NMSG13D17H[REDACTED] Date 2006.12.15		
Effective Date		Vehicle ID Number	5NMSG13D97H[REDACTED]

HMMA Presentation:

Quality Issue: Brake Lamp Switch Inop		Resp. Dept.: QA
		Presenter: Dan Mueller
Problem (Photo / Diagram)	Before (Photo / Diagram)	After (Photo/Diagram)
Brake Lamps do not illuminate when brake switch is activated.		
Status and Cause	Countermeasure Description	Service Countermeasure
Switch overheating causing warping and contacts do not close.	H0W60167 redesigns switch to improve heat resistance. 15 Dec 06 implementation at HMMA for automatic transmissions. Manual transmission anticipated implementation of April 2007. EMF 269532, CRA 061360	Replace switch
	Service Compatibility Yes / No	Supplier GLOVIS
	P/No. Change Yes No	Original Resp. Dept.

Failure Parts Analysis:


Picture 1

- "New" countermeasure part
- VIN: 5NMSH13EX7H[REDACTED]
- P/D: 3/26/07
- Miles: 5,660




Picture 2


- Picture of the switch mechanicals
- Note the 2 individual circuits and the capacitor
- VIN: 5NMSH13EX7H [REDACTED]
- P/D: 3/26/07
- Miles: 5,660

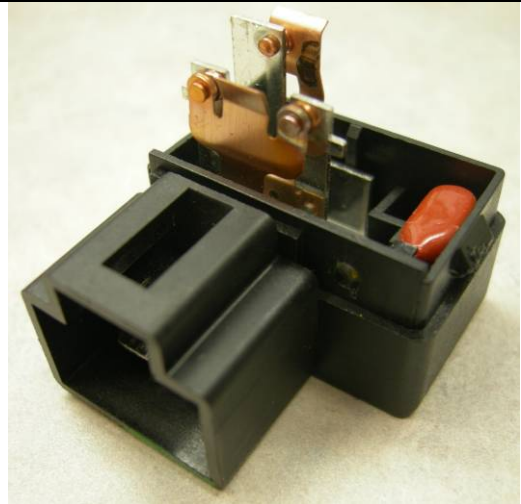**Picture 3**

- Most of the silver coating from the stationary side of the circuit has transferred to the opposite terminal
- Without the coating this is a poor conductor
- VIN: 5NMSH13EX7H [REDACTED]
- P/D: 3/26/07
- Miles: 5,660

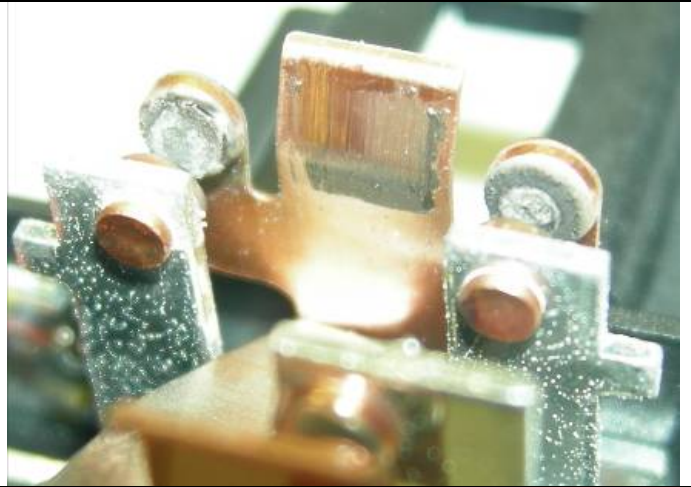**Picture 4**

- Picture of the stationary side of the circuit. Note that the silver material is no longer present
- VIN: 5NMSH13EX7H [REDACTED]
- P/D: 3/26/07
- Miles: 5,660

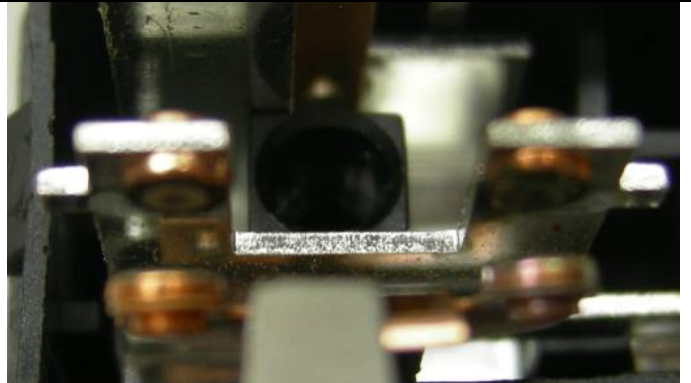**Picture 4**

- Stop Lamp Switch imprinted information.
- VIN: 5NMSH13EX7H [REDACTED]
- P/D: 3/26/07
- Miles: 5,660



Warranty Analysis:

Op Code: 93810R00

Prod Dates: 200701 – 200710

62 Claims

Total Cost: \$2,269.51

Causal Part #: 93810-0W000


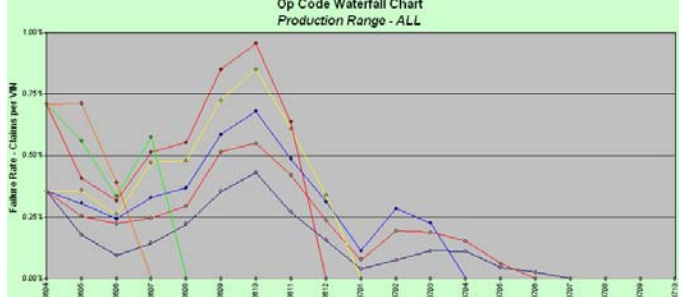
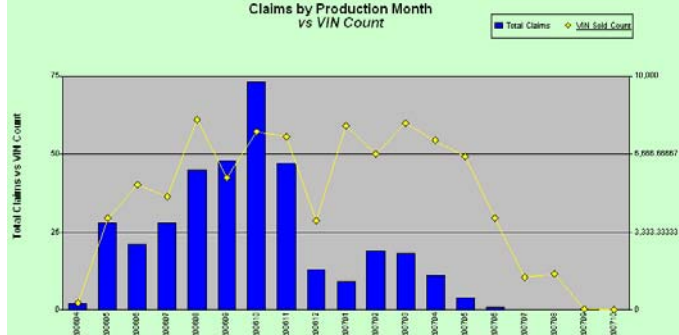
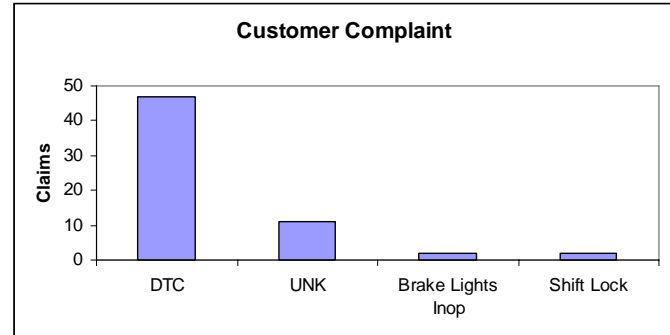
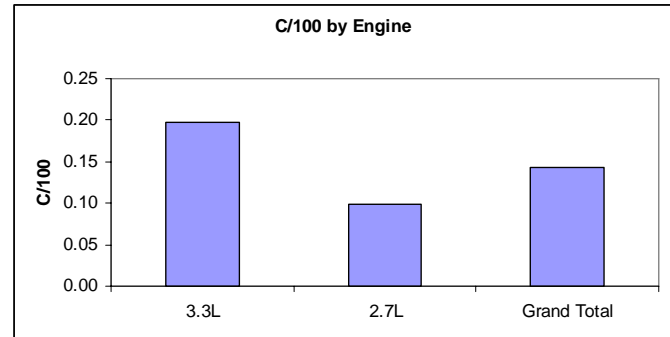
All Data	 All Data
Chart 2 <ul style="list-style-type: none">• Failure rate waterfall chart• A decrease in failure rate is visible after 200612• Claims are increasing again in 200702+	 <p>Op Code Waterfall Chart Production Range - ALL</p>
Chart 3 <ul style="list-style-type: none">• Claims by production date• VIN sold in yellow	 <p>Claims by Production Month vs VIN Count</p>
Chart 4 <ul style="list-style-type: none">• Claims categorized by customer complaint• DTC: P0504, C1513	 <p>Customer Complaint</p>
Chart 5 <ul style="list-style-type: none">• C/100 by engine• 3.3L failure rate is nearly 2 times greater.	 <p>C/100 by Engine</p>

Chart 6

- C/100 by engine
- **Trend over production month is not consistent between 2.7L and 3.3L**

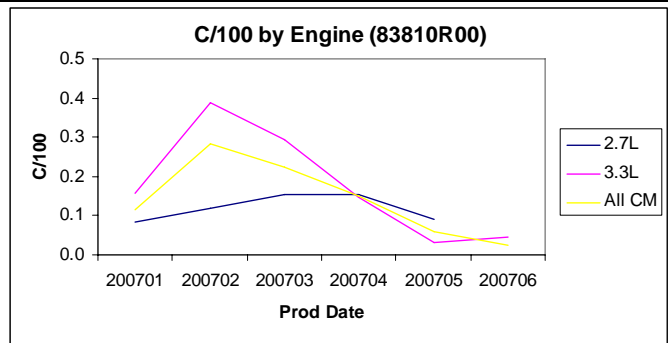


Chart 7

- Nature and Cause codes

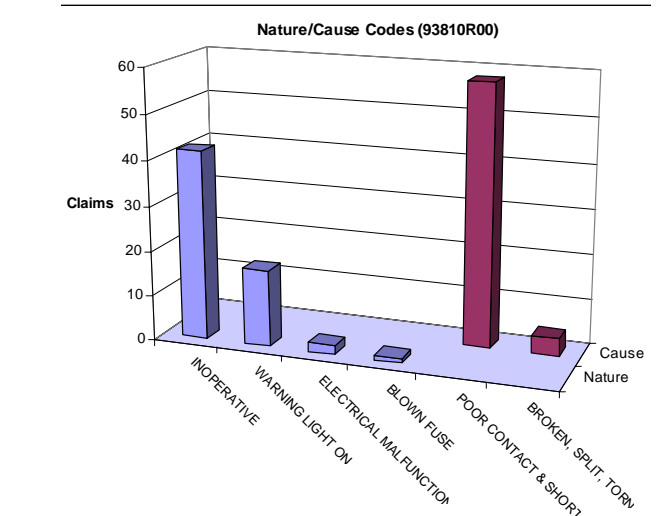


Chart 8

- Op Code: 93810R00 on all models (200701 – 200710)
- The stop lamp switch is a common part on most HMA vehicles.
- **NF and CM are consistently higher than other models (EP and EN have low volumes)**


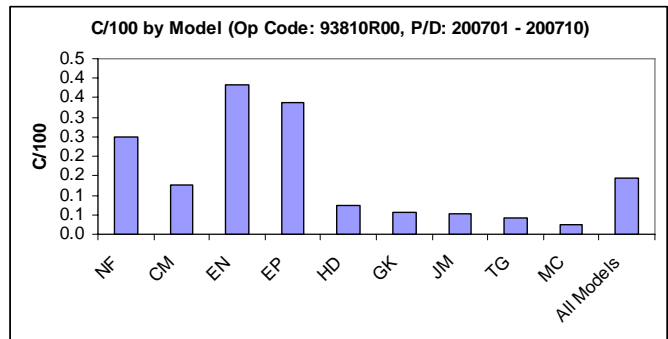


Chart 9

- C/100 by Prod Month
- **Again NF and CM trend near the top for stop lamp switch warranty claims.**



3. Action:

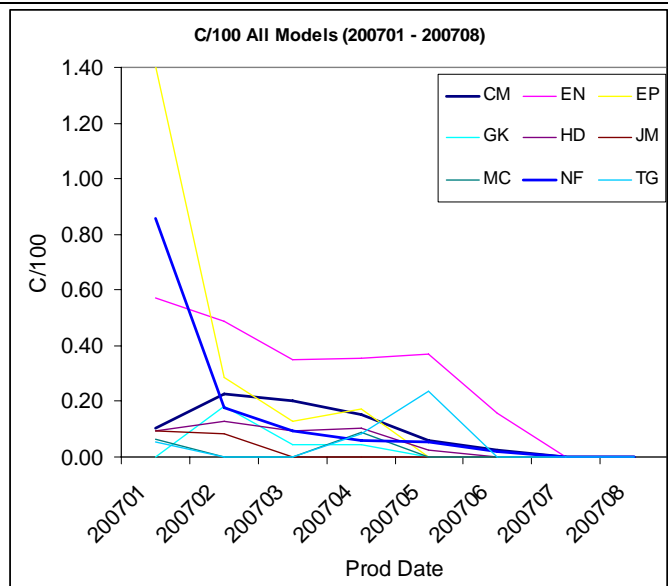

- **Dealer fix:** Confirm proper adjustment. Replace stop lamp switch if necessary.
- **Repair procedure:**



Shop

4. Comment/Recommendation:


Short Term (Immediate Action)

Description	Responsibility	Timing	Status
Confirm effective C/M implementation and containment.	HMMA	10/15/07	
Study the loads on the stop lamp circuit between different models to help determine why common parts have different failure rates.	HMC/HATCI	11/1/07	

Field Fix

Description	Responsibility	Timing	Status
None	---	---	---

Long Term (Component Revision)

Description	Responsibility	Timing	Status
Based on recommendations from the above mentioned HMC/HATCI study implement best practices on future designs.	HMC	---	

5. Attachments:

QACM-C-071005

Model Code CM	Subject Code* CHASSIS	Severity Code 7	HMA Report Number QACM-C-071005	
Creation date/time/user: 10/03/2007 09:53:38 AM by Joshua Vedder		Analyst:* Joshua Vedder	Co-analyst(s): Harrison Aye	Modified date/time/user: 10/03/2007 09:53:38 AM by
Distributor* HMA	Country* USA	Vendor Info INFAC	Causal part No 93810-0W000	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input type="checkbox"/> Other
Model* SANTA FE	Engine or Transmission #* G6DB7K244424	Lot # 6L27	Production Date* (MM/DD/YY) 3/26/07	
VIN* 5NMSH13EX7H [REDACTED]	Mileage* 5,660	Repair Date (MM/DD/YY) 8/18/07	Delivery Date* (MM/DD/YY) 5/26/07	
Subject* [B] STOP LAMP SWITCH - COUNTERMEASURE NOT EFFECTIVE - HMMA				

Types of QIR					
<input type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date:

Report Number : QACM-C-071005

- Customer statement:


- ESC light has been coming on
- ESC and the check engine lights on and the cruise control does not work.
- Customer states check engine light on
- Can not put car in park, brake lights inop
- ESC light on brake lights not working

- Technician statement:

- P0504. Tech replaced faulted /shorted brake light switch and verified repair
- Replaced brake switch because it kept coming out of adjustment
- ABS, brake and air bag light is on, code C1513, short in stop switch, replaced stop switch
- Scan found code C1513. Then found that brake lamp switch has an internal open.

- Customer driving habit / operation condition: N/A**- Road condition:** N/A**- Weather condition:** N/A**- Vehicle speed:** N/A**- Number of passengers:** N/A**- Region:****Chart 1**

- Claims by region.
- Op Code: 93810R00
- P/D: 200701 - 200710
- No indications of dealer abuse.

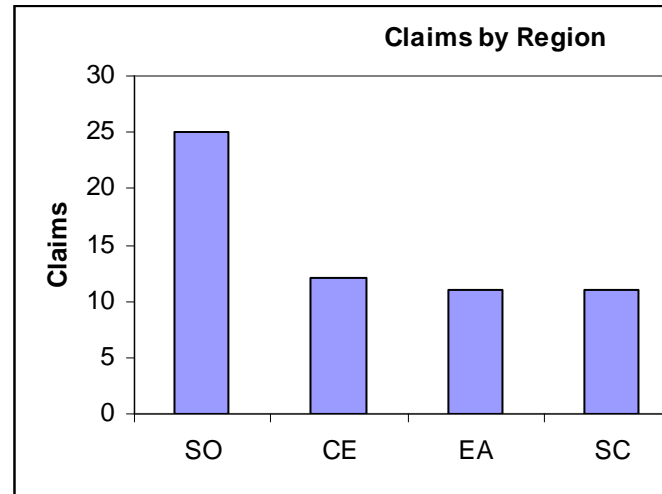

- Other comments: None

Analysis:

Date:

Report Number : QACM-C-071005


This is the 3rd CM QIR on this condition. (Last QIS)

Date	2007-03-01	QIR Issue Date	2007-01-10
Subject	(QACM-C-070108) [B] STOP LAMP SWITCH IN-OPERATIVE (EARLY WARNING) - HMMA		
Report No.	B28MM2007011053	Model	Santafe(CM)
Status	Improved	TSB No.	NULL
Attachment			

► Improvement Status

Condition	The customer complained that the brake light stays on.		
Cause	Brake light switch is overheating , causing the brake light to remain on.		
Countermeasure	EO change was not approved by HMC. Containment at supplier is a 100% check for a set cycle to confirm functionality of the switch. Yellow dot is marked after passing test.		
	VIN 5NMSG13D17H[REDACTED] Date 2006.12.15		
Effective Date		Vehicle ID Number	5NMSG13D97H[REDACTED]

HMMA Presentation:

Quality Issue: Brake Lamp Switch Inop		
Problem (Photo / Diagram)	Before (Photo / Diagram)	A
Brake Lamps do not illuminate when brake switch is activated.		
Status and Cause	Countermeasure Description	S
Switch overheating causing warping and contacts do not close.	H0W60167 redesigns switch to improve heat resistance. 15 Dec 06 implementation at HMMA for automatic transmissions. Manual transmission anticipated implementation of April 2007. EMF 269532, CRA 061360	Re
	Service Compatibility	Yes / No
	P/No. Change	Yes No

Failure Parts Analysis:


Picture 1

- "New" countermeasure part
- VIN: 5NMSH13EX7H [REDACTED]
- P/D: 3/26/07
- Miles: 5,660




Picture 2

- Picture of the switch mechanicals
- Note the 2 individual circuits and the capacitor
- VIN: 5NMSH13EX7H [REDACTED]
- P/D: 3/26/07
- Miles: 5,660

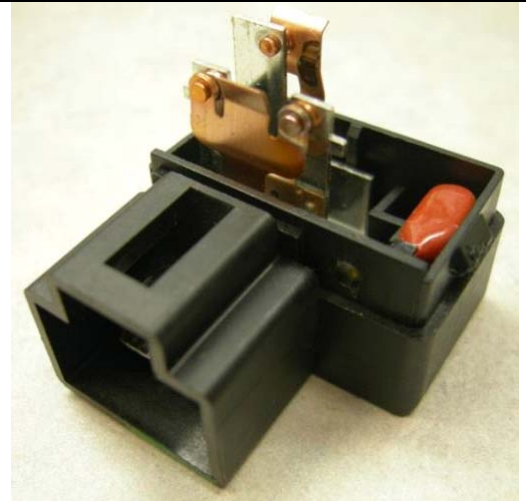


Picture 3

- Most of the silver coating from the stationary side of the circuit has transferred to the opposite terminal
- Without the coating this is a poor conductor
- VIN: 5NMSH13EX7H [REDACTED]
- P/D: 3/26/07
- Miles: 5,660

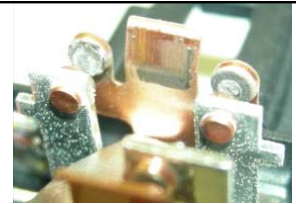


Picture 4

- Picture of the stationary side of the circuit. Note that the silver material is no longer present
- VIN: 5NMSH13EX7H [REDACTED]
- P/D: 3/26/07
- Miles: 5,660

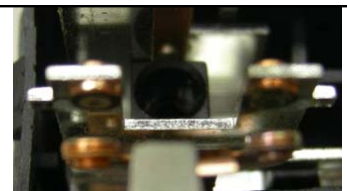


Picture 4

- Stop Lamp Switch imprinted information.
- VIN: 5NMSH13EX7H [REDACTED]
- P/D: 3/26/07
- Miles: 5,660

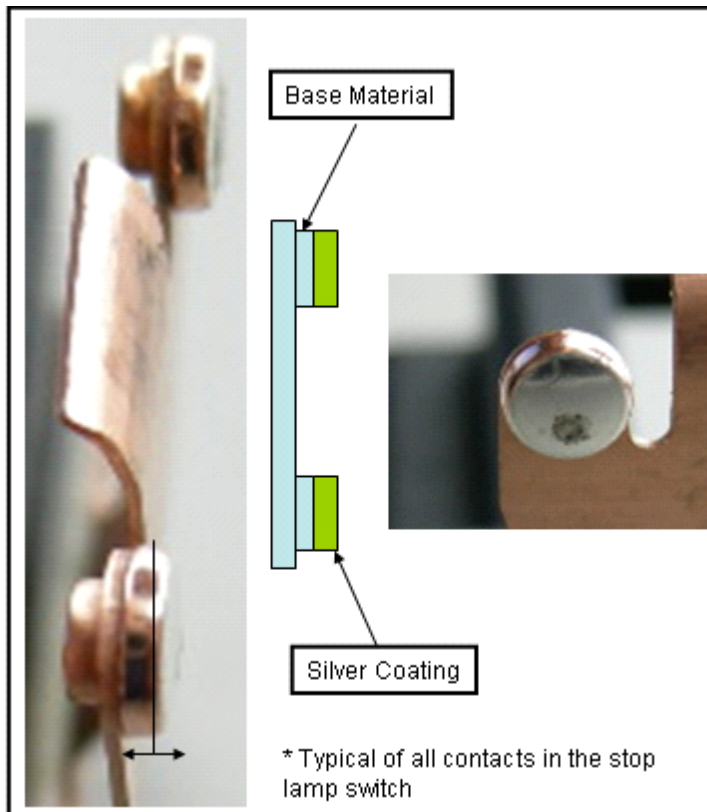


Stop Lamp Circuit Detail

 Brake Lights Off




Brake Lights On

 

Good

Brake Lights On

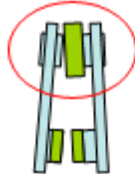



Brake Lights On



No Good

The silver coating (highlighted green) is melting and transferring to the mating contact. The excess flash combined with the distortion on the switch internals prevents the circuit from opening keeping the brake lights illuminated.

Circuit Diagram:

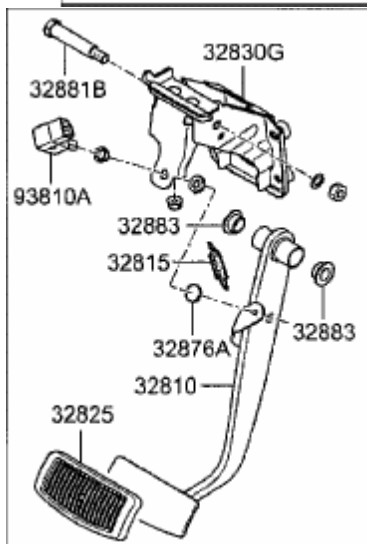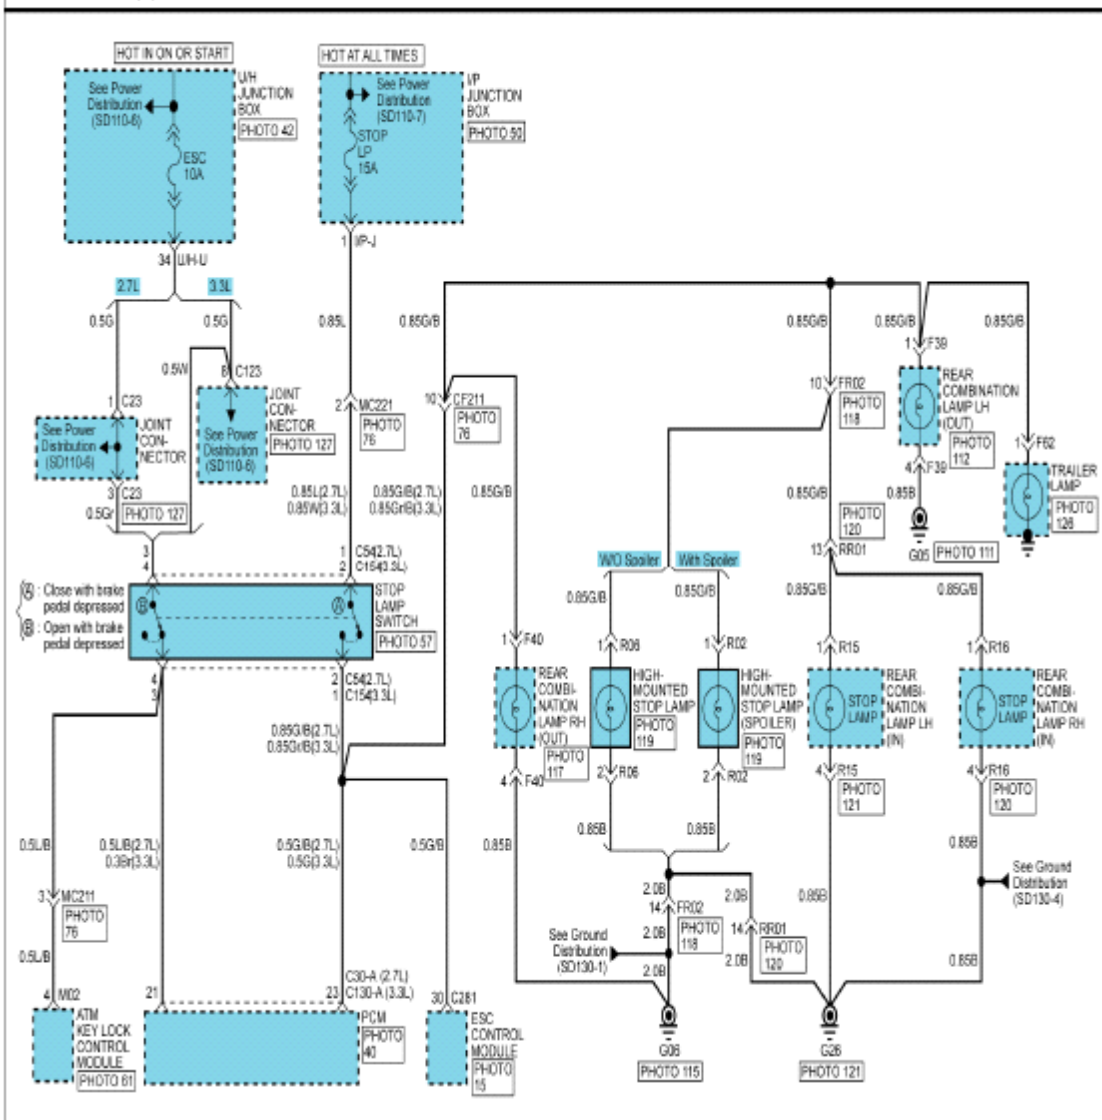

Warranty Analysis:

Op Code: 93810R00

Prod Dates: 200701 – 200710

62 Claims

Total Cost: \$2,269.51

Causal Part #: 93810-0W000

All Data	
Chart 2 <ul style="list-style-type: none">• Failure rate waterfall chart• A decrease in failure rate is visible after 200612• Claims are increasing again in 200702+	

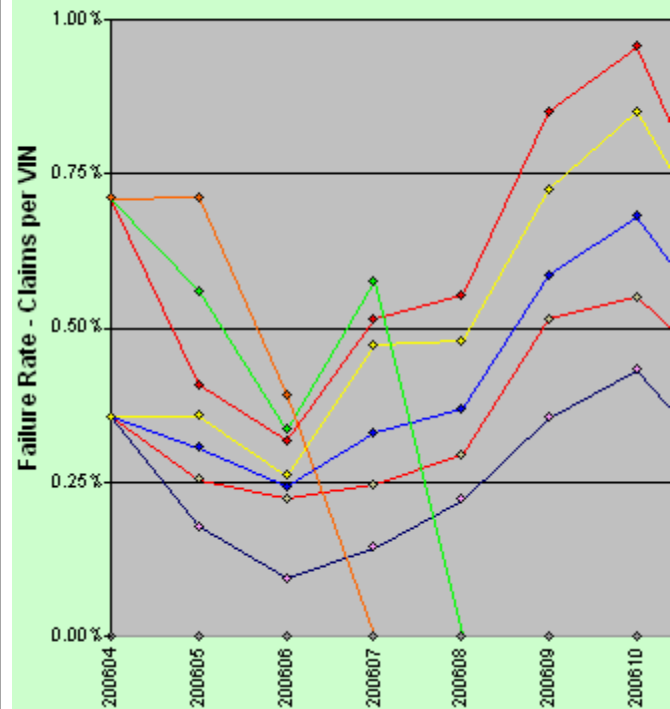


Chart 3

- Claims by production date
- VIN sold in yellow

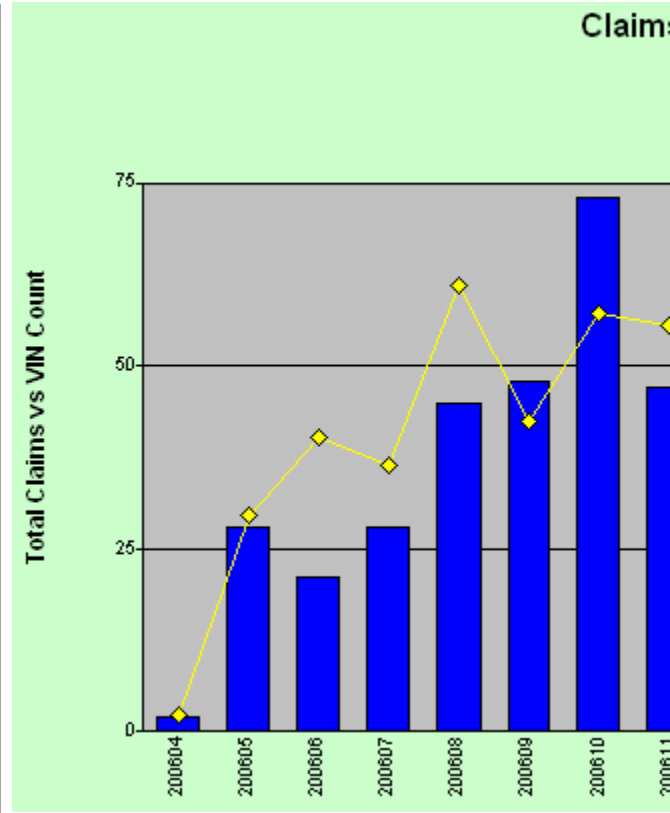


Chart 4

- Claims categorized by customer complaint
- DTC: P0504, C1513

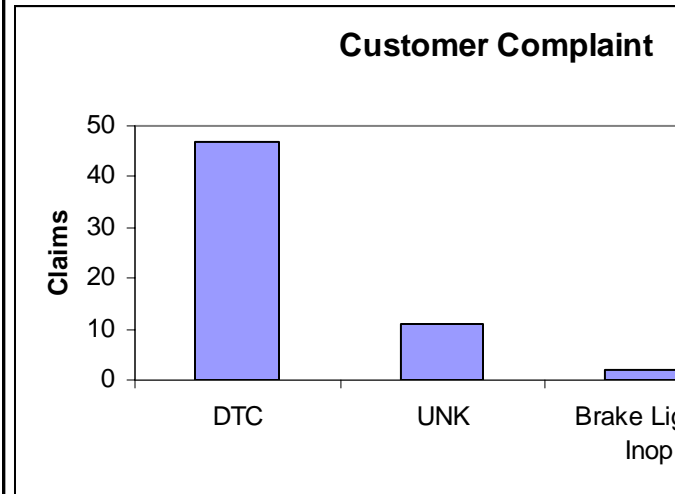


Chart 5

- C/100 by engine
- **3.3L failure rate is nearly 2 times greater.**

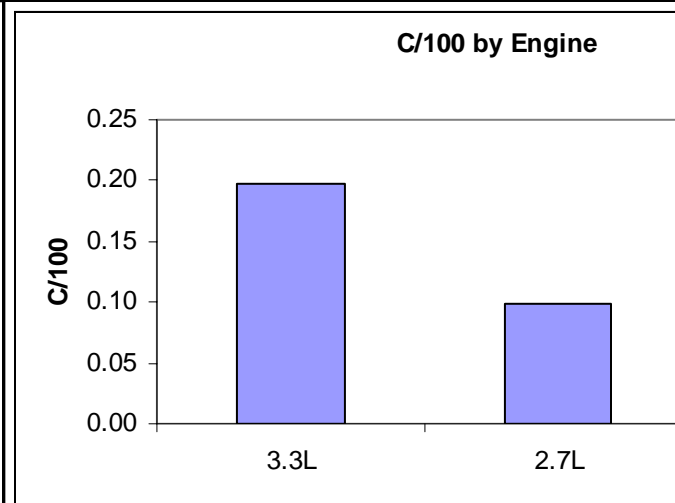


Chart 6

- C/100 by engine
- **Trend over production month is not consistent between 2.7L and 3.3L**

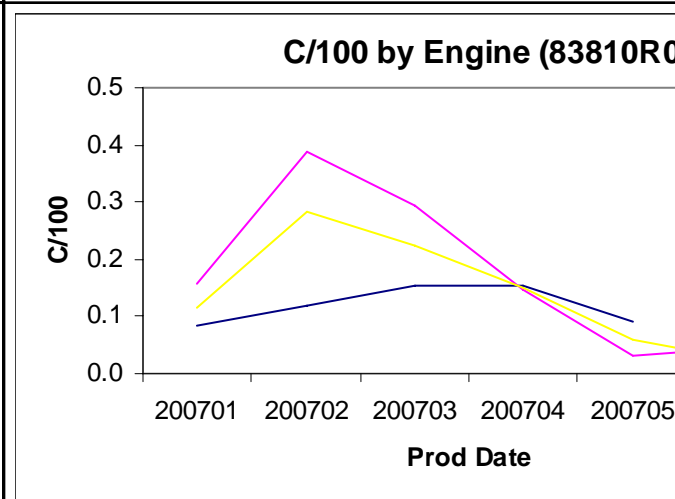


Chart 7

- Nature and Cause codes

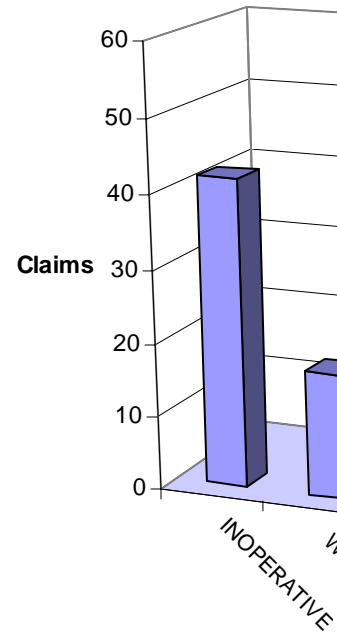


Chart 8

- Op Code: 93810R00 on all models (200701 – 200710)
- The stop lamp switch is a common part on most HMA vehicles.
- **NF and CM are consistently higher than other models (EP and EN have low volumes)**

C/100 by Model (Op Code: 93810R00, P/D: 2)


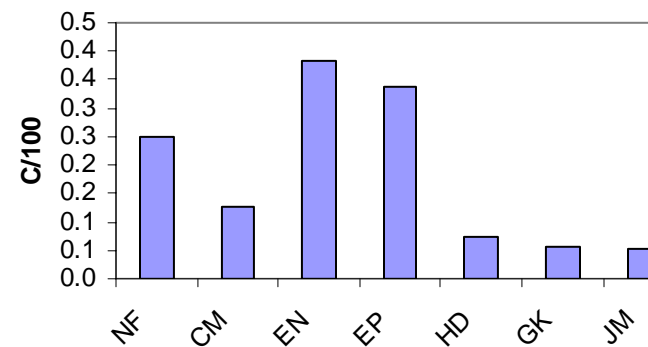


Chart 9

- C/100 by Prod Month
- **Again NF and CM trend near the top for stop lamp switch warranty claims.**

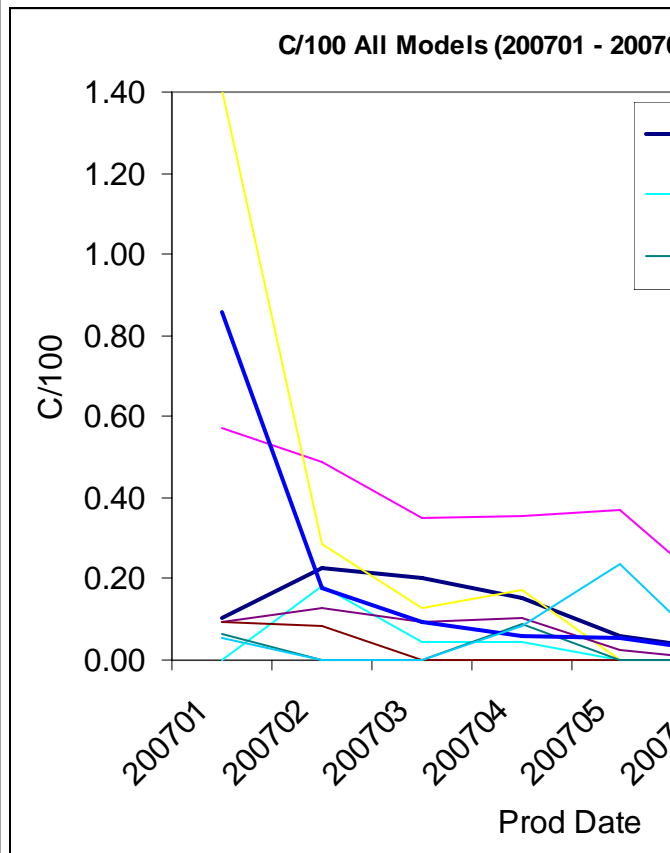

Corrective Action:

Date:

Report Number : QACM-C-071005

- **Dealer fix:** Confirm proper adjustment. Replace stop lamp switch if necessary.
- **Repair procedure:**

Shop Manual

Comments and Recommendations:

Date:

Report Number : QACM-C-071005

Short Term (Immediate Action)

Description	Responsibility	Timing	Status
Confirm effective C/M implementation and containment.	HMMA	10/15/07	A
Study the loads on the stop lamp circuit between different models to help determine why common parts have different failure rates.	HMC/HATCI	11/1/07	A

Field Fix

Description	Responsibility	Timing	Status
None	---	---	---

Long Term (Component Revision)

Description	Responsibility	Timing	Status
Based on recommendations from the above mentioned HMC/HATCI study implement best practices on future designs.	HMC	---	A

Attachments:

Date:

Report Number : QACM-C-071005



Stop Lamp Switch rev2.doc

QAEN-C-070513

Attachment

QUALITY INFORMATION REPORT

CONFIDENTIAL

Model Code	Subject Code*		HMA Report Number	
EN	CHASSIS			
Creation date/time/user:	Analyst:*	Co-analyst(s):	Modified date/time/user:	
	CASEY SHAH			
Distributor*	Country*	Date	HMC Report Number	Attachments
HMA	USA	5/14/2007		<input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model*	Engine or Transmission Number*		Production Date*	
VERACRUZ	G6DA7A798644		2/07/2007	
Vehicle Identification Number*		Mileage*	Delivery Date*	
KM8NU13C47U [REDACTED]		480	3/15/2007	
Subject*				
[B] INTERMITTENT NO "PARK" RELEASE AND "ESC" LIGHT ON (EARLY WARNING)				

1. Condition:

The customer states that the transmission will not come out of park and have to put the key into the shift lock to release the lock. Additional vehicles with the same condition:

<u>VIN</u>	<u>P/D</u>	<u>MILEAGE</u>
KM8NU73C67U [REDACTED]	1/18/07	1,605
KM8NU73C17U [REDACTED]	2/06/07	2,615

2. Analysis:


- The dealer technician confirmed the customer's condition.
- The "ESC OFF" light was lit on the dash.
- The Hi-Scan retrieved C1513 code (Brake Switch Error).
- The dealer technician replaced the stop lamp switch assembly, P/N: 93810-3K000, corrected the condition.
- The incident part was sent to HMA for analysis.
- The photo below shows the incident part.



- The static (on the bench) continuity measurement between the pins 1 & 2 and 3 & 4 shows the switch is operating correctly.
- The switch was installed in a Veracruz for checking the dynamic performance of the switch.
- After driving the vehicle, the “ESP OFF” light came on the dash as shown.



- The vehicle was stopped but the gear could not be released from “D” to “R” or “P”.
- At this moment, the Hi-Scan in the Current Data menu provided the following information.

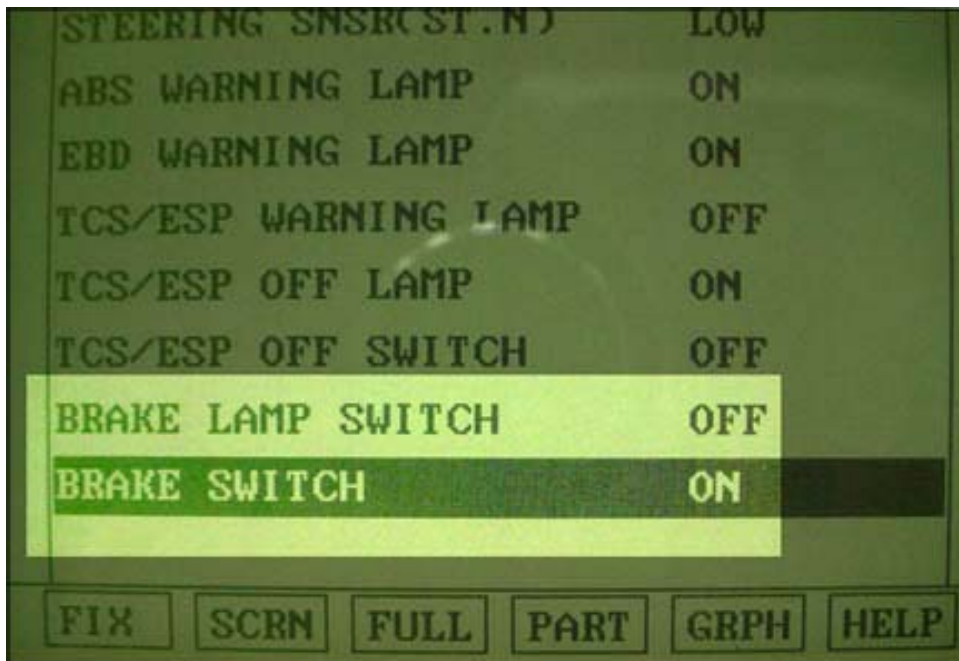

- The “Brake Lamp Switch” should also be ON if the switch is working correctly in the brake pedal depressed condition.
- The switch was left in the vehicle to reproduce this condition one more time.
- The Hi-Scan captured the following code.

1.1 DIAGNOSTIC TROUBLE CODES

C1513 BRAKE LAMP SWITCH

- In the field, three stop lamp switches have been replaced for the same condition (see TABLE below).

VIN Number	Prod Date	Mileage	Total Cost	Technician Comment	Customer Complaint	Cause Comment	Technician Correction
KM8NU73C17U	2/06/07	2615	32.14	GEAR SHIFT WOULD NOT SHIFT OUT OF PARK REPLACED STOM LAMP SWITCH RETESTED FINE			
KM8NU13C47U	2/07/07	480	40.54	CODE P0504 BRAKE SWITCH PLUNGER STUCK IN	CUSTOMER STATES THE TRANSMISSION WILL NOT COME OUT OF PARK HAVE TO PUT KEY IN SHIFT LOCK RELEASE TO GET INTO DRIVE	TECH VERIFIED CUSTOMER COMPLAINT NOTICED NO BRAKE LIGHT WHENPRESSING ON BRAKE PEDAL TECH ALSO VERIFIED ESC LIGHT ON USING GDS TO RETRIEVE CODE PO504 BRAKE SWITCH A/B CORRELATION. TECH CHECKED BRAKE SWITCH PLUNGER STUCK IN RECOMMEND REPLACE BRAKE SWITCH AN	REPLACED BRAKE SWITCH AND RECHECKED OK ESC LIGHT OUT AND SHIFTLOOK WORKING CORRECTY
KM8NU73C67U	1/18/07	1605	48.84	ATT TIME FOR DIAG	CUST STATES VEHICLE WILL NOT SHIFT OUT OF PARK AND WON'T SHIFT INTO REVERSE--YOU HAVE TO USE THE SHIFT LOCK RELEASE IN ORDER TO MOVE THE SHIFTER AT ALL PLEASE CK AND ADVISE	CHECK FOR POWER PIN 2 & 4 OF BRAKE SWITCH HAS 12 VOLTS PIN #1 & #3 SHOWS GROUND. R&R THE BRAKE SWITCH POWER AT #3 & #1	CORRECT--MEETS MANUFACTURERS STANDARDS AT THIS TIME
			121.52				


- Please note that this switch, P/N: 93810-3K000, was introduced on the following models from 3/1/2005.

PTR802	M00021791	Hyundai Motor America	5/14/2007
CSHAH		Part - Applied Model Code Inquiry	12:57:22
INQUIRY			
PART: 93810 3K000		SWITCH ASSY-STOP LAMP(4P)	
APPLIED MDL CDE	Effective 3/1/2005	DEV MDL	FIRST MDL YR
MDL CDE	MODEL NAME	MDL	LAST MDL YR
BH	TUCSON	JM	2005
BL	ACCENT	MC	2006
BM	SANTA FE (KOREA)	CM	2007
CB	TIBURON	GK	2003
CF	ELANTRA (2007 -)	HD	2007
CR	SANTA FE (HMMA)	CM	2007
EJ	VERACRUZ	EN	2007
EK	SONATA	NF	2006
EL	AZERA	TG	2006
EM	SONATA (HMMA)	NF	2006
GE	ENTOURAGE	EP	2006


» Quality Improvement Status			
Close Print			
Date	2007-02-08	QIR Issue Date	2007-01-26
Subject	(A) QANF-L-070108 INOPERATIVE BRAKE STOP LAMP SWITCH CAUSES NO ATM SHIFTER RELEASE-HMMA		
Report No.	B28MM2007012656	Model	Sonata(NFA)
Status	Improved	TSB No.	NULL
Attachment			
» Improvement Status			
Condition	Brake Lamps do not illuminate when brake switch is activated.		P/D = 11/08/2006
Cause	Switch overheating causing warping and contacts do not close.		P/N: 93810-3K000
Countermeasure	H0W60167 redesigns switch to improve heat resistance. 15 Dec 06 implementation at HMMA for automatic transmissions. Manual transmission anticipated implementation of April 2007. EMF 269532, CRA 061360		
Effective Date		Vehicle ID Number	5NPEU46F17H [REDACTED]

» Quality Improvement Status			
Close Print			
Date	2006-12-22	QIR Issue Date	2006-11-09
Subject	(QACM-C-061107) [B] STOP LAMP SWITCH INTERMITTENTLY MALFUNCTIONING (EARLY WARNING) - HMMA		
Report No.	B28MM2006110951	Model	Santafe(CM)
Status	Improved	TSB No.	NULL
Attachment			
» Improvement Status			
Condition	stop lamp intermittently malfunctioning		P/D = 6/26/2006
Cause	overheating of switch		P/N: 93810-3K000
Countermeasure	Proposal to add reinforced ribs, thicken ribs, knurl end of insert (see attachment) 100% testing of switch in place at HMMA Actual implementation of new parts March 07		
Effective Date		Vehicle ID Number	5NMSG13D97H [REDACTED]


- The cause(s) of this condition is not known; however, following are some possibilities based on the other incident switch that was cut opened for inspection:
 - Plunger may be sticking inside the cylinder due to dimensional variability and/or poor finish on the plastic plunger (see photo below).

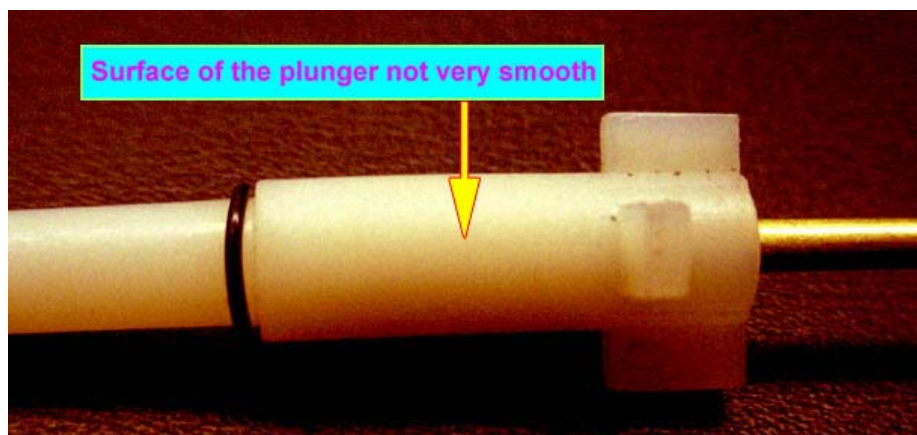


- The photo below shows an incident switch with collapsed plunger inside the cylinder (cause unknown).

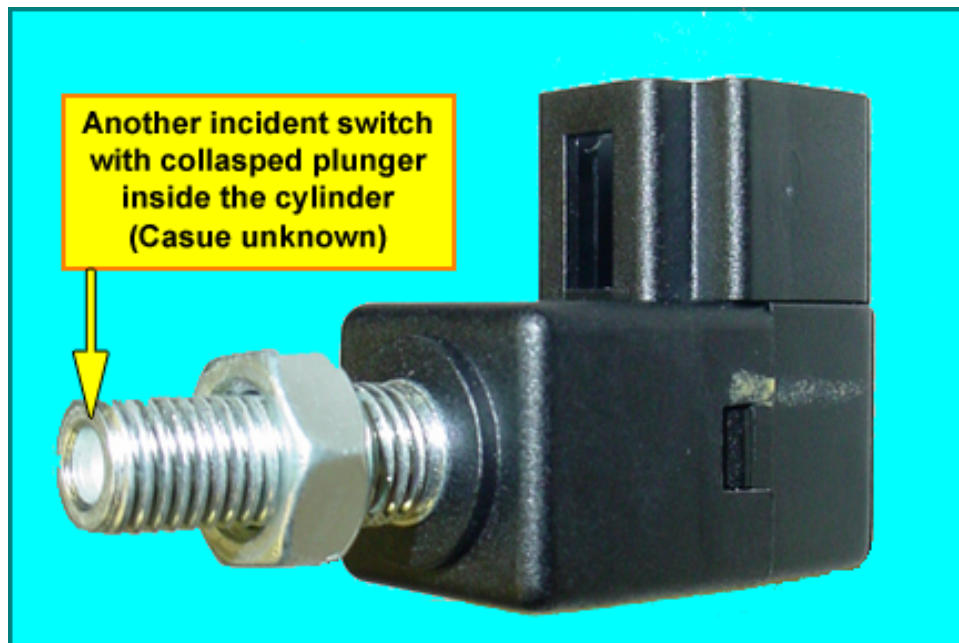


- The stop lamp switch high side contacts (one that operates the tail lamps and sends the signal to activate the shift lock) were found burnt (as shown in the following photographs) that could cause the conditions described in this report.

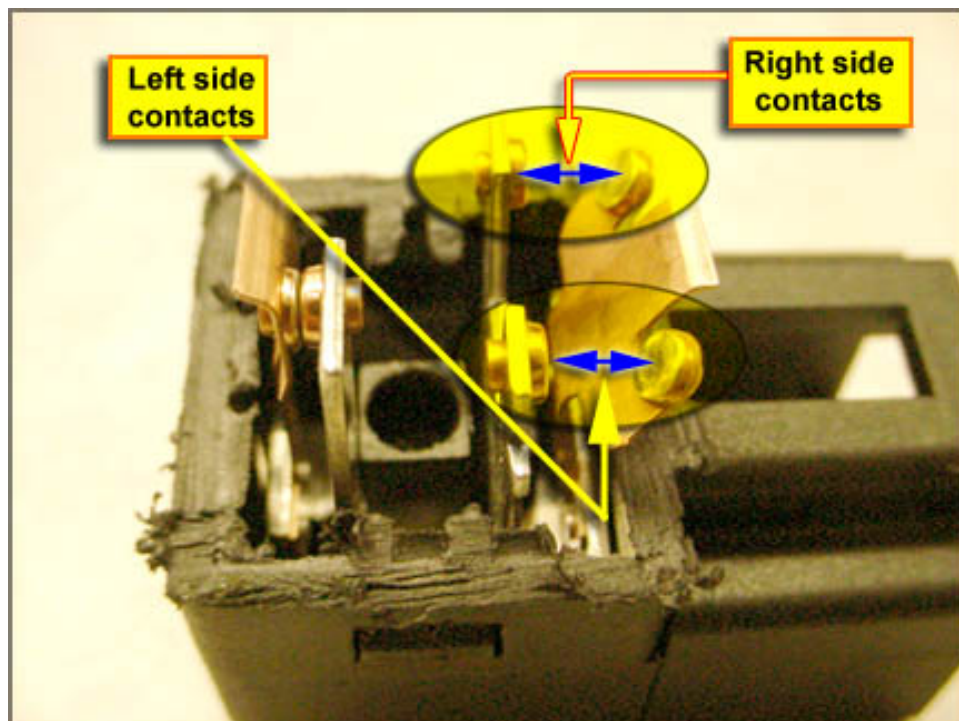

- The next two photos show the close up of the contacts.

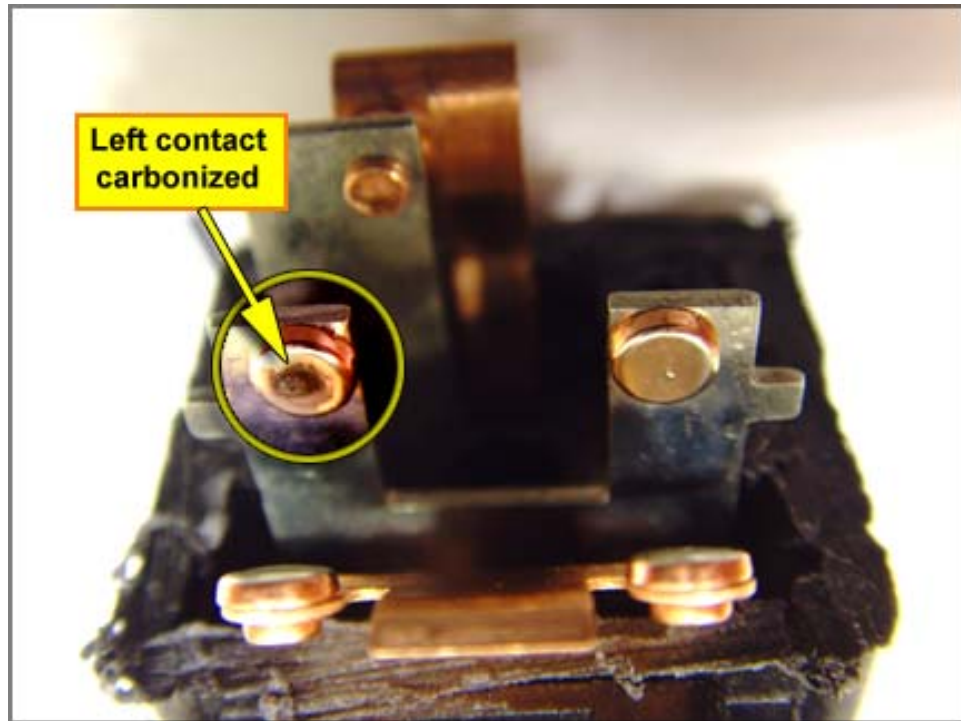

Note: Please note that contacts are flat not “convex”.

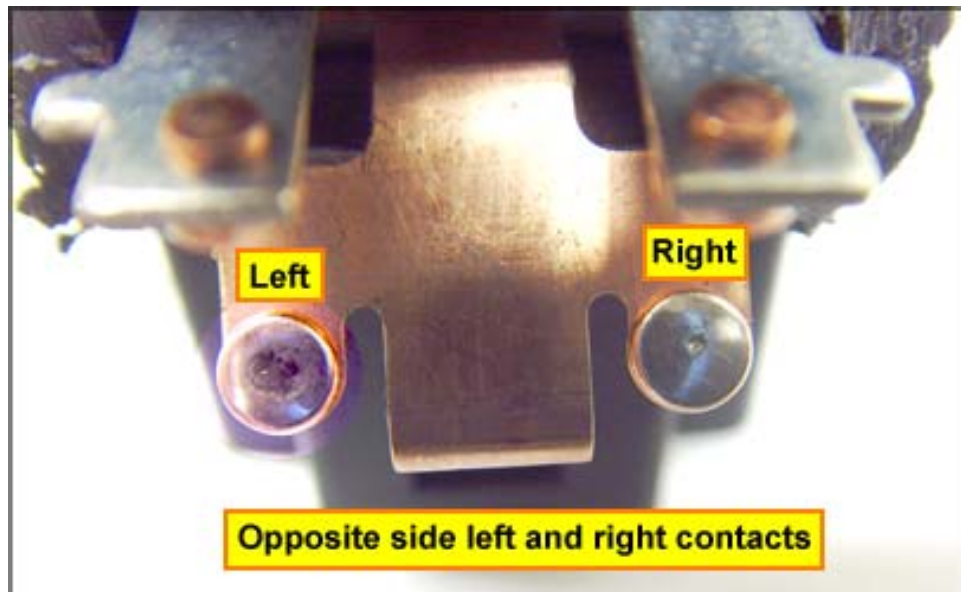

- As the contacts become less active, the switch to open or close electrically may delay more than 500ms. This could set a C1513 code if other conditions are met.
- HMA also feels that one stop lamp switch part number applied to many small to large models may not be adequate as the electrical loads are different for each model.
- Excessive play within switch interacting components that could cause mechanical delay of the switch.

- The chart below shows the incident vehicle repair order.

WPR008C M00021791		Hyundai Motor America	5/14/2007
CSHAH		Claim Inquiry	11:20:16
Inquiry			
Dealer Code : CA230 TRACY HYUNDAI		Pay Percent:	100.00
Claim No : 092901 R/O No: 092901 Version: 00		Sublet \$:	.00
R/O Date Open: 3/31/2007 Close: 3/31/2007		Sublet Type:	
Claim Status : A Approve Labor Rate: 104.00		Labor \$:	31.20
Claim Type : W New Veh. LTD Warranty		Parts \$:	9.34
PWA Type :		Freight \$:	.00
Rental Days : 0	Rental AMT: .00	Towing \$:	.00
Trans Type : Automatic		Total \$:	40.54
VIN Number : KM8NU13C47UI	Veracruz V6	2007 Month In Service:	.5
Sell Dealer : CA230 TRACY HYUNDAI		Mileage :	480
Org Owner :			
HPP Contract :		HPP: Y	HCP:
Nature: N99 OTHERS	Cause: C15 POOR CONTACT & SHORT		
Condition : TECH VERIFIED CUSTOMER COMPLAI			
Causal Part : 938103K000	Grp: 16 Main OP: 93810R00	Hour: .3	Qty: 1
SWITCH ASSY-STOP LAMP(4P)		SWITCH ASSY-STOP LAMP	

3. Action:

- Replace stop lamp switch assembly, P/N: 93810-3K000.

4. Comment/Recommendation:

- HMC should test the incident stop lamp switch in the vehicle to determine the cause(s) of this condition and apply corrections as necessary to improve this condition.
- HMA feels that switch design, particularly switch contact size and shape may be an issue here.
- HMC should open the switch with the collapsed plunger to determine the cause of this condition and apply corrections as necessary.

5. Attachments:

QAEN-C-070513

HYUNDAI

QUALITY INFORMATION
REPORT

CONFIDENTIAL

Model Code EN	Subject Code* CHASSIS	Severity Code 7	HMA Report Number QAEN-C-070513	
Creation date/time/user: 05/15/2007 01:38:56 PM by Casey Shah		Analyst:* Casey Shah	Co-analyst(s):	Modified date/time/user: 05/15/2007 01:39:36 PM by
Distributor* HMA	Country* USA	Vendor Info	Causal part No	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model* VERACRUZ	Engine or Transmission #* G6DA7A798644	Lot #	Production Date* (MM/DD/YY) 2/07/2007	
VIN* KM8NU13C47U [REDACTED]	Mileage* 480	Repair Date (MM/DD/YY)	Delivery Date* (MM/DD/YY) 3/15/2007	
Subject* [B] INTERMITTENT NO "PARK" RELEASE AND "ESC" LIGHT ON (EARLY WARNING)				

Types of QIR					
<input type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date: 05/15/2007

Report Number : QAEN-C-070513

The customer states that the transmission will not come out of park and have to put the key into the shift lock to release the lock. Additional vehicles with the same condition:


<u>VIN</u>	<u>P/D</u>	<u>MILEAGE</u>
KM8NU73C67U [REDACTED]	1/18/07	1,605
KM8NU73C17U [REDACTED]	2/06/07	2,615

Analysis:

Date: 05/15/2007

Report Number : QAEN-C-070513

- The dealer technician confirmed the customer's condition.
- The "ESC OFF" light was lit on the dash.
- The Hi-Scan retrieved C1513 code (Brake Switch Error).
- The dealer technician replaced the stop lamp switch assembly, P/N: 93810-3K000, corrected the condition.
- The incident part was sent to HMA for analysis.
- The photo below shows the incident part.

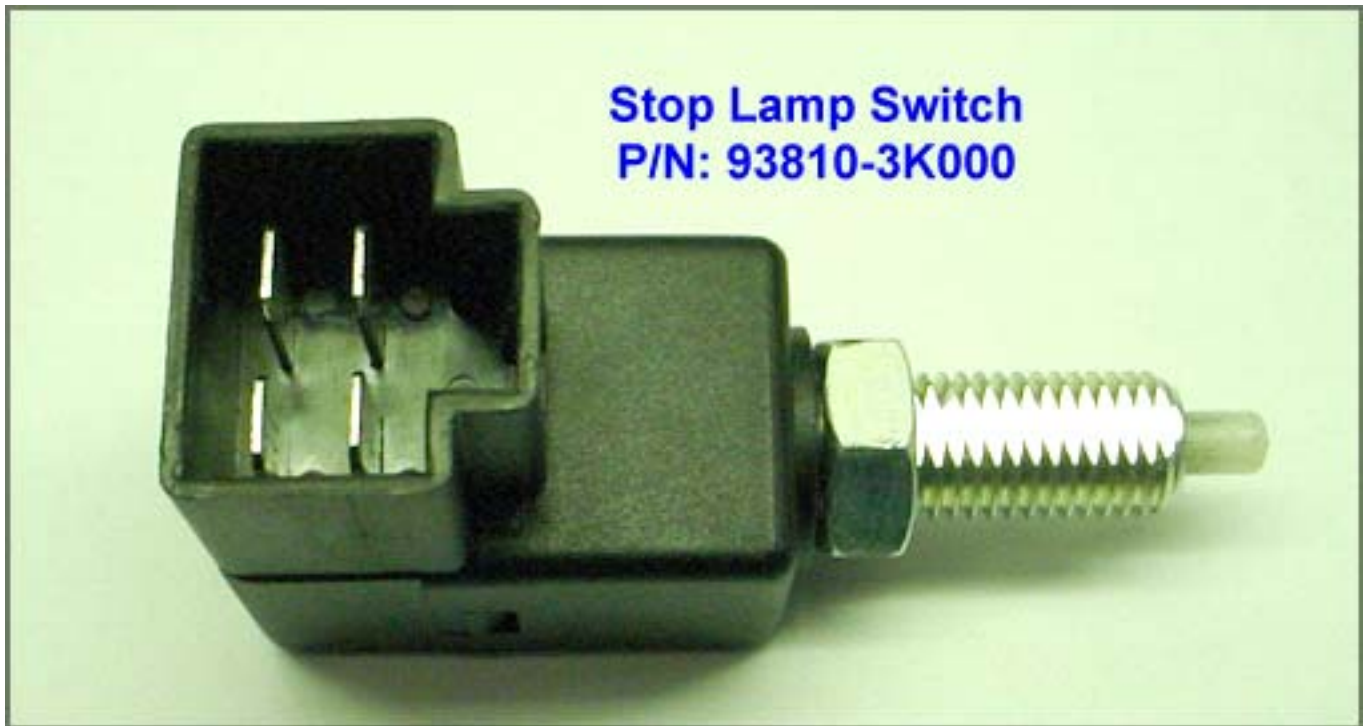


- The static (on the bench) continuity measurement between the pins 1 & 2 and 3 & 4 shows the switch is operating correctly.
- The switch was installed in a Veracruz for checking the dynamic performance of the switch.
- After driving the vehicle, the "ESP OFF" light came on the dash as shown.



- The vehicle was stopped but the gear could not be released from “D” to “R” or “P”.
- At this moment, the Hi-Scan in the Current Data menu provided the following information.

STEERING SNSR (ST.N)	LOW
ABS WARNING LAMP	ON
EBD WARNING LAMP	ON
TCS/ESP WARNING LAMP	OFF
TCS/ESP OFF LAMP	ON
TCS/ESP OFF SWITCH	OFF
BRAKE LAMP SWITCH	OFF
BRAKE SWITCH	ON

- The "Brake Lamp Switch" should also be ON if the switch is working correctly in the brake pedal depressed condition.
- The switch was left in the vehicle to reproduce this condition one more time.
- The Hi-Scan captured the following code.

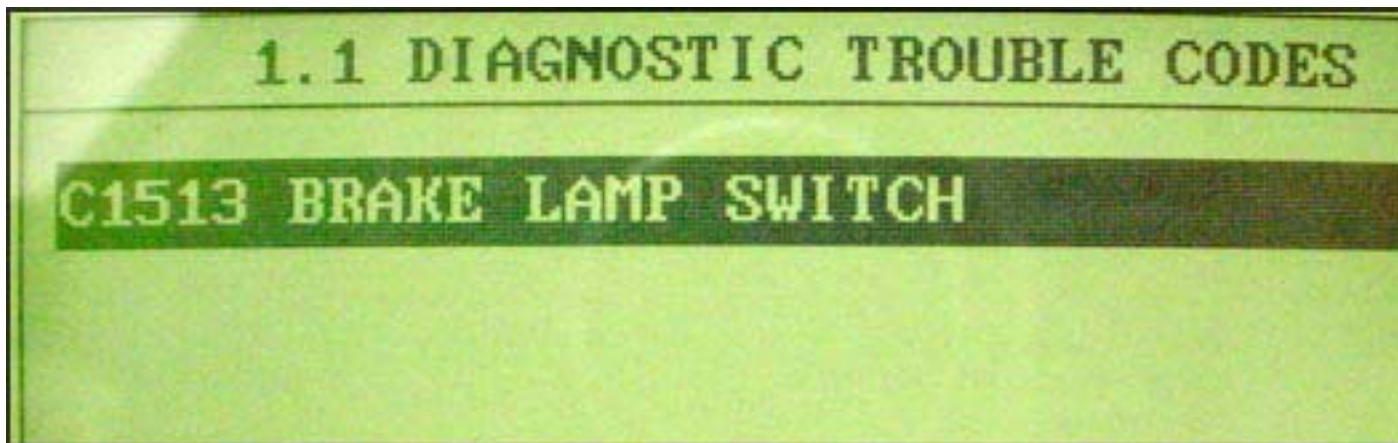

- In the field, three stop lamp switches have been replaced for the same condition (see TABLE below).

VIN Number	Prod Date	Mileage	Total Cost	Technician Comment	Customer Complaint	Cause Comment
KM8NU73C17U [REDACTED]	2/06/07	2615	32.14	GEAR SHIFT WOULD NOT SHIFT OUT OF PARK REPLACED STOM LAMP SWITCH RETESTED FINE		
KM8NU13C47U [REDACTED]	2/07/07	480	40.54	CODE P0504 BRAKE SWITCH PLUNGER STUCK IN	CUSTOMER STATES THE TRANSMISSION WILL NOT COME OUT OF PARK HAVE TO PUT KEY IN SHIFT LOCK RELEASE TO GET INTO DRIVE	TECH VERIFIED CUSTOMER COMPLAINT NOTICED NO BRAKE LIGHT WHEN PRESSING BRAKE PEDAL TECH ALSO VERIFIED LIGHT ON USING CODE TO RETRIEVE CODE P0504 BRAKE SWITCH A/B CORRELATION TECH CHECKED BRAKE SWITCH PLUNGER STUCK RECOMMEND REPLACE BRAKE SWITCH AND
KM8NU73C67U [REDACTED]	1/18/07	1605	48.84	ATT TIME FOR DIAG	CUST STATES VEHICLE WILL NOT SHIFT OUT OF PARK AND WON'T SHIFT INTO REVERSE--YOU HAVE TO USE THE SHIFT LOCK RELEASE IN ORDER TO MOVE THE SHIFTER AT ALL PLEASE CK AND ADVISE	CHECK FOR POWER PIN 2 & 4 OF BRAKE SWITCH HAS 12 VOLTS PIN #1 & #3 SHOW NO GROUND. R&R THE BRAKE SWITCH AND CHECK POWER AT #1
			121.52			

- Please note that this switch, P/N: 93810-3K000, was introduced on the following models from 3/1/2005.

PTR802 M00021791
CSHAH
INQUIRY


Hyundai Motor America
Part - Applied Model Code Inquiry

PART: 93810 3K000 _____

SWITCH ASSY-STOP LAMP(4P)

APPLIED MDL CDE	Effective 3/1/2005 MODEL NAME	DEV MDL	FIRST MDL YR	LAST MDL YR
-----	-----	---	-----	-----
BH	TUCSON	JM	2005	
BL	ACCENT	MC	2006	
BM	SANTA FE (KOREA)	CM	2007	2007
CB	TIBURON	GK	2003	
CF	ELANTRA (2007 -)	HD	2007	
CR	SANTA FE (HMMA)	CM	2007	
EJ	VERACRUZ	EN	2007	
EK	SONATA	NF	2006	2006
EL	AZERA	TG	2006	
EM	SONATA (HMMA)	NF	2006	
GE	ENTOURAGE	EP	2006	

- The water fall chart of this part provides the following information:

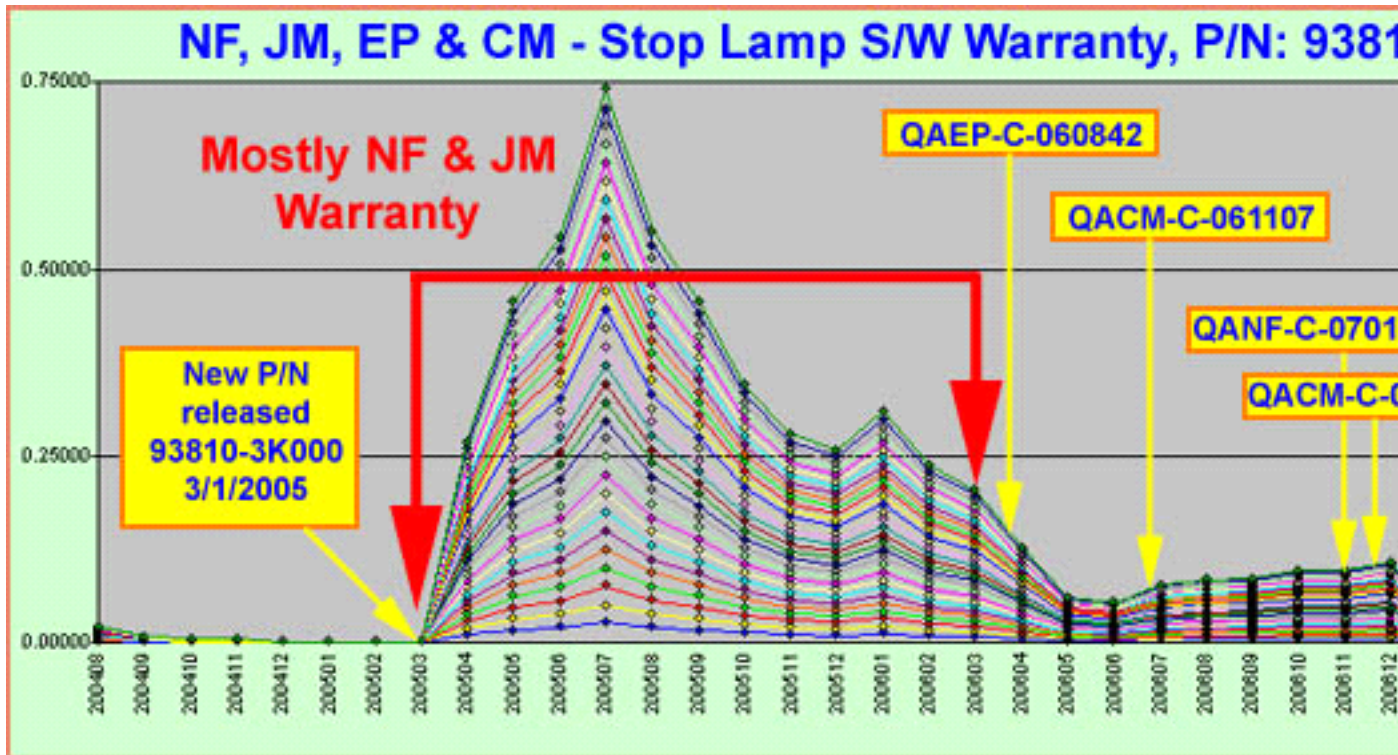

- The following provides HMC's countermeasure responses for each QIR:

Quality Information Report

Including QIS ☐ Status(All) ☐ M

Date: 2006-02-08 ~ 2007-05-16 Model: ***** Nature: *****

Subject: QAEP-C-060842 Report No: Cause: *****

P/No: Refresh Search

Date	Model	Subject	Qty	P/No	Status
2006-08-21	Entourage(EP)	(QAEP-C-060842) [B] STOP LAMP SWITCH WARRANTY (E	5	93810	Wait & See

» Quality Improvement Status

Date	2007-03-01	QIR Issue Date	2007-01-
Subject	(QACM-C-070108) [B] STOP LAMP SWITCH IN-OPERATIVE (EARLY WA		
Report No.	B28MM2007011053	Model	Santafe(C
Status	Improved	TSB No.	NULL
Attachment			
► Improvement Status			
Condition	The customer complained that the brake light stays on.		
Cause	Brake light switch is overheating , causing the brake light to remain on		
Countermeasure	EO change was not approved by HMC. Containment at supplier is a 100% confirm functionality of the switch. Yellow dot is marked after passing t VIN 5NMSG13D17H[REDACTED] Date 2006.12.15		
Effective Date		Vehicle ID Number	5NM

» Quality Improvement Status

Date	2007-02-08	QIR Issue Date	2007-01-31
Subject	(A) QANF-L-070108 INOPERATIVE BRAKE STOP LAMP SWITCH CAUSES HMMA		
Report No.	B28MM2007012656	Model	Sonata(N
Status	Improved	TSB No.	NULL
Attachment			
► Improvement Status			
Condition	Brake Lamps do not illuminate when brake switch is activated.		P
Cause	Switch overheating causing warping and contacts do not close.		P
Countermeasure	H0W60167 redesigns switch to improve heat resistance. 15 Dec 06 imp automatic transmissions. Manual transmission anticipated implementation CRA 061360		
Effective Date		Vehicle ID Number	5NPE


» Quality Improvement Status

Date	2006-12-22	QIR Issue Date	2006-11-1
Subject	(QACM-C-061107) [B] STOP LAMP SWITCH INTERMITTENTLY MALFUNCTIONING HMMA		
Report No.	B28MM2006110951	Model	Santafe(C
Status	Improved	TSB No.	NULL
Attachment			


► Improvement Status

Condition	stop lamp intermittently malfunctioning	P/D =
Cause	overheating of switch	P/N: S
Countermeasure	Proposal to add reinforced ribs, thicken ribs, knurl end of insert (see at 100% testing of switch in place at HMMA Actual implementation of new parts March 07	
Effective Date		Vehicle ID Number


- The cause(s) of this condition is not known; however, following are some possibilities:
 - Plunger may be sticking inside the cylinder due to dimensional variability and/or poor finish on the plastic plunger (see photo below).

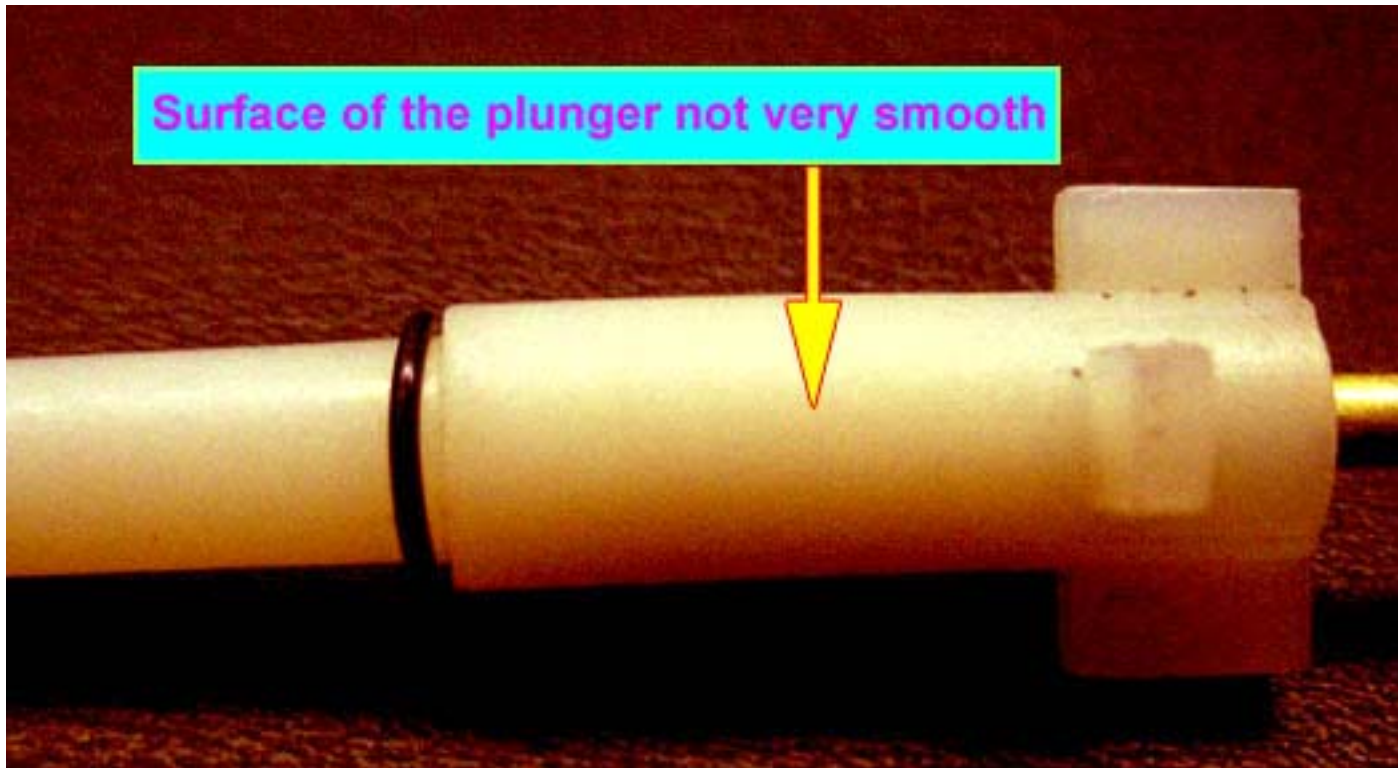


- The photo below shows an incident switch with collapsed plunger inside the cylinder (cause unknown).

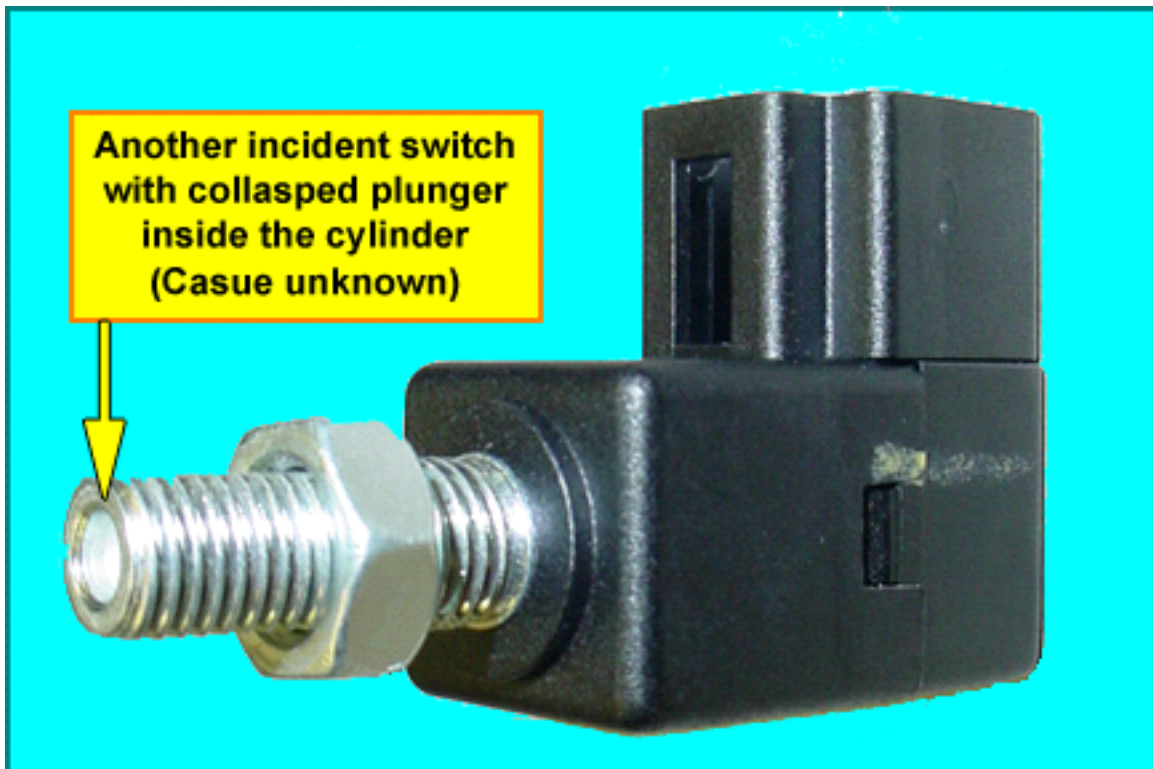


- The stop lamp switch high side contacts (one that operates the tail lamps and sends the signal to activate the shift lock) were found burnt (as shown in the following photographs) that could cause the conditions described in this report.

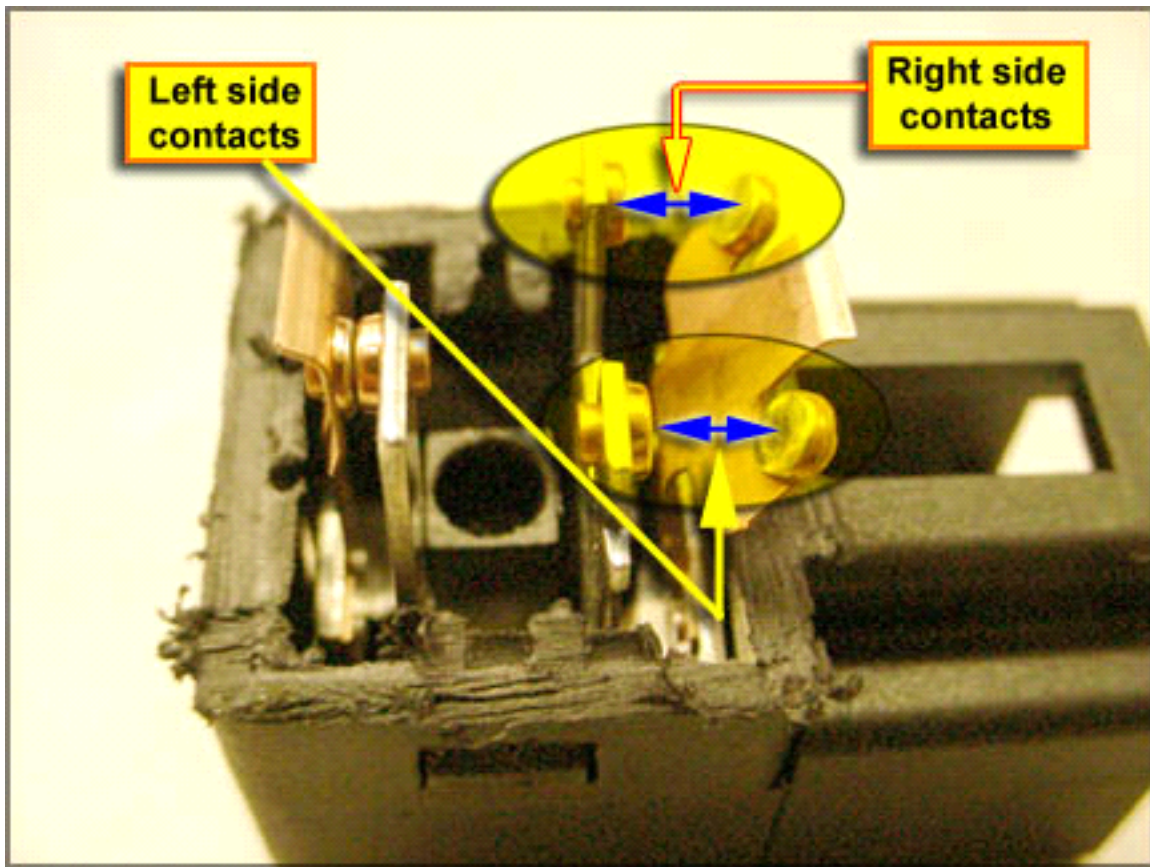

- The next two photos show the close up of the contacts.

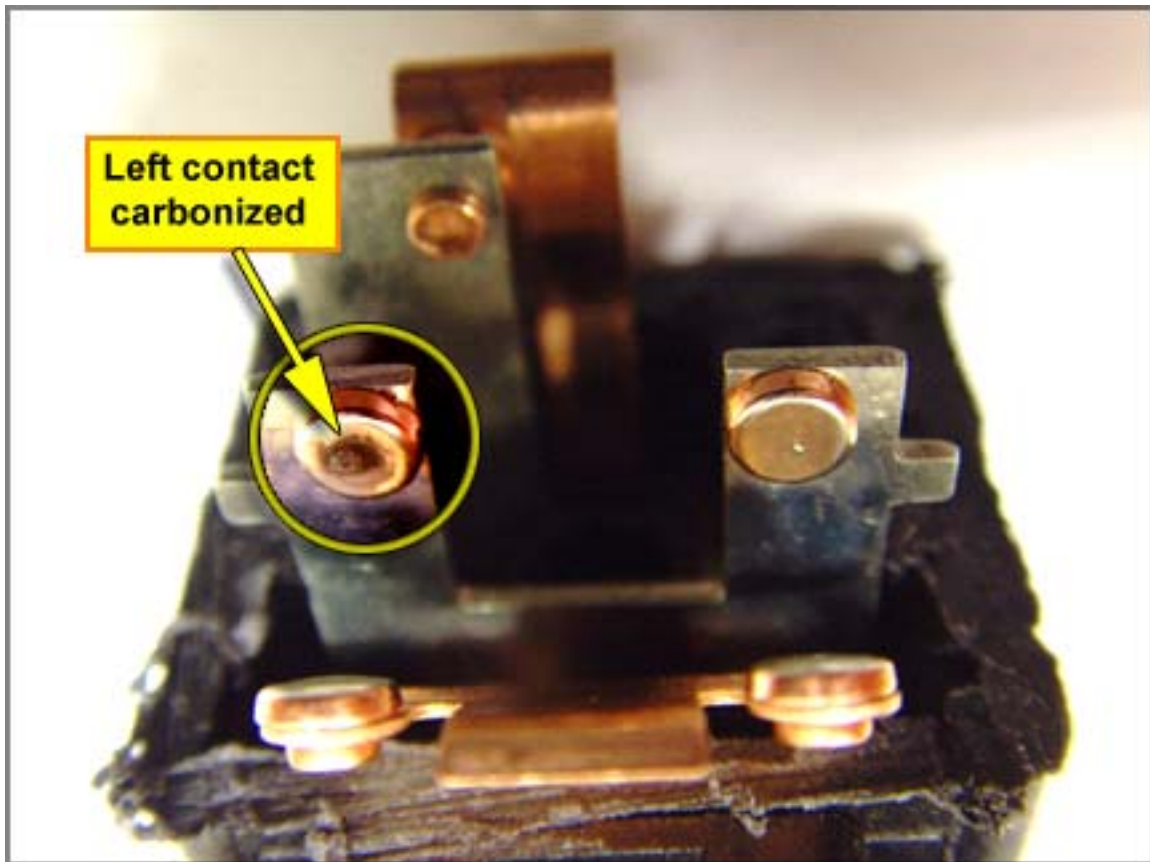

Note: Please note that contacts are flat not "convex".

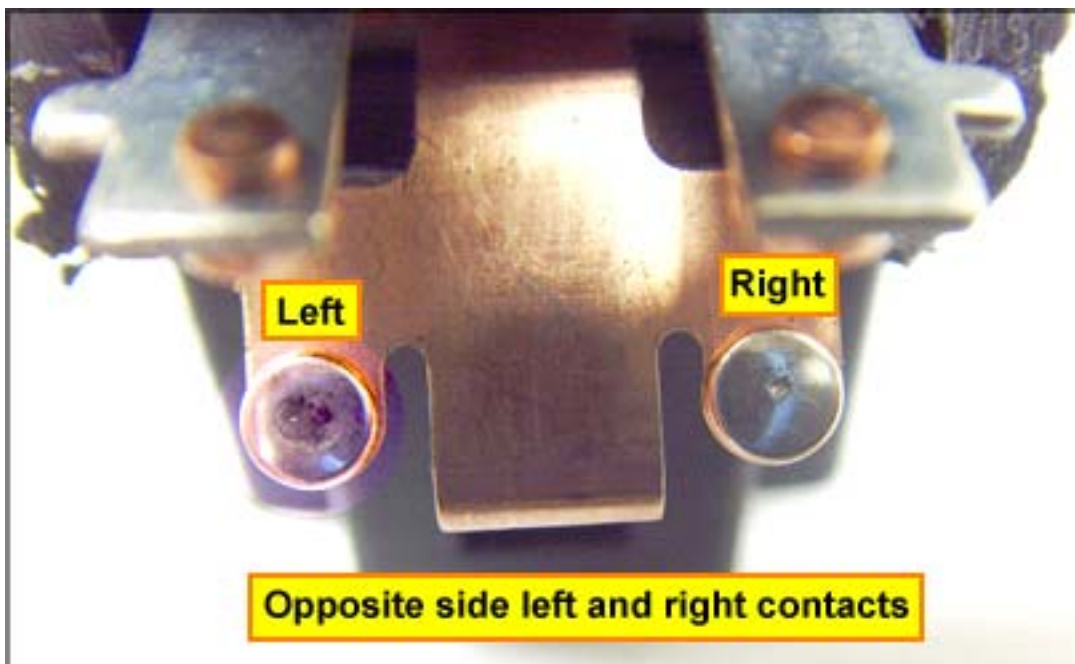

- As the contacts become less active, the switch to open or close electrically may delay more than 500ms. This could set a C1513 code if other conditions are met.

- HMA also feels that one stop lamp switch part number applied to many small to large models may not be adequate as the electrical loads are different for each model.

Excessive play within switch interacting components that could cause mechanical delay of the switch.

- The chart below shows the incident vehicle repair order.

WPR008C M00021791		Hyundai Motor America	
CSHAH		Claim Inquiry	
Inquiry			
Dealer Code	: CA230 TRACY HYUNDAI	Pay Percent:	
Claim No	: 092901 R/O No: 092901 Version: 00	Sublet \$:
R/O Date Open	: 3/31/2007 Close: 3/31/2007	Sublet Type:	
Claim Status	: A Approve Labor Rate: 104.00	Labor \$:
Claim Type	: W New Veh. LTD Warranty	Parts \$:
PWA Type	:	Freight \$:
Rental Days	: 0 Rental AMT: .00	Towing \$:
Trans Type	: Automatic	Total \$:
VIN Number	: KM8NU13C47U Veracruz V6	2007 Month In Se	
Sell Dealer	: CA230 TRACY HYUNDAI	Mileage	:
Org Owner	:		
HPP Contract	:	HPP: Y HCP:	
Nature: N99 OTHERS		Cause: C15 POOR CONTACT & S	
Condition	: TECH VERIFIED CUSTOMER COMPLAI		
Causal Part	: 938103K000 Grp: 16 Main OP: 93810R00 Hour:		
	SWITCH ASSY-STOP LAMP(4P)	SWITCH ASSY-STOP LAM	

Corrective Action:

Date: 05/15/2007

Report Number : QAEN-C-070513

- Replace stop lamp switch assembly, P/N: 93810-3K000.

Comments and Recommendations:

Date: 05/15/2007

Report Number : QAEN-C-070513

- HMC should test the incident stop lamp switch in the vehicle to determine the cause(s) of this condition and apply corrections as necessary to improve this condition.
- HMA feels that switch design, particularly switch contact size and shape may be an issue here.
- HMC should open the switch with the collapsed plunger to determine the cause of this condition and apply corrections as necessary.

Attachments:

Date: 05/15/2007

Report Number : QAEN-C-070513



QIR 19 EN Stop Lamp Switch.doc

QAEN-C-081001

Attachment

QUALITY INFORMATION REPORT

CONFIDENTIAL

Model Code	Subject Code*	Severity	HMA Report Number		
EN	CHASSIS	7			
Creation Date / Time	Analyst*	Co-Analyst	Modified Date / Time		
09/29/08 10:55:02 AM	Carlos Sanders	Arthur Anderson			
Distributor*	Country*	Vendor Information	Causal Part Number*	Attachments	
HMA	USA	Unknown	938103K000	<input checked="" type="checkbox"/> Photo <input type="checkbox"/> Part <input type="checkbox"/> Movie	
Model*	Engine Number*	Lot #	Production Date*		
VERACRUZ	G6DA6A771311	Unknown	01/24/07		
VIN*	Mileage*	Repair Date	Delivery Date*		
KM8NU73C17U [REDACTED]	4,310	02/04/08	10/27/07		
Subject*					
[B] ESC Light Illuminated; Stop Lamp Switch (Countermeasure not effective) - HMC					
QIR TYPE					
<input checked="" type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

1. Condition:

Note:

- This QIR documents EN Stop Lamp Switch claims after the countermeasure date of 12-03-06. (QIS for QIR QAEN-C-070513 shown below).
- Stop Lamp Switch, part number 93810-3K000, is also used in many other HMC vehicles such as the HD (QAHD-L-080702).

Customer statement:

- Customer states ESC light is illuminated. Necessary to use override feature to shift into "D".
- Customer states shift lever sticks when engaging into gear and ESC light comes on.
- Customer states that at times ESC light illuminates and will not come out of "P".

- **Technician statement:** Tech found code C1513, Stop Lamp Switch Circuit. -- Intermittent Stop Lamp switch operation.

Line	VIN	Miles	Prod Date	Customer Complaint	Tech Comment	Cause	Tech Correction
1	KM8NU13C07U [REDACTED]	13771	01/25/07	GUEST STATE THAT AT TIMES WILL NOT GET OUT OF GEAR AND HARD FROM PARK TO OTHER GEARS WILL GO INTO N SHIFT HARD		TECH DIAG STATE THAT STOP LAMP SWITHC INTERMITTANT FAILURE ESC LIGHT ON	INSTALL STOP LAMP SWITCH
2	KM8NU13C37U [REDACTED]	12140	02/01/07	CUSTOMER REPORTS SHIFTER GETS STUCK IN REV AND DRIVE AND HAS TO USE SHIFT UNLOCK TO GET OUT OF GEAR- CHECK AND ADVISE ALSO STILL HEARS A NOISE ON DOWN SHIFT ALSO HAS A JERK WHEN SLOWING DOWN		SWEPT FOR CODES-FOUND CODE C1513- SHORTED BRAKE LAMP SWITCH AFFECTING SHIFTER	R&R BRAKE LAMP SWITCH-- TEST DROVE VEHICLE AND COULD NOT DUPLICATE SHIFT STICKING OR SHIFT NOISE / JERK ALL OKAY AT THIS TIME
3	KM8NU13C47U	16239	02/05/07	C/S SHIFTER VERY	CUSTOMER STATES	DEFECTIVE	REPLACED

	██████			HARD TO MOVE	SHIFTER VERY HARD TO MOVE; PLUNGER ON SWITCH STICKING AT TIMES; REPLACED BRAKE LAMP SWITCH	BRAKE LAMP SWITCH	BRAKE LAMP SWITCH
4	KM8NU73C17U ██████	2615	02/06/07	CUSTOMER STATES GEAR SHIFT WOULD NOT SHIFT OUT OF PARK	GEAR SHIFT WOULD NOT SHIFT OUT OF PARK. REPLACED STOP LAMP SWITCH. RETESTED FINE	BRAKE LIGHT SWITCH	INSPECT AND REPLACE 93810R00.3 // N94 // C15
5	KM8NU73C97U ██████	6541	12/28/06	CAMPAIGN T50 FUEL FILTER CANISTER.	*CUSTOMER STATES ESC LIGHT ON WHEN PUSHING BRAKE, SCAN TEST C1518 SWITCH SHORTED. REPLACED SWITCH. ATT IS FOR SCAN"		COMPLETED T50 CAMPAIGN
6	KM8NU73CX7U ██████	18200	01/11/07	CUSTOMER STATES THE ESC LIGHT CAME ON AND SHE RESTARTED AND WENT AWAY	18200 ECS LIGHT CAME ON. SCANNED FOR CODES, FOUND C1315 BAD BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH		93810RP0 18200 ECS LIGHT CAME ON. SCANNED FOR CODES, FOUND C1315 BAD BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH
7	KM8NU73C97U ██████	20770	01/12/07	C/S ESC LIGHT IS ON. VEHICLE WILL NOT GO INTO PARK. KEY WONT COME OUT OF IGNITION. CHECK ENGINE LIGHT CAME ON AND AS OF SUNDAY CONDITIONS DISAPPEARED. CUSTOMER HAD TOW TRUCK. DRIVER ADJUST SHIFT LOCK BY SHIFTER TO ENABLE MOVEMENT	C/S ESC LT IS ON VEH. WONT GO INTO PARK. KEY WONT COME OUT OF IGNITION/ INTERNAL FAILURE OF BRAKE SWITCH/TECHNICIAN REPLACED SWITCH TO CORRECT CONCERN. CLEARED CODES. ROADTESTED. OPERATING TO DESIGN INTENT AT THIS TIME	INTERNAL FAILURE OF BRAKE SWITCH. ADJUSTMENTS WILL NOT CORRECT AT THIS TIME. REQUIRES REPLACEMENT OF SWITCH	TECHNICIAN REPLACED SWITCH TO CORRECT CONCERN. CLEARED CODES. ROADTESTED. OPERATING TO DESIGN INTENT AT THIS TIME
8	KM8NU13C67U ██████	15547	01/18/07	C/S ESC LITE IS ON	FOUND SHORTED BRAKE LIGHT SWITCH.... CAUSE OF BOTH PROBLEMS. NORMAL OPERATION.		
9	KM8NU73C67U ██████	1605	01/18/07	CUST STATES THAT THE ESC LIGHT DOES NOT COME ON. PLEASE CHECK AND ADVISE	ATT TIME FOR DIAG	COULD NOT DUPLICATE	ESC LIGHT AND CHECK ENGINE LIGHT IS OFF- MEETS MANUFACTURE RS STANDARDS AT THIS TIME
10	KM8NU73C97U ██████	6541	12/28/06	CAMPAIGN T50 FUEL FILTER CANISTER.	*CUSTOMER STATES ESC LIGHT ON WHEN PUSHING BRAKE SCAN TEST C1518 SWITCH SHORTED. REPLACED SWITCH. ATT IS FOR SCAN"		COMPLETED T50 CAMPAIGN

- **Customer driving habit / operation condition:** Normal driving conditions.
- **Road condition:** N/A
- **Weather condition:** N/A
- **Vehicle speed:** Normal driving speeds.
- **Number of passengers:** N/A
- **Region:** N/A
- **Other comments:** N/A

2. Analysis:

To	HMA		
Attn	HMA Service Staff		
CC	Casey Shah	Date	2007-08-23
From	YOUNGHOKIM/Hyundai Motor Company	QIR Issue Date	2007-05-30
Subject	(QAEN-C-070513) [B] INTERMITTENT NO "PARK" RELEASE AND "ESC" LIGHT ON (EARLY WARNING)		
Report No.	B28AA2007051903	Model	Veracruz(EN)
Status	Improved	TSB No.	

► Improvement Status
Condition
Transmission will not come out of park and have to put the key into the shift lock to release the lock.
Cause
Investigation results. (Defective parts : total 3EA) - 2EA : Normal. - 1EA : Improper rod return.
Countermeasure
The molding of stop lamp switch rod was modified. - The Lot of defective parts is before improvement.
Effective Date/TSB No.
2006-12-03
Vehicle ID No.
KMHNU81WP7U003758

QIS for QIR QAEN-C-070513

- **Number of cases (specific to QIR):** 10
- **Concern rate (number of cases/overall warranty)** 3.9% (819/20,836)

Customer complaints	Warranty	CA	Tech Line	FSE	EQF	OTHERS	
10	819	0	0	3	0	Buy back	RSA
						0	xx


2008 Model	T14: Auto Trans-Gearshift Hard To Operate
'08 EN	0.7
Chrysler Pacifica	0.0
Dodge Durango	0.0
Ford Edge	0.0
Ford Explorer	0.0
Ford Taurus X	0.0
Kia Sorento	0.0
Saturn OUTLOOK	0.0
Toyota 4Runner	0.0
Mazda CX-9	0.2
Subaru Tribeca	0.3
Nissan Pathfinder	0.5
Toyota Highlander (Total)	0.5

2008 JD Power IQS Scores (Syndicated Study)


- There are generally two (2) symptoms that accompany Stop Lamp Switch failures (improper shift lever operation or ESC light illuminated).
- Since there is **no JD Power survey question specifically pertaining about ESC**, the survey question: "T14: Auto Trans-Gearshift Hard to Operate" data was reviewed. Please refer to 2008 IQS score chart above.
- The 2008 IQS scores suggest that there is an area of opportunity for improvement (many competitors score 0.0 PP100) for "Auto Trans-Gearshift Hard to Operate".

■ **Warranty analysis:**


- Warranty data analyzed reveals that most claims occur between 10 and 12 months in service.

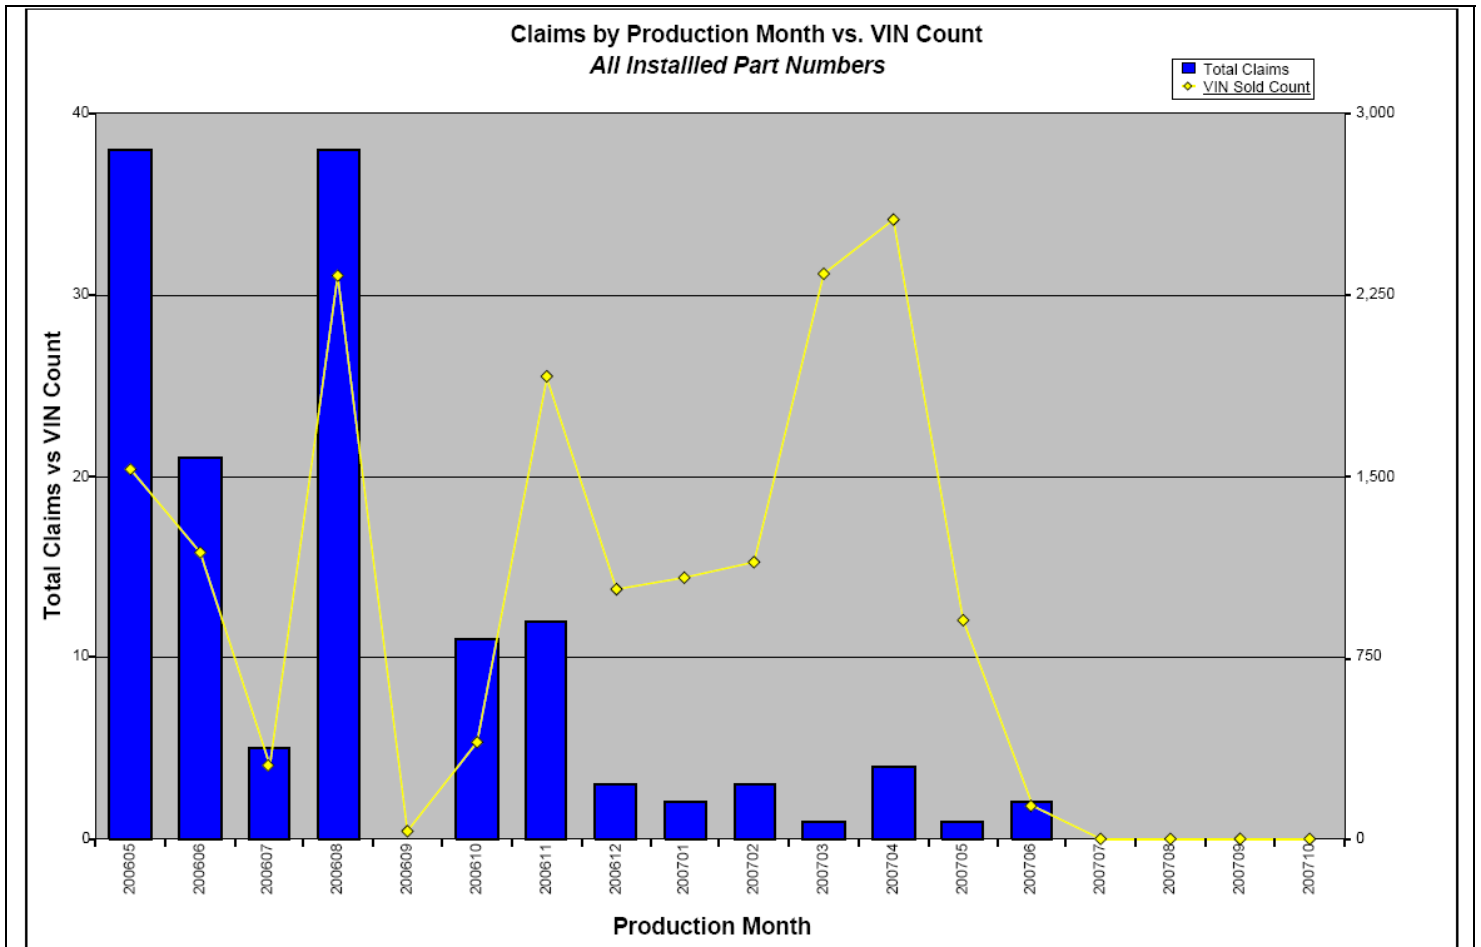


Claims by Claim Repair Month
Included Op Codes: '93810R00'

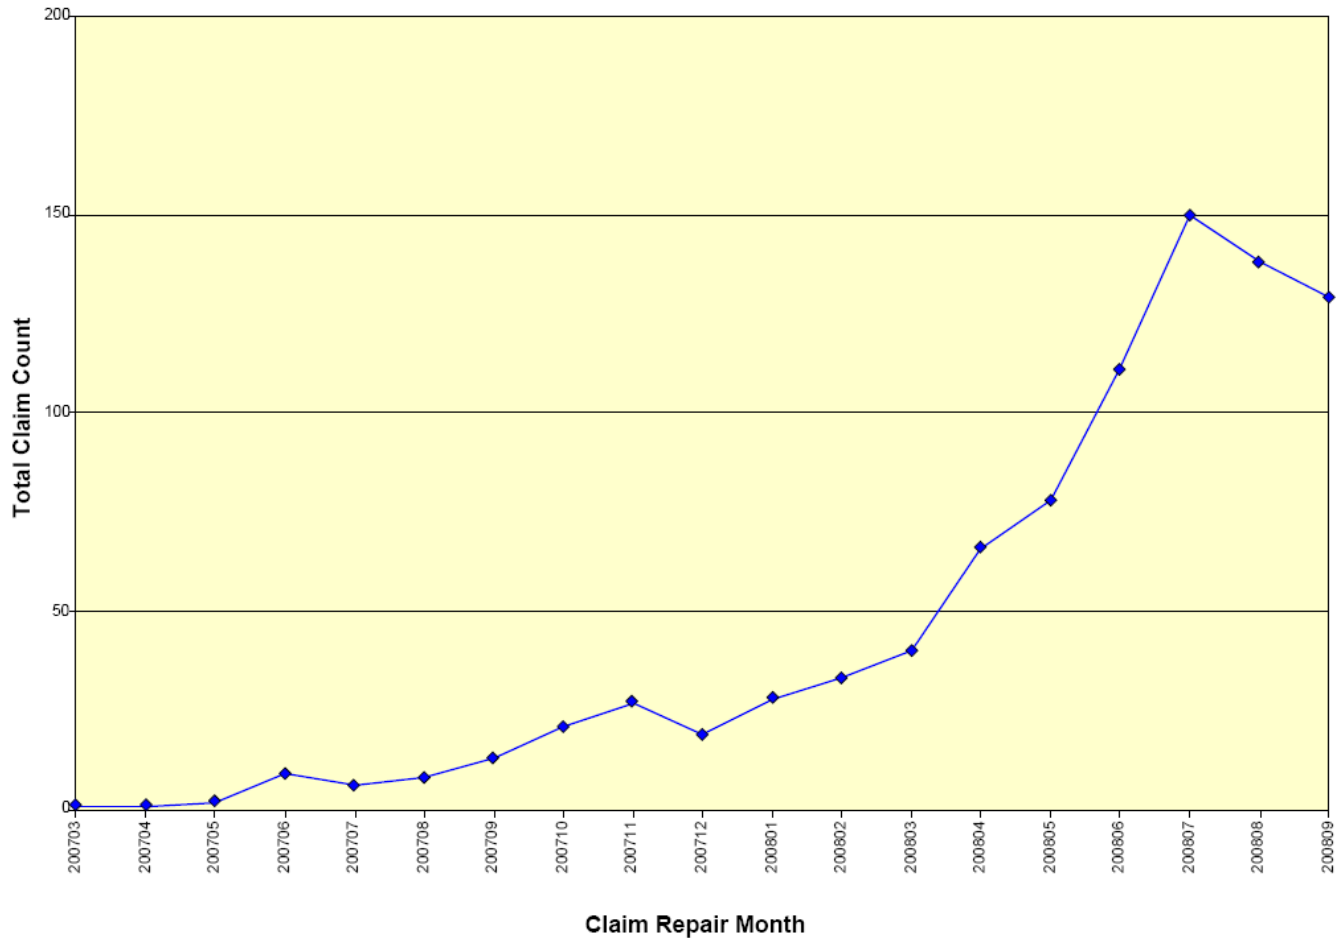


Claims by Months In Service
Included Op Codes: '93810R00'

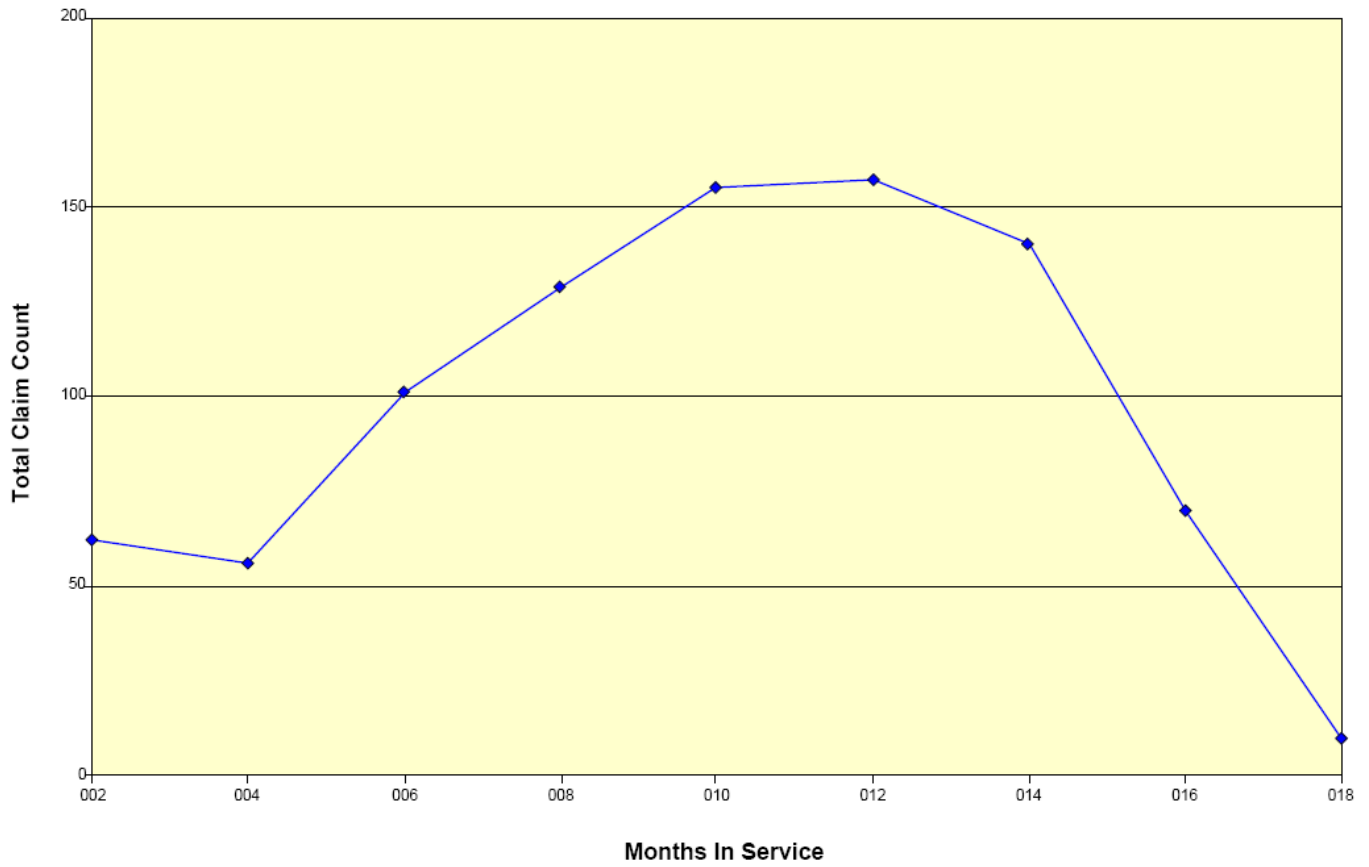


Defects by Mileage Range
Included Op Codes: '93810R00'

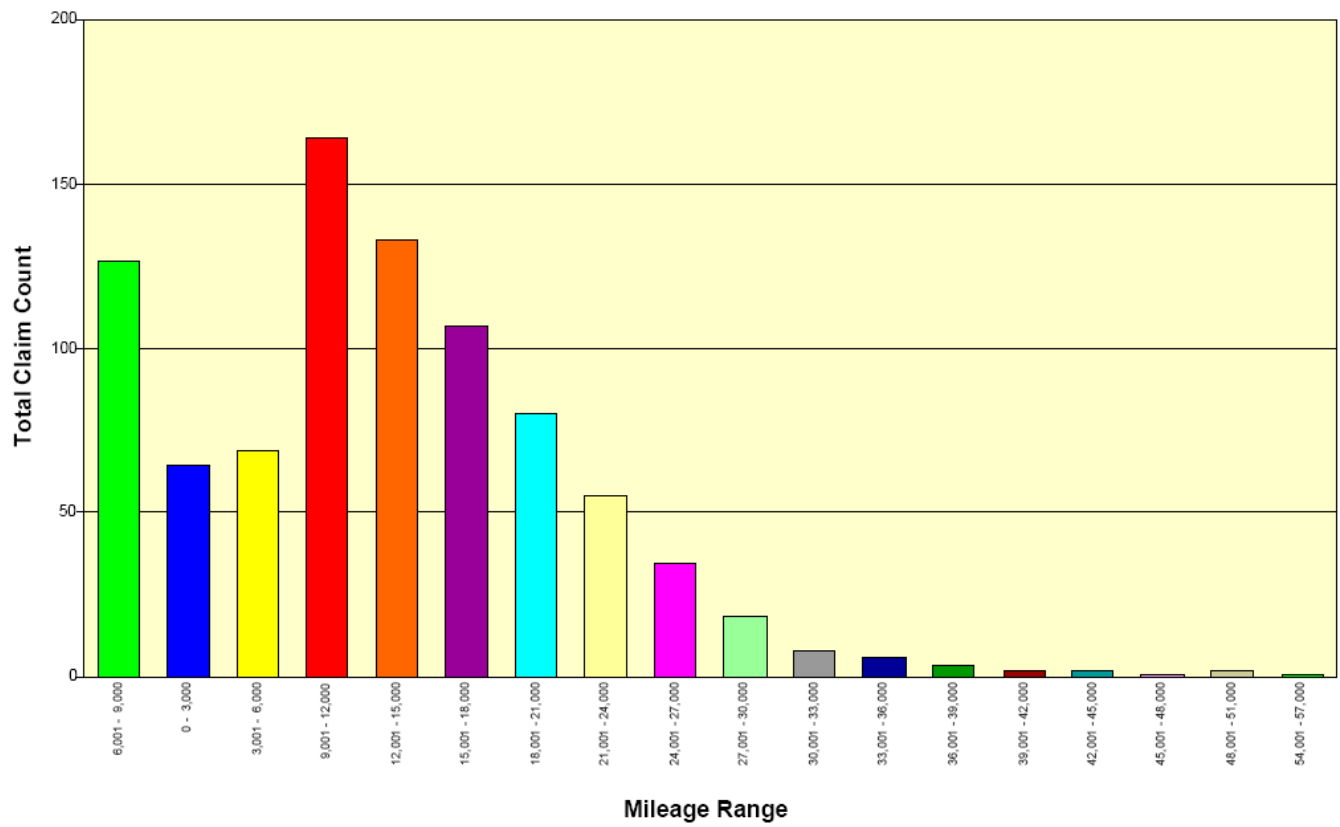

Claims by Nature Code
Included Op Codes: '93810R00'

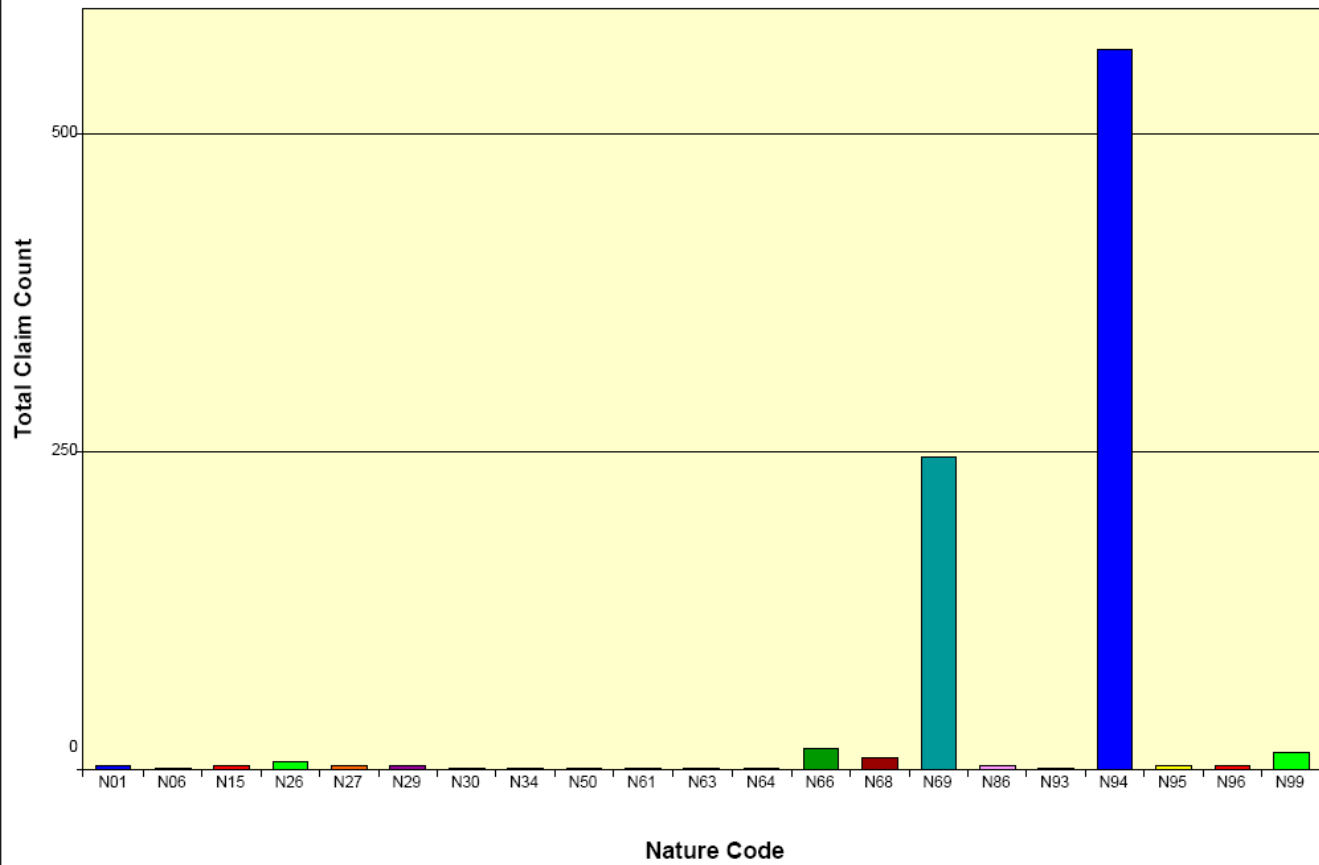

N94	N69	Others
526 (64%)	231 (28%)	62 (8%)

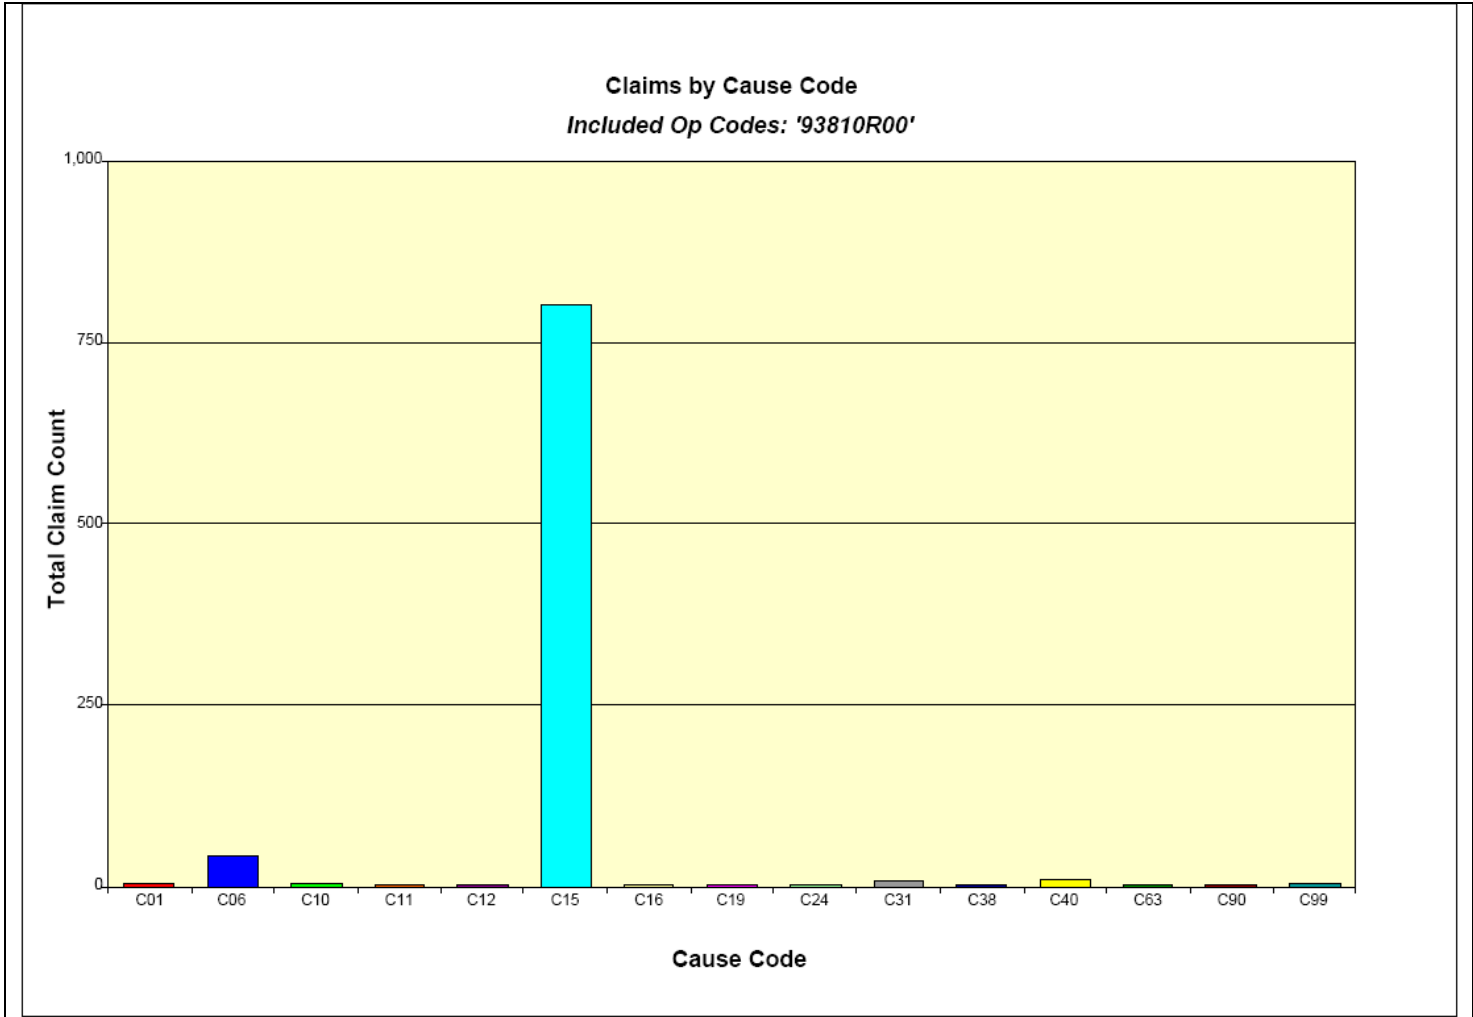

Summary


Production Date : All		Region : All		Months In Service : All	
Claim Paid Date : All				Mileage Range : All	
Claim Repair Date : All					

Model Year : All Model Code : EN Warranty Claim Type : All Transmission Type : All Engine Code : All Emissions Flag : All	DMRS Group Code : All Tread Act Group Code : All Cause Code : All Nature Code : All Plant Code : All Port Claim : X	Body Style : All Trim Level : All Exterior Color : All Interior Color : All
--	--	--

Included Op Code : '93810R00' 1st 5 Op Code : All Causal Part No : All 1st 5 Causal Part No : All Installed Part No : All 1st 5 Installed Part No : All	Excluded Op Code : All 1st 5 Op Code : All Causal Part No : All 1st 5 Causal Part No : All Installed Part No : All 1st 5 Installed Part No : All	Range Op Code : All 1st 5 Op Code : All Causal Part No : All 1st 5 Causal Part No : All Installed Part No : All 1st 5 Installed Part No : All
--	---	--

Business Processing Date : 09-26-2008
Run Date : 09/29/08 04:05 PM

- Total EN warranty dollars at this time: ~\$31,000 approximately \$38 per claim.
- This condition, when looking at “the bigger picture” is an opportunity to improve IQS and VDS scores.
- The chart below shows Stop Lamp Switch claims for all Hyundai models for vehicles produced after January 2008. The data suggests that improvements to the Stop Lamp Switch should help improve reliability and the perception of quality for all Hyundai models.

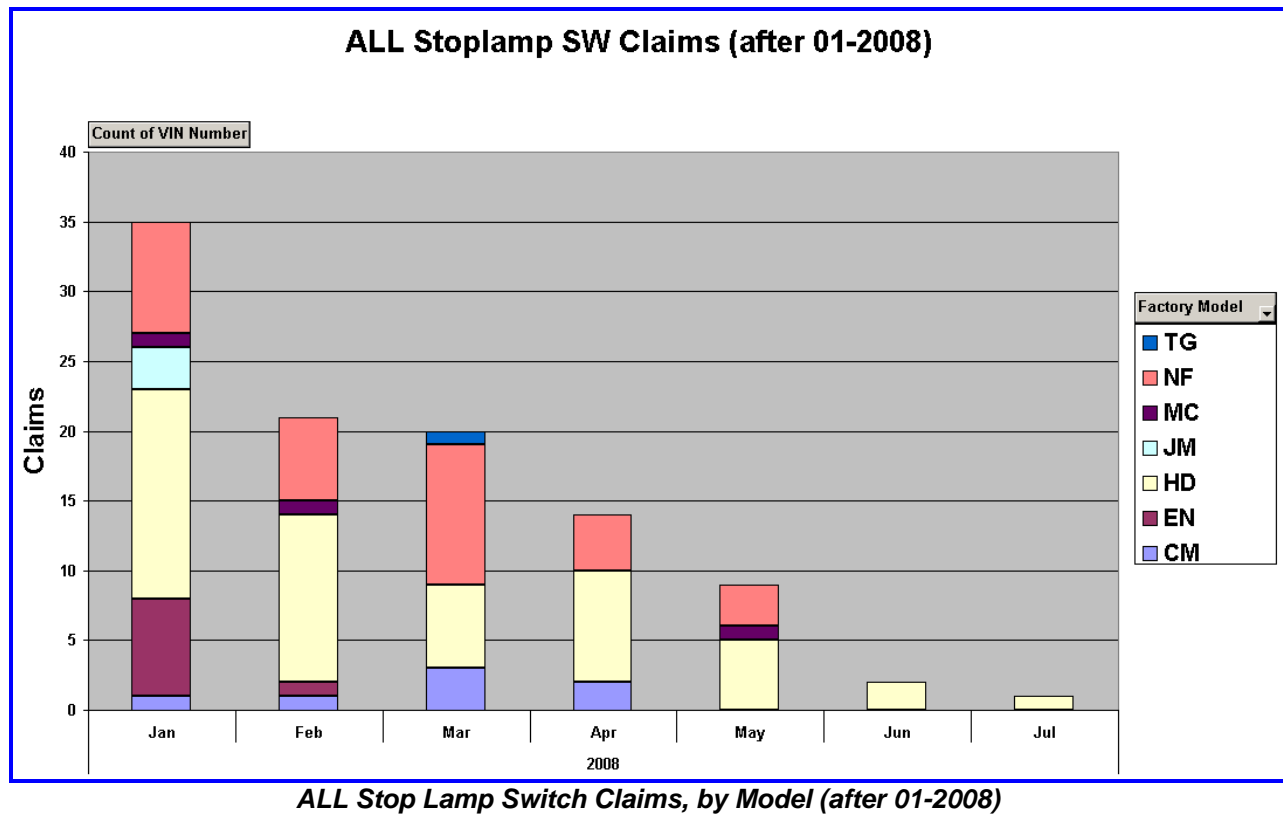

3. Action:

- **Dealer fix**
 - Dealers diagnose using scan tool and replace incident stop lamp switch to resolve.
- **Repair procedure**
 - Remove and replace according to the service manual.

4. Comment/Recommendation:

- **Production C/M**
 - HMC should develop a more robust Stop Lamp Switch to prevent setting ESC codes and prevent transmission shift lever interlock concerns.
 - HMA will collect incident parts and forward them to HMC.
- **Port action**
 - A port campaign and countermeasure parts will be required.
- **Field fix**
 - HMC should develop improved parts, and purge old stock of the 93810-3K000 Stop Lamp Switch.
- **TSB**
 - HMC should develop a TSB to advise dealers regarding diagnosis and countermeasure parts along with proper old and part identification.
- **C/M Part:**
 - An effective countermeasure should be developed for field/port repairs.
- **Other comment**

- o N/A.

Attachments:

QAEN-C-081001

HYUNDAI

QUALITY INFORMATION
REPORT

CONFIDENTIAL

Model Code EN	Subject Code* CHASSIS	Severity Code 7	HMA Report Number QAEN-C-081001	
Creation date/time/user: 10/01/2008 09:55:56 AM by Carlos Sanders		Analyst:* Carlos Sanders	Co-analyst(s): Arthur Anderson	Modified date/time/user: 10/01/2008 09:55:33 AM by
Distributor* HMA	Country* USA	Vendor Info Unknown	Causal part No 938103K000	Attachments Yes <input type="checkbox"/> Movie <input type="checkbox"/> Photo <input type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model* VERACRUZ	Engine or Transmission #* G6DA6A771311	Lot # Unknown	Production Date* (MM/DD/YY) 01/24/07	
VIN* KM8NU73C17U [REDACTED]	Mileage* 4,310	Repair Date (MM/DD/YY) 02/04/08	Delivery Date* (MM/DD/YY) 10/27/07	
Subject* [B] ESC Light Illuminated; Stop Lamp Switch (Countermeasure not effective) - HMC				

Types of QIR					
<input checked="" type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date:

Report Number : QAEN-C-081001

Note:

- o This QIR documents EN Stop Lamp Switch claims after the countermeasure date of 12-03-06. (QIS for QIR QAEN-C-070513 shown below).
- o Stop Lamp Switch, part number 93810-3K000, is also used in many other HMC vehicles such as the HD (QAHD-L-080702).

▪ **Customer statement:**

- o Customer states ESC light is illuminated. Necessary to use override feature to shift into "D".
- o Customer states shift lever sticks when engaging into gear and ESC light comes on.
- o Customer states that at times ESC light illuminates and will not come out of "P".

▪ **Technician statement:** Tech found code C1513, Stop Lamp Switch Circuit. -- Intermittent Stop Lamp switch operation.

Line	VIN	Miles	Prod Date	Customer Complaint	Tech Comment	Cause	Tech Correction
1	KM8NU13C07U [REDACTED]	13771	01/25/07	GUEST STATE THAT AT TIMES WILL NOT GET OUT OF GEAR AND HARD FROM PARK TO OTHER GEARS WILL GO INTO N SHIFT HARD		TECH DIAG STATE THAT STOP LAMP SWITHC INTERMINTANT FALURE ESC LIGHT ON	INSTALL STOP LAMP SWITCH
2	KM8NU13C37U [REDACTED]	12140	02/01/07	CUSTOMER REPORTS SHIFTER GETS STUCK IN REV AND DRIVE AND HAS TO		SWEPT FOR CODES-FOUND CODE C1513-SHORTED BRAKE LAMP SWITCH	R&R BRAKE LAMP SWITCH --TEST DROVE VEHICLE AND

				USE SHIFT UNLOCK TO GET OUT OF GEAR-CHECK AND ADVISE ALSO STILL HEARS A NOISE ON DOWN SHIFT ALSO HAS A JERK WHEN SLOWING DOWN		AFFECTING SHIFTER	COULD NOT DUPLICATE SHIFT STICKING OR SHIFT NOISE / JERK ALL OKAY AT THIS TIME
3	KM8NU13C47 U ■■■■■	16239	02/05/07	C/S SHIFTER VERY HARD TO MOVE	CUSTOMER STATES SHIFTER VERY HARD TO MOVE; PLUNGER ON SWITCH STICKING AT TIMES; REPLACED BRAKE LAMP SWITCH	DEFECTIVE BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
4	KM8NU73C17 U ■■■■■	2615	02/06/07	CUSTOMER STATES GEAR SHIFT WOULD NOT SHIFT OUT OF PARK	GEAR SHIFT WOULD NOT SHIFT OUT OF PARK REPLACED STOP LAMP SWITCH RETESTED FINE	BRAKE LIGHT SWITCH	INSPECT AND REPLACE 93810R00 .3 // N94 // C15
5	KM8NU73C97 U ■■■■■	6541	12/28/06	CAMPAIGN T50 FUEL FILTER CANISTER.	"CUSTOMER STATES ESC LIGHT ON WHEN PUSHING BRAKE, SCAN TEST C1518 SWITCH SHORTED REPLACED SWITCH ATT IS FOR SCAN"		COMPLETED T50 CAMPAIGN
6	KM8NU73CX7 U ■■■■■	18200	01/11/07	CUSTOMER STATES THE ESC LIGHT CAME ON AND SHE RESTARTED AND WENT AWAY	18200 ECS LIGHT CAME ON SCANNED FOR CODES, FOUND C1315 BAD BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH		93810RP0 18200 ECS LIGHT CAME ON SCANNED FOR CODES ,FOUND C1315 BAD BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH
7	KM8NU73C97 U ■■■■■	20770	01/12/07	C/S ESC LIGHT IS ON. VEHICLE WILL NOT GO INTO PARK KEY WONT COME OUT OF IGNITION. CHECK ENGINE LIGHT CAME ON AND AS OF SUNDAY CONDITIONS DISAPPEARED. CUSTOMER HAD	C/S ESC LT IS ON VEH. WONT GO INTO PARK-KEY WONT COME OUT OF IGNITION/ INTERNAL FAILURE OF BRAKE SWITCH/TECHNICIAN REPLACED SWITCH TO CORRECT CONCERN	INTERNAL FAILURE OF BRAKE SWITCH. ADJUSTMENTS WILL NOT CORRECT AT THIS TIME. REQUIRES REPLACEMENT OF SWITCH	TECHNICIAN REPLACED SWITCH TO CORRECT CONCERN CLEARED CODES. ROADTESTED. OPERATING TO DESIGN INTENT AT

				TOW TRUCK DRIVER ADJUST SHIFT LOCK BY SHIFTER TO ENABLE MOVEMENT	CLEARED CODES. ROADTESTED. OPERATING TO DESIGN INTENT AT THIS TIME		THIS TIME
8	KM8NU13C67 U ■■■■	15547	01/18/07	C/S ESC LITE IS ON	FOUND SHORTED BRAKE LIGHT SWITCH.... CAUSE OF BOTH PROBLEMS. NORMAL OPERATION.		
9	KM8NU73C67 U ■■■■	1605	01/18/07	CUST STATES THAT THE ESC LIGHT DOES NOT COME ON PLEASE CHECK AND ADVISE	ATT TIME FOR DIAG	COULD NOT DUPLICATE	ESC LIGHT AND CHECK ENGINE LIGHT IS OFF -MEETS MANUFACTURERS STANDARDS AT THIS TIME
10	KM8NU73C97 U ■■■■	6541	12/28/06	CAMPAIGN T50 FUEL FILTER CANISTER.	"CUSTOMER STATES ESC LIGHT ON WHEN PUSHING BRAKE SCAN TEST C1518 SWITCH SHORTED REPLACED SWITCH AT IS FOR SCAN"		COMPLETED T50 CAMPAIGN

- Customer driving habit / operation condition: Normal driving conditions.
- Road condition: N/A
- Weather condition: N/A
- Vehicle speed: Normal driving speeds.
- Number of passengers: N/A
- Region: N/A
- Other comments: N/A

Analysis:

Date:

Report Number : QAEN-C-081001

To	HMA		
Attn	HMA Service Staff		
CC	Casey Shah	Date	2007-08-23
From	YOUNGHOKIM/Hyundai Motor Company	QIR Issue Date	2007-05-30
Subject	(QAEN-C-070513) [B] INTERMITTENT NO "PARK" RELEASE AND "ESC" LIGHT ON (EARLY WARNING)		
Report No.	B28AA2007051903	Model	Veracruz(EN)
Status	Improved	TSB No.	

► Improvement Status			
Condition			
Transmission will not come out of park and have to put the key into the shift lock to release the lock.			
Cause			
Investigation results. (Defective parts : total 3EA) - 2EA : Normal. - 1EA : Improper rod return.			
Countermeasure			
The molding of stop lamp switch rod was modified. - The Lot of defective parts is before improvement.			
Effective Date/TSB No.	2006-12-03	Vehicle ID No.	KMHNU81WP7U003758

QIS for QIR QAEN-C-070513

- Number of cases (specific to QIR): 10
- Concern rate (number of cases/overall warranty) 3.9% (819/20,836)

Customer complaints	Warranty	CA	Tech Line	FSE	EQF	OTHERS
10	819	0	0	3	0	Buy back RSA 0 xx

2008 Model	T14: Auto Trans-Gearshift Hard To Operate
'08 EN	0.7
Chrysler Pacifica	0.0
Dodge Durango	0.0
Ford Edge	0.0
Ford Explorer	0.0
Ford Taurus X	0.0
Kia Sorento	0.0
Saturn OUTLOOK	0.0
Toyota 4Runner	0.0
Mazda CX-9	0.2
Subaru Tribeca	0.3
Nissan Pathfinder	0.5
Toyota Highlander (Total)	0.5

2008 JD Power IQS Scores (Syndicated Study)

- There are generally two (2) symptoms that accompany Stop Lamp Switch failures (improper shift lever operation or ESC light illuminated).
- Since there is no JD Power survey question specifically pertaining about ESC, the survey question: "T14: Auto Trans-Gearshift Hard to Operate" data was reviewed. Please refer to 2008 IQS score chart above.
- The 2008 IQS scores suggest that there is an area of opportunity for improvement (many competitors score 0.0 PP100) for "Auto Trans-Gearshift Hard to Operate".
- **Warranty analysis:**
 - Warranty data analyzed reveals that most claims occur between 10 and 12 months in service.

Corrective Action:

Date:

Report Number : QAEN-C-081001

- **Dealer fix**
 - Dealers diagnose using scan tool and replace incident stop lamp switch to resolve.
- **Repair procedure**
 - Remove and replace according to the service manual.

Comments and Recommendations:

Date:

Report Number : QAEN-C-081001

- **Production C/M**
 - HMC should develop a more robust Stop Lamp Switch to prevent setting ESC codes and prevent transmission shift lever interlock concerns.
 - HMA will collect incident parts and forward them to HMC.
- **Port action**
 - A port campaign and countermeasure parts will be required.
- **Field fix**
 - HMC should develop improved parts, and purge old stock of the 93810-3K000 Stop Lamp Switch.
- **TSB**

- HMC should develop a TSB to advise dealers regarding diagnosis and countermeasure parts along with proper old and part identification.

- **C/M Part:**

- An effective countermeasure should be developed for field/port repairs.

- **Other comment**

- N/A.

Attachments:

Date:

Report Number : QAEN-C-081001



[B] ESC Light Illuminated; Stop Lamp Switch (Countermeasure not effective) - HMC.doc

QAEPC-060842

Attachment

QUALITY INFORMATION REPORT

CONFIDENTIAL

Model Code	Subject Code*		HMA Report Number	
EP	CHASSIS			
Creation date/time/user:	Analyst:*	Co-analyst(s):	Modified date/time/user:	
	CASEY SHAH			
Distributor*	Country*	Date	HMC Report Number	Attachments
HMA	USA	8/10/2006		<input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model*	Engine or Transmission Number*		Production Date*	
ENTOURAGE	G6DA6S125491		3/23/2006	
Vehicle Identification Number*	Mileage*	Delivery Date*		
KNDMC233076 [REDACTED]	320	6/19/2006		
Subject*				
[B] STOP LAMP SWITCH WARRANTY (EARLY WARNING)				

1. Condition:

.The customer complained that both the ABS and ESC indicator lights are ON. Additional vehicle with same condition.


VIN
KNDMC233376 [REDACTED]

P/DATE
3/23/2006

MILEAGE
812

2. Analysis:

- The dealer technician confirmed the customer complain.
- Both ABS and ESP indicator lights were ON
- Hi-Scan retrieved P0571 (Cruise/Brake switch circuit malfunction) and C1513 (Brake Switch Error) DTC codes.
- The dealer technician replaced the stop lamp switch, P/N:93810-3K000, that corrected the condition.
- Both incident stop lamp switches were sent to HMA for analysis.
- The photo below shows the incident switch and the continuity check results.
- Accordingly, the stop lamp switch was determined to be OK (static condition).

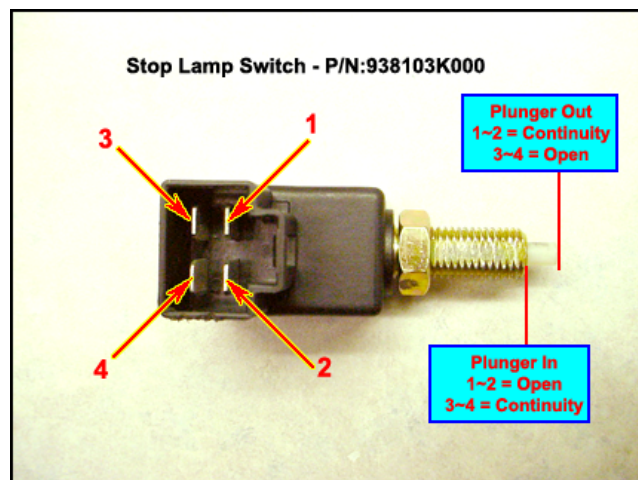

- The second incident vehicle switch was also checked out OK.
- The TABLE below shows all replaced stop lamp warranty.

VIN Number	Prod Date	Mileage	Total Cost
KNDMC233376[REDACTED]	2006-03-23	812.	\$38.30
KNDMC233076[REDACTED]	2006-03-23	320.	\$34.70
KNDMC233476[REDACTED]	2006-03-23	9.	\$35.30
KNDMC233576[REDACTED]	2006-03-08	1,857.	\$40.70
KNDMC233X76[REDACTED]	2006-04-06	2,251.	\$107.30
			\$256.30

- Since both incident stop lamp switches checked out OK, and since both incident vehicles were produced on the same day (2006-03-23), HMA suspects that both of these (and possibly others also) incidents were caused by the assembly line workers not adjusting the stop lamp switch correctly.
- If the switches are not properly adjusted, they may set P0504, P0571 and C1513 DTC codes.
- In service, the technicians generally would replace the switch first and then adjust it correctly just to avoid a customer comeback.
- Therefore, it is very important that HMC adjust all stop lamp switches correctly on the assembly line.

Additional Information:

- Since this part number is common to many models, and since the incident parts checked out OK per HMC's procedure, it is strongly believed that the switch adjustment is the issue here.

3. Action:

Replace the stop lamp switch, P/N:93810-3K000.

4. Comment/Recommendation:

- HMC should check both incident parts to determine the root cause of these incidents and apply corrections as necessary.

5. Attachments:

```

_WPR008C QPADEV007S      Hyundai Motor America      8/10/2006
_CSHAH                    Claim Inquiry                15:23:17
_Inquiry

Dealer Code : FL094 BOB DANCE HYUNDAI OF LONGWOOD    Pay Percent: 100.00
Claim No    : 71165A R/O No: 071165 Version: 00      Sublet $ : .00
R/O Date Open: 6/29/2006 Close: 6/29/2006           Sublet Type:
Claim Status : A Approve Labor Rate: 78.00 Labor $ : 23.40
Claim Type   : W New Veh. LTD Warranty               Parts $ : 11.30
PWA Type     :                                       Freight $ : .00
Rental Days  : 0 Rental AMT: .00 Towing $ : .00
Trans Type   : Automatic Total $ : 34.70
VIN Number   : KNDMC233076[REDACTED] Entourage (EP) 2007 Month In Service: .3
Sell Dealer  : FL094 BOB DANCE HYUNDAI OF LONGWOOD Mileage : 320
Org Owner    : [REDACTED]
HPP Contract : [REDACTED] HPP: HCP:
Nature: N94 INOPERATIVE Cause: C15 POOR CONTACT & SHORT
Condition :
Causal Part  : 938103K000 Grp: 16 Main OP: 93810R00 Hour: .3 Qty: 1
                SWITCH ASSY-STOP LAMP(4P) STOP LAMP SWITCH ASS'Y

```

QAEF-C-060842

HYUNDAI**QUALITY INFORMATION
REPORT****CONFIDENTIAL**

Model Code EP	Subject Code* CHASSIS	Severity Code	HMA Report Number QAEP-C-060842	
Creation date/time/user: 08/10/2006 04:58:32 by Casey Shah		Analyst:* Casey Shah	Co-analyst(s):	Modified date/time/user: by
Distributor* HMA	Country* USA	Vendor Info	Causal part No	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model* ENTOURAGE	Engine or Transmission #* G6DA6S125491	Lot #	Production Date* (MM/DD/YY) 03-23-2006	
VIN* KNDMC233076 [REDACTED]	Mileage* 320	Repair Date (MM/DD/YY)	Delivery Date* (MM/DD/YY) 06-19-2006	
Subject* [B] STOP LAMP SWITCH WARRANTY (EARLY WARNING)				

Types of QIR					
<input type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date: 08/10/2006

Report Number :

The customer complained that both the ABS and ESC indicator lights are ON. Additional vehicle with same condition.

VIN	P/DATE	MILEAGE
KNDMC233376 [REDACTED]	3/23/2006	812

Analysis:

Date: 08/10/2006

Report Number :

- The dealer technician confirmed the customer complain.
 - Both ABS and ESP indicator lights were ON
 - Hi-Scan retrieved P0571 (Cruise/Brake switch circuit malfunction) and C1513 (Brake Switch Error) DTC codes.
 - The dealer technician replaced the stop lamp switch, P/N:93810-3K000, that corrected the condition.
 - Both incident stop lamp switches were sent to HMA for analysis.
 - The photo below shows the incident switch and the continuity check results.
 - Accordingly, the stop lamp switch was determined to be OK (static condition).
- □□□□□□□□ Since both incident stop lamp switches checked out OK, and since both incident vehicles were produced on the same day (2006-03-23), HMA suspects that both of these (and possibly others also) incidents were caused by the assembly line workers not adjusting the stop lamp switch correctly.
 - If the switches are not properly adjusted, they may set P0504, P0571 and C1513 DTC codes.
 - □□□□□□□□ In service, the technicians generally would replace the switch first and then adjust it correctly just to avoid a customer comeback.
 - □□□□□□□□ Therefore, it is very important that HMC adjust all stop lamp switches correctly on the assembly line.

Additional Information:

- Since this part number is common to many models, and since the incident parts checked out OK per HMC's procedure, it is strongly believed that the switch adjustment is the issue here.

Corrective Action:

Date: 08/10/2006

Report Number :

Replace the stop lamp switch, P/N:93810-3K000.

Comments and Recommendations:

Date: 08/10/2006

Report Number :

- HMC should check both incident parts to determine the root cause of these incidents and apply corrections as necessary.

Attachments:

Date: 08/10/2006

Report Number :



QIR 42 Stop Lamp Switch.doc

QAHD-L-080702

Attachment

QUALITY INFORMATION REPORT

CONFIDENTIAL

Model Code	Subject Code*	Severity	HMA Report Number	
HD	Electrical	7		
Creation Date / Time	Analyst*	Co-Analyst	Modified Date / Time	
07/24/2008	Eric Buxton			
Distributor*	Country*	Vendor Information	Causal Part Number*	Attachments
HMA	USA	"INFAC"	938103K000	<input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input type="checkbox"/> Movie
Model*	Engine Number*	Lot #	Production Date*	
Elantra	G4GC7049430		10/09/2007	
VIN*	Mileage*	Repair Date	Delivery Date*	
KMH DU46DX8U [REDACTED]	588	04/09/2008	3/29/2008	
Subject*				
[B] Stop Lamp Switch (Countermeasure not effective)				
QIR TYPE				
<input checked="" type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring
		<input type="checkbox"/> VDS		

1. Condition:

- **Customer statement:** CUSTOMER STATED THE ESC OFF LIGHT TURNS IT'S SELF ON AND OFF
- **Technician statement:** FOUND ESC LIGHT ON, SCANNED FOR CODES, FOUND B1513- BRAKE LAMP SWITCH AT PEDAL. TESTED SWITCH, REPLACED SWITCH,

No.*	VIN	Mileage	Production Date	Customer Statement	Technician Comment	Cause Comment	Technician Comment
1	KMH DU46D98U [REDACTED]	354	5/16/08	CUSTOMER STATES ESP LIGHT STAYS ON-	SCANNED AND FOUND CODE C1513 FOR BRAKE LIGHT SWITCH SHORT OR OPEN-PERFORMED DIAG AND		REPLACED BRAKE LIGHT SWITCH-CHECKED OUT OK
2	KMH DU46D68U [REDACTED]	1394	4/23/08	COMPLAINT ESC LIGHT IS ON	1394 93810R00 + PLUS SCAN TOOL TIME	CAUSE THE INTERNAL OPEN ON THE BRAKE SWITCH IS CAUSING CODE C1513 BRAKE SWITCH CIRCUIT.	CORRECTION REMOVED AND REPLACED WITH NEW SWITCH AND CLEARED CODES
3	KMH DU46D78U [REDACTED]	356	3/13/08	CUST STATES WON'T COME OUT OF GEAR		WONT COME OUT OF PARK SWITCH SHORTED REPLACED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
4	KMH DU46D08U [REDACTED]	3204	1/14/08	CUSTOMER STATES THAT ESC LIGHT IS ON	PULLED VEHICLE IN SHOP AND PULLED CODE C1513 BRAKE LAMP SWITCH 93810R00-N69-C15 30 FOUND CODE C1513 BRAKE LAMP SWITCH.		TRIED TO ADJUST BUT DID NOT HELP. REPLACED THE SWITCH WITH A NEW ONE. I CLEARED THE CODE AND
5	KMH DU46DX8U [REDACTED]	6418	1/14/08		ESC LIGHT ON/CODE C1513 BRAKE LAMP SWITCH SHORTED OUT/REPLACED SWITCH		

6	KMH DU46D6 8U [REDACTED]	5054	1/07/08	CUSTOMER STATES CAR WILL NOT SHIFT FROM NUTRAL BACK TO REVERSE OR PARK	OPEN CIRCUIT BRAKE LIGHT SWITCH WOULD NOT RELEASE SHIFT ASSY	PERFORMED SYSTEM CHECK FOUND AND REPLACED INOP BRAKE SWITCH ASSY	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE OPEN CIRCUIT
7	KMH DU46D9 8U [REDACTED]	2801	1/05/08		DIAGNOSE INOPRITIVE BRAKE LAMP SWITCH. REPLACED THE SWITCH		
8	KMH DU46D2 8U [REDACTED]	3100	1/04/08	CUSTOMER STATES THE ESC LIGHT IS ON	3102 FOUND C1513 BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH, NO MORE CODES.	FOUND C1513 BRAKE LIGHT SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 3102 FOUND C1513 BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH, NO MORE CODES.
9	KMH DU46D6 8U [REDACTED]	1155	12/17/07	CUSTOMER STATES LT BLICKER WILL STAY ON & THEN WHEN BRAKING REVERSE WOULD LIGHT UP	CUST STATES LT BLICKER STAYS ON, CODE P0703 STOP SWITCH, REPL SWITCH	CODE P0703 STOP LAMP SWITCH MALFUNCTION	REPLACED STOP LAMP SWITCH
10	KMH DU46D0 8U [REDACTED]	1181	12/15/07		SHIFTER WILL NOT GO INTO PARK. TESTED, REMOVED AND INSTALLED NEW BRAKE SWITCH, ROAD TEST		
11	KMH DU46D7 8U [REDACTED]	1503	12/15/07	CUSTOMER STATES SHIFTER WILL NOT GO INTO REV OR PARK	PERFORM SYSTEMS TEST AND FOUND SHIFTER WOULD NOT GO INTO REV-PARK DUE TO SHORT IN BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH TO CORRECT CONDITION	FAILED SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
12	KMH DU46D4 8U [REDACTED]	5810	12/14/07		5810 BRAKE LAMP SWITCH SHORT REPLACED BRAKE LAMP SWITCH		
13	KMH DU46D0 8U [REDACTED]	65	12/11/07	VEHICLE WILL NOT GO OUT OF FIRST GEAR	FOUND THE BRAKE LAMP SWITCH TO BE STICKING CAUSING THE VEHICLE TO NOT SEE THE VEHICLES BRAKE DEPRESSED, NOT ALLOWING THE VEHICLE TO GO OUT OF PARK, Y	REPLACED THE BRAKE LAMP SWITCH AND TESTED TO VERIFY REPAIR FOUND THE VEHICLE SHIFTING OUT OF GEAR PROPERL	CHECKED AND FOUND THE BRAKE LAMP SWITCH TO BE STICKING CAUSING THE VEHICLE TO NOT SEETHE VEHICLES BRAKE DEPRESSED, NOT ALLOWINGTHE VEHICLE TO GO OUT OF PARK, REP
14	KMH DU46DX 8U [REDACTED]	3038	11/29/07		ESC LIGHT ON. USED SCANNER AND PULLED CODE C1513 BRAKE LAMP SWITCH.		CKD SWITCH ADJUSTMENT. REPLACED AND ADJUSTMENT SWITCH. CLEARED CODE
15	KMH DU46D4 8U [REDACTED]	558	11/22/07	BRAKE LIGHTS ARE INOP	. SWITCH DEFECTIVE. REPLACED BRAKE SWITCH		


- **Customer driving habit / operation condition:** not specified
- **Road condition:** not specified
- **Weather condition:** not specified
- **Vehicle speed:** not specified
- **Number of passengers:** not specified
- **Region:** not specified
- **Other comments:** not specified



2. Analysis:

- **Number of cases (specific to QIR):** 33
- **Concern rate (number of cases/overall warranty)** 3.9% (33/843)


Customer complaints	Warranty	CA	Tech Line	FPOR	EQF	Others
33	843	0	6	1	n/a	n/a

- **Warranty analysis**

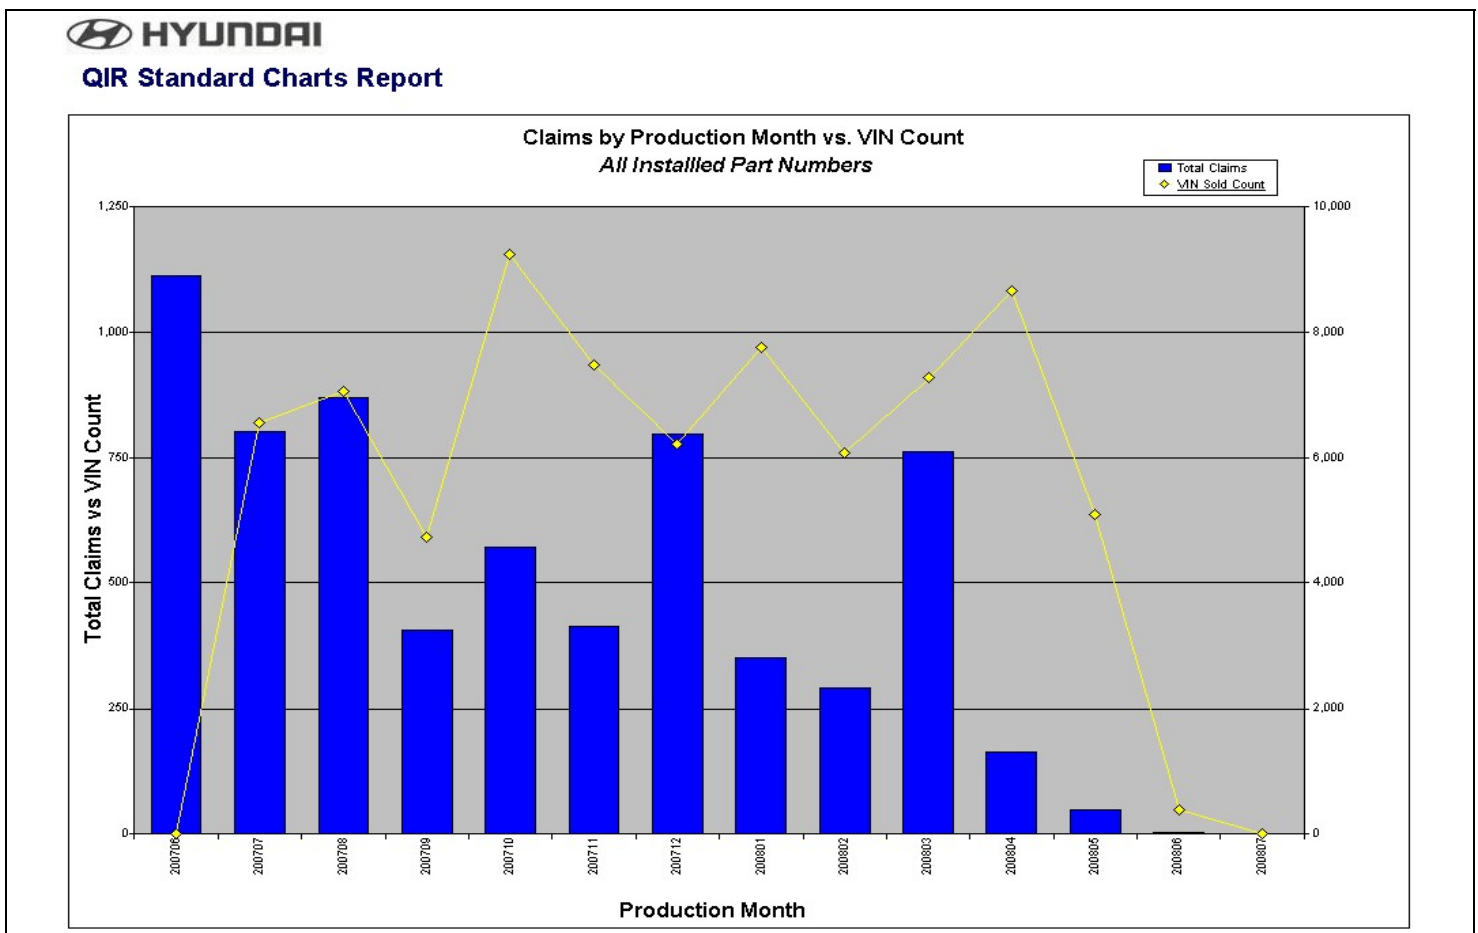


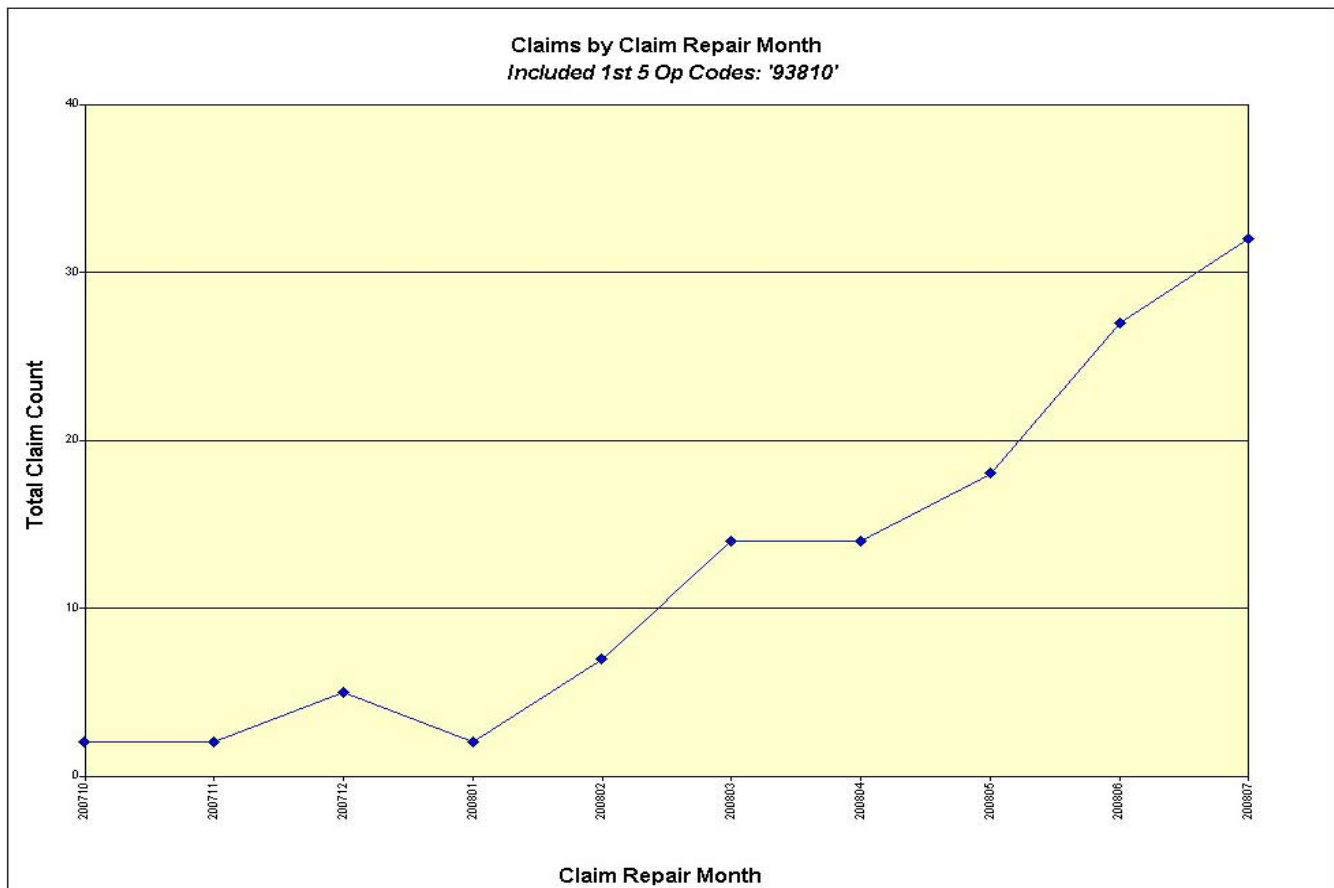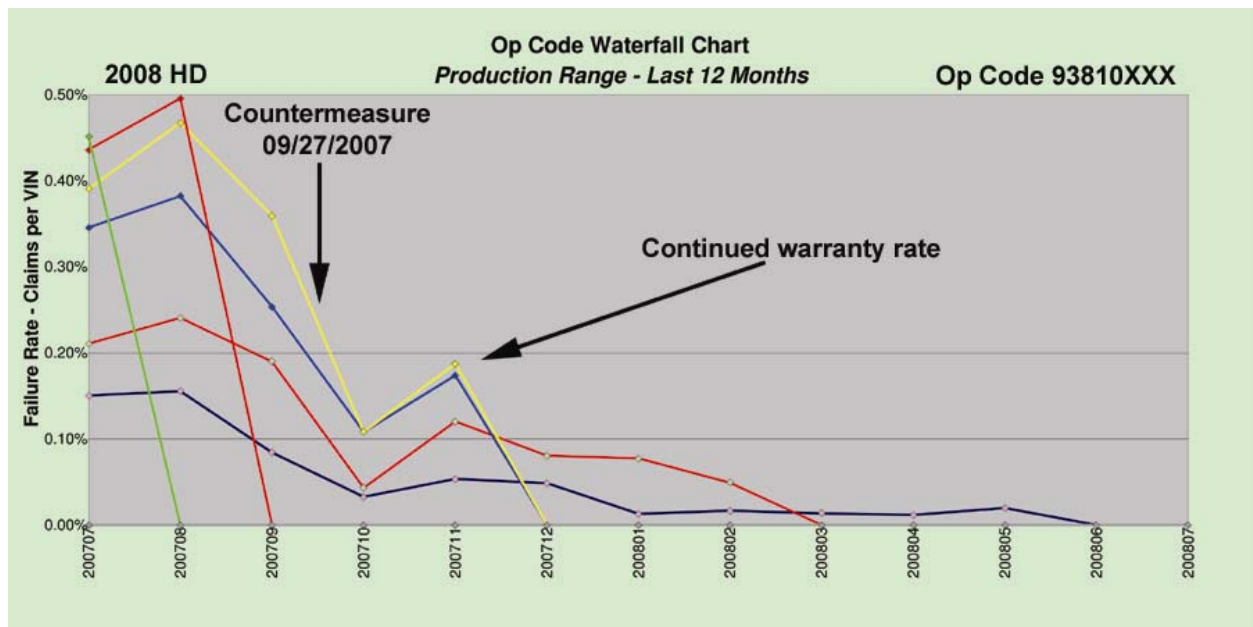


Claims by Months In Service
Included 1st 5 Op Codes: '93810'

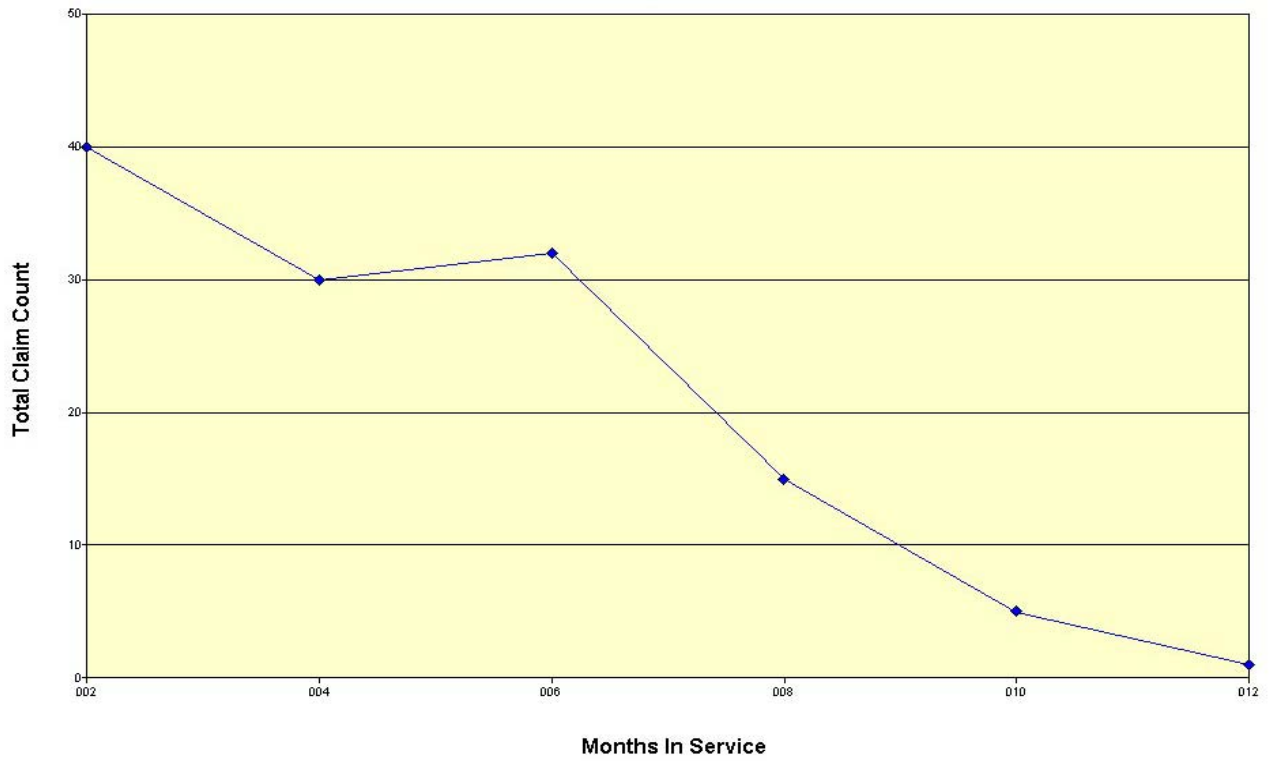


Defects by Mileage Range
Included 1st 5 Op Codes: '93810'

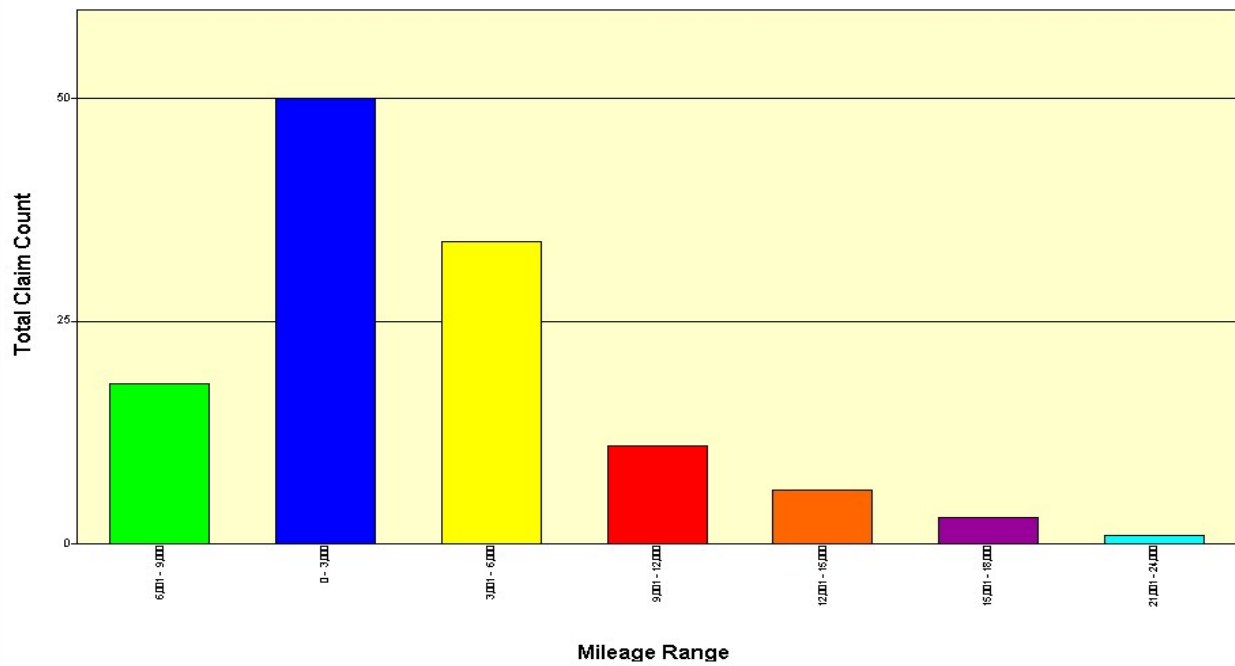

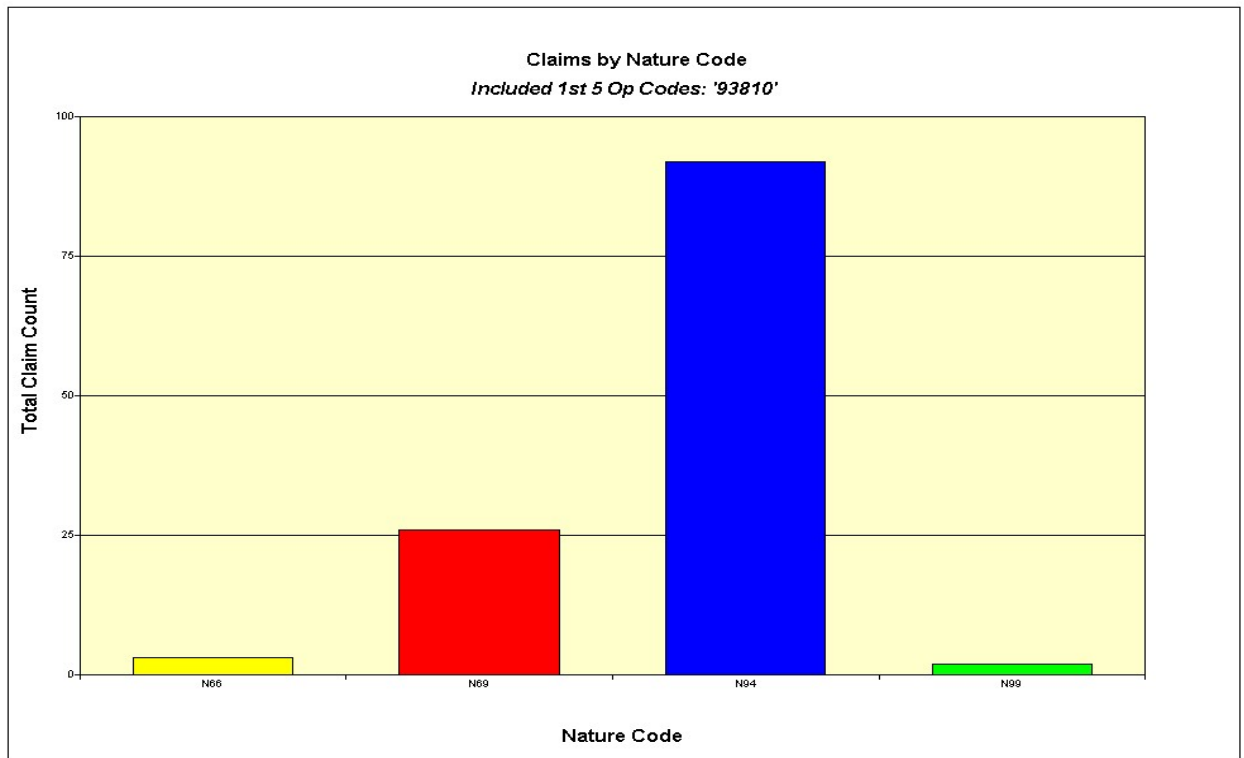

N94 - INOPERATIVE	N69 - WARNING LIGHT ON	N66 - ELECTRICAL MALFUNCTION	N99 - OTHERS
92 / 75%	26 / 21%	3 / 2%	2 / 2%

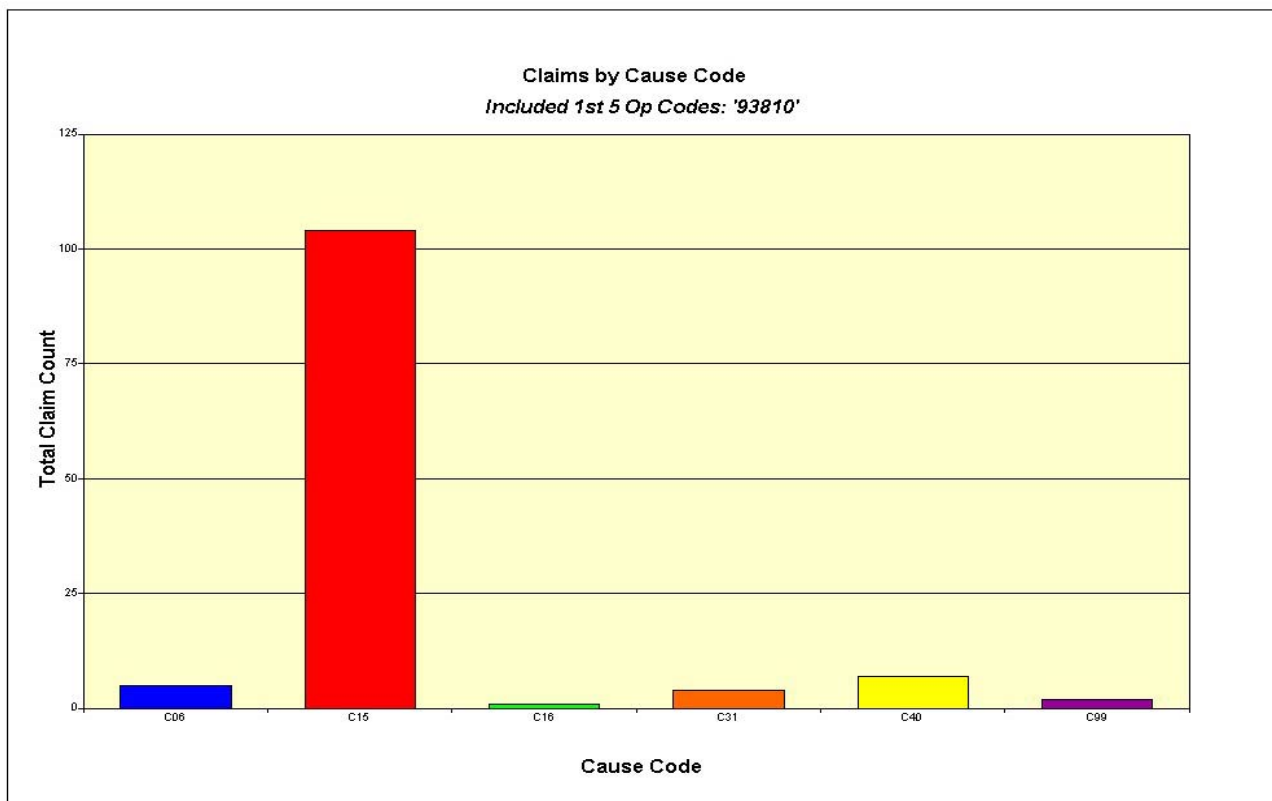

Summary

Production Date : All Claim Paid Date : All Claim Repair Date : All	Region : All	Months In Service : All Mileage Range : All
Model Year : 2008 Model Code : HD Warranty Claim Type : All Transmission Type : All Engine Code : All Emissions Flag : All	DMRS Group Code : All Tread Act Group Code : All Cause Code : All Nature Code : All Plant Code : All Port Claim : X	Body Style : All Trim Level : All Exterior Color : All Interior Color : All
Included Op Code : All 1st 5 Op Code : '93810' Causal Part No : All 1st 5 Causal Part No : All Installed Part No : All 1st 5 Installed Part No : All	Excluded Op Code : All 1st 5 Op Code : All Causal Part No : All 1st 5 Causal Part No : All Installed Part No : All 1st 5 Installed Part No : All	Range Op Code : All 1st 5 Op Code : All Causal Part No : All 1st 5 Causal Part No : All Installed Part No : All 1st 5 Installed Part No : All
Business Processing Date : 07-23-2008 Run Date : 07/24/08 12:00 PM		

Incident part/vehicle analysis

The Stop Lamp Switch (brake switch) is part number 93810-3K000.

The date code on the incident part is "7J04", well after the countermeasure date code of "7114" indicated for the same part number in the EN QIR QAEN-C-070513. HMC indicated the stop lamp was improved on 09/27/07:
"Improved plunger diameter tolerances"




The stop lamp circuit through the switch has redundant contacts. When the incident stop lamp switch was evaluated at HMA, the resistance measured through the switch was good:

- Open circuit when the plunger was depressed
- Closed circuit when the plunger was released

Upon inspection of the switch contacts, HMA noted that one of the contacts was discolored.

The discoloration may be an indication of contamination that could lead to intermittent operation.

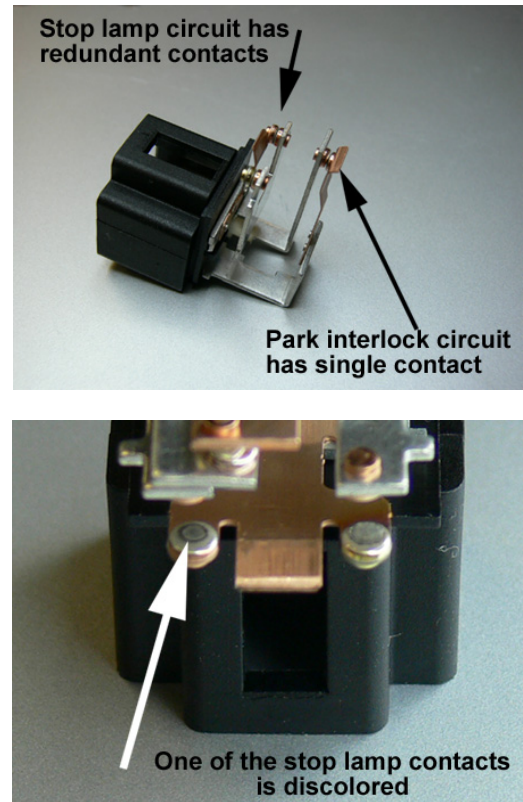

The continued warranty claims after the countermeasure indicates the countermeasure was not fully effective. The continued rate is under 0.2% for November production, but it is continuing to increase as the vehicles age.

3. Action:

- **Dealer fix**
Dealers replace the stop lamp switch as necessary
- **Repair procedure**
Remove and replace as per the shop manual

4. Comment/Recommendation:

- **Production C/M**
HMC needs to work with the vendor, "INFAC", to develop a trouble free stop lamp switch that will not set codes for the ESC or prevent the shift interlock from operating.

HMA will return the incident part to HMC. HMA will continue to collect incident switches and will send them when available.

- **Port action**
No port action required
- **Field fix**
HMC should ensure the improved part is applicable to all vehicles currently using the p/n 93810-3K000 switch
- **TSB**
No TSB required.
- **C/M Part:**
HMA would like 5 sample countermeasure parts after the countermeasure is developed

QAHD-L-080702

HYUNDAI

QUALITY INFORMATION
REPORT

CONFIDENTIAL

Model Code HD	Subject Code* ELECTRICAL	Severity Code 7	HMA Report Number QAHD-L-080702	
Creation date/time/user: 07/25/2008 03:14:22 PM by Eric Buxton		Analyst:* Eric Buxton	Co-analyst(s):	Modified date/time/user: 07/25/2008 03:14:22 PM by
Distributor* HMA	Country* USA	Vendor Info "INFAC"	Causal part No 93810-3K000	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input type="checkbox"/> Other
Model* HD ELANTRA	Engine or Transmission #* G4GC7049430	Lot #	Production Date* (MM/DD/YY) 10/09/2007	
VIN* KMHDU46DX8U [REDACTED]	Mileage* 588	Repair Date (MM/DD/YY) 04/09/2008	Delivery Date* (MM/DD/YY) 3/29/2008	
Subject* [B] Stop Lamp Switch (Countermeasure not effective)				

Types of QIR					
<input checked="" type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date:

Report Number : QAHD-L-080702

- **Customer statement:** CUSTOMER STATED THE ESC OFF LIGHT TURNS IT'S SELF ON AND OFF
- **Technician statement:** FOUND ESC LIGHT ON, SCANNED FOR CODES, FOUND B1513-BRAKE LAMP SWITCH AT PEDAL. TESTED SWITCH, REPLACED SWITCH,
-

No.*	VIN	Mileage	Production Date	Customer Statement	Technician Comment	Cause Comment	Technician Comment
1	KMHDU46D98U [REDACTED]	354	5/16/08	CUSTOMER STATES ESP LIGHT STAYS ON-	SCANNED AND FOUND CODE C1513 FOR BRAKE LIGHT SWITCH SHORT OR OPEN-PERFORMED DIAG AND		REPLACED BRAKE LIGHT SWITCH-CHECKED OUT OK
2	KMHDU46D68U [REDACTED]	1394	4/23/08	COMPLAINT ESC LIGHT IS ON	1394 93810R00 + PLUS SCAN TOOL TIME	CAUSE THE INTERNAL OPEN ON THE BRAKE SWITCH IS CAUSING CODE C1513 BRAKE SWITCH CIRCUIT.	CORRECTION REMOVED AND REPLACED WITH NEW SWITCH AND CLEARED CODE
3	KMHDU46D78U [REDACTED]	356	3/13/08	CUST STATES WON'T COME OUT OF GEAR		WONT COME OUT OF PARK SWITCH SHORTED REPLACED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP
4	KMHDU46D08U [REDACTED]	3204	1/14/08	CUSTOMER STATES THAT ESC LIGHT IS ON	PULLED VEHICLE IN SHOP AND PULLED CODE C1513 BRAKE LAMP SWITCH 93810R00-N69-C15 30 FOUND CODE C1513 BRAKE LAMP SWITCH.		TRIED TO ADJUST BUT DID NOT HELP REPLACED THE SWITCH WITH A NEW ONE. I CLEARED THE CODE AND
5	KMHDU46DX	6418	1/14/08		ESC LIGHT ON/CODE C1513 BRAKE LAMP		

	8U [REDACTED]				SWITCH SHORTED OUT/REPLACED SWITCH		
6	KMH DU46D6 8U [REDACTED]	5054	1/07/08	CUSTOMER STATES CAR WILL NOT SHIFT FROM NEUTRAL BACK TO REVERSE OR PARK	OPEN CIRCUIT BRAKE LIGHT SWITCH WOULD NOT RELEASE SHIFT ASSY	PERFORMED SYSTEM CHECK FOUND AND REPLACED INOP BRAKE SWITCH ASSY	SWITCH ASSY-ST LAMP RE SWITCH ASSY-STOP LAMP OPEN CIRCUIT
7	KMH DU46D9 8U [REDACTED]	2801	1/05/08		DIAGNOSE INOPRITIVE BRAKE LAMP SWITCH. REPLACED THE SWITCH		
8	KMH DU46D2 8U [REDACTED]	3100	1/04/08	CUSTOMER STATES THE ESC LIGHT IS ON	3102 FOUND C1513 BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH, NO MORE CODES.	FOUND C1513 BRAKE LIGHT SWITCH	SWITCH ASSY-ST LAMP RE SWITCH ASSY-STOP LAMP 3102 FOUND C15 BRAKE LIGHT SWITCHREPLAC BRAKE LIGHT SWITCH, NO MO CODES.
9	KMH DU46D6 8U [REDACTED]	1155	12/17/07	CUSTOMER STATES LT BLICKER WILL STAY ON & THEN WHEN BRAKING REVERSE WOULD LIGHT UP	CUST STATES LT BLICKER STAYS ON, CODE P0703 STOP SWITCH, REPL SWITCH	CODE P0703 STOP LAMP SWITCH MALFUNCTION	REPLACED STO LAMP SWITCH
10	KMH DU46D0 8U [REDACTED]	1181	12/15/07		SHIFTER WILL NOT GO INTO PARK. TESTED, REMOVED AND INSTALLED NEW BRAKE SWITCH, ROAD TEST		
11	KMH DU46D7 8U [REDACTED]	1503	12/15/07	CUSTOMER STATES SHIFTER WILL NOT GO INTO REV OR PARK	PERFORM SYSTEMS TEST AND FOUND SHIFTER WOULD NOT GO INTO REV-PARK DUE TO SHORT IN BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH TO CORRECT CONDITION	FAILED SWITCH	SWITCH ASSY-ST LAMP RE SWITCH ASSY-STOP LAMP
12	KMH DU46D4 8U [REDACTED]	5810	12/14/07		5810 BRAKE LAMP SWITCH SHORT REPLACED BRAKE LAMP SWITCH		
13	KMH DU46D0 8U [REDACTED]	65	12/11/07	VEHICLE WILL NOT GO OUT OF FIRST GEAR	FOUND THE BRAKE LAMP SWITCH TO BE STICKING CAUSING THE VEHICLE TO NOT SEE THE VEHICLES BRAKE DEPRESSED, NOT ALLOWING THE VEHICLE TO GO OUT OF PARK, Y	REPLACED THE BRAKE LAMP SWITCH AND TESTED TO VERIFY REPAIR FOUND THE VEHICLE SHIFTING OUT OF GEAR PROPERL	CHECKED AND FOUND THE BRA LAMP SWITCH TO STICKING CAUSI THE VEHICLE T NOT SEETHE VEHICLES BRAK DEPRESSED, NO ALLOWINGTHE VEHICLE TO GO O OF PARK, REF
14	KMH DU46DX 8U [REDACTED]	3038	11/29/07		ESC LIGHT ON. USED SCANNER AND PULLED CODE C1513 BRAKE LAMP SWITCH.		CKD SWITCH ADJUSTMENT REPLACED AND ADJUSTMENT SWITCH. CLEAR CODE
15	KMH DU46D4	558	11/22/07	BRAKE LIGHTS ARE INOP	. SWITCH DEFECTIVE. REPLACED BRAKE		

8U				SWITCH	
----	--	--	--	--------	--

Customer driving habit / operation condition: not specified

- Road condition: not specified
- Weather condition: not specified
- Vehicle speed: not specified
- Number of passengers: not specified
- Region: not specified
- Other comments: not specified

Analysis:


Date:

Report Number : QAHD-L-080702

- Number of cases (specific to QIR): 33
- Concern rate (number of cases/overall warranty) 3.9% (33/843)

Customer complaints	Warranty	CA	Tech Line	FPOR	EQF	Others
33	843	0	6	1	n/a	n/a

- **Warranty analysis**
(See the attached QIR Document for the complete charts)

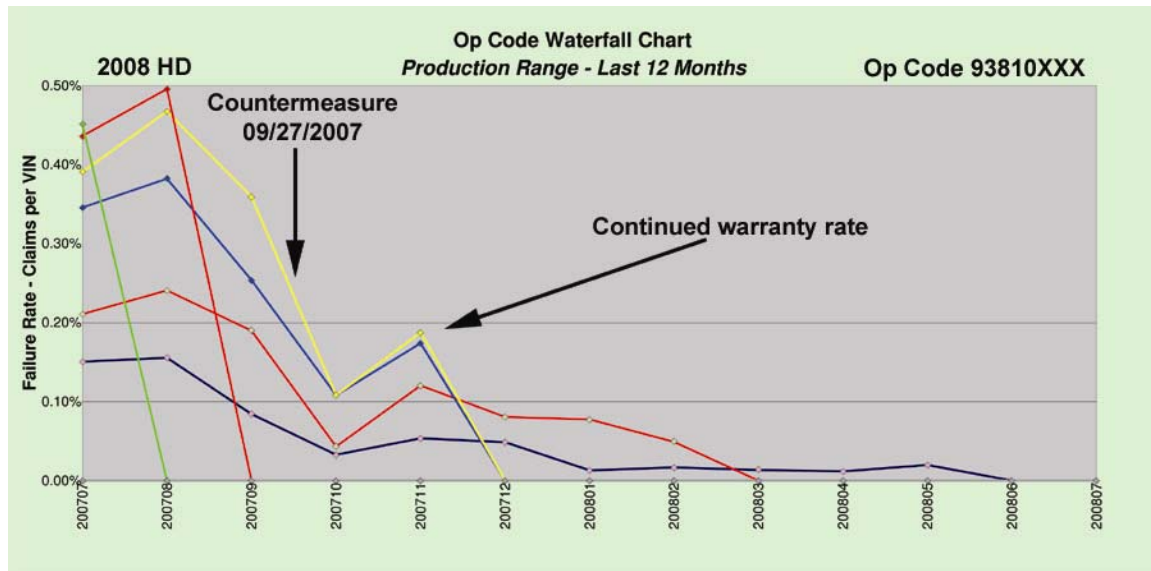

- Incident part/vehicle analysis

The Stop Lamp Switch (brake switch) is part number 93810-3K000.

The date code on the incident part is "7J04", well after the countermeasure date code of "7I14" indicated for the same part number in the EN QIR QAEN-C-070513. HMC indicated the stop lamp was improved on 09/27/07: "Improved plunger diameter tolerances"



The stop lamp circuit through the switch has redundant contacts. When the incident stop lamp switch was evaluated at HMA, the resistance measured through the switch was good:

- Open circuit when the plunger was depressed
- Closed circuit when the plunger was released


Upon inspection of the switch contacts, HMA noted that one of the contacts was discolored.

The discoloration may be an indication of contamination that could lead to intermittent operation.

Stop lamp circuit has redundant contacts



**Part
has**

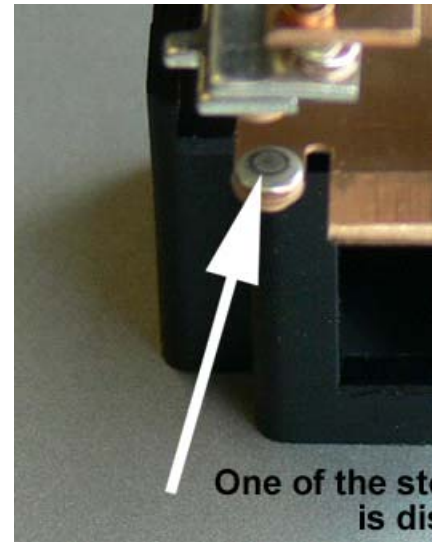

The continued warranty claims after the countermeasure indicates the countermeasure was not fully effective. The continued rate is under 0.2% for November production, but it is continuing to increase as the vehicles age.

Corrective Action:

Date:

Report Number : QAHD-L-080702

- **Dealer fix**
Dealers replace the stop lamp switch as necessary
- **Repair procedure**
Remove and replace as per the shop manual

Comments and Recommendations:

Date:

Report Number : QAHD-L-080702

- **Production C/M**
HMC needs to work with the vendor, "INFAC", to develop a trouble free stop lamp switch that will not set codes for the ESC or prevent the shift interlock from operating.

HMA will return the incident part to HMC. HMA will continue to collect incident switches and will send them when available.
- **Port action**
No port action required
- **Field fix**
HMC should ensure the improved part is applicable to all vehicles currently using the p/n 93810-3K000 switch
- **TSB**
No TSB required.
- **C/M Part:**

HMA would like 5 sample countermeasure parts after the countermeasure is developed

Attachments:

Date:

Report Number : QAHD-L-080702



HD Stop Lamp Switch QIR.doc

QAJM-C-071104

Attachment

Model Code	Subject Code*	Severity Code	HMA Report Number		
JM	CHASSIS	7			
Creation date/time/user:	Analyst:*	Co-analyst(s):	Modified date/time/user:		
11/28/2007	CASEY SHAH	ROLF BRANDT			
Distributor*	Country*	Vendor Info	Causal Part #	Attachments	
HMA	USA	INFAC	93810-3K000		
Model*	Engine or Transmission #*	Lot #	Production Date*	Movie	
TUCSON	G6BA5417865	PA66-GF30	12/05/2005		
VIN*	Mileage*	Repair Date*	Delivery Date*	X Photo	
KM8JN72D86U- [REDACTED]	10,452	10/17/2007	4/19/2006		
Subject*				X Part	
[B] STOP LAMP SWITCH ASSEMBLY – INTERMITTENT MALFUNCTION – DTC C1513					
				X Other	

Types of QIR

<input checked="" type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS
--	--	--------------------------------------	--	-------------------------------------

1. Condition:

- **Customer statement:**
 - Customer complaint "ESC" indicator light ON the dash.
 - Additional typical customer comments:

VIN Number	Prod Date	Mileage	Total Cost	Technician Comment	Customer Complaint	Cause Comment	Technician Correction
KM8JN72D47U	3/15/07	8516	33.36	CUSTOMER STATES LIGHTS FLICKER. SCANNED FOR CODES B1513 SHORT IN BRAKE LIGHT SWITCH. REPLACED SWITCH.	ESC LIGHT COMES ON INTERMITTENTLY. INSTRUMENT FLICKERS.	SCANNED FOR CODES,	B1513 REPLACED BRAKE LIGHT SWITCH.
KM8JN72D37U	2/01/07	53	36.66		CUSTOMER STATES - DASH E.S.C. LIGHT IS ON. INSPECT & ADVISE.	TECH VERIFIED DASH E.S.C. LIGHT IS ON. SET VEHICLE ON DIAGNOSTIC SCANNER, FOUND CODE C1513 BRAKE SWITCH ERROR. PERFORMED INSPECTION, FOUND BRAKE SWITCH HAS AN INTERNAL OPEN CIRCUIT.	REMOVED AND REPLACED BRAKE SWITCH. CLEARED CODES. SWITCH TESTED OKAY. CODE DID NOT RETURN.
KM8JM12B97U	1/20/07	2456	32.14	ESC LIGHT COMES ON WHILE DRIVING. REPLACED STOP LAMP SWITCH TO FIX CONCERN.	CUSTOMER COMPLAINS THAT ESC LIGHT COMES ON WHILE DRIVING.	BRAKE STOP LIGHT SWITCH	INSPECT TEST AND REPLACE 93810R00 .3 // N94 // C15
KM8JM12B57U	1/19/07	1597	33.04		CUSTOMER STATES ESC OFF LIGHT STAYS ON.	CODE C1513 PRESENT	REPLACED STOP LAMP SWITCH
KM8JN12D17U	11/22/06	644	38.16		CUST STATES ESC LIGHT IS ON	PERFORMED SCAN TOOL TEST AND FOUND CODE C1513 BRAKE SWITCH OPEN	REPLACED BRAKE SWITCH AND CLEARED CODE. TESTED OK AT THIS TIME.
KM8JN72D27U	11/17/06	4998	33.09		CUSTOMER STATES THE ESC LIGHT INTERMITTENTLY KEEPS COMING ON	INOPERATIVE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D77U	11/14/06	1583	55.54	1583 SCAN VEH FOUND CODE C1513 BRAKE SWITCH CIRCUIT MAL. TESTED SWITCH INTERNAL. SHORT. REPLACE OK AT T THIS TIME.	C/S THAT THE ECS LIGHT STAYS ON	ESC LIGHT STAYS ON	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 1583 SCAN VEH FOUND CODE C1513 BRAKE SWITCH CIRCUIT MAL. TESTED SWITCH INTERNAL. SHORT. REPLACE OK AT T THIS TIME.
KM8JM12BX7U	11/13/06	809	54.66	ADDL TIME FOR SCAN TOOL	CUST STATES INTERMITTENTLY ESC OFF LIGHT WILL COME ON AND NOT GO OFF UNTIL IGNITION SHUT OFF	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D57U	11/10/06	7938	55.86	VEH. CAME IN ESC LIGHT DISPLAYED, SCANNED VEH. FOUND CODE C1513, FAULTY BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH, CLEARED CODE, RETESTED OKAY.	CUSTOMER STATES ESC LIGHT CAME ON TODAY BUT GOES AWAY ONCE SHE RESTARTS THE VEHICLE	SCAN TOOL CODE C1513 FAULTY BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH AND TEST DROVE VEHICLE FOR NORMAL OPERATION
KM8JN12D97U	11/10/06	3	29.4	SCAN ELECTRONIC STABILITY CONTROL SYSTEM WITH G.D.S. - C1237 PRIMARY PRESSURE SIGNAL / C1513 B BRAKE SWITCH CIRCUIT - CAUSED BY FAULTY STOP LAMP SWITCH - CLEAR CODES/ VERIFIED PROPER OPERATION	UPON INSPECTION FOUND ESC OFF LAMP ALWAYS ON PLEASE CK AND ADVISE	CAUSED BY FAULTY STOP LAMP SWITCH	ADD SCAN TOOL INSPECTION E.S.C.E.C.T. SWITCH ADD SCAN TOOL OPERATION SCAN ELECTRONIC STABILITY CONTROL SYSTEM WITH G.D.S. - C1237 PRIMARY PRESSURE SIGNAL / C1513 B BRAKE SWITCH CIRCUIT - CAUSED BY FAULTY STOP LAMP SWITCH - CLEAR CODES/ VERIFIED PROPER OPERATION

- **Technician statement:**
 - Technician verified the condition and retrieved the DTC C1513 (Brake Switch Error) code.
- **Customer driving habit / operation condition:**
 - Stop and go with extended period of stopping with brakes applied.
- **Road condition:**
 - City roads
- **Weather condition:**
 - Humid
- **Vehicle speed:**
 - Low speeds under 20 mph
- **Number of passengers:**
 - One
- **Region:**
 - Western
- **Other comments:**
 - None

2. Analysis:

- The incident vehicle had three previous repairs as shown below.

WPC008 M00021791		Hyundai Motor America		11/29/2007						
CSHAH		Claim Inquiry Bu Vin,R/O,Claim		08:15:54						
VIN : KM8JN72D86U		Tucson (JM) V-6		2006 Total Claims: 10						
Dealer: _____		Claim No: _____		R/O No: _____						


A Delr	Claim#	R/O No	VR	C/T	R/O Date	Mileage	OP Code	Paid Date	Sts	
-----						-----				
-	OR024	29677A	029677	00	G	10/17/2007	10,452	93810A2Z	10/18/2007	A
-	OR024	29430A	029430	01	W	10/02/2007	10,452	93810R00	10/18/2007	A
-	OR024	28495A	028495	00	R	8/08/2007	8,843	618046R0	8/17/2007	A
-	OR024	24718B	024718	01	W	1/05/2007	4,999	93810R00	10/18/2007	A
-	OR024	23378A	023378	00	W	10/13/2006	3,473	59150R00	10/13/2006	A
-	OR024	22972A	022972	00	W	9/18/2006	3,197	93810R00	9/18/2006	A
-	OR024	22827A	022827	00	W	9/08/2006	2,976	89831R0B	9/08/2006	A
-	OR024	22827B	022827	00	W	9/08/2006	2,976	95440RP0	9/08/2006	A
-	OR024	19050A	019050	00	I	1/20/2006	5	PREDELIV	2/17/2006	A
-	OR024	19050B	019050	00	W	1/20/2006	5	81641R00	2/27/2006	A

- At the 4th repair, FSE (Field Service Engineer) got involved to determine the cause of the multiple repairs.
- The incident switch was cut open to monitor the dynamics of the DTC C1513 setting as shown.



- The diagram below provides the following information:
- The picture to the right is a page from the electrical troubleshooting manual (ETM) that shows brake light switch inputs to the electronic stability control (ESC) control unit.
- The switch between terminals 2 and 4 is the brake light switch that closes when the brakes are applied. Output 12V.
- The switch between terminals 3 and 4 is the brake switch that opens when the brakes are applied. Output 0 V.


- If the ESC control module sees both brake switch and brake light switch in the same state for >500ms and the brake pressure is >20 bar DTC C1513 is set.

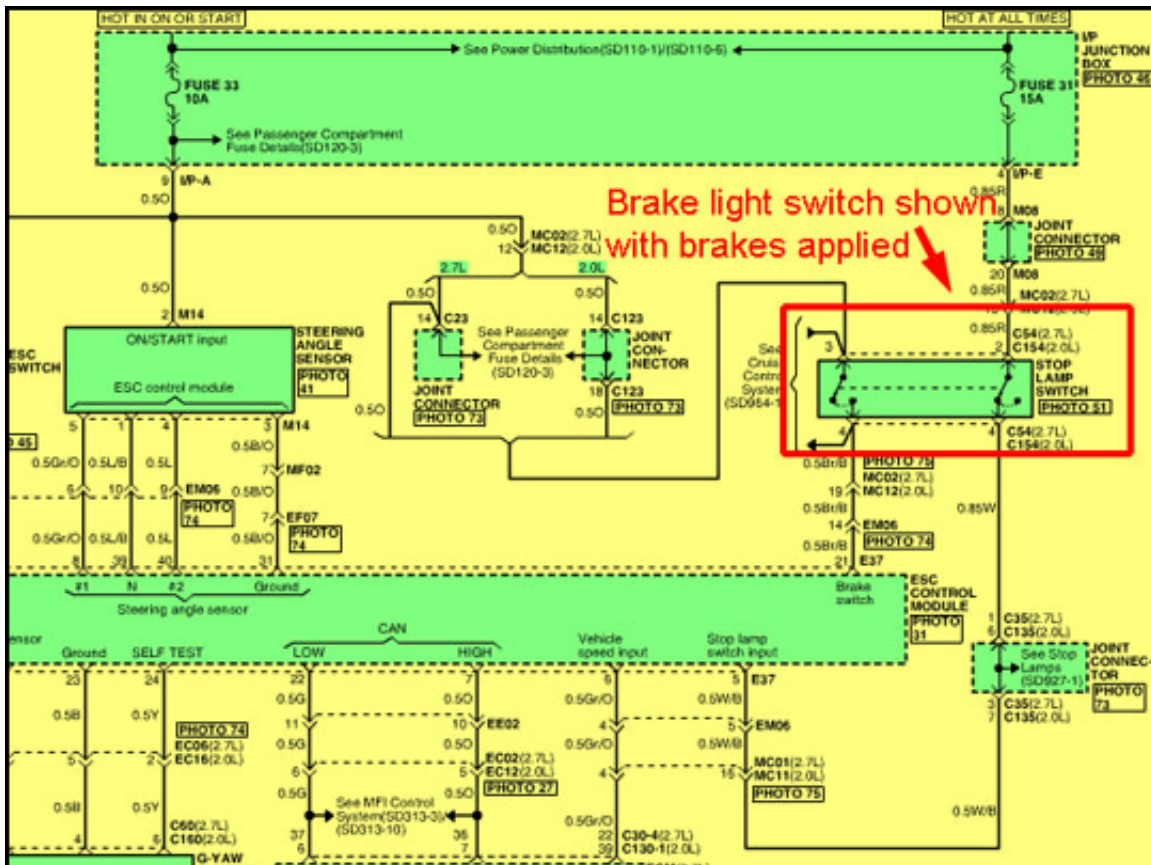



- The brake pressure and brake switch voltage was monitored that set the DTC C1513 as shown.
- The picture below shows the event that set the DTC C1513. The brake light switch is on, the brake switch is on and the brake pressure is >20 bar.
- The brake lights were ON during the event.







- The picture below shows the internal components of the brake light switch.
- After extended operation, the "Brake Switch" contacts closed with brake pressure present and the brake lights on, causing the DTC C1513 to set.

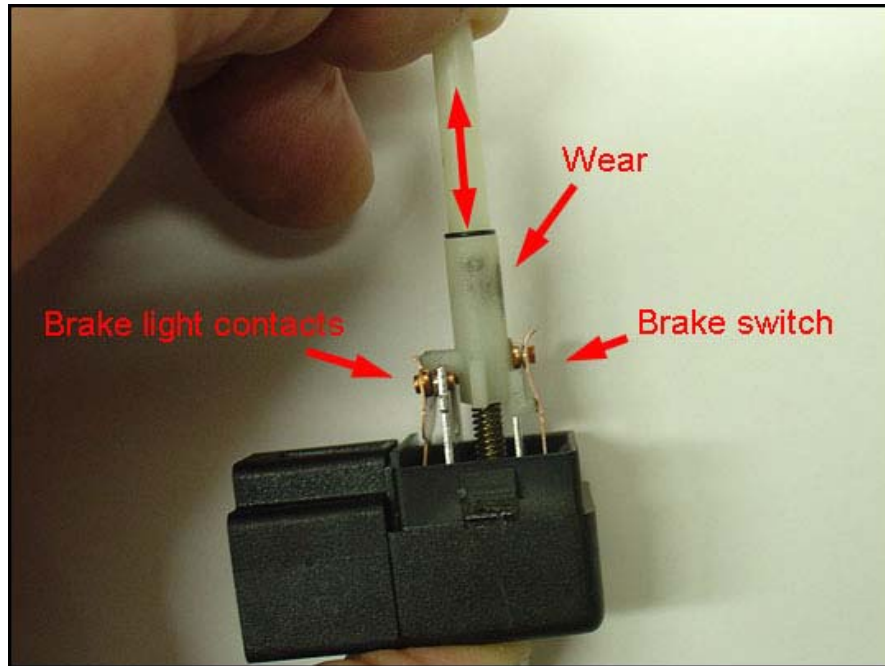

- From this exercise, the following was realized:
 - That the DTC C1513 can occur if one of the following conditions can occur:
 - Brake switch contacts get hot and loose the continuity
 - Brake contacts burn out
 - Plunger hang-up in the cylinder
 - Switch not adjusted correctly
 - Grease in the switch may contaminate the contacts
 - One of the connectors in the harness loses contact
 - Brake pressure switch acts erratically
- The part warranty data provides the following information:

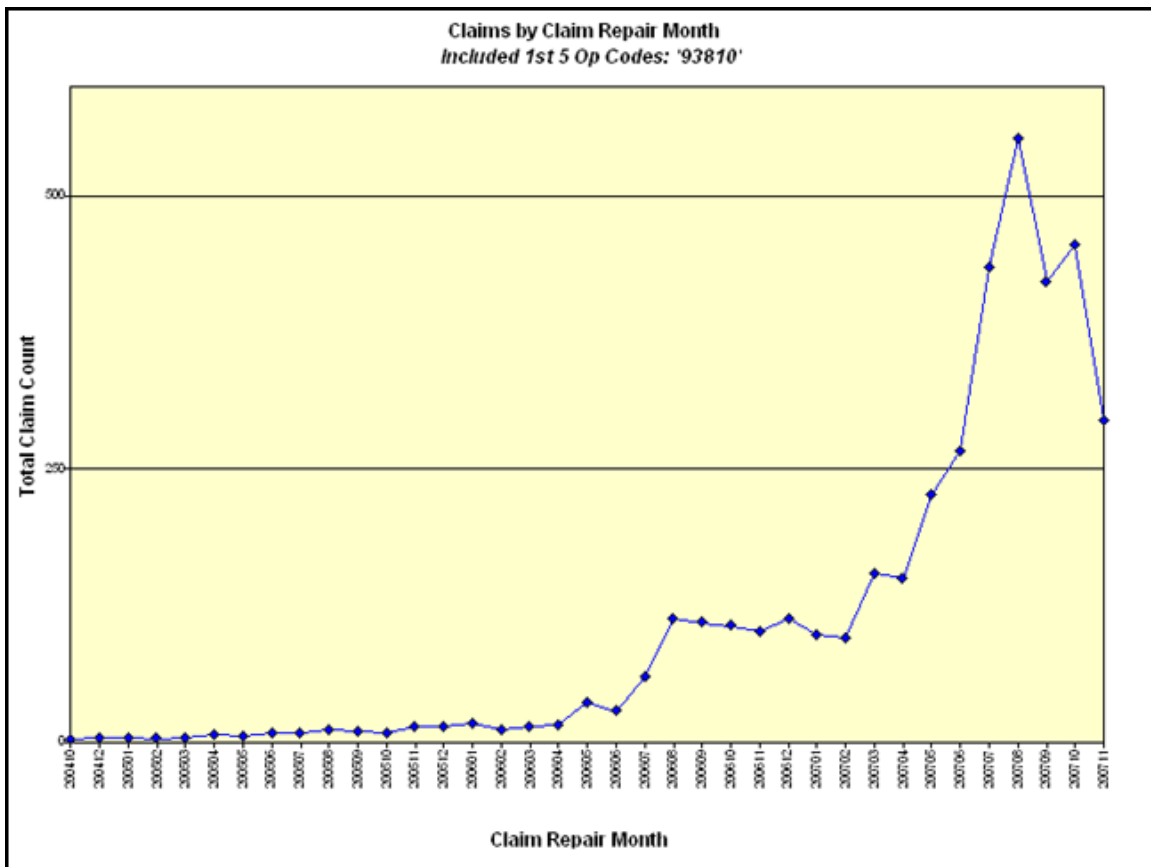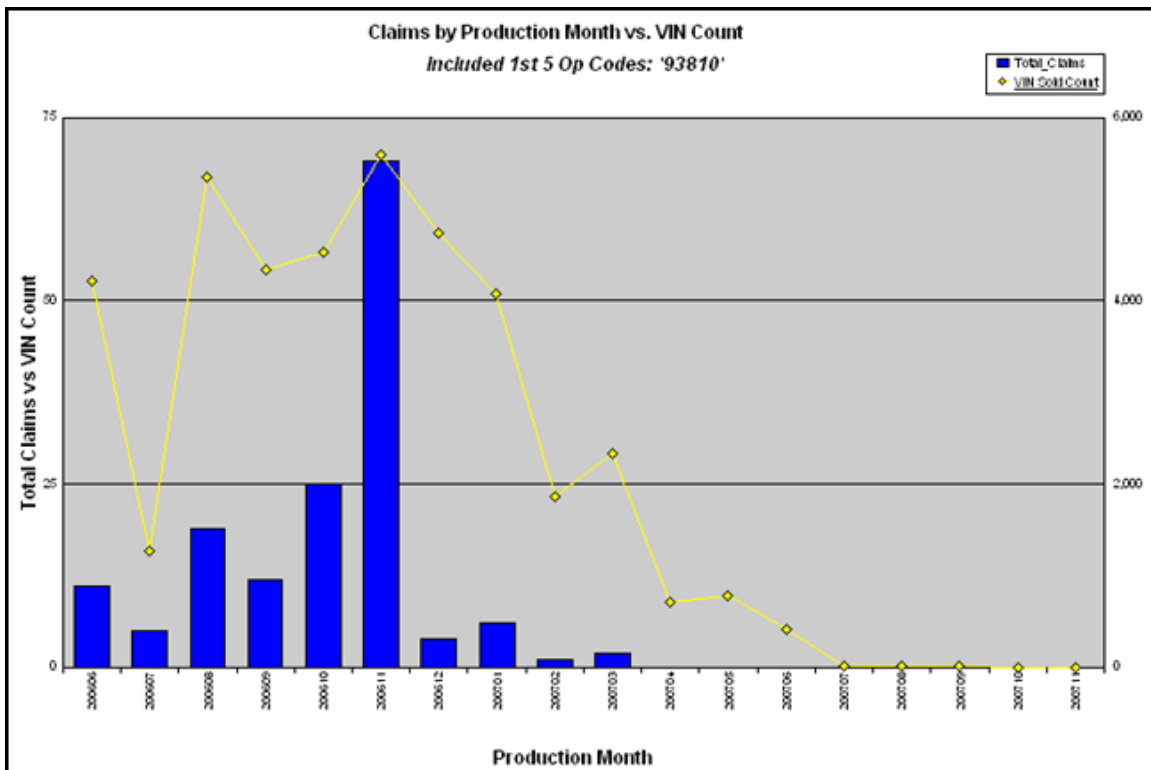

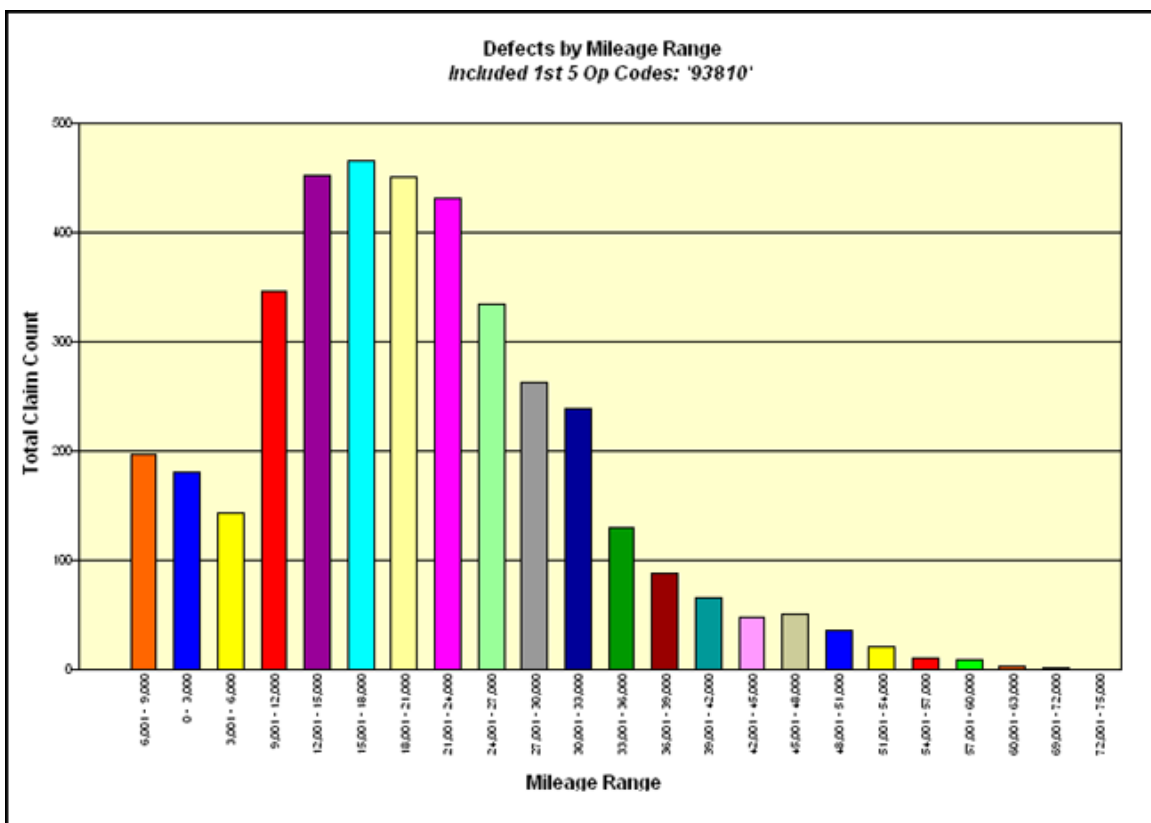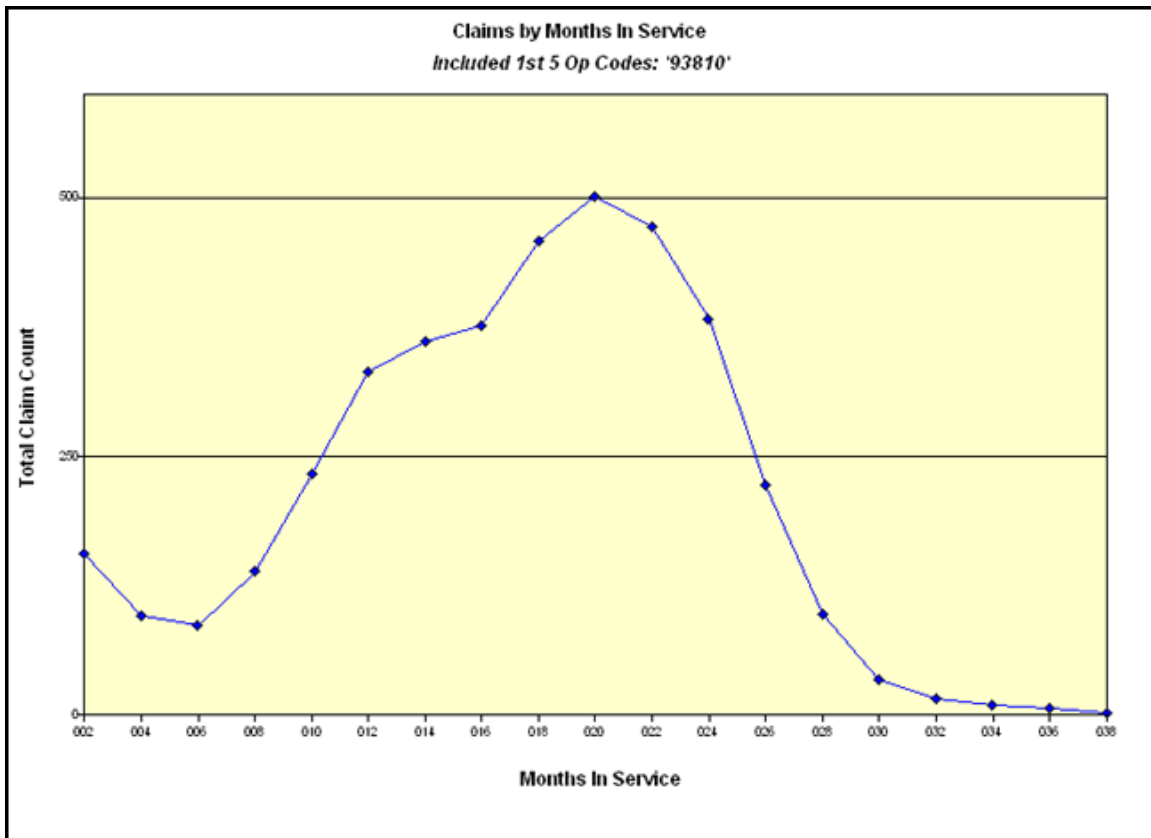

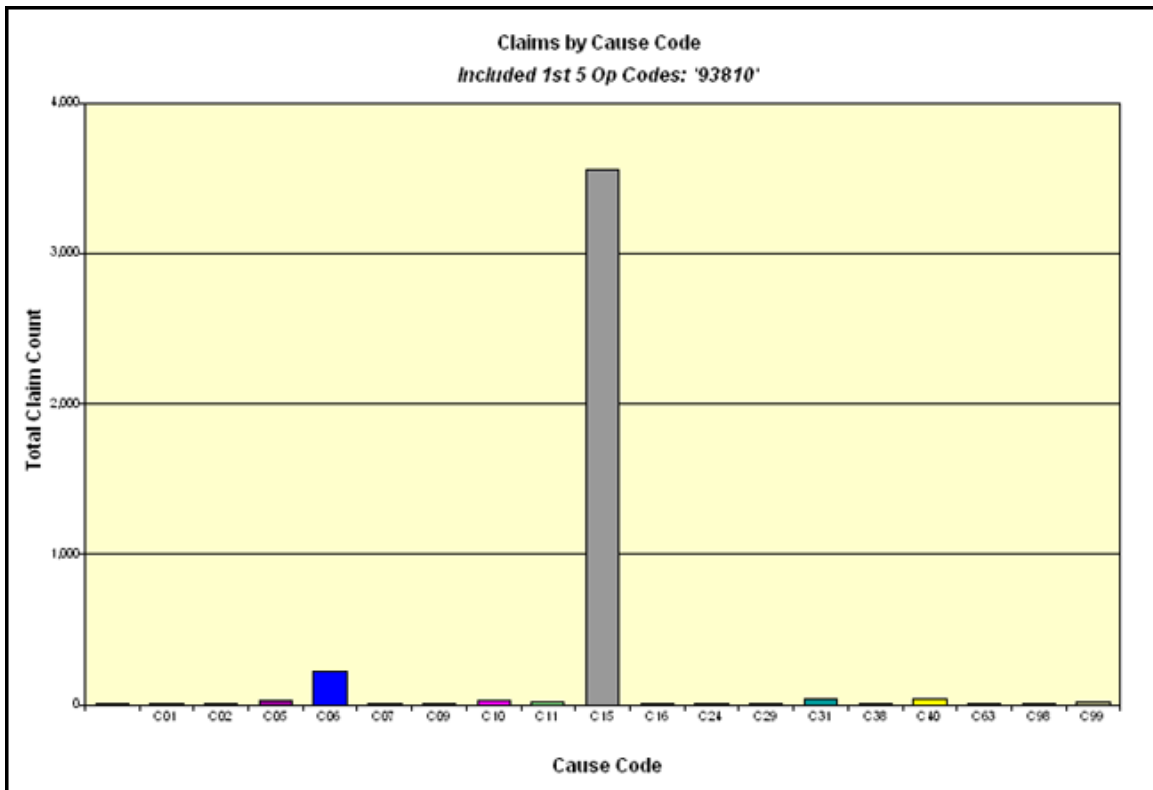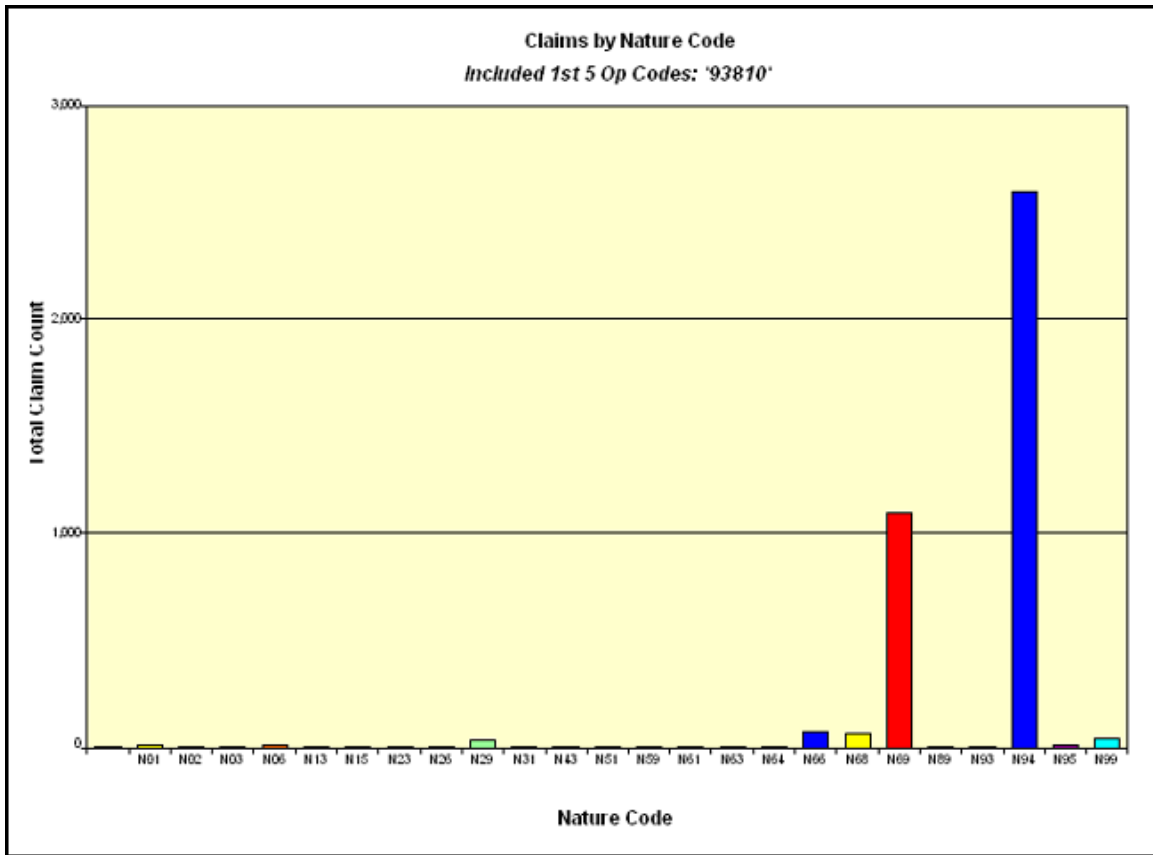

4. Comment/Recommendation:

- **Production C/M:**
 - HMC should investigate this condition and apply corrections as soon as possible.
- **Port action:**
 - Not required at this time as replacement part may or may not correct the condition permanently.
- **Field fix:**
 - Required from HMC as soon as improved parts are available.
- **TSB:**
 - HMC should provide a TSB with the improved parts.
- **Other comment:**
 - As the stop lamp switch also provides input to auto shift release, sometimes customers complain that the shifter cannot be released from the PARK position.

5. Attachments:

QAJM-C-071104

Attachment 2

VIN Number	Prod Date	Mileage	Total Cost	Technician Comment	Customer Complaint	Cause Comment	Technician Correction
KM8JM72B86U [REDACTED]	10/16/05	33369	28.54		CUSTOMER STATES ESC LIGHT TURNS ON AND OFF ON OWN-REPLACE STOP LAMP SWITCH	93810R00 .3 N-94 C-15	REPLACED STOP LAMP SWITCH AS PER CUSTOMER REQUEST- RUNNING AS PER SPECS AT THIS TIME
KM8JM12B36U [REDACTED]	7/16/05	41703	33.06				
KM8JN72D66U [REDACTED]	12/03/05	19521	32.74		CUSTOMER STATE ESC LIGHT WILL COME ON AT TIMES - IF SHUT VEHICLE OFF AND RESTART WILL GO OFF	PERFORM ELECTRONICS TESTING - FOUND TO HAVE ERROR CODE C1513BRAKE LAMP SWITCH INTERMITTENT SHORT.	REPLACE BRAKE LAMP SWITCH AND VERIFY OPERATIO - CLEAR ERROR FAULT CODE
KM8JN72D95U [REDACTED]	5/14/05	10699	37.24	REPLACE BRAKE SWITCH	CUSTOMER STATES L/F SEATBELT KEEPS LOCKING WHEN PUTTING ON OR SLIGHT MOVEMENT	BELT FAILED INTERNAL	FRONT SEAT BELT ASS'Y (LH) RE FRONT SEAT BELT ASS'Y (LH) RE REPLACE L/F SEATBELT
KM8JN72D95U [REDACTED]	5/14/05	10699	37.24	REPLACE BRAKE SWITCH	CUSTOMER STATES ESP LIGHT COMES ON (PART IS HERE)	BRAKE SWITCH FAILED INTERNAL	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE REPLACE BRAKE SWITCH
KM8JN72D37U [REDACTED]	11/10/06	7654	37.24	SCANNED SYSTEM FOR FAULT CODES,C1513 STORED. UPON INSPECTION FOUND THE STOP LAMP SWITCH FAILED.COMPLETED AND VERIFIED REPAIR			
KM8JN72D66U [REDACTED]	12/03/05	19521	32.74		RECALL 079 - DRIVERS AIR BAG COVER REPLACEMENT	PER RECALL INSTRUCTIONS	REPLACE DRIVERS AIR BAG COVER AS PER RECALL 079
KM8JN72D16U [REDACTED]	11/19/05	19797	38.16	19797 W CUSTOMER STATES ESC LITE IS ON CONFIRM CONCERN FOUND FAILURE OF STOP LAMP SWITCH REPLACED SWITCH CONFIRM REPAIR			
KM8JM12B56U [REDACTED]	7/19/05	18197	38.16	18199 WARR CUSTOMER STATES ESC LIGHT HAS BEEN COMING ON CONFIRM CONCERN FOUND FAILURE OF STOP LAMP SWITCH REPLACED SWITCH CONFIRM REPAIR			
KM8JN72D16U [REDACTED]	9/29/05	29563	65.46	SCANNED SYSTEM FOR CODES,C1513 CODE SET,UPON INSPECTION FOUND THE BRAKE LIGHT SWITCH FAILED. REPLACE BRAKE LIGHT SWITCH,CLEARED CODE, RECHECKED,OK			
KM8JN12DX6U [REDACTED]	9/23/05	26559	31.24	26559 ESC LIGHT ON,CHECK STOP SWITCH,CONFIRM Malfunt 93810R00 .3 PERFORMED ELECTRICAL DIAG ON CIRCUIT,PREVIOUS RO,FOUND STOP LAMP SWITCH INTERNAL SHORT/MAL REMOVED AND REPLACED STOP LAMP SWITCH ASSY REDROVE CAR,SWITCH IS WORKING,CRUISE SETS ESC LAMP IS OF	CUSTOMER CONCERN THE ESC LIGHT STAYS ON ALL THE TIME	STOP LAMP SWITCH SHORT	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 26559 ESC LIGHT ON,CHECK STOP SWITCH,CONFIRM Malfunt 93810R00 .3 PERFORMED ELECTRICAL DIAGON CIRCUIT,PREVIOUS RO,FOUND STOP LAMP SWITCHINTERNAL SHORT/MAL REMOVED AND REPLACED STOPLAMP SWITCH ASSY REDROVE
KM8JN72D36U [REDACTED]	7/16/05	22139	38.16	CUSTOMER STATES THE ESC LIGHT IS SHOWING OFF AT ALL TIMESCONFIRM CONCERN FOUND FAILURE OF BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH CONFIRM REPAIR			
KM8JN12D06U [REDACTED]	10/04/05	2369	66.34	CUSTOMER STATES ESC LIGHT IS ON ESC WILL. NOT ENGAGE CODE C1513 FOUND FAULTY BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH AND CLEARED CODE			
KM8JN72D16U [REDACTED]	7/26/05	30201	37.84	CUSTOMER STATES ESC LIGHT ON FOUND ELECTRICAL FAILURE OF BRAKE LIGHT SWITCH REPLACED SWITCH			
KM8JN12DX6U [REDACTED]	9/23/05	26559	31.24	26559 ESC LIGHT ON,CHECK STOP SWITCH,CONFIRM Malfunt 93810R00 .3 PERFORMED ELECTRICAL DIAG ON CIRCUIT,PREVIOUS RO,FOUND STOP LAMP SWITCH INTERNAL SHORT/MAL REMOVED AND REPLACED STOP LAMP SWITCH ASSY REDROVE CAR,SWITCH IS WORKING,CRUISE SETS ESC LAMP IS OF	CUSTOMER CONCERN THERE IS A WATER DRIPPING SOUND COMING FROM BEHIND THE DASH WHEN THE A/C IS ON	BLOWER MOTOR NOISEY	AIR CONDITIONING MOTOR AND FAN BLOWER ASS'Y RE AIR CONDITIONING MOTOR AND FAN BLOWER ASS'Y RE 26559 CHECK WATER NOISE,CONFIRMED BLOWERMOTOR WET 97109R00 .3 REMOVE AND REPLACEDBLOWER MOTOR ASSY,WATER AROUND CAGE,BLOWER ISNOISEY,DAMP RESEALED FRESH INTAKE A
KM8JM12B36U [REDACTED]	7/13/05	18982	33.97		CUSTOMER STATES THE ESC IS COMING ON WHILE DRIVING,CHECK AND ADVISE.	15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN12D96U [REDACTED]	12/31/05	11669	66.66	11674 BRAKE SWITCH 93810R00 N94 C15, 93810RP0 60 FOUND CODE C1513, BRAKE PEDAL SWITCH CIRCUIT FAULT. WITH HIGHSCAN I MONITORED THE BRAKE SWITCH AS I PRESSED IT IN AND OUT. FOUND THAT SOMETIMES IT WONT REGISTER AS BEING OPEN WHEN THE PEDAL IS DEPRESSED. RE	CUSTOMER STATES TRANS IS JUMPY WHENSWITCHING GEARS	RESET ADAPTIVE VALUES	TRANS ASSY-AUTO ADD SCAN TOOL & AUTO TRANS TEST OP TRANS ASSY-AUTO ADD SCAN TOOL & AUTO TRANS TEST OP 11674 RESET ADAPTIVE VALUES 45000RP0 30 TESTDROVE AND FOUND TRANS A LITTLE ROUGH AT TIME.CHECKED FLUID...OK. CHECKED FOR CODES NONEFOUND. RESET TRANS ADA
KM8JN12D96U [REDACTED]	12/31/05	11669	66.66	11674 BRAKE SWITCH 93810R00 N94 C15, 93810RP0 60 FOUND CODE C1513, BRAKE PEDAL SWITCH CIRCUIT FAULT. WITH HIGHSCAN I MONITORED THE BRAKE SWITCH AS I PRESSED IT IN AND OUT. FOUND THAT SOMETIMES IT WONT REGISTER AS BEING OPEN WHEN THE PEDAL IS DEPRESSED. RE	RECALL 079	079	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 11674 079 61B046R0 20 079 RECALL.

KM8JM12B06U	12/30/05	31186	33.34	31186 N94 / C15 93810R00 / 0.3 0.3 CONFIRMED COMPLAINT , PULLED CODES , RAN PINPOINT TEST , FOUND HIGH RESISTANCE IN BRAKE LAMP SWITCH, REPLACED SWITCH			
KM8JM12B26U	8/23/05	18257	37.84		CUSTOMER STATES THAT THE ESC LIGHT STAYS ON AND WILL NOT TURN OFF	INTERNALY FAILED BRAKE LAMP SWITCH	SCAN FOR CODES, CODE C1513 BRAKE LAMP SWITCH STORED. NECESSARY TO REPLACE BRAKE LAMP SWITCH ASSEMBLY
KM8JM12B26U	8/23/05	18257	37.84		AS OF 11/02/06, ALL TUCSONS HAVE BEEN EQUIPPED WITH A NEW DESIGN DRIVER AIR BAG COVER MODULE.	ALL PREVIOUS TUCSON DRIVER AIR BAG COVER MODULES MUST BE REPLACED.	DRIVER AIR BAG MODULE REPLACEMENT 0.2 M/H-61B046R0
KM8JN12D96U	12/31/05	11669	66.66	11674 BRAKE SWITCH 93810R00 N94 C15, 93810RP0 60 FOUND CODE C1513, BRAKE PEDAL SWITCH CIRCUIT FAULT. WITH HIGHSCAN I MONITORED THE BRAKE SWITCH AS I PRESSED IT IN AND OUT. FOUND THAT SOMETIMES IT WONT REGISTER AS BEING OPEN WHEN THE PEDAL IS DEPRESSED. RE	CUSTOMER STATES ESC LIGHT IS ON	BRAKE SWITCH	SCAN TOOL DIAG SCAN TOOL DIAG 11674 BRAKE SWITCH 93810R00 N94 C15, 93810RP060 FOUND CODE C1513, BRAKE PEDAL SWITCH CIRCUIT FAULT. WITH HIGHSCAN I MONITORED THE BRAKE SWITCH AS I PRESSED IT IN AND OUT. FOUND THAT SOMETIMES IT WONT REGISTER AS BEING OPEN WHEN T
KM8JN12DX5U	10/27/04	16761	35.01		CUST STATES THE ESP OFF LIGHT STAYS ON AND GOES OFF INTERMITTENTLY. PART IS HERE.	BRAKE PEDAL SWITCH TO HAVE INTERMITTENT OPEN	NEC TO REPLACE BRAKE PEDAL SWITCH AND RE-TEST OPERATION OK
KM8JN72D35U	5/14/05	9083	37.84		CUSTOMER REPORTS THE ESC LIGHT IS COMING ON AT TIMES AND THAN WILL GO OUT	INTERNALY FAILED BRAKE LAMP SWITCH	SCAN FOR CODES, CODE C1513 BRAKE LAMP SWITCH STORED. NECESSARY TO REPLACE BRAKE LAMP SWITCH ASSEMBLY.
KM8JN12D55U	4/21/05	11603	37.25		CUSTOMER STATES ESP LIGHT COMES ON AND OFF. SPECIAL ORDERED BRAKE LAMP SWITCH.	TECHNICIAN FOUND BRAKE LAMP SWITCH INTERNALLY SHORTED.	NECESSARY TO REPLACE BRAKE LAMP SWITCH. TEST DROVE. GOOD. VEHICLE OPERATING AS DESIGNED AT THIS TIME.
KM8JN12D96U	12/31/05	11669	66.66	11674 BRAKE SWITCH 93810R00 N94 C15, 93810RP0 60 FOUND CODE C1513, BRAKE PEDAL SWITCH CIRCUIT FAULT. WITH HIGHSCAN I MONITORED THE BRAKE SWITCH AS I PRESSED IT IN AND OUT. FOUND THAT SOMETIMES IT WONT REGISTER AS BEING OPEN WHEN THE PEDAL IS DEPRESSED. RE	CUSTOMER STATES ESC LIGHT IS ON	BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 11674 BRAKE SWITCH 93810R00 N94 C15, 93810RP060 FOUND CODE C1513, BRAKE PEDAL SWITCH CIRCUIT FAULT. WITH HIGHSCAN I MONITORED THE BRAKE SWITCH AS I PRESSED IT IN AND OUT. FOUND THAT SOMETIMES IT WONT REGISTER
KM8JM12B16U	7/14/05	27960	38.16	27960 CONNECTED GDS, CODE C1513 STORED. FOUND STOP LAMP SWITCH OPEN. 93810R00 N94 C15 30 REMOVED AND REPLACED STOP LAMP SWITCH.	CUSTOMER STATES ESC OFF LIGHT IS COMING ON AND STAYING ON WHEN OFF BUTTON IS PUSHED IT IS INTERMNT	CONNECTED GDS, CODE C1513 STORED. FOUND STOP LAMP SWITCH OPEN.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 27960 CONNECTED GDS, CODE C1513 STORED. FOUND STOP LAMP SWITCH OPEN. 93810R00 N94 C15 30 REMOVED AND REPLACED STOP LAMP SWITCH.
KM8JM12B67U	10/31/06	1330	37.54	.3	CUSTOMER STATES THAT THE ESC LIGHT COMES ON AT TIMES SEEMS TO OCCURE AT ANY DRIVING CONDITION - LIGHT IS OFF NOW	FOUND CODE C1513 BRAKE LAMP SWITCH NEEDS NEW BRAKE LAMP SWITCH	INSTALLED NEW BRAKE LAMP SWITCH
KM8JN72D95U	5/27/05	19384	38.16	NECESSARY TO REPLACE BRAKE SWITCH. CLEARED CODES AND TEST DROVE VEHICLE	CUSTOMER STATES THAT TEH ESC LIGHT OFF STAYS ON	SCANNED FOR CODES AND FOUND C1513 BRAKE LAMP SWITCH FOUND INTERNAL FAILURE IN BRAKE SWITCH	NECESSARY TO REPLACE BRAKE SWITCH. CLEARED CODES AND TEST DROVE VEHICLE
KM8JN12D77U	11/01/06	5668	38.16	REPLACE THE BRAKE SWITCH, CLEAR CODES AND TEST DRIVE VEHICLE. CODES DID NOT RETURN.			
KM8JN12D06U	8/19/05	17358	38.16		CUST STATES WHEN VEH IS STARTED COLD THERE IS A SQUEALING SOUND FROM ENGINE AREA.	FOUND NOISE FROM THE IDLER PULLEY THAT WAS REPLACED ON 04/12/07. FOUND THE PULLEY DEFORMED, CAUSING BELT WEAR.	REPLACE THE IDLER PULLEY AND BELT
KM8JN12D96U	8/17/05	19607	37.86	REPLACED THE BRAKE LAMP SWITCH, CLEARED CODE C1513	CUSTOMER STATES THAT THE ECS LIGHT COMES ON AND WILL NOT SHUT OFF WITH THE SWITCH AND HAD TO CHARGE AND JUMP THE BATTERY YEASTERDAY AM AND WOULD LIKE THE BATTERY CHECKED AND SEESM TO START OK TODAY	THE BRAKE LAMP SWITCH IS FAULTY.	REPLACED THE BRAKE LAMP SWITCH, CLEARED CODE C1513
KM8JN72DX6U	8/08/05	18956	37.86		CUSTOMER STATES ESC LIGHT WILL COME ON DASH AT RANDOM...CHECK AND ADVISE	CODE C1513 FAULTY STOP LAMP SWITCH	CLEARED CODE AND REPLACED STOP LAMP SWITCH TEST DRIVE OK
KM8JN72DX6U	8/08/05	18956	37.86		OWNER REPORTS THAT THE CHECK ENGINE LIGHT HAS COME ON.	CODE P0130 O2 SENSOR MALFUNCTION	CLEARED CODE AND REPLACED O2 SENSOR
KM8JN12D06U	8/19/05	17358	38.16		CUST STATES THE ESC OFF LIGHT COMES ON.	FOUND CODE C1513, BRAKE LAMP CIRCUIT MALFUNCTION. FOUND THE BRAKE LAMP SWITCH OPEN/SHORTED.	REPLACE THE BRAKE LAMP SWITCH.
KM8JN72D85U	5/30/05	19124	38.16		CUST STATES THE ESP OFF LIGHT STAYS ON. COMES ON AND OFF WHEN DRIVING	SCANNED VEHICLE FOR CODES AND FOUND C1513. TESTED OPERATION OF BRAKE SWITCH AND FOUND INTERNAL OPEN	NECESSARY TO REPLACE BRAKE SWITCH AND CLEARED CODE. RETESTED AND TEST DROVE VEHICLE
KM8JN12D35U	6/09/05	25271	37.25		CUSTOMER STATES ESP LIGHT COMES ON AND OFF	TECHNICIAN FOUNDN CODE C1513 BRAKE LAMP SWITCH. FOUND BRAKE LAMP SWITCH SHORTED.	NECESSARY TO REPLACE BRAKE LAMP SWITCH. TESTED. GOOD. VEHICLE OPERATING AS DESIGNED AT THIS TIME.
KM8JM12B06U	7/12/05	25582	37.86	0.3HRS	CUSTOMER STATES ESC LIGHT ON	FOUND CODE C1513-BRAKE LAMP SWITCH.	REPLACED BRAKE LAMP SWITCH.
KM8JM12B06U	7/12/05	25582	37.86	0.3HRS	CUSTOMER STATES BRAKE LIGHTS ON ALL THE TIME CHECK AND ADVISE	TECHNICIAN EXPERIENCED NO BRAKE LIGHTS AT ALL. BRAKE LIGHTS WERE NOT ON AT ALL TIMES AS COMPLAINT STATED BY CUSTOMER.	PROBLEM RELATED TO PROBLEM IN LINE #1.

KM8JM72B85U	4/22/05	32065	37.86		GUEST HAS A CONCERN OF A LOW PITCHED MOAN THAT SEEMS TO COME FROM THE FRONT END WHEN TURNING AT LOW SPEEDS. ADVISE.	COULD NOT VERIFY CUSTOMERS CONCERN AT THIS TIME. NO ABNORMAL NOISE HEARD FROM VEHICLE WHEN TURNING OR ACCEL.	NO CORRECTIONS MADE. TECH 1181 VERIFIED.
KM8JN12DX6U	1/04/06	13117	37.84		CUSTOMER STATES THE ESC OFF LIGHT STAYS ON AT TIMES, ALSO THE SWITCH IS INOPERATIVE AT TIMES.	SCANNED FOR CODES, FOUND CODE C1237-PRESSURE SENSOR MALFUNCTION, CODE C1513-BRAKE LAMP SWITCH MALFUNCTION. FOUND NO READING FROM THE BRAKE LAMP SWITCH.	REPLACE THE BRAKE LAMP SWITCH AND RETEST.
KM8JN12DX6U	1/04/06	13117	37.84		AS OF 11/02/06, ALL TUCSONS HAVE BEEN EQUIPPED WITH A NEW DESIGN DRIVER AIR BAG COVER MODULE.	ALL PREVIOUS TUCSON DRIVER AIR BAG COVER MODULES MUST BE REPLACED.	DRIVER AIR BAG MODULE REPLACEMENT 0.2 M/H-61B046R0
KM8JN12D66U	7/28/05	15152	39.8		CUSTOMER STATES ESC LIGHT COMES WHILE DRIVING. CHECK AND ADVISE.	SCANNED FOR CODES, FOUND CODE C1513-BRAKE LAMP SWITCH MALFUNCTION.	REPLACED THE BRAKE LAMP SWITCH AND CLEAR CODE
KM8JM72B85U	4/22/05	32065	37.86		GUEST HAS A CONCERN OF A HISsing NOISE HEARD WHEN A/C IS ON SOUNDS ALMOST AS THOUGH THE SYSTEM IS LOSING PRESSURE. GUEST SAYS THAT THE A/C REMAINS COLD EVEN WHEN THE SOUND OCCURS. INSPECT AND ADVISE.	VERIFIED CUSTOMER COMPLAINT. FOUND NOISE IS NORMAL CONDITION OF VEHICLE. HISsing NOISE IS FROM COMPRESSOR CYCLING ON AND OFF WHEN A/C IS ON.	NO CORRECTIONS MADE. CHECKED FUNCTIONS OF A/C, PRESSURE, AND DISCHARGE TEMP. ALL ARE OK AT THIS TIME. NO LEAKS FOUND. TECH 1181 VERIFIED E
KM8JM72B85U	4/22/05	32065	37.86		GUEST SAYS THAT THERE ARE TIMES WHEN THE ESC OFF LIGHT COMES ON THE DASH WITHOUT HITTING THE ACTIVATION	FOUND CODE C1513 BRAKE LAMP SWITCH. FOUND FAULTY SWITCH.	CLEARED CODE. REPLACED SWITCH AND TEST DROVE. TEST DRIVE OK. NO FURTHER CODES OR CORRECTIONS MADE.
KM8JN12D66U	7/28/05	15152	39.8		AS OF 11/02/06, ALL TUCSONS HAVE BEEN EQUIPPED WITH A NEW DESIGN DRIVER AIR BAG COVER MODULE.	ALL PREVIOUS TUCSON DRIVER AIR BAG COVER MODULES MUST BE REPLACED.	DRIVER AIR BAG MODULE REPLACEMENT 0.2 M/H-61B046R0
KM8JN12D36U	11/30/05	19219	38.16		CUST STAES THERE IS A CLUNKING SOUND WHEN PUTTING VEH INTO REVERSE, FEELS LIKE ITS BINDING WHEN TRYING TO PUT INTO REVERSE.	TECH TEST DROVE VEH, DID NOT CONFIRM A CLUNKING SOUND INSPECTED OPERATION OF TRANS GOING FROM PARK TO REVERSE WITH SCANNER PER TSB 07-40-009-1. IS OK. FOUND BRAKE LAMP SWITCH HAD FAILED	NEC TO REPLACE BRAKE LAMP SWITCH AND TEST OPERATION
KM8JN72D16U	7/14/05	41289	37.86		CUSTOMER STATES ESC LIGHT OFF ALL THE TIME	FOUND CODE C1513 BRAKE LAMP SWITCH FAULTY	REPLACED BRAKE LAMP SWITCH AND CLEARED CODES. TEST DROVE OK
KM8JN72D75U	6/15/05	21828	37.86	0.3HRS	CUSTOMER STATES THE ESP LIGHT IS COMING ON SPORADICALLY	ESP LIGHT CODE C1315-BRAKE LAMP SWITCH CIRCUIT.	REPLACED INOP BRAKE LAMP SWITCH.
KM8JN72D86U	10/05/05	22380	37.86	.3 HOURS	CUSTOMER STATES THAT AT TIMES FOR NO REASON THE ECS LIGHT GOES ON AND ESC OFF IS IRRATIC	BRAKE SWITCH HAS POOR CONTACTS INTERNALLY - INTERMITTENTLY BRAKE LIGHTS ARE INOPERATIVE.	REPLACED BRAKE SWITCH ASSEMBLY.
KM8JN12D46U	8/23/05	26215	37.84		CUSTOMER STATES THAT THE ECS OFF LIGHT WAS ON AND WOULD NOT SHUT OFF OR TURN OFF	SCANNED VEHICLE FOR CODES AND FOUND C1513 BRAKE STOP SWITCH. TESTED AND FOUND INTERNAL OPEN	NECESSARY TO REPLACE BRAKE LAMP SWITCH AND RETEST
KM8JN12D15U	1/12/05	25601	38.16		CUSTOMER REPORTS TWO TIMES THE ESP LIGHT OFF HAS COME ON AND WILL NOT GO OUT WITH THE SWITH UNLESS YOU TURN OFF THE KEY AND RESTART THE VEHICLE	SCANNED FOR CODES, FOUND CODE C1237-PRESSURE SENSOR MALFUNCTION, CODE C1513, BRAKE LAMP SWITCH MALFUNCTION.	REPLACE THE BRAKE LAMP SWITCH. NECESSARY TO ORDER NEW PRESSURE SENSOR.
KM8JN72D26U	8/16/05	12024	38.16		CUSTOMER STATES THE ESC OFF LIGHT COMES ON WHILE DRIVING	INTERNALY FAIELD BRAKE LAMP SWITCH	SCAN FOR CODES, CODE B1513 BRAKE SWITCH CIRCUIT STORED. NECESSARY TO REPLACE BRAKE LAMP SWITCH ASSEMBLY
KM8JN72D86U	10/05/05	22380	37.86	.3 HOURS	CAMPAIGN 079	OPEN CAMPAIGN.	COMPLETED CAMPAIGN 079.
KM8JN12D96U	12/09/05	18746	37.54		CUSTOMER STATES ESC LIGHT WOULD COME ON AT RANDOM CHECK AND ADVISE	FOUND FAULTY STOP LAMP SWITCH INTERNAL FAILURE	REPLACED STOP LAMP SWITCH AND TEST DROVE. CLEARED CODES
KM8JN12D96U	12/09/05	18746	37.54		OWNER REPORTS AIRBAG WARNING LIGHT IS ON	FOUND WIRES PULLED MAKING POOR CONNECTION CODE B1334	REMOVED SEAT AND WIRE COVERS REROUTED WIRES AND CLEARED CODE TEST DROVE OK
KM8JN12D75U	9/12/04	209	35.67				
KM8JN72D45U	10/20/04	12912	33.66		O/R ESP LAMP IS ON....INSTALL SOP	N94 INTERNAL FAILURE OF SWITCH	FOUND BRAKE LAMP SWITCH IS FAULTY. REPLACED SWITCH ASSEMBLY STOP LAMP SWITH AND/OR CLUTCH SWITCH ASSY
KM8JM12B47U	8/24/06	678	34.86		CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING (DIAGNOSED AT LAST VISIT AND TRACED TO BRAKE SWITCH) REPLACED BREAK SWITCH AS PER PRIOR DIAG FOR THE ESC LIGHT OFF BEING ON AND SET CODE C1513		
KM8JN72D16U	7/19/05	14538	34.54		CUSTOMER STATES ESC OFF LIGHT STAYS ON	DIAGNOSED- CODE C1613 BRAKE SWITCH	REMOVED AND REPLACED BRAKE SWITCH, CLEARED DIAGNOSTIC TROUBLE CODE AND TEST DROVE ESC OFF LIGHT DID NOT
KM8JN12D85U	4/12/05	51945	37.86	.30	GUEST SAYS THAT THE ESC OFF LIGHT WILL COME ON AND OFF WITHOUT PUSHING THE ACTIVATION BUTTION.	THE BRAKE LAMP SWITCH IS FAULTY	REPLACED THE BRAKE LAMP SWITCH, CLEARED CODE C1513
KM8JN12D85U	4/12/05	51945	37.86	.30	PERFORM CAMPAIGN 079	OPEN CAMPAIGN	CAMPAIGN COMPLETED
KM8JN72DX6U	7/28/05	27010	37.86	.3	CUSTOMER STATES THAT THE ESC LIGHT OFF (LIGHT) IS COMMING ON	THE BRAKE SWITCH IS FAULTY. SET DTC C1513 BRAKE SWITCH CIRCUIT.	REPLACED THE BRAKE LAMP SWITCH AND CLEARED THE DTC. ROAD TESTED TO VERIFY REPAIRS. 93810R00 N69 C15
KM8JN72D56U	11/19/05	21719	34.86				

KM8JN72D46U	12/27/05	8874	146.3	8874 VERIFIED CONCERN. CHECKED FOR TSB AND NONE APPLY TESTED THE MAIN CRUISE CONTROL SWITCH ON STEERING WHEEL PER SHOP MANUAL AND IS OK WHEN YOU TAP THE SWITCH-REMOVED DRIVERS SIDE AIRBAG TO CHECK. REPLACED SWITCH AND ROADTESTED AND STILL NOT WORKING CORREC			
KM8JN72D16U	11/05/05	26400	29.79	VERIFIED CUSTOMER CONCERN. FOUND BRAKE SWITCH ASSEMBLY HAD SHORT IN IT. REPLACED BRAKE SWITCH ASSY.			
KM8JN72DX6U	7/28/05	27010	37.86	.3	CUSTOMER STATES THAT THE CENTER CONSOLE HAS CLIPS BROKE IN THE CUP HOLDER - SPECIAL ORDER PART	THE CENTER CONSOLE CUP HOLDER IS BROKEN.	INSTALLED A NEW CENTER CONSOLE CUP HOLDER. 84970R00 N86 C06
KM8JN12D36U	12/20/05	15751	37.86	0.3HRS	CUSTOMER STATES THAT THE CRUISE IS NOT WORKING FROM THE SWITCH AT TIMES - SPECIAL ORDER PART IS HERE	FOUND BRAKE STOP LAMP SWITCH TO BE FAULTY.	REPLACED STOP LAMP SWITCH ASSEMBLY.
KM8JN72D06U	7/27/05	26834	32.97				
KM8JN12D85U	9/02/04	20137	29.92	VERIFIED CUSTOMER CONCERN. FOUND CODES C1237 PRESSURE SENSOR OTHER AND C1513 BRAKE LAMP SWITCH. FOUND FAULTY BRAKE ALMP SWITHC. WHILE MONITORING DATA LIST THE BRAKE LAMP SWITCH ON OFF WOULD CUT IN AND OUT. LOSE SIGNAL. R AND R BRAKE LAMP SWITCH.	CUSTOMER STATES THE ESP LIGHT IS ON	VERIFIED CUSTOMER CONCERN PERFORMED EEC/WDS TESTS FOUND CODE 1237 & 1513	REPLACED DEFECTIVE BRAKE LAMP SWITCH
KM8JN12D45U	4/14/05	46659	29.79	VERIFIED CUSTOMER CONCERN. FOUND BRAKE LAMP SWITCH WITH INTERNAL DAMAGE. REPLACED BRAKE LAMP SWITCH.			
KM8JN72D05U	6/20/05	18362	56.3	CUST ST ESP LIGHT GOES ON AND OFF CK CODES C1513 INTERNAL OPEN CURCIT IN BRAKE SWITCH RR SWITCH ATT	CUSTOMER STATES ESP LIGHT COMES ON AND AND OFF CHECK AND ADVISE...	SCAN FOR CODES AND RETRIEVED CODE #C1513, BRAKE SWITCH TEST SWITCH AND CONFIRMED FAILURE.	REPLACE BRAKE LIGHT SWITCH, ERASE CODE AND ROADTEST.
KM8JN72D25U	4/08/05	38060	32.97		CUSTOMER STATES:PERFORM AIRBAG RECALL 079 AIR BAG COVER REPLACE	RECALL .	COMPLETED AIRBAG COVER REPLACEMENT
KM8JN72D25U	4/08/05	38060	32.97		CUSTOMER STATES:ESP LIGHT ON WILL FLASH TOO.	- TESTED & SCAN BRAK LIGHT SWITCH MALFUNCTION SCANNED CODES C1513 - BRAKE LAMP SWITCH C1237 PRESSURE SENSOR - OTHER (ERRONIOUS CODE).	REMOVED & REPLACED BRAKE LIGHT SWITCH
KM8JN12D45U	3/26/05	5133	30.38	VERIFIED CUSTOMER CONCERN. FOUND CODE C1513 BRAKE LAMP SWITCH. MEASURED RESISTANCE OF BRAKE LIGHT SWITCH PER GDS FLOW CHART. RESISTANCE TOO HIGH. R AND R BRAKE LAMP SWITCH, CLEARED CODE AND TEST DROVE 2 DRIVE CYCLES.	CUSTOMER STATES ESP LIGHT ON	VERIFIED CONCERN. FOUND CODE C1513 BRAKE LAMP SW. MEASURE RESISTANCE OF BRAKE LIGHT SW PER GDS FLOW DRAFT CHART. RESISTANCE TOO HIGH.	REPLACED DEFECTIVE BRAKE LAMP SWITCH AND CLEARED CODES. TESTDROVE 2 DRIVE CYCLES.
KM8JN72D66U	11/14/05	14572	30.38	VERIFIED CUSTOMERS CONCERN:REPLACED BRAKE SWITCH AND CLEARED CODE. ROAD TESTED TO VERIFY	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON ESC LIGHT	VERIFIED CUSTOMER CONCERN PERFORMED EEC/WDS TESTS FOUND CODE C1513 FOR BRAKE SWITCH	REPLACED BRAKE SWITCH AND CLEARED CODE. ROAD TESTED TO VERIFY REPAIRS
KM8JM72B95U	6/21/05	16473	32.02	VERIFIED CUSTOMER CONCERN. FOUND FAULTY BRAKE SWITCH. CHECKED FOR CODES USING GDS AND FOUND C1513 FOR FAULT IN BRAKE SWITCH CIRCUIT. REPLACED BRAKE SWITCH AND CLEARED CODE.	CUSTOMER STATES ESC LIGHT COMES ON AT TIMES. IT IS NOT ON RIGHT NOW.	FAULTY BRAKE SWITCH	CHECKED FOR CODES USING GDS AND FOUND C1513 FOR FAULT IN BRAKE SWITCH CIRCUIT. REPLACED BRAKE SWITCH AND CLEARED CODE.
KM8JM12B85U	5/25/05	53081	41.3	VERIFIED CONCERN. TESTED AND FOUND FAULTY BRAKE LAMP SWITCH REPLACED SWITCH AND RETESTED NORMAL OPERATION AT THIS TIME	OWNER REPORTS ESC LIGHT OFF IS ALWAYS ON, SWITCH DOES NOT CHANGE SETTING	SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE VERIFIED CONCERN. TESTED AND FOUND FAULTYBRAKE LAMP SWITCH REPLACED SWITCH AND RETESTED NORMAL OPERATION AT THIS TIME
KM8JM12B85U	5/25/05	53081	41.3	VERIFIED CONCERN. TESTED AND FOUND FAULTY BRAKE LAMP SWITCH REPLACED SWITCH AND RETESTED NORMAL OPERATION AT THIS TIME	OWNER REPORTS CORROSION ON PASSENGER ROCKER PANEL INSIDE FRONTDOOR, APPT MADE WITH JOE AT FRANKS ON 01/18 943	COROSSION	SUBLET REPAIRS VERIFIED CORROSION ON INSPECTION, SUBLET TOFRANKS AUTO BODY FOR WARRANTY REPAIR TOPASSENGER ROCKER PANEL AT FRONT INSIDE DOORREFINISH ROCKER PANEL
KM8JM72B95U	6/21/05	16473	32.02	VERIFIED CUSTOMER CONCERN. FOUND FAULTY BRAKE SWITCH. CHECKED FOR CODES USING GDS AND FOUND C1513 FOR FAULT IN BRAKE SWITCH CIRCUIT. REPLACED BRAKE SWITCH AND CLEARED CODE.	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON	VERIFIED CUSTOMER CONCERN PERFORMED EEC/WDS TESTS FOUND CODE P0111 FOR INCORRECT INTAKE AIR TEMP SENSOR RANGE	REPLACED MASS AIRFLOW SENSOR AND ROAD TESTED TO VERIFY REPAIRS
KM8JN72D86U	11/16/05	24895	30.38	VERIFIED CUSTOMERS CONCERN. REPLACED BRAKE SWITCH AND ROAD TESTED.	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON BRAKE PEDAL SWITCH IN STOCK (SOP)	VERIFIED CUSTOMER CONCERN PERFORMED EEC/WDS TESTS FOUND CODE C1513 FOR BRAKE PEDAL SWITCH	REPLACED BRAKE PEDAL SWITCH AND TESTED FUNCTION. CLEARED FAULT CODE.
KM8JM12B85U	5/25/05	53081	41.3	VERIFIED CONCERN. TESTED AND FOUND FAULTY BRAKE LAMP SWITCH REPLACED SWITCH AND RETESTED NORMAL OPERATION AT THIS TIME	OWNER REPORTS CORROSION INSIDE FRONTDOOR, APPT MADE WITH JOE AT FRANKS ON 01/18 943	COROSSION	FRONT PILLAR - RH FRONT PILLAR - LH VERIFIED CORROSION ON INSPECTION, SUBLET TOFRANKS AUTO BODY FOR WARRANTY REPAIR TOPASSENGER ROCKER PANEL AT FRONT INSIDE DOORREFINISH

KM8JN72D56U	12/13/05	5312	39.34	VERIFIED CONCERN, RETRIEVED CODE C1513, TESTED AND FOUND BRAKE LAMP SWITCH IS SHORTED INTERNALLY REPLACED BRAKE LAMP SWITCH, CLEARED CODE AND RETESTED	CUSTOMER STATES THE ECS LIGHT KEEPS COMING ON CHECK ANA DVICE	SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE VERIFIED CONCERN, RETRIEVED CODE C1513,TESTED AND FOUND BRAKE LAMP SWITCH IS SHORTED INTERNALLY REPLACED BRAKE LAMP SWITCH,CLEARED CODE AND RETESTED
KM8JN12D85U	2/17/05	24754	33.73	SC40914			
KM8JN12B57U	10/30/06	2527	60.36	ATT TIME FOR SCAN TIME: CODE C1513			
KM8JN12D06U	8/17/05	32261	35.01	REPLACED BRAKE LIGHT SWITCH			
KM8JN12DX5U	5/23/05	11865	36.65	ADJUSTED SWITCH ACCORDING TO TSB BUT PROBLEM DI DNT GO AWAY. REPLACED THE BRAKE SWITCH AND REA DJUSTED.			
KM8JN12D35U	5/24/05	11529	38.3	VERIFIED CONCERN, RETRIEVED CODES C1616, C1513, U0101, P0703, U001, U0100 FOUND BRAKE SWITCH SHORTED INTERNALLY REPLACED BRAKE SWITCH INTERNALLY	OWNER RPEORTS BRAKE LIGHTS STAY ON AT TIMES, ESP OFF LIGHT COMES ON WHILE DRIVING, AND CRUISE CONTROL IS INOP	SHORTED	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE VERIFIED CONCERN, RETRIEVED CODES C1616,C1513, U0101, P0703, U001, U0100 FOUND BRAKESWITCH SHORTED INTERNALLY REPLACED BRAKESWITCH INTERNALLY
KM8JN12D86U	7/22/05	33964	39.66	VERIFIED CONCERN. FOUND CODE 1513 BRAKE LAMP SWI TCH INOP. REPLACED BRAKE LIGHT SWITCH AND TESTE D	CUSTOMER STATES ESC OFF LIGHT IS ONINTT. CHECK AND ADVISE	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE VERIFIED CONCERN. FOUND CODE 1513 BRAKE LAMP SWI TCH INOP. REPLACED BRAKE LIGHT SWITCH AND TESTE
KM8JN12DX5U	9/03/04	37037	29.25	BRAKE LIGHTS NOT WORKING. FOUND POOR CONNECTION IN BRAKE SWITCH			
KM8JN12D96U	7/22/05	17006	60.36	ATT TIME FOR SCAN TIME: C1513PER MIKE @ HELPLINE THERE IS NO SCAN TIME FOR THIS.			
KM8JN12D16U	7/20/05	23339	34.69	REPLACED BRAKE LIGHT SWITCH 1			
KM8JN12B45U	5/20/05	26423	34.69				
KM8JN12D06U	7/29/05	14150	35.01	REPLACED SWITCH			
KM8JN12D36U	10/23/05	13300	30.96				
KM8JN72D05U	4/12/05	24610	32.3				
KM8JN72D06U	9/09/05	18114	28.84				
KM8JN72D55U	10/01/04	25743	27.73				
KM8JN72D66U	7/23/05	26182	31.26	25000 N69 OPEN TECH SCANNED FOR CODES AND FOUND C1513 PRESENT. TECH FOUNDN THE BRAKE SWITCH IS SHORTED CAUSING THE ESC LIGHT TO COME ON. TECH REPLACED THE SWITCH AND CAR IS OK AT THIS			
KM8JN72D66U	7/23/05	26182	25				
KM8JN12D46U	11/21/05	9198	30.94	ESC LIGHT ON. TEST SYSTEM. FOUND STOP LAMP SWITCH DEF. REPLACED SWITCH. RETEST. OK.	AIR BAG RECALL	RECALL	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT
KM8JN72D15U	11/16/04	20061	30.66		CHK AND ADVISE, CUSTOMER STATES ENGINE IS MAKING TICING NOISE	C26	LASH ADJUSTER ASS'Y (ALL)RE LASH ADJUSTER ASS'Y (ALL)RE 20061 TESTED ENGINE FOR EXCESSIVE" TICKING" NOISE. FOUND ENGINE MADE UPPER- END NOISE FOR A MINUTE OR TWO WHEN FIRST STARTED COLD. CHECKED OIL LEVEL. OK. ROAD TESTED VEHICLE. RETESTED FOR NOISE NEXT MO
KM8JN72D15U	11/16/04	20061	30.66		CHK AND ADVISE, CUSTOMER STATES CRUISE CONTROL IS INOP	C15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 20063 VERIFIED CONCERN. USING SCHEMATIC, PINPOINT TESTED CIRCUITS AT CRUISE CONTROL ACTUATOR/UNIT AND FOUND CIRCUITS OK FROM CONTROL SWITCH, TO ACTUATOR UNIT. TEST CIRCUITS FROM BRAKE SWITCH AND FOUND VOL
KM8JN72DX6U	12/30/05	16226	28.7		CUSTOMER REQUEST TO PLEASE REPLACE THE BRAKE SWITCH. PER PRIOR DIAGNOSIS. PART IN WILL CALL.	FOUND THAT THE BRAKE SWITCH WAS FAULTY.	REPLACED THE BRAKE SWITCH. TESTED OPERATION ALL OK AT THIS TIME. SEE RO#135881 FOR PRIOR DIAGNOSIS.
KM8JN12D46U	11/21/05	9198	30.94	ESC LIGHT ON. TEST SYSTEM. FOUND STOP LAMP SWITCH DEF. REPLACED SWITCH. RETEST. OK.	C/S ESC LIGHT IS ON, INSTALL SPEC. ORD. PART	N94	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN12B36U	12/30/05	14584	52.54	SCAN ABS SYSTEM. FOUND CODE C1513 - BRAKE LIGHT SWITCH. REPLACED SWITCH. REPAIR COMPLETE. DPSM AUTH# SC40711OK	RECALL 079/AIRBAG COVER	E	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT
KM8JN12B36U	12/30/05	14584	52.54	SCAN ABS SYSTEM. FOUND CODE C1513 - BRAKE LIGHT SWITCH. REPLACED SWITCH. REPAIR COMPLETE. DPSM AUTH# SC40711OK	C/S ESC LIGHT STAYS ON SOMETIMES	ABS DIAG CODE C1513 - BRAKE LIGHT SWITCH	ADD SCAN TOOL TEST ADD SCAN TOOL TEST
KM8JN12D26U	12/20/05	12425	30.36				
KM8JN12D26U	12/20/05	3839	32				
KM8JN72D96U	10/14/05	12152	32				
KM8JN72D17U	6/02/06	1690	30.04				
KM8JN12B36U	12/30/05	14584	52.54	SCAN ABS SYSTEM. FOUND CODE C1513 - BRAKE LIGHT SWITCH. REPLACED SWITCH. REPAIR COMPLETE. DPSM AUTH# SC40711OK	C/S ESC LIGHT STAYS ON SOMETIMES	ABS DIAG CODE C1513 - BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN72D96U	12/19/05	3770	31.56				

KM8JN72D75U	3/19/05	13855	32.16	BRAKE LITE SWITCH SQUEEK INTERMITTANTLY, REPLACED STOP LAMP SWITCH ASSEMBLY	CUSTOMER STATES INSTALL S.O. BRAKE LIGHT SWITCH(SQUEEKING)	BRAKE LIGHT SWITCH SQUEEKS INTERMITTENTLY.	REPLACED STOP LAMP SWITCH ASSEMBLY TO REPAIR.
KM8JN72D46U	5/15/06	3607	32				
KM8JN72D26U	12/27/05	22279	30.04				
KM8JN72D46U	5/15/06	13250	30.04				
KM8JN72D45U	9/24/04	19590	34.5	CUSTOMER STATES BRAKE LIGHTS STAY ON COULD NOT GET THE BRAKE LIGHTS TO STAY ON BUT DID FIND TAHT THE BRAKE LIGHT SWITCH NEEDS ADJUSTING GOING OVER BUMPS THE BRAKE LIGHTS COME ON ADJUSTED LIGHT SWITCH			
KM8JN72D25U	2/26/05	28630	23.1	CHECKED AND FOUND BRAKE SWITCH LOOSE, TIGHTEND SWITCH	CUSTOMER STATES BRAKE LIGHTS WILL NOT SHUT OFF	CHECKED AND FOUND BRAKE SWITCH IS LOOSE.	TIGHTENED SWITCH AND CHECKS OKAY NOW.
KM8JN72DX6U	8/25/05	30750	32.76	SCANNED AND RETRIVED C1511 BRAKE LAMP SWITCH, FOUND SWITCH IS INOP REPLACED SWITCH	CUSTOMER REPORTS ESC LIGHT INTERMITTENTLY COMES ON WHILE DRIVING. TURNS OFF WHEN VEHICLE TURNED OFF	SCANNED AND RETRIEVED CODE C1513, BRAKE LAMP SWITCH. FOUND SWITCH IS INOP.	REPLACED SWITCH TO REPAIR.
KM8JN72DX6U	8/25/05	30750	32.76	SCANNED AND RETRIVED C1511 BRAKE LAMP SWITCH, FOUND SWITCH IS INOP REPLACED SWITCH	CUSTOMER REPORTS WINDSHIELD SPRAYER ON RIGHT SIDE INOP	FOUND SPRAY NOZZLES ARE PLUGGED.	UNPLUGGED NOZZLES.
KM8JN12D15U	11/16/04	23537	30.04				
KM8JN72DX6U	10/11/05	20593	32				
KM8JN72D07U	8/17/06	1567	30.04				
KM8JN72B67U	11/01/06	12	30.04				
KM8JN72D35U	4/28/05	22622	32.44	SCANNED ESP AND FOUND C1513 BRAKE LAMP SWITCH ALSO BRAKE LIGHTS NOT COMING ON, TESTED BRAKE SWITCH FOUND INOP, REPLACED BRAKE SWITCH	CUSTOMER STATES ESP OFF LIGHT COMES ON AND WONT SHUT OFF INTERMITANTLY	SCANNED ESP AND FOUND CODE C1513, BRAKE LAMP SWITCH. BRAKE LIGHTS ARE NOT COMING ON. BRAKE SWITCH IS INOP.	REPLACED BRAKE SWITCH.
KM8JN72D86U	12/06/05	13093	32.44	TEST DROVE AND FOUND CRUISE CONTROL SWITCH INTERMITANTLY WORKING CHECKED AND FOUND BRAKE SWITCH INOP, REPLACED BRAKE SWITCH	CUSTOMER REPORTS CRUISE CONTROL WILL NOT ACTIVATE PLEASE CHECK AND ADVIS	TEST DROVE AND FOUND CRUISE SWITCH INTERMITENTLY WORKING. CHECKED AND FOUND BRAKE SWITCH IS INOP.	REPLACED BRAKE SWITCH TO REPAIR.
KM8JM12B87U	10/19/06	2988	30.04				
KM8JM12B87U	8/22/06	2259	30.04				
KM8JM12B87U	8/22/06	332	32				
KM8JM72B55U	7/05/05	15670	34.69				
KM8JN12D66U	8/18/05	23424	32.76	SCAN TESTED HAS CODE ESC C1513 BRAKE SWITCH, CHECKED CONNECTOR AT BRAKES LITE SWITCH CHECKS OK, REPLACED BRAKE LITE ROAD TESTED OK.	CUSTOMER STATES ESC OFF LIGHT CAME ON 1 TIME	SCAN TESTED HAS CODE ESC V1513 BREKE LIGHT SWITCH CHECKS OK.NEEDS SWITCH INTERNAL CONCERN.	REPLACED BRAKE LITE SWITCH ASSMEBLY CLEARED CODE AND ROAD TESTED OK.
KM8JN72D96U	10/17/05	13191	34.4	BRAKE LAMP SWITCH INTERNAL FAILURE , REPLACED BRAKE LAMP SWITCH TESTED OPERATION AND WAS WORKING	CUSTOMER REPORTS BRAKE LAMPS INOP	BRAKE LAMP SWITCH HAS AN INTERNAL FAILURE.	REPLACED BRAKE LAMP SWITCH AND TESTED OPERATION. WORKING AS DEISIGNED.
KM8JN72D15U	5/19/05	23444	36.66	CUSTOMER STATES THAT THE ESP LIGHT KEEPS COMING ON AND GOING OFFSCAN TOOL INDICATES C1513-BRAKE LIGHT INTERNAL SHORTREMOVE AND REPLACE BRAKE LIGHT SWITCH	CUST STATES THAT THE ESP LIGHT KEEPS COMING ON AND GOING OFF	CHECKED OUT WITH THE HI-SCAN, CODE C1513 BRAKE LIGHT SWITCH	INSTALLED NEW BRAKE LIGHT SWITCH
KM8JN72D56U	12/28/05	14104	32.14				
KM8JN72D95U	5/20/05	23908	32.46				
KM8JN72D36U	10/28/05	13715	22.8	ESP LIGHT WILL COME ON WHEN DRIVING INTERMITTANTLY. HAS CODE C1513 STOP LAMP SWITCH CIRCUIT. FOUND STOP LAMP SWITCH OUT OF ADJUSTMENT. ADJUSTED SWITCH AND RETESTED.			
KM8JN12D26U	9/27/05	8495	36.34	CUSTOMER STATES THAT THE BRAKE LIGHTS ARE INOPVERIFIED CONCERN, FOUND AN OPEN SHORT IN SWITCH REMOVE AND REPLACE BRAKE	CUST STATES THAT THE BRAKE LIGHTS ARE INOP	CHECKED AND FOUND THAT THE BRAKE LIGHT SWITCH HAS AN OPEN SHORT	REMOVE AND REPLACE BRAKE LITE SWITCH
KM8JN12DX6U	8/11/05	16434	36.55	16434 CONFIRMED COMPLAINT. STEPPED ON BRAKE TPDAL SEVERAL TIMES LIGHT WOULD COM AND BRAKE LIGHTS WOULDD NOT SWITCH WOULD NOT MAKE CONTACT, NEED TO REPLACE SWITCH. REPLACED SWITCH OK NOW			
KM8JN12D46U	12/31/05	11223	34.91	11223 CHECK ESC CODE = C1513 STOP LIGHT SWITH MAL. REPLACEMENT OF STOP LIGHT SWITH ASSY & CLEAR CODE. O.K.NOW.			
KM8JN72D95U	1/25/05	11938	30.96	C/S CRUISE CONTROL WILL NOT SET AT TIMES. WORKS INTERMITTANTLY.. FOUND FAULTY SWITCH - OPEN/SHORT. REPLACED BRAKE SWITCH			
KM8JM12B35U	6/17/05	19997	34.56				
KM8JN72D85U	6/10/05	26886	25.94				
KM8JN12D95U	11/18/04	16063	33.06				
KM8JN12D56U	11/15/05	3121	31.95				
KM8JM12B26U	5/25/06	13174	34.91	13174 FOUND CODES C1235 PRI PRESS SNSR, C1513 BRAKE SWICH PRI PRESS SNSR CODE CAUSED BY BRAKE SWITCH INOPT NEED TO REPLACE BRAKE SWITCH AT THIS TIME/REPLACED SWITCH OK NOW			

KM8JN12D26U	8/12/05	16359	36.55	16359 SCANNED FOR CODES, FOUND PO C1513 BRAKE LAMP SWITCH. CHECKED BRAKE LIGHT SWITCH CONNECTING. NEED TO REPLACE SWITCH. RPLACED SWITCH BRAKE LIGHT OK AT THIS TIME			
KM8JN12D26U	8/12/05	25838	34.91	25838 FOUND CODE FOR BRAKE SWITCH. NEED TO REPLACE SWITCH. INSTALLED BRAKE LAMP SWITCH OK AT THIS TIME.			
KM8JN72D27U	6/30/06	1965	34.56				
KM8JN72D86U	9/16/05	17238	36.8				
KM8JN12D56U	10/25/05	31928	34.84				
KM8JM12B65U	1/03/05	24443	33.19				
KM8JN72D75U	11/06/04	42762	33.48	42762 FOUND TWO CODES 1273 AND 1513. HAD TO ORDER BRAKE PRESSURE SWITCH. AND REPLACED BRAKE LIGHT SWITCH.			
KM8JN72D76U	9/14/05	59244	34.91	59244 DIAGNOSE CODE C1513 BREAK SWITCH NEED REPLACED REPLACED BREAK SWITCH AND ERASED THE CODE FOR THE SWITCH DONE			
KM8JN12D06U	4/19/06	2944	34.59	2944 REMOVED AND REPLACED THE BRAKE SWITCH.			
KM8JN12D6U	8/12/05	13601	36.8				
KM8JM12B25U	6/15/05	29800	34.84				
KM8JN12DX6U	8/12/05	18086	34.84				
KM8JN12D76U	7/26/05	26509	35.16				
KM8JN72D47U	6/30/06	1758	34.91	1758 CHECK ESC CODE = C1513 BRAKE LAMP SWITCH / C1235 PRESSURE SENSOR(1ST)-ELECT REPLACEMENT OF BRAKE LIGHT SWITCH ASSY & CLEAR CODE. O.K.NOW.			
KM8JM12B66U	7/15/05	28833	34.91	28833 C1513 BRAKE LAMP SWITCH FAILED FOUND CODE C1513 = SUGGESTED REPL. BRAKE LAMP SWITCH = REPL. BRAKE LAMP SWITCH = CLEAR CODE = NO DTC = O.K			
KM8JN72D05U	6/10/05	18157	39.36		CUSTOMER STATES BRAKE LIGHTS INOP AT TIMES	15	BRAKE LAMP SWITCH SHORTING - REPLACED BRAKE LAMP SWITCH ASSY-STOP LAMP RE
KM8JN72D15U	10/14/04	370	35.97				
KM8JN12D25U	9/11/04	19217	30.22	CRUISE INOP. FOUND BAD VOLTAGE AT PIN 1 FOR BRAKE SWITCH. RPL BRAKE SWITCH	CK. CRUISE CONTROL INOP (PARTS HERE)	MALFUNCTION	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 19217 CRUISE INOP CHECK CRUISE ACTUATOR INPUTS. PIN TEST FOR VOLTAGE AND RESISTANCE CANNOT FIND BAD WIRING TO ACTUATOR. REPLACED ACTUATOR. TEST DRIVE. PROB STILL EXISTS. RETEST ACTUATOR INPUTS. FOUND B
KM8JN12D25U	9/11/04	19217	30.22	CRUISE INOP. FOUND BAD VOLTAGE AT PIN 1 FOR BRAKE SWITCH. RPL BRAKE SWITCH	CK. CRUISE CONTROL INOP (PARTS HERE)	MALFUNCTION	CRUISE CONTROL ACTUATOR ASSY RE CRUISE CONTROL ACTUATOR ASSY RE 19217 CRUISE INOP CHECK CRUISE ACTUATOR INPUTS. PIN TEST FOR VOLTAGE AND RESISTANCE CANNOT FIND BAD WIRING TO ACTUATOR. REPLACED ACTUATOR. TEST DRIVE. PROB STILL EXISTS. RETEST ACTUATOR IN
KM8JN12D46U	2/23/06	12735	39.36		CUSTOMER STATES VEHICLE WILL NOT START - TURN KEY NOTHING HAPPENS - TOW IN	15	BATTERY FAILED LOAD TEST - REPLACED WEAK BATTERY BATTERY ASSY RE
KM8JN12D46U	2/23/06	12735	39.36		CUSTOMER STATES VEHICLE WILL NOT START - TURN KEY NOTHING HAPPENS - TOW IN	15	BATTERY ASSY ADD SCAN TOOL OPERATION BATTERY ASSY ADD SCAN TOOL OPERATION
KM8JN12D46U	2/23/06	12735	39.36		CUSTOMER STATES PERFORM OPEN DRIVERS SIDE AIRBAG MODULE COVER REPLACEMENT CAMPAIGN	15	REPLACED DRIVERS SIDE AIRBAG MODULE COVER PER CAMPAIGN INSTRUCTIONS DRIVERS AIRBAG MODULE REPLACEMENT
KM8JN12D05U	5/21/05	49279	33.36				
KM8JN72D06U	10/12/05	39272	40.86		CUST STATES THE ESC LIGHT IS ON AND THE BRAKE LIGHTS ARE INOP	FOUND CODE C1513. BRAKE SWITCH INTERNALLY FAILED	REPLACED THE BRAKE LIGHT SWITCH
KM8JN12D35U	6/15/05	25208	40.86	REPLACED BRAKE LIGHT SWITCH TEST DROVE VEHICLE, NO PROBLEMS AT THIS TIME			
KM8JN12D35U	5/14/05	31621	69.9				
KM8JN12D46U	2/23/06	12735	39.36		CUSTOMER STATES ESC LAMP WILL NOT GO OFF INTERMITTENTLY	15	C1513 BRAKE LAMP SWITCH OPEN CIRCUIT - REPLACED SWITCH ASSY-STOP LAMP RE
KM8JN72D86U	1/23/06	28144	54.66	THE TECHNICIAN RETRIEVED AND CLEARED THE FOLLOWING CODE: C1513 - BRAKE SWITCH CIRCUIT. HE INSTALLED A NEW BRAKE SWITCH AND CONFIRMED THE REPAIR.			
KM8JM12B55U	6/28/05	22728	33.34		DR/AIRBAG MOD REPL	079 RECALL COMPLETED	DR/AIRBAG MOD REPL DR/AIRBAG MOD REPL REPLACED AIR BAG COVER PER 079 RECALL
KM8JM72B95U	6/18/05	14768	35.16				
KM8JN72D05U	9/13/04	30402	32.76				
KM8JN72D05U	9/13/04	30402	29.99		CUSTOMER STATES ESP LIGHT IS ON IN DASH//CHECK ADVISE	C1513 STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH
KM8JN72D05U	9/13/04	30402	29.99		CUSTOMER STATES BOTH BRAKE LIGHTS ARE OUT//CHECK ADVISE	DEFECTIVE STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH

KM8JM12B55U	6/28/05	22728	33.34		CUST STATES ESP OFF LIGHT IS ON NOTICED WHEN A/C IS ON INTERM.	C1513 BRAKE SWITCHM C1260 ANGLE SNSR ORDERED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE GDS SCAN CODES C1260 STEERING SNSR, P1513BRAKE SWITCH, REPLACED BRAKE SWITCH, ORDEREDSTEERIN G ANGLE SENSOR.
KM8JN72DX6U	7/22/05	11763	33.34		CUST STATES ESC LIGHT WILL GO ON INTHE MORNING AND OFF HAPPENED 4X	C1513 BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE GDS SCAN CODES C1513 BRAKE SWITCH CIRCUIT,REPL ACED BRAKE SWITCH CLEARED CODE ANDRETEST OK
KM8JN72D76U	11/28/05	13373	33.66				
KM8JN72D26U	1/05/06	15649	28.24	15649 FOUND BRAKE SWITCH STICKING AT TIMES REPLACED SWITCH TEST DROVE EVERYTHING OK AT THIS TIME+	CUSTOMER STATES THE CRUISE CONTROL DOESN'T WORK AT TIMES.	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 15649 FOUND BRAKE SWITCH STICKING AT TIMESREPLACED SWITCH TEST DROVE EVERYTHING OK ATTHIS TIME+
KM8JN72D26U	1/05/06	15649	28.24	15649 FOUND BRAKE SWITCH STICKING AT TIMES REPLACED SWITCH TEST DROVE EVERYTHING OK AT THIS TIME+	INSTALL SOP CAP ON REAR WIPER	09	REPLACE WIPER CAP3 REPLACE WIPER CAP3 15649 REPLACED REAR WIPER CAP MISSING
KM8JN12D65U	9/14/04	11411	30.52				
KM8JM12B86U	8/23/05	15176	33.66		CUST STATES CHECK ENGINE LIGHT IS ON	P0111 REPROGRAMED PCM PER TSB 06-36-005	JM ECM REPROGRAMMING (TSB# 06-36-005) JM ECM REPROGRAMMING (TSB# 06-36-005) GDS SCAN CODES P0111. REPROGRAM PER TSB06-3605 TSB 06-36-005.
KM8JM12B86U	8/23/05	15176	33.66		CUST STATES ESC OFF LIGHT IS ON	C1513 OPEN CIRCUIT BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE GDS SCAN C1513 BRAKE LAMPS SWITCH, INSPECTEDSW ITC H ADJUSTMENT OK, BENCH TEST SWITCHINTERMIT OPEN CIRCUIT. REPLACED BRAKE LAMP SWITCH AND CL EARED CODE
KM8JN12D96U	7/20/05	29901	33.66		CUST STATES ESC OFF LIGHT KEEPS COMING ON & WON'T GO OFF UNTIL YOU TURN THE CAR OFF	FAULTY BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE CHKD W/SCANTOOL C1513 BRAKE SWITCH CIRCUIT R&RB RAKE SWITCH TO CORRECT CONCERN
KM8JN72D96U	9/14/05	21876	56.46	SCANN TIME TO CHECK FOR CODES. INSPECTED AND FOUND CODE C1516			
KM8JN72D36U	8/17/05	8418	30.05	VEHICLE'S ESC LIGHT WAS ILLUMINATED,FOUND FAULT IN STOP LAMP SWITCH(OPEN/SHORT)REPLACE D SWITCH, VEHICLE OPERATING AS DESIGNED			
KM8JN72D96U	12/06/05	26628	28.41	REPLACED BRAKE LIGHT SWITCH DUE TO NO CRUISE CONTROL,TEST SYSTEM PER TECH LINE REF#3163335			
KM8JN12D76U	12/19/05	28077	33.66				
KM8JN72D56U	10/07/05	24171	33.34		CUST STATES ESC OFF LIGHT KEEPS COMING ON AND OFF	C1513 BRAKE SWITCH CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE GDS SCAN CODES C1513 BRAKE SWITCH CIRCUIT,INSP ECTED BRAKE SWITCH FOUND INTERMIT OPENCIRCUIT. REPLACED BRAKE SWITCH CLEARED CODE
KM8JN12D26U	10/14/05	18354	33.66		CUST STATES ESC OFF LIGHT COMES ON FOR NO REASON (SOP)	BRAKE SWTICH NO GOOD	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE SEE PREVIOUS DIAG. REPLACED BRAKE LIGHTSWITCH TO CORRECT CONCERN
KM8JM12B06U	7/15/05	24932	47.16	CUSTOMER STATES ECS LIGHT STAYS ON,PULLED CODES C1513 STORED TESTED SYSTEM AND FOUND STOP LIGHT SWITCH TO BE BAD REPLAED RESET CODE OK AT THIS TIME			
KM8JM72B47U	11/02/06	4551	31.69	ESC LIGHT COMES ON AND STAYS ON, WHEN LIGHT IS ON THERE ARE NO BRAKE LIGHTS, COMPLETED CHECKOUT, CODE B1513, BRAKE LIGHT SWITCH MALFUNCTION, OPEN CIRCUIT DETECTED IN THE BRAKE LIGHT SWITCH, REPLACED THE BRAKE LIGHT SWITCH, CLEARED CODE AND RETESTED, RETES	CUSTOMER STATES THE ESC LIGHT COMES ON AND STAYS ON, WHEN THE LIGHT IS ON THERE ARE NO BRAKE LIGHTS.	COMPLETED CHECKOUT, TROUBLE CODE- B1513, BRAKE LIGHT SWITCH MALFUNCTION. OPEN CIRCUIT DETECTED IN THE BRAKE LIGHT SWITCH	REPLACED THE BRAKE LIGHT SWITCH, CLEARED CODE AND RETESTED, VEHICLE RETESTED OKAY AT THIS TIME.
KM8JN72D35U	5/13/05	25522	33.5	BRAKE SWTICH WAS OPEN	C/S WHEN TURNING RIGHT CUSTOMER FEELS HARD VIBRATION	BRAKE PRESSURE SWITCH WAS OPEN	R AND R SWITCH
KM8JN12DX6U	10/27/05	25018	33.34		CUST STATES ESC OFF LIGHT COMES ON & OFF	BRAKE SWITCH MALFUNCTION	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACED BRAKE SWITCH TO CORRECT CONCERN
KM8JN12D65U	4/15/05	38032	33.34		CUST STATES ESP LIGHT IS STAYING ON(SOP)	C1513 BRAKE SWITCH CIRCUIT.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE SCAN CODES C1513 BRAKE SWITCH CIRCUIT, C1237PR IMARY PRESSURE SNSR SIGNAL. INSTALL SOPBRAKE L AMP SWITCH. ORDERED BRAKE PRESSURESENSOR
KM8JN12D66U	12/07/05	11272	58.35	CRUISE NOT WORKING; REPLACED CRUISE CONTROL			

KM8JN12D85U	4/06/05	27774	33.5	BRAKE LIGHT SWITCH HAD INTERNAL SHORT; REPLACED SWITCH	CUSTOMER STATES NO BRAKE LIGHTS	BRAKE LIGHT SWITCH HAD INTERNAL SHORT	REPLACED SWITCH
KM8JM12B06U	1/07/06	13305	33.34	VERIFIED CONCERN RAN SCAN DIAG AND CALLED TECH ASSISTANCE LINE ISOLATE TO BRAKE SWITCH. REPLACED SWITCH CLEARED CODE TEST OK			
KM8JM12B56U	8/23/05	15525	34.85	C/R THAT THE BRAKE LIGHTS ARE NOT WORKING INSPECTED VEHICLE FOUND BRAKE LIGHTS INOP. INSPECTED ALL FUSES AND CONNECTIONS CHECKED BULBS AND TESTED BRAKE SWITCH FOUND BRAKE SWITCH TO BE BAD NECESSARY TO REPLACE REPLACED BRAKE SWITCH TEST DROVE FOUND BRAKE	CUSTOMER STATES THE BRAKE LIGHTS ARE NOT WORKING, PLEASE INSPECT AND ADVISE	INSPECTED VEHICLE, FOUND BRAKE LIGHTS NOT WORKING, INSPECTED ALL FUSES AND CONNECTION, CHECKED BULBS, AND TESTED BRAKE SWITCH, FOUND BRAKE SWITCH TO BE BAD, NECESSARY TO REPLACE SWITCH	REPLACED BRAKE SWITCH, TEST DROVE, FOUND BRAKE LIGHTS OPERATING NORMALLY, VEHICLE OPERATING NORMALLY AT THIS TIME
KM8JN72D25U	6/01/05	14330	34.54	BRAKE LIGHT SWITCH MALFUNCTION			
KM8JN72D46U	8/16/05	34651	35.29	34651 BRAKE LIGHT SWITCH CHECKED AND FOUND CODE B1513 BRAKE LAMP SWITCH. CHECKED AND FOUND WHILE DEPRESSING BRAKE PEDAL INTERMITTENTLY BRAKE LIGHT WON'T COME ON. REPLACED BRAKE LAMP SWITCH CLEARED CODE AND TEST DROVE OK.			
KM8JN72D86U	7/29/05	13377	37.25	CHECKED AND FOUND BRAKE SWITCH HAD AN INTERNAL FAILURE			
KM8JN12D55U	10/06/04	47238	31.95	SCAN C1513, FOUND BRAKE SWITCH SHORTING, RPLCD SWITCH, OK AT THIS TIME			
KM8JN72D66U	10/23/05	26510	33.34	FOUND INTERMIT OPEN CIRCUIT IN BRAKE SWITCH, RPLCD SWITCH, OK AT THIS TIME			
KM8JM12B46U	7/15/05	20323	36.36	BRAKE LIGHT SWITCH IN TERNAL OPEN REPLACE SWITCH	CUSTOMER STATES BRAKE LIGHTS INOP	OPEN CIRCUIT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE BRAKE LIGHT SWITCH IN TERNAL OPEN REPLACESWITCH
KM8JM12B26U	7/09/05	41869	31.26				
KM8JN72D26U	12/13/05	16514	35.29				
KM8JM72B36U	11/14/05	26996	35.61	26996 BRAKE LIGHT SWITCH CHECKED AND FOUND CODE C1513 BRAKE SWITCH CIRCUIT. CHECKED AND FOUND BRAKE LIGHT SWITCH INTERNAL FAILURE REPLACED TEST DROVE OK.			
KM8JN72D55U	5/19/05	9042	36.8	CHECKED AND FOUND CODE C15B, FOUND FAILED BRAKE LIGHT SWITCH, REPLACED SWITCH CLEARED CODE AND			
KM8JN12D76U	7/29/05	19405	31.26				
KM8JM12B35U	6/14/05	13338	32.9		C/S ESP LIGHT STAYS ON	INTERNAL FAILURE IN BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D46U	9/02/05	15786	29.83				
KM8JN72D76U	3/07/06	21898	35.61	21899 BRAKE SWITCH SCAN FOUND C1513 CHECK FOUND BRAKE SWITCH INTERNAL FAILURE REPLACED OK			
KM8JN72DX6U	10/28/05	6366	37.25	CHECKED AND FOUND C1513 BRAKE LIGHT SWITCH ERROR, REPLACED BRAKE LIGHT SWITCH, CLEARED CODE AND			
KM8JN72D96U	12/16/05	9599	37.26	9600 BRAKE LIGHT SWITCH CHECKED AND FOUND ESC LIGHT WAS ON. SCAN FOUND CODES C2402-MOTOR ELECTRICAL AND C1513-BRAKE LAMP SWITCH. REMOVED AND REPLACED SWITCH. CHECKED AND FOUND OK.			
KM8JM12BX5U	7/01/05	17539	30.66		CUSTOMER STATES THAT INTERMITTANTLY ESP LIGHT SHOWS OFF CAN NOT GET TO GO OFF EVEN WHEN PUSH BUTTON	F	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY
KM8JN12D85U	4/09/05	26103	33.05		CUSTOMER STATES WHEN SHIFTING ON MANUAL MODE AT TIMES HAVE TO SHIFT TWICE TO SHIFT	DIAGNOSE VEHICLE AND DROVE AROUND WITH SCANNER VEHICLE WORKING AS DESIGNED	NO WORK DONE
KM8JN12D85U	4/09/05	26103	33.05		CUSTOMER STATES ESP LIGHT ON	DIAGNOSE VEHICLE AND FOUND C1513 BRAKE LAMP SWITCH	NECESSARY TO REPLACE BRAKE LAMP SWITCH VEHICLE WORKING AS DESIGNED
KM8JN72D26U	9/23/05	2817	78.88	CHECKED AND CONFIRMED CUSTOMERS CONCERN, FOUND CODE C1513 RELATING TO BRAKE LIGHT CIRCUIT, FOUND INTERNAL OPEN IN THE BRAKE LIGHT SWITCH REPLACED SWITCH, AND RECHECKED NOW OPERATING TO DESIGNED INTENT.. F			
KM8JN72D26U	9/23/05	2817	78.88	CHECKED AND CONFIRMED CUSTOMERS CONCERN, FOUND CODE C1513 RELATING TO BRAKE LIGHT CIRCUIT, FOUND INTERNAL OPEN IN THE BRAKE LIGHT SWITCH REPLACED SWITCH, AND RECHECKED NOW OPERATING TO DESIGNED INTENT.. F			

KM8JN72D86U	10/21/05	3952	36.8	CHECKED AND FOUND CODE C1513 BRAKE LAMP SWITCH. CHECKED AND FOUND BRAKE LIGHT SWITCH INTERNAL FAILURE. REPLACED SWITCH AND CLEARED TROUBLE CODE.			
KM8JN12D85U	4/09/05	26103	33.05		CUSTOMER STATES PASSENGER SIDE LIGHT STAYS ON WHEN ADULT SITTING ON PASSENGER SIDE CK AND ADVISE	DIAGNOSE VEHICLE AND FOUND NO CODES NO PROBLEM FOUND	NO WORK DONE
KM8JN12D85U	4/09/05	51939	31.41	REPLACED THE BRAKE SWITCH TO CORRECT CONCERN	CUSTOMER STATES SHIFTRONIC IS INOPERATIVE AND WOBBLY	INSPECTED AND FOUND PROBLEM IS THE SWITCH HOUSING IS INOPERATIVE	REMOVED RADIO COVER AND SHIFTER TO REPLACE THE SWITCH HOUSING TO CORRECT CONCERN
KM8JN12D85U	4/09/05	51939	31.41	REPLACED THE BRAKE SWITCH TO CORRECT CONCERN	CUSTOMER STATES "ESP" LIGHT CAME ON 2 TIMES IN A WEEKS TIME	INSPECTED AND FOUND THE PROBLEM IS THE BRAKE SWITCH, USED SCANNER FOUND CODE C1513 BRAKE SWITCH LAMP	REPLACED THE BRAKE SWITCH TO CORRECT CONCERN
KM8JN72D06U	11/07/05	1193	37.25	SCANNED TRACTION CONTROL SYSTEM FOR CODES AND FOUND BRAKE LIGHT SWITCH HAS INTERNAL FAILURE. REPLACED BRAKE LIGHT SWITCH AND RECHECKED FOUND EVERYTHING WORKING PROPERLY			
KM8JN72D36U	7/27/05	20561	37.26	20561 ESC LIGHT ESC OFF LIGHT STAY ON, SCANNED FOR CODE C1513 BRAKE SWITCH CHECK AND FOUND BRAKE SWITCH INTERNAL FAILURE, REPLACE SWITCH AND RESET LIGHT			
KM8JN72D45U	12/06/04	37458	33.9	37459 BRAKE LIGHT SWITCH CHECKED AND FOUND ESP LIGHT ON. SCAN FOUND C1237 AND C1513. FOUND FAULTY BRAKE LIGHT SWITCH. REMOVED AND REPLACED BRAKE LAMP SWITCH AND RECHECKED FOUND GOOD.			
KM8JN12D85U	4/09/05	51939	31.41	REPLACED THE BRAKE SWITCH TO CORRECT CONCERN	CUSTOMER STATES "PASSENGER AIRBAG OFF" LIGHT STAYS ON EVEN WHEN SOMEONE IS SEATED IN PASSENGER SEAT	UNABLE TO VERIFY CONCERN AT THIS TIME	NO REPAIR PERFORMED
KM8JM12B95U	6/21/05	17765	33.05		CUST STATES VEH WON'T START	INSPECTED VEHICLE COULD NOT DUPLICATE CONCERN AT THIS TIME STARTED VEHICLE SEVERAL TIMES AND NO PROBLEM FOUND	COULD NOT DUPLICATE CONCERN AT THIS TIME
KM8JM12B95U	6/21/05	17765	33.05		CUSTOMER STATES "ESP" LIGHT COMES ON	INSPECTED VEHICLE FOUND CODE C1513 BRAKE LAMP SWITCH MALFUNCTION NECESSARY TO REPLACE BRAKE	REPLACED BRAKE SWITCH AND CORRECTED CONCERN
KM8JM12B26U	4/24/06	9925	39.8		CUSTOMER STATES DRIVERS DOOR PANEL FABRIC COMING	FOUND DOOR PANEL COMING	SPECIAL ORDERED DOOR PANEL
KM8JM12B26U	4/24/06	9925	39.8		ELECTRICAL PROBLEMS CUSTOMER STATES WHILE DRIVING PARKING BRAKE LIGHT COMES ON ODOMETER STOPS READING AND SMELLS WIRES BURNING, INTERMITTENT.	COULD NOT DUPLICATE DURING TEST DRIVE SCANNED FOR CODES FOUND C1513 TEST BRAKE SWITCH CIRCUIT-NORMAL	REPLACED BRAKE SWITCH AND CLEARED CODES. VEHICLE OPERATING AS DESIGNED AT THIS TIME
KM8JN72D66U	12/20/05	11671	37.84				
KM8JN12D66U	11/29/05	27587	38.16		PERFORM 34 POINT COURTESY INSPECTION	PLEASE REFER TO ATTACHED SHEET	COURTESY INSPECTION COMPLETED
KM8JN72DX6U	10/20/05	24081	31.41	R/R BRAKE SWITCH WORKS AS DESIGNED	CUST STATES BRAKE LIGHTS ARE INOP	FOUND LAMPS INOP CAUSED BY INTERNAL FAILURE OF BRAKE SWITCH	R/R BRAKE SWITCH WORKS AS DESIGNED
KM8JN72D65U	9/18/04	51848	31.41		CUST STATES TRANS GETS STUCKED ON PARK	CHECK CONCERN FOUND BRAKE SWITCH LIGHT NOT WORKING	REPLACED BRAKE SWITCH TO CORRECT CONCERN
KM8JN72D65U	9/18/04	51848	31.41		CUST STATES ESC LIGHT IS ON	TEST DROVE 10 MILES NO ESC LIGHT ON	RELATE TO JOB #1
KM8JN12D66U	11/29/05	27587	38.16		CUSTOMER STATES VEHICLE HAS BEEN STALLING THIS PAST WEEK STALLED 3 TIMES LAST NIGHT. VEHICLE WILL IMMEDIATELY START UP AFTER STALLING OKAY. CUSTOMER ALSO NOTED VEHICLE HAD SLIGHT HESITATION WHEN ACCEL FROM A DEAD STOP, HESITATED 3 TIMES ON THE WAY HERE TO	SCANNED FOR CODES. NO CODES PRESENT. PERFORMED FUEL SYSTEMS TEST	FOUND FUEL PASSED BOTH TESTS. UNABLE TO DUPLICATE CUSTOMER'S CONCERN AT THIS TIME. CUSTOMER TO RESCHEDULE FOR FURTHER DIA
KM8JN12D66U	11/29/05	27587	38.16		CUSTOMER STATES ESC LIGHT COMES ON AND OFF	VERIFIED CUSTOMER'S CONCERN, FOUND BRAKE SWITCH MALFUNCTION	REMOVED AND REPLACED BRAKE LIGHT SWITCH WITH NEW
KM8JN72D65U	9/18/04	51848	31.41		CUST STATES ABS LIGHT IS ON	TEST DROVE 10 MILES OK NO ABS LIGHT COME ON	RELATE TO JOB #1
KM8JN72D16U	11/25/05	22068	31.41				
KM8JN12DX5U	4/16/05	31704	31.09		CUST STATES BRAKE LIGHTS ARE INOP	SWITCH STOP BRAKE BROKEN	REPLACED STOP SWITCH BRAKE
KM8JN12D56U	8/17/05	9906	39.8		CUSTOMER STATES ESC LIGHT HAS COME ON INTERMITTENTLY, LAST TIME ON WAS ABOUT 3 WEEKS AGO. CHECK AND ADVISE.	FOUND CODE C1513 BRAKE LAMP SWITCH. TESTED CIRCUIT FOUND IT TO BE NORMAL.	REPLACED SWITCH, CLEARED CODES AND RETESTED. NO CODES RETURNED.
KM8JM12B65U	4/12/05	29703	37.84		PERFORM 34 POINT COURTESY INSPECTION	PLEASE REFER TO ATTACHED SHEET	COURTESY INSPECTION COMPLETED
KM8JM12B65U	4/12/05	29703	37.84		I UNDERSTAND THAT PLANET HYUNDAI WILL DO EVERYTHING POSSIBLE TO SERVICE MY VEHICLE TODAY BUT WITHOUT A SCHEDULED		
KM8JN12D16U	10/11/05	25820	204.07	INSPECT AND FOUND CODE C1515 BRAKE SWITCH IS THE PROBLEM AND SHIFTER IS BROKEN REMOVED CENTER FACIA AND SHIFTER TO REPLACE THE BRAKE SWITCH AND KEY LOCK CAM	CUSTOMER STATES SHIFT LEVER CAN BE MOVED WITH ENGINE OFF AND BRAKE PEDAL NOT BEING APPLIED	INSPECT AND FOUND THE CODE C1515 BRAKE SWITCH IS THE PROBLEM AND SHIFTER IS BROKEN	REMOVED THE CENTER FACE AND SHIFTER TO REPLACE THE BRAKE SWITCH AND KEY LOCK CAM. AND CORRECTED PROBLEM

KM8JN12D16U	10/11/05	25820	204.07	INSPECT AND FOUND CODE C1515 BRAKE SWITCH IS THE PRBLEM AND SHIFTER IS BROKEN REMOVED CENTER FACIA AND SHIFTER TO REPALCE THE BRAKE SWITCH AND KEY LOCK CAM	CUSTOMER STATES PILLAR POST BETWEEN PASSENGER FRONT/REAR DOORS HAS WATER STAINS ON MATERIAL	INSPECT AND FOUND THE PROBLEM IS THE ROOF RACK IS LOOSE	TIGHTEN THE BOLTS AND CORRECTED PROBLEM
KM8JN12D16U	10/11/05	25820	204.07	INSPECT AND FOUND CODE C1515 BRAKE SWITCH IS THE PRBLEM AND SHIFTER IS BROKEN REMOVED CENTER FACIA AND SHIFTER TO REPALCE THE BRAKE SWITCH AND KEY LOCK CAM	CUSTOMER STATES CONSOLE FRONT CUPHOLDER DOES NOT HOLD ITEMS IN PLACE (PART IN)	INSPECT AND FOUND THE PROBLEM IS THE CUP HOLDER DOSE NOT HOLD	REMOVE THE CENTER CONSOLE TO REPLACE THE CUP HOLDER AND CORRECTED PROBLEM
KM8JM12B65U	4/12/05	29703	37.84		CUSTOMER STATES VEHICLE HAS NO BRAKE LIGHTS ADVISE.	BRAKE SWITCH SHORTED	REPLACED BRAKE SWITCH RETESTED AND VERIFIED PROEPR OPERA TION FOUND CENTER BRAKE LIGHT BROKEN PHYSICAL DAMAGED NOT COVERED UNDER WARRANTY
KM8JM12B65U	4/12/05	29703	37.84		079 DRIVER ISDE AIR BAG COVER	PERFORMED CAMPAIGN AS PER HYUNDAI SPECS	RECALL COMPLETE
KM8JN12D27U	6/05/06	5513	37.84		CUSTOMER HAD TO JUMP VEHICLE MULTIPLE TIMES	VERIFIED CUSTOMER'S CONCERN, PERFORMED MIDTRONICS TEST. FOUND ALTERNATOR LOW VOLTAGE	REPLACED ALTERNATOR AND RETESTED. AS PER TECH LINE, REPLACEDWITH NEW BATTERY
KM8JN12D16U	10/11/05	25820	204.07	INSPECT AND FOUND CODE C1515 BRAKE SWITCH IS THE PRBLEM AND SHIFTER IS BROKEN REMOVED CENTER FACIA AND SHIFTER TO REPALCE THE BRAKE SWITCH AND KEY LOCK CAM	CUSTOMER STATES CENTER CONSOLE LID DOES NOT LATCH (PART IN)	INSPECT AND FOUND PROBLEM IS ARM REST DONT STAY CLOSE	REMOVE THE CENTER CONSOLE TO REPLACE THE ARM REST AND CORRECTED PROBLEM
KM8JN12D16U	10/11/05	25820	204.07	INSPECT AND FOUND CODE C1515 BRAKE SWITCH IS THE PRBLEM AND SHIFTER IS BROKEN REMOVED CENTER FACIA AND SHIFTER TO REPALCE THE BRAKE SWITCH AND KEY LOCK CAM	CUSTOMER STATES RUBBER GROMMET AT DRIVER FRONT DOOR EDGE (INSIDE) IS PINCHED	INSPECT AND FOUND THE PROBLEM IS THE BOTTOM PLASTIC OFF THE D/DOOR IS PINCHED	REPLACED THE PLASTIC BOTTOM
KM8JN12D27U	6/05/06	5513	37.84		CUSTOMER STATES RUNNING LIGHT SWITCH SEEMS TO BE STICKING INTERMITTENTLY. FOUND RUNNING LIGHTS WILL BE ON, EVEN WHEN KEY IS REMOVED FROM IGNITION AND LIGHT SWITCH IS OFF. VERIFIED ON THE SERVICE DRIVE.	VERIFIED CUSTOMER'S CONCERN FOUND ETAC'S INTERNAL MALFUNCTIONALSO FOUND TAIL LIGHT RELAY STICKING	REPLACED ETAC'S WITH NEW, REPLACED TIAL LIGHT RELAY
KM8JN12D27U	6/05/06	5513	37.84		UPON REPAIRS FOUND ESC LIGHT ON	FOUND CODE C1513, FOUND INTERNAL SHORT IN BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH WITHNEW.
KM8JN12D27U	6/05/06	5513	37.84		PROVIDE ALTERNATE TRANSPORTATION FOR WARRANTY REPAIRS PLANET HYUNDAI IS NOT RESPONSIBLE FOR FUEL, INSURANCE	PROVIDED ALTERNATE TRANSPORTATION	COMPLETE
KM8JN12D16U	10/11/05	25820	204.07	INSPECT AND FOUND CODE C1515 BRAKE SWITCH IS THE PRBLEM AND SHIFTER IS BROKEN REMOVED CENTER FACIA AND SHIFTER TO REPALCE THE BRAKE SWITCH AND KEY LOCK CAM	CUSTOMER STATES WINDSHIELD WIPER ARM CAPS COME OFF	INSPECT AND FOUND THE WWIPER COVER IS MISSING	REPLACED NEW CAP W/WIPER ARM
KM8JN12D16U	10/11/05	25820	250	CUST STATES SHIFT LEVER CAN BE MOBED WITH ENGINE OFF AND BRAKEPEDAL NOT BEING APPLIED. INSPECTED AND FOUND THE PROBLEM BRAKE LAMP SWITCH AND THE SHIFTER IS BROKENREMOVED THE CENTER FACIA AND SHIFTER TO REPLACED THE SWITCH AND THE KEH LOCK CAM IN SHIFTE	CUSTOMER STATES SHIFT LEVER CAN BE MOVED WITH ENGINE OFF ANDBRAKE PEDAL NOT BEING APPLIED	INSPECT AND FOUND THE CODE C1515 BRAKE SWITCH IS THE PROBLEMAND SHIFTER IS BROKEN	REMOVED THE CENTER FACE AND SHIFTER TO REPLACE THE BRAKE SWITCH AND KEY LOCK CAM. AND CORRECTED PROBLEM
KM8JM12B85U	5/19/05	33207	37.84		CUSTOMER STATES BRAKE LIGHTS DONT COME ON PLEASE CHECK AND ADVISE	FOUND INTERNAL FAILURE OF BRAKE SWITCH	TECHNICIAN REPLACED BRAKE SWITCH
KM8JM12B86U	7/12/05	12547	37.84		CUSTOMER STATES E.S.C. LIGHT WILL COME ON AND GO OFF ON ITS OWN.	C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH AND VERIFIED PROPPER OPERATION.
KM8JN12D55U	2/21/05	12907	36.73		OWNER STATES SES LIGHT ON AND OFF INTERMITTANTLY. STATES WHEN ON AND BRAKING VEHICLE WOULD SHIMMEY-WHEN FOOT TAKEN OFF PROBLEM CONDITION WOULD SUBSIDE SLIGHTLY	VERIFIED SES LIGHT ON. SCAN SHOWS C-1237-BRAKE LIGHT SWITCH FAILURE AND P0301/P0304-1-4 MISSFIRE-NEEDS COIL	REPLACED BRAKE SWITCH- SPECIAL ORDERED PRESSURE SWITCH AND IGNITION COIL FOR 1.4
KM8JN12D16U	10/11/05	25820	250	CUST STATES SHIFT LEVER CAN BE MOBED WITH ENGINE OFF AND BRAKEPEDAL NOT BEING APPLIED. INSPECTED AND FOUND THE PROBLEM BRAKE LAMP SWITCH AND THE SHIFTER IS BROKENREMOVED THE CENTER FACIA AND SHIFTER TO REPLACED THE SWITCH AND THE KEH LOCK CAM IN SHIFTE	CUSTOMER STATES PILLAR POST BETWEEN PASSENGER FRONT/REAR DOORS HAS WATER STAINS ON MATERIAL	INSPECT AND FOUND THE PROBLEM IS THE ROOF RACK IS LOOSE	TIGHTEN THE BOLTS AND CORRECTED PROBLEM
KM8JN12D16U	10/11/05	25820	250	CUST STATES SHIFT LEVER CAN BE MOBED WITH ENGINE OFF AND BRAKEPEDAL NOT BEING APPLIED. INSPECTED AND FOUND THE PROBLEM BRAKE LAMP SWITCH AND THE SHIFTER IS BROKENREMOVED THE CENTER FACIA AND SHIFTER TO REPLACED THE SWITCH AND THE KEH LOCK CAM IN SHIFTE	CUSTOMER STATES CONSOLE FRONT CUPHOLDER DOES NOT HOLD ITEMS IN PLACE (PART IN)	INSPECT AND FOUND THE PROBLEM IS THE CUP HOLDER DOSE NOT HOLD	REMOVE THE CENTER CONSOLE TO REPLACE THE CUP HOLDER AND CORRECTED PROBLEM
KM8JN12D76U	8/17/05	29305	38.16				
KM8JN12DX7U	8/18/06	4527	37.84				
KM8JN12D96U	7/29/05	20053	38.16		CUSTOMER FEELS VEH USING TO MUCH GAS	INSPECTED AND TESTED	VEHICLE WORKING AS DESIGNED

KM8JN12D96U	7/29/05	20053	38.16		VEH HAD TO GET A JUMP START	BATTERY FAILED LOAD TEST	REPLACED BATTERY RETESTED STARTING AND CHARGING SYSTEM
KM8JN12D16U	10/11/05	25820	250	CUST STATES SHIFT LEVER CAN BE MOBED WITH ENGINE OFF AND BRAKEPEDAL NOT BEING APPLIED. INSPECTED AND FOUND THE PROBLEM BRAKE LAMP SWITCH AND THE SHIFTER IS BROKENREMOVED THE CENTER FACIA AND SHIFTER TO REPLACED THE SWITCH AND THE KEH LOCK CAM IN SHIFTE	CUSTOMER STATES CENTER CONSOLE LID DOES NOT LATCH (PART IN)	INSPECT AND FOUND PROBLEM IS ARM REST DONT STAY CLOSE	REMOVE THE CENTER CONSOLE TO REPLACED THE ARM REST AND CORRECTED PROBLEM
KM8JN12D16U	10/11/05	25820	250	CUST STATES SHIFT LEVER CAN BE MOBED WITH ENGINE OFF AND BRAKEPEDAL NOT BEING APPLIED. INSPECTED AND FOUND THE PROBLEM BRAKE LAMP SWITCH AND THE SHIFTER IS BROKENREMOVED THE CENTER FACIA AND SHIFTER TO REPLACED THE SWITCH AND THE KEH LOCK CAM IN SHIFTE	CUSTOMER STATES RUBBER GROMMET AT DRIVER FRONT DOOR EDGE (INSIDE) IS PINCHED	INSPECT AND FOUND THE PROBLEM IS THE BOTTOM PLASTIC OFF THE D/DOOR IS PINCHED	REPLACED THE PLASTIC BOTTOM
KM8JN12D96U	7/29/05	20053	38.16		VEH HAS A ESC LIGHT COMING ON	CODE C1513 BRAKE SWITCH SHORTED	REPLACED BRAKE SWITCH RETESTED AND VERIFIED PROPER OPERATION
KM8JN12DX5U	7/04/05	17124	28.34		CUSTOMER STATES CHECK ENGINE LIGHT CAME ON 7/11/07, VEHICLE WILL SEEM TO ACCEL AND DECELL BY ITSELF. VEHICLE WILL ONLY DRIVE IRRADICALLY WHEN IT IS WARM/ BEEN DRIVEN FOR A WHILE	PERFORMED SYSTEM DIAGNOSTICS - FOUND 4 CODES STORED IN SYSTETHROTTLE POSITION SENSOR RESISTANCE MEASURMENT INCORRECT	REPLACED THROTTLE POSITION SENSOR
KM8JN12DX5U	7/04/05	17124	28.34		CUSTOMER STATES THAT THE ESP LIGHT WILL COME ON INTERMITTENTLY - WILL GO OFF WHEN POWERED DOWN	BODY CODE C1513 - DEFECTIVE BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN12D16U	10/11/05	25820	250	CUST STATES SHIFT LEVER CAN BE MOBED WITH ENGINE OFF AND BRAKEPEDAL NOT BEING APPLIED. INSPECTED AND FOUND THE PROBLEM BRAKE LAMP SWITCH AND THE SHIFTER IS BROKENREMOVED THE CENTER FACIA AND SHIFTER TO REPLACED THE SWITCH AND THE KEH LOCK CAM IN SHIFTE	CUSTOMER STATES WINDSHIELD WIPER ARM CAPS COME OFF	INSPECT AND FOUND THE W/WIPER COVER IS MISSING	REPLACED NEW CAP W/WIPER ARM
KM8JM12B46U	2/28/06	17770	31.41		ESC LIGHT COMES ON AND OFF CHECK AND ADVISE	CHECK OUT BRAKE SWITCH FOUND FAILURE INSIDE THE SWITCH	REPLACED BRAKE SWITCH WORKING AS DESIGNED
KM8JM12B46U	2/28/06	17770	31.41		AIR BAG LIGHT ON CHECK AND ADVISE	CHECK THE SYSTEM WITH SCAN TOOL EVERYTHING CHECK OUT OK AT THIS TIME ALSO CHECK OUT PINS AND WIRING OK.ESC LIGHT ON/OFFAT TIMES.	NO WORK DONE
KM8JN12DX5U	7/04/05	17124	28.34		RECALL 079 - DRIVER AIRBAG COVER MOD REPLACE 07-01-001	AS PER SERVICE RECALL BULLETIN	COMPLETED RECALL
KM8JM12B46U	7/11/05	17281	37.84		CUSTOMER STATES ESC LIGHT ON	FOUND CODE C1513 BRAKE LAMP SWITCH OPEN/SHORT	REPLACED BRAKE LAMP SWITCH TEST. VEHICLE OPERATING AS DESIGNED AT THIS TIME
KM8JN12D55U	4/14/05	24525	38.16	REPLACED BRK. SW. ASSY.			
KM8JM12B36U	9/22/05	20276	29.7		CUSTOMER STATES "ESC OFF" LIGHT COMES ON MOST TIMES AND IS VERY HARD TO TURN OFF AT SWITCH. OPERATES FINE MANUALLY	USED SCAN TOOL DISPLAYED C1513 BRAKE LAMP SWITCH MAL.SHORTEDBRAKE SWITCH CAUSING ESC LIGHT TO COME ON	REPLACED SWITCH CODE CLEARED LIGHT DOES NOT COME ON RECHECKEFOR ANY DTC'S CODE DISPLAYED C1237 PRESSURE SENSOR PART ON ORDER
KM8JN12D75U	11/09/04	30616	30.81		CUSTOMER STATES "BRAKE LIGHT" AT DASH IS ON	FOUND BRAKE LAMP SWITCH HAD FAILED	REPLACED BRAKE LAMP SWITCH WORKING AS DESIGNED
KM8JN12D75U	11/09/04	30616	30.81		CUSTOMER STATES WHEN ALARM GOES OFF HORN SOUNDS WEAK	CK FUSES TO SEE IF THEIR WAS POWER GOING TO HORN CONNECTION THEN TESTED CONTINUITY OF HORN HORN SHORTED, RESISTENCE WAS TO HIGH INTERNALLY	REPLACED HORN TO CORRECT CONERN
KM8JN12D76U	1/20/06	24467	38.16	REPLACED BRAKE LIGHT SWITCH,OK.			
KM8JN12D96U	7/29/05	20053	30	RENTAL REIMBURESED TO CUSTOMER FOR CSI			
KM8JN12D16U	11/16/05	7832	39.8		CUSTOMER STATES APPLIED THE BRAKE PEDAL, VEHICLE DIDN'T STOP, KEPT ON ROLLING LIKE SHE WASN'T EVEN PUSHING THE PEDALCUSTOMER HAD PUMP THE BRAKES FOR VEHICLE TO RESPOND. CUSTOMER STATES ESC LIGHT WAS ON AT THE TIME.	INSPECTED AND FOUND BRAKE SWITCH MALFUNCTION	REMOVED AND REPLACED WITH NEW BRAKE SWITCH BRAKES OPERATE AS PER DESIGNED
KM8JM12B66U	11/10/05	45180	31.41		C/S THAT WHEN AT 30 MPH THE VEHICLE DOESN'T SHIFT PROPERLY AND RPM ARE SPURATIC.	CK WITH TSB #07-40-010 CKD GDS ALL SHIFTS NORMAL OK AT THIS TIME ALL SHIFTS TOOK LESS THAN 2 SEC	NO PROBLEMS FOUND AT THIS TIME
KM8JM12B66U	11/10/05	45180	31.41		C/S THAT THE VEHICLE SEEMS TO USE A LOT OF GAS	CKD O2 SENSORS WORKING AS DESIGNED NO OTHER ENGINE PROBLEMS AT THIS TIME	NO PROBLEMS FOUND AT THIS TIME
KM8JM12B35U	6/21/05	2210	32.63		CUST. STATES ESP LIGHT IS ON	INSP. AND FOUND BRAKE SWITCH TO BE CAUSING PROBLEM	REPLACED SWITCH TO CORRECT CONCERN
KM8JN12D16U	11/16/05	7832	39.8		CUSTOMER STATES BOTH DRIVERS AND PASSENGER MIRRORS WON'T ADJUST TO THE RIGHT. DUPLICATED ON THE DRIVE.		SPECIAL ORDERED MIRROR SWITCH
KM8JN12D75U	10/01/04	20483	40.61		PERFORM 34 POINT COURTESY INSPECTION	PLEASE REFER TO ATTACHED SHEET	COURTESY INSPECTION COMPLETED

KM8JN12D75U	10/01/04	20483	40.61		I UNDERSTAND THAT PLANET HYUNDAI WILL DO EVERYTHING POSSIBLE TO SERVICE MY VEHICLE TODAY BUT WITHOUT A SCHEDULED		
KM8JN12D75U	10/01/04	20483	40.61		CUSTOMER STATES CHECK ENGINE LIGHT WAS ON NOW OFF ADVISE.	CODE P0700 P0303 P0736 BULBS BURNED OUT AND BRAKE SWITCH SHORTED	REPLACED BOTH REAR TAIL LIGHT BULBS AND BRAKE SWITCH RETESTED AND VERIFIED PROPER OPERATION
KM8JN12D46U	7/22/05	10770	33.05		CUSTOMER STATES ESC LIGHT COMES ON AND GOES OFF INTERMITTENTLY.	VERIFIED CUSTOMER CONCERN AND FOUND DTC C1513 BRAKE SWITCH MALFUNCTION.	NECESSARY TO REPLACE BRAKE STOP SWITCH TO CORRECT CONCERN.
KM8JM12B06U	7/11/05	25265	31.41		ESC LIGHT TURNS OFF AND ON+ CHECK AND ADVISE	C1513 BRAKE LAMP SWITCH	REPLACED BRAKE SWITCH
KM8JM12B45U	6/01/05	23338	31.41		CUSTOMER STATES CHECK ENGINE LIGHT ON	P0128 COOLANT TEMP MAL SHOWN ON SCAN TOOL BAD THERMOSTAT STICKING	REPLACED THERMOSTAT ROAD TESTED NO DTC SHOWN CONCERN CORRECTED
KM8JM12B45U	6/01/05	23338	31.41		CUSTOMER STATES VEHICLE HESITATES TO START	FOUND DEAD BATTERY CELL	REPLACED BATTERY
KM8JN12D75U	10/01/04	20483	40.61		CUSTOMER STATES ESP BUTTON NOT WORKING ADVISE.	INSPECTED AND TESTED ESP LIGHT WORKING AS DESIGNED	NO WORK DONE AT THIS TIME
KM8JN12D26U	12/21/05	15402	37.84		ESC LIGHT COMES ON	FOUND CODE C1513 BRAKE SWITCH	ADJUSTED BRAKE SWITCH VERIFIED NORMAL OPERATION
KM8JN12D26U	12/21/05	15402	37.84		CUSTOMER STATES CHECK ENGINE LIGHT ON	FOUND DTCs FOUND DETERIORATED RAILS CAUSING BUILD UP IN INJECTORS	REPLACED ALL SIX FUEL INJECTORS AND SURGE TANK GASKETS CLEARED CODES TESTED NO CODES PRESENT
KM8JM12B45U	6/01/05	23338	31.41		CUSTOMER STATES ESP LIGHT WILL TURN ON AND OFF WHILE DRIVING	INSPECTED AND FOUND STOMP LAMP NOT WORKING AS IT SHOULD	REPLACED SWITCH TO CORRECT CONCERN
KM8JM12B76U	11/23/05	15850	32.78	15855 SCAN FOR DTC C1513 FOUND OPEN IN BRAKE SWITCH R&R BRAKE SWITCH AND ADJ. RETESTED GOOD PART #93810-3K000			
KM8JM12B16U	11/28/05	9501	33.06	9501 INSPECTED AND TESTED. FOUND BRAKE SWITCH TO BE FAULTY. SCANNED AND OT CODE B1513, THE BRAKE SWITCH HAS A LATE REACTION. REPLACED SWITCH AND RETESTED=GOOD.			
KM8JN12D95U	11/03/04	27653	36.45		CAR WON'T COME OUT OF PARK	FOUND INTERMITTANT OPEN SHORT IN BRAKE SWITCH	REPLACED BRAKE SWITCH SHIFTING AS DESIGNED
KM8JN12D55U	5/13/05	21903	37.84		PERFORM 34 POINT COURTESY INSPECTION	PLEASE REFER TO ATTACHED SHEET	COURTESY INSPECTION COMPLETED
KM8JN12D55U	5/13/05	21903	37.84		CUSTOMER STATES THE E.S.P. LIGHT IS ON. CHECK AND ADVISE.. ESP LIGHT COMES ON AND OFF WHILE DRIVING ADVISE.	CODE C1237 C1513 BRAKE LAMP SWITCH SHORTED	REPLACED BRAKE SWITCH RETESTED AND VERIFIED PROPER OPERATION
KM8JN12D46U	12/16/05	32791	32.78				
KM8JN72D36U	7/28/05	33439	37.34	33440 REPLACED BRAKE SWITCH PER PREVIOUS DIAGNOSIS FROM 638 CLEARED CODE 1513 FROM MEMORY AND ROADTESTED ALL OK	C/S THE ESC LIGHT COMES ON. INSTALL SOP BARKE LIGHT SWITCH	C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 33440 REPLACED BRAKE SWITCH PER PREVIOUS DIAGNOSIS FROM 638 CLEARED CODE 1513 FROM MEMORY AND
KM8JM72B85U	7/05/05	18380	35.7	18390 VERIFIED ESC LIGHT COMES ON. HOOKED UP GDS AND FOUND C1513. FOUND INTERM. OPEN IN SWITCH. REPLACED AND CLEARED CODES ALL OK	C/S THE REAR WINDOW IS STILL LEAKING WATER. INSTALL SPECIAL ORDERED SEAL	X	WEATHER STRIP-TAILGATE GLASS RE WEATHER STRIP-TAILGATE GLASS RE 18380
KM8JN12D56U	7/19/05	27837	38.16		PERFORM 34 POINT COURTESY INSPECTION CUSTOMER DECLINED 30K SERVICE AT THIS TIME	PLEASE REFER TO ATTACHED SHEET	COURTESY INSPECTION COMPLETED
KM8JN12D56U	7/19/05	27837	38.16		CUSTOMER STATES AIR BAG LIGHT ON ADVISE.	PERFORM CONSULT TEST	PARTS ORDERED BUCKLE ASSEMBLY
KM8JN12D56U	7/19/05	27837	38.16		079 DRIVER SIDE AIR BAG COVER	PERFORMED CAMPAIGN AS PER HYUNDAI SPECS	RECALL COMPLETE
KM8JM72B85U	7/05/05	18380	35.7	18390 VERIFIED ESC LIGHT COMES ON. HOOKED UP GDS AND FOUND C1513. FOUND INTERM. OPEN IN SWITCH. REPLACED AND CLEARED CODES ALL OK	C/S THE ESP LIGHT COMES ON. INSTALL SPECIAL ORDERED BOW SWITCH	X	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 18390 VERIFIED ESC LIGHT COMES ON. HOOKED UP GDS AND FOUND C1513. FOUND INTERM. OPEN IN SWITCH. REPLACED AND CLEARED CODES ALL OK
KM8JN72D96U	8/24/05	22286	35.38	22290 VERIFIED ESC LIGHT COMES ON. HOOKED UP SCAN PRO AND FOUND C1513 BRAKE SWITCH. VERIFIED OPEN AND REPLACED SWITCH TESTED OPERATION ALL OK	C/S THE CHECK ENGINE LIGHT IS ON. INSTALL SPECIAL ORDERED OXYGEN SENSOR, AND CAM SENSOR	X	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE 22286
KM8JM12B76U	7/12/05	14962	37.84		CUSTOMER STATES ESC LIGHT GOES ON AND OFF	INSPECTED AND FOUND OPEN SHORT IN BRAKE SWITCH CAUSING LIGHT TO GO ON AND OFF	REMOVED AND REPLACED WITH NEW BRAKE SWITCH
KM8JM12BX6U	7/13/05	7411	39.8		CUSTOMER STATES WHEN LOCKING CAR WITH REMOTE HEADLIGHTS DO NOT FLASH	INSPECTED AND FOUND LIGHTS WORKING AS PER DESIGNED	NO PROBLEM FOUND
KM8JM12BX6U	7/13/05	7411	39.8		CUSTOMER STATES ESC LIGHT COMES ON AND OFF INTERMITT	RAN FOR CODES AND FOUND C1513 BK LAMB	REPLACED WITH NEW SWITCH
KM8JM72B45U	7/06/05	21647	37.84				
KM8JN72D96U	8/24/05	22286	35.38	22290 VERIFIED ESC LIGHT COMES ON. HOOKED UP SCAN PRO AND FOUND C1513 BRAKE SWITCH. VERIFIED OPEN AND REPLACED SWITCH TESTED OPERATION ALL OK	C/S THE CHECK ENGINE LIGHT IS ON. INSTALL SPECIAL ORDERED OXYGEN SENSOR, AND CAM SENSOR	X	SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION 22286

KM8JN72D96U	8/24/05	22286	35.38	22290 VERIFIED ESC LIGHT COMES ON. HOOKED UP SCAN PRO AND FOUND C1513 BRAKE SWITCH. VERIFIED OPEN AND REPLACED SWITCH TESTED OPERATION ALL OK	C/S THE ESC LIGHT COMES ON INTERMITTENTLY	X	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 22290 VERIFIED ESC LIGHT COMES ON. HOOKED UP SCAN PRO AND FOUND C1513 BRAKE SWITCH. VERIFIED OPEN AND REPLACED SWITCH TESTED OPERATION ALL OK
KM8JM12BX6U	7/11/05	27289	37.84		ECS OFF LIGHT COMES ON WHEN APPLYING BRAKES - WILL GO OFF WHEN IGNITION KEY RECYCLED - CUSTOMER JUST WANTS TO KNOW IF ALRIGHT TO DRIVE - DOES NOT HAVE TIME TO REPAIR TODAY	ECS LIGHT ON - CODE C1513 INTERNAL DEFECT OF BRAKE LIGHT SWITCH	REPLACED BRAKE LAMP SWITCH - RETESTED SYSTEM - ECS LIGHT STAYS OFF WHEN BRAKES APPLIED - WORKING AS DESIGNED
KM8JM12B76U	7/19/05	5943	39.8		CUSTOMER STATES ECS LIGHT KEEPS COMING ON WHILE DRIVING	FOUND BRAKE LIGHT SWITCH TO BE FUALTY	REPLACED SWITCH AND TESETD OK
KM8JM12BX6U	11/29/05	14132	37.84		CUSTOMER STATES ENGINE WILL MAKE A LOUD SOUEALING NOISE INTERMITTENTLY..HAPPENS ANY TIME OF DAY..DOES IT WHILE IDLING AT A LIGHT OR AT A DRIVE THROUGH..CHECK AND ADVISE..	RADIATOR FAN HITTING SHROUD	REPLACED MOTOR AND FAN BLADE RETESTED AND VERIFIED VEHICLE WORKING AS DESIGNED
KM8JN72D66U	9/30/05	24933	35.7	24935 WARR. COULD NOT VERIFY THE CUSTOMERS CONCER OF THE ESC LIGHT BEING ON. HOOKED UP THE GDS AND CHECKED FOR CODES. FOUND CODE C1513 BRAKE SWITCH CIRCUIT. PERFORMED INSPECTION AND PINPOINT TEST AND FOUND THAT INTERMITTENTLY THE CONTACT POINTS IN THE SW	C/S THE VEHICLE DIES WHEN COMING TO A STOP.	X	SENSOR ASSY-THROTTLE POSITION RE SENSOR ASSY-THROTTLE POSITION RE 24965 WARR. VERIFIED THE CUSTOMERS CONCERN OF THE VEHICLE DIEING INTERMITTNTLY. CHECKED FOR CODES AND FOUND NONE PRESENT. CALLED RALF FROM HYUNDAI MOTOR AMERICA AND WAS TOLD TO REPLACE THE T
KM8JN72D66U	9/30/05	24933	35.7	24935 WARR. COULD NOT VERIFY THE CUSTOMERS CONCER OF THE ESC LIGHT BEING ON. HOOKED UP THE GDS AND CHECKED FOR CODES. FOUND CODE C1513 BRAKE SWITCH CIRCUIT. PERFORMED INSPECTION AND PINPOINT TEST AND FOUND THAT INTERMITTENTLY THE CONTACT POINTS IN THE SW	C/S THE ESC LIGHT COMES ON WHEN VEHICLE IS STARTED	X	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 24935 WARR. COULD NOT VERIFY THE CUSTOMERS CONCER OF THE ESC LIGHT BEING ON. HOOKED UP THE GDS AND CHECKED FOR CODES. FOUND CODE C1513 BRAKE SWITCH CIRCUIT. PERFORMED INSPECTION AND PINPOINT TEST AND FOUND
KM8JM12BX6U	11/29/05	14132	37.84		PROVIDE ALTERNATE TRANSPORTATION FOR WARRANTY REPAIRS PLANET HYUNDAI IS NOT RESPONSIBLE FOR FUEL, INSURANCE	PROVIDED ALTERNATE TRANSPORTATION LOANER #71581	COMPLETE
KM8JM12BX6U	11/29/05	14132	37.84		CUSTOMER STATES WHEN GOING OVER DIPS AND BUMPS THERE IS A VIBRATION/RATTLE COMING FROM UNDER CAR..SOUNDS LIKE SOMETHING IS LOOSE..CHECK AND ADVISE..	FRONT STRUT MOUNTING BOL LOOSE	TIGHTENED TO SPECS THE MOUNTING BOLTS AND VERIFIED PROPER OPERATION
KM8JN72D56U	1/18/06	13324	35.38	SECOND FOUND BRAKE LIGHT SWITCH FOUND AFTER INSTALLING THE CRUISE SWITCH SYS WOULD TRY TO COME ON BUT WOULD THEN GO OFF FOUND THE BRAKE PEDEL VIBRATION FROM THE ROAD WAS ENOUGH TO SEND A SIGNAL TO THE CRUISE MODULE AND CANCEL THE SYS WHEN BRAKE	C/S INTERMITTENTLY THE CRUISE CONTROL DOES NOT WORK PROPERLY..INSTALL SPECIAL ORDERED SPEED CONTROL SWITCH	C15	SWITCH ASSY-CRUISE CONTROL MAIN RE SWITCH ASSY-CRUISE CONTROL MAIN RE 13328 WARR. VERIFIED THE CUSTOMERS CONCERN OF THE CRUISE BEING INOP. PERFORMED PINPOINT TEST AND FOUND THAT IT WAS TWO THINGS CAUSING THE CRUISE TO BE INOP.
KM8JN72D56U	1/18/06	13324	35.38	SECOND FOUND BRAKE LIGHT SWITCH FOUND AFTER INSTALLING THE CRUISE SWITCH SYS WOULD TRY TO COME ON BUT WOULD THEN GO OFF FOUND THE BRAKE PEDEL VIBRATION FROM THE ROAD WAS ENOUGH TO SEND A SIGNAL TO THE CRUISE MODULE AND CANCEL THE SYS WHEN BRAKE	C/S INTERMITTENTLY THE CRUISE CONTROL DOES NOT WORK PROPERLY..INSTALL SPECIAL ORDERED SPEED CONTROL SWITCH	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 13328 WARR. VERIFIED THE CUSTOMERS CONCERN OF THE CRUISE BEING INOP. PERFORMED PINPOINT TEST AND FOUND THAT IT WAS TWO THINGS CAUSING THE CRUISE TO BE INOP.
KM8JM12BX6U	11/29/05	14132	37.84		CUSTOMER STATES "ESC" LIGHT COMES ON AND OFF INTERMITTENTLY..WONT GO OFF WHEN CUSTOMER PUSHES BUTTON..LIGHT WILL GO OFF ON ITS OWN..	CODE C1513 BRAKE LAMP SWITCH MALFUNCTION	REPLACED BRAKE LAMP SWITCH RETESTED AND VERIFIED PROEPR OPERATION
KM8JN12D25U	9/04/04	23732	8.23		OWNER STATES BRAKE LIGHTS WONT TURN OFF	VERIFIED CONDITION. FOUND BRAKE SWITCH STUCK CLOSED	REPLACED SWITCH-TESTED OPERATION-VERIFIED REPAIRS
KM8JN12D45U	9/21/04	27970	36.73		OWNER STATES ESP LIGHT OFF MIL. ILLUMINATES AFTER DRIVING FOR A FEW MINUTES	FOUND ESP COMES ON AFTER SEVERAL MINUTES OF DRIVING / FOUND C1513 CODE / FOUND INTERNAL INTERMITTENT SHORT OPEN IN BRAKE SWITCH	REPLACED BRAKE SWITCH ESC LIGHT STAYING OFF NOW / TEST DROVE / WORKING NOW AS PER DESIGN AT THIS TIME
KM8JM12B36U	12/30/05	14686	37.84				
KM8JN12D95U	7/04/05	22029	35		INSTALL SOP BRAKE LIGHT SWITCH TO REPAIR CODE C1513, SEE HISTORY		REPLACED BRAKE SWITCH.
KM8JN12D16U	7/18/05	12720	33.04		CUSTOMER STATES THAT THE ESC LIGHT IS BACK ON AND WILL NOT GO OFF. SEE HISTORY. CHECK AND ADVISE.	VERIFIED CUSTOMER CONCERN. SCANNED AND FOUND CODE C1513 BRAKE LAMP SWITCH. INSPECTED AND FOUND INTERNAL PROBLEM IN THE SWITCH CAUSING LIGHT TO COME ON. BUTTON IS STICKING	REPLACED SWITCH, TEST DROVE, AND VERIFIED REPAIR.
KM8JN72D86U	11/23/05	4892	35.9		CUSTOMER STATES BRAKES LIGHTS STAY ON AND RUN DOWN BATTERY3.		INSPECTED, REPLACED BRAKE LIGHT SWITCH

KM8JN12D96U	12/18/05	8755	37.84		C/S WAS HERE AND ESC LIGHT OFF WAS OFF AND CAME ON NOW AND WILL NOT GO OFF.	DIAGNOSE BRAKE LIGHT SWITCH FAILED	REPLACED BRAKE PEDAL SWITCH
KM8JN12D06U	10/13/05	15240	37.84		CUSTOMER STATES VEHICLE HAS NO BRAKE LIGHTS..	TRACED TO SHORT TO GROUND IN BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH AND VERIFIED BRAKE LIGHTS NOW WORK
KM8JM12B06U	2/13/06	25131	38.16	REPLACED BRAKE SWITCH AND VERIFIED PROPPER OPERATION	C/S NO BRAKES LIGHTS ESC LIGHT LIT ON DASH	FOUND BRAKE SWITCH STAYING OPEN AT ALL TIMES CAUSING LIGHT TO COME ON	REPLACED BRAKE SWITCH AND VERIFIED PROPPER OPERATION
KM8JN72D76U	3/23/06	6022	37.42		RECALL 079 (DRIVER AIRBAG COVER MOD REPL)	FAILURE	COMPLETED
KM8JN12D85U	10/05/04	28472	36.03		RECALL 079 DRIVERS AIRBAG COVER MOD REPLACE(07-01-001)	FAILURE	COMPLETED
KM8JN12D85U	10/05/04	28472	36.03		CUSTOMER STATES THAT ON ACCELERATION THE CAR JERKS AND FEELS LIKE IT CUTS OUT. HESITATION ON ACCELERATION	FOUND DTC C1237 BRAKE LAMP SWITCH OPEN SHORT.	DIAGNOSED, ACCESSED COMPUTER, TEST DROVE, REPLACED THE BRAKE LIGHT SWITCH, RETESTED ALL CHECKED OUT GOOD.
KM8JM12B76U	7/20/05	18609	39.8		CUSTOMER STATES THE BRAKE LIGHTS STAY ON PLEASE CHECK	INSPECTED AND FOUND BRAKE SWITCH BAD	REPLACED WITH NEW BRAKE SWITCH
KM8JM12B86U	1/12/06	16625	37.84		PERFORM 34 POINT COURTESY INSPECTION	PLEASE REFER TO ATTACHED SHEET	COURTESY INSPECTION COMPLETED
KM8JN12D56U	7/26/05	15803	39.8		CUSTOMER STATES ESC LIGHT IS ON ON DASH.	FOUND CODE C1513 BRAKE LAMP SWITCH FAILURE	REPLACED BRAKE LAMP SWITCH ASSY
KM8JN12D85U	10/05/04	28472	36.03		SUPPLIED LOANER CAR TO CUSTOMER WHILE IN SERVICE	OVERNIGHT LOANER OKED	LOANER WAS SUPPLIED WHILE CUSTOMER CAR WAS IN SHOP
KM8JN72D06U	11/19/05	2059	60.5	TT DIAGNOSE AND PULL CODE B1513	CUSTOMER STATES ESC LIGHT COMING ON WHEN DRIVING, WILL GO OUT WHEN KEY TURNED OFF. AFTER DRIVING BACK ON	FOUND CODE B1513 BRAKE LIGHT SWITCH MALFUNCTION	DIAGNOSED AND REPLACED THE BRAKE LIGHT SWITCH, RETESTED ALL TESTED GOOD
KM8JN72D16U	9/13/05	18081	37.74	REPLACED ESC BRAKE LIGHT SWITCH, RETESTED SYSTEM. ALL OK AT THIS TIME.	RECALL 079	FAILURE	COMPLETED
KM8JM12B96U	7/20/05	8448	39.8		CUSTOMER STATES VEHICLE PULLS TO THE RIGHT. CHECK AND ADVISE	PERFORMED VEHICLE ROAD TEST, ADJUSTED TIRE PRESSURE	FOUND VEHICLE TRACKS TRUE, ALL OKAY AT THIS TIME
KM8JM12B96U	7/20/05	8448	39.8		CUSTOMER STATES "ESC OFF" LIGHT COMES ON INTERMITTENTLY.. SOMETIMES GOES OFF WHEN BUTTON IS PUSHED BUT SOMETIMES IT WON'T.. CUSTOMER HAS TO TURN CAR OFF AND THEN START CAR TO MAKE LIGHT GO OUT	VERIFIED CUSTOMER'S CONCERN, FOUND BRAKE SWITCH INTERMITTENTLY STICKING	REPLACED WITH NEW BRAKE SWITCH, CLEARED CODES AND RETEST NO FAULT CODES RETURNED. ALL OKAY AT THIS TIME
KM8JN12D25U	11/04/04	514	33.57				
KM8JN72D16U	9/13/05	18081	37.74	REPLACED ESC BRAKE LIGHT SWITCH, RETESTED SYSTEM. ALL OK AT THIS TIME.	CUSTOMER STATES THE ESC LIGHT COME ON INTERMITTENT AND WILL NOT TURN OFF WITH BUTTON. CHECK AND ADVISE	CONFIRMED COMPLAINT, FOUND FAULTY SWITCH. NEEDS TO BE REPLACED AND RECHECKED.	REPLACED ESC BRAKE LIGHT SWITCH, RETESTED SYSTEM. ALL OK AT THIS TIME.
KM8JN12D26U	11/21/05	8166	37.42		CUSTOMER STATES THE ESC OFF LIGHT IS ON. CHECK AND ADVISE	FOUND CODE C1513 BRAKE LAMP CIRCUIT OPEN.	DIAGNOSED AND REPLACED THE BRAKE LIGHT SWITCH, RETESTED ALL TESTED GOOD AT THIS TIME.
KM8JN72D95U	9/13/04	1446	35.67				
KM8JN12D45U	9/03/04	380	34.88		CUSTOMER STATES VEHICLE BRAKE LIGHTS DON'T COME ON WHEN DEPRESSING THE BRAKE PEDAL	FOUND FAULTY BRAKE SWITCH, SHORTED.	REPLACED FAULTY BRAKE SWITCH
KM8JM12B35U	6/03/05	21415	38.16		CUSTOMER STATES SPEEDOMETER READS WRONG OR NOT AT ALL INTERMITTENT TRIP WILL NOT RESET	VERIFIED CONCERN FOUND SPEEDO WITH INTERMITTENT OPEN	SPEED SENSOR REMOVED AND REPLACED WITH NEW TEST DROVE TO VERIFY REPAIRS
KM8JM12B35U	6/03/05	21415	38.16		CUSTOMER STATES ESC LIGHT COMES ON AND STAYS ON NOT ON NOW, INTERMITTENT	FOUND DTC FOR BRAKE SWITCH OPEN	BRAKE SWITCH REMOVED AND REPLACED WITH NEW VERIFIED REPAIRS
KM8JN72D36U	9/16/05	7565	28.08		RECALL 079 (DRIVER AIRBAG COVER MOD REPL)	FAILURE	COMPLETED
KM8JN72D36U	9/16/05	7565	28.08		CUSTOMER STATES ESC LIGHT INTERMITTENTLY COMES ON WHILE DRIVING	BRAKE LIGHT SWITCH OUT OF ADJUSTMENT	INSPECT, ACCESS COMPUTOR AND DIAGNOIS. ADJUST BRAKE LIGHT SWITCH
KM8JN72D36U	9/16/05	9435	37.42		CUSTOMER STATES THE ESC LIGHT IS ON. CHECK AND ADVISE	CONFIRMED COMPLAINT, FOUND BRAKE LIGHT SWITCH INOP. NEED TO REPLACE SWITCH.	REPLACED SWITCH, TESTED OK AT THIS TIME
KM8JM12B36U	7/11/05	22692	38.16		CUSTOMER STATES AT TIMES ESC LIGHT COMES ON CHECK AND ADVISE-OFF NOW	DIAGNOSE AND FOUND CODE C1513. INTERNAL FAILURE FOR BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN72D65U	2/18/05	26165	37.56		CUSTOMER STATES HAS TO TIGHTEN BRAKE PEDAL COMES LOOSE EVERY 3-4 DAYS PLEASE CHECK	INSPECTED AND FOUND BRAKE SWITCH LOOSE AND NOT WORKING PROPERLY.	REPLACED WITH NEW BRAKE SWITCH
KM8JN72D65U	2/18/05	26165	37.56		CUSTOMER REQUESTS CHARGING SYSTEM CHECK HAS TO JUMP START	INSPECTED AND FOUND BATTERY NOT HOLDING CHARGE	REPLACED WITH NEW BATTERY
KM8JN12D85U	2/22/05	14451	36.03				INSPECTED, ACCESS COMPUTOR AND DIAGNOIS. REPAIRED VACUUM LEAK. CLEAR CODE RETEST OK
KM8JN12D85U	2/22/05	14451	36.03		RECALL 079 (DRIVER AIRBAG COVER MOD REPL)	FAILURE	COMPLETED
KM8JN12D85U	2/22/05	14451	36.03		SUPPLIED LOANER CAR TO CUSTOMER WHILE IN SERVICE	OVERNIGHT LOANER OKED	LOANER WAS SUPPLIED WHILE CUSTOMER CAR WAS IN SHOP
KM8JN72D75U	9/24/04	461	78.57				
KM8JM12B46U	7/11/05	30344	38.16				
KM8JN12D35U	6/24/05	18378	38.16		CUSTOMER STATES ESP LIGHT WONT SHUT OFF	FOUND CODE C 1513 ANGLE SENSOR FAILURE	REPLACED ANGLE SENSOR
KM8JN12D35U	6/24/05	18378	38.16		CUSTOMER STATES VEH HAS NO BRAKE LIGHTS	FOUND C 1260 C 1513 BRAKE LIGHT SWITCH FAILURE	REPLACED BRAKE LIGHT SWITCH
KM8JN12D75U	10/15/04	34189	36.73		CUSTOMER STATES MUFFLER HANGING DOWN HAD TO STRAP UP TO GET IT NOT HIT THE STREET WHILE DRIVING ADVISE.	EXHAUST HANGER BROKEN	SPECIAL ORDERED EXHAUST HANGER

KM8JN72D06U	12/31/05	6144	48.8	TRACED PROBLEM TO FAILED CRUISE BRAKE SWITCH. REPLACED SWITCH AND TEST DROVE, NO PROBLEMS AT THIS TIME.	CUST STATES THAT CRUISE CONTROL WILL NOT SET.		DIAG FOR BRAKE LIGHT SWITCH. DIAG FOR BRAKE LIGHT SWITCH. TRACED PROBLEM TO FAILED CRUISE BRAKE SWITCH. REPLACED SWITCH AND TEST DROVE, NO PROBLEMS AT THIS TIME.
KM8JN72D06U	12/31/05	6144	48.8	TRACED PROBLEM TO FAILED CRUISE BRAKE SWITCH. REPLACED SWITCH AND TEST DROVE, NO PROBLEMS AT THIS TIME.	CUST STATES THAT CRUISE CONTROL WILL NOT SET.		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE TRACED PROBLEM TO FAILED CRUISE BRAKE SWITCH. REPLACED SWITCH AND TEST DROVE, NO PROBLEMS AT THIS TIME.
KM8JN12D75U	10/15/04	34189	36.73		VERIFY BRAKE LIGHTS INOP	BRAKE SWITCH FAILURE	REPLACED BRAKE SWITCH
KM8JN12D75U	10/15/04	34189	36.73		CUSTOMER STATES ESP LIGHT ON ADVISE.	RELATED TO BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN12D75U	10/15/04	34189	36.73		CUSTOMER STATES WHEN CRUISE CONTROL IS ON WHEN TRYING TO BRAKE VEHICLE FIGHTS AGAINST YOU LIKE IT WANTS TO ACCELERATE AND CRUISE WILL NOT SHUT OFF ADVISE.	VERIFIED CONCERN-FOUND CODE 1513-BRAKE SWITCH MALFUNCTION	REPLACED SWITCH-TEST DROVE- VERIFIED REPAIRS
KM8JN72DX6U	11/29/05	23791	70.94	23804 CODE FOR PRESSURE SENSOR SIGNAL/BRAKE SWITCH CIRCUIT, CLEARED AND TEST DROVE, ONLY BRAKE SWITCH RETURNED-REPLACED BRAKE SWITCH, TEST DROVE, SCANNED AND FOUND SEVERAL CODES STORED IN MEMORY, CLEARED ALL CODES AND TEST DROVE AGAIN. FOUND CODE FOR BRAKE			
KM8JM12B55U	12/01/04	10019	33.81		CUST. SAY INT. BRAKES SEEM TO GRAB. WHEN LEAVING STOP SIGN. OR POSS HEST. BAD.	CODE C1513 BRAKE LAMP SWITCH CODE IS SET. CALLED TAC TO SEE IF C1513 FAULT COULD CAUSE GRABBING SENSATION. TAC WAS NOT SURE BUT THOUGH IT MAY SINCE C1513 SETTING CAUSES ESP TO BE TEMPORARILY DISABLED.	ORDERED BRAKE LAMP SWITCH. TAC CASE #213193. 1/6/06- REPLACED SWITCH AND CLEARED CODE. TEST DROVE= OK. CAUSAL 93810-38110
KM8JM12B55U	12/01/04	10019	33.81		CUST. SAY HEATER BLOWER MOTOR MAKES NOISE, SQUEEL INT. & OTHER TIMES GRAWAL ON HIGHER SPEEDS.	NAPKINS AND A STRAW HAVE BEEN SUCKED OUT OF GLOVE BOX AND INTO BLOWER THROUGH RECIRC DOOR	REMOVED BLOWER MOTOR AND REMOVED ALL DEBRIS. REINSTALLED AND VERIFIED REPAIR. CAUSAL 97113-2E200
KM8JM12B76U	7/14/05	27026	38.16		079 AIR BAG RECALL COVER MOD REPL 07 01 001	FACTORY RECALL	PERFORM RECALL 07 01 001 AIR BAG COVER
KM8JM12B76U	7/14/05	27026	38.16		ESC LIGHT COMES ON WONT TURN OFF EVEN FROM SWITCH	FOUND CODE C 1513 BRAKE LIGHT SWITCH OPEN CIRCUIT	REPLACED BRAKE LIGHT SWITCH
KM8JM12B26U	12/28/05	11813	38.16				
KM8JN12D16U	12/27/05	19065	38.16	REPLACED BRAKE SWITCH RETESTED AND VERIFIED PROPER OPERATION			
KM8JN12D26U	10/17/05	18483	31.85	18483 FAULTY BRAKE LAMP SWITCH. CODE C1513. DIAG INTERMITTENT OPEN CIRCUIT THROUGH BRAKE SWITCH (BRAKE LAMPS ARE ALSO INOP WHEN FAULT IS PRESENT!!!). ORDERED PART 8/10/07. 8/10/07- SWAPPED BRAKE SWITCH FOR STOCK VEHICLE INTO CUSTOMERS CAR. CUSTOMER IS			
KM8JN12DX5U	7/08/05	21148	35.3	INSPECTED AND FOUND CAR HAS NO BRAKE LIGHTS CHECKED AND FOUND POWER TO BRAKE LIGHT SWITCH BUT SWITCH WOULD NOT ENGAGE REPLACED BRAKE LIGHT SWITCH --CHECKED OPERATION OK AT THIS TIME	CUST REPORTS ESP LIGHT WONT GO OFFSOMETIMES	ABS MODULE INTERNAL FAILURE	HYDRAULIC MODULE ASSY - ABS RE HYDRAULIC MODULE ASSY - ABS RE CHECKED WITH SCAN TOOL AND FOUND CODES C1237,C1 513,C1612,C1611,C1616--ALSO FOUND CODE U0100 AN D U0101 FROM TCU--CLEARED CODES AND C1611,C1616 WOULD NOT CLEAR--CAN BUS OFF CODES--CALLED TEC H LI
KM8JN12D86U	11/21/05	22597	37.84		ESC LIGHT COMES ON WHILE DRIVING SEEMS TO BE A LITTLE LOOSE WHEN GOING AROUND COUNNER	DIAGNOSE AND FOUND CODE FOR SHORTED BRAKE LIGHT SWITCH	REPLACED BRAKE PEDAL SWITCH AND CLEAR CODES
KM8JM12B16U	7/20/05	1984	34.88		CUSTOMER STATES ESC LIGHT STARS LIT	FOUND CODE C1353, FOUND BRAKE SWITCH INOP	REPLACED FAULTY BRAKE SWITCH WITH NEW, TESTED, ALL OKAY AT THIS TIME
KM8JN12DX6U	1/11/06	15919	38.16		CUSTOMER STATES BATTERY DEAD. REPLACE BATTERY	FOUND BATTERY NOT HOLDING VOLTAGE	REPLACED BATTERY WITH NEW UNIT AND RETASTED OK
KM8JN12DX5U	7/08/05	21148	35.3	INSPECTED AND FOUND CAR HAS NO BRAKE LIGHTS CHECKED AND FOUND POWER TO BRAKE LIGHT SWITCH BUT SWITCH WOULD NOT ENGAGE REPLACED BRAKE LIGHT SWITCH --CHECKED OPERATION OK AT THIS TIME	CUST REPORTS ESP LIGHT WONT GO OFFSOMETIMES	ABS MODULE INTERNAL FAILURE	DIAGNOSTIC TIME FOR ELECTRICAL CHECK FOR ABS DIAGNOSTIC TIME FOR ELECTRICAL CHECK FOR ABS CHECKED WITH SCAN TOOL AND FOUND CODES C1237,C1 513,C1612,C1611,C1616--ALSO FOUND CODE U0100 AN D U0101 FROM TCU--CLEARED CODES AND C1611,C1616 WOULD NOT CLEAR--CAN BUS O
KM8JN12DX5U	7/08/05	21148	35.3	INSPECTED AND FOUND CAR HAS NO BRAKE LIGHTS CHECKED AND FOUND POWER TO BRAKE LIGHT SWITCH BUT SWITCH WOULD NOT ENGAGE REPLACED BRAKE LIGHT SWITCH --CHECKED OPERATION OK AT THIS TIME	CUST REPORTS CRUISE CONTROL WILL NOT RELEASE WHEN DRIVING	BRAKE LIGHT SWITCH INOP	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE INSPECTED AND FOUND CAR HAS NO BRAKE LIGHTS CHECKED AND FOUND POWER TO BRAKE LIGHT SWITCH BUT SWITCH WOULD NOT ENGAGE REPLACED BRAKE LIGHT SWITCH --CHECKED OPERATION OK AT THIS TIME

KM8JM12B36U	7/22/05	8341	32.44		C/S ESC LIGHT ON, SOP IN	SCAN SYSTEM CODE C1513 SWITCH IS SHORTED/NEEDS SWITCH	REPLACED SWITCH 93810R00 .3
KM8JN12D66U	7/27/05	7931	32.44		STABILITY CONTROL LIGHT COMES ON SOMETIMES	INTERMETTENT OPEN IN BRAKE LIGHT SWITCH	SCAN CODE C1513 .3 REPLACE BRAKE LIGHT SWITCH 93810R00 .3 E
KM8JN72D45U	10/12/04	51310	31.05				
KM8JM12B26U	7/11/05	17389	33.34	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 -BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LAMP SWITCH--CLEARED CODE--TEST DROVE--OK AT THIS TIME	CUST REPORTS ESC LIGHT OFF COMES ONWHILE DRIVING	BRAKE LAMP SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE CHECKED WITH SCAN TOOL AND FOUND CODE C1513-BR AKE LAMP SWITCH MALFUNCTION REPLACEDBRAKE LAMP SWITCH--CLEARED CODE--TESTDROVE--OK AT THIS TIME
KM8JM12B26U	7/12/05	5825	35.3	CHECKED WITH SCAN TOOL AND FOUND CODE C1513-BRAKE SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH--CLEARED CODE--TEST DROVE--OK AT THIS TIME	CUST REPORTS ESC LIGHT COMES ON	BRAKE SWITCH HAS INTERNAL SHORT	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE CHECKED WITH SCAN TOOL AND FOUND CODEC1513-BRA KE SWITCH MALFUNCTION REPLACEDBRAKE LIGHT SWITCH--CLEARED CODE--TESTDROVE--OK AT THIS TIME
KM8JN72D46U	1/04/06	12564	45.66		CUST STATES ESC LIGHT IS COMING ON BY ITSELF	STOP LAMP SWITCH INTERNAL ELECTRICAL OPEN INTERMITTENT	VERIFIED ESC MIL ON, CODES C1237 AND C1513 IN TRACTION. TEST SWITCHES W/GDS. FOUND OPEN STOP LAMP SWITCH, REPLACE STOP LAMP SWITCH AND RETEST, OK. CLEAR CODES AND TEST DRIVE,OK
KM8JN72D57U	8/22/06	3628	30.49				
KM8JM12B67U	9/29/06	235	30.81				
KM8JN72D17U	8/21/06	1877	30.49				
KM8JM12B26U	7/12/05	11739	62.46	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LIGHT SWITCH MALFUNCTION--REPLACED BRAKE LIGHT SWITCH -CHECKED OPERATION --TEST DROVE --OK AT THIS TIME	CUST REPORTS ESC HAS COME ON AND GONE OFF	BRAKE LIGHT SWITCH MALFUNCTION	SCAN TOOL FOR STOP LAMP SWITCH SCAN TOOL FOR STOP LAMP SWITCH CHECKED WITH SCAN TOOL AND FOUND CODE C1513BRAKE LIGHT SWITCH MALFUNCTION--REPLACEDBRAKE LIGHT SWITCH -CHECKED OPERATION --TESTDROVE --OK AT THIS TIME
KM8JM12B26U	7/12/05	11739	62.46	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LIGHT SWITCH MALFUNCTION--REPLACED BRAKE LIGHT SWITCH -CHECKED OPERATION --TEST DROVE --OK AT THIS TIME	CUST REPORTS ESC HAS COME ON AND GONE OFF	BRAKE LIGHT SWITCH MALFUNCTION	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE CHECKED WITH SCAN TOOL AND FOUND CODE C1513BRAKE LIGHT SWITCH MALFUNCTION--REPLACEDBRAKE LIGHT SWITCH -CHECKED OPERATION --TESTDROVE --OK AT THIS TIME
KM8JM12B05U	6/10/05	46627	34.41				
KM8JN12D75U	6/01/05	16391	34.41				
KM8JM12B26U	1/03/06	20345	34.09				
KM8JM12B65U	5/13/05	23296	58.84	ESP LIGHT COMES ON AT RANDOM WILL NOT TURN OFF UNLESS VEH SHUT OFF/RPLD BRAKE LIGHT SWITCH/ATT TIME WAS FOR SCAN TOOL TEST CODE C1513			
KM8JM12B66U	11/24/05	17795	35.74	CHECKED WITH SCAN TOOL AND FOUND CODE C1513-STOP LAMP SWITCH MALFUNCTION. REPLACED BRAKE LIGHT SWITCH--CLEARED CODE--TEST DROVE--OK	CUST REPORTS ESC LIGHT COMES ON AT TIMES	BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE CHECKED WITH SCAN TOOL AND FOUND CODEC1513-STO P LAMP SWITCH MALFUNCTION REPLACEDBRAKE LIGHT SWITCH--CLEARED CODE--TESTDROVE--OK
KM8JN12D96U	7/20/05	21358	36.06	CHECKED WITH SCAN TOOL AND FOUND CODE C1513-STO P LAMP SWITCH MALFUNCTION REPLACED STOP LAMP SWITCH--CLEARED CODE--TEST D ROVE--	079 CAMPAIGN-AIR BAG COVER	COMPLETED 079 CAMPAIGN	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT
KM8JN12D96U	7/20/05	21358	36.06	CHECKED WITH SCAN TOOL AND FOUND CODE C1513-STO P LAMP SWITCH MALFUNCTION REPLACED STOP LAMP SWITCH--CLEARED CODE--TEST D ROVE--OK	CUST REPORTS ESC LIGHT COMES ON--STAY ON FOR 2-3 DAYS THEN GOES OFF	STOP LAMP SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE CHECKED WITH SCAN TOOL AND FOUND CODEC1513-STO P LAMP SWITCH MALFUNCTION REPLACEDSTOP LAMP SWITCH--CLEARED CODE--TEST DROVE--
KM8JM12B06U	7/09/05	27229	34.41				
KM8JN72D45U	5/13/05	27590	31.86	CUSTOMER STATES ESP LIGHT IS ON DASH. FOUND CODE C1513. REPLACED BRAKE LAMP SWITCH, NO LIGHT AT THIS TIME.	CUSTOMER STATES HEARS RATTLING IN FRONT	PERFORMMED DIAG. FOUND STABILIZER LINKS BAD	REPLACED BOTH FRONT STABELIZER LINKS
KM8JN72D45U	5/13/05	27590	31.86	CUSTOMER STATES ESP LIGHT IS ON DASH. FOUND CODE C1513. REPLACED BRAKE LAMP SWITCH, NO LIGHT AT THIS TIME.	CUSTOMER STATES ESP LIGHT IS ON DASH	PERFORMMED DIAG. FOUND CODE C1513	REPLACED BRAKE SWITCH
KM8JM12B75U	5/09/05	16676	83.3	CHECKED WITH SCAN TOOL AND FOUND CODE C1501 BRAKE LIGHT SWITCH MALFUNCTION--INSPECTED AND FOUND BRAKE LIGHT SWITCH ADJUSTED PROPERLY --FOUND SHORTING INTERNALLY REPLACED BRAKE LIGHT SWITCH--CHECKED OPERATION --TEST DROVE --OK AT THIS TIME	071 CAMPAIGN	COMPLEETD 071 CAMPAIGN	PARKING BRAKE LEVER (TSB#05-01-006) PARKING BRAKE LEVER (TSB#05-01-006)

KM8JM12B75U	5/09/05	16676	83.3	CHECKED WITH SCAN TOOL AND FOUND CODE C1501 BRAKE LIGHT SWITCH MALFUNCTION--INSPECTED AND FOUND BRAKE LIGHT SWITCH ADJUSTED PROPERLY --FOUND SHORTING INTERNALLY REPLACED BRAKE LIGHT SWITCH--CHECKED OPERATION --TEST DROVE --OK AT THIS TIME	CUST REPORTS ESP LIGHT IS ON--SOP	BRAKE LIGHT SWITCH MALFUNCTION	SCAN TOOL AND REPLACED BRAKE LIGHT SWITCH SCAN TOOL AND REPLACED BRAKE LIGHT SWITCH CHECKED WITH SCAN TOOL AND FOUND CODE C1501BRAKE LIGHT SWITHC MALFUNCTION--INSPECTED AND FOUND BRAKE LIGHT SWITCH ADJUSTED PROPERLY--FOU ND SHORTING INTERNALLY REPLACED BR
KM8JN72D45U	5/13/05	27590	31.86	CUSTOMER STATES ESP LIGHT IS ON DASH. FOUND CODE C1513. REPLACED BRAKE LAMP SWITCH, NO LIGHT AT THIS TIME.	CUSTOMER STATES LIGHTS WONT FLASH WHEN LOCKING DOORS WITH KEY FOB	PERFORMMED DIAG. FOUND ETACS UNIT HAS OPEN CIRCUIT	REPLACED ETAC BODY CONTROL MODULE
KM8JN12D05U	5/23/05	15599	33.5		CUSTOMER STATES ESP LIGHT COMES ON AND OFF	SCANNED FOR CODES FOUND B1513. FOUND SHORTED STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH
KM8JM12B45U	6/13/05	37655	31.86	REPLACED STOP LAMP SWITCH C/S ESP LIGHT INTERMITTENELY COME ON. SCANNED FOR CODES AND FOUND C1513. FOUND SHORTED STOP LAMP SWITCH.REPLACEMENT COMPLETE, NO WARNING LIGHTS NOW.	CUSTOMER STATES ESP LIGHT INTERMITTENTLY COME ON	SCANNED FOR CODES FOUND C1513. FOUND SHORTED STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH
KM8JM12B75U	5/09/05	16676	83.3	CHECKED WITH SCAN TOOL AND FOUND CODE C1501 BRAKE LIGHT SWITCH MALFUNCTION--INSPECTED AND FOUND BRAKE LIGHT SWITCH ADJUSTED PROPERLY --FOUND SHORTING INTERNALLY REPLACED BRAKE LIGHT SWITCH--CHECKED OPERATION --TEST DROVE --OK AT THIS TIME	CUST REPORTS ESP LIGHT IS ON--SOP	BRAKE LIGHT SWITCH MALFUNCTION	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE CHECKED WITH SCAN TOOL AND FOUND CODE C1501BRAKE LIGHT SWITHC MALFUNCTION--INSPECTED AND FOUND BRAKE LIGHT SWITCH ADJUSTED PROPERLY--FOU ND SHORTING INTERNALLY REPLACED BRAKE LIGHT SWITCH--CHECKED OPERATI
KM8JN12D56U	10/07/05	35455	33.34	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH -CHECKED OPERATION --OK AT THIS TIME	CUST REPORTS CHECK ENGINE LIGHT IS ON SOMETIMES	O2 SENSOR MALFUNCTION	OXYGEN SENSOR ASSY LH (UP) RE OXYGEN SENSOR ASSY LH (UP) RE CHECKED WITH SCAN TOOL AND FOUND CODE P013002 SENSOR CIRCUIT MALFUNCTION B1/S1 INSPECTEDAND FOUND NO ACTIVITY FROM B1 REPLACED B1 S102 SENSOR--CHECKED OPERATION TEST DROVE --OKAT THIS TIME
KM8JM12B45U	6/13/05	37655	31.86	REPLACED STOP LAMP SWITCH C/S ESP LIGHT INTERMITTENELY COME ON. SCANNED FOR CODES AND FOUND C1513. FOUND SHORTED STOP LAMP SWITCH.REPLACEMENT COMPLETE, NO WARNING LIGHTS NOW.	CUSTOMER STATES BLOWER INTERMITTENTLY SHUTS OFF	CHECKED BLOWER AND TEST DROVE VEHICLE	COULD NOT DUBPLICATE
KM8JN72D96U	10/06/05	15755	31.86	C/STATES ESC LIGHT COMES ON INTERMITTENTLY. FOUND SHORTED STOP LAMP SWITCH ASSY. REPLACED STOP LAMP SWITCH, OK AT THIS TIME.	CUSTOMER STATES ESC LIGHT COME ON INTERMITTENTLY	FOUND SHORTED STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH
KM8JN12D65U	4/20/05	35038	33.5				
KM8JN12D56U	10/07/05	35455	33.34	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH -CHECKED OPERATION --OK AT THIS TIME	CUST REPORTS CHECK ENGINE LIGHT IS ON SOMETIMES	O2 SENSOR MALFUNCTION	OXYGEN SENSOR ASSY (LH) ADD SCAN TOOL OPERATION OXYGEN SENSOR ASSY (LH) ADD SCAN TOOL OPERATION CHECKED WITH SCAN TOOL AND FOUND CODE P013002 SENSOR CIRCUIT MALFUNCTION B1/S1 INSPECTEDAND FOUND NO ACTIVITY FROM B1 REPLACED B1 S102 SENSOR--CHECKED
KM8JN12D56U	10/07/05	35455	33.34	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH -CHECKED OPERATION --OK AT THIS TIME	079 CAMPAIGN--AIRBAG COVER REPL	COMPLETED 079 CAMPAIGN	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT
KM8JN12D16U	12/08/05	11853	33.5				
KM8JM12B86U	12/28/05	21551	31.86	CUST. SAYS ESC LIGHT COMES ON. FOUND SHORTED STOP LAMP SWITCH. REPLACEMENT COMPLETE, NO LIGHT AT THIS TIME.	CUSTOMER STATES ESC LIGHT COMES ON	FOUND SHORTED STOP LMP SWITCH	REPLACED STOP LAMP SWITCH
KM8JM12B86U	12/28/05	21551	31.86	CUST. SAYS ESC LIGHT COMES ON. FOUND SHORTED STOP LAMP SWITCH. REPLACEMENT COMPLETE, NO LIGHT AT THIS TIME.	CUSTOMER STATES HEARS SQUEAKING NOISE WHEN TURNING WHEEL	BAD BEARING IN STEERING COLUMN	ORDERED STEERING COLUMN
KM8JN12D56U	10/07/05	35455	33.34	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH -CHECKED OPERATION --OK AT THIS TIME	CUST REPORTS ESC LIGHT IS COMING ON	BRAKE LIGHT SWITCH MALFUNCTION	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE CHECKED WITH SCAN TOOL AND FOUND CODE C1513BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH -CHECKED OPERATION --OK AT THIS TIME
KM8JN12D25U	6/01/05	17137	35.3	INSPECTED AND FOUND BRAKE LIGHT SWITCH HAS SHORTED INTERNALLY CAUSING ESP LIGHT TO COME ON REPLACED BRAKE LIGHT SWITCH--CHECKED OPERATION --TEST DROVE--OK AT THIS TIME	CUST REPORTS CHECK ENGINE LIGHT IS ON	O2 SENSOR MALFUNCTION	OXYGEN SENSOR ASSY LH (UP) RE OXYGEN SENSOR ASSY LH (UP) RE CHECKED WITH SCAN TOOL AND FOUND CODEP0130-02 SENSOR CIRCUIT MALFUNCTIONB1/S1--INSPECTED AND FOUND NO ACTIVITY FROMB1 REPLACED O2 SENSOR B1/S1--CLEAREDCODE--TEST DR OVE--OK AT THIS TIME
KM8JN72D06U	7/22/05	21619	32.46				

KM8JM12B36U	7/19/05	19599	32.14				ESC ECM REPROGRAMMING ESC ECM REPROGRAMMING
KM8JN72D85U	4/20/05	17655	33.2				SWITCH ASSY-STOP LAMP RE
KM8JN72D85U	4/20/05	17655	33.2				SWITCH ASSY-STOP LAMP RE
KM8JN12D25U	6/01/05	17137	35.3	INSPECTED AND FOUND BRAKE LIGHT SWITCH HAS SHORTED INTERNALLY CAUSING ESP LIGHT TO COME ON REPLACED BRAKE LIGHT SWITCH--CHECKED OPERATION- -TEST DROVE--OK AT THIS TIME	CUST REPORTS CHECK ENGINE LIGHT IS ON	O2 SENSOR MALFUNCTION	OXYGEN SENSOR ASSY (LH) ADD SCAN TOOL OPERATION OXYGEN SENSOR ASSY (LH) ADD SCAN TOOL OPERATION CHECKED WITH SCAN TOOL AND FOUND CODEP0130-O2 SENSOR CIRCUIT MALFUNCTIONB1/S1--INSPECTED AND FOUND NO ACTIVITY FROMB1 REPLACED O2 SENSOR B1/S1--CLEAREDCODE--TE
KM8JN12D25U	6/01/05	17137	35.3	INSPECTED AND FOUND BRAKE LIGHT SWITCH HAS SHORTED INTERNALLY CAUSING ESP LIGHT TO COME ON REPLACED BRAKE LIGHT SWITCH--CHECKED OPERATION- -TEST DROVE--OK AT THIS TIME	CUST REPORTS ESP LIGHT IS ON	BRAKE LIGHT SWITCH HAS INTERNAL SHORT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE INSPECTED AND FOUND BRAKE LIGHT SWITCH HASSHORED INTERNALLY CAUSING ESP LIGHT TO COMEON REPLACED BRAKE LIGHT SWITCH--CHECKEDOPERATION- -TEST DROVE--OK AT THIS TIME
KM8JN72D86U	7/27/05	14113	33.2				STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B56U	7/21/05	2940	33.2				STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B36U	7/14/05	20712	33.2		C/S/TS THE BRAKE LIGHTS ARE INOPERATIVE		FOUND STOP LAMP SWITCH BURN'T OUT - NECESSARY TO REPLACE SWITCH SWITCH ASSY- STOP LAMP RE
KM8JN12D56U	11/17/05	19372	34.26	19372 BRAKE LAMP SWITCH HAS AN OPEN CIRCUIT 93810ROO N94 C06 .3 NEC TO REPLACE BRAKE LAMP SWITCH			
KM8JM12B36U	7/12/05	16573	59.3	CHECKED WITH SCAN TOOL AND FOUND CODE C1513-BRAKE SWITCH ERROR REPLACED BRAKE LIGHT SWITCH--CHECKED OPERATION- -OPERATING NORMALLY	CUST REPORTS CHECK ENGINE LIGHT IS ON	BRAKE LIGHT SWITCH	SCAN TOOL BRAKE LIGHT SWITCH SCAN TOOL AND REPLACED BRAKE LIGHT SWITCH CHECKED WITH SCAN TOOL AND FOUND CODEC1513-BRA KE SWITCH ERROR REPLACED BRAKELIGHT SWITCH--CHECKED OPERATION- - OPERATINGNORMALLY
KM8JM12B36U	7/12/05	16573	59.3	CHECKED WITH SCAN TOOL AND FOUND CODE C1513-BRAKE SWITCH ERROR REPLACED BRAKE LIGHT SWITCH--CHECKED OPERATION- -OPERATING NORMALLY	CUST REPORTS CHECK ENGINE LIGHT IS ON	BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE CHECKED WITH SCAN TOOL AND FOUND CODEC1513-BRA KE SWITCH ERROR REPLACED BRAKELIGHT SWITCH--CHECKED OPERATION- - OPERATINGNORMALLY
KM8JN12D56U	11/17/05	22079	34.26	22079 STOP LAMP SWITCH BAD 93810ROO N69 C15 0.3 REMOVED AND REPLACED STOOP LAMP SWITCH			
KM8JN72D35U	6/10/05	3125	35.9	REPLACED STOP LAMP AS PER TECHLINE, ADJ DID NOT WORK AS PER REQUEST OF T/LINE, THEN WAS TOLD TO REPLACE SWITCH.	CUSTOMER STATES THAT THE ESP OFF LIGHT STAYS ON AND BUTTON DOES NOT FUNCTION, CAN SHUT VEHICLE OFF AND TURN BACK ON AND LIGHT GOES OUT.	REPLACED BRAKE LIGHTSWITCH	REPLACED BRAKE LIGHT SWITCH AS PER TECH LINE ELECTRICAL MISC
KM8JN72D35U	6/10/05	12250	35.9	SCAN -CODE C1513, REPLACED BRAKE LIGHT SWITCH, INTERMITTANT SHORT IN SWITCH			
KM8JN12D25U	6/01/05	32699	36.06	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH FAILURE REPLACED BRAKE LAMP SWITCH--CHECKED OPERATION OK AT THIS TIME	CUST REPORTS CHECK ENGINE LIGHT IS ON	O2 SENSORMALFUNCTION	OXYGEN SENSOR ASSY LH (UP) RE OXYGEN SENSOR ASSY LH (UP) RE CHECKED WITH SCAN TOOL AND FOUND CODE P013302B /S1 TRAN TIME-- CHECKED WITH SCAN TOOL ANDFOUND NO ACTIVITY FROM BANK 1 REPLACED O2SENSOR B1/S1 --CHECKED OPERATION - OK AT THISTIME
KM8JN12D25U	6/01/05	32699	36.06	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH FAILURE REPLACED BRAKE LAMP SWITCH--CHECKED OPERATION OK AT THIS TIME	CUST REPORTS CHECK ENGINE LIGHT IS ON	O2 SENSORMALFUNCTION	OXYGEN SENSOR ASSY (LH) ADD SCAN TOOL OPERATION OXYGEN SENSOR ASSY (LH) ADD SCAN TOOL OPERATION CHECKED WITH SCAN TOOL AND FOUND CODE P013302B /S1 TRAN TIME-- CHECKED WITH SCAN TOOL ANDFOUND NO ACTIVITY FROM BANK 1 REPLACED O2SENSOR B1/S1 --CHECKED OPERATI
KM8JN12D25U	6/01/05	32699	36.06	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH FAILURE REPLACED BRAKE LAMP SWITCH--CHECKED OPERATION OK AT THIS TIME	079 CAMPAIGN--D/S AIR BAG COVER	COMPLETED 079 CAMPAIGN	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT
KM8JN72D35U	6/10/05	2744	65.6	SCAN CHECK-CODES C1237 &P1513, CORRECTED PROBLEM WITH BRAKE LIGHT SWITCH, PERFORMED CORRECTION AS PER SERVICE MANUAL	CUSTOMER STATES THAT THE ESP OFF LIGHT STAYS ON AND BUTTON DOES NOT FUNCTION, CAN SHUT OFF VEHICLE AND TURN BACK ON AND LIGHT GOES OUT.	SCAN-ADJ SWITCH PER T/LINE	SCAN CHECK-CODE C1237 & C1513, CK'D SYSTEM AND ADJ SWITCH PER MANUALN ASPER T/LINE BRIAN ELECTRICAL MISC
KM8JN72D35U	6/10/05	2744	65.6	SCAN CHECK-CODES C1237 &P1513, CORRECTED PROBLEM WITH BRAKE LIGHT SWITCH, PERFORMED CORRECTION AS PER SERVICE	CUSTOMER STATES THAT THERE IS A RATTLE FROM RIGHT REAR SIDE PANEL AROUND SIDE GLASS, ALL SPEEDS ROUGHROADS.	INSULATED PANELS TO SILENCE NOISE	INSTALLED PADDING IN SIDEPANEL TO INSULATE PANELS BODY MISC

KM8JN12D25U	6/01/05	32699	36.06	CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH FAILURE REPLACED BRAKE LAMP SWITCH--CHECKED OPERATION OK AT THIS TIME	CUST REPORTS ESP LIGHT IS ON	BRAKE LIGHT SWITCH MALFUNCTION	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE CHECKED WITH SCAN TOOL AND FOUND CODE C1513BRAKE LAMP SWITCH FAILURE REPLACED BRAKE LAMP SWITCH--CHECKED OPERATION OK AT THIS TIME
KM8JM12B65U	6/30/05	7072	33.09		CUSTOMER STATES ESP LIGHT COMES ON AND OFF INTERMITTENTLY	TECH INSPECTED AND VERIFIED CONCERN, INSTALLED SCAN TOOL AND FOUND 1 DTC CODE C1513 BRAKE LIGHT SWITCH INTERMITTENT SHORT	TECH REMOVED AND INSTALLED NEW BRAKE LIGHT SWITCH
KM8JN12D05U	1/22/05	16190	33.66	ESP LIGHT STAYS ILLUMINATED, AS PER TECH LINE, REPLACED BRAKE LIGHT SWITCH AND ADJUST TO .030 & "QOT", CASE# 241857, (NOTE SERVICE MANUAL HAS WRONG SPECS)			
KM8JM12B76U	7/16/05	12291	62.46	SCAN CK-CODE B1513, INDICATING BRAKE LAMP CIRCUIT. BRAKE LIGHT SWITCH HAS INTERMITTANT OPEN CIRCUIT WHEN PEDAL	CUSTOMER STATES THAT THE ESC LIGHT COMES ON AND OFF INTERMITTENTLY WHILE DRIVING, BUTTON WILL NOT CANCEL OR OVERRIDE LIGHT.	BRAKE LIGHT SWITCH HAS INTERMITTANT OPEN CIRCUIT	BRAKE LIGHT SWITCH HAS INTERMITTANT OPEN CIRCUIT WHEN PEDAL DEPRESSED ELECTRICAL MISC
KM8JN72D55U	4/20/05	14815	62.46	SCAN CODE C1513, TRACED CODE TO A SHORT/OPEN IN BRAKE LIGHT SWITCH	CUSTOMER STATES THAT THE ESP LIGHT IS COMING ON INTERMITTENTLY, WHEN LIGHT COMES ON ESP BUTTON WILL NOT CANCEL LIGHT.	BRAKE LIGHT SWITCH HAS AN INTERMITTANT OPEN/SHORT IN SWITCH	SCAN CHECKED-CODE C1513, REPLACED BRAKE LAMP SWITCH ELECTRICAL MISC
KM8JM12BX6U	11/24/05	28948	31.13		CUSTOMER STATES BRAKE LIGHTS DO NOT WORK AND "ESC OFF" LIGHT IS ON	TECH INSPECTED AND VERIFIED CONCERN, INSTALLED SCAN TOOL FOUND C1513 CODE BRAKE LIGHT SWITCH OPEN CIRCUIT	TECH REMOVED AND INSTALLED NEW BRAKE LIGHT SWITCH TESTED AND CLEARED CODE
KM8JN12D76U	7/27/05	30429	31.13		CUSTOMER STATES "ESC OFF" LIGHT CAME ON.	TECH INSPECTED NAD VERIFIED CONCERN FOUND C1513 BRAKE LIGHT SWITCH OPEN CIRCUIT	TECH REMOVED NAD INSTALLED NEW BRAKE LIGHT SWITCH CLEARED CODE TESTED OKAY
KM8JN12D76U	7/27/05	30429	31.13		CUSTOMER STATES ENGINE WON'T START OR SPIN OVER, PLEASE INSPECT.	TECH INSPECTED AND VERIFIED CONCERN RAN BATTERY TEST AND FOUND BATTERY WITH ONLY 379 CCA FOR A 600 CCA BATTERY	TECH REMOVED AND INSTALLED NEW BATTERY AND TESTED OKAY
KM8JN12D57U	8/15/06	3544	33.94	VEH HAS ESC LIGHT, FAULT CODE C1513, REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES THAT THE ESC OFF LIGHT WILL NOT CANCEL.	BRAKE LIGHT SWITCH OPEN	SCAN CODE C1513, REPLACED BRAKE LIGHT SWITCH ELECTRICAL MISC
KM8JN72D46U	12/20/05	18956	37.86	VERIFIED CONCERN, PERFORMED GDS DIAG, FOUND CODE C1513, PERFORMED BRAKE LIGHT CIRCUIT DIAG, FOUND BRAKE SWITCH FAILED, REPLACED SWITCH, CLEARED CODE, RETESTED OK AT THIS TIME.	CUSTOMER STATES PASS FRONT SEATBELTBUCKLE WILL NOT LATCH AND UNLATCH INTERM.	VERIFIED CONCERN	BODY & TRIM BODY & TRIM VERIFIED CONCERN, FOUND BUCKLE HARD TO OPERATE, SPECIAL ORDERED PART.
KM8JM12B96U	10/19/05	22592	31.45		CUSTOMER STATES ESC/ABS LIGHT COMES ON.	TECH INSPECTED AND VERIFIED CONCERN C1513 BRAKE LIGHT SWITCH	TECH REMOVED AND INSTALLED NEW BRAKE LIGHT SWITCH AND CLEARED CODES
KM8JN12D56U	10/08/05	9654	31.13		CUSTOMER STATES "ESC" LIGHT COMES ON AND OFF.	TECH INSPECTED AND INSTALLED SCAN TOOL FOUND 1 DTC CODE GDS B1513 BRAKE LIGHT SWITCH INTERMITTENT SHORT CIRCUIT	TECH REMOVED AND INSTALLED NEW BRAKE LIGHT SWITCH AND TESTED OKAY
KM8JN12D56U	10/08/05	9654	31.13		CHECK FOR CAMPAIGN 079	TECH INSPECTED AND FOUND OLD STYLE AIRBAG COVER	TECH REMOVED OLD AIRBAG COVER AND INSTALLED NEW STYLE AIRBAG COVER AS PER CAMPAIGN 079
KM8JN72D46U	12/20/05	18956	37.86	VERIFIED CONCERN, PERFORMED GDS DIAG, FOUND CODE C1513, PERFORMED BRAKE LIGHT CIRCUIT DIAG, FOUND BRAKE SWITCH FAILED, REPLACED SWITCH, CLEARED CODE, RETESTED OK AT THIS TIME.	CUSTOMER STATES THAT THERE IS A CHIRP NOISE FROM BLOWER MOTOR.	VERIFIED CONCERN	HVAC HVAC OPERATED BLOWER AT DIFFERENT SPEEDS, UNABLE TO DUPLICATE, INSPECTED BLOWER AND HEATER CASE-OK, LET SIT, RETESTED AND FOUND NOISE COMING FROM BLOWER MOTOR, NEC TO REPLACE, SPECIAL ORDERED PART.
KM8JN72D46U	12/20/05	18956	37.86	VERIFIED CONCERN, PERFORMED GDS DIAG, FOUND CODE C1513, PERFORMED BRAKE LIGHT CIRCUIT DIAG, FOUND BRAKE SWITCH FAILED, REPLACED SWITCH, CLEARED CODE, RETESTED OK AT THIS TIME.	CUSTOMER STATES THAT ESC LIGHT CAME ON AND STAYED ON FOR AWHILE, NOW OFF.	VERIFIED CONCERN	SWITCH ASSY-STOP LAMP RE VERIFIED CONCERN, PERFORMED GDS DIAG, FOUND CODE C1513, PERFORMED BRAKE LIGHT CIRCUIT DIAG, FOUND BRAKE SWITCH FAILED, REPLACED SWITCH, CLEARED CODE, RETESTED OK AT
KM8JN12D36U	10/15/05	56432	31.45		CUSTOMER STATES ESC/ABS LIGHT KEEPS COMING ON AND GOING OFF.	TECH INSPECTED AND INSTALLED SCAN TOOL FOUND 1 DTC C1513 BRAKE LIGHT SWITCH INOP.	TECH REMOVED AND INSTALLED NEW BRAKE LIGHT SWITCH AND TESTED OKAY
KM8JM12BX6U	8/25/05	42055	54.88	CUSTOMER STATES "ESC OFF" LIGHT STAYS ON. AND VEHICLE HAS NO BRAKE LIGHTS. TECH INSPECTED AND INSTALLED SCAN TOOL FOUND 4 DTC CODES C1513, C1200, C1201, C1237. BRAKE LIGHT SWITCH OPEN CIRCUIT. TECH REMOVED AND INSTALLED NEW BRAKE LIGHT SWITCH AND			
KM8JM12B26U	10/08/05	16407	31.13		CUSTOMER STATES BRAKES ARE MAKING A SQUEALING NOISE	TECH INSPECTED BRAKES AND FOUND MARTIAL IN GOOD CONDITION FRONT AND REAR. TECH INSPECTED FRONT AND REAR PADS FOR WEAR.	TECH FOUND NO TROUBLE AT THIS TIME, FRONT AND REAR BRAKE PADS IN GOOD OPERATING CONDITION

KM8JN72D26U	11/15/05	21763	35.14	VERIFIED CONCERN, CHECKED FOR CODES WITH GDS, FOUND C1513-BRAKE SWITCH CIRCUIT TURNED OFF, REPLACED BRAKE SWITCH, CLEARED CODE, TEST DROVE, RETESTED OK AT THIS TIME.	CUSTOMER STATES CK ENG LIGHT ON	VERIFIED CONCERN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE VERIFIED CONCERN, CHECKED FOR CODES WITH GDS, FOUND C1513-BRAKE SWITCH CIRCUIT TURNED OFF, REPLACED BRAKE SWITCH, CLEARED CODE, TEST DROVE, RETESTED OK AT THIS TIME.
KM8JN12D16U	4/19/06	9423	37.86	PERFORMED ESC DIAG AND CHECKED FOR CODES, FOUND CODE B1315, BRK LAMP CIRCUIT DIAG, BRAKE LIGHTS INOP, TESTED SWITCH, FOUND SWITCH INTERMITTENT, R&P R SWITCH, RETESTED, OK NOW			
KM8JN72D26U	9/26/05	15518	37.54	VERIFIED CONCERN, FOUND BRAKE LAMP SWITCH CAUSING LAMPS TO BE INOP INTERM, REPLACED SWITCH, RETESTED OK AT THIS TIME.	RECALL	PER RECALL	RECALL RECALL REMOVE AND REPLACE AIRBAG COVER PER RECALL
KM8JM12B26U	10/08/05	16407	31.13		CUSTOMER STATES ESC LIGHT HAS COME ON	TECH INSPECTED AND VERIFIED CONCERN, INSTALLED SCAN TOOL AND FOUND 1DTC CODE B1513	TECH REMOVED AND INSTALLED NEW BRAKE LIGHT SWITCH, CLEARED CODES AND ROAD TESTED OKAY.
KM8JM12B26U	10/08/05	16407	31.13		CUSTOMER STATES DRIVER'S DOOR HAS A RATTLE INSIDE PANEL	TECH INSPECTED AND VERIFIED CONCERN, TRACE TO DRIVERS WINDOW REGULATOR BOLTS LOOSE.	TECH REMOVED DOOR PANEL AND TIGHTEN WINDOW REG. BOLTS TESTED OKAY
KM8JN12D65U	1/19/05	9663	34.88		CUSTOMER STATES THE BRAKE LAMP WILL COME ON AFTER THE VEHICLE IS SHUT OFF, AND E.S.P. LIGHT IS WHILE DRIVING PLEASE CK AND ADVISE	FOUND BRAKE LAMP SWITCH TO HAVE INTERNAL SHORT CAUSING BRAKE LAMPS TO STAY ON	REPLACED BRAKE LAMP SWITCH TO CORRECT CONCERN
KM8JN72D26U	9/26/05	15518	37.54	VERIFIED CONCERN, FOUND BRAKE LAMP SWITCH CAUSING LAMPS TO BE INOP INTERM, REPLACED SWITCH, RETESTED OK AT THIS TIME.	CUSTOMER STATES HAVING TO JUMP BATTERY AFTER LEAVING PARKED	VERIFIED CONCERN	WIRING-ROOF RE WIRING-ROOF RE VERIFIED CONCERN, REMOVED REAR HEADLINER ASSEMBLY, LOOSE CONNECTOR FOR INOP DOOR ALARM MAKING LAMP MALFUNCTION, REMOVED TAILGATE COVER TO ACCESS DOOR LATCH SWITCHES FOR INSPECTION, FOUND LOOSE PINS, CORRECTED LOOSE PINS, RETEST
KM8JN72D26U	9/26/05	15518	37.54	VERIFIED CONCERN, FOUND BRAKE LAMP SWITCH CAUSING LAMPS TO BE INOP INTERM, REPLACED SWITCH, RETESTED OK AT THIS TIME.	CUSTOMER STATES TAILGATE ILL STAYS ON	VERIFIED CONCERN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE VERIFIED CONCERN, FOUND BRAKE LAMP SWITCH CAUSING LAMPS TO BE INOP INTERM, REPLACED SWITCH, RETESTED OK AT THIS TIME.
KM8JN12D95U	10/14/04	19037	22.8		CUSTOMER REQUEST CHECK CRUISE-DOES NOT WORK	FOUND BRAKE SWITCH DEFECTIVE	REPLACED. 94810R00 0.3 N94 C15
KM8JN12D95U	10/14/04	19037	22.8		CUSTOMER REQUEST CHECK HORN-NO HONK AT TIMES	FOUND HORNS DEFECTIVE	REPLACED. 96600R0B 0.3 N94 C15
KM8JN12D06U	7/15/05	22945	33.66				
KM8JN12D06U	8/08/05	17322	33.66				
KM8JN72D85U	10/20/04	43885	36.43	REPLACE BRAKE LIGHT SWITCH	CUSTOMER CONCERN OF ESC LIGHT COMING ON	FOUND C1513 CODE, FAULTY BRAKE LIGHT SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACE BRAKE LIGHT SWITCH
KM8JN72D06U	10/15/05	29225	37.86	PERFORM GDS DIAG, FOUND C1513, REMOVE AND REPLACE FAILED BRAKE SWITCH, RETEST ROAD TEST	DAB RECALL	PER RECALL	RECALL RECALL REPLACE AIRBAG COVER PER RECALL
KM8JN72D06U	10/15/05	29225	37.86	PERFORM GDS DIAG, FOUND C1513, REMOVE AND REPLACE FAILED BRAKE SWITCH, RETEST ROAD TEST	CUSTOMER STATES VEHICLE DIES WHEN COMING TO A STOP, MORE AT IDLE.	CND	DRIVABILITY DRIVABILITY PERFORM COMPLETE INSPECTION, ROAD TEST COULD NOT VERIFY CUSTOMER CONCERN AT THIS TIME. NO PROBLEM FOUND CUSTOMER TO MONITOR AND RETURN IF PROBLEM PERSISTS
KM8JM12B07U	11/16/06	4475	33.66				
KM8JN12D36U	9/29/05	12372	35.3				
KM8JN12D46U	12/05/05	16925	33.36				
KM8JM12B06U	4/03/06	13320	33.36				
KM8JN72D06U	10/15/05	29225	37.86	PERFORM GDS DIAG, FOUND C1513, REMOVE AND REPLACE FAILED BRAKE SWITCH, RETEST ROAD TEST	CUSTOMER STATES ESC LIGHT COMES ON INTERM.	FAILED BRAKE SWITCH	ELECTRICAL ELECTRICAL PERFORM GDS DIAG, FOUND C1513, REMOVE AND REPLACE FAILED BRAKE SWITCH, RETEST ROAD TEST
KM8JN72D56U	10/09/05	30344	37.86	PERFORM COMPLETE DIAG, C1513, FOUND FAILED BRAKE LIGHT SWITCH, REMOVE AND REPLACE SWITCH, RETEST, ROAD TEST	CUSTOMER STATES WINDSHIELD GASKET COMING LOOSE, SOP IN	FAILED GASKET	MOULDING-WINDSHIELD GLASS(ALL) MOULDING-WINDSHIELD GLASS(ALL) REMOVE AND REPLACE FAILED WINDSHIELD GASKET (REMOVE WINDSHIELD TO GAIN ACCESS)
KM8JN12D06U	8/11/05	11595	33.36				
KM8JN72D06U	7/30/05	3218	29.9		C/S THAT THE ESC OFF LIGHT INTERMIT COMES ON WHILE DRIVING	CODE C1513 BRAKE LIGHT SWITCH FOUND SWITCH INT. SHORTED	REPLACE AND ADJUST FAULTY SWITCH RETEST OK AT THIS TIME
KM8JN72D86U	8/10/05	13975	33.36				
KM8JN72D56U	10/09/05	30344	37.86	PERFORM COMPLETE DIAG, C1513, FOUND FAILED BRAKE LIGHT SWITCH, REMOVE AND REPLACE SWITCH, RETEST, ROAD TEST	CUSTOMER STATES ESC OFF LIGHT STAY ON	FAILED BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE PERFORM COMPLETE DIAG, C1513, FOUND FAILED BRAKE LIGHT SWITCH, REMOVE AND REPLACE SWITCH, RETEST, ROAD TEST
KM8JN12D16U	12/29/05	4344	32.44				

KM8JM12B46U	1/12/06	29248	102.06	CUSTOMER STATES INTERMITTENTLY THE ESP LIGHT WILL NOT COME ON. ROAD TESTED AND VERIFIED CONCERN. TESTED AND FOUND 4 FAULT CODES, C1611, C1612, C1237, C1513. TESTED AND FOUND FAULTY BRAKE LIGHT SWITCH. REPLACED SWITCH AND REASSEMBLED AND RESET CODES AND RO			
KM8JN12D35U	11/27/04	40743	31.93				
KM8JN72D06U	11/11/05	15284	29.9		ESC LIGHT IS ON		REPLACED BRAKE LIGHT SWITCH
KM8JN72D86U	8/08/05	31583	33.36				
KM8JN12D56U	8/10/05	30563	33.36				
KM8JN72D86U	8/08/05	31583	33.36				
KM8JN72D96U	9/13/05	24264	55.86	CUSTOMER STATES BRAKE FLUID INDICATOR LIGHT IS ON. LEVEL CHECKED OK. RAN TESTING FOR ELECTRONIC DTC CODES FOUND CODE C1513. FOUND BAD BRAKE LIGHT SWITCH. REPLACED SWITCH AND REASSEMBLED. RESET CODES.			
KM8JM12B25U	10/21/04	20440	37.05				
KM8JM12B66U	7/09/05	32257	32.76				
KM8JN72D65U	10/07/04	31595	25.2	COULD NOT VERIFY ESC LIGHT IS ON. CHECK FOR CODES. NONE. NTF AT THIS TIME.	CUSTOMER STATES ESC LIGHT STAYS ON	INSPECTED AND FOUND NO CODES IN SYSTEM. NO UPDATES OR TSB.S AT THIS TIME.	ALL OPERATING AS DESIGNED
KM8JN12D65U	3/28/05	2020	109.12		CUST.STATES ALL LIGHTS IN DASH ARE ON	15	HARNES REPAIR FOR ABS LIGHT HARNES REPAIR FOR ABS LIGHT
KM8JN12D65U	3/28/05	2020	109.12		CUST.STATES ALL LIGHTS IN DASH ARE ON	15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JM12B95U	6/14/05	22864	60.06	INSPECT FOR CLICK NOISE. SCAN FOR CODES, C1513. REPLACE BRAKE LAMP SWITCH. RESET AND RETEST, ALL PASS.	CUSTOMER STATES BETWEEN TRANS WONT SHIFT - CHUGS ROAD TEST WITH CUSTOMER	CHECKED FOR TRANS CODES, NONE FOUND	RESET TRANS ADAPTIVES
KM8JM12B95U	6/14/05	22864	60.06	INSPECT FOR CLICK NOISE. SCAN FOR CODES, C1513. REPLACE BRAKE LAMP SWITCH. RESET AND RETEST, ALL PASS.	CUSTOMER STATES THERE IS A CLICK NOISE WHEN TURNING - ROAD TEST WITH CUSTOMER	ROAD TESTED WITH CUSTOMER, UNABLE TO DUPLICATE NOISE CHECKED FOR CODES, FOUND C1513, TRACED TO BRAKE LIGHT SWITCH- INTERMITTENT HIGH RESISTANCE. ADJUSTED SWITCH PER TSB	REPLACED BRAKE LIGHT SWITCH, CLEARED CODES AND RECHECKED - OK
KM8JN72D75U	1/24/05	1438	32.62	15	CUST, STATES THE E.S. P. LIGHT COMES ON WHILE DRIVING	15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN72D66U	12/05/05	7565	824.91	COMPLAINT TURNING RT CAUSES ECS SYSTEM TO ENGAGE--SCAN CODES-C1282, C1513, C1283 STORED, REPLACE BRAKE SWITCH, R AND R CUP HOLDER CONSOLE, SWAP G SENSOR FROM STOCK VEH-NO CHANGE. TEST YAW SENSOR VOLTAGE, STEP 1 4.98V-OK STEP 2 2.4 AND 2.0 TO 2.1V, CALL TE			
KM8JN12D76U	8/24/05	11712	33.96				
KM8JN12D56U	12/24/05	11740	33.64				
KM8JN72D55U	4/22/05	16257	35.6		STATES ESP LIGHT IS ON ADVISE		REPLACED BRAKE SWITCH
KM8JN72D36U	12/28/05	11241	33.82	CUST REPORTS THE ESC OFF LIGHT STAYS ON. CONFIRMED ESC LITE ON DTC B1513 BRAKE LAMP SWITCH TESTED TO FIND OPEN/SHORT ON CRUISE CONTROL SIDE. REPLACED TESTED-PROBLEM CORRECTED. CLEARED DTC	CUST REPORTS THE ESC OFF LIGHT STAYS ON	SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE CODE B1513 REPLACED BRAKE LIGHT SWITCH
KM8JN12D16U	8/13/05	26574	33.82	CUST REPORTS THE ESC AND THE CHECK ENGINE LIGHT WILL COME ON AT TIMES. CHECKED W/SCAN TOOL FOUND C1513 FOR ESC. CHECKED BRAKE S/W AND FOUND IT WAS NOT WORKING. R/R, WORKS OK NOW. CHECKED W/SCAN TOOL, FOUND P0150 FOR ENGINE. CHECKED O2 SENSOR DATA AND WORK	DRIVERS AIRBAG COVER MODULE REPLACEMENT	RECALL	DRIVERS AIRBAG COVER MODULE REPLACEMENT DRIVERS AIRBAG COVER MODULE REPLACEMENT REPLACED AIR BAG COVER PER RECALL
KM8JN72DX6U	8/29/05	35875	33.96				
KM8JN72D26U	11/23/05	16280	33.96		STATES ESC OFF LIGHT STAYS ON AT TIMES	C1513 - BRAKE SWITCH OPEN	REPLACE BRAKE SWITCH - OPEN @TIMES. CLEAR CODES AND RECHECK
KM8JN12D35U	5/23/05	29801	35.46	REPLACE BRAKE LIGHT SWITCH CODE C1513	CUSTOMER STATES VEHICLE WILL DIE WHILE AT IDLE. WHEN YOU COME TO A STOP AFTER DRIVING ALSO	FOUND TPS OUTPUT IRRATIC HAPPENED WHEN COASTING OFF HYW RAMP	REPLACED TPS
KM8JN12D35U	5/23/05	29801	35.46	REPLACE BRAKE LIGHT SWITCH CODE C1513	CUST STATES BRAKE LIGHT SWITCH FAIL	FOUND FAILED BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH CODE C1513
KM8JN12D16U	8/13/05	26574	33.82	CUST REPORTS THE ESC AND THE CHECK ENGINE LIGHT WILL COME ON AT TIMES. CHECKED W/SCAN TOOL FOUND C1513 FOR ESC. CHECKED BRAKE S/W AND FOUND IT WAS NOT WORKING. R/R, WORKS OK NOW. CHECKED W/SCAN TOOL, FOUND P0150 FOR ENGINE. CHECKED O2 SENSOR DATA AND WORK	CUST REPORTS THE ESC AND THE CK ENLIGHT WILL COME ON AT TIMES	O2 CONNECTOR AND BRAKE SWITCH	OXYGEN SENSOR ASSY RH (UP) RE OXYGEN SENSOR ASSY RH (UP) RE REPLACED BRAKE SWITCH AND REPAIRED O2 SENSORCONNECTER

KM8JN12D16U	8/13/05	26574	33.82	CUST REPORTS THE ESC AND THE CHECK ENGINE LIGHT WILL COME ON AT TIMES. CHECKED W/SCAN TOOL FOUND C1513 FOR ESC. CHECKED BRAKE S/W AND FOUND IT WAS NOT WORKING. R/R, WORKS OK NOW. CHECKED W/SCAN TOOL, FOUND P0150 FOR ENGINE. CHECKED O2 SENSOR DATA AND WORK	CUST REPORTS THE ESC AND THE CK ENLIGHT WILL COME ON AT TIMES	O2 CONNECTOR AND BRAKE SWITCH	OXYGEN SENSOR ASSY RH ADDSCAN TOOL OXYGEN SENSOR ASSY RH ADDSCAN TOOL REPLACED BRAKE SWITCH AND REPAIRED O2 SENSORCONNECTER
KM8JN72D75U	4/21/05	16527	61.26	ATT IS FOR SCAN TOOL TIME FOR ESC LIGHT THAT WAS ON	CUSTOMER STATES THAT THE ESC LIGHT COMES ON	FOUND CODE C1513 BRAKE SWITCH CIRCUIT	REPLACED BRAKE SWITCH
KM8JN12D45U	11/17/04	29749	59.83	ATT WAS ADDED FOR SCAN TOOL LABOR OP NOT INCLUDED.	CUST STATES ESP LIGHT BACK ON	PULLED CODES C1237 C1513 PRESSURE SENSOR AND BRAKE LAMP SWIT	REPLACED WITH UPDATED PART BRAKE LIGHTS
KM8JN12D16U	8/13/05	26574	33.82	CUST REPORTS THE ESC AND THE CHECK ENGINE LIGHT WILL COME ON AT TIMES. CHECKED W/SCAN TOOL FOUND C1513 FOR ESC. CHECKED BRAKE S/W AND FOUND IT WAS NOT WORKING. R/R, WORKS OK NOW. CHECKED W/SCAN TOOL, FOUND P0150 FOR ENGINE. CHECKED O2 SENSOR DATA AND WORK	CUST REPORTS THE ESC AND THE CK ENLIGHT WILL COME ON AT TIMES	O2 CONNECTOR AND BRAKE SWITCH	WIRE REPAIR TIME (MINOR) WIRE REPAIR TIME (MINOR) REPLACED BRAKE SWITCH AND REPAIRED O2 SENSORCONNECTER
KM8JN12D66U	9/29/05	22854	35.26	REPLACE INOP BRAKE LIGHT SWITCH	CUSTOMER STATES:ESC LIGHT COMES ON WHILE DRIVING MORE SO WHEN WHEN BRAKING OR GOING OVER BUMPS	VERIFY CUSTOMER CONCERN TEST ELECTRICAL/SCAN ENGINE CHECK FOR FAULT CODES CODE C1513 IN COMPUTER MEMORY BRAKESWITCH CIRCUIT FAILURE/FOUND BRAKE SWITCH SHORTED REMOVE AND REPLACE BRAKE SWITCH	CLEAR CODE RESET ESC WARNING LIGHT
KM8JN72D66U	10/18/05	18650	34.94	SRS LIGHT IS ON. FOUND BAS STOP LIGHT SWITCH	CUSTOMER STATES:SRS LIGHT IS ON	VERIFY CUSTOMER CONCERN SCAN ENGINE CHECK FOR FAULT CODES CODE C1513 IN COMPUTER MEMORY/FOUND BRAKE SWITCH DEFECTIVE REMOVE AND REPLACE BRAKE SWITCH CLEAR MEMORY CODE ROADTEST	94 15
KM8JN12DX5U	9/06/04	55334	33.83	REPLACE INOP STOP LAMP SWITCH	CUSTOMER STATES:ESC LIGHT IS ON AT ALL TIMES CAN NOT TURN OFF MANUALLY	TEST ELECTRICAL FOUND BRAKE LIGHT SWITCH MALFUNCTION	REMOVE AND REPLACE BRAKE LIGHT SWITCH RETEST ESC SYSTEM
KM8JN12D16U	8/13/05	26574	33.82	CUST REPORTS THE ESC AND THE CHECK ENGINE LIGHT WILL COME ON AT TIMES. CHECKED W/SCAN TOOL FOUND C1513 FOR ESC. CHECKED BRAKE S/W AND FOUND IT WAS NOT WORKING. R/R, WORKS OK NOW. CHECKED W/SCAN TOOL, FOUND P0150 FOR ENGINE. CHECKED O2 SENSOR DATA AND WORK	CUST REPORTS THE ESC AND THE CK ENLIGHT WILL COME ON AT TIMES	O2 CONNECTOR AND BRAKE SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE REPLACED BRAKE SWITCH AND REPAIRED O2 SENSORCONNECTER
KM8JN12D26U	7/27/05	13103	33.82	CUST REPORTS THE ESC OFF LIGHT WILL COME ON AT TIMES WHILE DRIVING. COULD NOT DUPLICATE CUSTOMER CONCERN DURING TEST DRIVE. FOUND SINGLE DTC STORED, CODE C1513. RELATES TO BRAKE SWITCH MALFUNCTION. BRAKE LIGHTS OPERATE AS DESIGNED, HOWEVER FAULTY CONTACTS	CUST REPORTS HE GETS 15-16 MPG IN TOWN AND 19 HIGHWAY IS THE BEST ITS DONE	MONITOR SENSORS	DRIVEABILITY DRIVEABILITY MONITERED SYSTEMS AND FOUND ALL SYSTEMSWITHIN PARAMETERS NO REPAIRS MADE ORATTEMPTED
KM8JN12DX5U	9/06/04	55334	33.83	REPLACE INOP STOP LAMP SWITCH	CUSTOMER STATES:VEHICLE IS LEAKING FLUID DIAGNOSE FLUID LEAK	INSPECT VEHICLE FOR FLUID LEAKS FOUND FLUID LEAKING FROM TRANSMISSION COOLER AND COOLER LINEREMOVE AND REPLACE TRANSMISSION COOLER AND COOLER LINES RECHECK FOR LEAKS	87 37
KM8JN72D45U	8/31/04	21034	35.85	C1513,SWITCH FAULTY	CUST STATES ESC LIGHT IS ON	15	DIAG TIME/SCAN TEST DIAG
KM8JN72D45U	8/31/04	21034	35.85	C1513,SWITCH FAULTY	CUST STATES ESC LIGHT IS ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D26U	7/27/05	13103	33.82	CUST REPORTS THE ESC OFF LIGHT WILL COME ON AT TIMES WHILE DRIVING. COULD NOT DUPLICATE CUSTOMER CONCERN DURING TEST DRIVE. FOUND SINGLE DTC STORED, CODE C1513. RELATES TO BRAKE SWITCH MALFUNCTION. BRAKE LIGHTS OPERATE AS DESIGNED, HOWEVER FAULTY CONTACTS	CUST REPORTS THE ESC OFF LIGHJT WILL COME ON AT TIMES WHILE DRIVING	BRAKE SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE FOUND INTERMITTENT FAILURE IN THE BRAKE LIGHTW SWITCH REPLACED THE SWITCH
KM8JN12D26U	7/27/05	13103	33.82	CUST REPORTS THE ESC OFF LIGHT WILL COME ON AT TIMES WHILE DRIVING. COULD NOT DUPLICATE CUSTOMER CONCERN DURING TEST DRIVE. FOUND SINGLE DTC STORED, CODE C1513. RELATES TO BRAKE SWITCH MALFUNCTION. BRAKE LIGHTS OPERATE AS DESIGNED, HOWEVER FAULTY CONTACTS	HYUNDAI LOANER 5NPEU46F37H287893	LOANER	HYUNDAI LOANER CAR HYUNDAI LOANER CAR
KM8JN12D06U	9/26/05	34418	37.56		CUSTOMER STATES HAS NO BRAKE LIGHT S	REPLACED BRAKE LIGHTSWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B57U	11/01/06	1455	37.56		CUST STATES ESC LIGHT IS COMING ON AND STAYS ON AND BUTTON WILL NOT SHUT LIGHT OFF	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D46U	8/08/05	1453	90		C/S RIGHT REAR TAILLIGHT CRACKED	06	REAR COMBINATION LAMP ASSY (RH) RE REAR COMBINATION LAMP ASSY (RH) RE 1453

KM8JN72D46U	8/08/05	1453	90		ESC OFF BUTTON STAYING ON	E	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 1453
KM8JN12D96U	12/07/05	18760	33.82	CUST REPORTS THE ESC OFF LIGHT WILL GO ON INTERMITTENTLY WHILE DRIVING. CONFIRMED INTERMITTENT ESC LIGHT. DTC C1513 - BRAKE LAMP SWITCH. REPLACED SWITCH AND CLEARED DTC. OPERATION NORMAL. PERFORMED AIR BAG MODULE UPDATE.	DRIVERS AIRBAG COVER MODULE REPLACEMENT	RECALL	DRIVERS AIRBAG COVER MODULE REPLACEMENT DRIVERS AIRBAG COVER MODULE REPLACEMENT REPLACE AIR BAG COVER PER RECALL
KM8JN12D96U	12/07/05	18760	33.82	CUST REPORTS THE ESC OFF LIGHT WILL GO ON INTERMITTENTLY WHILE DRIVING. CONFIRMED INTERMITTENT ESC LIGHT. DTC C1513 - BRAKE LAMP SWITCH. REPLACED SWITCH AND CLEARED DTC. OPERATION NORMAL. PERFORMED AIR BAG MODULE UPDATE.	CUST REPORTS TEH ESC OFF LIGHT WILLGO ON INTERMITTENTLY WHILE DRIVING	BRAKE SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE REPLACE BRAKE LIGHT SWITCH
KM8JN72D46U	8/08/05	1453	90		HERTZ RENTAL	E	
KM8JN72D46U	8/08/05	1453	90		HERTZ RENTAL	E	6 DAYS RENTAL OTHER
KM8JN72D46U	8/08/05	1453	32.32		C/S RIGHT REAR TAILLIGHT CRACKED	06	REAR COMBINATION LAMP ASS'Y (RH) RE REAR COMBINATION LAMP ASS'Y (RH) RE 1453
KM8JM12B47U	10/16/06	2501	33.82	CUSTOMER STATES THE ESC LIGHT IS ON AND HAS BEEN ON FOR 2 DAYS. CHECK OUT SCANNED FOR CODES FOUND B1513 BRAKE LIGHTS SWITCH CHECK OUT HAS 3 THREADS SHOWING PULLED SWITCH FOUND INTERNAL PROBLEM WITH BRAKE SWITCH REPLACED IT RECHECK OK.	CUSTOMER STATES THE ESC LIGHT IS ONAND HAS BEEN ON FOR 2 DAYS (CHECK &ADVISE)	BRAKE SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE CODE B1513 BRAKE LIGHT SWITCH FAILUREREPLACED SWITCH
KM8JN72DX6U	12/17/05	17867	34.14	CUSTOMER STATES THE BRAKE LIGHTS DON'T WORK. CHECKED W/SCAN TOOL. FOUND DTC C1513. R/R BRAKE S/W. WORKS	CUSTOMER STATES ENGINE OIKL LEAK (CHECK & ADVISE)	DRAIN PLU GASKET	FOUND DRAIN PLUG LEAKING FROM JIFFY LUBE (NOT WARRANTY)CUSTOMER WILL TAKE BACK TO JIFFY LUBE
KM8JN72DX6U	12/17/05	17867	34.14	CUSTOMER STATES THE BRAKE LIGHTS DON'T WORK. CHECKED W/SCAN TOOL. FOUND DTC C1513. R/R BRAKE S/W. WORKS	CUSTOMER STATES CAR SURGES/STUTTERSON DECELL (CHECK & ADVISE BOTH DECELL AND ACCELL)	ADJUST	CRUISE CONTROL CABLE CRUISE CONTROL CABLE
KM8JN72D46U	8/08/05	1453	32.32		ESC OFF BUTTON STAYING ON	E	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 1453
KM8JN72D46U	8/08/05	1453	32.32		HERTZ RENTAL	E	
KM8JN72D46U	8/08/05	1453	32.32		HERTZ RENTAL	E	6 DAYS RENTAL OTHER
KM8JN72D66U	7/16/05	20277	33.04	DIAG CODE C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH OK NOW	CUSTOMER STATES HEARS A RUBBING NOISE IN FRONT DRIVERS SIDE WHEN MAKING SLOW RIGHT HAND TURN WITH OUT BRAKE BEING ON - ON DOWN HILL MOTION	62465R00/C10/N29	BUSHING-CROSSMEMBER MOUNTING (ALL) RE BUSHING- CROSSMEMBER MOUNTING (ALL) RE 20277 FAULTY REAR SUBFRAME BUSHINGS REPLACEDBUSHINGS OK NOW
KM8JN72DX6U	12/17/05	17867	34.14	CUSTOMER STATES THE BRAKE LIGHTS DON'T WORK. CHECKED W/SCAN TOOL. FOUND DTC C1513. R/R BRAKE S/W. WORKS	CUSTOMER STATES CAR SURGES/STUTTERSON DECELL (CHECK & ADVISE BOTH DECELL AND ACCELL)	ADJUST	ACCELERATOR CABLE ASS'Y RE ACCELERATOR CABLE ASS'Y RE
KM8JN72DX6U	12/17/05	17867	34.14	CUSTOMER STATES THE BRAKE LIGHTS DON'T WORK. CHECKED W/SCAN TOOL. FOUND DTC C1513. R/R BRAKE S/W. WORKS	CUSTOMER STATES CAR SURGES/STUTTERSON DECELL (CHECK & ADVISE BOTH DECELL AND ACCELL)	ADJUST	THROTTLE BODY ASS'Y AND/OR GASKET RE THROTTLE BODY ASS'Y AND/OR GASKET RE
KM8JN72DX6U	12/17/05	17867	34.14	CUSTOMER STATES THE BRAKE LIGHTS DON'T WORK. CHECKED W/SCAN TOOL. FOUND DTC C1513. R/R BRAKE S/W. WORKS	CUSTOMER STATES THE BRAKE LIGHTS DON'T WORK (CHECK & ADVISE)	SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN72D66U	7/16/05	20277	33.04	DIAG CODE C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH OK NOW	CUSTOMER STATES THAT THE ESC LIGHT HAS BEEN ON - WENT ON OVER THE WEEKEND BUT NOW IS OFF	93810R00/C15/N94	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20277 CODE C1513 BRAKE LAMP SWITCHMALFUNCTION REPLACED BRAKE LIGHT SWITCH
KM8JN72D66U	7/16/05	20277	33.04	DIAG CODE C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH	PICK IP LOANER 6/25/07 PM	LOANER 3 DAYS DJ0183	EXPENSE DJ0183 3 DAYS LOANER EXPENSE LOANER 3 DAYS DJ0183
KM8JN12D95U	5/09/05	13124	35.74		CUSTOMER STATES ESP LIGHT STAYS ON.	SCANNED AND FOUND C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN12D95U	5/09/05	13124	35.74		AIR BAG RECALL		
KM8JN12D56U	11/21/05	23389	35.74		CUSTOMER STATES ECS LIGHT CAME ON THIS MORNING BUT IS OFF NOW.	SCANNED AND FOUND C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH AND CLEARED CODE 93810R00 .3
KM8JN12D85U	10/04/04	29623	31.93	TECHNICIAN FOUND FAULTY BRAKE SWITCH, REPLACED FAULTY BRAKE SWITCH ROAD TESTED OK NOW.	CUSTOMER STATES THAT THE CRUISE CONTROL WILL NOT ENGAGE - REPLACE SOP ORDERED	93810R00/C40/N94	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 29623 FAULTY BRAKE SWITCH REPLACED BRAKESWITCH
KM8JN72D35U	6/02/05	18229	32	REPLACE BAD STOPLAMP SWITCH	ESP LITE GOES ON AND OFF INTERMITTENDLY	E	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 18229 C1513 REPLACE STOPLAMP SWITCH
KM8JN72D35U	6/02/05	18229	32	REPLACE BAD STOPLAMP SWITCH	LOANER EXPENSE	F	7 DAYS LOANER STK #DH0207 LOANER EXPENSE
KM8JN12D27U	11/01/06	4	35.74		UPON INSPECTION TECH NOTICED ESP LIGHT IS ON	BRAKE SWITCH SEIZING	REPLACED BRAKE SWITCH 93810R00 .3
KM8JN12D85U	9/10/04	40787	35.46		CUSTOMER STATES WHILE DRIVING, ESP LIGHT COMES ON AT TIMES . SOMETIMES GOES OFF AFTER KILLING AND RESTARTING VEHICLE.		REPLACED PRESSURE SENSOR, STEERING WHEEL ANGLE SENSOR AND BRAKE SWITCH. 59150R00 .5, 93810R00 .3, 93480R00 .6
KM8JM12B86U	11/29/05	19878	36.06		CUSTOMER STATES CHECK ENGINE LIGHT ON-PART HERE	SCANNED AND FOUND P0133 O2 SENSOR SLOW RESPONSE B1/S1	REPLACED O2 SENSOR AND CLEARED CODE 39214R00 .9 + 39214R00 .3 N69 C15
KM8JN72D66U	10/07/05	29533	29.44		C/S TAIL LAMPS INOP AT TIMES LIKE THEY HACE A SHORT IN	INTERNAL PROBLEM IN BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN72D96U	10/07/05	26670	34.84				

KM8JN72D95U	5/26/05	34021	34.84		CUSTOMER STATES CAR SHUT DOWN WHEN DRIVING	93810R00 .3 98310NTT .5	REPLACED BRAKE LIGHT SWITCH
KM8JN72D95U	5/26/05	34021	34.84		CHECK BRAKES SHAKE	WARPED	MACHINED ROTORS (51712A00 1.1)
KM8JM12B86U	11/29/05	19878	36.06		CUSTOMER STATES ESC LIGHT COMES ON AT TIMES AND THEN WILL GO OFF	SCANNED AND FOUND C1513 BRAKE LAMP SWITCH SHORT/OPEN	REPLACED BRAKE LAMP SWITCH AND CLEARED CODE 93810R00 .3 N94 C15
KM8JN12D85U	4/20/05	51247	36.06		CUSTOMER STATES CHECK ENGINE LIGHT IS ON	SCANNED AND FOUND P0430 CATALYST EFFICIENCY FAIL-B2, P0130 O2 SENSOR CIR MAF, B1/S1, AND P0102 AIR FLOW SIG-LOW INPUT	REPLACED O2 SENSOR AND ORDERED CAT. CONVERTOR AND AIR FLOW METER. 39214R00 .9 + 39214RP0 .3 N69 C15
KM8JN12D85U	4/20/05	51247	36.06		ESP OFF LIGHT IS ON	SCANNED AND FOUND C1237-PRESSURE SENSOR-OTHER, C1260 STEERING W/SENSOR ABNORMAL, AND C1513 BRAKE LAMP SWITCH OPEN/SHORT	REPLACE MASTER CYLINDER SWITCH, STEERING ANGLE SENSOR AND BRAKE LAMP SWITCH, CLEARED CODES AND TEST DROVE TO VERIFY. 59150R00 .5 N66 C15 + 93480R00 .6 N69 C15 + 93810R00 .3 N94 C15
KM8JN72D86U	7/20/05	14167	35.16		C/S:ESC LIGHT COMES ON AND GOES BACK OFF CHECK COMPUTER HISTORY	R/R BRAKE LIGHT SWITCH	98310R00 .3
KM8JN72DX6U	7/20/05	19435	34.84		PERFORM RECALL (SOP)	RECALL	PERFORMED DRIVERSIDE FRONT AIRBAG RECALL 61B04R0 .2
KM8JN72DX6U	7/20/05	19435	34.84		ESC LIGHT GOING ON AND OFF	CUSTOMER STATES ESC LIGHT ON AN OFF C1513 SWITCH	C1237 REPLACED BRAKE SWITCH
KM8JN12D46U	10/11/05	12526	35.16				
KM8JN12D85U	4/20/05	51247	36.06		PLEASE PERFORM 079 DRIVER AIRBAG MODULE REPLACEMENT	079 CAMPAIGN	COMPLETED 079 CAMPAIGN 61B046R0 .2
KM8JN72D96U	10/14/05	32323	37.11		CUSTOMER STATES: ESC LIGHT COMES ON WHILE BRAKING/ ADVISE	FOUND TROUBLE CODE C1513 BRAKE SWITCH CIRCUIT. CHECKED CIRCUIT WIRING/CONNECTIONS AND FOUND ALL TO NOT BE DAMAGED. CHECKED SWITCH RESISTANCE AND FOUND IT TO BE OUT OF SPECIFIED RANGE. NEEDS	REPLACED SWITCH, TEST DROVE VEHICLE SEVERAL TIMES AND FOUND NO CODES TO RESET. 93810R00 .3 N94/C15
KM8JM12B86U	7/28/05	19404	30.64		CUSTOMER STATES ESC LIGHT IS ON	C1513 BRAKE LAMP SWITCH ELECTRICAL MALFUNCTION	REPLACED ESC LIGHT
KM8JN72D26U	8/17/05	21131	34.84				
KM8JN12D95U	11/10/04	19359	33.45		ECM REPROGRAM	RECALL	50B035R1
KM8JN72DX5U	12/04/04	38280	33.45				
KM8JN12D36U	7/28/05	28559	35.16	R/R STOP SWITCH	C/S BRAKE LIGHTS ARE INOP	TECH FOUND BRAKE SWITCH TO BE DEFECTIVE	R/R STOP SWITCH
KM8JM12BX6U	2/14/06	21821	30.64		CUST STATES ESC LIGHT COMES ON AND OFF	CHECKED WITH SCAN TOOL BRAKE LIGHT SWITCH MAF	REPLACED BRAKE LIGHT SWITCH OPERATES PROPERLY
KM8JM12B76U	1/13/06	13528	30.64		CUSTOMER STATES ESC LIGHT STAYS ON	CHECK WITH SCANN TOOL, C1813, BRAK SWITCH BRAKE LIGHT INOP	INSTALLED NEW BRAKE LIGHT SWITCH.
KM8JM12B76U	1/13/06	13528	30.64		CUSTOMER STATES:PERFORM OPEN CAMPAIGN 079, DRIVERS AIR BAG COVER MODULE REPLACEMENT	CAMPAIGN 079	CAMPAIGN 079 COMPLETED,DRIVERS AIR BAG MODULE COVER REPLACED
KM8JN72D56U	8/09/05	15837	35.16		C/S: ESC LIGHT WILL NOT GO OFF	INTERNAL FALIURE WITH ESC SWITCH REPLACE SWITCH 93810R00 C1513	REPLACE ESC SWITCH
KM8JN72D55U	10/26/04	44637	33.73		ESC LIGHT WILL NOT GO OFF....WENT OFF AND HAS NOT COME ON SINCE	N94 C15 9381R00 .3 ECS LIGHT WAS ON HAD SEVERAL CODES C1611 C1612 C1237 C1513	FOUND BRAKE SWITCH INTERMITTENLY NOT WORKING REPLACE SWITCH TEST DROVE 20MILES NO TROUBLE FOUND
KM8JN12D35U	1/31/05	32499	33.73	R/R STOP LAMP SWITCH	CHECK CRUISE CONTROL INOP	93810R00 .3 N69C15 DEFECTIVE SWITCH C1513	R/R STOP LAMP SWITCH
KM8JM12B57U	11/16/06	1670	30.64		CUST STATES ECS LIGHT COMES ON CK AND ADVISE	CHECKED WITH SCAN TOOL FOUND P1260 STEERING WHEEL ANGLE AND P1513 BRAKE LIGHT SWITCH MAFUNTION	INSTALLED NEW BRAKE LIGHT SWITCH ORDERED STEERING ANGLE SENSOR CLEARED CODE
KM8JM12B57U	11/16/06	1670	30.64		CUST STATES HESITATES AND SHAKES ON TAKE OFF	CHECKED FOR CODES IN THE TRANSMISSION AND THE ENGINE NONE FOUND ROAD TESTED	COULD NOT DUPLICATE AT THIS TIME
KM8JN12D35U	6/16/05	27827	30.96		CUST STATES THE ESC LIGHT COME ON	CHECKED WITH SCAN TOOL FOUND BRAKE LIGHT SWITCH MAFUNTION	INSTALLED NEW BRAKE LIGHT SWITCH CLEARED CODE NO MORE DTCS
KM8JN72D56U	11/23/05	8075	34.84		C/S: ESC LIGHT STAYS ON WHEN USING THE BUTTON OFF AND ON	INTERNAL FAILURE WITH BRAKE LIGHT SWITCH REPLACE SWITCH 93810R00	REPLACE SWITCH
KM8JN72D56U	11/23/05	8075	34.84		C/S:AIRBAG RECALL	RECALL	REPLACE COVER
KM8JM12BX6U	7/19/05	24880	30.64				
KM8JN12DX6U	9/26/05	18746	32.6		CUST. STATES THE EDC LIGHT FLASHES DRIVING INSTALL S.O.P. SENSOR	CODE C1513 BRAKE LIGHT SWITCH HIGH RESISTANCE IN SWITCH	CHECK CODES REPLACE BRAKE LIGHT SWITCH RESET CODES
KM8JM12B46U	7/11/05	18744	30.64		CUST STATES ESC LIGHT COMES ON WHEN DRIVING	CHECKED CODES WITH SCAN TOOL FOUND P1513 BRAKE CIRCUIT MAF	INSTALLED NEW BRAKE SWITCH CLEARED CODE NO MORE DTCS
KM8JN12DX6U	8/29/05	18022	32.46	18023 C1513 IN HISTORY. BRAKE LAMP SWITCH CIRCUIT ERR OR. CHECKED BRAKE LAMP SWITCH. PLUNGER IN SWITC H INTERMITTENTLY SEIZING IN THE OPEN POSITION C AUSING BRAKE LAMPS TO NOT ILLUMINATE PROPERLY. NEW BRAKE LAMP SWITCH NEEDED. REPLACED BRAKE LA MP SWITCH.	GUEST STATES THAT THE ESC LIGHT COMES ON AT ODD TIMES WHILE DRIVINGPLEASE CHECK AND ADVISE	SEE STORY	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 18023 C1513 IN HISTORY. BRAKE LAMP SWITCHCIRCUIT ERR OR. CHECKED BRAKE LAMP SWITCH.PLUNGER IN SWITC H INTERMITTENTLY SEIZING INTHE OPEN POSITION C AUSING BRAKE LAMPS TO NOTILLUMINATE PROPERLY. NEW BRAKE
KM8JN12D55U	5/25/05	21780	34.1	21780 SCAN, CODE B1513, DIAG PROBLEM WITH BRAKE SWITC H, FOUND VERY INTERMITTANTLY SWITCH WILL STICK IN THE OFF POSTION. REPLACE DEFECTIVE BRAKE LAM P SWITCH.	AIR BAG COVER MODULE	PP	RECALL 079 RECALL 079 21780 REPLACE DRIVERS AIR BAG, RECALL 079

KM8JN12D55U	5/25/05	21780	34.1	21780 SCAN, CODE B1513, DIAG PROBLEM WITH BRAKE SWITCH, FOUND VERY INTERMITTANTLY SWITCH WILL STICK IN THE OFF POSITION. REPLACE DEFECTIVE BRAKE LAMP SWITCH.	ESP LIGHT COMES ON INTERMITTENTLY	REPLCED SWITCH	SWITCH ASSY-STOP LAMP RE 21780 SCAN, CODE B1513, DIAG PROBLEM WITHBRAKE SWITCH, FOUND VERY INTERMITTANTLYSWITCH WILL STICK IN THE OFF POSITION. REPLACEDDEFECTIVE BRAKE LAMP SWITCH.
KM8JM12B26U	7/13/05	18389	34.86	18389 BRAKE LIGHT INTERMITTENT OPEN LINE 93810R00 .3 INSPECT BRAKE LIGHT SWI OPEN LINE FOUND WHILE PRESING PEDAL STICK STOCK AT TIMES REPLACE BRAKE LIGHT SWI OK THIS TIME	CUST STATES REAR BRAKE LIGHTS INOP	E	SWITCH ASSY-STOP LAMP RE 18389 BRAKE LIGHT INTERMITTENT OPEN LINE93810R00 .3 INSPECT BRAKE LIGHT SWI OPEN LINEFOUND WHILE PRESING PEDAL STICK STOCK ATTIMES REPLACE BRAKE LIGHT SWI OK THIS TIME
KM8JN12D75U	6/03/05	53267	34.54	53267 BRAKE LIGHT SWITCH SHORTED 93810R00.3 .3-1329 REPLACE STOP LAMP SWITCH ASSY	079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	E	079 CAMPAIGN REPLACE DRIVER AIRBAG MODULE 079 CAMPAIGN REPLACE DRIVER AIRBAG MODULE 53267 079 RE/CALL 61B46RO.2 .2-1329 079RE/CALL COMPLETED
KM8JN12D75U	6/03/05	53267	34.54	53267 BRAKE LIGHT SWITCH SHORTED 93810R00.3 .3-1329 REPLACE STOP LAMP SWITCH ASSY	CUST STATES REAR BRAKE LIGHTS INOP	E	SWITCH ASSY-STOP LAMP RE 53267 BRAKE LIGHT SWITCH SHORTED 93810R00.3.3-1329 REPLACE STOP LAMP SWITCH ASSY
KM8JM12B17U	11/07/06	826	32.46	826 DIAG, FOUND THAT BRAKE SWITCH IS STUCK IN AND WILL NOT PASS CURRENT. REPLACE STUCK BRAKE SWITCH.	GUEST STATES THE CRUISE CONTROL WILL NOT DISENGAGE WHEN YOU HIT THEBRAKE PEDAL	OPEN	SWITCH ASSY-STOP LAMP RE 826 DIAG, FOUND THAT BRAKE SWITCH IS STUCK INAND WILL NOT PASS CURRENT. REPLACE STUCKBRAKE SWITCH.
KM8JN12D66U	11/28/05	5952	34.1	5952 SCAN, CODE C1513, DIAG, FOUND INTERMITTANTLY STOP LAMP SWITCH WILL NOT PASS CURENT, REPLACE DEFECTIVE STOP SWITCH.	CUST STATES ESC LIGHT IS COMING ON SOP	SEE STORY	SWITCH ASSY-STOP LAMP RE 5952 SCAN, CODE C1513, DIAG, FOUNDINTERMITTANTLY STOP LAMP SWITCH WILL NOT PASSCURRENT, REPLACE DEFECTIVE STOP SWITCH.
KM8JN12D66U	12/09/05	11696	34.86	11696 SCANTOOL NO CODE ALL SYSTEM CHECK 93810R00 1353 .3 CHECK BRAKE LIGHT SWITCH MALFUNCTION REPLACE BRAKE LIGHT SWITCH ASSY TESTED DRIVE NO PROBLEM OK	CUSTOMER STATES BRAKE INDICATOR LIGHT COMES ON AT TIMES. LIGHT NOT ON AT TIME OF WRITE UP	E	SWITCH ASSY-STOP LAMP RE 11696 SCANTOOL NO CODE ALL SYSTEM CHECK93810R00 1353 .3 CHECK BRAKE LIGHT SWITCHMALFUNCTION REPLACE BRAKE LIGHT SWITCH ASSYTESTED DRIVE NO PROBLEM OK
KM8JM12B57U	11/14/06	1691	34.86	1691 BRAKE LIGHT SWI STUCK IN 93810R00 .3 DTC-C1315 INSPECT BRAKE LIGHT SWI FOR ADJUSTMEN T FOUND SWI STOCK IN REPLACE BRAKE LIGHT SWI	CUSTOMER STATES THAT FUEL TANK DOORWONT OPEN , PLEASE ADVISE.	E	ADJUST PLASTIC FUEL DOOR/STILL MIGHT HAVE FUTURE PROBLEMS MISC MECHANICAL 1691 ADJUST DOOR
KM8JN12D06U	8/29/05	15251	32.14	15251 FOUND CODE C1513 BEAKE LAMP SWITCH. FOUND THAT INTERMITLY THE SWITCH WOULD NOT MAKE PROPER CONTACT INTERNALLY. REMOVED AND REPLACED BRAKE LAMP SWITCH TESTED. CODE DID NOT RETURN AT THIS TIME.	ESC LIGHT IS ON	SEE	SWITCH ASSY-STOP LAMP RE 15251 FOUND CODE C1513 BEAKE LAMP SWITCH.FOUND THAT INTERMITLY THE SWITCH WOULD NOTMAKE PROPER CONTACT INTERNALLY. REMOVED ANDREPLACED BRAKE LAMP SWITCH TESTED. CODE DIDNOT RETURN AT THIS TIME.
KM8JM12B16U	1/06/06	14732	32.46	14733 BRAKE LAMPS INTERMITTENTLY NOT ILLUMINATING WHI LE APPLYING BRAKES. BRAKE LAMP SWITCH PLUNGER I S STICKING. NEW BRAKE LAMP SWITCH NEEDED. REPLA CED BRAKE LAMP SWITCH. BRAKE LAMPS OPERATING AS DESIGNED.	GUEST STATES ESC LIGHT IS ON SOP	SEE STORY	SWITCH ASSY-STOP LAMP RE 14733 BRAKE LAMPS INTERMITTENTLY NOTILLUMINATING WHI LE APPLYING BRAKES. BRAKELAMP SWITCH PLUNGER I S STICKING. NEW BRAKELAMP SWITCH NEEDED. REPLA CED BRAKE LAMP SWITCH. BRAKE LAMPS OPERATING AS DESIGNED
KM8JM12B57U	11/14/06	1691	34.86	1691 BRAKE LIGHT SWI STUCK IN 93810R00 .3 DTC-C1315 INSPECT BRAKE LIGHT SWI FOR ADJUSTMEN T FOUND SWI STOCK IN REPLACE BRAKE LIGHT SWI	CUSTOMER STATES THAT ESC LIGHT GOES ON AND OFF	E	SWITCH ASSY-STOP LAMP RE 1691 BRAKE LIGHT SWI STOCK IN 93810R00 .3DTC-C1315 INSPECT BRAKE LIGHT SWI FORADJUSTMEN T FOUND SWI STOCK IN REPLACE BRAKELIGHT SWI
KM8JM12B46U	7/21/05	16061	34.54	16061 C1513 BRAKE LAMP SWITCH 93810R00 1353 .3 PERFORMED INSPECTION AS OUTLINED ON TSB 06-50-0 06. NECESSARY TO REPLACE BRAKE LAMP SWITCH. DON E.	CUSTOMER STATES WHILE DRIVING VEHICLE ON HIGHWAY ESC LIGHT COMES AT TIMES	E	SWITCH ASSY-STOP LAMP RE 16061 C1513 BRAKE LAMP SWITCH 93810R00 1353.3 PERFORMED INSPECTION AS OUTLINED ON TSB06-50-0 06. NECESSARY TO REPLACE BRAKE LAMP SWITCH. DON E.
KM8JN72D25U	7/04/05	32059	32.3		CUSTOMER STATES ESP LIGHT ON*PARTS ORDERED*	E	STOP LAMP SWITCH ASS'Y RE SWITCH ASSY-STOP LAMP RE
KM8JN72DX6U	8/19/05	27252	30.66		CUSTOMER STATES ESC LIGHT FLASHES ON AND OFF	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D35U	6/02/05	26278	60.34	ATT FOR SCAN TEST FOR ESP LIGHT ON			
KM8JM12B35U	5/18/05	18258	60.66	REPLACED BRAKE LAMP SWITCH			

KM8JN12D15U	5/30/05	10587	36.5	10587 C1513 BRAKE LIGHT SWITCH 93810R00 1353 .3 REPLACE BRAKE LAMP SWITCH. RESET SYSTEM. OK	CUSTOMER STATES "ESP OFF" LIGHT ON INSTRUMENT CLUSTER COMES ON BY ITSELF WHILE DRIVING	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 10587 C1513 BRAKE LIGHT SWITCH 93810R00 1353.3 REPLACE BRAKE LAMP SWITCH. RESET SYSTEM.OK
KM8JN12DX6U	12/13/05	29158	34.54	ALL BRAKE LIGHT INOP REPLACE SHORTED STOP LAMP SWITCH ADJ AS NEC FOUND LEFT REAR BULB BLOWN NEC TO REPALCE BULB CLEAN SOCKET AND CK SYS	ALL BRAKE LIGHTS INOPERATIVE	.	REPLACE STOP LAMP SWITCH MISC MECHANICAL 29158 93810R00 18642R00 .5 1606 REPLACESHORTED STOP LAMP SWITCH ADJUST AS NEC FOUNDLEFT REAR BULB BLOWN NEC TO REPLACE BULBCLEAN SOCKET AND CHECK SYSTEM
KM8JN12DX6U	12/13/05	29158	34.54	ALL BRAKE LIGHT INOP REPLACE SHORTED STOP LAMP SWITCH ADJ AS NEC FOUND LEFT REAR BULB BLOWN NEC TO REPALCE BULB CLEAN SOCKET AND CK SYS	ALL BRAKE LIGHTS INOPERATIVE	.	BULBS (LH) RE BULBS (LH) RE 29158 93810R00 18642R00 .5 1606 REPLACESHORTED STOP LAMP SWITCH ADJUST AS NEC FOUNDLEFT REAR BULB BLOWN NEC TO REPLACE BULBCLEAN SOCKET AND CHECK SYSTEM
KM8JN72D15U	10/05/04	21173	59.23	ATT TIME FOR DIAGNOSIS FOR GAS AND SPC LIGHTS ON-CODE C1513 STORED-REPLACED STOP LAMP SWITCH			
KM8JN72D16U	10/14/05	31270	34.84				
KM8JN72D45U	4/27/05	23370	60.66	ATT TIME FOR SCAN TEST-CODE C1513 STORED-REPLACED STOP LAMP SWITCH			
KM8JN72D66U	8/09/05	14832	34.86	14832 SCANTOOL CODE C1353 ESC/EPS BRAKE LAMP SWITCH 98310R00 1353 .3 REPLACE SWITCH BRAKE LAMP ASSY CHECK SYSTEM NO PROBLEM TESTED DRIVE CESAR MANAGER OK	CUST STATES CHECK ENGINE LIGHT CAMEON	E	ADJUST SPEED SENSOR MISC MECHANICAL 14832 SCANTOOL NO CODE ENGINE ANDTRANSMISSION OK 1353 N/C CHECK ALL SYSTEMCAR AJUSTER SPEED SENSOR WIRE CONNECTOR OKTESTED DRIVE
KM8JN72D66U	8/09/05	14832	34.86	14832 SCANTOOL CODE C1353 ESC/EPS BRAKE LAMP SWITCH 98310R00 1353 .3 REPLACE SWITCH BRAKE LAMP ASSY CHECK SYSTEM NO PROBLEM TESTED DRIVE CESAR MANAGER OK	CUST STATES ESC LIGHT COMES ON ALSOABS LIGHT	E	98310R00 MISC MECHANICAL 14832 SCANTOOL CODE C1353 ESC/EPS BRAKE LAMP SWITCH 98310R00 1353 .3 REPLACE SWITCH BRAKE LAMP ASSY CHECK SYSTEM NO PROBLEM TESTEDDRIVE CESAR MANAGER OK
KM8JM12B75U	4/16/05	26211	36.19	REMOVED AND REPLACED BRAKE LAMP SWITCH. RECHECK ED OPERATION	CUST STATES BRAKE LIGHTS INOP. WAS CHECKED MIGHT NEED A BRAKE LIGHT SWITCH. CHECK AND ADVISE	FOUND BRAKE LAMP SWITCH INOP	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY REMOVED AND REPLACED BRAKE LAMP SWITCH.RECHECK ED OPERATION
KM8JN72D06U	10/08/05	26892	36.51	FOUND FAULT CODE C1513 BRAKE LAMP OPEN CICURT REPLACED SWITCH	CUST STATES VEHICLE HAS A HARD START	ELECTRICAL MALFUNCTION'	AIR FLOW SENSOR ASSY RE AIR FLOW SENSOR ASSY RE FOUND FAULT CODE P0105 AIR FLOE SENSOR SIGNALL OW REPLACED SENSOR ALL OK
KM8JN72D06U	10/08/05	26892	36.51	FOUND FAULT CODE C1513 BRAKE LAMP OPEN CICURT REPLACED SWITCH	CUST STATES VEHICLE HAS A HARD START	ELECTRICAL MALFUNCTION'	AIR FLOW SENSOR ADD SCAN TOOL OPERATION AIR FLOW SENSOR ADD SCAN TOOL OPERATION FOUND FAULT CODE P0105 AIR FLOE SENSOR SIGNALL OW REPLACED SENSOR ALL OK
KM8JN72D66U	8/09/05	14832	34.86	14832 SCANTOOL CODE C1353 ESC/EPS BRAKE LAMP SWITCH 98310R00 1353 .3 REPLACE SWITCH BRAKE LAMP ASSY CHECK SYSTEM NO PROBLEM TESTED DRIVE CESAR MANAGER	CUST STATES VEHICLE WHEN SLOWING DOWN VEHICLE WILL STALL OUT	E	REF TO LINE A MISC MECHANICAL 14832 LINE A AND B SEEN PROBLEM OK 1353 N/C DONE
KM8JN12D96U	9/23/05	35584	60.24	AIRBAG LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 SET REPLACED SWITCH AND RESET CODE	CUSTOMER STATES ESC LIGHT STAYS ON	FOUND CODES C1513 BRAKE SW-MAL & C1237 PRESSOR SENSOR-MAL. FOUND CIRCUIT MALFUNCTION IN THE SENSOR & SWITCH.	REPLACED BRAKE PRESSURE SENSOR & BRAKE LIGHT SWITCH, RESET ECU, TESTED, OPERATION NORMAL. 9566ORPO -0.3 93810R00 -0.3 59150R00 -0.5 N69 C15
KM8JN72D06U	10/08/05	26892	36.51	FOUND FAULT CODE C1513 BRAKE LAMP OPEN CICURT REPLACED SWITCH	CUST STATES ESC LIGHT COMES ON INTERMITTENTLY	ELECTRICAL MALFINCTION	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE FOUND FAULT CODE C1513 BRAKE LAMP OPEN CICURTREPLACED SWITCH
KM8JN72D16U	12/06/05	11712	36.51	NECESSARY TO REPLACE BRAKE LAMP SWITCH, CLEARED CODE AND ROAD TEST VEHICLE. WORKING AS DESIGNE D	CUST STATES WHEN SLOWING DOWN VEHICLE VEHICLE DOWN SHIFTS THEN SURGES INTERMITTENTLY	SCANNED FOR CODE FOUND CODE C1513 BRAKE LAMP SWITCH OPEN/SHORT ON CRUISE SIDE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE NECESSARY TO REPLACE BRAKE LAMP SWITCH,CLEARED CODE AND ROAD TEST VEHICLE. WORKINGAS DESIGNE D
KM8JN12D96U	9/23/05	35584	60.24	AIRBAG LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 SET REPLACED SWITCH AND RESET CODE	CUSTOMER STATES ENGINE HAS RATTLE NOISE THAT SOUND LIKE LIFTERS AFTER VEHICLE IS LOADED (A/C ON) AND WARM	FOUND NOISE POSSIBLY RELATED TO ENGINE OIL FILTER.	NO WORK DONE.
KM8JN12D96U	9/23/05	35584	60.24	AIRBAG LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 SET REPLACED SWITCH AND RESET CODE	CAMPAIGN 079 - DRIVERS AIRBAG COVER MODULE	61B046R0 -0.2	RECALL COMPLETED.
KM8JN12D85U	5/31/05	13875	59.92	TT TIME FOR SCAN TOOL AIRBAG LIGHT ON CODE C1513 REPLACE SWITCH AND RESET CODE	ESP LIGHT ON SOP	CODE C1513 SET.BRAKE SWITCH MALFUNCTION.	REPLACE STOP LAMP SWITCH AND ADJUST.CLEAR CODE. 93810R00 0.3 93810RP0 0.3 N69
KM8JN72D16U	12/06/05	11712	36.51	NECESSARY TO REPLACE BRAKE LAMP SWITCH, CLEARED CODE AND ROAD TEST VEHICLE. WORKING AS DESIGNE D	CUST STATES WHEN SLOWING DOWN VEHICLE VEHICLE DOWN SHIFTS THEN SURGES INTERMITTENTLY	SCANNED FOR CODE FOUND CODE C1513 BRAKE LAMP SWITCH OPEN/SHORT ON CRUISE SIDE	SUBLET REPAIRS NECESSARY TO REPLACE BRAKE LAMP SWITCH,CLEARED CODE AND ROAD TEST VEHICLE. WORKINGAS DESIGNE D
KM8JN72D16U	12/06/05	11712	36.51	NECESSARY TO REPLACE BRAKE LAMP SWITCH, CLEARED CODE AND ROAD TEST VEHICLE. WORKING AS DESIGNE D	RENTAL VEHICLE	LOANER VEHICLE	RENTAL VEHICLE RENTAL VEHICLE LOANER VEHICLE

KM8JN12D85U	6/17/05	14460	36.19	REMOVED AND REPLACED BRAKE LIGHT SWITCH. CLEAR CODE RECHECKED OK	CUSTOMER STATES CHECK ENGINE LIGHT IS ON CHECK AND REPORT	FOUND CODE C1513 BRAKE LIGHT SWITCH MAL.	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY REMOVED AND REPLACED BRAKE LIGHT SWITCH. CLEAR CODE RECHECKED OK
KM8JN12D85U	5/31/05	13875	59.92	TT TIME FOR SCAN TOOL AIRBAG LIGHT ON CODE C1513 REPLACE SWITCH AND RESET CODE	REAR LIGHTER IS IN OP	CENTER CONSOLE SOCKET COVER CAME OFF.	REPLACE CENTER CONSOLE REAR SOCKET ASSY. 95120R00 0.2 N86 C06
KM8JN12D45U	5/18/05	19309	36.59		ESP LIGHT COMES ON AND STAYS ON	TEST WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH & C1237 PRESSURE SENSOR-OTHER. TEST AND FOUND BAD BRAKE LAMP SWITCH CAUSING PROBLEM.	REPLACED BRAKE LAMP SWITCH AND REASSY. AND ADJUST. 93810R00 0.3 N94 C15
KM8JN12D45U	5/18/05	19309	36.59		WHEN MAKING HARD LEFT TURN MAKES A RUBBING NOISE	ROAD TEST FOR RUBBING NOISE. NO NOISE WAS HEARD.	CANNOT DUPLICATE CUSTOMER CONCERN AT THIS TIME.
KM8JN12D85U	6/17/05	14460	36.19	REMOVED AND REPLACED BRAKE LIGHT SWITCH. CLEAR CODE RECHECKED OK	DRIVER SIDE AIR BAG MODULE REPLACEMENT (RECALL)	FOUND RECALL 079	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT PERFORMED RECALL 079
KM8JN72D75U	3/10/05	22204	26.96	FOUND FAULT CODE P1513 BRAKE LIGHT SWITCH SHORT ED INTERNALLY REPLACED SWITCH ALL OK AT THIS TIME	CUSTOMER STATES THE ESP LIGHT IS ON	ELECTRICAL MALFUNCTION	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY FOUND FAULT CODE P1513 BRAKE LIGHT SWITCH SHORT ED INTERNALLY REPLACED SWITCH ALL OK AT THIS TIME
KM8JN72DX6U	10/19/05	8954	36.51	FOUND FAULT CODE C1513 FOUND INTERNAL SHORT IN SWITCH REPLACED SWITCH ALL OK AT THIS TIME	CUSTOMER STATES ESC LIGHT OFF LIGHT WILL NOT GO OUT	ELECTRICAL MALFUNCTION	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE FOUND FAULT CODE C1513 FOUND INTERNAL SHORT IN SWITCH REPLACED SWITCH ALL OK AT THIS TIME
KM8JN12D35U	6/01/05	29515	34.95		ESP LIGHT COMES ON	CODE C1513 SET. STOP LAMP SWITCH MALFUNCTION.	REPLACE STOP LAMP SWITCH. CLEAR CODE. 93810R00 0.3 N69 C15
KM8JN12D35U	6/01/05	29515	34.95		CK ENG LIGHT COMES ON	CODE P0150 SET. B2/S1 02 SENSOR MALFUNCTION.	REPLACE LEFT UPPER 02 SENSOR. CLEAR CODE AND TEST. 02 OPERATION CHECK NORMAL. 39213R00 0.5 39213RP0 0.3 N69 C15
KM8JN12D46U	7/19/05	16692	59.92	TT TIME FOR SCAN TOOL CODE C1513 REPL SWITCH AND RESET CODE	CUSTOMER STATES ESC LIGHT STAYS ON	FOUND CODE C1513 BRAKE LAMP SW. FOUND OPEN CIRCUIT IN STOP LAMP SWITCH ASSY.	REPLACED STOP LAMP SWITCH ASSY. RESET MODULE, TESTED, OPERATION NORMAL. 95660RPO - 0.3 93810R00 - 0.3 N94 C15
KM8JM12B16U	1/11/06	24214	36.19	REPLACED STOP LAMP SWITCH INCLUDING ALL NECESSARY DISMANTLING. RECHECKED OPERATION WORKING AS DESIGNED	CUST STATES SMELLS ANTIFREEZE WHEN AT AN IDLE FOR SHORT PERIOD OF TIME	VERIFIED CUSTOMER'S CONCERN. FOUND UPPER RADIATOR HOSE LEAKING	RADIATOR UPPER HOSE RE RADIATOR UPPER HOSE RE REPLACED UPPER RADIATOR HOSE INCLUDING ALL NECESSARY DISMANTLING. TOPPED OFF COOLANT AND RECHECKED OPERATION WORKING AS DESIGNED
KM8JM12B16U	1/11/06	24214	36.19	REPLACED STOP LAMP SWITCH INCLUDING ALL NECESSARY DISMANTLING. RECHECKED OPERATION WORKING AS DESIGNED	PERFORM RECALL 079	PERFORMED RECALL 079	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT PERFORMED RECALL 079
KM8JN12D46U	7/19/05	16692	59.92	TT TIME FOR SCAN TOOL CODE C1513 REPL SWITCH AND RESET CODE	PERFORM 079 DRIVER AIRBAG COVER MODULE REPLACE CAMPAIGN -SOP-	61B046R0 -0.2	RECALL COMPLETED.
KM8JN12D56U	12/22/05	23526	60.24	AIRBAG LIGHT ON TECH FOUND CODE C1513 TT TIME FOR SCAN TOOL AND RESET CODE	CUSTOMER STATES ESC LIGHT IS ON	FOUND CODE C1513 FOR BRAKE SWITCH MAL.	REPLACED THE BRAKE SWITCH. RESET THE ECU. 93841RTT .6
KM8JN12D56U	12/22/05	23526	60.24	AIRBAG LIGHT ON TECH FOUND CODE C1513 TT TIME FOR SCAN TOOL AND RESET CODE	CUSTOMER STATES CHECK ENGINE LIGHT CAME ON AND VEHICLE IS RUNNING ROUGH	FOUND CODE P0301 FOR CLY NUMBER ONE MISFIRE. FOUND THE FUEL INJECTORS AND FUEL RAILS CLOGGED.	REPLACED THE FUEL INJECTORS. FUEL RAILS AND CROSS OVER PIPE. RESET THE ECU. TEST DROVE. 35310R00 1.3 35310RP0 .3 N69 C15
KM8JM12B16U	1/11/06	24214	36.19	REPLACED STOP LAMP SWITCH INCLUDING ALL NECESSARY DISMANTLING. RECHECKED OPERATION WORKING AS DESIGNED	CUST STATES ESC LIGHT GOES ON AND OFF	FOUND CODE C1513 STOP LAMP SWITCH OPEN/SHORT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED STOP LAMP SWITCH INCLUDING ALL NECESSARY DISMANTLING. RECHECKED OPERATION WORKING AS DESIGNED
KM8JN72D66U	9/28/05	13318	38.15	CUST STATES BRAKE LIGHT ON. FOUND CODE C1237 PRESSURE SENSOR C1513 BRAKE LAMP SWITCH. INSTALLED BRAKE SWITCH TEST DROVE NO LIGHT ON STOPPING FINE. ADJUSTED TIRE PRESSURE AND RESET FIRE PRESS S SENSOR	CUST STATES BRAKE LIGHTS ON. TOWIN	SCANNED CAR 2 CODES C1237 PRESSURE SENSOR C1513 BRAKE LAMP SWITCH	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY CUST STATES BRAKE LIGHT ON. FOUND CODE C1237 PRESSURE SENSOR C1513 BRAKE LAMP SWITCH. INSTALLED BRAKE SWITCH TEST DROVE NO LIGHT ON STOPPING FINE. ADJUSTED TIRE PRESSURE AND RESET FIRE PRESS S SENSOR
KM8JM12B66U	1/11/06	18652	34.63		CUSTOMER STATES ESC LIGHT COMES ON AND OFF (SOP IS HERE)	TEST WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH. TEST AND FOUND BRAKE LAMP SWITCH HAS INTERNAL PROBLEM.	REPLACED AND ADJUSTED BRAKE LAMP SWITCH. 93810R00 0.3 N94 C15
KM8JN12D66U	11/04/05	29964	34.95		CUSTOMER STATES ESC OFF LIGHT COMES ON WHILE DRIVING	PULLED CODE C1513 BRAKE LIGHT SWITCH ERROR. FOUND SHORT IN SWITCH	REPLACE BRAKE LIGHT SWITCH 93810R00 .3 N15,C05
KM8JN12D45U	6/17/05	9130	61.88		CUSTOMER STATES ESP LIGHT OFF INDICATOR COMES ON	FOUND CODE B1513 FOR THE BRAKE LAMP SWITCH MAL.	REPLACED THE BRAKE LAMP SWITCH. RESET THE ECU. 93810RTT .6 N69 C15
KM8JM12B86U	2/06/06	23445	36.51	REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT COMES ON AND OFF - SOP IS IN	FOUND BRAKE SWITCH SHORTED CAUSE LIGHT TO COME ON	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACED BRAKE LIGHT SWITCH

KM8JM12B75U		4/25/05	10787	36.19	FOUND BRAKE SWITCH TO HAVE NO OUTPUT AND ANGLE SENSOR TO BE STUCK ON HIGH SIGNAL. REMOVED AND REPLACED BRAKE SWITCH AND HIGH SIGNAL	CUST STATES ESC LIGHT STAYS ON	FOUND BRAKE SWITCH FAILED. CHECK WITH HIGH SCAN FOUND THAT ANGLE SENSOR TO BE STUCK ON HIGH SIGNAL.	SENSOR ANGULAR VELOCITY SENSOR ANGULAR VELOCITY FOUND BRAKE SWITCH TO HAVE NO OUTPUT AND ANGLE SENSOR TO BE STUCK ON HIGH SIGNAL. REMOVED AND REPLACED BRAKE SWITCH AND
KM8JM12B75U		4/25/05	10787	36.19	FOUND BRAKE SWITCH TO HAVE NO OUTPUT AND ANGLE SENSOR TO BE STUCK ON HIGH SIGNAL. REMOVED AND REPLACED BRAKE SWITCH AND HIGH SIGNAL	CUST STATES ESC LIGHT STAYS ON	FOUND BRAKE SWITCH FAILED. CHECK WITH HIGH SCAN FOUND THAT ANGLE SENSOR TO BE STUCK ON HIGH SIGNAL.	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE FOUND BRAKE SWITCH TO HAVE NO OUTPUT AND ANGLE SENSOR TO BE STUCK ON HIGH SIGNAL. REMOVED AND REPLACED BRAKE SWITCH AND
KM8JM12B96U		11/25/05	30460	60.24	ESC LIGHT ON TT TIME FOR SCAN TOOL CODE C1513 FOUND REPLACED SWITCH AND RESET CODE	CUSTOMER STATES ESC OFF LIGHT COMES ON WHILE DRIVING	FOUND CODE C1513 BRAKE LAMP SW-MAL. FOUND OPEN CIRCUIT IN BRAKE SWITCH.	REPLACED BRAKE SWITCH, RESET, TESTED, OPERATION NORMAL. 95660RPO -0.3 93810R00 -0.3 N94 C15
KM8JN12D65U		5/20/05	44854	34.95	SCANNED VEHICLE, FOUND CODE C1513, BRAKE LAMP SWITCH OPEN, REMOVE AND REPLACE BRAKE LAMP SWITCH, RESET ECU, TEST DRIVE OK AT THIS TIME	CUSTOMER STATES ESC LIGHT COMES ON AND OFF	BRAKE LAMP SWITCH, OPEN	SCANNED VEHICLE, FOUND CODE C1513, BRAKE LAMP SWITCH OPEN, REMOVE AND REPLACE BRAKE LAMP SWITCH, RESET ECU, TEST DRIVE OK AT THIS TIME, 93810R00 .3
KM8JN12D06U		8/23/05	24107	37.26		CUSTOMER STATES: ESC LIGHT STAYS ON INTERMITTENTLY. CK AND REPORT	SCANNED CODE 1513 BRAKE LAMP SWITCH	INSTALLED NEW BRAKE LAMP SWITCH
KM8JN12DX5U		3/25/05	5007	37.12		C/S THAT THE ESP LIGHT CAME ON AND WOULD NOT SHUT OFF	TECH SCANNED CAR AND FOUND CODE C1237 CALLED TECHLINE AND OPENED CASE #211722 ALSO HAD CODE C1513 WAS ADVISED TO CHECK BRAKE LIGHT SWITCH FOUND IT SHORTED TO GROUND	REMOVED AND REPLACED CLEARED CODES OK NOW
KM8JN12D95U		4/26/05	28710	36.94		CUSTOMER STATES : THAT THE BRAKE LIGHT CAME ON	TECH SCANNED CAR AND FOUND CODE C1513 UPON INSPECTION FOUND A FAULTY BRAKE LIGHT SWITCH	REMOVED AND REPLACED
KM8JN12D65U		5/20/05	44854	34.95	SCANNED VEHICLE, FOUND CODE C1513, BRAKE LAMP SWITCH OPEN, REMOVE AND REPLACE BRAKE LAMP SWITCH, RESET ECU, TEST DRIVE OK AT THIS TIME	CUSTOMER STATES CHECK ENGINE LIGHT ON SEE ATTACHED NOTE FROM OTHER SHOP	02 SENSOR B2/S2, FAULTY	SCANNED VEHICLE FOUND CODE P0159 O2 SENSOR B2/S2 FAULTY, REMOVE AND REPALCE O2 SENSOR RESET ECU, TEST DRIVE OK AT THIS TIME, 39210R0A .3, 39210RP0 .3
KM8JN12D85U		5/23/05	22442	59.92	AIRBAG LIGHT ON TECH FOUND CODE B1378 REPL SWITCH AND RESET CODE TT TIME FOR SCAN TOOL	CUSTOMER STATES ESP LIGHT OFF STAYS ON.	FOUND CODE C1513 FOR BRAKE LAMP SWITCH MAL.	REPLACED THE BRAKE LAMP SWITCH AND RESET THE HECU. 93810RTT .6 N94 C15
KM8JM12B46U		11/22/05	28682	34.95		EST OFF COMES ON RANDOMLY	TEST WITH SCAN TOOL AND FOUND CODE C1513 BRAKE LAMP SWITCH. TEST AND FOUND BAD BRAKE LAMP SWITCH.	REPLACED AND ADJUSTED REAR BRAKE LAMP SWITCH. 93810ROO 0.3 N69 C15
KM8JN12D95U		4/26/05	28710	36.94		CUSTOMER STATES CHECK ENGINE LIGHT IS ON	TECH SCANNED CAR AND FOUND CODE P0130 UPON TESTING AND INSPECTION FOUND A FAULTY B1/S1 O2 SENSOR	SPECIAL ORDERED PART
KM8JN12D75U		9/15/04	4168	36.57				
KM8JN72D95U		8/26/04	6413	37.12		CUSTOMER STATES: ESP LIGHT CAME ON	FOUND FAULTY BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12D05U		5/18/05	198	16.86		CUSTOMER REQUESTS CHARGING SYSTEM CHECK FOR NO START (SEE LINE 1)		CHARGED BATTERY.
KM8JN12D05U		5/18/05	198	16.86		BRAKE LIGHTS WILL NOT CANCEL WITHOUT LIFTING PEDAL. RAN BATTERY DOWN	FOUND BRAKE SWITCH OUT OF ADJUSTMENT.	ADJUSTED BRAKE SWITCH. 32002ATT .2
KM8JN12D75U		6/14/05	26899	59.92	ESP LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 REPL SWITCH	CUSTOMER STATES ESP LIGHT COMES ON INTERMITTENTLY	FOUND CODE C1513 BRAKE LAMP SW-MAL. FOUND BRAKE SWITCH SHORTED.	REPLACED BRAKE LIGHT SWITCH, RESET MODULE, TESTED, OPERATION NORMAL. 95660RPO - 0.3 93810R00 -0.3 N68 C15
KM8JN72D46U		1/04/06	17160	37.26	REPLACED SHORTED BRAKE LAMP SWITCH			
KM8JN12D16U		10/13/05	21484	37.26	REMOVED AND REPLACED	CUSTOMER STATES : THAT THE ESC LIGHT COMES ON WHEN DRIVING	TECH SCANNED CAR AND FOUND CODE C1513 UPON TESTING AND INSPECTION FOUND A FAULTY BRAKE LIGHT SWITCH	REMOVED AND REPLACED
KM8JN12D96U		10/08/05	19991	37.26				
KM8JN72D06U		7/27/05	20611	38.15		C/S THAT THE ESC LIGHT FLASHES ON AND OFF	TECH SCANNED CAR AND FOUND CODE C1513 UPON INSPECTION FOUND A FAULTY BRAKE LIGHT SWITCH	REMOVED AND REPLACED
KM8JN12D75U		6/14/05	26899	59.92	ESP LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 REPL SWITCH	CUSTOMER STATES AIRBAG LIGHT COMES ON AT TIMES	SCAN TESTED, NO CODES FOUND.	CANNOT DUPLICATE CUSTOMER CONCERN AT THIS TIME.
KM8JN12D75U		6/14/05	26899	59.92	ESP LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 REPL SWITCH	CUSTOMER STATES ENGINE IDLES REAL HIGH AND VEHICLE IS HARD TO START AT TIMES AND STALLS AT TIMES	SCAN TESTED, NO CODES FOUND. TEST DROVE, NO PROBLEMS FOUND.	COULD NOT DUPLICATE CUSTOMER CONCERN AT THIS TIME.
KM8JN12D75U		6/14/05	26899	59.92	ESP LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 REPL SWITCH	CUSTOMER STATES LIFTGATE STICKS AND IS HARD TO OPEN AT TIMES	FOUND SUBSTANCE SPILLED CAUSING LIFTGATE TO STICK.	REMOVED SUBSTANCE, INSPECTED, OPERATION NORMAL.
KM8JN72D06U		7/27/05	20611	38.15		C/S THAT THE TIRE PRESSURE LIGHT IS ON	TECH CHECKED CAR AND VERIFIED CONCERN FOUND SENSORS NEEDED TO BE CALIBRATED	CALIBRATED SENSORS
KM8JN72D06U		7/27/05	20611	38.15		C/S THAT THE C/D PLAYER IS INOP	TECH CHECKED CAR AND VERIFIED CONCERN FOUND THE RADIO FAULTY	REMOVED AND REPLACED
KM8JN12DX6U		11/03/05	1888	38.15		CUSTOMER STATES: STOP LIGHTS DO NOT WORK	FOUND STOP LIGHT SWITCH DEFECTIVE	REPLACE STOP LIGHT SWITCH WITH NEW
KM8JN12D75U		6/14/05	26899	59.92	ESP LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 REPL SWITCH	CAMPAIGN 079 - DRIVER AIRBAG COVER MOD REPL	61B046R0 -0.2	RECALL 079 COMPLETED.
KM8JN12D85U		9/10/04	18332	25		CUSTOMER STATES ESP LIGHT COMES ON INTERMITTENTLY. STAYS ON A FEW DAYS AND THEN GOES OFF	SCANNED AND FOUND CODE C1513. BRAKE SWITCH FAILURE	REPLACED BRAKE SWITCH AND CLEARED DTC. 93810R00 .3 N68 C05 93810R00 .3 93810ATT .3

KM8JN12D85U	9/10/04	18332	25		CUSTOMER STATES THAT LIGHTS WILL BLINK WHEN UNLOCKING DOORS WITH RKE, BUT DO NOT BLINK WHEN LOCKING DOORS WITH RKE		FOUND RUBBER SWITCH DEPRESSOR MISSING. REPLACED. 92736ATT .3
KM8JN12D86U	10/11/05	12816	37.26		CUSTOMER STATES: ESC LIGHT IS ON. CHECK AND REPORT	SCANNED CODE C1513 BRAKE LAMP SWITCH ADJUSTED SWITCH AND CODE CAME BACK AFTER FOLLOWING TSB 06-50-006	REPLACED BRAKE LAMP SWITCH
KM8JN72D16U	9/16/05	22100	35.83		CUSTOMER STATES : THAT THE ESC LIGHT COMES ON WHEN DRIVING	TECH CHECKED CAR AND VERIFIED CONCERN UPON TESTING AND INSPECTION FOUND A FAULTY BRAKE LIGHT	REMOVED AND REPLACED
KM8JN72D15U	10/04/04	12586	35.91		C/S THAT THE ESC LIGHT COMES ON WHEN DRIVING	TECH CHECKED CAR AND FOUND A FAULTY BRAKE LIGHT SWITCH	REMOVED AND REPLACED
KM8JN12D85U	9/10/04	18332	25		CUSTOMER STATES AC MAKES KNOCKING NOISE - WORSE WHEN FAN POSITION IS IN SETTING #1		NTF ON THIS COMPLAINT. SEE TICKET LINE 5
KM8JN12D85U	9/10/04	18332	25		CUSTOMER STATES AC BLOWER IS NOISY. WORSE IN #4 SETTING		FOUND 5 ACORN'S IN BLOWER. .7
KM8JN12D85U	9/10/04	18332	25		CUSTOMER STATES VEHICLE MAKES WHINE NOISE ON ACCELERATION		NTF AT THIS TIME. ALL SOUNDS ARE NORMAL.
KM8JN12D85U	9/10/04	18332	25		HPP RENT CAR		
KM8JN72D95U	11/25/04	2876	37.12		CUSTOMER STATES: ESP LIGHT IS ON	FOUND BRAKE LAMP SWITCH FAULTY	REPLACED BRAKE LAMP SWITCH
KM8JM12B76U	11/24/05	18292	36.19		CUSTOMER STATES : THAT THE ESC LIGHT IS ON	TECH SCANNED CAR AND FOUND CODE C1513 UPON TESTING AND INSPECTION FOUND A FAULTY BRAKE LIGHT SWITCH	REMOVED AND REPLACED
KM8JN12D15U	6/15/05	23169	37.26	REMOVED AND REPLACED STOP LAMP SWITCH.	CUSTOMER STATES ESP LIGHT FLICKERS ON AND OFF. MORE OFTEN WHEN IT RAINS. CHECK AND ADVISE.	SCANNED AND FOUND CODE C1513, BRAKE LAMP SWITCH MALF. FOUND BRAKE LIGHTS INOP SWITCH.	REMOVED AND REPLACED STOP LAMP SWITCH.
KM8JN12D85U	9/10/04	18332	62.2	CODE C1513 FOUND	CUSTOMER STATES ESP LIGHT COMES ON INTERMITTENTLY. STAYS ON A FEW DAYS AND THEN GOES OFF	SCANNED AND FOUND CODE C1513. BRAKE SWITCH FAILURE	REPLACED BRAKE SWITCH AND CLEARED DTC. 93810R00 .3 N68 C05 93810R00 .3 93810ATT .3
KM8JN12D85U	9/10/04	18332	62.2	CODE C1513 FOUND	CUSTOMER STATES THAT LIGHTS WILL BLINK WHEN UNLOCKING DOORS WITH RKE, BUT DO NOT BLINK WHEN LOCKING DOORS WITH RKE		FOUND RUBBER SWITCH DEPRESSOR MISSING. REPLACED. 92736ATT .3
KM8JN12D85U	9/10/04	18332	62.2	CODE C1513 FOUND	CUSTOMER STATES AC MAKES KNOCKING NOISE - WORSE WHEN FAN POSITION IS IN SETTING #1		NTF ON THIS COMPLAINT. SEE TICKET LINE 5
KM8JN72D55U	1/27/05	9272	37.12		C/S THAT THE R/F HEADLIGHT DOES NOT COME ON ALL THE TIME YOU HAVE TO TAP THE HEADLIGHT TO MAKE IT COME ON	TECH CHECKED CAR AND VERIFIED CONCERN FOUND THE GROUND WIRE CAME OUT OF CONNETOR	RESECURED WIRE WORKING PROPERLY AT THIS TIME
KM8JN72D55U	1/27/05	9272	37.12		C/S THAT THE ESP LIGHT STAYS ON PLEASE INSTALL SOP PART	TECH CHECKED CAR AND VERIFIED CONCERN FOUND THE BRAKE LIGHT SWITCH FAULTY	REMOVED AND REPLACED
KM8JN72D75U	6/20/05	19870	37.26		CUSTOMER STATES: ESP LIGHT STAYS ON AT TIMES	SCAN CODE C1513 - BRAKE LIGHT SWITCH MALFUNCTION	REPLACE STOP LAMP SWITCH WITH NEW
KM8JN12D85U	9/10/04	18332	62.2	CODE C1513 FOUND	CUSTOMER STATES AC BLOWER IS NOISY. WORSE IN #4 SETTING		FOUND 5 ACORN'S IN BLOWER. .7
KM8JN12D85U	9/10/04	18332	62.2	CODE C1513 FOUND	CUSTOMER STATES VEHICLE MAKES WHINE NOISE ON ACCELERATION		NTF AT THIS TIME. ALL SOUNDS ARE NORMAL.
KM8JN12D85U	9/10/04	18332	62.2	CODE C1513 FOUND	HPP RENT CAR		
KM8JM12BX6U	7/23/05	30601	35.46	30601 SCAN FOR CODES- C1513.BRAKE LAMP SW CIRCUIT.TEST BRAKE LAMP SW-STICKS CLOSED IN COLD CONDITION-REPLACE BRAKE LAMP SW AND CLEAR CODE.OPERATES NORMALLY NOW.	DRIVER AIRBAG COVER MODULE REPLACEMENT #079		REPLACE AIRBAG MODULE COVER PER CAMPAIGN 079 REPLACE AIRBAG MODULE COVER PER CAMPAIGN 079 30601 RECALL 079 COMPLETED
KM8JM12BX6U	7/23/05	30601	35.46	30601 SCAN FOR CODES- C1513.BRAKE LAMP SW CIRCUIT.TEST BRAKE LAMP SW-STICKS CLOSED IN COLD CONDITION-REPLACE BRAKE LAMP SW AND CLEAR CODE.OPERATES NORMALLY NOW.	CUST STATES ESC LITE GOES ON AND OFF AT WILL	N94	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 30601 SCAN FOR CODES- C1513.BRAKE LAMP SW-CIRCUIT.TEST BRAKE LAMP SW-STICKS CLOSED INCOLD CONDITION-REPLACE BRAKE LAMP SW ANDCLEAR CODE.OPERATES NORMALLY NOW.
KM8JN12D45U	3/25/05	23202	58.53	TT TIME FOR SCAN TOOL CODES C1237 C1513 SET TECH REPLACED STOP LAMP SWITCH AND CLEAR CODES	ESP LIGHT COMES ON SOP	CODES C1237 C1513 SET.PRESSURE SENSOR AND BRAKE SWITCH MALFUNCTION.	REPLACE MASTER CYLINDER PRESSURE SENSOR AND BRAKE SWITCH.AIR BLEED BRAKE SYSTEM,CLEAR CODES.TEST DRIVE VEHICLE BRAKE OP NORMAL ESP CODES NOT RESETTNG. 58510R00 0.8 93810R00 0.3 93810ATT 0.3 N69 C15
KM8JM12B76U	11/22/05	22055	34.95	REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ESC OFF LIGHT STAYS ON	BRAKE LIGHT SWITCH HAS SHORT	REPLACED BRAKE LIGHT SWITCH 2 32002A00 N68,C15
KM8JM12B76U	11/22/05	22055	34.95	REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES CHECK ENGINE LIGHT ON	PO 449 CANISTER CLOSE VALVE CIRCUIT	REPLACED CANISTER CLOSE VALVE. 5 31430R00 N68,C15 31420RP0 .3
KM8JM12BX6U	7/23/05	30601	35.46	30601 SCAN FOR CODES- C1513.BRAKE LAMP SW CIRCUIT.TEST BRAKE LAMP SW-STICKS CLOSED IN COLD CONDITION-REPLACE BRAKE LAMP SW AND CLEAR CODE.OPERATES NORMALLY NOW.	CUSTOMER REPORTS AIR BAG LIGHT IS ON	N69	SENSOR ASSY-FRONT DUAL AIR BAG (LH) RE SENSOR ASSY-FRONT DUAL AIR BAG (LH) RE 30601 SCAN FOR CODE- B1329,FIS DRIVERS,CLEAR CODE- CODE RETURNS. DIAGNOSE AS BAD FIS,DRIVERS.REPLACE DRIVERS FIS,RETEST-OK NOW NORETURN CODE

KM8JN72D26U	7/28/05	21517	35	21517 SCAN FOR CODES-C1513- BRAKE LIGHT SW, CLEAR CODE FURTHER DIAG WILL BE NEEDED IF SAME CODE RETURN (HAS AFTERMARKET REMOTE START)	CUST STATES, ESC OFF LITE KEEPS COMING ON, AND WILL NOT TURN OFF	N94	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 21517 SCAN FOR CODES-C1513- BRAKE LIGHT SW, CLEAR CODE FURTHERDIAG WILL BE NEEDED IF SAME CODE RETURN (HASAFTERMARKET REMOTE START)
KM8JM12B65U	5/16/05	34392	34.95		CUSTOMER STATES BRAKES LIGHTS FAIL TO COME ON AT TIMES	STOP LIGHT SWITCH HAS INTERNAL SHORT	REPLACED STOP LIGHT SWITCH 93810R00.3
KM8JM12B65U	5/16/05	34392	34.95		CAMPAIGN 079 - DRIVER AIRBAG COVER MODULE REPL	61B046R0 -0.2	RECALL COMPLETED.
KM8JM12B05U	5/16/05	21686	60.24	AIRBAG LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 SET REPLACED SWITCH AND RESET CODE	CUSTOMER STATES ESP LIGHT COMES ON AND OFF AND SWITCH DOES NOT SEEM TO HAVE ANY EFFECT ON OPERATION AT TIMES	FOUND CODE C1513 BRAKE LAMP SWITCH-MAL. FOUND OPEN CIRUCIT IN SWITCH.	REPLACED BRAKE LAMP SWITCH, RESET MODULE, TESTED, OPERATION NORMAL. 95660RPO - 0.3 93810R00 -0.3 N94 C15
KM8JN72D45U	5/19/05	19097	35.46	19097 SCANNED ABS FOR CODES. VEHICLE HAD CODE C1513 BRAKE LIGHT SWITCH. REMOVED SWITCH AND CHECKED CONTINUITY. SWITCH INTERMITTENTLY HAD NO CONTINUITY WITH PLUNGER OPEN. REPLACED SWITCH, CLEARED CODE. CODE HAS NOT	DRIVER AIRBAG COVER MODULE REPLACEMENT #079		REPLACE AIRBAG MODULE COVER PER CAMPAIGN 079 REPLACE AIRBAG MODULE COVER PER CAMPAIGN 079 19097 PERFORMED CAMPAIGN 079.
KM8JN72D45U	5/19/05	19097	35.46	19097 SCANNED ABS FOR CODES. VEHICLE HAD CODE C1513 BRAKE LIGHT SWITCH. REMOVED SWITCH AND CHECKED CONTINUITY. SWITCH INTERMITTENTLY HAD NO CONTINUITY WITH PLUNGER OPEN. REPLACED SWITCH, CLEARED CODE. CODE HAS NOT RETURNED.	CUSTOMER REPORTS ESC OFF LIGHT COMES ON ABOUT TWICE A MONTH	N94	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 19097 SCANNED ABS FOR CODES. VEHICLE HADCODE C1513 BRAKE LIGHT SWITCH. REMOVED SWITCHAND CHECKED CONTINUITY. SWITCH INTERMITTENTLYHAD NO CONTINUITY WITH PLUNGER OPEN. REPLACEDSWITCH, CLEARED CODE. CODE H
KM8JM12B45U	6/03/05	14031	35		CUSTOMER STATES ESC LIGHT COMES ON INTERMITTENTLY SEE R0#329974	N94	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 14031 SCANNED ABS FOR POSSIBLE CODES.VEHICLE HAD CODE C1513 BRAKE LAMP SWITCH OPENS SHORT. CHECKED FOR TSB'S FOR BRAKE LIGHTSWITCH ADJUSTMENT, FOUND NONE. REPLACED BRAKELIGHT SWITCH. CLEARED
KM8JM12B05U	5/16/05	21686	60.24	AIRBAG LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 SET REPLACED SWITCH AND RESET CODE	CUSTOMER STATES REAR WIPER IS INOP	FOUND WIPER NUT BACKED OFF CAUSING WIPER TO BE INOP.	TIGHTEN NUT, TESTED, OPERATION NORMAL.
KM8JM12B05U	5/16/05	21686	60.24	AIRBAG LIGHT ON TECH USED SCAN TOOL FOR TT TIME CODE C1513 SET REPLACED SWITCH AND RESET CODE	CAMPAIGN 079 - DRIVERS AIRBAG COVER MODULE	61B046R0 -0.2	RECALL COMPLETED.
KM8JN12DX6U	7/20/05	17948	34.63		CUSTOMER STATES ESC LIGHT COMES ON	CODE C1513 SET. BRAKE SWITCH MALFUNCTION.	REPLACE BRAKE LIGHT SWITCH, CLEAR CODE AND TEST DRIVE. CODE NOT RESETING. 93810R00 0.3 N68 C15
KM8JM12B35U	6/03/05	15987	35.46	15988 HISCANNED RETRIEVED C1513 BRAKE LAMP SWITCH. TESTED FOUND INTERNAL FAULT IN SWITCH, SHORTED. REPLACED ADJUSTED AND RECHECKED OPERATING NORMAL AT THIS TIME. NO CODE RETURN AT THIS TIME	CUSTOMER REPORTS ECS LIGHT WAS ON, LIGHT WENT OUT AFTER SETTING APPOINTMENT	N94	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 15988 HISCANNED RETRIEVED C1513 BRAKE LAMP SWITCH. TESTED FOUND INTERNAL FAULT IN SWITCH, SHORTED. REPLACED ADJUSTED ANDRECHECKED OPERATING NORMAL AT THIS TIME. NO CODE RETURN AT THIS TIME
KM8JN72D46U	11/05/05	27910	32.77		THE CUSTOMER STATES THE ESC LIGHT COMES ON AND IS ON NOW	INOPERIVE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D66U	12/19/05	20418	26.52	REPLACED BRAKELIGHT SWITCH	CUSTOMER STYATES ESC LIGHT COMES ON AND GOES OFF	BRAKE LIGHT SWITCH HAS SHORT	REPLACED BRAKELIGHT SWITCH 32002A00.2 N68 C15
KM8JN12D86U	2/02/06	12576	34.24	12576 BRAKE LITE SWITCH OPEN REPLACED BRAKE LITE SWITCH TK 140 F/P CODE C1513	E.S.P. LITE ON DASH IS ON (PTS. HERE)	LT	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP 12576 BRAKE LITE SWITCH OPEN REPLACED BRAKELITE SWITCH TK 140 F/P CODE C1513
KM8JN12D35U	4/28/05	19520	34.24	19520 USED GDS BRAKE SWITCH CIRCUIT REPLACED SWITCH FOR POOR CONTACT AND CLEARED CODE , TK140 F/P	C/S ECS LIGHT COMES ON	LT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 19520 USED GDS BRAKE SWITCH CIRCUIT REPLACEDSWITCH FOR POOR CONTACT AND CLEARED CODE ,TK140 F/P
KM8JN72D06U	12/05/05	212532	32.77		CUSTOMER STATES THE ESC LIGHT IS ON THE DASH WHEN HITTING THE BUTTON IT WILL NOT TURN THE LIGHT OFF	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B76U	7/22/05	33578	33.09		ESC LIGHT IS ON	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D86U	10/31/05	24068	32.77		CEL IS OFF NOW	SHORT	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE
KM8JN72D86U	10/31/05	24068	32.77		CEL IS OFF NOW	SHORT	SENSOR ASSY-OXYGEN RH ADD4 WHEEL DRIVE SENSOR ASSY-OXYGEN RH ADD4 WHEEL DRIVE
KM8JN12D75U	12/08/04	12828	34.36	SCAN TEST FOUND OPEN BRAKE SWITCH C1513 REPLACED BRAKE SWITCH TO REPAIR PROBLEM	ECM REPROGRAMMING (06-01-001) RECALL #922	B	CAMP 922 REPROGRAM ESCECM CAMP 922 REPROGRAM ESCECM 12828 RECALL 922 REPROGRAMMED ECM AS PERRECALL 922 TK 260 50B035R1 0.3

KM8JN12D75U	12/08/04	12828	34.36	SCAN TEST FOUND OPEN BRAKE SWITCH C1513 REPLACED BRAKE SWITCH TO REPAIR PROBLEM	CUST STATES ESP LIGHT STAYS ON ADVISE.	A	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 12828 SCAN TEST FOUND OPEN BRAKE SWITCH C1513 REPLACED BRAKE SWITCH TO REPAIR PROBLEM TK260 F/R
KM8JN12D75U	12/08/04	6246	34.36		ESP OFF LIGHT IS ON	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 6246 LOOSE CONNECTION RAN SCAN TEST NO FAULT CODE ESP LIGHT WOULD NOT TURN OFF R AND R ESP SWITCH AND FOUND CONNECTOR LOOSE RECONNECTED SWITCH ALSO FOUND NO BRAKE LIGHTS NOT WORKING TESTED SYSTEM AND REPLACED
KM8JN72D86U	10/31/05	24068	32.77		CEL IS OFF NOW	SHORT	SENSOR ASSY-OXYGEN RH ADDS CAN TOOL OPERATION SENSOR ASSY-OXYGEN RH ADDS CAN TOOL OPERATION
KM8JN72D86U	10/31/05	24068	32.77		THE CUSTOMER STATES THE ESC AND THE CHECK ENGINE LIGHT IS ON	BLOWN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D27U	11/17/06	4998	33.09		CUSTOMER STATES THE ESC LIGHT INTERMITTENTLY KEEPS COMING ON	INOPERATIVE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D55U	5/14/05	14665	34.24	BRAKE LAMP SWITCH NOT CONTACTING INSIDE BRAKE LAMP SWITCH AND NOT CONTACTING INSIDE AT TIMES - REPLACED BRAKE LAMP SWITCH	C/S THE ESP LIGHT WILL COME ON WHILE DRIVING BUT WILL GO OFF AFTER VEH IS TURNED OFF AND KEY IS REMOVED	LT	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP 14665 BRAKE LAMP SWITCH NOT CONTACTING INSIDE BRAKE LAMP SWITCH NOT CONTACTING INSIDE AT TIMES - REPLACED BRAKE LAMP SWITCH TK 140 F/P
KM8JN72D55U	5/14/05	14665	34.24	BRAKE LAMP SWITCH NOT CONTACTING INSIDE BRAKE LAMP SWITCH AND NOT CONTACTING INSIDE AT TIMES - REPLACED BRAKE LAMP SWITCH	AIR BAG RECALL	LT	RECALL 61B046R0 RECALL 61B046R0 14665 AIR BAG MODULE CAIMP COMPLETED AIR BAG MODULE CAIMP TK 140 F/P LOP 61B046R0 HRS .20
KM8JN72D86U	11/05/05	20192	32.77		THE CUSTOMER STATES THE ESC LIGHT COMES ON AND GOES OFF WHILE DRIVING	SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D65U	5/02/05	18053	129.7	DIAGNOSIS TIME AND TECH LINE CALL			
KM8JM12B26U	12/12/05	49785	33.09		CUSTOMER STATES THE ESC LIGHT IS ON	SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D75U	4/08/05	17111	38.14	FOUND BRAKE LIGHT SWITCH BAD/REPLACED	C/S ESP LIGHTS ON	PART FAILURE	REPLACE BRAKE LIGHT SWITCH
KM8JN72D76U	7/16/05	14491	33.66	DIAG ESC LIGHT, CONFIRM DEFECT STOP SW. R/R SW AND RD TEST.	CUST STATES ESC LIGHT COMES ON AT TIMES	FAULTY BRAKE LIGHT SWITCH SCAN TEST CODE C1513	REPLACE SWITCH/CLEAR AND RESET SYSTEM
KM8JN72D76U	7/16/05	14491	33.66	DIAG ESC LIGHT, CONFIRM DEFECT STOP SW. R/R SW AND RD TEST.	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON. CHECK AND ADVISE.	SCAN TEST AND FOUND CODE P0130 O2 SENSOR CIRCUIT MAL. B1/S1 C1513 BRAKE LAMP SWITCH	REPLACED B1/S1 O2 SENSOR FOR O2 CODE
KM8JN72D76U	7/16/05	14491	33.66	DIAG ESC LIGHT, CONFIRM DEFECT STOP SW. R/R SW AND RD TEST.	CUST STATES THERE IS A SLIGHT NOISE WHEN TURNING	CHECKED AND FOUND FAULTY BUSHINGS ON SUBFRAME	REPLACED SUBFRAME BUSHINGS RETEST OK NOW
KM8JN72DX6U	9/29/05	12134	38.46	REPLACED SWITCH	CUSTOMER STATES; ESC LIGHT IS ON	FOUND CODE C1513 BRAKE LAMP SWITCH FOUND RESISTANCE HIGH ON SWITCH	REPLACED SWITCH
KM8JN12D75U	6/01/05	25061	38.46		CUSTOMER STATES; ESP LIGHT IS ON	SCAN FOR CODES FOUND CODE B1513 BRAKE SWITCH.	REPLACED SWITCH AND CLEARED CODES TESTED DROVE EVERYTHING OK
KM8JN72D46U	11/04/05	22511	38.14	FOUND VEH HAD NO BRAKE LIGHTS/REPLACED SWITCH	TECH FOUND VEH HAD NO BRAKE LIGHTS	PART FAILURE	REPLACE BRAKE LIGHT SWITCH
KM8JM12B15U	12/16/04	4465	33.36		CUST STATES ESP LIGHT IS ON WHEN CUSTOMER PRESSES BUTTON MODE DOES NOT CHANGE.	PERFORMED DIAG ON ESP SYSTEM FOUND SHORTED LAMP SWITCH	REPLACED STOP LAMP SWITCH
KM8JM12B15U	12/16/04	4465	33.36		CUSTOMER STATES PERFORM CAMPAIGN NO 922 (ESC REPROGRAMMING)		PERFORMED 922 CAMPAIGN
KM8JM12B15U	12/16/04	4465	33.36		CUST STATES POWER OUTLET COVER IS BROKEN PIECE IS IN VEHICLE		REPLACE OUTLET POWER COVER
KM8JN72D56U	10/21/05	28525	38.46		CUSTOMER STATES; ESP-LIGHT COMES ON.	SCAN FOR CODES HAS A C1513 BRAKE LIGHT SWITCH.	REPLACED BRAKE LIGHT SWITCH, CLEARED CODE. RECK-OK.
KM8JN72DX6U	10/26/05	16063	66.94	TECH SCANNED COMPUTER FOUND CODE C-1513 BRAKE SWITCH OPEN SHORT, TECH REMOVED AND REPLACED BRAKE SWITCH ATT TIME FOR SCAN TOOL	CUSTOMER STATES ESC LIGHT COMES ON AND GOES OFF SOMETIMES	TECH SCANNED COMPUTER FOUND CODE C-1513	TECH REMOVED AND REPLACED BRAKE SWITCH TO SPECS. TECH CLEARED CODES ROAD TESTED VEHICLE FOUND OPERATING TO SPECS.
KM8JN72D45U	11/19/04	19408	9.06				
KM8JM12B15U	12/16/04	4465	33.36				SERVICE DEPT. LOANER CAR FOR WARRANTY REPAIRS PERFORM ON THIS VEHICLE
KM8JN12D16U	7/15/05	13860	36.34	13860 [WARR] REPLACE STOP LIGHT SWITCH CODE C1513 CLEAR CODE THANKS	RECALL #079	RECALL 079	079 TUCSON DRIVER AIR BAG COVER MODULE REPLACEMENT 079 TUCSON DRIVER AIR BAG COVER MODULE REPLACEMENT 13860 COMPLETED RECALL INSPECT AND REPLACED DRIVERS AIRBAG COVER TO CORRECT
KM8JN12D16U	7/15/05	13860	36.34	13860 [WARR] REPLACE STOP LIGHT SWITCH CODE C1513 CLEAR CODE THANKS	CUST STATES ESC OFF LIGHT COMING ON WHILE DRIVING??	INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 13860 [WARR] REPLACE STOP LIGHT SWITCH CODE C1513 CLEAR CODE THANKS

KM8JN72D45U	11/19/04	18345	58.86	TECH SCANNED COMPUTER FOUND CODE C-1612, C-1611, C-1513 CAN TIME OUT TCM. BRAKE LAMP SWITCH ERROR, TECH REPLACED BRAKE SWITCH TO SPECS AND CLEARED CODES ROAD TESTED VEHICLE FOUND OK.ATT TIME FOR SCAN TOOL	CUSTOMER STATES ESP LIGHT COMES ON	TECH SCANNED COMPUTER FOUND CODE C-1612, C-1611, C-1513 CAN TIME OUT, TCM BRAKE LAMP SWITCH ERROR.	TECH REMOVED AND REPLACED BRAKE SWITCH ASSEMBLY TO SPECS.. TECH CLEARED CODES ROAD TESTED VEHICLE FOUND OPERATING TO SPECS.
KM8JN12D36U	11/25/05	31124	38.46		CUSTOMER STATES:ECS LIGHT COMES ON AND OFF.	SCANNED FOR CODES FOUND CODE C1513 BRAKE SWITCH ERROR AND STEERING ANGLE SENSOR SIGNAL.	REPLACED BRAKE SWITCH AND ZEROED STEERING ANGLE SENSOR. ROAD TESTED VECH. EVERYTHING OKAY.
KM8JM12B76U	7/12/05	15883	37.1	15883 HAD CODE C1513 DEFECTIVE STOP LIGHT SWITCH. REPLACED STOP LIGHT SWITCH TO CORRECT PROBLEM.	CUST STATES ESC LIGHT COMING ON ANDGOES OFF BY ITSELF	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 15883 HAD CODE C1513 DEFECTIVE STOP LIGHTSWITCH. REPLACED STOP LIGHT SWITCH TO CORRECTPROBLEM.
KM8JN12D86U	10/15/05	6319	36.34	6319 CHECK ESC LIGHT ON CODE 1513 BRAKE LIGHT SWITCH INOP REPLACE BRAKE LIGHT SWITCH TO CORRECT PART FAILURE	079 DRIVER AIR BAG RECALL	RECALL 079	079 TUCSON DRIVER AIR BAGCOVER MODULE REPLACEMENT 079 TUCSON DRIVER AIR BAGCOVER MODULE REPLACEMENT 6319 COMPLETED RECALL INSPECT AND REPLACEDDRIVERS AIRBAG COVER TO CORRECT
KM8JN12D86U	10/15/05	6319	36.34	6319 CHECK ESC LIGHT ON CODE 1513 BRAKE LIGHT SWITCH INOP REPLACE BRAKE LIGHT SWITCH TO CORRECT PART FAILURE	ESC LIGHT STAYS ON DASH	INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 6319 CHECK ESC LIGHT ON CODE 1513 BRAKE LIGHTSWITCH INOP REPLACE BRAKE LIGHT SWITCH TOCORRECT PART FAILURE
KM8JN72D56U	10/06/05	22991	38.46		CUSTOMER STATES:ESC-LIGHT SAYES OFF.WHEN DRIVING.	FOUND BRAKE SWITCH HAS FAILED.	REPLACED BRAKE LIGHT SWITCH.
KM8JM12B97U	6/23/06	11922	38.46		CUSTOMER STATES; ESC LIGHT KEEPS GOING ON WHEN STEPPING ON THE BRAKE	FOUND THE B1513 BRAKE SWITCH	REPLACED BRAKE LIGHT SWITCH.
KM8JM12B47U	8/25/06	1198	95.3	CODE C1513 BRAKE SWITCH CIRCUIT TEST ALL SYSTEM CONTACT TECH LINE CASE # 254530 FOUND BRAKE LIGHT SWITCH OPEN VERY INTERMITTANT REPLACE SWITCH TO CORRECT	CUST STATES ESC LIGHT COMES AND OFF RANDOMLY	CODE C1513 BRAKE SWITCH CIRCUIT	TEST ALL SYSTEM, CONTACT TECH LINE CASE 254530 FOUND BRAKE LIGHT SWITCH OPEN VERY INTERMITTANT, REPLACE SWITCH TO CORRE
KM8JN12D86U	10/15/05	6319	36.34	6319 CHECK ESC LIGHT ON CODE 1513 BRAKE LIGHT SWITCH INOP REPLACE BRAKE LIGHT SWITCH TO CORRECT PART FAILURE	S/O/P RADIO-ENGINE MUST BE JUMP STARTED	INTERNAL FAILURE	RADIO ASSY-ETR RE RADIO ASSY-ETR RE 6319 CHECK RADIO DRAW REPLACE RADIO AUDIOUNT TO CORRECT PART FAILURE
KM8JN12D86U	10/15/05	6319	36.34	6319 CHECK ESC LIGHT ON CODE 1513 BRAKE LIGHT SWITCH INOP REPLACE BRAKE LIGHT SWITCH TO CORRECT PART FAILURE	VEHICLE DEPENDABILITY SURVEY	VDS	VEHICLE DEPENDABILITY SURVEY VEHICLE DEPENDABILITY SURVEY 6319 (NC)
KM8JM12B26U	7/11/05	23068	34.54		CUSTOMER STATES RATTLE NOISE WHEN GOING OVER BUMPS SOP HERE	VERIFIED CONCERN AS RIGHT STABILIZER LINK LOOSE REPLACED STABILIZER LINK TO CORRECT. INSPECTED	OTHER STABILIZER LINK AND TIRES FOR UNEVEN WEAR OR DAMAGE. ALL OK AT THIS TIME
KM8JM12B26U	7/11/05	23068	34.54		CUSTOMER STATES TCS LIGHT STAYING ON	SCAN SYSTEM FOUND CODE FOR C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LIGHT SWITCH TO CORRECT
KM8JM12B46U	7/20/05	19571	34.86		CUST STATES ESC LIGHT IS ON AND SAYS IT IS OFF	SCANNED FOR CODES FOUND C1513 FOR BRAKE SWITCH FOUND INTERMITENTLY STICKING	REPLACED SWITCH BRAKE SWITCH RETESTED OK
KM8JN12D95U	6/03/05	29023	36.66	29023 CODE C1513 BRAKE LAMP SWITCH SHORTED OUT. REPLACED SWITCH & WORKS AS DESIGNED.ERACE CODE COMP.	CUST STATES CAR SLOW TO START	F	BATTERY ASSY RE BATTERY ASSY RE 29023 TEST BATTERY & FAIL REPLACED BATTERYCHARGING SYSTEM & BATTERY ARE OK. COMP.
KM8JN12D95U	6/03/05	29023	36.66	29023 CODE C1513 BRAKE LAMP SWITCH SHORTED OUT. REPLACED SWITCH & WORKS AS DESIGNED.ERACE CODE COMP.	RECALL #079	RECALL	079 TUCSON DRIVER AIR BAGCOVER MODULE REPLACEMENT 079 TUCSON DRIVER AIR BAGCOVER MODULE REPLACEMENT 29023 COMPLETED RECALL INSPECT AND REPLACEAIRBAG COVER
KM8JN12D95U	6/03/05	29023	36.66	29023 CODE C1513 BRAKE LAMP SWITCH SHORTED OUT. REPLACED SWITCH & WORKS AS DESIGNED.ERACE CODE COMP.	CUST STATES ECS LIGHT COMING	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 29023 CODE C1513 BRAKE LAMP SWITCH SHORTEDOUT. REPLACED SWITCH & WORKS ASDESIGNED.ERACE CODE
KM8JN72DX5U	5/23/05	15063	34.54		CUST STATES ESP LIGHT COMES ON AND OFF RANDOMLY	BRAKE SWITCH OPEN	REPLACE SWITCH TO CORRECT
KM8JN12D06U	9/23/05	16571	34.86		CUST STATES ESC LIGHT WAS ON ALL DAY YESTERDAY TODAY IT WENT OUT	C1237 PRIMARY PRESSURE SENSOR CIRCUIT C1513 BRAKE SWITCH CIRCUIT COULD NOT CONFIRM LIGHT ON AT THIS TIME SCANNED COMPUTE	R RETRIEVED ABOVE CODES FOUND BRAKE SWITCH BOUND REPLACED BRAKE SWITCH RETESTED AND CLEARED CODES
KM8JM12B97U	8/29/06	6162	34.54		CUSTOMER STATES TCS LIGHT COMES ON INTERMITTANTLY	SCAN SYSTEM. VERIFIED CONCERN AS BRAKE LIGHT SWITCH INTERNAL MALFUNCTION	REPLACE BRAKE LIGHT SWITCH TO CORRECT
KM8JN12D25U	5/26/05	28815	36.34	28815 FOUND CODE C1513 BRAKE SWITCH CRICUIT CODE AND FREEZE FRAME ARE ON GDS PRINTOUT FOUND BRAKE SWITCH PART FAILURE REPLACED BRAKE SWITCH	CUST STATES ECS LIGHT COMING ON	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 28815
KM8JN72D06U	8/08/05	21997	36.06	TECH FOUND CODE B1513 BRAKE LAMP SWITCH INOP, ADVISED STOP LAMP SWITCH NEEDS TO BE REPLACED. TECHNICIAN HAS REPLACED STOP LAMP SWITCH. SERVICE HAS BEEN COMPLETED BY TECHNICIAN.			

KM8JN12D17U	11/03/06	3630	36.06	TECHNICIAN HAS FOUND STOP LAMP SWITCH SHORTED, NEEDS TO BE REPLACED. TECHNICIAN HAS REPLACED STOP LAMP SWITCH. SERVICE HAS BEEN COMPLETED BY TECHNICIAN.			
KM8JN72D85U	7/02/05	22965	34.86	REPLACED BRAKE LIGHT SWITCH TO CORRECT	CUSTOMER STATES ESP LIGHT GOES ON AND OFF INTERMITTANTLY WHILE DRIVING	SCAN SYSTEM. FOUND CODE FOR BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH TO CORRECT
KM8JM12B16U	7/16/05	15879	34.54		CUSTOMER STATES TCS LIGHT GOES ON AND OFF WHILE DRIVING	SCAN CK ESC SYST. C1513 BRAKE LAMP SWITCH CK BRAKE LP SWITC H ADJUSTMENT AND OPERATION INTERNAL SWITCH	REPLACE BRAKE LIGHT SWITCH ERASED CODE RETESTED GOOD
KM8JN72D56U	10/04/05	23800	34.86		CUSTOMER STATES ESC LIGHT COMES ON INTERMITTANTLY WHILE DRIVING. WONT GO OFF UNTIL CAR IS RESTARTED	TESTED SYSTEM. VERIFIED CONCERN AS INTERNAL MALFUNCTION IN BRAKE LIGHT SWITCH	REPLACED BRAKE LAMP SWITCH TO CORRECT
KM8JN72DX6U	7/15/05	22314	35.74	TECHNICIAN HAS FOUND BRAKE LAMP SWITCH INTERMITTANTLY INOP TECHNICIAN HAS REPLACED BRAKE LAMP SWITCH.			
KM8JN72DX6U	7/15/05	26645	36.06	SWITCH SHORTED TECHNICIAN HAS REPLACED BRAKE SWITCH.			
KM8JN72D36U	9/26/05	20634	36.06	C1513 BRAKE LAMP SWITCH SHORT, INOP TECNICIAN HAS REPLACED BRAKE LAMP SWITCH.			
KM8JM12B76U	8/19/05	14004	33.38	INSPECT VEHICLE FOUND C1237 PRESSURE SENSOR C15 13 BRAKE LAMP SWITCH SHORT			
KM8JM12B46U	9/09/05	14239	35.34	SHORTED			
KM8JN12DX6U	7/18/05	16802	33.38	SHORTED			
KM8JM12B45U	5/14/05	24555	35.34	INSPECT VEHICLE FOUND C1513 BRAKE SWITCH ERRA R PERFORMED DIAGNOSIS FOUND SWITCH STUCK NECESSAR Y TO REPLACE			
KM8JM12B96U	7/15/05	12491	37.7	C/S THE ESC LIGHT IS ON, TECH FOUND BRAKE LIGHT SWITCH NEEDS TO BE REPL. TECH REPL BRAKE LIGHT SWITCH	C/S THE ESC LIGHT IS ON-SOP HERE	TECH FOUND BRAKE LIGHT SWITCH NEEDS TO BE REPLACED.	TECH REPLACED BRAKE LIGHT SWITCH. 93810R00 0.3 N94 C15
KM8JN72D76U	12/10/05	17391	28.84		CUSTOMER STATES ESC LIGHT COMES ON AT TIMES WHILE DRIVING	PERFORM SCAN TEST--CODE C1513--BRAKE SWITCH CIRCUIT	REPLACE BRAKE LAMP SWITCH
KM8JN12D36U	10/21/05	21929	32.16		ESC LIGHT COMES ON	DTC C1513-BRAKELAMP SWITCH & C1237 - PRESSURE SNSR - OTHER	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21929 DTC C1513-BRAKELAMP SWITCH & C1237 -PRESSURE SNSR - OTHER CHECKED OPERATION OFBRAKE LAMP SW USING HIGH-SCAN PRO. NOTEDINTERMITTENT 'CLOSE' (OR 'ON') DURING TEST OFSW. REPLACED BRAKE LAMP SW. CHECKE
KM8JM12B46U	7/11/05	13900	35.16	INSPECT VEHICLE FOUND CODE C1237 PRESSURE SENSR C1513 BRAKE LAMP SWITCH REMOVED & REPLACED STOP LAMP SWITCH			
KM8JN12D75U	6/13/05	17861	35.34	SHORTED			
KM8JM12B57U	11/14/06	11968	35.16	C1513 BRAKE SWITCH CIRCUITSHORT			
KM8JN12D26U	7/29/05	24689	34.84	SHORTED			
KM8JN12D66U	12/27/05	13246	32.16		CUSTOMER STATES ESC LIGHT IS ON	C1513 BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 13246 C1513 BRAKE LAMP SWITCH REPLACEDBRAKE LAMP SWITCH AND CLEARED CODE
KM8JN12D45U	6/09/05	28318	32.16		ESC LIGHT IS ON	C1513 BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 28318 C1513 BRAKE LAMP SWITCH REPLACEDBRAKE LAMP SWITCH
KM8JM12B85U	10/28/04	29566	30.45		CUSTOMER STATES CHECK ENGINE LIGHT IS ON	PO506 IDLE CON EXPECTED RPM LOW/PO507 IDLE CON EXPECTED RPM HIGH	CUSTOMER STATES CHECK ENGINE LIGHT IS ON CUSTOMER STATES CHECK ENGINE LIGHT IS ON 29566 PO506 IDLE CON EXPECTED RPM LOW/PO507IDLE CON EXPECTED RPM HIGH CHECKED IDLEWITH HIGH SCAN PRO IDLE AT BETWEEN 698TO 720WITH AC OF WITH AC ON843 TO 857 NO PROBLEMFO
KM8JN12D86U	3/11/06	11708	33.38	SHORT			
KM8JN12D25U	7/08/05	37488	31.5	REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES: ESC LIGHT COMES ON INTERMITTENLY	SCAN TEST CODE B1513 BRAKE LIGHT SWITCH, ITERMITTEN OPEN CIRCUIT	REPLACED BRAKE LIGHT SWITCH
KM8JN72D46U	11/30/05	28467	31.5				
KM8JM12B85U	10/28/04	29566	30.45		CUSTOMER STATES ESC LIGHT ON	C1513 BRAKE LAMP SWITCH HAS INTERNAIL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 29566 C1513 BRAKE LAMP SWITCH HAS INTERNAILSHORT REPLACE BRAKE LAMP SWITCH AND CLEARDCODE
KM8JN12D75U	6/01/05	31487	31.84				
KM8JM12BX6U	12/29/05	18413	31.84		CUSTOMER STATES ESC LIGHT IS ON	RAIN SCAN TOOL FOUNDCODE C1513 BRAKE LAMP SWITCH HAS A INTERNAIL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 18413 RAIN SCAN TOOL FOUND CODE C1513 BRAKELAMP SWITCH HAS A INTERNAIL SHORT REPLACEBRAKE LAMP SWITCH CLEARD CODE AND ROAD
KM8JM12B36U	7/11/05	39441	45.34	TT TIME TO SCAN CODE C1237, C1513, REPLACED FAILED BRAKE SWITCH	TECH NOTED FRONT MAIN SEAL LEAKING OIL	TECH NOTED UPON FURTHER DIAG. FOUND VALVE COVER SEPERATED DUE TO VALVE COVER FAILURE	TECH REPLACED VALVE COVER GASKET OK NOW

KM8JM12B36U	7/11/05	39441	45.34	TT TIME TO SCAN CODE C1237, C1513, REPLACED FAILED BRAKE SWITCH	CLIENT STATES ESC LIGHT IS ON	TECH NOTED VERIFIED CLIENTS CONCERN FOUND CODE C1237,C1513 BRAKE SWITCH CIRCUIT DUE TO INTERNAL FAILURE IN BRAKE SWITCH	TECH REPLACED BRAKE LIGHT SWITCH CLEARED CODES OK NOW
KM8JN72D36U	12/22/05	37606	52.86	ECS LAMP ON. SCAN CODE C1513, REPLACEMENT SWITCH FAILED AFTER 5 MONTH OF SERVICE. REPLACED SWITCH, CLEARED CODE	CLIENT STATES ESC LIGHT IS ON	TECH NOTED VERIFIED CLIENTS CONCERN FOUND CODE C1513 DUE TO INTERNAL FAILURE IN BRAKE SWITCH	TECH REPLACED BRAKE SWITCH CLEARED CODES OK NOW
KM8JM12BX6U	12/29/05	18413	31.84		CUSTOMER STATES AC QUIT BLOWING	NO PROBLEM FOUND	CANNOT REPRODUCE CUSTOMER CONCERN CANNOT REPRODUCE CUSTOMER CONCERN 18413 NO PROBLEM FOUND
KM8JN12D05U	11/16/04	50511	30.45		PERFORM 079 RECALL	079 CAMPAIGN	61B046R0 DRIVER AIR BAG MODULE REPLACEMENT 50511 079 CAMPAIGN PREFORM 079 CAMPAIGN
KM8JN12D05U	11/16/04	50511	30.45		CUSTOMER STATES CHECK ENGINE LIGHT IS ON	C1513 BRAKE LAMP SWITCH HAS INTERNAL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 50511 C1513 BRAKE LAMP SWITCH HAS INTERNAL SHORT REPLACE BRAKE LAMP SWITCH AND CLEAR CODE
KM8JN72D36U	12/22/05	29543	30.94		CLIENT STATES THAT THE ESC LAMP HAD COME ON. COULD NOT TURN LAMP OFF. AFTER TURNING OFF CAR AND BACK ON AGAIN THE LAMP DID NOT COME BACK	TECH NOTED VERIFIED CLIENTS CONCERN FOUND CODE C1513 BRAKE LIGHT SWITCH DUE TO INTERNAL FAILURE IN SWITCH	TECH REPLACED SWITCH OK NOW
KM8JN12D55U	5/26/05	15475	31.26		C/S THAT ESP OFF LIGHT OFF AND ON	TECH NOTED VERIFIED CLIENTS CONCERN FOUND CODE 1513 DUE TO INTERNAL FAILURE IN BRAKE LAMP SWITCH	TECH REPLACED BRAKE LAMP SWITCH CLEARED CODES OK NOW
KM8JN72D76U	7/29/05	32151	29.83		ESC LIGHT WOULDNT GO OFF- BUT FINE NOW-JUST CHECK	TECH VERIFIED CONCERN...FOUND CODE C1513 DUE TO INTERNAL FAILURE IN BRAKE LIGHT SWITCH	TECH REPLACED BRAKE LIGHT SWITCH... CLEARED CODE OK NOW
KM8JM12B76U	7/11/05	28779	31.84		CUSTOMER STATES ESC LIGHT COMES ON AT TIMES	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 28779 FOUND BRAKE LIGHT SWITCH HAD INTERNAL SHORT CIR. REPLACE BRAKE LIGHT SWITCH ADJ AIRGAP
KM8JN12D96U	12/06/05	24684	31.84		CUST SAYS HEARS HUMMING NOISE FROM DASH WHEN A/C IS ON..MORE SO WHEN ON HIGH	FOUND BLOWER MOTOR TO BE OUT OF BALANCE	BLOWER ASSY RE BLOWER ASSY RE 24684 FOUND BLOWER MOTOR TO BE OUT OF BALANCE REPLACED BLOWER MOTOR
KM8JN12D96U	12/06/05	24684	31.84		T-79 RECALL	079 RECALL	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 24684 079 RECALL 020 REPLACED DRIVER AIRBAG
KM8JN72D06U	7/27/05	25236	52.86	CHECK ENGINE LAMP OJN. CODE C1513, STOP SWITCH FAILURE, REPLACED SWITCH(TT TIME TO SCAN CODES)	CUSTOMER STATES THAT THE CHECK ENGINE LAMP IS ON. CLIENT STATES ESC LIGHT IS ON	TECH VERIFIED CONCERN..FOUND CODE C1513 TRACED TO INTERNAL FAILURE BRAKE LIGHT SWITCH	TECH REPLACED SWITCH...CLEARED CODE...OK NOW
KM8JM72B96U	11/24/05	8297	52.54	TT TIME TO SCAN CODE C1513			
KM8JN12D85U	2/17/05	2631	32.32		CUSTOMER STATES BRAKE LIGHT STAYS WHEN VEHICLE OFF...ESP LIGHT IS ON...WILL STOP BY ITSELF..BRAKE LIGHT FUSE OUT	VERIFIED CUSTOMERS CONCERN ...FOUND BRAKE LIGHT SWITCH BROKEN DUE TO IMPROPER ADJUSTMENT AT FACTORY	REPLACED SWITCH WITH NEW OPERATING CORRECTLY NOW
KM8JN12D96U	12/06/05	24684	31.84		CUSTOMER STATES ESC LIGHT COMES ON INTERMITTENTLY	C1513 BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 24684 C1513 BRAKE LAMP SWITCH CUSTOMER STATED ESC LIGHT COMES ON AND OFF. CONNECTED SCAN TOOL AND FOUND CODE C1513. TESTED BRAKE LAMP SWITCH AND FOUND INTERMITTENT CONTACT. REPLACED SWITCH AND OPERATES NORMAL
KM8JM12B65U	7/04/05	69643	33.8		CHECK ENGINE LIGHT MISSING BOLT IN MANIFOLD	06	PROTECTOR-HEAT (OR V6 RH) PROTECTOR-HEAT (OR V6 RH) 69643 FOUND CODE C1237 PRESSURE SENSOR & C1513 BRAKE LAMP SWITCH OPEN OR SHORTED FOUND BRAKE LAMP SWITCH HAD INTERNAL OPEN CIRCUIT. REPLACE BRAKE LAMP SWITCH
KM8JM12B65U	7/04/05	69643	33.8		CUSTOMER STATED ESC LIGHT COMES ON AND OFF	15	JM ECM REPROGRAMMING (TSB# 06-36-005) JM ECM REPROGRAMMING (TSB# 06-36-005) 69643 CODE PO111 AIR INTAKE TEMPERATURE ABNORMAL 0.3 PERFORM ECM REPROGRAMMING STB#06-36-005 FOR MIL ILLUMINATION AND DTC CODE PO111
KM8JN72D36U	7/26/05	14675	31.26		TECH NOTED BRAKE LIGHTS INOP	TECH NOTED BRAKE LIGHTS INOP DUE TO INTERNAL FAILURE IN BRAKE SWITCH	TECH REPLACED BRAKE SWITCH OK NOW
KM8JN72D06U	8/10/05	10199	30.94		C/S THAT ESC OFF LIGHT APPEARS AT TIMES	TECHNICIAN CONFIRMED KLIGHT TO FIND INTERNAL SHORT IN BRAKE	SWITCH REASSEMBLED RETESTED ALL TO SPECS AT THIS TIME
KM8JN72D56U	3/03/06	6469	30.94		CLIENT STATES ESC LAMP CAME ON AND WOULD NOT GO OUT. COULD NOT TURN OFF. AFTER TURNING CAR OFF LAMP DID NOT COME BACK ON.	TECH CHECKED FOR CODES IN SYSTEM. C1513 CODE PRESENT, BRAKE LAMP SWITCH INTERMITTANT OPEN.	TECH REPLACED BRAKE LAMP SWITCH AND RECHECKED OPERATION. ROAD TEST NORMAL AT THIS TIME.

KM8JM12B65U	7/04/05	69643	33.8		CUSTOMER STATED ESC LIGHT COMES ON AND OFF	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 69643 CODE P0111 AIR INTAKE TEMPTURE ABNORMAL0.3 PERFORM ECM REPROGRAMMING STB#06-36-005FOR MIL ILLUMINATIO AND DTC CODE P0111
KM8JN12D66U	8/11/05	14034	31.84		CUSTOMER STATES ESC OFF LIGHT COMES ON (MOSTLEY HOTTER DAYS)	RAIN HIGH SCAN PRO TOOL FOUND CODE 1513 BRAKE LAMP SWITCH HAS INTERNAL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 14034 RAIN HIGH SCAN PRO TOOL FOUND CODE 1513BRAKE LAMP SWITCH HAS INTERNAL SHORTREPLACE BRAKE LIGHT SWITCH AND CLEAR CODE
KM8JN72D35U	1/14/05	32776	29.55		CUSTOMER STATES PASSENGER FOG LIGHT INOP	TECH VERIFIED DRIVERS FOG LIGHT INOP...DUE TO INTERNAL FILAMENT FAILURE	TECH REPLACED DRIVERS FOG LIGHT...OK NOW
KM8JN72D35U	1/14/05	32776	29.55		CLIENT STATES WINDOW WILL NO GO UP PROPERLY PARTS TAGGED CALLED CLIENT 02-28-07 L/M PART IN, DBEAN.	TECH VERIFIED CONCERN...FOUND DRIVERS FRONT WINDOW RUN CHANNEL DEFROMED	TECH REPLACED DRIVER FRONT WINDOW RUN CHANNEL OK NOW
KM8JN72D35U	1/14/05	32776	29.55		CUSTOMER STATES ESP OFF LIGHT HAS COME ON AND OFF WHILE ON COULD NOT PUSH BUTTON TO CHANGE...	CODES 1503/1513...TRACED CONCERN TO INTERNAL FAILURE IN BRAKE LIGHT SWITCH...	TECH REPLACED BRAKE LIGHT SWITCH...OK NOW
KM8JN12D66U	8/11/05	14034	31.84		CUSTOMER STATES WINDSHIELD WASHERS INOP FRONT/REAR	INTERNAL SHORT IN WASHER PUMP	MOTOR & PUMP ASSY- WINDSHIELD WASHER RE MOTOR & PUMP ASSY-WINDSHIELD WASHER RE 14034 INTERNAL SHORT IN WASHER PUMPREPLACE WASHER PUMP AND WASHER FLUID
KM8JN12D26U	7/18/05	14729	32.16		CUSTOMER STATES ECS LIGHT WAS ON (SPECIAL ORDERED PART)	C1513 BRAKE LAMP SWITCH HAS INTERNAL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 14729 C1513 BRAKE LAMP SWITCH HAS INTERNALSHORT REPLACE BRAKE LAMP SWITCH AND CLEARCODE
KM8JM12B16U	1/11/06	31513	32.16		CUSTOMER STATES ESC LIGHT IS ON	C1513 BRAKE LAMP SWITCH HAS A INTERNAL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 31513 C1513 BRAKE LAMP SWITCH HAS A INTERNAL SHORT REPLACE BRAKE LAMP SWITCH ANDCLEAR CODE
KM8JN72D35U	1/14/05	32776	29.55		CUSTOMER STATES THAT THE CHECK ENGINE LAMP IS ON. ON AND OFF	TECH VERIFIED CONCERN...FOUND CODE P0150 DUE TO INTERNAL FAILURE IN BANK TWO SENSOR ONE O2 SENSOR	TECH REPLACED O2 SENSOR CLEARED CODES...OK NOW
KM8JM72B66U	12/22/05	4012	52.54	TT TIME TO SCAN CODE C1513	CUSTOMER STATES SHIFTER KNOB SEPERATING PART HERE	REMOVED AND REPLACED SHIFTER KNOB REASSEMBLED RETESTED AALL	TO SPECS AT THIS TIME
KM8JN12D96U	8/15/05	23120	31.84		CUSTOMER STATES ESC LIGHT ON	15	SENSOR-PRESSURE SENSOR-PRESSURE 23120 HADE TWO CODES C1237 PRESSURE SENSOROTHER/C151 3 BRAKE LIGHT SWITCH CHECK BRAKEPRESSURE SENSO R FOUND OPEN SHORT/CHECK BRAKELIGHT SWITCH ALS O FOUND OPEN SHORT TO GROUNDREPLACE BRAKE LIGHT SWITCH AND BRAKE PRESSURESER
KM8JN12D96U	8/15/05	23120	31.84		CUSTOMER STATES ESC LIGHT ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 23120 HADE TWO CODES C1237 PRESSURE SENSOROTHER/C151 3 BRAKE LIGHT SWITCH CHECK BRAKEPRESSURE SENSO R FOUND OPEN SHORT/CHECK BRAKELIGHT SWITCH ALS O FOUND OPEN SHORT TO GROUNDREPLACE BRAKE LIGHT SWITCH AND
KM8JM12B35U	12/04/04	3746	50	CUSTOMER HAS RENTAL CAR LATE NIGHT FAILURE, PARTS ORDERED, SAFETY CONCERN	CUSTOMER STATES NONE OF THE BRAKE LIGHTS WILL ILLUMINATE	INTERNAL ELECTRICAL FAILURE	REPLACE BRAKE LIGHT SWITCH
KM8JM72B66U	12/22/05	4012	52.54	TT TIME TO SCAN CODE C1513	CLIENT STATES ESC LIGHT COMES ON&OFF	TECHNICIAN VERIFIED CODE TO FIND INTERNAL SHORT ON BRAKE SWI	TCH REMOVED AND REPLACED SWITCH RETETSED OPERATING AS DESIGNED AT THIS TIME
KM8JM12B76U	7/11/05	8090	56.9	ATT FOR DIO	ESP LIGHT COMING ON IN DASH WITHOUT CUSTOMER PUSHING BUTTON	DIO FOUND CODE C1513 BRAKE LAMP SWITCH PINPOINT DIAG FOUND INTERNAL SHORT IN BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH ROAD TESTED TO VERIFY REPAIRS.
KM8JN72DX6U	12/27/05	38128	32.46		CUSTOMER STATES CRUISE CONTROL INOPERATIVE	FPUND SHORT IN BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN72DX6U	12/27/05	38128	32.46		CUSTOMER STATES FLUID ON GROUND IN FRONT OF VEHICLE	FOUND AXLE BOOT SEEPING GREASE..BOTH ENDS	REPLACE AXLE BOOT
KM8JM12B35U	12/04/04	3746	50	CUSTOMER HAS RENTAL CAR LATE NIGHT FAILURE, PARTS ORDERED, SAFETY CONCERN	CUSTOMER HAS RENTAL CAR		2 DAYS RENTAL, LATE NIGHT FAILURE, PARTS ORDER SAFETY CONCERN
KM8JM12B35U	12/04/04	3746	37.12	CUSTOMER STATES NON OF THE BRAKE LIGHTS ILLUMINATE, INTERNAL MALFUNCTION REPLACE BRAKE LIGHT SWITCH	CUSTOMER STATES NONE OF THE BRAKE LIGHTS WILL ILLUMINATE	INTERNAL ELECTRICAL FAILURE	REPLACE BRAKE LIGHT SWITCH
KM8JM12B35U	12/04/04	3746	37.12	CUSTOMER STATES NON OF THE BRAKE LIGHTS ILLUMINATE, INTERNAL MALFUNCTION REPLACE BRAKE LIGHT SWITCH	CUSTOMER HAS RENTAL CAR		2 DAYS RENTAL, LATE NIGHT FAILURE, PARTS ORDER SAFETY CONCERN
KM8JN72D66U	10/21/05	21341	32.46		CUSTOMER STATES ESC LIGHT COMES ON AT TIMES	FOUND INTERNAL SHORT WITH BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH

KM8JN72D66U	7/25/05	20772	56.9	ATT FOR SCAN TOOL-DTC C1513	CUSTOMER STATES ESC LIGHT IS ON	DIO FOUND CODE C1513 BRAKE LAMP SWITCH FOUND BRAKE LAMP SWITCH SHORTED TO GROUND	REPLACED BRAKE LAMP SWITCH
KM8JN72D66U	7/25/05	20772	56.9	ATT FOR SCAN TOOL-DTC C1513	CUSTOMER STATES HANDLE ON PASSENGER SIDE IS LOOSE ROOF HANDL	TIGHTENED HANDLE AND REINSTALLED TRIM	
KM8JN72D46U	10/12/05	22009	37.41		CUSTOMER STATES THE ESC LIGHT COMES ON AND GOES OFF WHILE DRIVING	PER SCANNER CODE C1513	REPLACE BRAKE LIGHT SWITCH 93810R00.3 N94 C15
KM8JN72D66U	10/11/05	10065	37.84				
KM8JN72D15U	7/01/05	15286	38.6		C/S ESP LIGHT ON SOP		STOP LAMP SWITCH ASS'Y RE
KM8JM12B85U	7/06/05	24077	32.46		CUSTOMER STATES TCS LIGHT KEEPS GOING ON AND OFF	FOUND FAULTY BRAKE LIGHT SWITCH B1513	REPLACE BRAKE LIGHT SWITCH...CLEAR CODE...FINE
KM8JM12B87U	11/02/06	4530	32.46		CUSTOMER STATES THE ESC LIGHT COMES ON	DIAGNOSE-FOUND CODE C1413/BRAKE SWITCH CIRCUIT WITH INTERNAL SHORT.	REMOVED AND REPLACED BRAKE SWITCH. CLEARED CODE TEST DROVE OK.
KM8JM12B06U	11/01/05	7822	34.1		ECS LIGHT IS ON CUSTOMER STATES HAS A RECALL	FOUND INTERNALLY MALFUNCTION BRAKE LAMP SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12D66U	7/18/05	23483	38.16		C/S ESC LIGHT COMES ON ADVISE		SWITCH ASSY-STOP LAMP RE
KM8JN12D66U	7/18/05	23483	38.16		C/S ESC LIGHT COMES ON ADVISE		SCAN TIME
KM8JN12D86U	7/30/05	20925	38.16		C/S INSPECT FOR CLICKING NOISE HEARD ON ACCEL-- INCREASES WITH SPEED. ADVISE		BELT-V OR DRIVE BELT RE
KM8JN12D86U	7/30/05	20925	38.16		C/S INSPECT ESC LIGHT COMING ON AT TIMES WHILE DRIVING.		HYDRAULIC MODULE ASSY ADDSCAN TOOL OPERATION
KM8JN72D86U	8/18/05	35460	55.26	ATT FOR SCAN TOOL-C1513			
KM8JN72D15U	4/29/05	16593	38	16599 CHECK ABS LIGHT IS ON. WARR//PERFORMED A SCAN TEST AND FOUND CODE 1513 BRAKE LIGHT SWITCH OPEN.REPLACED THE SWITCH AND RESET THE ABS SYSTEM AND FOUND NO FUTHER PROBLEM AT THIS TIME.	CUSTOMER STATES THAT ABS LIGHT IS ON//SOP		STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 16599 CHECK ABS LIGHT IS ON. WARR//PERFORMEDA SCAN TEST AND FOUND CODE 1513 BRAKE LIGHTSWITCH OPEN.REPLACED THE SWITCH AND RESET THEABS SYSTEM AND FOUND NO FUTHER PROBLEM ATTHIS TIME.
KM8JN12D45U	6/20/05	33655	36.04	33656 CUST. SATES ESP LIGHT IS FLICKERING WARR//.PERFORMED A SCAN TEST AND FOUND CODE 1513 BRAKE SWITCH FAILURE.REPLACED THE SWITCH AND RESET THE ESP LIGHT.			
KM8JN12D86U	7/30/05	20925	38.16		C/S INSPECT ESC LIGHT COMING ON AT TIMES WHILE DRIVING.		SWITCH ASSY-STOP LAMP RE
KM8JN12D56U	10/11/05	15179	38.16		C/S ESC LIGHT CAME INMTLY ADVISE		SWITCH ASSY-STOP LAMP RE
KM8JN12D56U	10/11/05	15179	38.16		C/S ESC LIGHT CAME INMTLY ADVISE		SCAN TIME
KM8JM12B16U	7/13/05	9655	38.6		ESC LIGHT COMES ON AND OFF		STOP LAMP SWITCH ASS'Y RE
KM8JN72D66U	8/13/05	31816	36.36	31816 CHECK ESC LIGHT ON. WARR//PERFORMED SCAN TEST AND FOUND CODE C1513. AFTER FURTHER INSPECTION FOUND THE BRAKE LAMP SWITCH HAD INTERNAL FAILURE. REPLACED SWITCH AND RESET ESC. FOUND NO FURTHER PROBLEMS AT THIS TIME.			
KM8JM12B45U	6/15/05	51421	31.86	CUST STATES ESP LIGHT ONCODE C1513 SHORT IN BRAKE LIGHT SWITCHR N R SWITCH AND CLEAR CODES			
KM8JN12DX5U	4/15/05	9564	32.6		C/S ESP LIGHT IS COMING ON	FOUND BRAKE LIGHT SWITCH FAULTY	REPLACED SWITCH
KM8JM12B16U	7/13/05	9655	38.6		C/S INSPECT FOR POSSIBLE LEAKS ADVISE		NO PROBLEM FOUND
KM8JM12B16U	7/13/05	9655	38.6		PROVIDE LOANER		PROVIDED RENTAL VEHICLE
KM8JN72D85U	10/15/04	14841	39.38		C/S ESP LIGHT GOES ON AND OFF ON ITS OWN SOP		STOP LAMP SWITCH ASS'Y RE
KM8JN12DX5U	4/15/05	9564	32.6		C/S REAR WIPER MAKING RUBBING NOISE	FOUND WIPER MAKING NOISE	REPLACED WIPER
KM8JN12DX5U	4/15/05	14082	34.26		C/S ESP LIGHT IS ON	FOUND BRAKE LIGHT SWITCH FAULTY	REPLACED BRAKE LIGHT SWITCH
KM8JN12DX5U	4/15/05	14082	34.26		C/S VEH MAKING NOISE WHEN SHIFTING INTO GEAR	FOUND INTERNAL TRANSMISSION FAILURE	REPLACED TRANSMISSION
KM8JN12DX5U	5/25/05	24447	33.8				
KM8JN72D27U	3/07/07	7502	33.36	7502 HAD CODE C1513 REPLACED THE BRAKE LIGHT SWITCH NOW HAS BRAKE LIGHT AND ECS LIGHT IS OFF CLEARED THE CODE			
KM8JM12B67U	10/10/06	2826	33.36	2826 USED SCAN TOOL CHECK DTCS IN ABS ESC ECT FOUND C1513 BRAKE LAMP SWITCH DTC RUN TESTS WITH SCAN TOOL NO SWITCH OUTPUT SHOWING CHANGE IN PEDAL POSION OR BRAKE LAMPS INSPECT AND TEST SWITCH OPEN CIRCUIT IN SWITCH REPLACED SWITCH CLEAR DTC TEST GOOD ROAD			
KM8JN12D46U	8/09/05	13343	35.76	13343 93810R00 .3 N69 C15 ESC LIGHT ON SCAN TEST C1513 BRAKE LIGHT SWITCH INT. OPEN REPLACE SWITCH AND RETEST OK AT THIS TIME	CUSTOMER STATES ESC LIGHT IS ON.	N69 C15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 13343 93810R00 .3 N69 C15 ESC LIGHT ON SCANTEST C1513 BRAKE LIGHT SWITCH INT. OPENREPLACE SWITCH AND RETEST OK AT THIS TIME
KM8JN12DX5U	5/25/05	50568	54.66	C1513--ADDITIONAL TIME FOR GDS DIAGNOSIS			
KM8JM12B85U	6/15/05	25291	56.3	C1513--ADDITIONAL TIME FOR SCAN TOOL DIAGNOSIS			
KM8JN72D26U	7/27/05	24360	30.34				

KM8JM12B47U	7/05/06	9603	34.54	9603 93810R00 .3 N94 C15 ESC LIGHT WILL NOT GO OFF SCAN TEST C1513 BRAKE SWITCH CIRCUIT TEST SWITCH OPEN CIRCUIT AND NO BRAKE LIGHTS REPLACE BRAKE SWITCH AND RETEST OK AT THIS TIME	CUST STATE STHE ESC LIGHT WILL NOT GO OFF	N94 C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 9603 93810R00 .3 N94 C15 ESC LIGHT WILL NOTGO OFF SCAN TEST C1513 BRAKE SWITCH CIRCUITTEST SWITCH OPEN CIRCUIT AND NO BRAKE LIGHTSREPLACE BRAKE SWITCH AND RETEST OK AT THISTIME
KM8JN12D55U	5/14/05	39836	34.26	CUST STATTES ESC LIGHT CAME ON LAST TIME AUG 16THCAUSE C1513 BRAKE LAMP SWITCH CODE - RLCD SWITCH	AIB BAG MODULE REPLACMENT (07-01-001) 61B046R0	AIR BAG MOSULE REPLACED AIR BAG MODULE	AIR BAG MOSULE CAMPAIGN AIR BAG MOSULE CAMPAIGN
KM8JN12D05U	1/04/05	42845	30.39		CUST STATES CRUISE CONTROL INOP (SOP)	BRAKE SWITCH READ LOW AND HIGH VOLTAGES	REPLACED CRUISE ACTUATOR AND STOP LAMP SWITCH. CHECKED WIRE CONNECTORS AT CRUISE MODULE. TEST DROVE CHECKED OK.
KM8JN72D26U	9/01/05	9414	31.7		CUSOTMER STATES ESC LIGHT IS ON	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D26U	9/01/05	21056	30.06				
KM8JN72D16U	9/15/05	32787	29.74		CUSTOMER STATES ESC LIGHT WILL COMEON AT TIMES WILL STAY ON TILL YOU TURN VEH OFF		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D55U	5/14/05	39836	34.26	CUST STATTES ESC LIGHT CAME ON LAST TIME AUG 16THCAUSE C1513 BRAKE LAMP SWITCH CODE - RLCD SWITCH	CUSTOMER STATES ESC LIGHT CAME ON LAST TIME 16TH OF AUG	C1513 BRAKE LAMP SITCH CODE REPLACED BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D86U	8/09/05	22689	32.44		CUSTOMER STATES ECS LIGHT COMES ON AND WONT SHUT OFF	C1513 BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D86U	8/09/05	22689	32.44		LOANER EXPENSE	LOANER CUSTOMER SATISFACTION	LOANER EXPENSE LOANER EXPENSE
KM8JM12B76U	9/14/05	58034	30.96				
KM8JM12B56U	7/12/05	12635	21.3	WHEN SLOWING DOWN ON INCLINE AND PRESSING BRAKE THE ESC LIGHT COMES ON TESTED CIRCUIT C1513 BRAKE SWITCH CIRCUIT ADJUSTED SWITCH AND ORDERED NEW SWITCH	CUSTOMER STATES WHEN GOING DOWN INCLINE AND PRESSING BRAKE OCCASIONALLY ESC LIGHT COMES ON.	TEST FOR CODES; C1513. BRAKE SWITCH CIRCUIT.	ADJUSTED SWITCH AND ORDERED REPLACEMENT SWITCH.
KM8JM12B56U	7/12/05	12709	32.6		CUSTOMER STATES AT TIMES WHEN GOING DOWN INCLINE THE ESC LIGHT COMES ON / S/O/PART	CHECKED ESC CIRCUIT	DIAGNOSE AND REPLACED BRAKE SWITCH
KM8JN12DX6U	8/08/05	21261	34.26		CUSTOMER STATES ESC LIGHT COMES ON WHILE DRIVING-ON YESTERDAY	C1513 BRAKE LAMP SWITCH CODE REPLACED BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D56U	8/31/05	31598	34.26	CUST STATES ESC LIGHT COMES ON WHEN ROADS ARE WETC1513 BRAKE LAMP SWITCH OPEN RPLCD BRAKE LAMP SWITCH	CUSTOMER STATES ESC LIGHT COMES ON WHEN ROADS ARE WET	C1513 BRAKE LAMP SWITCH OPEN REPLACED BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D85U	5/27/05	21863	34.26	CSYT STATES ESP OFF LIGHT COMS ON INTERMITTANTCODE C1513 BRAKE LAMP SWITCH CIRCUIT RPLCD BRAKE LAMP SWITCH	AIB BAG MODULE REPLACMENT (07-01-001) 61B046R0	AIR BAG CAMPAIGN	AIR BAG MOSULE CAMPAIGN AIR BAG MOSULE CAMPAIGN
KM8JM72B46U	10/06/05	29240	32.6		CUSTOMER STATES WHILE DRIVING ESC LIGHT COMES ON AT TIMES ORDERED BRAKE LIGHT SWITCH.	BRAKE LAMP SWITCH IS DEFECTIVE.	REPLACED BRAKE LIGHT SWITCH. E
KM8JN72D36U	7/26/05	52255	59.36	A TIME TO DIAGNOSE AND ACTUAL TIME FOR REPLACEMENT			
KM8JN72D05U	2/23/05	20207	30.36		CUST STATES THAT WHEN DRIVING THE VEH ON SNOW THERE IS A GRINDING NOISE AND A VIBRATION THROUGHOUT THE VEH ALSO WILL THROW THROW THE VEH TO THE RIGHT SIDE AND BRAKES WILL HARDLY SLOW DOWN THE VEH NOT A BRAKE GRINDING NOISE SOUNDS LIKE BOTTOM OF VEH FALLIN	DIO AND REPLACED BRAKE FLUID PRESSURE SENSOR	AND BRAKE SWITCH
KM8JN12D85U	5/27/05	21863	34.26	CSYT STATES ESP OFF LIGHT COMS ON INTERMITTANTCODE C1513 BRAKE LAMP SWITCH CIRCUIT RPLCD BRAKE LAMP SWITCH	CUSTOMER STATES ESP OFF LIGHT COMESON INTERMITTANT	CODE C1513 BRAKE LAMP SWITCH CIRCUIT REPLACED BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D66U	8/24/05	9695	34.26	CUST STATES ESC OFF LIGHT IS ONSCAN SYSTEM FOUND FAULT CODE C1513 RPLC STOP LAMP SWITCH	AIB BAG MODULE REPLACMENT (07-01-001) 61B046R0	RECALL	AIB BAG MODULE REPLACEMENT(07-01-001) 61B046R0 AIB BAG MODULE REPLACEMENT(07-01-001) 61B046R0
KM8JN72D66U	8/24/05	9695	34.26	CUST STATES ESC OFF LIGHT IS ONSCAN SYSTEM FOUND FAULT CODE C1513 RPLC STOP LAMP SWITCH	CUSTOMER STATES ESC OFF LIGHT IS ON	SCAN SYSTEM FOUND FAULT CODE C1513 REPLACE STOP LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D46U	7/28/05	23408	30.96				
KM8JM72B56U	11/23/05	26061	30.96				
KM8JM12B35U	4/30/05	45106	31.26		"OUTSTANDING" IS A HARD RATING TO GIVE ANYONE FOR ANY KIND OF SERVICE. YOU MAY BE CONTACTED BY JD POWERS AND ASSOC.	ANYTHING BELOW AN "OUTSTANDING" IS A FAILING GRADE TO US.	(...) YES, I WILL GRADE YOU AS "OUTSTANDING" ON THE SURVEY.
KM8JM12B35U	4/30/05	45106	31.26		CUSTOMER STATES 3RD BRAKE LITE OUT	TECH FOUND BRAKE LITE SWITCH INOP	TECH REPLACED DEFECTIVE BRAKE LITE SWITCH, OPS CHEKC OK AT THIS TIME
KM8JN12D76U	8/31/05	13281	34.4	DIAGNOSED AND REPLACED BRAKE LAMP SWITCH-TESTED VERIFIED REPAIR	CUSTOMER STATES ESC LIGHT COMES ON INTERMITTENT	CODE C1513 BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE DIAGNOSED AND REPLACED BRAKE LAMP SWITCH-TESTED VERIFIED REPAIR
KM8JN72D26U	4/07/06	3201	34.4	DIAGNOSED AND REPLACED BRAKE LAMP SWITCH ORDERED PRESSURE SENSOR	CUSTOMER STATES ESP LIGHT COMES ON WHILE DRIVING	CODE C1513 BRAKE SWITCH CODE C1237 PRESSURE SENSOR	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE DIAGNOSED AND REPLACED BRAKE LAMP SWITCHORDERED PRESSURE SENSOR

KM8JM12B35U	4/30/05	45106	31.26		CUSTOMER STATES 3RD BRAKE LITE OUT	TECH FOUND 3RD BRAKE LITE INOP	TECH REPLACED DEFECTIVE 3RD BRAKE LITE OPS CHECK OK AT THIS
KM8JN12D16U	1/09/06	12863	30.94		"OUTSTANDING" IS A HARD RATING TO GIVE ANYONE FOR ANY KIND OF SERVICE. YOU MAY BE CONTACTED BY JD POWERS AND ASSOC.	ANYTHING BELOW AN "OUTSTANDING" IS A FAILING GRADE TO US.	(...) YES, I WILL GRADE YOU AS "OUTSTANDING" ON THE SURVEY.
KM8JN12D16U	1/09/06	12863	30.94		CUSTOMER STATES THAT ESC LIGHT IS ON	TECH SCANNED VEHICLE, CODE B1513, BRAKE LIGHT SWITCH MALFUNCTION	TECH REPLACED BRAKE LIGHT SWITCH AND CLEARED FAULT
KM8JM12BX6U	7/12/05	36015	34.26	36015 N99 SCAN TEST SYSTEM C1503 C1513 REPLACE BRAKE LAMP SWITCH ORDER NEW ESC SWITCH	OWNER STATES ECS WARNING LAMP IS COMING ON	N99	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 36015 N99 SCAN TEST SYSTEM C1503 C1513 REPLACE BRAKE LAMP SWITCH ORDER NEW ESC SWITCH
KM8JN12D06U	10/31/05	6402	23.1	REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES ESC OFF LIGHT IS ON AND BUTTON DOES NOT WORK	SHORTED	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED BRAKE LAMP SWITCH
KM8JN72D36U	9/13/05	42835	32.44		CUSTOMER STATES ESC LIGHT COMES ON	C1513 OPEN IN SWITCH REPLACED BRAKE LAMP	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B46U	2/22/06	16543	30.94		CUSTOMER STATES ESC LIGHT IS ON	SCAN VEHICLE, CODE C1513, BRAKE LIGHT SWITCH INTERNAL SHORT IN SWITCH	TECHNICIAN REPLACE BRAKE LIGHT SWITCH
KM8JN12D06U	7/29/05	24050	30.94		CUSTOMER STATES THAT AT TIMES ESC LIGHT WILL COME ON AT TIMES AND THEN GOES OFF.	TECH HAS FOUND THAT VEHICLE BRAKE SWITCH HAS INTERNAL FAILURE	TECH HAS REMOVED AND REPLACED VEHICLE DEFECTIVE BRAKE SWITCH AND RETESTED VEHICLE IS NOW TO FAC SPEC
KM8JN12D06U	7/29/05	24050	30.94		PERFORM CAMPAIGN 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT	61B046R0.2 DRIVER AIR BAG MODULE REPLACEMENT	COMPLETED RECALL AS DESIGNED BY HYUNDAI
KM8JN12D17U	11/03/06	906	59.74	CUSTOMER STATES THE ESC LIGHT IS COMING ON. CODE C1513; STOP LAMP SWITCH OPEN. PERFORM DIAGNOSTIC TESTS AND FOUND CODE C1513 FOR LAMP CIRCUIT; AND FOUND STOP SWITCH OPEN. REPLACE STOP LAMP SWITCH.	CUSTOMER STATES THE ESC LIGHT IS COMING ON	CODE C1513 STOP LAMP SWITCH OPEN	SCAN TEST ADD TIME FOR STOP LAMP SWITCH SCAN TEST ADD TIME FOR STOP LAMP SWITCH
KM8JN12D17U	11/03/06	906	59.74	CUSTOMER STATES THE ESC LIGHT IS COMING ON. CODE C1513; STOP LAMP SWITCH OPEN. PERFORM DIAGNOSTIC TESTS AND FOUND CODE C1513 FOR LAMP CIRCUIT; AND FOUND STOP SWITCH OPEN. REPLACE STOP LAMP SWITCH.	CUSTOMER STATES THE ESC LIGHT IS COMING ON	CODE C1513 STOP LAMP SWITCH OPEN	PERFORM DIAGNOSTIC TESTS, FOUND CODE C1513 STOP LAMP CIRCUIT, FOUND STOP SWITCH OPEN, REPLACE STOP LAMP SWITCH SWITCH ASSY STOP LAMP RE
KM8JN12D17U	11/03/06	906	59.74	CUSTOMER STATES THE ESC LIGHT IS COMING ON. CODE C1513; STOP LAMP SWITCH OPEN. PERFORM DIAGNOSTIC TESTS AND FOUND CODE C1513 FOR LAMP CIRCUIT; AND FOUND STOP SWITCH OPEN. REPLACE STOP LAMP SWITCH.	RENTAL VEHICLE	RENTAL	RENTAL VEHICLE RENTAL VEHICLE
KM8JN12D25U	5/24/05	38625	31.26		"OUTSTANDING" IS A HARD RATING TO GIVE ANYONE FOR ANY KIND OF SERVICE. YOU MAY BE CONTACTED BY JD POWERS AND ASSOC.	ANYTHING BELOW AN "OUTSTANDING" IS A FAILING GRADE TO US.	(...) YES, I WILL GRADE YOU AS "OUTSTANDING" ON THE SURVEY.
KM8JN12D25U	5/24/05	38625	31.26		CUSTOMER STATES LEAKING OIL ON RIGHT SIDE OF ENGINE/FRONT SEAL POSSIBLY	TECH FOUND OIL DRAIN PLUG GASKET LEAKING	TECH REPLACED OIL DRAIN PLUG/GASKET OPS CHECK OK AT THIS TIME
KM8JN12D25U	5/24/05	38625	31.26		CUSTOMER STATES FRONT CUPHOLDER IN CONSOLE BROKEN/PART HERE	TECH FOUND SPRING FOR CTR CONSOLE BROKEN	TECH REPAIR CTR CONSOLE TO ACCESS AND REPLACE BROKEN CUPHOLDER/OPS CHECK OK AT THIS TIME
KM8JN12DX6U	8/29/05	15944	60.06	CUSTOMER STATES THE ESC LIGHT HAS BEEN COMING ON. SCAN TEST CODE C1513 FOR BRAKE LAMP SWITCH. CHECK AND REPLACE THE SWITCH. CLEAR CODES AND RETEST O/K.	CUSTOMER STATES THE ESC LIGHT HAS BEEN COMING ON, SEE SOP	INOP	SCAN TEST ADD TIME FOR STOP LAMP SWITCH SCAN TEST ADD TIME FOR STOP LAMP SWITCH
KM8JN12DX6U	8/29/05	15944	60.06	CUSTOMER STATES THE ESC LIGHT HAS BEEN COMING ON. SCAN TEST CODE C1513 FOR BRAKE LAMP SWITCH. CHECK AND REPLACE THE SWITCH. CLEAR CODES AND RETEST O/K.	CUSTOMER STATES THE ESC LIGHT HAS BEEN COMING ON, SEE SOP	INOP	SCAN TEST CODE C1513 FOR BRAKE LAMP SWITCH. CHECK AND REPLACE THE SWITCH CLEAR CODE ROAD TEST O/K SWITCH ASSY-STOP LAMP RE
KM8JN12D25U	5/24/05	38625	31.26		CUSTOMER STATES HANDLE OVER PASS DOOR BROKEN/PART HERE	TECH FOUND RIGHT FRONT HANDLE STRIPPED OUT	TECH REPAIR STRIPPED RIGHT FRONT DOOR HANDLE, OPS CHECK OK AT THIS TIME
KM8JN12D25U	5/24/05	38625	31.26		CUSTOMER STATES ESP COMES ON INTERMITTENTLY	TECH FAULT TRACED CODE C1513 DEFECTIVE BRAKE SWITCH INTERNAL	TECH REPLACED DEFECTIVE SHORTED BRAKE SWITCH/CLEARED CODE TEST DROVE OPS CHECK OK AT THIS TIME
KM8JN12D16U	8/09/05	12024	30.94		CUSTOMER STATES CHECK ENGINE LIGHT ON	HI SCAN CODE TEST FOUND BAD BRAKE LAMP SWITCH	REPLACED BAD SWITCH
KM8JN72D46U	11/17/05	11830	35.3		CUSTOMER STATES THE STABILITY CONTROL LIGHT IS ON SEE ATTACHED NOTE	SWITCH INTERMITTENT	PERFORM DIAGNOSTIC TESTS, FOUND CODE C1513 FOR BRAKE SWITCH CIRCUIT, TEST SWITCH AND CHECK CIRCUIT, REPLACE SWITCH AND ROAD TEST SWITCH ASSY-STOP
KM8JN72D46U	11/17/05	11830	35.3		RENTAL VEHICLE	RENTAL	RENTAL VEHICLE RENTAL
KM8JN72D96U	8/18/05	22444	33.34		DRIVER AIR BAG COVER MODULE REPLACEMENT	PER RECALL	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT
KM8JN12D15U	5/24/05	16635	31.26		CUSTOMER STATES CHECK ENGINE LIGHT ON	TECH PERFORMED DIAGNOSTIC PROCEDURE AND FOUND THAT VEHICLE HAS CODE P0449, CONTROL CIRCUIT	REPLACED BAD VENT VALVE.

KM8JN12D15U		5/24/05	16635	31.26		CUSTOMER STATES THAT AT TIMES ESP LIGHT COMES ON AND OFF	TECH PERFORMED DIAGNOSTIC PROCEDURE AND FOUND VEHICLE HAD CODE C1513. BRAKE LIGHT SWITCH FAILURE.	REPLACED BRAKE LIGHT SWITCH.
KM8JN12D36U		8/17/05	29215	32.16	VERIFIED CONCERN. PERFORMED ELECT. TEST AND REPLACED OPEN CIRCUIT STOP LAMP SWITCH	CUSTOMER STATES ESC LIGHT IS ON	BRAKE LIGHT SWITCH CODE C1513	REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT, CLEARED CODES AND RECHECKED ALL OK AT THIS
KM8JN72D96U		8/18/05	22444	33.34		CUSTOMER STATES SECOND VISIT WHEN APPLYING THE BRAKE PEDAL IT WILL GODOWN SO FAR THEN PEDAL GETS VERY HARD AND YOU CANNOT DEPRESS IT ANY FURTHER. ALSO ON OCCASION THERE IS A CLUNK NOISE FROM THE FRONT OF VEHICLE WHEN CAR ACTUALLY COMES TO A STOP. BOTH HAP	CODE C1513 BRAKESWITCH SHORTING INTERMITTENTLY	ROADTEST VEHICLE, FELT FALSE ABS ACTIVATION. CHECK ABS AND BRAKE SYSTEMS, FOUND STOP LAMP SWITCH INTERMITTENTLY SHORTED, REPLACE SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN72D96U		8/18/05	22444	33.34		RENTAL VEHICLE	RENTAL	RENTAL VEHICLE RENTAL
KM8JN12D46U		10/28/05	11377	32.44		CUSTOMER STATES THE ESC LIGHT COMES ON	SWITCH INTERMITTENT	PERFORM DIAGNOSTIC TESTS, FOUND STOP LAMP SWITCH INTERMITTENT, REPLACED STOP LAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN72D95U		2/22/05	10321	45	C1513 C1237 IN MEMORY. TEST PER WSM. FOUND NO FREE PLAY IN BRAKE PEDAL. BRAKE SWITCH HOLDING BRAKE PEDAL DOWN. ADJUSTED SWITCH. CLEARED CODES. RETEST, ALL PASS. ROAD TEST TO VERIFY.	CUSTOMER STATES WHEN LETTING OFF ACCEL, THERE IS NO COAST EFFECT, FEELS LIKE BRAKES ARE APPLIED, VEHICLE SLOWING	ROAD TEST. VERIFIED. FOUND CODES C1513 C1237. NO FREE PLAY IN BRAKE PEDAL. BRAKE SWITCH HOLDING PEDAL DOWN.	ADJUSTED SWITCH. CLEARED CODES.
KM8JN12D66U		7/28/05	32806	31.84	CODE C1513. BRAKE SWITCH ERROR. REPLACED BRAKE LIGHT SWITCH.	CAMPAIGN 079. TUCSON DRIVER AIR BAG COVER MODULE REPLACEMENT 61B046R0.20	OPEN CAMPAIGN	COMPLETED CAMPAIGN 079.
KM8JN12D46U		10/28/05	11377	32.44		CUSTOMER STATES THE CD PLAYER BOUNCES AROUND TO DIFFERENT TRACKS, SOP PART HERE	CD SKIPPING TRACKS	FOUND RADIO ASSEMBLY MALFUNCTIONING, REPLACE RADIO ASSEMBLY RADIO ASSY-ETR RE
KM8JN12D36U		10/18/05	20123	59.74	CUSTOMER STATES THE ESC LIGHT CAME ON AT IDLE AND WHILE DRIVING. PUSHING THE BUTTON HAS NO EFFECT ON THE SYSTEM.	CUST STATES THE ESC LIGHT CAME ON AT IDLE AND WHILE DRIVING, PUSHING THE BUTTON HAS NO EFFECT ON THE SYSTEM, IN ORDER TO GET THE LIGHT OFF YOU NEED TO SHUT OFF THE ENGINE AND TURN BACK ON, LIGHT IS OFF TODAY	SWITCH MALFUNCTION	SCAN TEST ADD TIME FOR STO LAMP SWITCH SCAN TEST ADD TIME FOR STO LAMP SWITCH
KM8JN12D66U		7/28/05	32806	31.84	CODE C1513. BRAKE SWITCH ERROR. REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES ESC LIGHT KEEPS COMING ON/OFF-ADVISE	BRAKE LIGHT SWITCH OPEN CIR CODE C1513 BRAKE SWITCH ERROR	REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT CUSTOMER CONCERN, CLEARED CODES ALL OK AT THIS TIME.
KM8JM12B25U		6/03/05	31972	31.84	CUST STATES ESP LIGHT FLASHES AT TIMES CAUSE DEFECTIVE BRAKE SWITCH N69 C15 CORRECTION ELECT TEST AND REPLACE BRAKE SWITCH	CUST STATES AIR BAG LIGHT ON	OPEN CAMPAIGN	COMPLETED CAMPAIGN 079.
KM8JM12B25U		6/03/05	31972	31.84	CUST STATES ESP LIGHT FLASHES AT TIMES CAUSE DEFECTIVE BRAKE SWITCH N69 C15 CORRECTION ELECT TEST AND REPLACE BRAKE SWITCH	CUST STATES ESP LIGHT FLASHES AT TIMES	DEFECTIVE BRAKE SWITCH N69 C15	ELECT TEST AND REPLACE BRAKE SWITCH
KM8JN12D36U		10/18/05	20123	59.74	CUSTOMER STATES THE ESC LIGHT CAME ON AT IDLE AND WHILE DRIVING. PUSHING THE BUTTON HAS NO EFFECT ON THE SYSTEM.	CUST STATES THE ESC LIGHT CAME ON AT IDLE AND WHILE DRIVING, PUSHING THE BUTTON HAS NO EFFECT ON THE SYSTEM, IN ORDER TO GET THE LIGHT OFF YOU NEED TO SHUT OFF THE ENGINE AND TURN BACK ON, LIGHT IS OFF TODAY	SWITCH MALFUNCTION	PERFORM DIAGNOSTIC TESTS, FOUND CODE C1513, FOR BRAKE LIGHT SWITCH, RUN TESTS AND REPLACE THE BRAKE LAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN72D96U		8/16/05	17087	60.06	CUSTOMER STATES THE ESC LIGHT IS ILLUMINATED ON THE DASHBOARD. HITTING THE BUTTON HAS NO EFFECT. SCAN TEST CODE C1513 CHECK AND REPLACE THE BRAKE LIGHT SWITCH.	CUSTOMER STATES THE ESC OFF LIGHT IS ILLUMINATED ON THE DASH, HITTING THE ESC BUTTON HAS NOT EFFECT	SHORTED	SCAN TEST ADD TIME FOR STO LAMP SWITCH SCAN TEST ADD TIME FOR STO LAMP SWITCH
KM8JN72D96U		8/16/05	17087	60.06	CUSTOMER STATES THE ESC LIGHT IS ILLUMINATED ON THE DASHBOARD. HITTING THE BUTTON HAS NO EFFECT. SCAN TEST CODE C1513 CHECK AND REPLACE THE BRAKE LIGHT SWITCH.	CUSTOMER STATES THE ESC OFF LIGHT IS ILLUMINATED ON THE DASH, HITTING THE ESC BUTTON HAS NOT EFFECT	SHORTED	SCAN TEST CODE C1513 CHECK AND REPLACE THE BRAKE LIGHT SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN12D16U		10/10/05	19520	32.16	CODE C1513 BRAKE LIGHT SWITCH OPEN CIRCUIT CHECKED SYSTEM, REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT, CLEARED CODES AND RECHECKED ALL OK	CUSTOMER STATES ESC LIGHT COMES ON/OFF	CODE C1513 BRAKE LIGHT SWITCH	REMOVED AND REPLACED BRAKE LIGHT SWITCH, CLEARED CODES AND RECHECKED ALL OK AT THIS TIME.
KM8JN72D77U		7/04/06	1526	61.84	COMPLAINT ESC LIGHT ON/OFF TAP BRAKE PEDAL LIGHT COMES ON CAUSE CODE C1513 OPEN CIRCUIT BRAKE LIGHT SWITCH CORRECTION REPLACED BRAKE LIGHT SWITCH AND REPAIRED CONNECTOR AT PEDAL PINS BENT TO CORRECT. RECHECKED SYSTEM ALL OK AT T	ESC LIGHT ON/OFF TAP BRAKE PEDAL LIGHT COMES ON	CODE C1513 OPEN CIRCUIT BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH AND REPAIRED CONNECTOR AT PEDAL PINS BENT TO CORRECT. RECHECKED SYSTEM ALL OK AT THIS TIME.
KM8JN72D96U		8/16/05	17087	60.06	CUSTOMER STATES THE ESC LIGHT IS ILLUMINATED ON THE DASHBOARD. HITTING THE BUTTON HAS NO EFFECT. SCAN TEST CODE C1513 CHECK AND REPLACE THE BRAKE LIGHT SWITCH.	RENTAL VEHICLE	RENTAL	RENTAL VEHICLE RENTAL VEHICLE

KM8JM12B56U	12/12/05	11337	60.06	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON. STOP LAMP SWITCH INTERMITTENT CODE C1513. PERFORM DIAGNOSTIC TESTS AND FOUND CODE FOR STOMP LAMP CIRCUIT. TEST CIRCUIT AND FOUND STOP LAMP SWITCH INTERMITTENT. REPLACE STOP LAMP SWITCH.	CUSTOMER STATES THE MALFUNCTION INDICATOR LAMP IS ILLUMINATED	CODE P0111 TSB 06-36-005	PERFORM DIAGNOSTIC TESTS.FOUND CODE P0111, FOUND TSB FOR UPDATED PROGRAMMING, REPROGRAM AND UPDATE ELECTRONIC CONTROL MODULE JM ECM REPROGRAMMING (TSB# 06-36-005)
KM8JN12DX6U	9/24/05	26665	32.16	ESC WARNING LIGHT ON. TEST PER WSM.BRAKE LIGHT SWITCH INACTIVE.REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES ESC LAMP ON	OPEN CIRCUIT BRAKE SWITCH	DIAG. AND REPLACE BRAKE SWITCH
KM8JN12DX5U	4/28/05	29798	32.16	ELECT DIAG TEST B1513 REPLACE OPEN CIRCUIT BRAKE LIGHT SWITCH	CUSTOMER STATES CHECK ENGINE LIGHT IS ON	RUN EEC TESTS AS NECESSARY TO COMPLETE DIAGNOSTICS. CODE P0130 B1/S1 OUT OF SPECS	PERFORMED FOLLOWING REPAIRS TO CORRECT CK ENGINE LIGHT ON; REMOVED AND REPLACED O2 SENSOR TO CORRECT, CLEARED CODES AND RECHECKED ALL OK AT THIS TIME
KM8JN12DX5U	4/28/05	29798	32.16	ELECT DIAG TEST B1513 REPLACE OPEN CIRCUIT BRAKE LIGHT SWITCH	CUSTOMER STATES ESP LIGHT COMES ON/OFF	CODE B1513 BRAKE LIGHT SWITCH-OPEN CIRCUIT	REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT CLEARED CODES AND RECHECKED ALL OK.
KM8JM12B56U	12/12/05	11337	60.06	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON. STOP LAMP SWITCH INTERMITTENT CODE C1513. PERFORM DIAGNOSTIC TESTS AND FOUND CODE FOR STOMP LAMP CIRCUIT. TEST CIRCUIT AND FOUND STOP LAMP SWITCH INTERMITTENT. REPLACE STOP LAMP SWITCH.	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON	STOP LAMP SWITCH INTERMITTENT CODE C1513	SCAN TEST ADD TIME FOR STO LAMP SWITCH SCAN TEST ADD TIME FOR STO LAMP SWITCH
KM8JM12B56U	12/12/05	11337	60.06	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON. STOP LAMP SWITCH INTERMITTENT CODE C1513. PERFORM DIAGNOSTIC TESTS AND FOUND CODE FOR STOMP LAMP CIRCUIT. TEST CIRCUIT AND FOUND STOP LAMP SWITCH INTERMITTENT. REPLACE STOP LAMP SWITCH.	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON	STOP LAMP SWITCH INTERMITTENT CODE C1513	PERFORM DIAGNOSTIC TESTS.FOUND CODE C1513 FOR STOPLAMP CIRCUIT, TEST CIRCUIT AND FOUND STOP SWITCH INTERMITTENT, REPLACE STOP LAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN12D85U	12/28/04	24696	61.56	C/S RED BRAKE LAMP ON.FOUND BRAKE LIGHT SWITCH TO HAVE INTERNAL SHORTREPLACED STOP LAMP SWITCH.	CUSTOMER STATES RED BRAKE LAMP ON	OPEN CURCUIT	REPAIRED WIRE
KM8JN12D85U	12/28/04	24696	61.56	C/S RED BRAKE LAMP ON.FOUND BRAKE LIGHT SWITCH TO HAVE INTERNAL SHORTREPLACED STOP LAMP SWITCH.	CUSTOMER STATES THAT CARGO NET IS INOP	CARRIAGE HOLDER CLIP - PLASTIC FAILURE	R&R RT REAR CLIP
KM8JN12D85U	12/28/04	17802	31.56		CUSTOMER STATES ESC LAMP ON AND OFF		REPLACED BRAKE LIGHT SWITCH.
KM8JN12D36U	7/15/05	27641	60.06	CUSTOMER STATES THE ESC LIGHT IS COMING ON. CODE C1513 STOP LAMP SWITCH INOPERATIVE. PERFORM DIAGNOSTIC TESTS. REPLACED	CUST STATES THE ESC LIGHT COMES ON	CODE C1513 STOP LAMP SWITCH INOP	SCAN TEST ADD TIME FOR STO LAMP SWITCH SCAN TEST ADD TIME FOR STO LAMP SWITCH
KM8JN12D36U	7/15/05	27641	60.06	CUSTOMER STATES THE ESC LIGHT IS COMING ON. CODE C1513 STOP LAMP SWITCH INOPERATIVE. PERFORM DIAGNOSTIC TESTS. REPLACED STOP LAMP SWITCH.	CUST STATES THE ESC LIGHT COMES ON	CODE C1513 STOP LAMP SWITCH INOP	PERFORM DIAGNOSTIC TESTS.FOUND CODE C1513 FOR STOPLAMP CIRCUIT, TEST AND FOUND STOP LAMP SWITCH INOPERATIVE, REPLACE STOPLAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN72D26U	8/18/05	28913	60.06	CUSTOMER STATES THE ENGINE LIGHT IS ON BUT THE CAR IS RUNNING SMOOTH. PERFORM SCAN TEST AND FOUND CODE C1513 FOR BRAKE LAMP SWITCH.	CUST STATES THE ENGINE LIGHT IS ON,ENGINE RUNS SMOOTH, CUST NEEDS TO LEAVE AT 3:00	SHORTED	SCAN TEST ADD TIME FOR STO LAMP SWITCH SCAN TEST ADD TIME FOR STO LAMP SWITCH
KM8JN12D85U	12/28/04	17802	31.56		CUSTOMER STATES MUSTY ODOR FROM A/C VENTS	MILDEW BUILDUP, DRAIN PARTIALLY CLOGGED.	CLEARED DRAIN, INSTALLED ANTIBACTERIAL SPRAY INSIDE TUBE AND IN FRESH AIR INTAKE.
KM8JN12D46U	10/05/05	40072	32.16	CODE B1513. BRAKE LIGHT SWITCH OPEN CIRCUIT.REPLACED SWITCH.	CAMPAIGN 079. TUCSON DRIVER AIR BAG COVER MODULE REPLACEMENT61B046R0 .20	OPEN CAMPAIGN	COMPLETED CAMPAIGN 079.
KM8JN12D46U	10/05/05	40072	32.16	CODE B1513. BRAKE LIGHT SWITCH OPEN CIRCUIT.REPLACED SWITCH.	CUSTOMER STATES ESC LAMP COMES ON AND OFF WHEN DRIVING	BRAKE LIGHT SWITCH INTERNAL CODE 93810R00	REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT CUSTOMER CONCERN. CLEARED CODES RECHECKED ALL OK.
KM8JN72D26U	8/18/05	28913	60.06	CUSTOMER STATES THE ENGINE LIGHT IS ON BUT THE CAR IS RUNNING SMOOTH. PERFORM SCAN TEST AND FOUND CODE C1513 FOR BRAKE LAMP SWITCH.	CUST STATES THE ENGINE LIGHT IS ON,ENGINE RUNS SMOOTH, CUST NEEDS TO LEAVE AT 3:00	SHORTED	COULD NOT VERIFY ANY LIGHTS BEING ON. PERFORM SCAN TEST CODE C1513 BRAKE LAMP CIRCUIT. CHECKAND REPLACE THE BRAKE LAMP SWITCH. SWITCH ASSY-STOP LAMP RE
KM8JN12D46U	10/06/05	24763	59.74	THE CUSTOMER STATES THE ESC LIGHT KEEPS COMING ON AND WILL STAY ON. IF YOU CYCLE THE IGNITION ON AND OFF IT WILL GO OUT, PUSHING THE ESC BUTTON DOESN'T AFFECT THIS.	CUSTOMER STATES THE ESC LIGHT KEEPS COMING ON AND WILL STAY ON. IF YOU CYCLE THE IGNITION ON AND OFF IT WILL GO OUT, PUSHING THE ESC BUTTON DOES NOT SEEM TO EFFECT IT, THE LIGHT WILL NOT GO OUT	STOP LAMP SWITCH INTERMITTENT	SCAN TEST ADD TIME FOR STO LAMP SWITCH SCAN TEST ADD TIME FOR STO LAMP SWITCH
KM8JN12D85U	12/28/04	45274	30.45	CUSTOMER STATES ESP LIGHT COMES ON/OFF AT TIMES-CHECK WITH CUSTOMER ON DRIVE LIGHT NOT ON BRAKE LIGHT CODE C1513 REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT. CLEARED CODES AND	CUSTOMER STATES ESP LIGHT COMES ON/OFF AT TIMES-CHECK WITH CUSTOMER ON DRIVE LIGHT NOT ON-ADVISE	BRAKE LIGHT SWITCH CODE C1513	REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT. CLEARED CODES AND RECHECKED ALL OK.

KM8JN12D85U	12/28/04	45274	30.45	CUSTOMER STATES ESP LIGHT COMES ON/OFF AT TIMES-CHECK WITH CUSTOMER ON DRIVE LIGHT NOT ON BRAKE LIGHT CODE C1513 REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT. CLEARED CODES AND	DRIVER DOOR LOCK STICKS OR WILL NOT OPEN/CLOSE AT TIMES FROM REMOTE OR MASTER SWITCH-ADVISE	CHECKED POWER DOOR LOCK CIRCUIT PER WS. TO COMPLETE DIAG. LATCH-ACTUATOR INTERNAL PROBLEM	REMOVED AND REPLACED LATCH LOCK ACTUATOR TO CORRECT.
KM8JN12D46U	10/06/05	24763	59.74	THE CUSTOMER STATES THE ESC LIGHT KEEPS COMING ON AND WILL STAY ON. IF YOU CYCLE THE IGNITION ON AND OFF IT WILL GO OUT, PUSHING THE ESC BUTTON DOESN'T AFFECT THIS.	CUSTOMER STATES THE ESC LIGHT KEEPS COMING ON AND WILL STAY ON, IF YOU CYCLE THE IGNITION ON AND OFF IT WILL GO OUT, PUSHING THE ESC BUTTON DOES NOT SEEM TO EFFECT IT, THE LIGHT WILL NOT GO OUT	STOP LAMP SWITCH INTERMITTENT	PERFORM DIAGNOSTIC TESTS, FOUND CODE C1513 FOR STOP LAMP SWITCH, TESTED SWITCH, REPLACE STOP LAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN12D46U	10/06/05	24763	59.74	THE CUSTOMER STATES THE ESC LIGHT KEEPS COMING ON AND WILL STAY ON. IF YOU CYCLE THE IGNITION ON AND OFF IT WILL GO OUT, PUSHING THE ESC BUTTON DOESN'T AFFECT THIS.	LOANER VEHICLE	RENTAL	LOANER VEHICLE LOANER VEHICLE
KM8JN12D45U	2/24/05	37453	32.16	GEAR SHIFTER WILL NOT MOVE, FOUND BRAKE LIGHT SWITCH INACTIVE, REPLACED SWITCH	CUSTOMER STATES: THAT AT TIMES GEAR SHIFTER WILL NOT MOVE,	OPEN CIRCUIT	REPLACED BRAKE LIGHT SWITCH
KM8JN12D05U	4/22/05	28465	21.3		CUSTOMER STATES CRUISE CONTROL WON'T DISENGAGE WHEN BRAKES ARE APPLIED, BRAKE LIGHTS DON'T COME ON INTERMITT- ESP LIT ON	RAN DIAG AND DETECTED CODE 1513 BRAKE SWITCH CIRCUIT	REMOVED AND REPLACED CIRCUIT AND CLEARED CODES AND VERIFIED REPAIR
KM8JM12B16U	9/01/05	13387	33.72	ESC OFF LIGHT IS ON IN AM AND WHEN COLD-REC'D CODE C1513- BRAKE LIGHT SWITCH SHORTED- NEC TO REPLACE SWITCH-			
KM8JN12D16U	8/10/05	15723	35.3		CUSTOMER STATES TRIED TO PICK UP CAR LAST NIGHT BUT THE ESC LIGHT WOULD NOT TURN OFF AND THE TRANS IS SHIFTING FUNNY WHEN THE	REPLACE STOP LAMP SWITCH	PERFORM DIAGNOSTIC TESTS, ROAD TEST VEHICLE, REPLACE STOP LAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN72D06U	7/28/05	15328	60.06	CUSTOMER STATES THE ESC LIGHT IS COMING ON INTERMITTENTLY. THE STOP LAMP SWITCH IN INTERMITTENT. PERFORM DIAGNOSTIC TESTS AND FOUND CODE C1513 FOR STOP LAMP CIRCUIT. CHECKED AND FOUND LAMP SWITCH FAULTY; REPLACE.	CUSTOMER STATES THE ESC OFF LIGHT IS COMING ON INTERMITTENTLY	STOP LAMP SWITCH INTERMITTENT	SCAN TEST ADD TIME FOR STO LAMP SWITCH SCAN TEST ADD TIME FOR STO LAMP SWITCH
KM8JN12DX6U	9/26/05	19841	58.42	ESC LIGHT IS ON INTERMITTENTLY--PERFORMED SCAN TEST, REC'D CODE C1513- BRAKE LIGHT SWITCH IS SHORTED OUT--NEC TO REPLACE			
KM8JN12D76U	7/15/05	19320	35.68	ESC LIGHT COMES ON--PERFORMED SCAN TEST, REC'D CODE C1513- BRAKE LIGHT SWITCH SHORTED INTERNALLY-- REPLACED SWITCH			
KM8JN12D56U	8/10/05	18738	62.62	ESC & QUOT;OFF" LIGHT STAYS ON--PERFORMED SCAN TEST, REC'D CODE C1513--OPEN CIRCUIT IN BRAKE LIGHT SWITCH- NEC TO REPLACE SWITCH			
KM8JM12B26U	7/13/05	18319	35.68	ESC LIGHT IS ON--PERFORMED SCAN TEST, REC'D CODE C1513- BRAKE LIGHT SWITCH SHORTED- NEC TO REPLACE SWITCH			
KM8JN72D06U	7/28/05	15328	60.06	CUSTOMER STATES THE ESC LIGHT IS COMING ON INTERMITTENTLY. THE STOP LAMP SWITCH IN INTERMITTENT. PERFORM DIAGNOSTIC TESTS AND FOUND CODE C1513 FOR STOP LAMP CIRCUIT. CHECKED AND FOUND LAMP SWITCH FAULTY; REPLACE.	CUSTOMER STATES THE ESC OFF LIGHT IS COMING ON INTERMITTENTLY	STOP LAMP SWITCH INTERMITTENT	PERFORM DIAGNOSTIC TESTS, FOUND CODE C1513 FOR STOP LAMP CIRCUIT. CHECKED CIRCUIT AND FOUND STOP LAMP SWITCH FAULTY, REPLACE SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN72DX6U	9/27/05	27107	60.06	CUSTOMER STATES THE ESC LIGHT IS COMING ON EVERY TIME THE VEHICLE IS STARTED/DRIVEN. THE LIGHT WILL NOT TURN OFF ANF THE BUTTON HAS NO EFFECT. PERFORM DIAGNOSTIC TESTS AND FOUND CODE C1513 FOR	CUSTOMER STATES THE ESC OFF LIGHT IS COMING ON EVERY TIME YOU DRIVE VEHICLE, WILL NOT TURN OFF AND THE BUTTON HAS NO EFFECT	CODE C1513 STOP LAMP SWITCH	SCAN TEST ADD TIME FOR STO LAMP SWITCH SCAN TEST ADD TIME FOR STO LAMP SWITCH
KM8JN72DX6U	9/27/05	27107	60.06	CUSTOMER STATES THE ESC LIGHT IS COMING ON EVERY TIME THE VEHICLE IS STARTED/DRIVEN. THE LIGHT WILL NOT TURN OFF ANF THE BUTTON HAS NO EFFECT. PERFORM DIAGNOSTIC TESTS AND FOUND CODE C1513 FOR	CUSTOMER STATES THE ESC OFF LIGHT IS COMING ON EVERY TIME YOU DRIVE VEHICLE, WILL NOT TURN OFF AND THE BUTTON HAS NO EFFECT	CODE C1513 STOP LAMP SWITCH	PERFORM DIAGNOSTIC TESTS, FOUND CODE C1513 FOR STOP LAMP CIRCUIT, CHECK AND REPLACE THE STOP LAMP CIRCUIT. SWITCH ASSY-STOP LAMP RE
KM8JM12B26U	7/22/05	17835	60.06	ABS AND ESC LIGHT STAYS ON--PERFORMED SCAN TEST--REC'D CODES-C1205-C1202-C1237- C15132--BRAKE LIGHT SWITCH MALFUNCTION--REPLACED SWITCH			
KM8JN12D85U	7/08/05	33152	24.38	ESP LIGHT IS ON--PERFORMED SCAN TEST, REC'D CODE C1513- BRAKE LIGHT SWITCH-SWITCH AND LIGHTS ALL CHECK GOOD--ERASED CODE-TEST DROVE VEHICLE-NO LIGHT RETURNED			

KM8JN12D95U	6/03/05	8185	35.68	ESP LIGHT IS ON--PERFORMED SCAN TEST, REC'D CODE C1513--BRAKE LAMP SWITCH IS STICKING--REPLACED STOP LAMP SWITCH			
KM8JN12D56U	1/06/06	5683	37.45		LIFTER ASSYM FOR PARTS DEPARTMENT ORDERED OM 07/10/06 81771-2E000 LIFTER ASSY TAIL.....		TECH DIAGNOSED AND REPLACED TAILGATE ASSYM E
KM8JN12D56U	1/06/06	5683	37.45		C/S THAT ECS LIGHT IS ON STEADY AND AND NOW OFF GOES OFF AND ON // CHECK AND		TECH DIAGNOSED AND REPLACED BRAKE LIGHT SWITCH
KM8JN12D56U	1/06/06	5683	37.45		REPLACE PARTS WARRANTY FOR CARS TRANSMITTER		REPLACE PARTS WARRANTY FOR TRANSMITTER
KM8JN12D85U	7/08/05	45241	35.68	ESC AND ABS LIGHT IS ON--PERFORMED SCAN TEST, REC'D CODE C1513--OPEN CIRCUIT INSIDE BRAKE LIGHT SWITCH--REPLACED SWITCH			
KM8JN12DX5U	4/23/05	11670	58.42	ESC LIGHT IS ON--PERFORMED SCAN TEST, REC'D CODE C1513--BRAKE LIGHT SWITCH SHORTED--NEC TO REPLACE SWITCH			
KM8JM12B36U	7/12/05	26455	33.72	ESC LIGHT COMES ON WHILE DRIVING--PERFORMED SCAN TEST, REC'D CODE C0513--BRAKE LIGHT SWITCH SHORTING--NEC TO REPLACE SWITCH			
KM8JM72B76U	10/10/05	25130	37.11		C/S WHEN DRIVING VEHICLE ESC LIGHT COMES ON AND CAN NOT SHUTIT OFF.CHECK AND ADVISE.	TECH HAD FOUND BACK LAMP SWITCH FAILING ON VEHICLE.	REPLACED BRAKE SWITCH ON VEHICLE.
KM8JM72B76U	10/10/05	25130	37.11		C/S HEADLINER HANDLE ON PASSENGER SIDE OF VEHICLE FELL OFF CHECK AND ADVISE.	HANDLE WAS STILL INTACT JUST NEEDED TO BE RESECURED.	RESECURED HANDLE ON VEHICLE.
KM8JN72D85U	6/10/05	11222	37.11		C/S CHECK ESP LIGHT STAYS ON AND WHEN USING BUTTON DOSTN'T SHUT OFF ..	C1513	TECH DIAGNOSED AND REPLACED BRAKE SWITCH
KM8JN12D35U	5/14/05	16176	35.68	FOUND SWITCH SHORTED OUT NECESSARY TO REPLACE PER COMPUTER CHECKER GOT CODE C1513			
KM8JN12D35U	5/14/05	27032	35.54	ESC LIGHT IS STAYING ON--PERFORMED SCAN TEST, REC'D CODE C1513--OPEN CIRCUIT IN BRAKE LIGHT SWITCH--NEC TO REPLACE SWITCH			
KM8JN72D26U	7/27/05	15969	33.72	ESC LIGHT IS ON--PERFORMED SCAN TEST, REC'D CODE C1513, BRAKE LIGHT SWITCH FAILURE--NEC TO REPLACE SWITCH			
KM8JN72D26U	8/12/05	22760	35.49		C/S ESC LIGHT AND ABS LIGHT COMES ON.STAYS ON BUT THEN GOES OFF.NOT ON DASHBOARD RIGHT NOW.	TECH HAD SCANNED VEHICLE AND GOT DTC C1513 BRAKE LAMP SWITCH	TECH REMOVED AND REPLACED BRAKE LIGHT SWITCH ON VEHICLE.
KM8JN72D16U	9/30/05	10557	37.11		C/S CHECK ESC LIGHT COMES ON & OFF WHILE DRIVING //	CODE C1513 BRAKE SWITCH CIRCUIT	TECH DIAGNOSED AND REPLACED BRAKE SWITCH
KM8JN72D16U	7/26/05	22852	36.06		CUSTOMER STATES CHECK ENGINE LIGHT IS ON	TECH VERIFIED CONCERN. FOUND CODES P0130 B1/S1 CIRCUIT. VEHICLE NEEDS O2	TECH REMOVED AND REPLACED O2 SENSOR. TESTED OKAY
KM8JN12D95U	6/03/05	26390	35.54	ESC LIGHT HAS COME ON--WHEN PERFORMED SCAN TEST, REC'D CODE C1513-BRAKE LIGHT SWITCH MALFUNCTION--NEC TO REPLACE BRAKE LIGHT SWITCH			
KM8JM12BX6U	12/06/05	17008	58.1	ESC LIGHT IS ON--PERFORMED SCAN TEST, REC'D CODE C1513--BRAKE LIGHT SWITCH HAS OPEN CIRCUIT--NEC TO REPLACE SWITCH ASSY			
KM8JN12DX6U	11/10/05	22578	33.72	ESC LIGHT STAYS ON--PERFORMED SCAN TEST, REC'D CODE P1513--BRAKE LIGHT SWITCH SHORTED OUT--NEC TO REPLACE SWITCH			
KM8JN12D36U	9/14/05	16879	58.42	E.S.C. LIGHT IS ON--PERFORMED SCAN TEST, REC'D CODE C1511--BRAKE LIGHT SWITCH HAS OPEN CIRCUIT--NEC TO REPLACE SURGE TANK			
KM8JN72D16U	7/26/05	22852	36.06		CUSTOMER STATES ESC LIGHT IS ON.	TECH VERIFIED CONCERN. FOUND CODE C1513 BRAKE SWITCH CIRCUITFOUND FAULTY BRAKE SWITCH.	TECH REMOVED AND REPLACED BRAKES SWITCH. TESTED OKAY.
KM8JN12D36U	7/21/05	10481	36.06	TECH REPLAFCD THE LISTED SWITCH	CUSTOMER STATES CHECK ENGINE LIGHT IS ON NOW IT IS OFF	TECH VERIFY SCAN TETSED CODE P0150 PRESENT. DIAG TIME FOUND THE OXY SENSOR B2S1 NOT RESPONDING	CASUING THE LIGHT TECH REPLACED THE LISTED SENSOR AND CLEARED THE CODE
KM8JN12D36U	7/21/05	10481	36.06	TECH REPLAFCD THE LISTED SWITCH	CUST STATES THE BRAKES LIGHTS ARE INOP	TECH VERIFY CONCERN DIAG TIME FOUND THE BRAKE LIGHT SWITCH AT FAULT (STICKING)	TECH REPLAFCD THE LISTED SWITCH
KM8JN12D35U	11/09/04	20312	33.44	SHIFTER GETS STUCK IN PARK AT TIMES--ALSO BINDS AND WILL NOT GO INTO DRIVE FROM PARK--FOUND BRAKE LIGHT SWITCH STICKING--NEC TO REPLACE SWITCH ASSY			
KM8JN12D66U	11/03/05	27457	33.72	ESC LIGHT IS ON--PERFORMED SCAN TEST, REC'D CODE C1513--BRAKE LAMP SWITCH SHORTED--NEC TO REPLACE BRAKE LIGHT SWITCH ASSY			
KM8JN12D66U	1/18/06	7173	34.04	BRAKE LIGHTS ARE STAYING ON--FOUND BRAKE LIGHT SWITCH SHORTED OUT--NEC TO REPLACE SWITCH			

KM8JN12D66U	8/19/05	19055	35.74		CUSTOMER STATES ESC & ESC OFF LIGHT COMES ON INTERNALLY CHECK & ADVISE	FOUND BRAKE LIGHT SWITCH INTERNAL MALF	REMOVED & REPLACED SWITCH
KM8JN12D66U	8/19/05	19055	35.74		AS OF 11-2-06 PRODUCTION, ALL TUCSON VEHICLES HAVE BEEN EQUIPPED WITH A NEW DESIGN DRIVER AIRBAG COVER MODULE.	REPLACE D/S AIRBAG COVER	SERVICE CAMPAIGN 079 COMPLETE
KM8JN72D46U	7/27/05	36640	36.06		DURING TEST DRIVE AFTER TRANSMISSION R&R NOTICED A LOUD CLUNK NOISE ON AND OFF THE GAS PEDAL	TECH FOUND LEFT AND RIGHT REAR SUBFRAME BUSHINGS RUBBER SEPERATED FROM METAL SLEVE.	TECH REMOVED AND REPLACED SUBFRAME BUSHINGS LEFT AND RIGHT ROAD TESTED TESTED OK!!
KM8JN12D66U	11/03/05	29763	33.72				
KM8JM12B77U	11/15/06	5843	33.72	ESC LIGHT IS ON-FOUND BRAKE LIGHT SWITCH TO HAVE OPEN CIRCUIT-NEC TO REPLACE STOP LIGHT SWITCH			
KM8JN72D75U	5/26/05	18675	34.86	18681 TEST DROVE AND VERIFIED CONCERN. HOOKED UP SCANNER AND RECIEVED CODE C1513 FOR BRAKE LAMP SWITCH MAL. TESTED AND FOUND BRAKE LAMP SWITCH IS INTERMITTENTLY OPEN CURCUIT. REPLACED BRAKE LAMP SWITCH AND RETESTED OK. CLEARED CODE AND TEST DROVE OK.	PCM REPROGRAM 06-01-001		ESP RECALL ESP RECALL 18675 REPROGRAMMED PCM AS PER RECALL
KM8JN72D46U	7/27/05	36640	36.06		CUSTOMER STATES TSC LIGHT IS ON PLS CHECK AND ADVISE	TECH VERIFIED CONCERN FOUND CODE P1513 STORED TECH CHECKED AND ADJUSTMENT OF BRAKE SWITCH OK	TECH NOTICED AT TIME WITH BRAKE SWITCH PEDAL DEPRESSED PLUNGER OF SWITCH DID NOT RELEASE TECH REMOVED AND REPLACED BRAKE SWITCH TESTED NO OPERATING PROPERLY
KM8JN72D05U	4/25/05	2056	36.08		CUST STATES ESP LIGHT IS STAYING ON THE DASH SOLID INSTALL S.O. PARTS	TECH VERIFY CONCERN FOUND BRAKE LIGHT SWITCH FAULTY	TECH REPLACED SWITCH RE-CHECK OPERATION OK
KM8JN72D75U	5/26/05	18675	34.86	18681 TEST DROVE AND VERIFIED CONCERN. HOOKED UP SCANNER AND RECIEVED CODE C1513 FOR BRAKE LAMP SWITCH MAL. TESTED AND FOUND BRAKE LAMP SWITCH IS INTERMITTENTLY OPEN CURCUIT. REPLACED BRAKE LAMP SWITCH AND RETESTED OK. CLEARED CODE AND TEST DROVE OK.	DRIVER SIDE AIR BAG COVER MODULE		RECALL 079 RECALL 079 18675 REPLACED DRIVER'S AIR BAG COVER AS PERRECALL.
KM8JN72D75U	5/26/05	18675	34.86	18681 TEST DROVE AND VERIFIED CONCERN. HOOKED UP SCANNER AND RECIEVED CODE C1513 FOR BRAKE LAMP SWITCH MAL. TESTED AND FOUND BRAKE LAMP SWITCH IS INTERMITTENTLY OPEN CURCUIT. REPLACED BRAKE LAMP SWITCH AND RETESTED OK. CLEARED CODE AND TEST DROVE OK.	CUSTOMER STATES THAT THERE IS A CREEKING TYPE NOISE NOTICED WHEN TURNING THE WHEEL TO THE RIGHT MOSTLY AT SLOW SPEED, MOST NOTICED TURNING TO THE RIGHT SUCH AS PULLING OUT ONTO THE ROAD FROM A DRIVEWAY, NOTICED AT ALL TIMES WHENDRIVING THERE ARE NO WEATHE	TECHNICIAN HI-SCANNED FOUND C1513- BRAKE LAMP SWITCH. TESTEDBRAKE LAMPS, NOT WORKING. REPLACED BRAKE LAMP SWITCH, AND RE	BUSHING-CROSSMEMBER MOUNTING (ALL) RE BUSHING-CROSSMEMBER MOUNTING (ALL) RE 18688 TEST DROVE AND VERIFIED NOISE. TESTEDAND FOUND DRIVER'S SIDE SUB-FRAME BUSHING HASSEPERATED AND IS WORN. REPLACED SUB-FRAMEBUSHING AND RETESTED OK. TEST DROVE OK.
KM8JM12B77U	10/26/06	11413	36.06		CUSTOMER STATES ESC LIGHT COMES ON, AND CAN NOT SHUT OFF. HAPPENS INTERMITTENTLY, AND IS NOT HAPPENING NOW. PLEASE CHECK AND ADVISE.	TECH VERIFIED CONCERN. FOUND CODE P0303 CYLINDER NUMBER THREE IS MISFIRING. PLUG SIRE IS ARCHING AT BOOT.	TESTED BRAKE LAMPS. NOW OPERATING AS DESIGNED.
KM8JN72D26U	7/29/05	18040	36.06		CUSTOMER STATES CHECK ENGINE LIGHT IS ON	TECH VERIFIED CONCERN. FOUND CODE C1513 BRAKE SWITCH CIRCUITVEHICLE HAS NO BRAKE LIGHTS.	TECH REMOVED AND REPALCED WIRES 1, 3 & 5 AND CLEARED CODE. TESTED OKAY.
KM8JN72D26U	7/29/05	18040	36.06		CUSTOMER STATES ESC LIGHT IS ON.		TECH REMOVED AND REPLACED BRAKE SWITCH AND CLEARED CODE. TESTED OKAY.
KM8JN72D75U	5/26/05	18675	34.86	18681 TEST DROVE AND VERIFIED CONCERN. HOOKED UP SCANNER AND RECIEVED CODE C1513 FOR BRAKE LAMP SWITCH MAL. TESTED AND FOUND BRAKE LAMP SWITCH IS INTERMITTENTLY OPEN CURCUIT. REPLACED BRAKE LAMP SWITCH AND RETESTED OK. CLEARED CODE AND TEST DROVE OK.	CUSTOMER STATES THAT THE ESP LIGHT WILL LIGHT UP WHILE DRIVING AND IS NOT RESET UNTIL TURNING OFF WHEN SHUTTING OFF THE VEHICLE AND RESTARTING. EVEN WHEN PRESSING THE BUTTON THE LIGHT STAYS ON AND WILL NOT TURN OFF. PLEASE CHECK AND ADVISE		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 18681 TEST DROVE AND VERIFIED CONCERN. HOOKEDUP SCANNER AND RECIEVED CODE C1513 FOR BRAKELAMP SWITCH MAL. TESTED AND FOUND BRAKE LAMP SWITCH IS INTERMITTENTLY OPEN CURCUIT.REPLACED BRAKE LAMP SWITCH AND RET
KM8JN12D25U	4/13/05	18615	34.54	18618 INSPECTED AND VERIFIED CONCERN. TESTED AND FOUND BRAKE SWITCH IS CAUSING NOISE FROM PEDAL. REMOVED AND TRIED TO LUBE SWITCH BUT STILL MAKES NOISE INTERNALLY. REPLACED BRAKE SWITCH AND RETESTED OK. TEST DROVE OK.	FACTORY RECALL 079	RECALL	RECALL 079 RECALL 079 18615 REPLACED DRIVER'S SIDE AIR BAG AS PERRECALL.
KM8JN72D26U	7/29/05	18040	36.06		AS OF 11-2-06 PRODUCTION, ALL TUCSON VEHICLES HAVE BEEN EQUIPPED WITH A NEW DESIGN DRIVER AIRBAG COVER MODULE.	REPLACE D/S AIRBAG COVER	SERVICE CAMPAIGN 079 COMPLETE
KM8JN12D66U	10/21/05	6830	50.4		CUST STATES ESC LIGHY COMES ON THE DASH AT TIMES	USING FLOW CHART CHECKED FOR CONTINUITY W PEDAL DEPRESS O.K.... NOTICED THAT BRAKE PEDAL PRESS AGAIN THE BRAKE SW	ADJSUT BRAKE SWITCH
KM8JN12D86U	10/04/05	23664	36.06		CUST STATES ESC LIGHT OFF COMES ON DASH AT TIMES INSTALL S.O. PART	TECH VERIFY CONCERN BRAKE LIGHT HAS A OPEN/SHORT CASUING CONCERN	TECH REPLACED THE LISTED SWITCH TEST DRIVE OK

KM8JN12D25U		4/13/05	18615	34.54	18618 INSPECTED AND VERIFIED CONCERN. TESTED AND FOUND BRAKE SWITCH IS CAUSING NOISE FROM PEDAL. REMOVED AND TRIED TO LUBE SWITCH BUT STILL MAKES NOISE INTERNALLY. REPLACED BRAKE SWITCH AND RETESTED OK. TEST DROVE OK.	NOISE/VIBRATION CUSTOMER STATES IN FRT OF VEHICLE DASH AREA PASSENGER SIDE WHERE WINDOW AND DASH COME TOGETHER CAN HEAR A SQUEAKING TYPE NOISE WHEN GOING OVER ANY KIND OF BUMPS AND AT ALL SPEEDS. HOWEVER WHEN VEHICLE IS WET CUSTOMER STATES NOISE CANNOT BE H	SEE STORY	MOULDING-WINDSHIELD GLASS(ALL) MOULDING-WINDSHIELD GLASS(ALL) 18618 TEST DROVE AND VERIFIED NOISE. TESTED AND FOUND WINDSHIELD GUIDES AT BOTTOM ARE CAUSING NOISE. TRIED TO REMOVE AND WINDSHIELD CRACKED. HAD GLASS COMPANY COME OUT AND REPLACE WINDSHIELD
KM8JN72D46U		10/19/05	12643	36.06		CUSTOMER STATES ESC LIGHT SHOWED OFF ON DASHBOARD. HIT BUTTON AND LIGHT WOULD NOT GO OUT. TURNED VEHICLE OFF AND BACK ON AGAIN AND LIGHT WENT OUT. PLEASE CHECK AND ADVISE.	TECH VERIFIED CONCERN. FOUND CODE P1513 BRAKE SWITCH MALFUNCTION, INSPECTED BRAKE SWITCH AND AT TIMES PLUNGER HESTING STUCK IN.	TECH REMOVED AND REPLACED BRAKE SWITCH. TESTED OKAY
KM8JN72D25U		12/30/04	983	31.17	CUST STATES BRAKE LAMPS ARE INOP CONFIRM CONCERN. TRACE PROBLEM TO INOP BRAKE LAMP SWITCH REPLACE SWITCH. NORMAL OPERATION RESTORED			
KM8JN12DX6U		11/24/05	18282	33.92	18282 C/S CHECK ENGINE LIGHTS WAS ON RUNNING OK NOW OFF. ALSO ESC LIGHT CAME ON NOW OFF. CHECKED FOUND CODE C1513 STOP LAMP SWITCH OPEN CHECKED STOP LAMP WIRE HARNESS OK. R & R STOP LAMP SWITCH ASSY AND CLEAR CODE. ROAD TESTED VEHICLE TO VERIFY THE REPAIR.	WCS MAINT. LOF	C	WCS MAINT. LOF WCS MAINT. LOF 18282 PERFORMED WCS MAINT. LOF TK263/3 CP
KM8JN12D25U		4/13/05	18615	34.54	18618 INSPECTED AND VERIFIED CONCERN. TESTED AND FOUND BRAKE SWITCH IS CAUSING NOISE FROM PEDAL. REMOVED AND TRIED TO LUBE SWITCH BUT STILL MAKES NOISE INTERNALLY. REPLACED BRAKE SWITCH AND RETESTED OK. TEST DROVE OK.	NOISE/VIBRATION CUSTOMER STATES BRAKE PEDAL SQUEAKS WHEN APPLIED GENTLY PLEASE CHECK AND ADVISE	SEE STORY	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 18618 INSPECTED AND VERIFIED CONCERN. TESTED AND FOUND BRAKE SWITCH IS CAUSING NOISE FROM PEDAL. REMOVED AND TRIED TO LUBE SWITCH BUT STILL MAKES NOISE INTERNALLY. REPLACED BRAKE SWITCH AND RETESTED
KM8JM72B35U		6/23/05	25200	31.54	25205 INSPECTED AND BRAKE LIGHTS ARE WORKING. HOOKED UP SCANNER AND RECEIVED CODE C1513 FROM ESC SYSTEM FOR BRAKE SWITCH MAL. TESTED AND FOUND BRAKE SWITCH IS INTERMITTENTLY SHORTING INTERNALLY AND HAS HIGH RESISTANCE. REPLACED BRAKE LAMP SWITCH AND RETESTED	RENTAL VEHICLE	.	RENTAL RENTAL 25200
KM8JN12DX6U		11/24/05	18282	33.92	18282 C/S CHECK ENGINE LIGHTS WAS ON RUNNING OK NOW OFF. ALSO ESC LIGHT CAME ON NOW OFF. CHECKED FOUND CODE C1513 STOP LAMP SWITCH OPEN CHECKED STOP LAMP WIRE HARNESS OK. R & R STOP LAMP SWITCH ASSY AND CLEAR CODE. ROAD TESTED VEHICLE TO VERIFY THE REPAIR.	HORN IS NOT WORKING WITH REMOTE.	B	WIRE REPAIR TIME (MINOR)-ADJUSTMENT WIRE REPAIR TIME (MINOR)-ADJUSTMENT 18282 C/S HORN IS NOT WORKING WITH REMOTE. CHECKED FOUND REMOTE IS GOOD. CHECKED FOR POWER TO THE SIREN OK. FOUND BAD CONNECTION TO THE SIREN. PERFORMED MINOR WIRE REPAIR. RETESTED TO VERIFY T
KM8JM72B35U		6/23/05	25200	31.54	25205 INSPECTED AND BRAKE LIGHTS ARE WORKING. HOOKED UP SCANNER AND RECEIVED CODE C1513 FROM ESC SYSTEM FOR BRAKE SWITCH MAL. TESTED AND FOUND BRAKE SWITCH IS INTERMITTENTLY SHORTING INTERNALLY AND HAS HIGH RESISTANCE. REPLACED BRAKE LAMP SWITCH AND RETESTED	CUSTOMER STATES BRAKE LIGHTS INOP SOMETIMES, CHECK AND ADVISE	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 25205 INSPECTED AND BRAKE LIGHTS ARE WORKING. HOOKED UP SCANNER AND RECEIVED CODE C1513 FROM ESC SYSTEM FOR BRAKE SWITCH MAL. TESTED AND FOUND BRAKE SWITCH IS INTERMITTENTLY SHORTING INTERNALLY AND HAS HIGH RE
KM8JM72B35U		6/23/05	25200	31.54	25205 INSPECTED AND BRAKE LIGHTS ARE WORKING. HOOKED UP SCANNER AND RECEIVED CODE C1513 FROM ESC SYSTEM FOR BRAKE SWITCH MAL. TESTED AND FOUND BRAKE SWITCH IS INTERMITTENTLY SHORTING INTERNALLY AND HAS HIGH RESISTANCE. REPLACED BRAKE LAMP SWITCH AND RETESTED	RENTAL VEHICLE	.	SUBLET REPAIRS 25200
KM8JN72D45U		9/21/04	16502	33.82	16502 VERIFIED CUSTOMER CONCERN. PERFORMED PINPOINT TEST FOUND STOP LAMP SWITCH WORN CAUSING SQUEAK SOUND. REPLACED STOP LAMP SWITCH. RETESTED	PCM REPROGRAM 06-01-001	E	ESP RECALL ESP RECALL 16502 PERFORMED PCM REPROGRAM
KM8JN12DX6U		11/24/05	18282	33.92	18282 C/S CHECK ENGINE LIGHTS WAS ON RUNNING OK NOW OFF. ALSO ESC LIGHT CAME ON NOW OFF. CHECKED FOUND CODE C1513 STOP LAMP SWITCH OPEN CHECKED STOP LAMP WIRE HARNESS OK. R & R STOP LAMP SWITCH ASSY AND CLEAR CODE. ROAD TESTED VEHICLE TO VERIFY THE REPAIR.	CHECK ENGINE LIGHTS WAS ON. RUNNING OK. NOW OFF. ALSO ESC LIGHT CAME ON NOW OFF.	A	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 18282 C/S CHECK ENGINE LIGHTS WAS ON RUNNING OK NOW OFF. ALSO ESC LIGHT CAME ON NOW OFF. CHECKED FOUND CODE C1513 STOP LAMP SWITCH OPEN CHECKED STOP LAMP WIRE HARNESS OK. R & R STOP LAMP SWITCH ASSY AND

KM8JN12DX6U	11/24/05	18282	33.92	18282 C/S CHECK ENGINE LIGHTS WAS ON RUNNING OK NOW OFF. ALSO ESC LIGHT CAME ON NOW OFF. CHECKED FOUND CODE C1513 STOP LAMP SWITCH OPEN CHECKED STOP LAMP WIRE HARNESS OK. R & R STOP LAMP SWITCH ASSY AND CLEAR CODE. ROAD TESTED VEHICLE TO VERIFY THE REPAIR.	WCS MAINT. LOF	C	SPECIAL SERVICES MAINT. COST SPECIAL SERVICES MAINT. COST 18282 PERFORMED WCS MAINT. LOF TK263/3 CP
KM8JN12D66U	11/25/05	30647	33.92	30647 C/S TRACTION CONTROL LIGHT SHOW TO BE OFF AND EVEN WITH PUSHING IN LIGHT USED SCAN CK FOR CODE FOUND CODE #C1513 BRAKE LAMP SWITCH OPEN REPLACE BRAKE LAMP SWITCH ERASE CODE AND TEST. AND CK FOR CODE NO MORE CODE FOUND 93810ROO//TK293//3/N94//C15			
KM8JN72D45U	9/21/04	16502	33.82	16502 VERIFIED CUSTOMER CONCERN. PERFORMED PINPOINT TEST FOUND STOP LAMP SWITCH WORN CAUSING SQUEAK SOUND. REPLACED STOP LAMP SWITCH. RETESTED HEARD NO NOISE.	CUSTOMER STATES EVERY TIME BRAKE PEDAL IS PRESSED CAN HEAR IT SQUEEK. PLEASE CHECK AND ADVISE	E	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 16502 VERIFIED CUSTOMER CONCERN. PERFORMED PINPOINT TEST FOUND STOP LAMP SWITCH WORN CAUSING SQUEAK SOUND. REPLACED STOP LAMP SWITCH. RETESTED HEARD NO NOISE.
KM8JM12B25U	4/20/05	20018	33.5	20018 TESTED AND FOUND BRAKE LIGHT SWITCH IS INTERNALLY SHORTED. REPLACED STOP LAMP SWITCH AND RETESTED OK.	CUSTOMER STATES, ESP LIGHT KEEPS GOING ON AND OFF AND INSTALL SOP SWITCH	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20018 TESTED AND FOUND BRAKE LIGHT SWITCH IS INTERNALLY SHORTED. REPLACED STOP LAMP SWITCH AND RETESTED OK.
KM8JN12D85U	5/11/05	19810	33.6	19810 C/S O/D LIGHT COMING ON AT TIMES UNABLE TO LOCATE O/D LIGHT, FOUND IN ESC SYSTEM BRAKE LAMP SWITCH MALFUNCTIONING CODE C1513 REPLACED SWITCH AND CLEARED CODE TK 507 93810R00 .3 HRS//N69 C15 93810RW0 .5 HRS DGS DIAGNOSIS SEE ATTCH SHEET	RECALL 079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	.	RECALL 079 DRIVER AIRBAG COVER RECALL 079 DRIVER AIRBAG COVER 19810 RECALL 079 OPEN PERFORMED RECALL 079-REPLACED DSAB COVER TK 507 61B046R0 2HRS
KM8JN12D85U	5/11/05	19810	33.6	19810 C/S O/D LIGHT COMING ON AT TIMES UNABLE TO LOCATE O/D LIGHT, FOUND IN ESC SYSTEM BRAKE LAMP SWITCH MALFUNCTIONING CODE C1513 REPLACED SWITCH AND CLEARED CODE TK 507 93810R00 .3 HRS//N69 C15 93810RW0 .5 HRS DGS DIAGNOSIS SEE ATTCH SHEET	C/S CENTER CONSOLE LID BROKEN	06	ARM REST ASSY-CONSOLE RE ARM REST ASSY-CONSOLE RE
KM8JN72D25U	12/24/04	16490	104.15	16498 INSPECTED AND VERIFIED CRUISE INOP. TESTED AND HAVE POWER TO MODULE FROM BRAKE SWITCH PINS 1&5. HAD 12 VOLTS CHK VOLTAGE SWITCHES AND THEY ARE WITHIN SPCS TO PIN 11. GETTING SIGNAL WHEN STARTING VEHICLE ON PIN 10. FOUND ACTUATOR NOT APPLYING INTERNA	CUSTOMER STATES THAT THE CRUISE CONTROL IS NOT WORKING, INSTALL SOPMODULE	.	ADDITIONAL TIME ADDITIONAL TIME 16498 INSPECTED AND VERIFIED CRUISE INOP. TESTED AND HAVE POWER TO MODULE FROM BRAKESWITCH PINS 1&5. HAD 12 VOLTS CHK VOLTAGESWITCHES AND THEY ARE WITHIN SPCS TO PIN 11. GETTING SIGNAL WHEN STARTING VEHICLE ON PIN 10. FOUND AC
KM8JN72D25U	12/24/04	16490	104.15	16498 INSPECTED AND VERIFIED CRUISE INOP. TESTED AND HAVE POWER TO MODULE FROM BRAKE SWITCH PINS 1&5. HAD 12 VOLTS CHK VOLTAGE SWITCHES AND THEY ARE WITHIN SPCS TO PIN 11. GETTING SIGNAL WHEN STARTING VEHICLE ON PIN 10. FOUND ACTUATOR NOT APPLYING INTERNA	CUSTOMER STATES THAT THE CRUISE CONTROL IS NOT WORKING, INSTALL SOPMODULE	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16498 INSPECTED AND VERIFIED CRUISE INOP. TESTED AND HAVE POWER TO MODULE FROM BRAKESWITCH PINS 1&5. HAD 12 VOLTS CHK VOLTAGESWITCHES AND THEY ARE WITHIN SPCS TO PIN 11. GETTING SIGNAL WHEN STARTING VEHICLE
KM8JN12D85U	5/11/05	19810	33.6	19810 C/S O/D LIGHT COMING ON AT TIMES UNABLE TO LOCATE O/D LIGHT, FOUND IN ESC SYSTEM BRAKE LAMP SWITCH MALFUNCTIONING CODE C1513 REPLACED SWITCH AND CLEARED CODE TK 507 93810R00 .3 HRS//N69 C15 93810RW0 .5 HRS DGS DIAGNOSIS SEE ATTCH SHEET	C/S MOLDING ON DRIVERS SIDE A PILLAR BOWING OUT	09	TRIM ASSY-FRONT PILLAR (LH) RE TRIM ASSY-FRONT PILLAR (LH) RE 19810 C/S TRIM AT W/S IS BOWING OUT FOUND APILLAR TRIM WARPED REPLACED TRIM PANEL TK 50785823R00 .2 HRS//N58 C09
KM8JN12D85U	5/11/05	19810	33.6	19810 C/S O/D LIGHT COMING ON AT TIMES UNABLE TO LOCATE O/D LIGHT, FOUND IN ESC SYSTEM BRAKE LAMP SWITCH MALFUNCTIONING CODE C1513 REPLACED SWITCH AND CLEARED CODE TK 507 93810R00 .3 HRS//N69 C15 93810RW0 .5 HRS DGS DIAGNOSIS SEE ATTCH SHEET	C/S WATER LEAK COMING FROM THIRD BRAKE LIGHT	09	WEATHER STRIP-TAILGATE GLASS RE WEATHER STRIP-TAILGATE GLASS RE
KM8JN12D46U	8/29/05	17876	34.86	17878 HOOKED UP SCANNER AND RECIEVED CODE C1513 FOR BRAKE LAMP SWITCH. TESTED AND FOUND BRAKE LAMP SWITCH IS OPEN CURCUIT INTERNALLY. REPLACED BRAKE LAMP SWITCH AND RETESTED OK. CLEARED CODE AND TEST DROVE OK.	CUSTOMER STATES THAT THE PASSENGER SIDE FOG LIGHT IS OUT, PLEASE CHECK AND ADVISE	.	BULB-HEAD LAMP (RH) BULB-HEAD LAMP (RH) 17878 INSPECTED AND VERIFIED CONCERN. TESTED AND FOUND FOG LAMP BULB IS INTERNALLY OPEN. REPLACED PASSENGER FOG LAMP BULB AND RETESTED OK.

KM8JN12D85U	5/11/05	19810	33.6	19810 C/S O/D LIGHT COMING ON AT TIMES UNABLE TO LOCATE O/D LIGHT, FOUND IN ESC SYSTEM BRAKE LAMP SWITCH MALFUNCTIONING CODE C1513 REPLACED SWITCH AND CLEARED CODE TK 507 93810R00 .3 HRS//N69 C15 93810RW0 .5 HRS DGS DIAGNOSIS SEE ATTCH SHEET	C/S OD OFF LIGHT COMING ON AT TIMESBY ITSELF	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 19810 C/S O/D LIGHT COMING ON AT TIMES UNABLE TO LOCATE O/D LIGHT, FOUND IN ESC SYSTEM BRAKELAMP SWITCH MALFUNCTIONING CODE C1513REPLACED SWITCH AND CLEARED CODE TK 50793810R00 .3 HRS//N69 C15 93810RW0 .5 HR
KM8JN12D85U	5/11/05	19810	33.6	19810 C/S O/D LIGHT COMING ON AT TIMES UNABLE TO LOCATE O/D LIGHT, FOUND IN ESC SYSTEM BRAKE LAMP SWITCH MALFUNCTIONING CODE C1513 REPLACED SWITCH AND CLEARED CODE TK 507 93810R00 .3 HRS//N69 C15 93810RW0 .5 HRS DGS DIAGNOSIS SEE ATTCH SHEET	C/S OD OFF LIGHT COMING ON AT TIMESBY ITSELF	15	DIAGNOSIS TIME DIAGNOSIS TIME 19810 C/S O/D LIGHT COMING ON AT TIMES UNABLE TO LOCATE O/D LIGHT, FOUND IN ESC SYSTEM BRAKELAMP SWITCH MALFUNCTIONING CODE C1513REPLACED SWITCH AND CLEARED CODE TK 50793810R00 .3 HRS//N69 C15 93810RW0 .5 HRS DGS DIAGNOSIS SEE A
KM8JN12D46U	8/29/05	17876	34.86	17878 HOOKED UP SCANNER AND RECIEVED CODE C1513 FOR BRAKE LAMP SWITCH. TESTED AND FOUND BRAKE LAMP SWITCH IS OPEN CURCUIT INTERNALLY. REPLACED BRAKE LAMP SWITCH AND RETESTED OK. CLEARED CODE AND TEST DROVE OK.	CUSTOMER STATES THAT THE ESC LIGHT HAS COME ON 2 TIMES SOLID WHILE DRIVING AND THEN WILL GO OFF AFTER TURNING OFF THE VEHICLE. THERE AER NO DRIVABILITY CONCERNS PRESENT.	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 17878 HOOKED UP SCANNER AND RECIEVED CODEC1513 FOR BRAKE LAMP SWITCH. TESTED AND FOUNDBRAKE LAMP SWITCH IS OPEN CURCUIT INTERNALLY.REPLACED BRAKE LAMP SWITCH AND RETESTED OK.CLEARED CODE AND TEST DROVE OK.
KM8JN12D36U	8/08/05	18968	34.86	18968 VERFIED ESC/ ABS LIGHT ON SCAN CODES C1813 BRAKE SWITCH OPEN FOUND DEFECTIVE SWITCH REPLACED SWITCH ASSY ADJUSTED TO SPEC'S ROAD TEST OK CODES CELARED	079 AIR BAG CAMPAIGN	RECALL COMPLETWED	RECALL 079 RECALL 079 18968 PERFORMED AIR BAG COVER RECALL
KM8JN12D36U	8/08/05	18968	34.86	18968 VERFIED ESC/ ABS LIGHT ON SCAN CODES C1813 BRAKE SWITCH OPEN FOUND DEFECTIVE SWITCH REPLACED SWITCH ASSY ADJUSTED TO SPEC'S ROAD TEST OK CODES CELARED	GUEST STATES ESC LIGHT IS ON STEADY	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 18968 VERFIED ESC/ ABS LIGHT ON SCAN CODESC1813 BRAKE SWITCH OPEN FOUND DEFECTIVESWITCH REPLACED SWITCH ASSY ADJUSTED TOSPEC'S ROAD TEST OK CODES CELARED
KM8JN12D85U	5/11/05	19810	33.6	19810 C/S O/D LIGHT COMING ON AT TIMES UNABLE TO LOCATE O/D LIGHT, FOUND IN ESC SYSTEM BRAKE LAMP SWITCH MALFUNCTIONING CODE C1513 REPLACED SWITCH AND CLEARED CODE TK 507 93810R00 .3 HRS//N69 C15 93810RW0 .5 HRS DGS DIAGNOSIS SEE ATTCH SHEET	C/S SQUEAK/RATTLE COMING FROM RIGHTWINDSHIELD AREA OVER BUMPS	.	COULD NOT REPRODUCE ANY DEFECTIVE CONDITION AT THIS TIME COULD NOT REPRODUCE ANY DEFECTIVE CONDITION AT THIS TIME 19810 C/S RATTTLING FROM P/S DASH AREA ONLYNOISE HEARD COMING FROM ARTICLES IN GLOVE BOXAREA TK507
KM8JN12D66U	10/21/05	17655	33.6	17655 C/S ESC LIGHT COMES ON AND OFF BY ITSELF TESTED AND FOUND FOR STOP LAMP SWITCH C1513 CONFIRMED CONCERN WITH SCAN TOOL, FOUND SWITCH FAILING AT TIMES. INSTALLED NEW SWITCH AND ADJUSTED. TK 507 .3 HRS//N68 C15	C/S ESC LIGHT COMES ON AND TURNS OFF BY ITSELF FOR NO REASON	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 17655 C/S ESC LIGHT COMES ON AND OFF BYITSELF TESTED AND FOUND FOR STOP LAMP SWITCHC1513 CONFIRMED CONCERN WITH SCAN TOOL, FOUNDSWITCH FAILING AT TIMES. INSTALLED NEW SWITCHAND ADJUSTED. TK 507 .3 HRS//N68
KM8JN72D36U	8/24/05	24397	35.01	RETRIEVED FAULTS C1503 C1237 C1513 DUE TO FAUL TY BRAKE LAMP. REPLACED BRAKE LAMP SWITCH, CLEA RED DTC, & RETESTED OK.....TT TIME FOR DIAGNOSIS	CLIENT STATES ESC LIGHT COMES ON AND OFF	RETRIEVED FAULTS C1503 C1237 C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE RETRIEVED FAULTS C1503 C1237 C1513 DUE TOFAUL TY BRAKE LAMP. REPLACED BRAKE LAMP SWITCH, CLEA RED DTC, & RETESTED OK
KM8JN72D36U	8/24/05	24397	35.01	RETRIEVED FAULTS C1503 C1237 C1513 DUE TO FAUL TY BRAKE LAMP. REPLACED BRAKE LAMP SWITCH, CLEA RED DTC, & RETESTED OK.....TT TIME FOR DIAGNOSIS	CLIENT STATES ESC LIGHT COMES ON AND OFF	RETRIEVED FAULTS C1503 C1237 C1513	SCAN TOOL TESTING SCAN TOOL TESTING RETRIEVED FAULTS C1503 C1237 C1513 DUE TOFAUL TY BRAKE LAMP. REPLACED BRAKE LAMP SWITCH, CLEA RED DTC, & RETESTED OK.
KM8JN12D36U	12/27/05	14114	33.92	14114 C/S ESC LIGHT COMES ON CHECKED FOUND CODE C1513 BRAKE LAMP SWITCH MAL CHECKED CONNECTOR ON BRAKE SWITCH OKAY.FOUND SWITCH FAULTY CAUSED ESC LIGHT TO COMES ON. R & R BRAKE LAMP SWITCH ASSY AND CLEAR CODE ROAD TESTED VEHICLE TO VERIFY THE			
KM8JN72D56U	10/10/05	11009	25.83	11009 C/S ECS LIGHT ON AND OFF CHECKED FOUND CODE C1513 BRAKE LAMP SWITCH SHORTED.R & R STOP LAMP SWITCH ASSY AND CLEAR CODE.ROAD TESTED VEHICLE TO VERIFY THE REPAIR FINDING NO DTC AT THIS TIME AND ECS LIGHT NOT COMING ON AND OFF. 32001A00 //2 //N69 C15 T	C/S ECS LIG COMES ON AND OFF.	C15	BRAKE PEDAL BRAKE PEDAL 11009 C/S ECS LIGHT ON AND OFF CHECKED FOUNDCODE C1513 BRAKE LAMP SWITCH SHORTED.R & R STOP LAMP SWITCH ASSY AND CLEAR CODE.ROADTESTED VEHICLE TO VERIFY THE REPAIR FINDINGNO DTC AT THIS TIME AND ECS LIGHT NOT COMING ON AND OFF. 32001
KM8JN12D75U	6/09/05	23070	62	EDP LIT ON DASH,INTERNAL FAULT BRAKE LIGHT SWITCH,REPLACE			
KM8JN72D16U	10/15/05	27296	32.29				
KM8JN72D36U	7/15/05	18500	32.61				

KM8JM72B96U	10/05/05	27678	32.61				
KM8JM12B66U	1/12/06	19448	33.6	19448 C/S ESC LIGHT ON WHILE DRIVING C/D FOUND CODE C1513 STOP LAMP SWITCH MAL CHECKED STOP LAMP WIRE HARNESS OK.FOUND STOP LAMP SWITCH FAULTY.REPLACED STOP LAMP SWITCH AND CLEAR.ROAD TESTED VEHICLE AND RECHECKED FOUND NO DTC AT THIS TIME 93810R00//N94 C1	SOP ESC LIGHT ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 19448
KM8JM12B56U	7/21/05	27851	33.92	27851 C/S BRAKE LIGHTS STAY ON ALL THE TIME CHECKED AND FOUND CODE C1513 BRAKE LAMP SWITCH CHECKED AND FOUND BRAKE LAMP SWITCH TO BE STICKING VAUSING THE BRAKE LIGHTS TO STAY ON ALL THE TIME, REPLACED BRAKE LAMP SWITCH AND ERASED CODE, TESTED VEHICLE TO V	079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	.	RECALL 079 DRIVER AIRBAG COVER RECALL 079 DRIVER AIRBAG COVER MOD REPLPERFORMED 079 RECALL DAB COVER REPALCEMENTTK469///61B046R0//1.2HRS
KM8JM12BX6U	7/09/05	16321	32.61				
KM8JN12D25U	5/03/05	2576	35.62		CHECK FOR ANY OPEN RECALLS ON THIS VEHICLE	CPN	PARKING BRAKE LEVER ASSEMBLY REPLACEMENT (05-01-006) PARKING BRAKE LEVER ASSEMBLY REPLACEMENT (05-01-006)
KM8JN12D25U	5/03/05	2576	35.62		CUST STATES SOMETIME BRAKE LIGHTS DO NOT WORK	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D66U	7/29/05	17612	37.99	17614 NEEDS BRAKE SWITCH REPLACED BRAKE SWITCH	CUSTOMER STATES INSTALL ORDERED BRAKE SWITCH AND PRESSURE SENSOR FOUND CODES C1513	N69	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY 17614 NEEDS BRAKE SWITCH REPLACED BRAKESWITCH
KM8JM12B56U	7/21/05	27851	33.92	27851 C/S BRAKE LIGHTS STAY ON ALL THE TIME CHECKED AND FOUND CODE C1513 BRAKE LAMP SWITCH CHECKED AND FOUND BRAKE LAMP SWITCH TO BE STICKING VAUSING THE BRAKE LIGHTS TO STAY ON ALL THE TIME, REPLACED BRAKE LAMP SWITCH AND ERASED CODE, TESTED VEHICLE TO V	C/S BRAKE LIGHTS STAY ON ALL THE TIME- SOP	94	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 27851 C/S BRAKE LIGHTS STAY ON ALL THE TIMECHECKED AND FOUND CODE C1513 BRAKE LAMP SWITCH CHECKED AND FOUND BRAKE LAMP SWITCH TOBE STICKING VAUSING THE BRAKE LIGHTS TO STAYON ALL THE TIME, REPLACED BRAKE LA
KM8JN12D56U	1/06/06	12156	33.6	12156 C/S SOP ESC LIGHT ON REPLACED BRAKE LIGHT SWITCH FROM PREVIOUS INSPECTION,ERASED CODE C1513 BRAKE SWITCH ERROR AND TESTED TO VERIFY REPAIR WITH NO LIGHT RETURNING AT THIS TIME TK469///93810R00/3 N94-C15	SOP ESC LIGHT ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 12156 C/S SOP ESC LIGHT ON REPLACED BRAKELIGHT SWITCH FROM PREVIOUS INSPECTION,ERASEDCODE C1513 BRAKE SWITCH ERROR AND TESTED TOVERIFY REPAIR WITH NO LIGHT RETURNING AT THISTIME TK469///93810R00/3 N94-C15
KM8JN72D66U	7/29/05	17612	37.99	17614 NEEDS BRAKE SWITCH REPLACED BRAKE SWITCH	CUSTOMERS STATES TRIP COMPUTER IS OFF READ 57 MILES WERE LEFT BEFORE FUEL TANK IS EMPTY VEHICLE WAS DRIVEN 5 MILES NOW READS ZERO INSTALL ORDERED FUEL FLOATS	N63	FUEL SENDER ASSY (BOTH SIDES) FUEL SENDER ASSY (BOTH SIDES) 17614 NEEDS SENDERS/FLOATS REPLACED BOTHFLOATS/SENDERS
KM8JN12D46U	7/19/05	24029	38.31	CHECK BRAKE LIGHT SWITCH SHORTED REPLACED SWITCH VERIFIED PROPER OPERATION	CUSTOMER STATES CHECK ESC LIGHT COMES ON AT TIMES	N94	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 24400 N94 CHECK BRAKE LIGHT SWITCH SHORTEDREPLACE SWITCH VERIFIED PROPER OPERATION
KM8JN12D96U	1/05/06	20083	33.6	20106 C/S CRUIE CONTROL WILL NOT SET, CK.D OVER FOR CRUISE NOT SETTING, FOUND CRUISE SETTING AND THEN AFTER DRIVING FOUND WOULD JUST DROP OUT AFTER SOME TIME, INSPECTED WITH SCAN TOOL IN ABS SYSTEM CODE C1513 BRAKE LAMP SWITCH MALFUNCTION , TESTED BRAKE L	C/S LEFT TURN SIGNAL DOES NOT CANCEL	B	SEE TECH STORY FOR EXPLANATION SEE TECH STORY FOR EXPLANATION 20110 C/S LEFT TURN SIGNAL DOES NOT CANCEL.CK.D FOUND LEFT TURN SIGNAL NOT WANTING TOCANCEL AT TIMES LEFT SIGNAL NOT CANCELING.FOUND TURN SIGNAL SWITCH DRY AT CANCEL, LUBEDTURN SIGNAL CANCEL SW
KM8JN12D96U	1/05/06	20083	33.6	20106 C/S CRUIE CONTROL WILL NOT SET, CK.D OVER FOR CRUISE NOT SETTING, FOUND CRUISE SETTING AND THEN AFTER DRIVING FOUND WOULD JUST DROP OUT AFTER SOME TIME, INSPECTED WITH SCAN TOOL IN ABS SYSTEM CODE C1513 BRAKE LAMP SWITCH MALFUNCTION , TESTED BRAKE L	C/S CRUISE CONTROL WILL NOT SET	A	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20106 C/S CRUIE CONTROL WILL NOT SET, CK.DOVER FOR CRUISE NOT SETTING, FOUND CRUISESETTING AND THEN AFTER DRIVING FOUND WOULDJUST DROP OUT AFTER SOME TIME, INSPECTED WITHSCAN TOOL IN ABS SYSTEM
KM8JN72D76U	8/10/05	18879	38.31		CUSTOMER STATES ECT LIGHT IS ON	N69	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D56U	10/12/05	11477	37.99	11477 SCAN ESC SYS. CODE C1513 REPLACE BRAKE LT. SWITCH	CUSTOMER STATES ESC OFF LIGHT COMESON WHEN DRIVING	N69	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 11477 SCAN ESC SYS. CODE C1513 REPLACE BRAKELT.
KM8JN12D85U	4/30/05	49268	33.65	CODE C1513, INTERMITTENTLY INTERNAL OPEN CIRCUIT, REPLACE BRAKE LIGHT SWITCH			
KM8JN12D46U	9/23/05	39092	35.16		CUSTOMER STATES ESC LIGHT IS ON	N94	FOUND SHORT IN SWTICH R/R SWITCH STOP LAMP SWITCH ASSY RE
KM8JM12B45U	7/05/05	31871	35.16		CUSTOMER STATES TRANSMISSION WILL NOT SHIFT GEARS	N27	FOUND TRANSMISSION BINDING, REPLACE TRANSMISSION M/T ASSY - 2 WHEEL DRIVE(BETA ENGINE)
KM8JM12B45U	7/05/05	31871	35.16		CUSTOMER STATES AIR BAG LIGHT ON	N69	FOUND SHORT SHORT AT AIR BAG MODULE, REPAIRED SHORT DRIVER AIR BAG MODULE ASSY

KM8JN12D06U	7/29/05	10191	57.64	DEBIT AND RESUBMIT. ESC LIGHT IS ON. SCAN TEST, CODE C1513. BRAKE SWITCH CIRCUIT. FOUND SWITCH STICKING IN OFF POSITION. REPLACE BRAKE SWITCH. RETEST. STRAIGHT TIME FOR SCAN TEST, NO LABOR OP			
KM8JN12D56U	7/19/05	20218	62.44	TT IS FOR SCAN CHECK ESC LIGHT ON, CODE C1513 NO OP	CUSTOMER STATES ESC LIGHT GOES ON AND OFF AT TIMES	FOUND CODE C1513 BRAKE LAMP SWITCH FAULT	REPLACED BRAKE LAMP SWITCH
KM8JN12D35U	4/27/05	13442	52.55	TT TIME IS FOR SCAN CHECK AND NO OP CODE EXISTS	CUSTOMER STATES THE ESP LIGHT OFF WILL COME ON AND GO OFF	P1513 ECU	REPLACE LATE LAMP SWITCH
KM8JM12B45U	7/05/05	31871	35.16		CUSTOMER STATES AIR BAG LIGHT ON	N69	DRIVER AIR BAG MODULE ASSY ADD SCAN TOOL OPER. DRIVER AIR BAG MODULE ASSY ADD SCAN TOOL OPER.
KM8JM12B45U	7/05/05	31871	35.16		CUSTOMER STATES ESC LIGHT IS ON	N94	FOUND SHORT IN STOP LAMP ASSY. REPLACED STOP LAMP SWITCH STOP LAMP SWITCH ASSY RE
KM8JN72D85U	6/09/05	25397	35.16		C/S ESC LIGHT COMES ON WHILE DRIVING	INSPECTED AND FOUND BRAKE LIGHT SWITCH IS MALFUNCTIONING	REPLACED BRAKE LIGHT SWITCH
KM8JN12D96U	8/17/05	12565	62.44	TT TIME IS FOR SCAN CHECK ESC LIGHT ON, NOO COP CODE	CUSTOMER STATES THE ESC LIGHT IS ON PLEASE CHECK AND ADVISE	P1513 FAULTY BRAKE SWITCH	REPLACED BRAKE SWITCH AND CLEARED CODE ALL OK AT THIS TIME
KM8JM12B86U	7/22/05	24116	36.21	REPLACED SWITCH	CUSTOMER STATES THE BRAKE LIGHTS ARE OUT AND THE ESC LIGHT IS ON-PLEASE CHECK	FAULTY BRAKE LAMP SWITCH	REPLACED SWITCH
KM8JN12D56U	12/16/05	12984	37.85		CUSTOMER STATES THE ESC LIGHT WILL COME ON AND TURN OFF BY ITSELF-PLEASE CHECK	C1503 TCS-ESP SWITCH C1513 BRAKE LAMP SWITCH - BOTH ARE FAULTY	REPLACE BRAKE SWITCH AND ALL WORKING AS DESIGNED
KM8JN12D36U	7/18/05	25314	35.89		CUSTOMER STATES THE ESC LIGHT IS COMING ON AND STAYING ON PLEASE CHECK	FAULTY BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN72D85U	6/09/05	25397	35.16		RECALL	RECALL	PERFORMED RECALL 079
KM8JM12B17U	9/13/06	10366	34.84		CUSTOMER STATES ESP LIGHT COMES ON & OFF ADVISE.	SCAN TEST CODE C1513 BAD BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH. OP 93810R00.3 N94 C15
KM8JN12D16U	3/31/06	23963	35.16		ESC LIGHT IS ON ADVISE	FOUND CODE C1513 BRAKE LIGHT SWITCH MALFUNCTION	REPLACED BRAKE LIGHT SWITCH OP 93810R00.3 N94 C15
KM8JN12D16U	3/31/06	23963	35.16		PERFORM AIR BAG RECALL	RECALL 079	PERFORMED AIRBAG RECALL OP 61B046R0.2
KM8JN12DX5U	10/13/04	12193	33.81		CUSTOMER STATES CRUISE CONTROL WON'T SET PLEASE CHECK AND ADVISE	CONTACTS IN BRAKE SWITCH BURNT	REPLACE AND ADJUST SWITCH
KM8JN12DX6U	7/26/05	9941	62.44	TT TIME IS FOR SCAN CHECK ESC LIGHT ON, NO OP CODDE	CUSTOMER STATES ESC LIGHT ON. PLEASE CHECK.	BAD SWITCH	REPLACED
KM8JN12D26U	1/20/06	14432	62.44	TT IS FOR SCANNING ESC LIGHT NO OP CODE	CUSTOMER STATES THE "ESC OFF" LIGHT COMES ON AFTER DRIVING FOR A SHORT WHILE	FAULTY STOP LAMP SWITCH	REPLACED SWITCH AND CLEARED CODES
KM8JM12B06U	7/16/05	20294	34.84		C/S THE BRAKE LIGHTS DON'T WORK	FOUND BRAKE SWITCH IS MALFUNCTIONING	REPLACED BRAKE SWITCH OP 93810R00.3 N94 C15
KM8JN12D56U	7/16/05	36397	35.16	REPLACED BRAKE LIGHT SWITCH OP 93810R00.3 N94 C15	CHECK ENGINE LIGHT ON.	CODE P0150	REPLACED BRAKE LIGHT SWITCH OP 93810R00.3 N94 C15
KM8JM12B96U	8/31/05	22787	34.84		CUSTOMER STATES THE ESC LIGHT COMES ON	INSPECTED AND FOUND C1513 CODE FOR BRAKE LIGHT SWITCH MALFUNCTION	REPLACED BRAKE LIGHT SWITCH ASSEMBLY OP 93810R00.3 N94 C15
KM8JN12D26U	1/20/06	14432	62.44	TT IS FOR SCANNING ESC LIGHT NO OP CODE	079 CAMPAIGN OPEN ON THIS VEHICLE PARTS IN STOCK		COMPLETED
KM8JM12BX5U	4/28/05	22570	37.85		CUSTOMER STATES THAT THE ESP LIGHT COMES ON INTERM AND WILL STAY ON UNTIL THE CAR HAS BEEN TURNED OFF.	C1206 C1207 C1315 INTERNAL FAILURE OF THE BRAKE LIGHT SWITCH AND DIRTY GROUND	AT G08 COMPLETED THE REPLACEMENT OF THE BLS AND CLEAN GROUND
KM8JM12BX5U	4/28/05	22570	37.85		CUSTOMER STATES THAT THE HOOD LATCH HANDLE IS INOP. PLEASE CHECK AND ADVISE	THE CABLE HAS COME LOOSE	REATTACH THE CABLE FOR THE HOOD LATCH HANDLE
KM8JM12B96U	8/31/05	22787	34.84		CUSTOMER REQUEST TO PERFORM Z9 AIRBAG RECALL	RECALL	PERFORMED RECALL OP 61B046R0.2
KM8JN72D66U	9/28/05	14259	35.16		C/S ESC LIGHT ON	BRAKE LIGHT SWITCH HAS OPEN CIRCUIT	REPLACED BRAKE LIGHT SWITCH OP 93810R00.3 N94 C15
KM8JM12B06U	7/15/05	15215	36.04		CUSTOMER STATES-VEHICLES ESC LIGHT COMES ON INTERMITTENTLY HAS BEEN DOING THIS FOR OVER A MONTH	C1513-BRAKE LAMP SWITCH CIRCUIT	TEST AND REPLACE BRAKE LAMP SWITCH
KM8JN12D25U	4/30/05	23564	62.44	NO OP CODE FOR SCAN TEST BRAKE LIGHT ON	CUSTOMER STATES ENGINE WONT START HAD TO BE JUMPED TODAY	WILL NOT HOLD CHARGE	REPLACED BATTERY WARRANTY CODE# 6AS4C-0QWK0
KM8JN12D25U	4/30/05	23564	62.44	NO OP CODE FOR SCAN TEST BRAKE LIGHT ON	CUSTOMER STATES BRAKE LIGHT ON ABS LIGHT	FAULTY STOP LAMP SWITCH SCAN TOOL OPERATION	REPLACED STOP LAMP SWITCH
KM8JN12D76U	8/08/05	22840	62.76	TT TIME IS FOR SCAN CHECK ESC LIGHT ON , B1513, NO OP CODE	CUSTOMER STATES ESC LITE STAYS ON	CODE 1513 FAULTY BRAKE LITE SWITCH	REPLACED SWITCH
KM8JM12B06U	7/15/05	15215	36.04		CUSTOMER STATES--CHECK ENGINE LIGHT IS ON, CAME ON ABOUT 90 MILES AGO	P0455-EVAP LARGE LEAK	TIGHTEN GAS CAP
KM8JN72D16U	10/17/05	14812	35.31	14818 93810R00 N94 C15 030 ESC LIGHT ON REPLACED THE BRAKE LAMP SWITCH AND MADE THE LIGHT GO OUT	CUSTOMER STATES WHEN BRAKING SHUTTER TYPE NOISE	0	BRAKE DISC MACHINING (BOTH SIDES)-ADJUSTMENT BRAKE DISC MACHINING (BOTH SIDES)-ADJUSTMENT 14818 5172A00 58415A00 N21 C15 220
KM8JN72D16U	10/17/05	14812	35.31	14818 93810R00 N94 C15 030 ESC LIGHT ON REPLACED THE BRAKE LAMP SWITCH AND MADE THE LIGHT GO OUT	CUSTOMER STATES WHEN BRAKING SHUTTER TYPE NOISE	0	REAR BRAKE DISC MACHINING(BOTH SIDES)-ADJUSTMENT REAR BRAKE DISC MACHINING(BOTH SIDES)-ADJUSTMENT 14818 5172A00 58415A00 N21 C15 220
KM8JN12D76U	8/08/05	22840	62.76	TT TIME IS FOR SCAN CHECK ESC LIGHT ON , B1513, NO OP CODE	CUSTOMER STATES WIPER FLUID NOT PUMPING OUT	FAULTY PUMP	REPLACED PUMP
KM8JN12D76U	8/08/05	22840	62.76	TT TIME IS FOR SCAN CHECK ESC LIGHT ON , B1513, NO OP CODE	079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	RECALL COMPLETED	RECALL COMPLETED
KM8JM12B06U	7/12/05	2102	35.63		CUSTOMER STATES BRAKE LIGHTS DO NOT WORK	FAULTY BRAKE LIGHT SWITCH	REPLACED SWITCH

KM8JN72D16U	10/17/05	14812	35.31	14818 93810R00 N94 C15 030 ESC LIGHT ON REPLACED THE BRAKE LAMP SWITCH AND MADE THE LIGHT GO OUT	CUSTOMER STATES ESC LIGHT COMES ON AND WENT OFF AFTER LONG RIDE	0	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 14818 93810R00 N94 C15 030 ESC LIGHT ON REPLACED THE BRAKE LAMP SWITCH AND MADE THE LIGHT GO OUT
KM8JM12B75U	12/02/04	32235	33.6	32235 93810R00 N94 C15 003 C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACE BRAKE LIGHT SWITCH	ESP LIGHT ON	TEST SYSTEM CODE C1513 INSTALL NEW BRAKE LIGHT SWITCH RETEST O/K	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 32235 93810R00 N94 C15 003 C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACE BRAKE LIGHT SWITCH
KM8JN12D37U	11/01/06	395	62.44	TT TIME IS FOR SCAN CHECKING BRAKE LIGHT ON, C1513	CUSTOMER STATES THE ESC LIGHT COMES AND GOES PLEASE CHECK	C1513 FAULTY STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH
KM8JN12D36U	8/31/05	10396	35.3				
KM8JN12D95U	6/03/05	12746	34.54				
KM8JN12DX6U	9/14/05	30643	34.86				
KM8JN72D26U	8/31/05	53125	35.31	52000 32002A00 N69 C15 020 HOOK UP SCAN TOOL CODE U0101 CAN-TIME OUT TCU, REPLACED STOP LAMP SWITCH CLEARED CODE.	ESC OFF LIGHT COMES ON AT TIMES	TEST SYSTEM SCAN TEST INSTALL NEW STOP LIGHT SWITCH RETEST O/K	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP 52000 32002A00 N69 C15 020 HOOK UP SCAN TOOL CODE: U0101 CAN-TIME OUT TCU, REPLACED STOP LAMP SWITCH CLEARED
KM8JN72D76U	10/17/05	33289	60.96	33289 C1513 BRAKE LAMP SWITCH 93810R00 .3 93810RP0 .3 N68 C05 60 USED HIGH SCAN & PULLED CODE C1513 BRAKE LAMP SWITCH. CHECKED FOR LOOSE OR BROKEN WIRES NONE WERE FOUND. REPLACED SWITCH AND CLEARED CODE.	CUST STATES THE ESC OFF LIGHT IS ON, INTERM	C1513 BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 33289 C1513 BRAKE LAMP SWITCH 93810R00 .393810RP0 .3 N68 C05 60 USED HIGH SCAN & PULLED CODE C1513 BRAKE LAMP SWITCH. CHECKED FOR LOOSE OR BROKEN WIRES NONE WERE FOUND. REPLACED SWITCH AND CLEARED CODE.
KM8JN12D46U	8/09/05	5729	34.54				
KM8JN12D76U	7/29/05	10411	34.86				
KM8JN12D96U	7/29/05	17602	34.54				
KM8JN12D16U	12/28/05	15056	34.86				
KM8JN72D76U	10/17/05	33289	60.96	33289 C1513 BRAKE LAMP SWITCH 93810R00 .3 93810RP0 .3 N68 C05 60 USED HIGH SCAN & PULLED CODE C1513 BRAKE LAMP SWITCH. CHECKED FOR LOOSE OR BROKEN WIRES NONE WERE FOUND. REPLACED SWITCH AND CLEARED CODE.	CUST STATES THE ESC OFF LIGHT IS ON, INTERM	C1513 BRAKE LAMP SWITCH	SCAN SCAN 33289 C1513 BRAKE LAMP SWITCH 93810R00 .393810RP0 .3 N68 C05 60 USED HIGH SCAN & PULLED CODE C1513 BRAKE LAMP SWITCH. CHECKED FOR LOOSE OR BROKEN WIRES NONE WERE FOUND. REPLACED SWITCH AND CLEARED CODE.
KM8JM72B46U	11/24/05	9435	34.99	9400 93810R00 N94 C15 .3 DIAG CODE C1513, REPLACED BRAKE LAMP SWITCH	ESC LIGHT ON AT TIMES	TEST SYSTEM CODE C1513 INSTALL NEW STOP LAMP SWITCH RETEST O/K	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 9400 93810R00 N94 C15 .3 DIAG CODE C1513, REPLACED BRAKE LAMP SWITCH
KM8JN72D25U	5/30/05	12065	34.4	CONF CUST COMP. TECH SCAN FOR CODE GOT C1513 BRAKE LAMP SWITCH TECH CHECK AND REPLACED SWITCH AND CLEAR CODE OK AT THIS TRIME	CUSTOMER STATES CHECK NOISE RATTLE WHEN TURNING	0	BUSHING-CROSSMEMBER MOUNTING (ALL 4WD) RE BUSHING-CROSSMEMBER MOUNTING (ALL 4WD) RE CONF CUST COMP. TECH CHECK AND REPAIR CROSSMEMBER BUSHINGS OK AT THIS TIME
KM8JN12D56U	7/28/05	33842	34.54				
KM8JN12D46U	8/30/05	6057	35.3				
KM8JN12D66U	8/08/05	9160	34.86				
KM8JN12D66U	12/29/05	3183	35.3				
KM8JM12B15U	12/09/04	6751	35.62				
KM8JN72D25U	5/30/05	12065	34.4	CONF CUST COMP. TECH SCAN FOR CODE GOT C1513 BRAKE LAMP SWITCH TECH CHECK AND REPLACED SWITCH AND CLEAR CODE OK AT THIS TRIME	CUSTOMER STATES CHECK ESC LIGHT COMES ON	0	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE CONF CUST COMP. TECH SCAN FOR CODE GOT C1513 BRAKE LAMP SWITCH TECH CHECK AND REPLACED SWITCH AND CLEAR CODE OK AT THIS TRIME
KM8JN72D86U	8/10/05	20102	35.31	20115 C1513 BRAKE SWITCH MAL 93810R00 .3 30 CONF CUST COMP TECH SCAN FOR CODE GOT C1513 BRAKE LAMP SWITCH TECH CHECK AND REPLACED DEFECTIVE BRAKE LAMP SWITCH CLEAR CODE AND TEST DRIVE NO LIGHTS ON AT THIS TIME	CUSTOMER STATES VEH HAS STALLED OUT ONCE AGAIN	P1726 TPS NO SIGNAL	IDLE SPEED ACTUATOR ASSY RE IDLE SPEED ACTUATOR ASSY RE 20115 P1726 TPS NO SIGNAL 35102RPO .335150RPO .3 60 CONF CUST COMP TECH SCAN FOR CODE GOT MULTIPLE CODES P1765 P1767 P1726 TPSENSOR TECH CHECK AND REPLACED DEFECTIVE TPSENSOR ADJUSTED CRUISE CONTROL
KM8JN72D85U	6/10/05	8648	35.3				
KM8JM12B96U	9/09/05	23258	35.3				
KM8JN12D96U	11/10/05	1749	35.3				
KM8JN12D76U	9/14/05	16940	34.86				
KM8JN72D86U	8/10/05	20102	35.31	20115 C1513 BRAKE SWITCH MAL 93810R00 .3 30 CONF CUST COMP TECH SCAN FOR CODE GOT C1513 BRAKE LAMP SWITCH TECH CHECK AND REPLACED DEFECTIVE BRAKE LAMP SWITCH CLEAR CODE AND TEST DRIVE NO LIGHTS ON AT THIS TIME	CUSTOMER STATES VEH HAS STALLED OUT ONCE AGAIN	P1726 TPS NO SIGNAL	IDLE SPEED ACTUATOR ASSY ADD SCAN TOOL OPERATION IDLE SPEED ACTUATOR ASSY ADD SCAN TOOL OPERATION 20115 P1726 TPS NO SIGNAL 35102RPO .335150RPO .3 60 CONF CUST COMP TECH SCAN FOR CODE GOT MULTIPLE CODES P1765 P1767 P1726 TPSENSOR TECH CHECK AND REPLACED
KM8JN72D86U	8/10/05	20102	35.31	20115 C1513 BRAKE SWITCH MAL 93810R00 .3 30 CONF CUST COMP TECH SCAN FOR CODE GOT C1513 BRAKE LAMP SWITCH TECH CHECK AND REPLACED DEFECTIVE BRAKE LAMP SWITCH CLEAR CODE AND TEST DRIVE NO LIGHTS ON AT THIS TIME	CUSTOMER STATES CHECK ESC LIGHT COME ON AND WAS ON UNTIL HAD SHUT OFF VEH AND RESTARTED THEN DID GO OUT BUT DID COME BACK ON	C1513 BRAKE SWITCH MAL	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20115 C1513 BRAKE SWITCH MAL 93810R00 .3 30 CONF CUST COMP TECH SCAN FOR CODE GOT C1513 BRAKE LAMP SWITCH TECH CHECK AND REPLACED DEFECTIVE BRAKE LAMP SWITCH CLEAR CODE AND TEST DRIVE NO LIGHTS ON

KM8JN12D66U	8/18/05	12251	34.86				
KM8JN12B56U	7/14/05	13902	34.54				
KM8JN12D86U	9/26/05	10427	34.86				
KM8JN12B47U	10/24/06	711	34.86				
KM8JN72D06U	9/28/05	15781	34.99	15781 DTC C1513 93810ROO 30 REPLACE DEFECTIVE BRAKE LAMP SWITCH	CUST STATES THE ELECT. STAB.OFF LIGHT CAME ON WHILE DRIVEING. WENT OFF AFTER RESTART. HAS NOT HAPPENEDLATELY..	DTC C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 15781 DTC C1513 93810ROO 30 REPLACE DEFECTIVEBRAKE LAMP SWITCH
KM8JN72D86U	11/11/05	22520	35.31	22520 BRAKE LAMPS INOP 93810ROO N94 C15 30 CONF CUST COMPL. BRAKE LAMPS INOP. BULBS OKAY AND FUSES OKAY. REMOVED BRAKE LAMP SWITCH AND FOUND TO BE DEFECTIVE. REPLACED BRAKE LAMP SWITCH. BRAKE LAMPS OP. REPAIRS COMPLETED	CUST STATES THE BRAKE LIGHTS ARE INOP..	BRAKE LAMPS INOP	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 22520 BRAKE LAMPS INOP 93810ROO N94 C15 30CONF CUST COMPL. BRAKE LAMPS INOP. BULBS OKAYAND FUSES OKAY. REMOVED BRAKE LAMP SWITCH ANDFOUND TO BE DEFECTIVE. REPLACED BRAKE LAMPSWITCH. BRAKE LAMPS OP. REPAIRS
KM8JM12B86U	1/05/06	24243	34.86				
KM8JN12D75U	6/13/05	29721	34.54				
KM8JM12B76U	7/14/05	11507	35.3				
KM8JM12B87U	10/23/06	3814	34.86				
KM8JN72DX5U	5/31/05	53569	35.31	53569 93810R00 N94 C15 030 TOOK VEHICLE FOR A RIDE COULD NOT DUPLICATE THE ISSUE. HOOKED IT UP TO THE SCAN TOOL AND FOUND CODES P1765-P1767-P1726-P1764 AND C1513-C1612-C1611. COULD NOT FIND TSB'S FOUND ONE CAMPAIN AND IT HAD ALREADY BEEN DONE TO THE VEHIC	ESC LIGHT COMES ON WHEN WET,NOT ON NOW	TEST AND INSTALL NEWBRAKE LIGHT SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 53569 93810R00 N94 C15 030 TOOK VEHICLE FORA RIDE COULD NOT DUPLICATE THE ISSUE. HOOKEDIT UP TO THE SCAN TOOL AND FOUND CODESP1765-P1767- P1726-P1764 ANDC1513-C1612- C1611. COULD NOT FIND TSB'S FOUNDONE CAM
KM8JN72DX5U	5/31/05	53569	35.31	53569 93810R00 N94 C15 030 TOOK VEHICLE FOR A RIDE COULD NOT DUPLICATE THE ISSUE. HOOKED IT UP TO THE SCAN TOOL AND FOUND CODES P1765-P1767-P1726-P1764 AND C1513-C1612-C1611. COULD NOT FIND TSB'S FOUND ONE CAMPAIN AND IT HAD ALREADY BEEN DONE TO THE VEHIC	CUST IN RENTAL	2 DAY RENTAL	CUSTOMER IN RENTAL CUSTOMER IN RENTAL
KM8JN12D26U	1/10/06	16957	34.54				
KM8JN72D45U	10/30/04	4511	33.87				
KM8JM12B25U	10/28/04	11637	34.2				
KM8JN12D45U	5/24/05	9580	35.3				
KM8JM12B15U	4/29/05	38370	34.99	38370 FOUND BRAKE LIGHT SWITCH CODE 93810ROO .3 N68 C05 .3 REPLACED BRAKE LIGHT SWITCH C1513 BRAKE LIGHT SWITCH INPUT	CS TRACTION CONTROL TURNS OFF AND WILL NOT TURN BACK ON ESP	TEST SYSTEM CODE C1513 REPLACED FAULTY BRAKE LIGHT SWITCH AND RETEST O/K	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 38370 FOUND BRAKE LIGHT SWITCH CODE 93810ROO.3 N68 C05 .3 REPLACED BRAKE LIGHT SWITCHC1513 BRAKE LIGHT SWITCH INPUT
KM8JM12B26U	7/20/05	16544	34.4	REPLACED FAULTY BRAKE LIGHT SWITCH	NOISE IN FRT END ON LEFT TURNS	REMOVED SUBFRAME, LUBED BUSHINGS FOR NOISE ON LEFT TURNS	BUSHING-CROSSMEMBER MOUNTING (ALL, 4WD) RE BUSHING-CROSSMEMBER MOUNTING (ALL, 4WD) RE REMOVED SUBFRAME AND LUBED NOISY BUSHINGS
KM8JM12B35U	6/15/05	16278	34.86				
KM8JN12D45U	5/25/05	34038	34.86				
KM8JM12B86U	7/19/05	22091	34.54				
KM8JN12D95U	7/07/05	27323	35.3				
KM8JM12B26U	7/20/05	16544	34.4	REPLACED FAULTY BRAKE LIGHT SWITCH	CUSTOMER STATES PLEASE INSTALL HELDBRAKE LIGHT SWITCH, ASC LIGHT WAS COMING ON, SCAN TEST LED TO BAD BRAKE LIGHT SWITCH	REPLACED FAULTY BRAKE LIGHT SWITCH ASC LIGHT WAS COMING ON	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACED FAULTY BRAKE LIGHT SWITCH
KM8JN72D36U	4/22/06	12119	35.31	12119 B1347 DAB RES HIGH C1513 BRK LMP SWITCH 91701RPO .3 91000A00 .4 93801ROO .3 100 CORRECTED POOR CONNECTION AT DAB CLEAR DTC ALSO REPLACED DEFECTIVE BRAKE LAMP SWITCH	WIRING REPAIR REPAIR	0	WIRE REPAIR TIME (MINOR)- ADJUSTMENT WIRE REPAIR TIME (MINOR)-ADJUSTMENT
KM8JN72D36U	4/22/06	12119	35.31	12119 B1347 DAB RES HIGH C1513 BRK LMP SWITCH 91701RPO .3 91000A00 .4 93801ROO .3 100 CORRECTED POOR CONNECTION AT DAB CLEAR DTC ALSO REPLACED DEFECTIVE BRAKE LAMP SWITCH	CUSTOMER STATES AIR BAG LIGHT ON	B1347 DAB RES HIGH C1513 BRK LMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 12119 B1347 DAB RES HIGH C1513 BRK LMP SWITCH91701RPO .3 91000A00 .4 93801ROO .3 100CORRECTED POOR CONNECTION AT DAB CLEAR DTCALSO REPLACED DEFECTIVE BRAKE LAMP SWITCH
KM8JN12D86U	10/10/05	17773	34.86				
KM8JN12D76U	10/25/05	31375	34.86				
KM8JN12D45U	5/24/05	29535	34.54				
KM8JN12D85U	7/08/05	16194	34.54				
KM8JN72D96U	7/30/05	38625	35.31	38625 C1513 BRAKE LAMP SWITCH 93810R00 .3 93810RPO .3 N68 C05 60 USED HIGH SCAN & PULLED CODE C1513 BRAKE LAMP SWITCH. CHECKED CONECTION & WIRES GOING TO SWITCH. NOTHING WAS BROKEN, CONNECTION WAS FINE. AFTER REAPLACING SWITCH CODE WENT AWAY ON SCAN TOOL.			
KM8JN12D76U	8/09/05	45431	32.16	45431 REMOVED AND REPLACED FAULTY BRAKE SWITCH PER PREVIOUS DIAG			
KM8JN12D95U	5/03/05	35966	30.66	FOUND CODE FOR BARKE LIGHT SWITCH REPLACED FAULTY			
KM8JM12B75U	6/16/05	21563	34.86				

KM8JM12B05U	6/09/05	20830	34.86				
KM8JN12D56U	9/24/05	34086	34.86				
KM8JN12DX6U	2/23/06	19269	34.86				
KM8JN12D46U	8/18/05	32753	34.86				
KM8JM12B85U	6/03/05	49710	53.43	TECH FOUND DTC C1513, AND C1503 SET STOP LAMP SWITCH INOP. REPLACED STOP LIGHT SWITCH.			
KM8JN12D35U	10/12/04	23771	30.55	CUSTOMER REPORTS PLEASE CHECK CRUISE CONTROL. FOUND BRAKE LIGHT SWITCH INOPERABLE. REPLACED BRAKE LIGHT SWITCH TO CORRECT			
KM8JN72DX5U	4/28/05	21084	31.94	CUSTOMER REPORTS ESP INDICATOR LIGHT WILL NOT WORK, DRIVER WILL PUSH ESP BUTTON BUT LIGHT WILL NOT COME ON. FOUND BRAKE LIGHT SWITCH NOT WORKING WITH OPEN CIRCUIT. REPLACED THE BRAKE LIGHT SWITCH TO CORRECT.			
KM8JN12D96U	7/18/05	36029	34.86				
KM8JN12D96U	9/26/05	14088	35.3				
KM8JN12D86U	7/26/05	21604	34.54				
KM8JN12D86U	8/11/05	16995	34.86				
KM8JM12B06U	4/07/06	22488	32.26	TECH FOUND BRAKE SWITCH FAULTY. REPLACED SWITCH.			
KM8JM12B45U	6/23/05	36993	31.94	CUSTOMER REPORTS STABILITY CONTROL LIGHT OFF; LIGHTS COMES ON AND OFF ON THE DASH AT TIMES. FOUND BRAKE SWITCH HAS OPEN CIRCUIT. REPLACED STOP LAMP SWITCH ASSY TO CORRECT.			
KM8JN12D56U	7/29/05	25783	54.86	TECH FOUND DTCC1513 BRAKELIGHT SWITCH SHORTED. REPLACED BRAKELIGHT SWITCH.			
KM8JN12D85U	6/16/05	27639	34.54				
KM8JM12B96U	10/25/05	21656	35.3				
KM8JN72D55U	12/14/04	19609	33.15				
KM8JM12B85U	7/02/05	28101	35.3				
KM8JM12B26U	9/13/05	19950	33.9	CUSTOMER REPORTS ESC LIGHT COMES ON FOUND TROUBLE CODE C1513 SET. FOUND BRAKE STOP LAMP SWITCH ASSY INOPERATIVE INTERMITTENTL. REPLACED BRAKE SWITCH.			
KM8JN12D66U	10/17/05	17708	32.26	TECH FOUND CODE C1513 BRAKE SWITCH BAD. REPLACED BRAKE SWITCH.			
KM8JN12D95U	4/14/05	31515	33.06				
KM8JN12D15U	5/25/05	31442	33.36				
KM8JN12D97U	8/25/06	3772	34.54				
KM8JM12B75U	5/14/05	36105	34.54				
KM8JN12D75U	1/24/05	11844	33.06				
KM8JN12D45U	5/14/05	13043	34.54				
KM8JM12B25U	10/13/04	21383	33.45		CUSTOMER STATE CRUISE CONTROL INOP	BRAKE LIGHT SWITCH INOP	REPLACE BRAKE LIGHT SWITCH
KM8JN12D76U	7/29/05	11069	34.84		CUSTOMER STATES ESC LIGHT COMES ON INTERMIT. S.O.P.	OPEN SWITCH	REPLACED SWITCH
KM8JN12D86U	7/29/05	17215	35.16		CUST STATES ESC LIGHT COMES ON INTERMITTANT	OPEN SWITCH	REPLACE STOP LAMP SWITCH
KM8JN12D66U	9/14/05	19107	35.16	REPLACE STOP LAMP SWITCH	CUST STATES ECS LT COMES ON INTERMITTANT	OPEN SWITCH	REPLACE STOP LAMP SWITCH
KM8JM12B47U	11/13/06	5570	34.86				
KM8JN12D16U	1/03/06	4522	39.35	ABS LIGHT ON. CODE B1513 BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES VEHICLE HAD TO BE JUMPED STARTED	BATTERY FAILED	BATTERY ASSY RE BATTERY ASSY RE BATTERY FAILED, REPLACED BATTERY
KM8JN12D16U	1/03/06	4522	39.35	ABS LIGHT ON. CODE B1513 BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES ESC LIGHT WAS ON UNTIL IGN WAS CYCLED	B1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE ABS LIGHT ON, CODE B1513 BRAKE LIGHT SWITCH,RE PLACED BRAKE LIGHT SWITCH
KM8JN72D46U	7/16/05	6191	34.84		CUSTOMER STATES THAT ESC LIGHT COMES ON INTERMIT. AWD ENGAGES. HAPPENS ON DRY SURFACE.	OPEN SWITCH	REPLACE STOP LAMP SWITCH
KM8JM12B06U	7/13/05	20376	36.33	STAB CONTOL LITE COMES ON AND OFF WHEN PASS IN FRONT SEAT TEST AND DIAG BRAKE LITE SWITCH SHORTED REPL BRAKE LITE SWITCH TO CORRECT			
KM8JN12D26U	7/15/05	26377	36.65	ESC OFF LITE COMES ON INTERMITT TEST AND DIAG DTC C1513 MALF IN BRAKE SWITCH REPL 11 20 06 REPL TO CORRECT			
KM8JM12B76U	7/22/05	10073	67.4		ESC OFF LIGHT REMAINS ON. INSTALLING SPECIAL ORDER PART, BRAKE LIGHT SWITCH.		BRAKE SWITCH REORDERED BRAKE LIGHT SWITCH
KM8JM12B76U	7/22/05	10073	67.4		ESC OFF LIGHT REMAINS ON. INSTALLING SPECIAL ORDER PART, BRAKE LIGHT SWITCH.		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REORDERED BRAKE LIGHT SWITCH
KM8JN12D26U	7/19/05	16476	37.39	INTERMITTENT OPERATION PERFORM HY-SCAN DIAGNOSTIC/ELECTRICAL SYSTEM DIAGNOSTIC/VISUAL INSPECTION- VERIFY CUSTOMER'S CONCERN (FAULT PRESENT- C1513). REPLACE BRAKE LIGHT SWITCH. CLEAR FAULT. TEST DRIVE VEHICLE-	C/S: SHE SAID HER ESC LIGHT IS ON.	INTERMITTENT OPERATION REPLACED SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16476 INTERMITTENT OPERATION PERFORMHY-SCAN DIAGNOSTIC/ELECTRICAL SYSTEMDIAGNOSTIC/VISUAL INSPECTION- VERIFYCUSTOMER'S CONCERN (FAULT PRESENT- C1513).REPLACE BRAKE LIGHT SWITCH. CLEAR FAULT. TESTDRIVE VE

KM8JN12D95U	3/01/05	21289	35.22	CEL C1513 STOP LAMP SWITCH INTERMITTENT OPEN REPL TO CORRECT			
KM8JN12D26U	7/15/05	14355	38.29	BRAKE LITE SWITCH SHORTED REPL TO CORRECT			
KM8JN12D76U	9/22/05	12021	36.33	ESC OFF LITE TESTED CODE P0114 BRAKE LITE SWITCH SHORTED REPL SWITCH RESET OK AT THIS TIME			
KM8JM12B66U	1/06/06	13216	36.65	BRAKE LITE SWITCH SHORTED REPL TO CORRECT			
KM8JN72D35U	6/13/05	11941	37.39	BRAKE SWITCH INTERMITTENT BRAKE LAMP. REPLACED. NOW OK.	RECALL 079	RECALL 079	RECALL 079 0 11941 RECALL 079 PERFORMED RECALL 079
KM8JN72D35U	6/13/05	11941	37.39	BRAKE SWITCH INTERMITTENT BRAKE LAMP. REPLACED. NOW OK.	CUSTOMER STATES ESP LIGHT ON IN DASH	BRAKE SWITCH INTERMITTENT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 11941 BRAKE SWITCH INTERMITTENT BRAKE LAMP REPLACEMENT 1513 BRAKE LAMP SWITCH
KM8JN12D15U	6/03/05	19870	36.65	ESC LIGHT STAYS ON TEST AND DIAG C1513 INTERNAL SHORT IN BRAKE LAMP SW REPL BRAKE LAMP SWITCH TO CORRECT			
KM8JN12D05U	5/26/05	32111	36.65	CS ESP LIGHT STAYS ON IN DASH AT TIMES TESTED DIAG FOUND OPEN CIRCUIT IN BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH TO CORRECT			
KM8JN12D26U	1/10/06	12135	36.33	STAB LITE COMES ON AND OFF WHILE DRIVE TEST AND DIAG CODE 1513 BRAKE SWITCH SHORTED REPL TO CORRECT OK AT THIS TIME			
KM8JN12DX6U	8/16/05	31858	37.39	OPEN CIRCUIT PERFORM HY-SCAN DIAGNOSTIC TEST/ELECTRICAL SYSTEM DIAGNOSTIC TEST- FAULT PRESENT. VERIFY CUSTOMER'S CONCERN. REPLACE BRAKE LIGHT SWITCH. TEST DRIVE VEHICLE- VERIFY REPAIR/OPERATION	CUSTOMER STATES VEHICLE STALLS WHEN SLOWING TO STOPS? WILL RESTART? ADVISE	FAULT PRESENT REPLACED BODY ASSY	BODY ASSY-THROTTLE AND/OR GASKET RE BODY ASSY-THROTTLE AND/OR GASKET RE 31858 FAULT PRESENT PERFORM HY-SCAN DIAGNOSTIC/ELECTRICAL SYSTEM DIAGNOSTIC/CONTACT TECHNICAL ASSISTANCE/CHECK FOR APPLICABLE SERVICE BULLETINS. CONTACT DPSM (MICHAEL P.) IN REGARDS TO CO
KM8JN12DX6U	8/16/05	31858	37.39	OPEN CIRCUIT PERFORM HY-SCAN DIAGNOSTIC TEST/ELECTRICAL SYSTEM DIAGNOSTIC TEST- FAULT PRESENT. VERIFY CUSTOMER'S CONCERN. REPLACE BRAKE LIGHT SWITCH. TEST DRIVE VEHICLE- VERIFY REPAIR/OPERATION	CUSTOMER STATES VEHICLE STALLS WHEN SLOWING TO STOPS? WILL RESTART? ADVISE	FAULT PRESENT REPLACED BODY ASSY	BODY ASSY-THROTTLE &/OR GSKE ADD SCAN TOOL OPERATION BODY ASSY-THROTTLE &/OR GSKE ADD SCAN TOOL OPERATION 31858 FAULT PRESENT PERFORM HY-SCAN DIAGNOSTIC/ELECTRICAL SYSTEM DIAGNOSTIC/CONTACT TECHNICAL ASSISTANCE/CHECK FOR APPLICABLE SERVICE BULLETINS.
KM8JN12D16U	1/12/06	6499	36.65	TEST AND DIAG INTERNAL SHORT REPL TO CORRECT			
KM8JM12B66U	8/29/05	13681	27.65	CS ESC LIGHT COMES ON INTERM TESTED DIAG FOUND LAMP SWITCH SHORTED REPLACED STOP LAMP SWITCH TO CORRECT			
KM8JN12D96U	10/20/05	23497	36.65	ESC LITE CODE C1513 BRAKE SWITCH SHORTED OUT CIRCUIT REPL TO CORRECT			
KM8JN12D06U	8/19/05	9246	36.65	CS ESC LIGHT OFF TEST AND DIAG BRAKE SWITCH OPEN REPLACED TO CORRECT			
KM8JN12DX6U	8/16/05	31858	37.39	OPEN CIRCUIT PERFORM HY-SCAN DIAGNOSTIC TEST/ELECTRICAL SYSTEM DIAGNOSTIC TEST- FAULT PRESENT. VERIFY CUSTOMER'S CONCERN. REPLACE BRAKE LIGHT SWITCH. TEST DRIVE	RECALL 079	CAMPAIGN 079 RECALL 079 PERFORME	RECALL 079 RECALL 079 31858 CAMPAIGN 079 PERFORMED CAMPAIGN 079
KM8JN12DX6U	8/16/05	31858	37.39	OPEN CIRCUIT PERFORM HY-SCAN DIAGNOSTIC TEST/ELECTRICAL SYSTEM DIAGNOSTIC TEST- FAULT PRESENT. VERIFY CUSTOMER'S CONCERN. REPLACE BRAKE LIGHT SWITCH. TEST DRIVE VEHICLE- VERIFY REPAIR/OPERATION	CUSTOMER STATES CHECK ENGINE LIGHT ON, VEHICLE STALLS WHILE DRIVING,	STALLS REPLACED WIRING	WIRING ASSY-ENGINE RE WIRING ASSY-ENGINE RE 31858 STALLS TEST DRIVE VEHICLE- VERIFY CUSTOMER'S CONCERN (STALLING). PERFORM HY-SCAN DIAGNOSTIC TEST/SECONDARY IGNITION ANALYSIS/FUEL SYSTEM DIAGNOSTIC/ELECTRICAL SYSTEM DIAGNOSTIC TEST/CHECK FOR APPLICABLE SERVICE
KM8JN12D06U	7/29/05	8007	38.29	BRAKE LITE SWITCH SHORTED INTERNALLY REPL TO CORRECT OK AT THIS TIME			
KM8JN12D76U	7/18/05	13053	63.32	ESC LAMP ON CODE C1513 OPEN CIRCUIT IN BRAKE LAMP SWITCH REPL TO CORRECT CLEARED CODES			
KM8JN12D85U	6/10/05	17225	36.65	ESC LITE COMES ON AND OFF CODE C1513 BRAKE LITE SWITCH SHORTED OUT REPL TO			

KM8JN12DX6U	8/16/05	31858	37.39	OPEN CIRCUIT PERFORM HY-SCAN DIAGNOSTIC TEST/ELECTRICAL SYSTEM DIAGNOSTIC TEST- FAULT PRESENT. VERIFY CUSTOMER'S CONCERN. REPLACE BRAKE LIGHT SWITCH. TEST DRIVE VEHICLE- VERIFY REPAIR/OPERATION	CUSTOMER STATES CHECK ENGINE LIGHT ON, VEHICLE STALLS WHILE DRIVING,	STALLS REPLACED WIRING	WIRING ASSY-ENGINE ADD SCAN TOOL OPERATION WIRING ASSY-ENGINE ADD SCAN TOOL OPERATION 31858 STALLS TEST DRIVE VEHICLE- VERIFY CUSTOMER'S CONCERN (STALLING), PERFORM HY-SCAN DIAGNOSTIC TEST/SECONDARY IGNITION ANALYSIS/FUEL SYSTEM DIAGNOSTIC/ELECTRICAL SYSTEM
KM8JN12DX6U	8/16/05	31858	37.39	OPEN CIRCUIT PERFORM HY-SCAN DIAGNOSTIC TEST/ELECTRICAL SYSTEM DIAGNOSTIC TEST- FAULT PRESENT. VERIFY CUSTOMER'S CONCERN. REPLACE BRAKE LIGHT SWITCH. TEST DRIVE VEHICLE- VERIFY REPAIR/OPERATION	CUSTOMER STATES ESC LIGHT COMES ON ADVISEF	OPEN CIRCUIT REPLACED SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 31858 OPEN CIRCUIT PERFORM HY-SCAN DIAGNOSTIC TEST/ELECTRICAL SYSTEM DIAGNOSTIC TEST- FAULT PRESENT. VERIFY CUSTOMER'S CONCERN. REPLACE BRAKE LIGHT SWITCH. TEST DRIVE VEHICLE- VERIFY REPAIR/OPERATION
KM8JN72D56U	10/12/05	43495	34.26	43495 SOP 93810R00 N94 C15 30 INSTALL SOP BRAKE LIGHT SWITCH, ESC LIGHT NO CODES PRESENT.	CUSTOMER STATES:PART FOR AIRBAG LIGHT IS IN	RECALL	REPLACE AIRBAG COVER AS PER BULLETIN REPLACE AIRBAG COVER AS PER BULLETIN 43495 SOP 61B046R0 20 079 COMPLETE
KM8JN72D56U	10/12/05	43495	34.26	43495 SOP 93810R00 N94 C15 30 INSTALL SOP BRAKE LIGHT SWITCH, ESC LIGHT NO CODES PRESENT.	CUSTOMER STATES:PART FOR CHECK ENGINE LIGHT-ESC	INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 43495 SOP 93810R00 N94 C15 30 INSTALL SOP BRAKE LIGHT SWITCH, ESC LIGHT NO CODES PRESENT.
KM8JN12D06U	4/10/06	3238	37.39	BRAKE LIGHT SWITCH ESC. CODE C1513 BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH. NOW OK.	ESC LIGHT STAYS ON	C1513 BRAKE LIGHT SWITCH REPLACED SWITCH ASM	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 3238 C1513 BRAKE LIGHT SWITCH ESC CODE C1513 BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT
KM8JN72DX6U	7/28/05	18892	37.71	18892 OK BRAKE SWICH 1513 WASE REPLACE POOR CONTACT.	CUST STATES EAC LIGHT COMING ON AND OFF SOMETIMES	EAC LIGHT COME ON AND OFF INTERMITT FOUND BRAKE SWITHC OPEN CIRCUIT REPLACE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 18892 OK BRAKE SWICH 1513 WASE REPLACE
KM8JN12DX6U	8/17/05	14525	37.39	REPLACE BRAKE LAMP SWITCH	RECALL 079	OPEN CAMPAIGN	00
KM8JN72D46U	7/26/05	29588	34.26	29589 SOP BRAKE LIGHT SWITCH 93810R00 N94 C15 30 REPLACED BRAKE LIFHT SWITCH FOR BRAKE LIGHT SWITCH CODE IN ECS C1513	CUSTOMER STATES:RETURNING FOR SPECIAL ORDERED PART	INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 29589 SOP BRAKE LIGHT SWITCH 93810R00 N94 C1530 REPLACED BRAKE LIFHT SWITCH FOR BRAKE LIGHT SWITCH CODE IN ECS C1513
KM8JN12D76U	7/11/05	20359	33.94	20359 ESC LIGHT IS ON 93810R00 N94 C15 30 C1513 BRAKE LAMP SWITCH WHEN PRESSING BRAKE LAMP MANUALLY, SWITCH WILL INTERMITTENTLY MALFUNCTION, CAUSING BRAKE LIGHTS TO BE INOP. REPLACED BRAKE LAMP SWITCH.	CUSTOMER STATES:ESC LIGHT IS ON / SOP	INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20359 ESC LIGHT IS ON 93810R00 N94 C15 30 C1513 BRAKE LAMP SWITCH WHEN PRESSING BRAKE LAMP MANUALLY, SWITCH WILL INTERMITTENTLY MALFUNCTION, CAUSING BRAKE LIGHTS TO BE INOP. REPLACED BRAKE LAMP SWITCH.
KM8JM12B36U	7/13/05	7554	35.3				
KM8JM12B36U	7/13/05	7554	35.3				
KM8JN12DX6U	8/17/05	14525	37.39	REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES HIGH MOUNT BRAKE LIGHT INOP AT TIMES	C1513 BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACE BRAKE LAMP SWITCH
KM8JN12D55U	5/19/05	22044	54.25		CK BRAKE LIGHTS	BRAKE LIGHT SWITCH INTERNAL MALFUNCTION	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED BRAKE LIGHT SWITCH
KM8JM12B26U	7/15/05	8258	39.35		CHECK ESC LIGHT ON AT TIMES	TECH REPLACED BRAKE LIGHTSWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D56U	7/21/05	24542	34.86				
KM8JN72D96U	8/10/05	38683	34.86	CUSTOMER STTES ESP ILGHT GOES ON AND OFF, LIGHT OFF, TECH SCANNED, FOUND CODE C1513 FOR BRAKE LAMP SWITCH, SWITCH WAS SHORTED, REPLACED SWITCH, CLEARED CODE, ALL OK NOW			
KM8JN72D55U	4/23/05	24921	33.34				
KM8JN12DX6U	11/10/05	24052	37.39	BRAKE SWITCH INOP ESC LIGHT ON BRAKE SWITCH BAD, REPLACED BRAKE LIGHT SWITCH. NOW OK.	RECALL 079	RECALL 079	RECALL 079 RECALL 079 24052 RECALL 079 PERFORMED RECALL 079
KM8JN12DX6U	11/10/05	24052	37.39	BRAKE SWITCH INOP ESC LIGHT ON BRAKE SWITCH BAD, REPLACED BRAKE LIGHT SWITCH. NOW OK.	CUSTOMER STATES ESC LIGHT ON	BRAKE SWITCH INOP	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 24052 BRAKE SWITCH INOP ESC LIGHT ON BRAKE SWITCH BAD, REPLACED BRAKE LIGHT SWITCH
KM8JM12B67U	11/01/06	13	37.39	FOUND BRAKE LIGHT ON. BRAKE SWITCH SHORTED OUT. REPLACED TO CORRECT.	ESC LIGHT IS ON	ESC LIGHT ON REPLACED BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 13. FOUND BRAKE LIGHT ON BRAKE SWITCH SHORTED OUT REPLACED TO CORRECT
KM8JN72D16U	11/14/05	19857	34.86				
KM8JN72D95U	5/14/05	32104	33.43				
KM8JN72D76U	8/18/05	40075	34.86				
KM8JN72D06U	9/14/05	31319	34.54				
KM8JN12D86U	10/08/05	14635	34.86				
KM8JN12D55U	5/19/05	40454	37.71	40454 FOUND BRAKE LAMP SWITCH SHORT INTERNALLY, REPLACED	079 - DRIVER AIRBAG COVER MOD REPL (07-01-001)	RECALL	RECALL 079 RECALL 079 40454 PERFORMED RECALL
KM8JN12D55U	5/19/05	40454	37.71	40454 FOUND BRAKE LAMP SWITCH SHORT INTERNALLY, REPLACED	CUSTOMER CLAIMS ESP LIGHT STAYES ON WHILE DRIVING	ESP LIGHT STAY ON WHILE DRIVING FOUND OPEN CIRCUIT/SHORT REPLACE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 40454 FOUND BRAKE LAMP SWITCH SHORT INTERNALLY, REPLACED

KM8JN12D96U	9/09/05	18712	37.71	18712 BRAKE LAMP SWITCH SCAN TEST, RETRIEVED CODE B1315 R.R BRAKE LAMP SWITCH,CLEAR FAULT			
KM8JM12B96U	7/11/05	14408	33.34				
KM8JN72D95U	12/10/04	31241	34.86				
KM8JN12D06U	10/06/05	23237	34.86				
KM8JN12D06U	1/07/06	10714	34.54				
KM8JN12D05U	10/13/04	20856	37.11		CHECK ABS NOT WORKING	TCH SCANNED SYSTEM CODE C1503 TCS SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D86U	10/31/05	19370	37.39	REPLACED BRAKE LAMP SWITCH C1513 BRAKE LAMP SWITCH FAILED REPLACED NOW OK.	C/S: THE AIR BAG IS ON (INTERMIT), CUSTOMER WOULD LIKE TO KNOW IF THISWILL BE A RECALL PROBLEM FOR HER VEHICLE.	AIR BAG LIGHT ON CLEARED CODE RESECURED	AIR BAG LIGHT ON DIAGNOSTIC TESTING AND EVALUATION 19370 B1346 CLEANED AND ADJUSTED CABLES
KM8JN12D86U	10/31/05	19370	37.39	REPLACED BRAKE LAMP SWITCH C1513 BRAKE LAMP SWITCH FAILED REPLACED NOW OK.	C/S: THE DRIVER SIDE VISOR IS LOOSE SHE ORDERED THIS PART LAST DECEMBER BUT, SHE NEVER RECEIVED A LETTER OR PHONE CALL SAYING THAT THE PART	REPLACED SUNVISOR	SUNVISOR ASSY (LH) RE SUNVISOR ASSY (LH) RE 19370 DRIVER SIDE VISOR FALLING APART
KM8JM72B85U	6/17/05	37371	34.86				
KM8JN72DX5U	5/20/05	41285	34.54				
KM8JM12B15U	5/10/05	45018	32.36	CUSTOMER STATES ESP LIGHT COMES ON WHILE DRIVING SOP IS IN AUSE:C1513 CODE CORRECTION CORRECTION;REPLACE STOP LAMP S/W	CUSTOMER STATES ESP LIGHT COMES ON WHILE DRIVING SOP IS IN	CAUSE:C1513 CODE	CORRECTION;REPLACE STOP LAMP SW
KM8JN12D86U	10/31/05	19370	37.39	REPLACED BRAKE LAMP SWITCH C1513 BRAKE LAMP SWITCH FAILED REPLACED NOW OK.	C/S ESC LIGHT ON	REPLACED BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 19370 REPLACED BRAKE LAMP SWITCH C1513BRAKE LAMP SWITCH FAILED REPLACED NOW OK
KM8JM12B06U	7/20/05	26712	37.39	BRAKE LAMP SWITCH CHECK WIRING FOUND AT TIMES BRAKE LAMP SWITCH SHORTING OUT REPLACED TO CORRECT.	RECALL 079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	RECALL 079 PERFORMED	RECALL 079 RECALL 079
KM8JM12B06U	7/20/05	26712	37.39	BRAKE LAMP SWITCH CHECK WIRING FOUND AT TIMES BRAKE LAMP SWITCH SHORTING OUT REPLACED TO CORRECT.	C/S BRAKE LIGHTS ARE INOP AT TIMES	BRAKE LAMP SWITCH REPLACED SWITCH ASM	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 26712 BRAKE LAMP SWITCH CHECK WIRING FOUNDAT TIMES BRAKE LAMP SWITCH SHORTING OUTREPLACED TO CORRECT
KM8JN12D55U	5/13/05	27688	32.04	ESP LIGHT COMES ON WHILE DRIVING TRACED AND DIAG TO FAULTY BRAKE SWITCH CODE C1513 REPL AND ADJUSTED BRAKE SWITCH			
KM8JN12D76U	2/21/06	14163	32.04	ESC LIGHT ON DASH STAYS ON CODE C1523 BRAKE SW CIRCUIT MALFUNCTION REPL BRAKE SW			
KM8JN12D76U	2/27/06	18327	32.04	ESC LIGHT IS COMING ON WHILE DRIVING CODE C1513 BRAKE BRAKE SWITCH CIRCUIT MALFUNCTION REPL BRAKE SWITCH	CUSTOMER STATES ESC LIGHT IS COMING ON WHILE DRIVING	C1513 BRAKE SWITCH CIRCUIT MALFUNCTION 3	DIAG. SCAN TOOL OP. REPLACED BRAKE SWITCH AS NEEDED
KM8JM72B06U	12/03/05	22295	55.86	22295 RAN SCAN TEST AND FOUND CODE C1513 FOR STOP LAMP CIRCUIT FAILURE. TESTED STOP LAMP SWITCH AND FOUND INTERMIT OPEN. NEC TO REPLACE SWITCH FOR STOP			
KM8JN12D56U	8/08/05	37128	28.84				
KM8JN12D66U	7/12/05	39243	48.34	C/S THE ESC OFF LIGHT KEEPS COMING ON & OFF. INSPECTED FOR CONCERN, REPLACED BARKE LIGHT SWITCH FOR CODE B1315 OPEN CIRCUIT.			
KM8JM12B66U	7/12/05	19929	32.04	ESC LIGHT ON CODE C1513 BRAKE SWITCH MALFUNCTION REPL STOP LAMP SWITCH	CUSTOMER STATES ESC LITE ON	C1513 BRAKE SWITCH CIRCUIT MALFUNCTION	DIAG. SCAN TOOL OP REPLACD STOP LAMP SWITCH AS NEEDED
KM8JM12B66U	7/12/05	19929	32.04	ESC LIGHT ON CODE C1513 BRAKE SWITCH MALFUNCTION REPL STOP LAMP SWITCH	CUSTOMER STATES AFTER DRIVE AWILE STOP HEAR SIZZLING NOISE UNDER CAR	A/C CONDENSATION DRIPPING ON EXHAUST	N/C NORMAL CONDITION
KM8JN12D25U	6/14/05	19739	34		CUSTOMER STATES ESP LITE ON SPECIAL ORDER PART IN	B1513 STOP LAMP SWITCH INTERMITTANT OPERATION	DIAG. SCAN TOOL OP. REPLACED STOP LAMP SWITCH & VERIFIED OP.
KM8JN12D66U	8/15/05	19103	11.3		CUSTOMER STATES THE CHECK ENGINE/SERVICE ENGINE SOON WARNINGLAMP IS ON. CHECK AND ADVISE. S/O P/H.	FAILED RH UPSTREAM O2 SENSOR.	INSPECTED FOR CONCERN; SCAN TESTED AND DIAGNOSED DTC P0154; TESTED/VERIFIED CIRCUIT INTEGRITY AND REPLACED RIGHT SIDE UPSTREAM OXYGEN SENSOR DUE TO INTERNAL OPEN CIRUIT. RESTORED SYSTEM, CLEARED CODE & RETESTED TO VERIFY REPAIRS OP #39214ROO 0.9, 39214RPO
KM8JN12D66U	8/15/05	19103	11.3		CUSTOMER STATES THE ESC LIGHT STILL COMES ON AT TIMES & THE SWITCH WILL NOT TURN IT OFF, WHEN ON. S/O P/H.		INSPECTED FOR CONCERN; SCAN TESTED AND DIAGNOSED SYSTEM. REPLACED FAILED STOP LAMP SWITCH DUE TO OPEN CIRCUIT. RESTORED SYSTEM & RETESTED TO VERIFY REPAIRS OP #93810ROO 0.3 N69 C15 FPN 93810-3K000
KM8JN12D05U	6/09/05	16231	34	CUST STATES ESP LIGHT ON CODE C1513 BRAKE LAMP SW CIR MAL DUE TO INTER BRAKE SW FUNCTION REPL STOP LAMP SW	CUSTOMER STATES MIL LITE ON -- DECLINED MAINTENANCE	PO455 GROSS EVAP LEAK DUE TO LOOSE FUEL CAP	DIAG. SCAN TOOL OP. TIGHTENED FUEL CAP & PERFORMED EVAP TEST

KM8JN12D05U	6/09/05	16231	34	CUST STATES ESP LIGHT ON CODE C1513 BRAKE LAMP SW CIR MAL DUE TO INTER BRAKE SW FUNCTION REPL STOP LAMP SW	CUSTOMER STATES ESP LITE ON	C1513 BRAKE LAMP SWITCH CIRCUIT MALFUNCTION DUE TO INTERMITT BRAKE SWITCH FUNCTION	DIAG. REPLACED STOP LAMP SWITCH AS NECESSARY
KM8JM12B76U	11/04/05	45175	30.82	CUSTOMER STATES ESC LIGHT IS ON	CUSTOMER STS ESC LIGHT IS ON, SOP HERE	INPECT AND FOUND CODES FOR BRAKE SWITCH NOT MAKING NO CONTACT	REPLACE BRAKE SWITCH REPLACE BRAKE SWITCH INSPECT AND FOUND CODES FOR BRAKE SWITCH NOTMA KING ANY CONTACT, CAUSING THE ESC LIGHT TOCOME ON. REMOVE AND REPLACE BRAKE SWITCH ANDCLEARE D CODES AND TEST DRIVE, VEHICLEWORKING FINE AS T THIS TIME
KM8JN12D66U	8/15/05	16881	28.56	CUSTOMER STATES THE ESC OFF LAMP COMES ON AT TIMES WHEN DRIVING AND CAN'T BE SWITCHED OFF CHECKED FOR CONCERN TRACED WIRING AND FOUND SHORT AT BRAKE LIGHT SWITCH REPLACED SWITCH	CUSTOMER STATES THE ESC OFF LAMP COMES ON AT TIMES WHILE DRIVING & CAN'T BE SWITCHED OFF W/BUTTON. CK & ADVISE		INSPECTED FOR CONCERN; SCAN TESTED AND DIAGNOSED & REPLACED BRAKE LIGHT SWITCH DUE TO INTERMITTENT POOR CONTACT. RESTORED & RETESTED TO VERIFY REPAIRS OP #93810R00 0.3 N69 C15
KM8JM12B95U	10/27/04	20358	30.9	CUSTOMER STATES ESP LIGHT STAYS ON CHECKED FOUND FAULTY STOP LIGHT SWITCH REPLACED SWITCH			
KM8JM12B95U	6/14/05	23228	30.8	CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF INSPECTED AND FOUND A SHORT AT THE BRAKE LIGHT SWITCH REPLACED THE SWITCH AND RECHECKED OPERATION TO VERIFY REPAIR	CUSTOMER STATES THAT THE ESC LIGHT COMES ON. PART HERE		INSPECTED FOR CUSTOMERS CONCERN AND FOUND INTERNAL OPEN CIRCUIT IN BRAKE SWITCH. INSTALLED NEW SWITCH, CLEARED ALL CODES AND RETESTED TO VERIFY REPAIR. OP CODE 93810R00 .3 (N94 C15) FPN HY93810-3K000
KM8JN12D36U	10/14/05	25713	32.44	CS ESC LIGHT COMES ON AND STAYS ON TILL TURN OFF AND RESTART. SCANNED TRACTION CONTROL FOUND CODE C1513. REPLACED BRAKE LAMP SWITCH, ERASED CODE. TEST DROVE AND VERIFIED CORRECTION.			
KM8JN12D67U	11/16/06	9	32.76	BRAKE LIGHTS STAYING ON AND CRUISE STAYING ENGAGED. BRAKE LIGHT SWITCH STUCK. REPLACE BRAKE LIGHT SWITCH ASSY.			
KM8JM12B05U	5/11/05	27818	34.23		DRIVER AIR BAG MODULE REPLACEMENT	CPN	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT
KM8JM12B05U	5/20/05	6234	37.7		CHECK CUSTOMER STATES ESP OFF LIGHT COMES ON	CHECKED AND FOUND BRAKELIGHT SWITCH FAILED	REPLACED BRAKE SWITCH
KM8JM12B86U	7/11/05	11909	37.7		CHECK CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING PUSHING BUTTON DOES	CHECKED AND FOUND BRAKE SWITCH FAILED REPLACED BRAKE SWITCH	
KM8JN72D56U	8/18/05	4805	37.7		CHECK CUSTOMER STATES ESC LIGHT GOES ON AND OFF RANDOMLY S.O.P. IN	CHECKED AND FOUND CODE C1513 - BRAKE SWITCH FAILED	REPLACED BRAKE SWITCH
KM8JM12B05U	5/11/05	27818	34.23		CSTATES ESP OFF LIGHT COMING ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM72B05U	4/29/05	31134	36.19		C/S ESP LIGHT IS OFF... (POPPING UPON DASH)	94	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B36U	7/13/05	29666	34.55		CSTATES ESC LT STAYING ON SOP	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D16U	1/04/06	31360	34.55		CSTATES CK ENG LIGHT ON	15	SENSOR ASSY-THROTTLE POS POSITION RE SENSOR ASSY- THROTTLE POSITION RE
KM8JM12B06U	10/08/05	21540	59.46	ADDITIONAL TIME			
KM8JN72D36U	2/21/06	9350	34.24				
KM8JN12D66U	7/27/05	38407	36.06				
KM8JM12B25U	7/12/05	18250	35.74				
KM8JN72D16U	1/04/06	31360	34.55		CSTATES CK ENG LIGHT ON	15	SENSOR ASSY-THROTTLE POS ADD SCAN TOOL OPERATION SENSOR ASSY-THROTTLE POS ADD SCAN TOOL OPERATION
KM8JN72D16U	1/04/06	31360	34.55		CSTATES 4WD LIGHT FLASHING WHEN HITTING BRAKE	40	SENSOR-PRESSURE SENSOR- PRESSURE
KM8JN72D16U	1/04/06	31360	34.55		C/STATES WHEN TURNING LEFT- SIGNAL LIGHT LEVER WILL NOT CANSCL.	15	SWITCH ASSY-LIGHTING AND/OR TURN SIGNAL RE SWITCH ASSY- LIGHTING AND/OR TURN SIGNAL RE
KM8JN12D76U	9/15/05	32376	36.06				
KM8JN72D76U	9/23/05	11207	35.74				
KM8JM12BX5U	6/14/05	26443	37.84	INSTALLED S/O STOP LAMP SWITCH TO CORRECT CODE 1513 AND STOP LAMP STAYING ON. RECHECK - OK AT THIS TIME			
KM8JN72D56U	11/18/05	13681	36.64	13681 REPLACE BRAKES LIGHT SWITCH C1513 93350R00.3 N94/C15			
KM8JN72D16U	1/04/06	31360	34.55		CSTATES 4WD LIGHT FLASHING WHEN HITTING BRAKE	40	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D76U	7/15/05	46613	108.89	TRACE WIRING AND MEASURE VOLTAGE	C/S ELECTRONIC STABILIZER CONTROL ISON...	15	SENSOR-PRESSURE SENSOR- PRESSURE
KM8JN72D76U	7/15/05	46613	108.89	TRACE WIRING AND MEASURE VOLTAGE	C/S ELECTRONIC STABILIZER CONTROL ISON...	15	CK VOLTS AT PRESSURE SENSOR WIRE REPAIR TIME (MAJOR)- ADJUSTMENT
KM8JM12B46U	7/12/05	50002	36.96	50002 CODE C1513 BRAKE SWITCH INUP 93810R00 0.3 0.3 50004 REPLACE BRAKE SWITCH + CLEAR CODE			
KM8JM12B46U	7/13/05	30211	36.96	30213 FOUND THAT AT TIMES, BRAKE LIGHT SWITCH IS INOP 93810R00 N94/C15 0.3 REPLACED BRAKE SWITCH			

KM8JN12D06U	8/15/05	14980	36.96	14980 BRAKE LIGHT SWITCH INOP 32002A00/C15 0.2 C1513 BRAKE LAMP SWITCH.SWITCH REPLACE			
KM8JN72D76U	7/15/05	46613	108.89	TRACE WIRING AND MEASURE VOLTAGE	C/S ELECTRONIC STABILIZER CONTROL ISON...	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D96U	7/27/05	32388	34.23		CSTATES CK ENG LIGHT ON	15	SENSOR ASSY-OXYGEN LH (UP) RE SENSOR ASSY-OXYGEN LH (UP) RE
KM8JN72D96U	7/27/05	32388	34.23		CSTATES CK ENG LIGHT ON	15	SENSOR ASSY-OXYGEN LH ADDDSCAN TOOL OPERATION SENSOR ASSY-OXYGEN LH ADDDSCAN TOOL OPERATION
KM8JN72D96U	7/27/05	32388	34.23		CSTATES ESC LT WAS ON OFF NOW	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D26U	7/29/05	11230	38.6	11231 B1513 BRAKE LIGHT SWITCH MALFUNCTION. FOUND THAT THE BRAKE LIGHT SWITCH ITSELF HAS AN OPEN CIRCUIT 93810R00 N94/C15 0.3 REPLACED BRAKE LIGHT SWITCH	CUST STATES ESC OFF LIGHT CAME ON AND WHEN PRESSING ESC OFF BUTTON WOULD NOT WORK THEN VEHICLE SHUT DOWN	FOUND BRAKE LIGHT SWITCH MALFUNCTION HASAN OPEN CIRCUIT, REPLACED BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 11231 B1513 BRAKE LIGHT SWITCH MALFUNCTION.FOUND THAT THE BRAKE LIGHT SWITCH ITSELF HASAN OPEN CIRCUIT 93810R00 N94/C15 0.3 REPLACEDBRAKE LIGHT SWITCH
KM8JN72D25U	5/18/05	25223	36.64	25225 FOUND THAT THE BRKE LIGHT SWITCH AT TIMES WOUNLD HAVE AN OPEN CIRCUIT 93810R00 N94/C15 0.3 REPLACED SWITCH	DRIVER AIR BAG MODULE REPLACEMENT	PERFORMED CAMP T079	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 25225 OPEN RECALL 61B046R0 0.2 REPLACEDAIRBAG MODULE COVER
KM8JN72D35U	6/17/05	22163	36.19		C/STATES ESP LIGHT WILL COME ON ANDOFF.	INTERNAL FAILURE.	PRESSURE SENSOR PRESSURE SENSOR
KM8JN72D35U	6/17/05	22163	36.19		C/STATES ESP LIGHT WILL COME ON ANDOFF.	INTERNAL FAILURE.	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D35U	6/17/05	22163	36.19		C/STATES ESP LIGHT WILL COME ON ANDOFF.	INTERNAL FAILURE.	59150ATT STRIGHT TIME. MISC
KM8JN72D25U	5/18/05	25223	36.64	25225 FOUND THAT THE BRKE LIGHT SWITCH AT TIMES WOUNLD HAVE AN OPEN CIRCUIT 93810R00 N94/C15 0.3 REPLACED SWITCH	CUST STATES ESP LIGHT COMES ON BY ITSELF	FOUND BRAKE LIGHT SWITCH INTERMITANT OPEN CIRUIT, REPLACED SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 25225 FOUND THAT THE BRKE LIGHT SWITCH ATTIMES WOUNLD HAVE AN OPEN CIRCUIT 93810R00N94/C15 0.3 REPLACED SWITCH
KM8JM12B55U	6/15/05	21815	38.6	21816 SWITCH HAS POOR CONTAC 93810ROO- 0.3HR.,N94/C15 0.3HR.	CUSTOMER STATES ETC LIGHT WAS STAYING ON DIAG AS NEEDING A BRAKE SWITCH SOP IS HERE	REPLACED LAMP SWITCHHAS POOR CONTACT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 21816 SWITCH HAS POOR CONTAC93810ROO- 0.3HR.,N94/C15 0.3HR.
KM8JN72D35U	6/20/05	16941	36.64	16943 FOUND THAT THE BRAKE SWITCH IS INOP 93810R00 N94/C15 0.3 REPLACED BRAKE SWITCH			
KM8JM12B97U	10/23/06	5	34.55		NO BRAKE LIGHTS	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B76U	11/19/05	3248	24.89	ADJUST BRAKE LAMP SWITCH	C STATES VEH HAS NO BRAKE LIGHTS'	C15	ADJUST BRAKE LIGHT SWITCH MISC
KM8JM72B45U	6/22/05	28691	34.55		CSTATES ESC LT COMMING ON SOP	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B25U	5/23/05	31385	34.55		BRAKE LIGHT SWITCH IS STICKING.	INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B05U	5/21/05	23359	32.08	COMPLAINT: CUSTOMER STATES THE ESC LIGHT IS COMING ON CAUSE: BAD BRAKE LAMP SWITCH CORRECTION: REPLACED SWITCH	CUSTOMER STATES THE ESC LIGHT IS COMING ON.	BAD BRAKE LAMP SWITCH	REPLACED SWITCH OP CODE 32002A00 .2
KM8JM12B05U	5/21/05	23359	32.08	COMPLAINT: CUSTOMER STATES THE ESC LIGHT IS COMING ON CAUSE: BAD BRAKE LAMP SWITCH CORRECTION: REPLACED SWITCH	PER VIS, DRIVER AIRBAG COVER REPL. (07-01-001)	RECALL	PERFORMED RECALL OP CODE 61B046R0 .2
KM8JM12B56U	10/24/05	11967	34.08				
KM8JN12D06U	12/06/05	23924	33.76				
KM8JM12B55U	6/02/05	23358	34.23		C/STATES ENG WILL NOT CRANK	INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B56U	12/09/05	22927	34.55		C STATES ESC LIGHT IS COMING ON	INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D06U	1/03/06	10723	34.55		C.S THEY HEAR A RATTLE NEAR THE TOPOF THE BACK WINDOW	15	R&I LAMP INSTALL SOUND DEADENER ALL OK LAMP ASSY- HIGH MOUNTED STOP RE
KM8JM12B25U	6/24/05	34077	33.76				
KM8JN12DX5U	4/06/05	28701	34.08				
KM8JN12D06U	11/16/05	37650	31.24				
KM8JN12D76U	11/18/05	19350	33.2		ESC LIGHT IS ON	.	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP
KM8JN12D06U	1/03/06	10723	34.55		C/C THE ESC LIGHT COMES ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D06U	1/03/06	10723	34.55		CSTATES RADIO DRAINING BATTERY	28	RADIO ASSY-ETR RE RADIO ASSY- ETR RE
KM8JN72D76U	7/16/05	14765	29.14	VERIFY CONCERN. TEST AND REPLACE BRAKE LITE SWITCH			
KM8JN72D96U	9/09/05	7546	30.8		CUST STATES THAT THE ESC LIGHT IS COMING ON INSTALL	BRAKE LAMP SWITCH SHORTED	REPLACED BRAKE LAMP SWITCH AND RECCHK
KM8JM12B05U	6/23/05	29414	31.56				
KM8JN12D96U	10/25/05	48401	31.24	48401 INSPECTED FOUND STOP SWITCH INTERNAL FAILURE REPLACED BRAKE LIGHT SWITCH RETEST OK			
KM8JN12D96U	10/18/05	36809	31.56				
KM8JM12B96U	7/11/05	19031	34.84		CUST STATES STABILITY LIGHT GOES ON AND OFF	FOUND CODE FOR BRAKE LIGHT SWITCH	REPLACE SWITCH
KM8JN72D75U	8/28/04	10947	28.56		CUSTOMER STATES: THAT TEH CRUISE CONTROL IS INOP	BRAKE SWITCHED NOT OPERATING	REPLACED BRAKE SWITCH
KM8JM12B86U	7/13/05	10213	36.66	C1513, TEST CIRCUITS, ISOLATED TO SHORTED STOP LAMP SWITCH	C/S BREAK LIGHTS INOP. CHECK AND ADVISE	N94	SWITCH ASSY-STOP LAMP RE
KM8JN12D75U	4/27/05	19867	27	C1513 - ADJUSTED BRAKESWITCH HEIGHT PER BULLITEN	C/S ESP LIGHT ON DASH WOULD NOT TURN OFF	40	SWITCH ASSY-STOP LAMP
KM8JN72D96U	11/26/05	9911	35.16				
KM8JM12BX6U	7/15/05	21300	34.84				

KM8JM12B46U	7/22/05	9129	32	INSPECTED VEHICLE AND FOUND CODE C1513, BRAKE SWITCH MALFUNCTION. CHECKED CIRCUIT WIRING. OK. REPLACED BRAKE SWITCH PER DIAGNOSIS OF PROBLEM. CLEARED CODES AND TEST DROVE, NO FURTHER PROBLEMS AT THIS TIME	CUSTOMER STATES THE ESC LIGHT STAYS ON ALL THE TIME	BRAKE SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE INSPECTED VEHICLE AND FOUND CODE C1513, BRAKES WITCH MALFUNCTION. CHECKED CIRCUIT WIRING. OK. REPLACED BRAKE SWITCH PER DIAGNOSIS OF PROBLEM. CLEARED CODES AND TEST DROVE, NO FURTHER PROBLEMS AT THIS TIME
KM8JN12D75U	4/27/05	19867	27	C1513 - ADJUSTED BRAKE SWITCH HEIGHT PER BULLETIN	C/S CK ENGINE LIGHT ON SOP IN	15	SENSOR ASSY-OXYGEN RH (UP) RE
KM8JN12D75U	4/27/05	19867	27	C1513 - ADJUSTED BRAKE SWITCH HEIGHT PER BULLETIN	C/S CK ENGINE LIGHT ON SOP IN	15	SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION
KM8JN12D06U	7/15/05	10814	38.3	ADJUST SWITCH TO SPECS PERTSB AND LIGHT CONTINUED TO COME ON	ESC AND ABS LIGHTS ON	15	SWITCH ASSY-STOP LAMP RE
KM8JM12B86U	7/13/05	7865	32	INSPECTED VEHICLE AND FOUND CODE C1513, STOP LAMP SWITCH OPEN/SHORT. SHORT TO GROUND. TESTED CIRCUIT AND CALLED TECH SUPPORT. FOUND PROBLEM WITH STOP LAMP SWITCH. REPLACED SWITCH. TEST DROVE. OK AT THIS TIME	ESC LIGHT COMES ON AT TIMES	STOP LAMP SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE INSPECTED VEHICLE AND FOUND CODE C1513, STOP LAMP SWITCH OPEN/SHORT. SHORT TO GROUND. TESTED CIRCUIT AND CALLED TECH SUPPORT. FOUND PROBLEM WITH STOP LAMP SWITCH. REPLACED SWITCH. TEST DROVE. OK AT THIS TIME
KM8JM12B96U	7/12/05	12937	35.3		CUSTOMER STATES THE ESC LIGHT COMES ON ON IT'S OWN. WHILE DRIVING.	PULLED VEHICLE IN HOOKED UP THE HI SCAN PULLED CODES FOUND C-1513- "BRAKE SWITCH" NECESSARY TO REPLACE	-SOP- PART ON ORDER...
KM8JN12DX6U	7/16/05	10024	36.34	C1513	C/S HAS TO JUMP START CAR	N01	BATTERY ASSY RE
KM8JN12DX6U	7/16/05	10024	36.34	C1513	C/S ESE LIGHT KEEPS COMING ON	N69	SWITCH ASSY-STOP LAMP RE
KM8JN12D15U	5/26/05	11811	38.3		C/S CAR CUT OUT WHILE DRIVING	15	THROTTLE POSITION SENSOR ASSY RE
KM8JN12D15U	5/26/05	11811	38.3		C/S CAR CUT OUT WHILE DRIVING	15	STOP LAMP SWITCH ASSY RE
KM8JN12D26U	9/13/05	5519	59.3		CUSTOMER STATES TPS LIGHT COMES ON--THE ESC LIGHT COMES ON--AND THE WARNING LIGHT NEXT TO THE TPS LIGHT COMES ON-- REPORT.	DTC C1513 "BRAKE SWITCH OPEN"	PERFORMED INSPECTION AND PULLED DTC C1513. REPLACED THE BRAKE SWITCH. CLEARED DTC. AND RECHECKED.
KM8JM12B96U	7/12/05	13452	59.3	ESC LIGHT ON. DTC C1513 -NO ON OFF INPUT FOUND WHEN PUSH ON BRAKE PEDAL.RPLCD BRAKE SWITCH.	CUSTOMER STATES THE ESC LIGHT COMES ON AND GOES OFF ON IT' OWN	FOUND THE BRAKE SWITCH HAD NO ON & OFF INPUT WHEN THE BRAKE PEDAL IS PUSHED.	INSTALLED A NEW BRAKE SWITCH TESTED & CHECKED.
KM8JN12D15U	4/25/05	17612	33.34		CUSTOMER STATES THE ENGINE LIGHT IS ON--REPORT. CURRENTLY THE LIGHT WENT OFF ON THE WAY HERE.	PO130 O2 SENSOR MALFUNCTION CIRCUIT MALFUNCTION BANK1 SENSOR1	TECH PERFORMED INSPECTION HOOKED UP THE HISCAN TOOL PULLED CODE PO130 O2 SENSOR BANK1 SENSOR1 MALFUNCTION, TECH REPLACED THE O2 SENSOR AND TESTED OPERATING AS DESIGNED.
KM8JN12D15U	5/26/05	23225	36.66	ESP LIGHT COMES ON, FOUND SHORTED STOP LAMP SWITCH	C/S ESP LIGHT COMES ON SOP IN	N94	SWITCH ASSY-STOP LAMP RE
KM8JN12D15U	5/26/05	23225	36.66	ESP LIGHT COMES ON, FOUND SHORTED STOP LAMP SWITCH	C/S HORN DOSE NOT WORK ALL THE TIME	N94	HORN ASSY (LH) RE
KM8JN12D06U	7/12/05	16263	36.66	ESC OFF LIGHT ON, C1513	C/S ESE OFF LIGHT IS ON AND WILL NOT GO OFF	N94	SWITCH ASSY-STOP LAMP RE
KM8JN12D15U	4/25/05	17612	33.34		CUSTOMER STATES THE ESP LIGHT WILL COME ON AND GO OFF BY ITSELF.	BRAKE LAMP SWITCH INTERMITTENT SHORT	TECH PERFORMED INSPECTION HOOKED UP THE HISCAN TOOL FOUND THE BRAKE LAMP SWITCH FATIGUED. TECH REPLACED THE BRAKE LAMP SWITCH AND TESTED OPERATING AS DESIGNED.
KM8JN12D15U	4/25/05	17612	33.34		079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	CAMPAIGN	TECH REPLACED COVER MODULE AS PER CAMPAIGN.
KM8JN12D15U	4/25/05	17612	33.34		CUSTOMER STATES THE A/C WILL KICK ON AND OFF BY ITSELF.	NO PROBLEM FOUND	TECH TESTED OPERATIONS FOUND A/C FUNCTIONS ARE OPERATING AS DESIGNED.
KM8JN12D16U	9/29/05	7354	38.3		C/S CHECK ENGINE LIGHT CAME ON AND CAR WAS JERKING AND ECS LIGHT WAS COMING IN AND OUT	06	THROTTLE POSITION SENSOR ASSY RE
KM8JN12D16U	9/29/05	7354	38.3		C/S CHECK ENGINE LIGHT CAME ON AND CAR WAS JERKING AND ECS LIGHT WAS COMING IN AND OUT	06	THROTTLE POSITION SENSOR ADD SCAN TOOL OPERATION
KM8JN12D16U	9/29/05	7354	38.3		C/S CHECK ENGINE LIGHT CAME ON AND CAR WAS JERKING AND ECS LIGHT WAS COMING IN AND OUT	06	STOP LAMP SWITCH ASSY RE
KM8JN72D36U	7/27/05	18195	36.34		RADIO INOP	N68	FUSE-BLADE RE
KM8JN72D86U	8/22/05	24298	37.24		C/S ESC WARNING LITE ON	BRAKE LAMP SWITCH FAILING	REPLACE BRAKE LAMP SWITCH AS REQUIRED, RE-TEST-OK.
KM8JN72D45U	5/31/05	19742	37.24		UPON ROAD TEST FOUND BRAKE LAMPS NOT WORKING	BRAKE SWITCH FAILED	REPLACE STOP LAMP SWITCH AS REQUIRED, RE-TEST-ALL OPERATING NORMAL.
KM8JN72D45U	5/31/05	19742	37.24		CUSTOMER STATES THAT THE CHECK ENGINE LIGHT CAME ON. STUMBLE FELT AT TIMES AT 2000-2500 R/P/M.	ROAD TEST VEHICLE-VERIFIED CONDITION, PERFORM SYSTEM TEST- FOUND MALFUNCTION P0700 AND P0734-4TH. GEAR INCORRECT RATIO	FOUND FLUID TO LEVEL, REPLACE TRANSMISSION AS AUTHORIZED BY D/P/S/M, FLUSH COOLER, TOP OFF FLUID TO LEVEL AND RE-TEST-OK.
KM8JN72D36U	7/27/05	18195	36.34		BRAKE LIGHTS INOP	N94	SWITCH ASSY-STOP LAMP RE
KM8JN12D96U	9/27/05	9882	38.3	C1513, ADJUSTING SWITCH TO PROPER DISTANCE AND LIGHT STILL COMES ON	C/S ESC LIGHTS GOES ON STAYS ON WHILE DRIVING	15	SWITCH ASSY-STOP LAMP RE
KM8JM12B26U	8/29/05	17143	36.34		C/S TAIL LIGHT STAY ON CAUSING VEHICLE TO HAVE TO BE JUMPED	N94	SWITCH ASSY-STOP LAMP RE
KM8JM12B26U	7/23/05	18000	36.49	ESC LIGHT ON. REPLACED STOP LAMP SWITCH. NOW OK.			
KM8JN12D06U	12/27/05	31521	36.81	NEC TO SCAN TEST TO LOCATE CAUSE OF BRAKE WARNING LIGHT ON			

KM8JN12D36U	12/05/05	14835	34.84	ESC LIGHT COMES ON INTERMITTENTLY AND STAYS ON. FOUND CODE B1513. FOUND BRAKE LIGHT SWITCH HAS INTERMITTENT OPEN. REPLACED SWITCH	CUSTOMER STATES ESC LIGHT COMES ON INTERMITTENTLY AND STAYS ON.	TECH RAN DIAGNOSTIC TEST AND FOUND BRAKE LIGHT SWITCH MALFUNCTIONING. NEEDS SWITCH REPLACEMENT AND RECHECK SYSTEM.	REPLACED BRAKE LIGHT SWITCH AND TEST DROVE VEHICLE. VEHICLE OPERATING AT MANUFACTURERS SPECIFICATIONS.
KM8JN12D26U	9/27/05	32965	36.66	ESC OFF LIGHT, C1513	C/S "ESC OFF" LIGHT CAME ON. CHECK AND ADVISE	N94	SWITCH ASSY-STOP LAMP RE
KM8JN12D56U	7/18/05	12785	38.3		C/S ESC BUTTON STICKS	15	STOP LAMP SWITCH ASSY RE
KM8JM12BX6U	7/09/05	22964	36.34	BRAKE LIGHTS KEEP BLOWING FUSES, ESC LIGHT ON, CODE C1513	C/S BRAKE LIGHTS KEEP BLOWING FUSES CHECK AND ADVISE	N94	SWITCH ASSY-STOP LAMP RE
KM8JN12D56U	8/17/05	23417	36.66		C/S ESC LIGHT GOES ON AND OFF	94	SWITCH ASSY-STOP LAMP RE
KM8JN12D36U	12/05/05	14835	34.84	ESC LIGHT COMES ON INTERMITTENTLY AND STAYS ON. FOUND CODE B1513. FOUND BRAKE LIGHT SWITCH HAS INTERMITTENT OPEN. REPLACED SWITCH	CUSTOMER STATES ALL LIGHTS ON DASH FLICKER AT ALL TIMES.	TECH FOUND POSITIVE BATTERY CABLE TERMINAL STRIPPED CAUSING LOOSE CONNECTION WHICH IS CAUSING LIGHTS TO FLICKER.	REPLACED TERMINAL.
KM8JM12B86U	7/13/05	10545	34.84		CUSTOMER STATES ESC LIGHT COMES ON INTERMITTENTLY.	TECH RAN DIAGNOSTIC TEST AND FOUND BRAKE LAMP SWITCH MALFUNCTIONING.	REPLACED BRAKE LAMP SWITCH.
KM8JN72D46U	12/10/05	16547	24.6		CUSTOMER STATES ESC LIGHT IS ON, CHECK AND ADVISE.	CODE: C1513-BRAKE LIGHT SWITCH	TECH FOUND THAT BRAKE LIGHT SWITCH IS SETTING LIGHT TO COME ON. TECH REMOVED AND REPLACED BRAKE LIGHT SWITCH. OP#93810R00= 3 N68 C05
KM8JN12D36U	8/31/05	15789	27	C1513 - STOP LAMP SWITCH OUT OF ADJUSTMENT CAUSING ECS LIGHT TO COME ON AND OFF	ECS LIGHT COMES ON AND OFF, CHECK AND ADVISE	40	SWITCH ASSY-STOP LAMP RE
KM8JM12B36U	10/05/05	19137	36.66		RECALL 079 DRIVERS AIR BAG MODUAL REPL 07-01-001	CPN	DRIVER AIR BAG MODULE REPLACEMENT (079 07-01-001)
KM8JM12B36U	10/05/05	19137	36.66		C/S ESE OFF LIGHT IS COMING OFF AND ON	N69	SWITCH ASSY-STOP LAMP RE
KM8JN72D46U	12/10/05	9714	33.94		CUSTOMER STATES ESP LIGHT IS ON FOR ESC OFF	BRAKE LIGHT SWITCH INTERNAL FAILURE CAUSING ESC/ESC LIGHT TO COME ON	REPLACED BRAKE LIGHT SWITCH TO CORRECT 93810R00 N94 C15
KM8JN12D75U	3/07/05	15250	32.55		CUSTOMER STATES BATTERY WILL NOT HOLD CHARGE.	BRAKE LAMP SWITCH	TECH FOUND BRAKE LAMP SWITCH CODE C1513. TECH REMOVED AND REPLACED BRAKE LAMP SWITCH. OP#93810R00= 3=BRAKE LAMP SWITCH, N68, C15.
KM8JN12D96U	9/27/05	20138	36.66	ESC LIGHT ON, C1513	C/S ESC LIGHT ON	69	SWITCH ASSY-STOP LAMP RE
KM8JN12D16U	8/25/05	9878	32.46	INSPECTED SENSOR ON BRAKE MASTER CYLINDER, REMOVE CONNECTOR AND CLEAN, CHK OK. CLEAR CODES AND VERIFY REPAIR, CHK OK			
KM8JM12B05U	5/04/05	24668	34.1		CUST STATES ALL BRAKELIGHTS ARE INOP	INTERNAL ELCT FAULT IN BRAKE LAMP SWITCH	VERIFY, CHECK CODES, NONE FOUND, CHK BULBS, CHK OK, INSPECT PEDAL TO SWITCH CONTACT, CHK OK, TEST BRAKE SWITCH, REPLACE BRAKE LAMP SWITCH
KM8JN12D75U	3/07/05	15250	32.55		CUSTOMER STATES VEHICLE WILL NOT START, TOWED IN, CHECK AND ADVISE.	BRAKE SWITCH SHORT DRAINING BATTERY VOLTAGE.	TECH FOUND BATTERY CCA IS LOW, AT 332 CCA. WARRANTY CODE: 44RKQ-0QMJ8, FOUND BRAKE LAMP SWITCH SHORT CODE C1513. TECH REMOVED AND REPLACED BRAKE LAMP SWITCH. OP#93810R00= 3= BRAKE SWITCH, N68, C15. OP#37110R00= 3=BATTERY, N61, C99.
KM8JN12D05U	4/25/05	46197	34.26	CUSTOMER STATES ESP LIGHT IS ON. TECH FOUND STEERING WHEEL SENSOR TO HAVE INTERNAL SHORT. TECH REMOVED AND REPLACED STEERING WHEEL SENSOR.	UPON TECHNICIAN INSPECTION OF VEHICLE FOUND BRAKE SWITCH TO HAVE INTERNAL SHORT, CHECK AND ADVISE.	TECH FOUND BRAKE SWITCH TO HAVE INTERNAL SHORT.	TECH REMOVED AND REPLACED BRAKE SWITCH PN93810-3K000, OP#93810R00 3, N94 C15. ALL OKAY AT THIS TIME.
KM8JN12D05U	4/25/05	46197	34.26	CUSTOMER STATES ESP LIGHT IS ON. TECH FOUND STEERING WHEEL SENSOR TO HAVE INTERNAL SHORT. TECH REMOVED AND REPLACED STEERING WHEEL SENSOR.	CUSTOMER STATES THE ESP LIGHT IS ON, CHECK AND ADVISE. SOP IS IN.	TECH FOUND STEERING WHEEL SENSOR TO HAVE INTERNAL SHORT	TECH REMOVED AND REPLACED STEERING WHEEL SENSOR, CLEARED CODES AND TEST DROVE TO CONFIRM REPAIR. PN93480-2E100 OP#93480R00.6 N69 C15
KM8JN12D76U	7/23/05	22584	34.1		CUST STATES ESC LIGHT ON DASH, AND CAR HAS NO BRAKE LIGHTS	INTERNAL ELCT FAULT IN BRAKE LIGHT SWITCH	VERIFY CUST CONCERN, CHECK CODES, FOUND BRAK LIGHT SWITCH NOT SENDING SIGNAL, REPLACE BRAKE LIGHT SWITCH AND VERIFY
KM8JN12D76U	11/11/05	17006	35.14		079 CAMPAIGN-DRIVER AIRBAG COVER MOD REPL (07-01-001)	OPEN CAMP 079	079-DRIVER AIR BAG COVER MODULE REPLACEMENT 079-DRIVER AIR BAG COVER MODULE REPLACEMENT
KM8JN12D76U	11/11/05	17006	35.14		THE CUSTOMER STATES THAT THE ESC LAMO COMES ON WHILE DRIVING, INTERMITTENTLY.	CODE C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D95U	5/16/05	27853	37.89		CUSTOMER STATES ESC LIGHT IS ON		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D65U	5/23/05	37752	34.26	CUSTOMER STATES ESP LIGHT COMES ON. TECH FOUND CODE FOR BRAKE SWITCH MALFUNCTION. TECH REMOVED AND REPLACED BRAKE SWITCH	CUSTOMER REQUEST CAMPAIGN 079 PERFORMED.	RECALL	TECH PERFORMED CAMPAIGN 079, DRIVERS AIRBAG MODULE REPLACEMENT, OP#61B046R0
KM8JN72D65U	5/23/05	37752	34.26	CUSTOMER STATES ESP LIGHT COMES ON. TECH FOUND CODE FOR BRAKE SWITCH MALFUNCTION. TECH REMOVED AND REPLACED BRAKE SWITCH	CUSTOMER STATES ESP LIGHT COMES ON, CHECK AND ADVISE.	CODE: B1513-BRAKE SWITCH MALFUNTION	TECH REMOVED AND REPLACED BRAKE SWITCH, CHECKED OPERATION, ALL OKAY AT THIS TIME. OP#93810R00 N68 C05
KM8JN12D35U	6/03/05	8562	37.1	8562 REPLACE BREKE LAM SWCHIT FOR CODE	CUST.STATES ESP OFF LIGHT IS ON/PART IN	E	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 8562 REPLACE BREKE LAM SWCHIT FOR CODE

KM8JN12D76U	10/08/05	11397	37.1		THE CUSTOMER STATES THAT THE ETS LAMP STAYS ON. INSTALL SPECIAL ORDER PART.	OPEN/SHORT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACE BRAKE LAMP SWITCH ASSEMBLY
KM8JN12D16U	10/13/05	18167	36.34		CUSTOMER STATES A/C IS NOT COOLING-INSTALL SPECIAL ORDER PART	LEAK COMING FROM SEAL	EVACUATE AND CHARGE-AIR CONDITIONING-ADJUSTMENT EVACUATE AND CHARGE-AIR CONDITIONING-ADJUSTMENT
KM8JN12D66U	9/23/05	18166	31.86		CUSTOMER STATES ESC LIGHT IS ON	C1513 CODE PRESENT BRAKE LAMP SWITCH FAILED	REPLACED BRAKE LAMP SWITCH 32002A00 .2 N69/C15
KM8JN12D56U	12/16/05	14317	34.56		CUSTOMER STATES CRUIS WILL NOT SET	INSPECTED, TRACED TO BROKEN BRAKE SWITCH	REPLACED BRAKE SWITCH TESTED TO VERIFY CORRECTION 93810R00 .0.3 N94 C06
KM8JN12D46U	10/27/05	9088	31.54	ESC LAMP COMES ON IF NOT PUT IN GEAR RIGHT AWAY AFTER ACCELERATION. C1513 BRAKE LAMP SWITCH FAILURE. REPLACED BRAKE LAMP SWITCH.	CUSTOMER STATES RADIO HAS BUTTONS NOT WORKING	NO PROBLEM FOUND	ALL RADIO BUTTONS WORKING AT THIS TIME
KM8JN12D16U	10/13/05	18167	36.34		CUSTOMER STATES ESC LIGHT COMES ON-INSTALL SPECIAL ORDER PART	SWITCH HAS AN OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D16U	10/13/05	18167	36.34		CUSTOMER STATES A/C IS NOT COOLING-INSTALL SPECIAL ORDER PART	LEAK COMING FROM SEAL	HOSE AND/OR RING "O"-SUCTION (**) RE HOSE AND/OR RING "O"-SUCTION (**) RE
KM8JN12DX6U	9/14/05	17458	36.34		079 CAMPAIGN-DRIVER AIRBAG COVER MOD REPL (07-01-001)	OPEN CAMP 079	079-DRIVER AIR BAG COVER MODULE REPLACEMENT 079-DRIVER AIR BAG COVER MODULE REPLACEMENT
KM8JN12D46U	10/27/05	9088	31.54	ESC LAMP COMES ON IF NOT PUT IN GEAR RIGHT AWAY AFTER ACCELERATION. C1513 BRAKE LAMP SWITCH FAILURE. REPLACED BRAKE LAMP SWITCH.	CUSTOMER STATES ESC LAMP COMES ON IF NOT PUT IN GEAR RIGHT AWAY. AFFECTS ACCELERATION	C1513 BRAKE LAMP SWITCH FAILURE	REPLACED BRAKE LAMP SWITCH 93810R00 .3 N94/C15
KM8JN12D46U	10/27/05	9088	31.54	ESC LAMP COMES ON IF NOT PUT IN GEAR RIGHT AWAY AFTER ACCELERATION. C1513 BRAKE LAMP SWITCH FAILURE. REPLACED BRAKE LAMP SWITCH.	CUSTOMER STATES HAS RECALL 079	SAFTEY ISSUE	ORDERED PARTS FOR 079 RECALL
KM8JN72D26U	12/28/05	8995	34.56	REPLACE BRAKE LIGHT SWITCH 93810R00 .3/N94/C15	CUSTOMER STATES ESC OFF LIGHT STAYS ON SOMETIMES	C1513BRAKE LIGHT CIRCUIT FAILURE	REPLACE BRAKE LIGHT SWITCH 93810R00 .3/N94/C15
KM8JN12DX6U	9/14/05	17458	36.34		CUSTOMER STATES ESC LIGHT STAYS ON AND COMES OFF INTERMITTENT	C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D85U	5/21/05	22543	36.34				
KM8JM12B76U	9/13/05	10221	36.34	REPLACE THE STOP LAMP SWITCH.	079 CAMPAIGN-DRIVER AIRBAG COVER MOD REPL (07-01-001)	RECALL COMPLETE.	079-DRIVER AIR BAG COVER MODULE REPLACEMENT 079-DRIVER AIR BAG COVER MODULE REPLACEMENT REPLACE THE DRIVER AIR BAG COVER.
KM8JM12B75U	7/08/05	12115	35.14		EVERY TIME SHE COMES TO A STOP THE ESP LIGHT COMES ON SHE	DTC #C1513 ,INTERMITTENT OPEN IN SWITCH CONTACTS	SCANNED SYSTEM FOR DTC'S C1513 BRAKE LAMP SWITCH-MALF REPLACED BRAKE LAMP SWITCH & RETESTED-OK
KM8JN12D55U	3/03/05	11308	34.03		C/S THAT CRUISE CONTROL IS INTERMITTENTLY INOPERATIVE. - SOP HERE-	NC N94 CC C98 WARR PART #93810-38110 AND 96450-2D200	DIA AND REPLACED BRAKE LAMP SWITCH ROAD TEST AFTER REPAIRS AND FOUND CRUISE SWITCH STICKING AT TIME AND INOP AT TIMES REPLACED CRUISE SWITCH AND ROAD TEST AGAIN AND RETEST ALL OK AT THIS TIME
KM8JN72D66U	12/27/05	9014	35.46		C/S THAT ESC LAMP INTERMITTENTLY COME ON/OFF	NC N69 CC C98 WARR PART # 39810-3K000	PERFORMED ABS DIA CODE C1513 BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH CLEAR CODE AND RETEST
KM8JM12B76U	9/13/05	10221	36.34	REPLACE THE STOP LAMP SWITCH.	CUSTOMER STATES ESC LIGHT COMES ON FREQUENTLY	STOP LAMP SWITCH OPEN INTERMITTENTLY.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACE THE STOP LAMP SWITCH.
KM8JN12D85U	12/09/04	35788	34.95		CUSTOMER STATES ESC LIGHT IS ON	REPLACED BRAKE LAMP SWITCH PINTLE STICKS CLOSED.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D46U	7/29/05	29676	36.66		079 CAMPAIGN-DRIVER AIRBAG COVER MOD REPL (07-01-001)	PERFORMED RECALL	079-DRIVER AIR BAG COVER MODULE REPLACEMENT 079-DRIVER AIR BAG COVER MODULE REPLACEMENT
KM8JN12DX7U	11/14/06	3073	160	LOSING POWER TO ESC UNIT. BACK PROBED CONNECTOR TO ESC MODULE - TEST DROVE - NO POWER WHEN APPLYING. BRAKE LIGHT COME ON AND STAYS ON UNTIL L CYCLE KEY. BACK PROBE CONNECTOR IN KICK PANEL STILL LOSING POWER. BACK PROBE CONNECTOR AT BRAKE LAMP IN JOINT CON	C/STS THE ESC LIGHT IS BACK ON		SEE STORY BELOW REPAIRED WIRING CONNECTION LOSING POWER TO ESC UNIT. BACK PROBEDCONNECTOR TO ESC MODULE - TEST DROVE - NOPOWER WHEN APPLYING. BRAKE LIGHT COME ON ANDSTAYS ON UNTIL L CYCLE KEY. BACK PROBECONNECTOR IN KICK PANEL STILL LOSING POWER.BACK PROBE
KM8JM12BX5U	5/20/05	21386	38.44	21386 ESP LIGHT ON VERIFIED ESP LIGHT ON,SCANNED VEHICLE AND FOUND BRAKE LAMP SWITCH TO BE INTERNALLY DAMAGED. NOT READING SIGNAL INTERMITTENTLY, REPLACED BRAKE LAMP SWITCH UNDER WARRENTY FINE AFTER REPAIR.			
KM8JN12D46U	7/29/05	29676	36.66		CUSTOMER STATES THE BRAKE LIGHTS ARE NOT WORKING.	BRAKE LIGHTS NOT WORKING. CODE C1513 ALSO STORED.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D76U	4/14/06	17511	36.34		CUSTOMER STATES ESC LIGHT COMES ON AND OFF	CODE C1513-BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D76U	4/13/06	17081	36.66		CUSTOMER STATES THE ESC WARNING LIGHT CAME ON	ESC WARNING LIGHT COMES ON	TENSIONER ASSY-DRIVE BELTRE TENSIONER ASSY-DRIVE BELTRE

KM8JN72DX6U	7/16/05	13663	38.44	13663 VERIFY CUST. CONCERN FOUND BRAKE LAMPS NOT WORKING FOUND ESC LIGHT ON IN DASH. PERFORMED SCAN FOUND CODE C1513 BRAKE LAMP SWITCH. FOUND SWITCH INTERNAL FAILURE CAUSING CODE AND BRAKE LIGHTS NOT TO WORK, REPLACE SWITCH, CLEARED CODE FOUND LIGHTS OPER			
KM8JM12B26U	7/14/05	10374	38.3	SCANNED CAR FOUND CODE C1513 FOUND BRAKE LAMP S WITCH TO BE INOP REPLACED BRAKE LAMP SWITCH NOW ESC LIGHT IS OFF			
KM8JN12D46U	11/25/05	3446	38.3	VERIFIED ESC LIGHT ON FOUND BRAKE LAMP SWITCH T O BE MALFUNCTIONED SCANNED FOUND CODE C1513 BRA KE LAMP SWITCH MAL REPLACED SWITCH AND CLEARED CODE TEST DROVE 5 MILES AFTER REPAIR			
KM8JN12D76U	4/13/06	17081	36.66		079 CAMPAIGN-DRIVER AIRBAG COVER MOD REPL (07-01-001)	OUTSTANDING RECALL NOTICE	079-DRIVER AIR BAG COVER MODULE REPLACEMENT 079-DRIVER AIR BAG COVER MODULE REPLACEMENT
KM8JN12D76U	4/13/06	17081	36.66		CUSTOMER STATES THE VEHICLE MAKES AROARING SOUND UPON ACCELERATION	THE ENGINE MADE A ROARING NOISE	REPLACED BELT TENSIONER AND IDLER PULLEY ENTER REPAIR DESC.
KM8JN12D86U	2/24/06	15447	36.66		079 CAMPAIGN-DRIVER AIRBAG COVER MOD REPL (07-01-001)	RECALL 079	079-DRIVER AIR BAG COVER MODULE REPLACEMENT 079-DRIVER AIR BAG COVER MODULE REPLACEMENT
KM8JM12B65U	5/20/05	40085	38.76	40085 VERIFY CONCERN PERFORMED SCAN FOUND CODE C1513, FOUND BRAKE LIGHTS NOT WORKING. BRAKE SWITCH INTERNAL FAILURE. REPLACE SWITCH CLEARED CODE FOUND BRAKE LIGHTS WORKING AT THIS TIME.			
KM8JN12D56U	8/16/05	20800	36.8		CUSTOMER STATES: HE SAYS THE ESC LIGHT IS COMING	BRAKE SWITCH	REPLACED SWITCH
KM8JN12D56U	8/16/05	20800	36.8		CUSTOMER STATES: THAT HE RADIO HAS STATIC	REMOVED RADIO AND REGROUNDED	NO PROBLEM FOUND
KM8JN12D86U	2/24/06	15447	36.66		CUSTOMER STATES THE ABS AND ESC WARNING LIGHTS COME ON	THE ABS AND ESC LIGHT COMES ON.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D76U	8/12/05	26209	32.07				
KM8JN72D86U	1/25/06	20418	32.07		C/S ESC OFF INDICATOR LIGHT COMES ON SOMETIMES. CHECK AND ADVISE.	TECHNICIAN PULLED CODE C1513 BRAKE LAMP SWITCH FAILURE TECHNICIAN FOUND BRAKE LAMP SWITCH HAS INTERNAL SHORT- NEEDSREPLACED.	TECHNICIAN REPLACED BRAKE LAMP SWITCH AS NEEDED. 93810R00 N-69 C-15 .3
KM8JN12D56U	8/16/05	20800	36.8		CUSTOMER STATES: HIS KEY FOB ISNT WORKING THE DOORS		REPROGRAMMED KEY FOBS
KM8JM12B06U	7/12/05	20	36.8		CUSTOMER STATES: THE ESP LAMP IS ON	CODE# P1501	REPLACED BRAKE PETAL SWITCH
KM8JN12D55U	1/03/05	821	30	15			
KM8JN72D86U	7/26/05	23126	31.26		CUSTOMER STATES THE ESC LIGHT COMESON	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D36U	7/29/05	16121	27.8		ELECTRICAL CUSTOMER STATES ESC LIGHT IS COMING ON AND OFF INSTALL SOP EB	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16125 CUSTOMER STATES ESC LIGHTS COMES ON ANDOFF SCANNED FOR DTCS. C1513 BRAKE LAMP SWITCH. FOLLOW CHART IN SHOP MANUAL AND FOUND BRAKE LAMP SWITCH TO BE AT FAULT. REPLACED THE BRAKE LAMP SWITCH. CLEARED CO
KM8JN72D36U	7/29/05	31721	31.56	BRAKE LAMP SWITCH SCANNED FOR CODES, B1513 BRAKE LAMP SWITCH. CHECKED SWITCH ADJUSTMENT AND BRAKE LAMP BULBS, OK. REPLACED SWITCH AND CLEARED DTC	CUST STATES ESC OFF LIGHT COMES ON,INSTALL SOP	BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 31721 BRAKE LAMP SWITCH SCANNED FOR CODES,B1513 BRAKE LAMP SWITCH. CHECKED SWITCHADJUSTMENT AND BRAKE LAMP BULBS, OK. REPLACEDSWITCH AND CLEARED DTC
KM8JN72D36U	7/29/05	31721	31.56	BRAKE LAMP SWITCH SCANNED FOR CODES, B1513 BRAKE LAMP SWITCH. CHECKED SWITCH ADJUSTMENT AND BRAKE LAMP BULBS, OK. REPLACED SWITCH AND CLEARED DTC	CUST STATES ESC OFF LIGHT COMES ON,INSTALL SOP	BRAKE LAMP SWITCH	SWITCH ASSY-OVERDRIVE ADDSCAN TOOL OPERATION SWITCH ASSY-OVERDRIVE ADDSCAN TOOL OPERATION 31721 BRAKE LAMP SWITCH SCANNED FOR CODES,B1513 BRAKE LAMP SWITCH. CHECKED SWITCHADJUSTMENT AND BRAKE LAMP BULBS, OK. REPLACEDSWITCH AND CLEARED DTC
KM8JN12D45U	4/18/05	24457	38.3		CUSTOMER STATES INTERMITTENT ESP WARNING LIGHT	FOUND DEFECTIVE BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITC
KM8JM72BX6U	1/09/06	1635	38.3		CUSTOMER STATES CRUISE CONTROL WILL NOT ENGAGE. SPECIAL ORDER PART HERE.	OPEN CIRCUIT IN BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN72D46U	12/13/05	137	38.3		REPORTED INOP BRAKE LIGHTS DURING SALES ROAD TEST.	FOUND DEFECTIVE BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN72D16U	7/26/05	19972	35.74	P1514 BRAKE LIGHT FAULT FOR ESC LAMP COMING ON AND OFF.			

KM8JN72D06U	8/11/05	40359	31.56	C/S ESC OFF LIGHT COMES ON WHILE DRIVING SCANNED FOR DTCS. C1513 BRAKE LAMP SWITCH. FOUND SWITCH TO BE ADJUSTED PROPERLY. REPLACED BRAKE LAMP SWITCH. CLEARED CODE. TEST DROVE VEHICLE. ESC OFF LIGHT DID NOT COME ON.	CUST STATES CHECK ENGINE LIGHT IS ON	F	SENSOR-FUEL PRESSURE ADD SCAN TOOL OPERATION SENSOR-FUEL PRESSURE ADD SCAN TOOL OPERATION 40359 C/S CEL IS ON SCANNED FOR DTCS. P0455EVAP SYSTEM LARGE LEAK. CODE IS SET IN HISTORY. CLEARED CODE. RAN EVAP SYSTEM LEAK TEST. NO LEAKS FOUND.
KM8JM12B06U	7/22/05	10316	35.74				
KM8JN72D16U	7/22/05	16359	34.24				
KM8JN72D45U	3/18/05	26781	34.63				
KM8JN72D46U	10/21/05	14302	36.2				
KM8JN72D06U	8/11/05	40359	31.56	C/S ESC OFF LIGHT COMES ON WHILE DRIVING SCANNED FOR DTCS. C1513 BRAKE LAMP SWITCH. FOUND SWITCH TO BE ADJUSTED PROPERLY. REPLACED BRAKE LAMP SWITCH. CLEARED CODE. TEST DROVE VEHICLE. ESC OFF LIGHT DID NOT COME ON.	CUST STATES ESC OFF LIGHT COMES ON WHILE DRIVING	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 40362 C/S ESC OFF LIGHT COMES ON WHILE DRIVING SCANNED FOR DTCS. C1513 BRAKE LAMP SWITCH. FOUND SWITCH TO BE ADJUSTED PROPERLY. REPLACED BRAKE LAMP SWITCH. CLEARED CODE. TEST DROVE VEHICLE. ESC
KM8JN72D16U	10/11/05	22631	31.56	C/S ESC LIGHT GOES ON AND OFF SCANNED FOR DTCS. B1513 BRAKE LAMP SWITCH. FOUND SWITCH TO BE ADJUSTED PROPERLY. REPLACED BRAKE LAMP SWITCH. CLEARED CODE. CODE DID NOT RESET.	CUST STATES PERFORM RECALL FOR AIR BAG	F	(RECALL)REPLACE DRIVER AIR BAG MODULE (RECALL)REPLACE DRIVER AIR BAG MODULE 22631 PERFORMED CAMPAIGN 079. REPLACED DRIVER AIRBAG COVER.
KM8JN72D16U	10/11/05	22631	31.56	C/S ESC LIGHT GOES ON AND OFF SCANNED FOR DTCS. B1513 BRAKE LAMP SWITCH. FOUND SWITCH TO BE ADJUSTED PROPERLY. REPLACED BRAKE LAMP SWITCH. CLEARED CODE. CODE DID NOT RESET.	CUST STATES ESC LITE ON AND OFF INTERMITTENTLY	C/S ESC LIGHT GOES ON AND OFF	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 22631 C/S ESC LIGHT GOES ON AND OFF SCANNED FOR DTCS. B1513 BRAKE LAMP SWITCH. FOUND SWITCH TO BE ADJUSTED PROPERLY. REPLACED BRAKE LAMP SWITCH. CLEARED CODE. CODE DID NOT RESET.
KM8JN72D15U	4/25/05	26370	36.2				
KM8JN72D06U	10/16/05	22190	36.06				
KM8JN12D86U	10/14/05	29173	36.06				
KM8JN12D75U	2/28/05	27770	34.63				
KM8JN72D16U	10/11/05	22631	31.56	C/S ESC LIGHT GOES ON AND OFF SCANNED FOR DTCS. B1513 BRAKE LAMP SWITCH. FOUND SWITCH TO BE ADJUSTED PROPERLY. REPLACED BRAKE LAMP SWITCH. CLEARED CODE. CODE DID NOT RESET.	C/S THAT CLIMATE CONTROL "MODE" POSITION MALFUNCTIONS AND CENTER VENT AIR FLOW IS POOR...	C/S MODE CONTROL MALFUNCTIONS	SPECIAL PART ON ORDER. SPECIAL PART ON ORDER. 22631 C/S MODE CONTROL MALFUNCTIONS VERIFIED CONCERN. FOUND THE MODE DOOR ACTUATOR TO BE BINDING. NEED TO REPLACE MODE DOOR ACTUATOR. DO NOT HAVE IN STOCK. GAVE P&A TO ADVISOR.
KM8JN72D36U	7/19/05	29351	26.16		(RECALL)REPLACE DRIVER AIR BAG MODULE	RECALL.	(RECALL)REPLACE DRIVER AIR BAG MODULE (RECALL)REPLACE DRIVER AIR BAG MODULE 29351 RECALL. REPLACED DRIVER SIDE AIR BAG COVER AS PER
KM8JN12D06U	7/27/05	10277	36.2				
KM8JN72D46U	9/25/05	33871	36.06				
KM8JN12D15U	5/23/05	28352	31.84	C1513 BRAKE LAMP SWITCH OPEN CIRCUIT REPL	CUSTOMER STATES THE ESP LIGHT IS ON	C1513 BRAKE LAMP SWITCH BRAKE LAMP SWITCH OPEN CIRCUIT REPL SWITCH	STOP LAMP SWITCH/CLUTCH ASSY RE STOP LAMP SWITCH/CLUTCH ASSY RE
KM8JN72D36U	7/19/05	29351	26.16		CUST STATES ESC OFF LIGHT COMES ON WHILE DRIVING, OFF WHEN VEHICLE IS STARTED	ESC LIGHT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 29351 ESC LIGHT WAS UNABLE TO REPRODUCE CONCERN OF ESC LIGHT ON WHILE DRIVING - CHECKED FOR ANY SET DTC FOUND C1513 SET FOR BRAKE LAMP SWITCH MAL. ALSO FOUND C1237 SET FOR BRAKE PRESSURE SENSOR BELIVE DTC TI
KM8JN72D86U	7/15/05	27989	26.16		PERF CAMP 079--AIRBAG COVER	RECALL 079.	(RECALL)REPLACE DRIVER AIR BAG MODULE (RECALL)REPLACE DRIVER AIR BAG MODULE 27989 RECALL 079. INSTALLED AIR BAG COVER. TORQUED TO SPEC.
KM8JN72D86U	7/15/05	27989	26.16		CUST STATES "ESC OFF" LIGHT COMES ON WHEN VEHICLE IS PUT INTO GEAR	ESC LIGHT IS ON	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 27991 ESC LIGHT IS ON CODE C1513 BRAKE LIGHT SWITCH. REPLACED SWITCH. SET ADJUSTMENT. TESTED OPERATION. PERFORMED AS DESIGNED.
KM8JN72D06U	10/04/05	17815	34.56		CUSTOMER STATES THE BRAKE LITES WILL NOT WORK, CHECK ADVISE	FOUND BRAKE LIGHT SWITCH CIRCUIT OPEN INTERMITTENTLY CAUSING BRAKE LIGHTS TO BE INOPERATIVE	REPLACED BRAKE LIGHT SWITCH EVERYTHING OK NOW
KM8JN72D06U	10/04/05	17815	34.56		RECALL 079	CONFIRMED RECALL 079	REPLACED AIR BAG IN STEERING WHEEL PER INSTRUCTIONS IN THE RECALL 079 NOTICE EVERYTHING OK NOW
KM8JN12D16U	10/06/05	16311	34.24		CUSTOMER STATES ESC OFF LIGHT IS DISPLAYED AND CAN NOT CONTROL ESC	FOUND BRAKE LIGHT SWITCH SHORTED OPEN CAUSING NO BRAKE LIGHTS AND ESC OFF LIGHT TO COME ON	REPLACED BRAKE LIGHT SWITCH AND FOUND ESC OFF SWITCH WORKING AS DESIGNED AND BRAKE LIGHTS WORKING AS DESIGNED
KM8JN72D95U	11/23/04	1138	27.57				

KM8JN72D26U	7/29/05	50901	31.56	ESC LIGHT IS ON. CODE C1513 BRAKE LIGHT SWITCH CODE SET. REPLACED SWITCH AND SET CLEARANCE. CLEARED DTC. LIGHT DID NOT RESET.	(RECALL) REPLACE DRIVER AIR BAG MODULE	F	(RECALL) REPLACE DRIVER AIR BAG MODULE (RECALL) REPLACE DRIVER AIR BAG MODULE 50902 RECALL 079. INSTALLED D/S AIRBAG COVER AND TORQUED TO SPEC.
KM8JN72D26U	7/29/05	50901	31.56	ESC LIGHT IS ON. CODE C1513 BRAKE LIGHT SWITCH CODE SET. REPLACED SWITCH AND SET CLEARANCE. CLEARED DTC. LIGHT DID NOT RESET.	PENNSYLVANIA STATE INSPECTION.	F	BUSHING-CROSSMEMBER MOUNTING (ALL, 4WD) RE BUSHING-CROSSMEMBER MOUNTING (ALL, 4WD) RE 50903 STATE INSPECTION. LF 4/B RR 5/B TIRES 4/32 DURING INSPECTION FOUND THE FRONTSUBFRAME BUSHING LOCATED IN R/R POSITION BLOWN OUT. R&R BUSHING TO ISSUE
KM8JN12D16U	10/06/05	16311	34.24		CUSTOMER REQUESTS RECALL 079, DRIVERS SIDE AIRBAG COVER	PERFORMED RECALL 079, REPLACED DRIVERS SIDE AIRBAG COVER	RECALL 079, DRIVERS SIDE AIRBAG COVER IS COMPLETED
KM8JM12B15U	4/21/05	14425	30.04	14425 CHECK ALL FUSES, RELAY, AND HARNESS FOR BAD CONNECTION. STOP LIGHT SWITCH HAD OPEN/SHORT. INSTALLED NEW STOP LIGHT SWITCH, GOOD AFTER REPAIR. PART # 93810-3K000	CUSTOMER STATES AIRBAG COVER MOD REPL	.	CAMPAIGN 79 DRIVERS AIRBAG COVER MOD. REPLACE CAMPAIGN 79 DRIVERS AIRBAG COVER MOD. REPLACE 14425 61B046R0 0.2 COMPLETED 079 RECALL. OPCODE 61B046R0 0.2
KM8JM12B15U	4/21/05	14425	30.04	14425 CHECK ALL FUSES, RELAY, AND HARNESS FOR BAD CONNECTION. STOP LIGHT SWITCH HAD OPEN/SHORT. INSTALLED NEW STOP LIGHT SWITCH, GOOD AFTER REPAIR. PART # 93810-3K000	CUSTOMER STATES THE ESP LIGHT WILL NOT GO OFF.	STOP LIGHT SWITCH HAD OPEN/SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 14425 CHECK ALL FUSES, RELAY, AND HARNESS FOR BAD CONNECTION. STOP LIGHT SWITCH HAD OPEN/SHORT. INSTALLED NEW STOP LIGHT SWITCH, GOOD AFTER REPAIR. PART # 93810-3K000
KM8JN72D26U	7/29/05	50901	31.56	ESC LIGHT IS ON. CODE C1513 BRAKE LIGHT SWITCH CODE SET. REPLACED SWITCH AND SET CLEARANCE. CLEARED DTC. LIGHT DID NOT RESET.	CUST STATES "ESC OFF" LIGHT COMES ON WHILE DRIVING	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 50902 ESC LIGHT IS ON. CODE C1513 BRAKE LIGHT SWITCH CODE SET. REPLACED SWITCH AND SET CLEARANCE. CLEARED DTC. LIGHT DID NOT RESET.
KM8JN72D56U	7/28/05	18370	26.16		CUST STATES ESC LIGHT COMES ON WHILE DRIVING	BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 18370 BRAKE LAMP SWITCH SCANNED VEHICLE FOR STORED CODES, FOUND CODE B1353 BRAKE LAMP SWITCH. CHECKED SWITCH ADJUSTMENT, OK. REPLACED SWITCH AND CLEARED DTC
KM8JM12B15U	4/21/05	21990	22.8	21990 C1513 BRAKE SWITCH CIRCUIT. CLEARED CODES. CURRENT DATA IS NORMAL. WIRING HARNESS IS NORMAL. NO PROBLEM FOUND. PROBLEM IS INTERMITTENT. NEED TO HAVE PROBLEM PRESENT SO WE CAN FIX THE PROBLEM. NO PROBLEM AT THIS TIME.	CUSTOMER STATES ESP LIGHT HAS BEEN ON AGAIN BUT WENT OFF TODAY	C1513 BRAKE SWITCH CIRCUIT. CLEARED CODES. CURRENT DATA IS NORMAL. WIRING HARNESS IS NORMAL. NO PROBLEM FOUND	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21990 C1513 BRAKE SWITCH CIRCUIT. CLEARED CODES. CURRENT DATA IS NORMAL. WIRING HARNESS IS NORMAL. NO PROBLEM FOUND. PROBLEM IS INTERMITTENT. NEED TO HAVE PROBLEM PRESENT SO WE CAN FIX THE PROBLEM. NO PROBLEM
KM8JM12B96U	7/13/05	29090	30.36	29090 C1513 NEEDS BRAKE SWITCH. REPLACED BRAKE SWITCH. CLEARED CODES. GOOD.	CUSTOMER CALLED IN 12:38 09/24 CUSTOMER STATES ESC LIGHT COMING ON.	C1513 NEEDS BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 29090 C1513 NEEDS BRAKE SWITCH. REPLACED BRAKE SWITCH. CLEARED CODES.
KM8JN72D55U	4/13/05	26666	31.56	BRAKE LIGHT SWITCH NOTED CONCERN OF ESP LIGHT OFF. LIGHT ON CHECKED FOR SET DTC. FOUND C1513 SET FOR BRAKE LAMP SWITCH CIRCUIT MALFUNCTION. FOUND SWITCH TO BE AT FAULT. - REMOVED AND REPLACED BRAKE LAMP SWITCH AND CLEARED DTC - REDROVE DTC DID NOT RESET.	C/S THAT A CLUNK/THUMP NOISE SENSATION FROM FRONT OVER UNEVEN ROAD SURFACE....	.	BUSHING-CROSSMEMBER MOUNTING (ALL, 4WD) RE BUSHING-CROSSMEMBER MOUNTING (ALL, 4WD) RE 26666 NOISE. TEST DROVE VEHICLE. NOTED CONCERN OF A "CLUNK" NOISE FROM FRONT OF VEHICLE. FOUND BOTH REAR SUBFRAME TO BE AT FAULT. - REMOVED AND REPLACED 2 BUSHINGS AND REDROVE
KM8JN72D55U	4/13/05	26666	31.56	BRAKE LIGHT SWITCH NOTED CONCERN OF ESP LIGHT OFF. LIGHT ON CHECKED FOR SET DTC. FOUND C1513 SET FOR BRAKE LAMP SWITCH CIRCUIT MALFUNCTION. FOUND SWITCH TO BE AT FAULT. - REMOVED AND REPLACED BRAKE LAMP SWITCH AND CLEARED DTC - REDROVE DTC DID NOT RESET.	C/S THAT THE E.S.C. LITE WILL NOT GO OFF AFTER VEHICLE HAS BEEN STARTED...	E.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 26666 BRAKE LIGHT SWITCH NOTED CONCERN OF ESP LIGHT OFF. LIGHT ON CHECKED FOR SET DTC. FOUND C1513 SET FOR BRAKE LAMP SWITCH CIRCUIT MALFUNCTION. FOUND SWITCH TO BE AT FAULT. - REMOVED AND REPLACED BRAKE
KM8JN12D95U	5/26/05	25651	30.36	25651 OPEN/SHORT BRAKE SWITCH HAD OPEN/SHORT. INSTALLED NEW BRAKE SWITCH. PART # 93810-3K000			
KM8JM12B15U	4/21/05	20987	22.8	20987 C1513. BRAKE SWITCH WAS ALREADY REPLACED. ADJUSTED BRAKE SWITCH. CLEARED CODES. BRAKE SWITCH CURRENT DATA WAS OPERATING GOOD AFTER REPAIR.	CUSTOMER STATES ESP LIGHT IS ON	C1513. BRAKE SWITCH WAS ALREADY REPLACED.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20987 C1513. BRAKE SWITCH WAS ALREADY REPLACED. ADJUSTED BRAKE SWITCH. CLEARED CODES. BRAKE SWITCH CURRENT DATA WAS OPERATING GOOD AFTER REPAIR.

KM8JN72D45U	5/30/05	34650	27.8		ELECTRICAL CUSTOMER STATES ESP LIGHT IS COMING ON INTERMITTENTLY INSTALL SOP EB	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 34650 ESP LIGHT CUSTOMER STATES ESP LIGHT COMES ON. TROUBLE CODE C1513 STORED, BRAKELAMP SWITCH MALFUNCTION. INSTALLED SOP BRAKELIGHT SWITCH, CK OPERATION, CLEARED TROUBLECODE
KM8JN72D96U	9/29/05	15191	25.84		C/S THAT C.E.L. AND E.S.C. LITES WERE ON.....	E	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE 15191 CHECK ENGINE LIGHT AND ESP LIGHT.CODE PO130 SENSOR 1 BANK 1 WILL NEED TO ORDERSENSOR.CODE C1513 BRAKE LIGHT SWITCH.WILLNEED TO ORDER SWITCH AND O2 SENSOR.REPLACEDBRAKE LIGHT SWITCH AND BANK
KM8JN12D36U	9/14/05	33397	32.46	33397 C1513 BRAKE CIRCUIT , C1237 PRESSURE SENSOR REPLACED BRAKE PEDAL SWITCH. CLEARED CODES. GOOD. C1237 IS INTERMITTENT NO PROBLEM AT THIS TIME.			
KM8JN12D25U	6/08/05	16935	30.04	16935 C1513-BRAKE PEDAL SWITCH-OPEN CIRCUIT 93810ROO, N94, C15 30 R&R BRAKE PEDAL SWITCH, REPLACED WITH NEW.	CUSTOMER STATES CHECK ENGINE LIGHT ON.	P0130-B1/S1 CIRCUIT. POOR CONNECTION	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE 16935 P0130-B1/S1 CIRCUIT. POOR CONNECTION39214ROO QTY 0, 39214RP0, .30, N69, C15 30CLEARED CODE. TEST OPERATION OF O2 SENSORS,NORMAL. CODE WAS A HISTORY CODE WITH NOCURRENT FAILURE. TEST
KM8JN12D25U	6/08/05	16935	30.04	16935 C1513-BRAKE PEDAL SWITCH-OPEN CIRCUIT 93810ROO, N94, C15 30 R&R BRAKE PEDAL SWITCH, REPLACED WITH NEW.	CUSTOMER STATES CHECK ENGINE LIGHT ON.	P0130-B1/S1 CIRCUIT. POOR CONNECTION	SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION 16935 P0130-B1/S1 CIRCUIT. POOR CONNECTION39214ROO QTY 0, 39214RP0, .30, N69, C15 30CLEARED CODE. TEST OPERATION OF O2 SENSORS,NORMAL. CODE WAS A HISTORY CODE WITH NO
KM8JN72D96U	9/29/05	15191	25.84		C/S THAT C.E.L. AND E.S.C. LITES WERE ON.....	E	SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION 15191 CHECK ENGINE LIGHT AND ESP LIGHT.CODE PO130 SENSOR 1 BANK 1 WILL NEED TO ORDERSENSOR.CODE C1513 BRAKE LIGHT SWITCH.WILLNEED TO ORDER SWITCH AND O2 SENSOR.REPLA
KM8JN72D96U	9/29/05	15191	25.84		OPEN RECALL /CAMP.....DRIVERS AIR BAG...	E	(RECALL)REPLACE DRIVER AIR BAG MODULE (RECALL)REPLACE DRIVER AIR BAG MODULE 15191 RECALL 079 INSTALLED COVER.
KM8JN72D96U	9/29/05	15191	25.84		C/S THAT C.E.L. AND E.S.C. LITES WERE ON.....	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 15191 CHECK ENGINE LIGHT AND ESP LIGHT.CODE PO130 SENSOR 1 BANK 1 WILL NEED TO ORDERSENSOR.CODE C1513 BRAKE LIGHT SWITCH.WILLNEED TO ORDER SWITCH AND O2 SENSOR.REPLACEDBRAKE LIGHT SWITCH AND BANK ONE SENSO
KM8JN12D25U	6/08/05	16935	30.04	16935 C1513-BRAKE PEDAL SWITCH-OPEN CIRCUIT 93810ROO, N94, C15 30 R&R BRAKE PEDAL SWITCH, REPLACED WITH NEW.	CUSTOMER STATES THE ESP AND CHECK ENGINE LIGHTS ARE ON.	C1513-BRAKE PEDAL SWITCH- OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16935 C1513-BRAKE PEDAL SWITCH-OPEN CIRCUIT93810ROO, N94, C15 30 R&R BRAKE PEDAL SWITCH.REPLACED WITH NEW.
KM8JN12D76U	7/16/05	12473	34.86	CODE C1513-BRAKE LIGHT SWITCH./C1235-PRIMARY PRESSURE SENSOR ELEC. CK OPERATION OF PRESSURE SENSOR PER SHOP MANUAL, WAS WORKING PROPERLY. CK BRAKE LIGHT SWITCH, INT WAS NOT OPERATING. INSTALLED NEW SWITCH.	C/S: CUSTOMER STATES ESC LIGHT IS ON.	INT OPEN IN BRAKE LIGHT SWITCH CODE C1513	HOOK UP SCANNER CK FOR CODES FIND CODE C1235 PRIMARY PRESSURESENSOR ELEC AND C1513 BRAKE LIGHT SWITCH CK OPERATION OF PRESSURE SENSOR PER SHOP MANUAL WAS WORKING PROPERLY AT THIS TIME CK BRAKE LIGHT SWITCH INT WAS NOT OPERATING INSTALL NEW SWITCH
KM8JN12D66U	7/28/05	10675	30.13	ESC LIGHT CK FOR TROUBLE CODES. RECEIVED CODE C1513, STOP LAMP SWITCH MALFUNCTION. CK BRAKE LIGHTS. ALL LIGHTS WORKING PROPERLY. FAULT IN SWITCH. REPLACED STOP LAMP SWITCH. CK OPERATION, O.K.	C/S THAT THE E.C.S. LITE HAS COME ON SEVERAL TIMES AND A STRANGE SENSATION WAS FELT.....LIKE JUDDER/SHUDDER...	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 10675 ESC LIGHT CK FOR TROUBLE CODES.RECEIVED CODE C1513. STOP LAMP SWITCHMALFUNCTION. CK BRAKE LIGHTS. ALL LIGHTSWORKING PROPERLY. FAULT IN SWITCH. REPLACEDSTOP LAMP SWITCH. CK OPERATION, O.K.

KM8JN12D66U	7/28/05	10675	30.13	ESC LIGHT CK FOR TROUBLE CODES. RECEIVED CODE C1513, STOP LAMP SWITCH MALFUNCTION. CK BRAKE LIGHTS. ALL LIGHTS WORKING PROPERLY. FAULT IN SWITCH. REPLACED STOP LAMP SWITCH. CK OPERATION, O.K.	FACTORY COUPON FOR A FREE 34 PT CHECK....HM02 HYUNDAI REALITY...	E	FACTORY COUPON GOOD FOR FREE 34 PT CK....HM02 HYUNDAI REALITY.. COMPLETE BRAKE INSPECTION. 10675 34 POINT INSPECTION
KM8JN72D36U	12/24/05	3998	33.2	BRAKE LAMP SWITCH NOT SENDING PROPER SIGNAL. REPLACED BRAKE LAMP SWITCH.	CUSTOMER STATES ABS LIGHT ON INSTALL SOP PART.	BRAKE LAMP SWITCH NOT SENDING PROPER SIGNAL	REPLACED BRAKE LAMP SWITCH.CONFIRMED CODES GONE
KM8JM12B95U	12/27/04	7	33.3	INSTALLED BRAKE LAMP SWITCH, RECHECKED OK AT THIS TIME			
KM8JM12B56U	7/11/05	26239	34.54	CODE C1513-FOUND THAT BRAKE LIGHT SWITCH WAS FAULTY. REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE. RETEST SYSTEM. OK	CUSTOMER STATES AT TIMES WHEN STARTING CAR ESC OFF LIGHT WILL COME ON AT TIMES	DIAG. RETREIVED CODE C1513 PINPOINT TEST FOUND BRAKE LIGHT SWITCH AT FAULT	REPLACED BRAKE LIGHT SITCH CLEARED CODE.RETEST SYSTEM TEST..OK
KM8JN72D86U	8/17/05	29106	31.56	ESC LIGHT WAS UNABLE TO REPRODUCE CONCERN OF ESC LIGHT ON CHECKED FOR ANY SET DTC FOUND C1513 SET FOR BRAKE SWITCH CIRCUIT MALFUNCTION CHECKED FOR RELATED SERVICE BULLETINS NONE FOUND - BELIVE BRAKE SWITCH TO HAVE INTERMIT INTERNAL FAULT. REPLACED SWITCH	CUST STATES ESC OFF LIGHT COMES ON WHILE DRIVING	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 29106 ESC LIGHT WAS UNABLE TO REPRODUCE CONCERN OF ESC LIGHT ON CHECKED FOR ANY SETDTC FOUND C1513 SET FOR BRAKE SWITCH CIRCUITMALFUNCTION CHECKED FOR RELATED SERVICEBULLETINS NONE FOUND - BELIVE BRAKE SW
KM8JN72D66U	7/19/05	12737	26.6		CUSTOMER STATES CHECK LF SHOCK,SQUEAKS	N94 C15	INSULATOR ASSY-STRUT (LH)RE INSULATOR ASSY-STRUT (LH)RE
KM8JN72D66U	7/19/05	12737	26.6		CUSTOMER STATES ESC LIGHTS COMING ON,SOP	N94 C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D95U	6/16/05	38191	34.86	CODE C1513-FOUND STOP LAMP SWITCH FAULTY. REPLACED STOP LAMP SWITCH, CLEARED CODES, RETESTED OPERATION.	C/S ESP LIGHT KEEPS COMING ON	DIAG. RETREIVED CODE C1513 PINPOINT TEST FOUND STOP LAMP SWITCH FAULTY	REPLACED STOP LAMP SWITCH,CLEARED CODES RETEST OPERATION CHECK..OK
KM8JN72D25U	12/16/04	22370	33.15	CRUISE INOP, BRAKE LAMP SWITCH FAILURE. REPLACED BRAKE LAMP SWITCH. CRUISE WORKS PROPERLY AT THIS TIME	C/S CRUISE QUIT WORKING AGAIN	BRAKE LAMP SWITCH FAILURE	REPLACED BRAKE LAMP SWITCH CRUISE WORKS NORMALLY AT THIS TIME
KM8JN72D25U	12/16/04	22370	125	5 DAY RENTAL	C/S CRUISE QUIT WORKING AGAIN	BRAKE LAMP SWITCH FAILURE	REPLACED BRAKE LAMP SWITCH CRUISE WORKS NORMALLY AT THIS TIME
KM8JN72D35U	2/19/05	11201	24.36	CUSTOMER STATES VEHICLE HAD CHECK ENGINE LIGTH COME ON THEN GO OFF. C1513-BRAKE LAMP SWITCH. SHORTED OUT. REPLACED BRAKE LAMP SWITCH.	TECH STATES FOUND CODE P0130	N69 C15 SCAN CODE P0130	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE
KM8JN72D35U	2/19/05	11201	24.36	CUSTOMER STATES VEHICLE HAD CHECK ENGINE LIGTH COME ON THEN GO OFF. C1513-BRAKE LAMP SWITCH. SHORTED OUT. REPLACED BRAKE LAMP SWITCH.	TECH STATES FOUND CODE P0130	N69 C15 SCAN CODE P0130	SENSOR ASSY-OXYGEN RH ADD4 WHEEL DRIVE SENSOR ASSY-OXYGEN RH ADD4 WHEEL DRIVE
KM8JN72DX6U	7/28/05	32371	34.69	TECH SCANNED FOR DTC'S AND FOUND C1513 BRAKE SW ITCH CIRCUIT MALF. . TECH REPLACED BRAKE LAMP SW ITCH CLEARED CODES WITH SCAN TOOL. , TECH DROVE AND MONITORED WHEEL SPEED SENSORS WITH CURRENT DATA TO CONFIRM NO PROBLEM WITH WHEEL SPEED SEN SOR CIRCUIT 37-563	CUSTOEMR STATES WAS RAINING, HAD PUT VEHICLE IN 4WD DRIVING STRAIGHTM AND THERE WAS A CLICKING OR ABNORMAL NOISE EVAL AND ADVISE	BRAKE SWITCH ASSY.	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE TECH SCANNED FOR DTC'S AND FOUND C1513 BRAKESW ITCH CIRCUIT MALF. . TECH REPLACED BRAKELAMP SW ITCH CLEARED CODES WITH SCAN TOOL. TECH DROVE AND MONITORED WHEEL SPEED SENSORSWITH CURRENT DATA TO CONFIRM N
KM8JN72DX6U	7/28/05	32371	34.69	TECH SCANNED FOR DTC'S AND FOUND C1513 BRAKE SW ITCH CIRCUIT MALF. . TECH REPLACED BRAKE LAMP SW ITCH CLEARED CODES WITH SCAN TOOL. , TECH DROVE AND MONITORED WHEEL SPEED SENSORS WITH CURRENT DATA TO CONFIRM NO PROBLEM WITH WHEEL SPEED SEN SOR CIRCUIT 37-563	LOANER NEEDED - L55	..	WARRANTY APPLIED FOR WARRANTY APPLIED FOR
KM8JN72D35U	2/19/05	11201	24.36	CUSTOMER STATES VEHICLE HAD CHECK ENGINE LIGTH COME ON THEN GO OFF. C1513-BRAKE LAMP SWITCH. SHORTED OUT. REPLACED BRAKE LAMP SWITCH.	TECH STATES FOUND CODE P0130	N69 C15 SCAN CODE P0130	SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION
KM8JN72D35U	2/19/05	11201	24.36	CUSTOMER STATES VEHICLE HAD CHECK ENGINE LIGTH COME ON THEN GO OFF. C1513-BRAKE LAMP SWITCH. SHORTED OUT. REPLACED BRAKE LAMP SWITCH.	CUST STATES VEH HAD CK ENGINE LIGHTCOME ON THEN GO OFF	N69 C15 SCAN CODE C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D26U	12/27/05	41098	30.36	CUST STATES ESC LIGHT KEEPS COMING ON. C1513 BRAKE SWITCH MALFUNCTION. REPLACE BRAKE SWITCH.			
KM8JN72D16U	1/09/06	3816	24.64	ESC LIGHTS IS STAYING ON. SWITCH MALFUNCTION INTERNALLY. REPLACED STOP LAMP SWITCH			
KM8JM12B66U	7/13/05	18448	32.3	18448 SCAN TOOL TEST C1513 BRAKE LAMP MALFUNCTION CHECK WEBSITE FOR CODE TEST AND ORDER PART P0111 INTAKE AIR TEMP ABNORMAL COMPLETE REPROGRAM ALSO FOR P0111 TSB 06-36-005 COMPLETE REPLACE BRAKE LAMP SWITCH N69 C15	REPROGRAM ESC	.	06-36-005 ESC REPROGRAM 06-36-005 ESC REPROGRAM 922 RECALL OPEN ON CAR REPROGRAM ESCREPROGRAM

KM8JM12B66U	7/13/05	18448	32.3	18448 SCAN TOOL TEST C1513 BRAKE LAMP MALFUNCTION CHECK WEBSITE FOR CODE TEST AND ORDER PART P0111 INTAKE AIR TEMP ABNORMAL COMPLETE REPROGRAM ALSO FOR P0111 TSB 06-36-005 COMPLETE REPLACE BRAKE LAMP SWITCH N69 C15	C/S ESC LIGHT AT DASH I SCOMMING ON		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 18448 SCAN TOOL TEST C1513 BRAKE LAMP MALFUNCTION CHECK WEBSITE FOR CODE TEST AND ORDER PART P0111 INTAKE AIR TEMP ABNORMAL COMPLETE REPROGRAM ALSO FOR P0111 TSB06-36-005 COMPLETE REPLACE BRAKE LAMP SWITCH
KM8JM12B96U	10/21/05	26592	21.5	CUSTOMER STATES ESC LIGHT KEEPS COMING ON. CHECK ESP LIGHT ON AT TIMES. C1237 PRESSURE SENSOR OTHER. C1513 BRAKE LAMP SWITCH. BRAKE SWITCH INOP NO BRAKE LIGHTS. VERIFIED SWITCH BAD. REPLACED SWITCH. VERIFIED REPAIR OKAY.	CUST STATES ESC LIGHT KEEPS COMING ON	N69 C40	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP
KM8JM12B96U	10/21/05	41176	30.36	CUST STATES ESC LIGHT ON. REPLACE STOP SWITCH.			
KM8JN72DX6U	8/13/05	21199	30.36	CUST STATES ESC LIGHT COME ON THEN WHEN CAR IS SHUT OFF AND TURNED BACK ON LIGHT GOES OUT. REPLACE BRAKE LAMP SWITCH.			
KM8JM12B46U	12/12/05	13892	32.46	13892 SCAN TOOL TEST C1513 BRAKE LAMP SWITCH. TEST AND ORDER PART. REPLACE BRAKE LIGHT SWITCH AND TEST	C/S ESC LIGHT IS ON		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 13892 SCAN TOOL TEST C1513 BRAKE LAMP SWITCH. TEST AND ORDER PART. REPLACE BRAKE LIGHT SWITCH AND TEST
KM8JN72D66U	9/15/05	25751	32.46	25751 TPS LIGHT LFT REAR TIRE RECENTLY PLUGGED LEAKING AT PLUG. SEND TIRE TO QUICK LANE TO BE REPAIRED. REINSTALL. ESC LIGHT. SCAN TOOL TEST C1513 BRAKE LAMP SWITCH SHORT/OPEN. TEST AND REPLACE BRAKE LAMP SWITCH. CLEAR CODE AND RETEST OK	C/S ESC & TPS LIGHTS ARE COMING ON		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 25751 TPS LIGHT LFT REAR TIRE RECENTLY PLUGGED LEAKING AT PLUG. SEND TIRE TO QUICK LANE TO BE REPAIRED. REINSTALL. ESC LIGHT. SCAN TOOL TEST C1513 BRAKE LAMP SWITCH SHORT/OPEN. TEST AND REPLACE BRAKE LAMP SW
KM8JN72D25U	5/20/05	18552	30.36	CUST STATES TECH STATES FOUND TROUBLE CODE C1513. BRAKE SWITCH MALFUNCTION. REPLACE STOP LAMP ASSY.			
KM8JN72D96U	9/22/05	45514	30.04	FOUND TROUBLE CODE C1513. REPLACED STOP LAMP SWITCH			
KM8JN72D36U	8/17/05	33000	24.64	CUSTOMER STATES ESC LIGHT COMING ON-SOP. SHORT IN SWITCH. ESC LIGHT ON. REPLACE BRAKE SWITCH.	CUSTOMER STATES ESC LIGHT COMING ON-SOP	94 15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D86U	7/28/05	13309	32.46	13019 SCAN TOOL TEST C1513 BRAKE LAMP SWITCH CIR. TEST AND ORDER PART. REPLACE BRAKE LAMP SWITCH. CLEAR CODE AND RETEST OK	C/S A/C COMPRESSOR KICKS OFF & ON TO OFTEN & IT ALSO KICKS ON WHEN ITS TURNED OFF		CONTROL ASSY-HEATER RE CONTROL ASSY-HEATER RE 13309 VIS. INSP A/C COMPRESSOR. CNVCONCERN. HOOK GAUGES TO A/C SYSTEM. PRESSURE NORMAL. RD TEST AND MONITOR A/C RELAYS AND SWITCHES WITH SCAN TOOL. LET SET IN BAY RUNNING. VERIFIED FAN RUNNING WHEN MODESWITC
KM8JN12D06U	1/20/06	14947	37.24		CUST STATES THE BLOWER MOTOR MAKES A WINE NOISE	INSPECT FOUND NO NOISE AT THIS TIME	NO REPAIRS NEEDED AT THIS TIME
KM8JN12D06U	1/20/06	14947	37.24		CUST STATES THE ESC LIGHT COMES ON	FOUND CODE C1513	REPLACE BRAKE SWITCH RETEST OK
KM8JN72D15U	9/19/04	4401	15.3				
KM8JN72D65U	5/18/05	15358	30.36	CUSTOMER STATES ESC LIGHT HAS BEEN COMING ON. C1513 STOP LAMP SWITCH MALFUNCTION. REPLACE STOP LAMP SWITCH.			
KM8JM12BX7U	11/14/06	559	30.36	CUST STATES CHECK ESC LIGHT COMES ON AT TIMES. REPLACE STOP LAMP ASSY.			
KM8JN72D65U	1/18/05	30005	29.4	REPAIRED HARNESS SEE JOB ONE FOUND BRAKE SWITCH OUT OF ADJUSTMENT ADJUSTED BRAKE SWITCH FOUND CRUISE STILL INOP REPLACED BRAKE SWITCH TEST DROVE CRUISE IS WORKING PROPERLY AT THIS TIME			
KM8JM12B66U	3/31/06	15624	65.46	CUSTOMER STATES THE ESC LIGHT COMES ON. VERIFIED CONCERN. SCAN TEST - FOUND CODE C1315. TRACED TO OPEN CIRCUIT IN BRAKE LIGHT SWITCH. REPLACE BRAKE LIGHT SWITCH. RESET CODE. RETEST - NO CODES SET. ATT = SCAN TEST FOR DIAG - PER GEORGE.			
KM8JM12B06U	7/12/05	6902	37.24		CUSTOMER STATES THE ESC LIGHT WAS ON	RAN SCAN FOUND CODE C1573 BRAKE SWITCH INOP	REPLACED BRAKES
KM8JN12D06U	12/30/05	16387	37.24		CUST STATES THE ESC LIGHT WILL COME ON WHILE DRIVING	FOUND CODE C1513 BRAKE LAMP SWITCH INTERMITTENT FAILER	REPLACE SWITCH RETEST OK
KM8JN72DX6U	10/18/05	19824	30.79	SCANNED FOR CODES HAD CODE C1513 BRAKE SWITCH CIRCUIT FOUND BRAKE SWITCH INOP AT TIMES REPLACED SWITCH CLEARED CODES ALL OK AT THIS TIME			
KM8JN12D05U	11/30/04	5397	32.92				

KM8JM12B56U	4/27/06	4	36.8		CUSTOMER STATES BRAKE LIGHT INOP	PERFORMED SELF DIAGNOSTIC FOUND BRAKE LIGHT DEFECTIVE	REMOVED AND REPALCED BRAKE LIGHT AND ALL RELATED PARTS
KM8JN12D76U	9/24/05	10033	34.84		CUST STATES THE ESC LIGHT STAYS ON SOP IN	FOUND BRAKE STOP SWITCH INOP	SOP IN REPLACE SWITCH RETEST OK
KM8JN12D15U	7/01/05	15179	37.24	CUSTOMER STATES THE ESP LIGHT STAYS ON - FOUND CODE C1513 - BRAKE SWITCH. REPLACE BRAKE SWITCH - RETEST - OK.	CUST STATES THE ESP LIGHT WAS ON TILL TODAY	FOUND C1260 STERRING ANGLE SENSOR C1513 BRAKE SWITCH CIRT	REPLACE STERRING ANGLE SENSOR RETEST OK
KM8JN12D15U	7/01/05	15179	37.24	CUSTOMER STATES THE ESP LIGHT STAYS ON - FOUND CODE C1513 - BRAKE SWITCH. REPLACE BRAKE SWITCH - RETEST - OK.	CUST STATES THE ESP LIGHT STAYS ON SPLIT REPAIR	C1513 BRAKE SWITCH	REPLACE SWITCH RETEST OK
KM8JN12D15U	5/20/05	6667	36.8		CUSTOMER STATES ESP LIGHT INOP	PERFORMED SCAN DIAGNOSTIC FOUND CODE P1707 BRAKE SWITCH DEFECTIVE	REMOVED AND REPLACED BRAKE SWITCH AND ALL ELATED PARTS
KM8JN12D15U	5/20/05	6667	36.8		CUSTOMER STATES PERFORM RECALL 922	OPEN RECALL	PERFORMED RECALL 922
KM8JM12B26U	7/09/05	9860	34.7	ESC LIGHT CAME ON A COUPLE TIMES C1513 STOP LAMP SWITCH FAILUREREPLACED STOP LAMP SWITCHCONCERN RESOLVED	ESC LIGHT CAME ON A COUPLE TIMES	C1513 STOP LAMP SWITCH FAILURE	REPLACED STOP LAMP SWITCH
KM8JN72D56U	12/31/05	11591	36.8		CUSTOMER STATES TEH ECS OFF LIGHT STAYS ON	FOUND BAD BRAKE SWITCH	REPLACE SWITCH RETEST OK
KM8JN72D56U	12/31/05	11591	36.8		CUSTOMER STATES THE RUBBER CROMMENTS AROUND THE FENDER WELLSARE FADED		SOP CUST TO RETURN FOR REPAIRS
KM8JN72D56U	12/31/05	11591	36.8		CUSTOMER STATES THE A/C HAS A LOUD HUMMING NOISE COMMING THROUGH THE VENTS		NO PROBLEM FOUND AT THIS TIME
KM8JN12D35U	5/10/05	34620	28.24	34620 BRAKE LAMP SWITCH INTERMITTENT FAILURE. CODE C1513 FOUND DURING HECU SCAN. BRAKE LAMP SWITCH HAD INTERNAL FAULT. REPLACED BRAKE LAMP SWITCH. CODE CLEARED. NO OTHER CODES DETECTED AT THIS TIME.	079 DRIVER AIRBAG COVER MOD REPL(07-01-001)	RECALL	DRIVER AIR BAG MODULE RECALL # 07-01-001 DRIVER AIR BAG MODULE RECALL # 07-01-001 34620 RECALL CAMPAIGN. 61B046R0. 2 REPLACEDDRIVER AIRBAG MODULE COVER WITH REVISED PART AS PER RECALL INSTRUCTIONS.
KM8JN12D35U	5/10/05	34620	28.24	34620 BRAKE LAMP SWITCH INTERMITTENT FAILURE. CODE C1513 FOUND DURING HECU SCAN. BRAKE LAMP SWITCH HAD INTERNAL FAULT. REPLACED BRAKE LAMP SWITCH. CODE CLEARED. NO OTHER CODES DETECTED AT THIS TIME.	C/S THE ESP LIGHT WILL COMEON AND OFF AT TIMES	N69 C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 34620 BRAKE LAMP SWITCH INTERMITTENT FAILURE. CODE C1513 FOUND DURING HECU SCAN. BRAKELAMP SWITCH HAD INTERNAL FAULT. REPLACEDBRAKE LAMP SWITCH. CODE CLEARED. NO OTHERCODES DETECTED AT THIS TIME.
KM8JN12D46U	11/15/05	15103	65.46	CUSTOMER STATES THAT WHEN APPLING THE BRAKES - THE ESC LIGHT SOMES ON. INSPECT - TRACED TO INTERNAL FAILURE IN BRAKE SWITCH. REPLACE BRAKE SWITCH. RETEST - OK.	CUSTOMER STATES THAT WHEN APPLING BRAKES ESC LIGHT COMES ON	TRACED TO INTERNAL FAILURE IN BRAKE SWITCH	REPLACED BRAKE SWITCH AND RETESTED OK
KM8JN72D06U	7/21/05	17046	34.84		CUSTOMER STATES THERE IS AN ABNORMAL TYPE SOUND IN THE ENGINE AREA	CHECKED OK AT THIS TIME	OK AT THIS TIME
KM8JN72D06U	7/21/05	17046	34.84		CUSTOMER STATES THE ESC LIGHT WAS ON	RAN SCAN FOUND DTC C1513 TRACED TO INTERNAL SHORT IN SWITCH	REPLACED SWITCH
KM8JN72D06U	7/21/05	17046	34.84		RECALL 079 AIR BAG MOD	PERFORMED RECALL	REPLACED AIR BAG MODULE
KM8JN12D25U	4/11/05	37914	30.2	37914 STOP LAMP SWITCH. SCANNED ESP MODULE FOR CODES. FOUND CODE C1513. STOP LAMP SWITCH ABNORMAL. ALL WIRES CHECKED FINE. SWITCH ALIGNMENT WITHIN SPECS. REPLACED STOP LAMP SWITCH. CODE CLEARED. NO OTHER CODES DETECTED FOR ESP SYSTEM.	C/S CHECK ENGINE LIGHT IS ON	N69 C29 CODE P0455	CANISTER ASSY RE CANISTER ASSY RE 37914 LOOSE FUEL CAP. LOOSE FUEL CAPCAUSING A LARGE LEAK ON FUEL EVAPORATIVESYSTEM. TIGTEND FUEL CAP AND CLEARED CODEP0455. PERFORMED SYSTEM PRESSURE TEST. TESTPASSED. NO OTHER CODES DETECTED AT THIS TIME.
KM8JN12D25U	4/11/05	37914	30.2	37914 STOP LAMP SWITCH. SCANNED ESP MODULE FOR CODES. FOUND CODE C1513. STOP LAMP SWITCH ABNORMAL. ALL WIRES CHECKED FINE. SWITCH ALIGNMENT WITHIN SPECS. REPLACED STOP LAMP SWITCH. CODE CLEARED. NO OTHER CODES DETECTED FOR ESP SYSTEM.	RECALL CAMPAIGNS 071 PARKING BRAKE LEVER REPL (0501006)	RECALL 51B028R0	PARKING BRAKE LEVER (TSB#05-01-006) PARKING BRAKE LEVER (TSB#05-01-006) 37914 RECALL CAMPAIGN. 51B028R0. 6 REPLACEDPARKING BRAKE LEVER WITH RECALLED REPLACEMENTLEVER.
KM8JN72D96U	11/01/05	25313	37.56	CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF. VERIFIED. SCAN TEST - FOUND CODE C1513. TRACED TO SHORTED BRAKE LIGHT SWITCH. REPLACE BRAKE LIGHT SWITCH. RESET CODE. RETEST - NO CODES RETURNED.	CUSTOMER STATES THE CENTER CONSOLE LID LATCH BROKE	VERIFIED	REPLACED CONSOLE LID ASSY
KM8JN72D96U	11/01/05	25313	37.56	CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF. VERIFIED. SCAN TEST - FOUND CODE C1513. TRACED TO SHORTED BRAKE LIGHT SWITCH. REPLACE BRAKE LIGHT SWITCH. RESET CODE. RETEST - NO CODES RETURNED.	CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF	VERIFIED TRACED TO SHORTED BRAKE LIGHT SWITCH	REPLACED SWITCH OK NOW

KM8JN12D25U	4/11/05	37914	30.2	37914 STOP LAMP SWITCH. SCANNED ESP MODULE FOR CODES. FOUND CODE C1513. STOP LAMP SWITCH ABNORMAL. ALL WIRES CHECKED FINE. SWITCH ALIGNMENT WITHIN SPECS. REPLACED STOP LAMP SWITCH. CODE CLEARED. NO OTHER CODES DETECTED FOR ESP SYSTEM.	C/S ESP LIGHT COMES ON AND OFF	N69 C15 CODE C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 37914 STOP LAMP SWITCH. SCANNED ESP MODULE FOR CODES. FOUND CODE C1513. STOP LAMP SWITCH ABNORMAL. ALL WIRES CHECKED FINE. SWITCH ALIGNMENT WITHIN SPECS. REPLACED STOP LAMP SWITCH. CODE CLEARED. NO OTHER COD
KM8JN12D25U	4/11/05	37914	30.2	37914 STOP LAMP SWITCH. SCANNED ESP MODULE FOR CODES. FOUND CODE C1513. STOP LAMP SWITCH ABNORMAL. ALL WIRES CHECKED FINE. SWITCH ALIGNMENT WITHIN SPECS. REPLACED STOP LAMP SWITCH. CODE CLEARED. NO OTHER CODES DETECTED FOR ESP SYSTEM.	RECALL CAMPAIGNS 922 ECM REPROGRAMMING (06-01-001)	RECALL 50B035R1	RECALL 50B035R1 [4"- 37914 RECALL CAMPAIGN. 50B035R1 3REPROGRAMMED ESP MODULE ASPER RECALLINSTRUCTIONS.
KM8JN72D85U	6/07/05	1267	79.3		NEW CAR DELIVERY FRESHEN UP OR SERVICE VEHICLE WASH	WASH	WASH
KM8JN72D85U	6/07/05	1267	79.3		CUST STATES ESP LIGHT COMING ON AND OFF	VERIFY MONOTOR T/C C1513 RNR HARNESS AT BRAKE SWITCH VOLTAGE FOR DTC 1513 BRAKE SWITCH BAD	REPLACE BRAKE LIGHT SWITCH
KM8JN72D75U	12/07/04	9255	35.62		CUSTOMER STATES THERE IS A NOISE COMING FROM RIGHT SIDE OF DASH	REMOVED BLOWER MOTOR TO CHECK FOR DE BREEZ NONE FOUND FOUND BLOWER INOP	CUSTOMER RETURN FOR SOP PART BLOWER MOTOR
KM8JM12B66U	7/16/05	35599	28.56	35599 BRAKE LIGHT SWITCH. CODE C1513 FOUND IN THE ESC MODULE. BRAKE LIGHT SWITCH HAD INTERNAL FAILURE. REPLACED BRAKE LIGHT SWITCH, AND SET SWITCH-TO-PEDAL GAP. CODE CLEARED. NO OTHER CODES DETECTED AT THIS TIME.	CHECK ENGINE LIGHT IS ON	N69 C40	JM ECM REPROGRAMMING (TSB# 06-36-005) JM ECM REPROGRAMMING (TSB# 06-36-005) 35599 CODE P0111. INTAKE TEMP. SENSOR ABNORMAL. 39110F35. 3 TSB AVAILABLE FOR CODE P0111. TSB#06-36-005. REPROGRAMMED ECU WITH REVISED SOFTWARE AS PER TSB INSTRUCTIONS. CODE CLEARED.
KM8JM12B66U	7/16/05	35599	28.56	35599 BRAKE LIGHT SWITCH. CODE C1513 FOUND IN THE ESC MODULE. BRAKE LIGHT SWITCH HAD INTERNAL FAILURE. REPLACED BRAKE LIGHT SWITCH, AND SET SWITCH-TO-PEDAL GAP. CODE CLEARED. NO OTHER CODES DETECTED AT THIS TIME.	C/S ESC LIGHT WILL COME ON AT TIMES	N69 C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 35599 BRAKE LIGHT SWITCH. CODE C1513 FOUND IN THE ESC MODULE. BRAKE LIGHT SWITCH HAD INTERNAL FAILURE. REPLACED BRAKE LIGHT SWITCH, AND SET SWITCH-TO-PEDAL GAP. CODE CLEARED. NO OTHER CODES DETECTED AT THIS TIME.
KM8JN72D75U	12/07/04	9255	35.62		CUSTOMER STATES ESP LIGHT WILL COME OFF AND ON	RAN SCAN FOUND CODE C1513 BRAKE LIGHT SWITCH INOP	REPLACED BRAKE LIGHT SWITCH
KM8JN12DX5U	5/31/05	18642	37.56		CUSTOMER STATES THE REAR BRAKE LIGHTS DO NOT WORK AT ALL	FOUND BRAKE SWITCH INOP	REPLACED BRAKE SWITCH VARIIFIED REPAIR NOW OK
KM8JN12DX5U	5/31/05	18642	37.56		RECALL 079 DRIVERS AIRBAG	RECALL	CUSTOMER WILL RETURN FOR SOP
KM8JN12D86U	9/24/05	11864	37.24		CUSTOMER STATES THAT AFTER DRIVING VEHICLE FOR ABOUT 20 MINUTES VEHICLE WILL STALL.	TRACED TO INTERNAL FAILURE IN TPS SENSOR	REPLACED TPS SENSOR AND RETESTED OK
KM8JN12D05U	4/22/05	16334	28.24	16334 INTERNAL SHORT USED HI SCAN TOOL TO RETRIEVE CODE C1513 (BRAKE SWITCH FAILURE) REPLACED BRAKE SWITCH. CLEARED CODE	C/S ESC LIGHT WILL COME ON AT TIMES	N69 C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16334 INTERNAL SHORT USED HI SCAN TOOL TO RETRIEVE CODE C1513 (BRAKE SWITCH FAILURE) REPLACED BRAKE SWITCH. CLEARED CODE
KM8JN12D17U	11/09/06	2651	33.36	2651 BRAKE LIGHT SWITCH. CODE C1513 FOUND DURING ESC MODULE SCAN. REPLACED BRAKE LIGHT SWITCH. CLEARED CODE. DID NOT COME BACK.	ESC LIGHT IS ON	N69 C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 2651 BRAKE LIGHT SWITCH. CODE C1513 FOUND DURING ESC MODULE SCAN. REPLACED BRAKE LIGHT SWITCH. CLEARED CODE. DID NOT COME BACK.
KM8JN12D36U	8/25/05	18472	30.34	BRAKE LIGHTS ARE ON AND WILL NOT TURN OFF -TECH FOUND STOP LAMP SWITCH WITH OPEN CIRCUIT-REPL SWITCH TO CORRECT CONDITION	CUSTOMER STATES BRAKE LIGHTS ARE ON AND WILL NOT TURN OFF	TECH FOUND STOP LAMP SWITCH WITH OPEN CIRCUIT	REPLACED SWITCH TO CORRECT OP 93810 NC/N94 CC/C24
KM8JM12B76U	7/14/05	7841	121.8		CUST STATES ESC LIGHT STAYING ON AT TIMES SWITCH ON DASH WILL NOT WORK ALSO	SCAN ESC CODE C1513 BRAKE CIRCUIT INSPECT TEST VOLTAGE VOLTAGE DROP AT BRAKE	RETEST VOLTAGE AT E39 12.01 VOLTS CIRCUIT SWITCH FOR BRAKES
KM8JM12B06U	1/09/06	17002	37.24		CUSTOMER STATES THE ESP LIGHT IS ON SOP IN	FOUND DTCC 1513 TRACED TO SHORTED BRAKE SWITCH	REPLACED BRAKE SWITCH TEST DROVE OK
KM8JN12D36U	11/28/05	13883	37.56		CUST STATES THE AC FLUXUATES PARTS ON ORDER IN	FOUND BLOWER MOTOR HAS INTERMITENT FAILUER	REPLACE BLOWER MOTOR RETEST OK
KM8JN12D26U	12/03/05	36055	36.34		CUSTOMER STATES ESC LIGHT AND ABS LIGHT COMES ON ..CHECK AND ADVICE	93810R00 C1513	MISC. TRIM ELECT 15A MISC. TRIM ELECT 15A 36055 USING SCANNER FOUND CODE C1513, BRAKE LAMP SW. 93810R00 0.3 REPLACED BRAKE LAMP SWITCH, CHECKED FOR PROPER
KM8JN12DX6U	11/10/05	23453	36.66		CUSTOMER STATES ON STEPPING ON BRAKE ECS LIGHT COMES ON INTERMITTENTLY ..BRAKE PEDAL IS SPONGY	93810R00	MISC. TRIM ELECT 15A MISC. TRIM ELECT 15A 23453 N94 93810R00 0.3 ON INSPECTION, USING SCANNER FOUND CODE C1513 BRAKE LIGHT SWITCH, BRAKE LIGHTS NOT WORKING REPLACED SWITCH AND CHECKED FOR PROPER OPERATIO
KM8JN12D36U	11/28/05	13883	37.56		CUST STATES THE ESC LIGHT COMES ON SOP IN	FOUND SWITCH BROKEN	REPLACE SWITCH RETEST OK

KM8JN12D36U	11/28/05	5703	70.8	ATT TIME = DIAGNOSTIC TIME AS PER GEORGE	CUST STATES THE ESC OFF LIGHT ON DASH COMES ON FOR NO REASON	FOUND BAD SWITCH ASSY,	REPLACE SWITCH RETEST OK
KM8JN12D36U	11/28/05	5703	70.8	ATT TIME = DIAGNOSTIC TIME AS PER GEORGE	CUST STATES THE AC CONTROL HEAD WHEN AC IS ON HIGH IT FLUCTRATES POWER HIGH,,LOW HIGH LOW ECT..	FOUND BAD MOTOR FAN	REPLACE FAN RETEST OK
KM8JN12DX6U	11/10/05	23453	36.66		CUSTOMER STATES TRANSMISSION DOES NOT SHIFT PROPERLY ..CHECK AND ADVICE	NPF	CUSTOMERS CONCERN COULD NOT BE DUPLICATED, NO REPAIR MADE. CUSTOMERS CONCERN COULD NOT BE DUPLICATED, NO REPAIR MADE.
KM8JN12D15U	6/14/05	17468	38.3		SOP PART IN ...	93810R00 STOP LAMP SWITCH TRIGGERING TC SLIGHT TO COME ON	MISC.TRIM ELECT 15A MISC.TRIM ELECT 15A 17468 INTERMITTENT 93810R00 0.3 REPLACEINTERMITTENT STOP LAMP SWITCH
KM8JM12BX6U	7/11/05	17584	34.84	CUST STATES ESC LIGHT STAYS ON AND BUTTON DOES NOTHINGVERIFIED AND REPLACED DEFECTIVE SWITCH			
KM8JM12B45U	6/13/05	15797	36.8		CUSTOMER STATES THAT AIR BAG STICKERS FELL OFF LEFT AND RIGHT VISOR	VARIFIED THAT STICKERS PEELED FROM VISOR	NO WORK DONE AT THIS TIME CUSTOMER WILL RETURN FOR SOP
KM8JM12B45U	6/13/05	15797	36.8		CUSTOMER STATES THAT THE ESP LIGHT KEEPS COMING ON AND OFF AND WHEN ITS ON SHE CANT TURN IT OFF	FOUND FAULTY BRAKE SWITCH	REPLACED BRAKE LIGHT SWITCH RETESTED OK
KM8JM12B45U	6/13/05	15797	36.8		CUSTOMER STATES CLOCK IS INOP BUTTON STUCK	FOUND INTERNAL FAILURE IN CLOCK	NO WORK DONE AT THIS TIME CUSTOMER WILL RETURN FOR SOP
KM8JN12D46U	12/22/05	22705	77.34	CUST STATES VEHICLE IS STALLING,VEHCILE HESITATES AND LUNGES FORWARD.TEST DROVE VEHICLE REPRODUCED CUST CONCERN. DIGNOSED AND FOUND CODE C1513 BRAKE SWITCH ERROR.REPLACED BRAKE SWITCH, AFTER CLEARING COULD IT WOULD COME BACK ON. ADJUSTED SWITCH TESTED FI			
KM8JN72D16U	11/03/05	21893	36.66	CUSTOMER STATES BRAKE LIGHTS AND TAIL LIGHTS OUT. INSPECTED, THIS PROBLEM DUE TO OPEN AT BRAKE SWITCH. REMOVED AND REPLACED SWITCH. CK OPERATION.			
KM8JM12B36U	7/11/05	18282	35.74				
KM8JM12B97U	11/01/06	4771	62.46	SCANNED FOR CODES - CODE C1513 - DIAG TIME REQUIRED			
KM8JM12B66U	7/19/05	16948	34.84		CUSTOMER STATES THE DRIVERS INSIDE DOOR HANDLE IS PUSHED IN	VERIFIED	REPLACED DRIVERS FRONT INSIDE DOOR HANDLE
KM8JM12B66U	7/19/05	16948	34.84		CUSTOMER STATES THE ESC LIGHT IS ON	RAN SCAN FOUND DTC C1513 BRAKE LIGHT SWITCH OPEN	REPLACED BRAKE LIGHT SWITCH OK NOW
KM8JM12B66U	7/19/05	16948	34.84		RECALL 079 AIR BAG MOD	PERFORMED RECALL	REPLACED AIR BAG MODULE
KM8JN12D75U	4/23/05	12346	36.8		CUSTOMER STATES THE ESP LIGHT KEEPS COMMING ON	RAN SCAN FOUND CODE C1373 BRAKE LIGHT SWITCH INOP	REPLACED BRAKE SWITCH
KM8JN12D96U	8/10/05	20696	79.74	ESC LIGHT ON - TECH SCANNED FOR CODES - C1611, C1612, C1513, - FOUND BRAKE LIGHT SWITCH FAILING - REPLACED SWITCH - OK AT THIS TIME			
KM8JN12DX6U	1/06/06	10368	114.94	CRUISE CONTROL INOP - EXTENSIVE DIAG - FOUND BRAKE SWITCH ASSMBY INOP - CASE # 270193			
KM8JN72D97U	11/09/06	12927	36.06				
KM8JN12D16U	7/27/05	29968	37.24		CUSTOMER STATES THE ESC LIGHT COMES ON WHILE DRIVING	RAN SCAN FOUND DTC C1513 TRACED TO SHORTED BRAKE SWITCH	REPLACED BRAKE SWITCH OK NOW
KM8JN12D95U	5/16/05	10653	37.56	CUSTOMER STATES THE ESP LIGHT COMES ON. SCAN TEST - FOUND CODE C1513. TRACED TO INTERNAL FAILURE IN THE BRAKE SWITCH. REPLACE THE BRAKE SWITCH.	CUST STATES THE ESP LIGHT COMES ON	C1513 TRACED TO INTERNAL FAILURE IN BRAKE SWITCH	REPLACED BRAKE SWITCH AND RETESTED OK
KM8JN12DX6U	7/29/05	16256	60.34	16256 I VERIFIED FOUND CODE IN SYSTEM C 1513 STOP LAMP SWITCH. I FOUND THE SWITCH IT SELF HAS AN INTERNAL PROBLEM. I REPLACED SWITCH WITH A STOCK UNIT. DUE TOO THE FACT THAT WE DIDN'T STOCK ONE NOR DOES ANY LOCAL			
KM8JN12D46U	10/17/05	22540	34.84	22540 USED SCAN TOO AND FOUND CODE C1513 BRAKE SWITCH. FOUND BRAKE LIGHT SWITCH DEFECTIVE. REPL SWITCH.			
KM8JN12D46U	8/18/05	21669	60.66	VERIFIED ESC LIGHT ON. FOUND CODE C1513 BRK LT CIRCUIT,TESTED SWITCH FOUND HIGH RESISTANCE. REPL BRAKE LIGHT SWITCH. ADD'L TIME NEEDED FOR SCAN CODE.			
KM8JN12D66U	12/13/05	23560	65.46	CUSTOMER STATES THE ESC LIGHT IS ON. VERIFY CONCERN - SCAN TEST - FOUND CODE B1513 - BRAKE LAMP SWITCH. REPLACE BRAKE LAMP SWITCH. ATT = SCAN TEST.	CUST STATES THE AC DIES DOWN AND LIGHTS DIM	PERFORM BATTERY SYSTEM CHECK FOUND ALT,BAD FAILED	REPLACE ALTERNATOR RETEST OK

KM8JN12D66U	12/13/05	23560	65.46	CUSTOMER STATES THE ESC LIGHT IS ON. VERIFY CONCERN - SCAN TEST - FOUND CODE B1513 - BRAKE LAMP SWITCH. REPLACE BRAKE LAMP SWITCH. ATT = SCAN TEST.	CUST STATES THE ESC LIGHT IS ON	VERIFY CONCERN FOUND B1513 BRAKE LAMP SWITCH	REPLACE SWITCH RETEST OK
KM8JN12D66U	12/13/05	23560	65.46	CUSTOMER STATES THE ESC LIGHT IS ON. VERIFY CONCERN - SCAN TEST - FOUND CODE B1513 - BRAKE LAMP SWITCH. REPLACE BRAKE LAMP SWITCH. ATT = SCAN TEST.	UPON PERFORMING SYSTEM CHECK FOUND BATTERY TEST FAILED		REPLACE BATTERY RETEST OK
KM8JN12D95U	9/24/04	2889	39.9				
KM8JN12D46U	7/15/05	21040	72	21040 CODE C1538 POOR CONTACT AT THE BRAKE SWITCH CONNECTOR 93810NTT (0.8) GDS SCANTOOL TEST AND CONNECTOR REPAIR GDS SCAN TOOL TEST FOR CODE C1513, TESTED BRAKE SWITCH AND FOUND POOR CONTACT AT THE BRAKE SWITCH CONNECTOR.. REPAIRED THE CONNECTOR FOR THE	REAR SEATBELT HAS COME APART	CENTER LATCH FOR THE SEATBELT HAS COME APART	SEAT BELT-REAR CENTER RE SEAT BELT-REAR CENTER RE 21040 CENTER LATCH FOR THE SEATBELT HAS COME APART 89803R00 (0.2) N94 C31 REPLACED THE CENTER SEATBELT BUCKLE...334
KM8JN12D46U	7/15/05	21040	72	21040 CODE C1538 POOR CONTACT AT THE BRAKE SWITCH CONNECTOR 93810NTT (0.8) GDS SCANTOOL TEST AND CONNECTOR REPAIR GDS SCAN TOOL TEST FOR CODE C1513, TESTED BRAKE SWITCH AND FOUND POOR CONTACT AT THE BRAKE SWITCH CONNECTOR.. REPAIRED THE CONNECTOR FOR THE	ESC LIGHT IS ON	CODE C1538 POOR CONTACT AT THE BRAKE SWITCH CONNECTOR	93810NTT MISCELLANEOUS 21040 POOR CONTACT AT THE CONNECTOR FOR THE BRAKE SWITCH 93810NTT (0.5) REPAIR CONNECTOR FOR BRAKE SWITCH REPAIRED THE CONNECTOR FOR THE BRAKE LIGHT SWITCH...334
KM8JN72D16U	7/27/05	25246	99.46		CUST STATES HER ESC LIGHT KEEPS CUTTING ON AND OFF	HI PSRO SCAN C1513 BRAKE LAMP SWITCH. CHECKED VOLTAGE ON PINS 21 & 5 E39 CONNECTOR VOLTAGE GOOD. TWEKKED PINS AT 1 &	DIAG TIME TO DETERMINE CAUSE OF PROBLEM ADJUSTED IMPROPERLY ADJUSTED BRAKE LIGHT SWITCH
KM8JN72D16U	7/27/05	25246	99.46		CUST STATES HER ESC LIGHT KEEPS CUTTING ON AND OFF	HI PSRO SCAN C1513 BRAKE LAMP SWITCH. CHECKED VOLTAGE ON PINS 21 & 5 E39 CONNECTOR VOLTAGE GOOD. TWEKKED PINS AT 1 &	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D46U	7/15/05	21378	36.66	21378 SHORT IN THE STOP LAMP SWITCH 93810R00 (0.3) N94 C15 REPLACED THE STOP LAMP SWITCH...334	ESC LIGHT ON	SHORT IN THE STOP LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21378 SHORT IN THE STOP LAMP SWITCH 93810R00(0.3) N94 C15 REPLACED THE STOP LAMP SWITCH...334
KM8JM12B66U	7/13/05	9271	25.5	9277 C1513 BRAKE LAMP SWITCH, FOUND AN OPEN IN THE BRAKE SWITCH HARNESS. MINOR WIRE REPAIR. EREASE DTC	CUST STATES THE ESC LIGHT KEEPS FLASHING ON AND OFF WHILE DRIVING		WIRE REPAIR TIME (MINOR) WIRE REPAIR TIME (MINOR) 9277 C1513 BRAKE LAMP SWITCH, FOUND AN OPEN IN THE BRAKE SWITCH HARNESS. MINOR WIRE REPAIR. EREASE DTC
KM8JM12B55U	5/13/05	17306	36.8	17306 ESC LIGHT COME ON NEED TO REPLACE BRAKE SWITCH REMOVE & INSTALL BRAKE SWITCH. IS COMPLETE	CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING PART IN TO BE INSTALLED		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 17306 ESC LIGHT COME ON NEED TO REPLACE BRAKE SWITCH REMOVE & INSTALL BRAKE SWITCH. IS COMPLETE
KM8JN72D75U	7/04/05	15140	37.75		CUST STATES INTERMITTENTLY THE ESP OFF LIGHT WILL COME ON WHILE DRIVING	FOUND SWITCH SHORTED OUT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B65U	3/22/05	12297	35.92		CUST STATES ESP LIGHT CAME ON WHILE DRIVING AND STAYED ON 456 MINUTES. ADVISE	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE HI PRO SCAN C1513 FOR BAD BRAKE SWITCH. REPLACE D BRAKE SWITCH
KM8JM12B65U	3/22/05	12297	35.92		LOANER CAR	F	LOANER CAR LOANER CAR
KM8JN72D25U	6/11/05	9587	37.75		CUST STATES ESP LIGHT ON ADVISE	HI PRO SCAN C1513 BRAKE LIGHT SWITCH. BRAKE LIGHT SWITCH HAS AN OPEN CIRCUIT. REPLACED BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D66U	9/07/05	9102	36.64	9102 INSPECT VEHICLE SAW ESP LIGHT WAS ON DUE TO INOP BRAKE LAMP SWITCH REPLACED SWITCH	CUST STATES THE BATTERY WILL NOT HOLD A CHARGE CHECK AND ADVISE		BATTERY ASSY RE BATTERY ASSY RE 9102 LOAD TEST BATTERY LOAD WAS BELOW SPECS DUE TO INTERNAL FAILURE REPLACED BATTERY ALSO CHECKED ALTERNATOR OUTPUT IT WAS WITHIN SPECS VEHICLE STARTS FINE
KM8JN12D66U	9/07/05	9102	36.64	9102 INSPECT VEHICLE SAW ESP LIGHT WAS ON DUE TO INOP BRAKE LAMP SWITCH REPLACED SWITCH	CUST STATES THE BATTERY WILL NOT HOLD A CHARGE CHECK AND ADVISE		BATTERY ASSEMBLY ADD SCANTOOL OPERATION BATTERY ASSEMBLY ADD SCANTOOL OPERATION 9102 LOAD TEST BATTERY LOAD WAS BELOW SPECS DUE TO INTERNAL FAILURE REPLACED BATTERY ALSO CHECKED ALTERNATOR OUTPUT IT WAS WITHIN SPECS VEHICLE STARTS FINE
KM8JN72D25U	6/11/05	9587	37.75		LOANER CAR	F	LOANER CAR LOANER CAR
KM8JN72D45U	2/05/05	11062	115.45		CUST STATES 4X4 LIGHT IS FLASHING	15 OPEN IN SWITCH	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY
KM8JN72D45U	2/05/05	11062	115.45		CUST STATES VEH STILL JERKS AND CUTS OFF	99 CODE P0123 HIGH INPUT ,P0507 IDLE CON. RPM HIGH	SCAN TOOL SCAN TOOL
KM8JN12D66U	9/07/05	9102	36.64	9102 INSPECT VEHICLE SAW ESP LIGHT WAS ON DUE TO INOP BRAKE LAMP SWITCH REPLACED SWITCH	DRIVER AIR BAG MODULE REPLACEMENT	CPN	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 9102 REPLACED AIR BAG MODULE AS PER BULLETIN

KM8JN12D66U	9/07/05	9102	36.64	9102 INSPECT VEHICLE SAW ESP LIGHT WAS ON DUE TO INOP BRAKE LAMP SWITCH REPLACED SWITCH	CUST STATES THE ESC LIGHT COMES ON AND OFF WHILE DRIVING		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 9102 INSPECT VEHICLE SAW ESP LIGHT WAS ON DUE TO INOP BRAKE LAMP SWITCH REPLACED SWITCH
KM8JM12B36U	8/23/05	9966	36.64	9966 HOOK UP HDS FOUND CODE C1513 BRAKE LAMP SWITCH FOUND BRAKE LAMP SWITCH CRANKED REPLACE BRAKE LAMP SWITCH OK COMP	DRIVER AIR BAG MODULE REPLACEMENT	CPN	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 9966 REPLACE AIR BAG MODULE COMP
KM8JN72D45U	2/05/05	11062	115.45		RECALL 922	RECALL COMPLETED	ESC EMC REPRORAMMING ESC EMC REPRORAMMING
KM8JN72D45U	2/05/05	11062	115.45		CUST STATES 4X4 LIGHT IS FLASHING	15 OPEN IN SWITCH	
KM8JN72D45U	2/05/05	11062	115.45		CUST STATES 4X4 LIGHT IS FLASHING	15 OPEN IN SWITCH	NO CHARGE NO CHARGE
KM8JN72D45U	2/05/05	11062	35.51		CUST STATES 4X4 LIGHT IS FLASHING	15 OPEN IN SWITCH	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY
KM8JM12B36U	8/23/05	9966	36.64	9966 HOOK UP HDS FOUND CODE C1513 BRAKE LAMP SWITCH FOUND BRAKE LAMP SWITCH CRANKED REPLACE BRAKE LAMP SWITCH OK COMP	CUST STATES THAT ESC LIGHT COMES ON AND OFF WHILE DRIVING		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 9966 HOOK UP HDS FOUND CODE C1513 BRAKE LAMP SWITCH FOUND BRAKE LAMP SWITCH CRANKED REPLACE BRAKE LAMP SWITCH OK COMP
KM8JN12DX6U	12/05/05	4555	25.5	4557 C1513 BRAKE SWITCH MALF ADJUSTMENT OF BRAKE SWITCH AS TSB 06-05-006 REC, EREASE DTC	CUST STATES THE ESC LIGHT KEEPS COMING ON WHEN DRIVING		MINOR DIAGNOSTIC MINOR DIAGNOSTIC 4557 C1513 BRAKE SWITCH MALF ADJUSTMENT OF BRAKE SWITCH AS TSB 06-05-006 REC, EREASE DTC
KM8JN72D45U	2/05/05	11062	35.51		CUST STATES VEH STILL JERKS AND CUTS OFF	99 CODE P0123 HIGH INPUT ,P0507 IDLE CON. RPM HIGH	SCAN TOOL SCAN TOOL
KM8JN72D45U	2/05/05	11062	35.51		RECALL 922	RECALL COMPLETED	ESC EMC REPRORAMMING ESC EMC REPRORAMMING
KM8JN72D45U	2/05/05	11062	35.51		CUST STATES 4X4 LIGHT IS FLASHING	15 OPEN IN SWITCH	
KM8JM12B86U	7/11/05	16210	36.8	16210 BRAKE LIGHT SWITCH IN OP REPLACED BRAKE LIGHT SWITCH	CUST STATES THE ESC LIGHT COMES ON WHILE DRIVING		WIRE REPAIR TIME (MINOR) WIRE REPAIR TIME (MINOR) 16210 BAD WIRE TO ESC SWITCH REPAIRED WIRE TO PLUG OF ECS SWITCH
KM8JM12B86U	7/11/05	16210	36.8	16210 BRAKE LIGHT SWITCH IN OP REPLACED BRAKE LIGHT SWITCH	CUST STATES THE REARN BRAKE LIGHTS ARE INOPPT		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 16210 BRAKE LIGHT SWITCH IN OP REPLACED BRAKE LIGHT SWITCH
KM8JN12DX6U	12/05/05	6008	36.8	6014 C1513 BRAKE SWITCH, FOUND IT WITH AN OPEN IN ITS INNER CIRCUITS REPLACED SWITCH, EREASE DTC	CUSTOMER STATES THE ESC LIGHT COMES ON AND STAYS ON* SOP PART IS IN		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 6014 C1513 BRAKE SWITCH, FOUND IT WITH AN OPEN IN ITS INNER CIRCUITS REPLACED SWITCH, EREASE DTC
KM8JN72D45U	2/05/05	11062	35.51		CUST STATES 4X4 LIGHT IS FLASHING	15 OPEN IN SWITCH	NO CHARGE NO CHARGE
KM8JM12B96U	11/06/05	12286	31.7		CUST. STATES ESC LIGHT STAYING ON AT TIMES	15	REPLACE PARKING BRAKE SWITCH PARKING BRAKE SWITCH
KM8JN12D45U	6/01/05	20325	35		C/S BRAKE LIGHT SWITCH	BRAKE LAMP SWITCH OPEN/SHORT	REPLACED BRAKE LAMP SWITCH 93810R00,N94/C15
KM8JM12B66U	7/13/05	11702	36.8	11703 SOB PART TO INSTALLED INSTALLED BRAKE PEDAL SWITCH	CUST STATES THE ESC LIGHT STAYS ON	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 11703 SOB PART TO INSTALLED INSTALLED BRAKE PEDAL SWITCH
KM8JN12D56U	9/28/05	27416	36.64	27416 HOOK UP HDS FOUND CODE C1513 BRAKE LAMP SWITCH CHK SWITCH NOT WORKING REPLACE BRAKE LAMP SWITCH OK ROAD TEST COMP	DRIVER AIR BAG MODULE REPLACEMENT		DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 27416 REPLACE AIR BAG MODULE COMP
KM8JN12D45U	6/01/05	32861	33.04		C/S ESC LIGHT HAS COME ON WHILE DRIVING	C1512 BRAKE LAMP SWITCH, CHECK SWITCH-OHMS OUT-OK PLUGGER STICKS IN AT TIMES	REPLACE BRAKE LAMP SWITCH AND ADJUST AND RETESTOK 93810R00/N-94/C-15
KM8JN12D75U	5/21/05	15536	33.04		C/S ESP KEEPS GOING OFF WHILE DRIVING	POOR CONTACT IN STOP LAMP SWITCH	REPLACED BRAKE LAMP SWITCH 93810R00,N94/C15
KM8JN12D46U	8/22/05	13274	35		BRAKE LIGHT	WARNING LIGHT ON, POOR CONTACT	REPLACED STOP LIGHT SWITCH 93810R00/N-69/C-15
KM8JN12D46U	8/22/05	13274	35		C/S CK CAR STUMBLES WHILE DRIVING LIKE IT IS NOT GETTING FUEL AT LOW SPEEDS	CAR STUMBLES, POOR CONTACT	REPLACED THROTTLE POSITION SENSOR 35102R00/35102RPO/N-03/C-15
KM8JN12D56U	9/28/05	27416	36.64	27416 HOOK UP HDS FOUND CODE C1513 BRAKE LAMP SWITCH CHK SWITCH NOT WORKING REPLACE BRAKE LAMP SWITCH OK ROAD TEST COMP	CUSTOMER STATES "ESC" LIGHT GOING ON BY ITSELF, WHEN IT GOES OFF, VEHICLE IN MOTION, HIT BUTTON TO ACTIVATE AND IT WON'T ACTIVATE, MUST SHUT OFF VEHICLE AND RESTART.		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 27416 HOOK UP HDS FOUND CODE C1513 BRAKE LAMP SWITCH CHK SWITCH NOT WORKING REPLACE BRAKE LAMP SWITCH OK ROAD TEST COMP
KM8JM12B46U	7/09/05	11606	27.3	11606 SCANTOOL TEST CODE C1513 BRAKE LAMP SWITCH ADDJUST BRAKE LAMP SWITCH	CUST STATES THAT ESC LIGHT COMES ON AND OFF WHILE DRIVING	.F	ADJUST STOP LAMP SWITCH STOP LAMP SWITCH ASSY RE 11606 SCANTOOL TEST CODE C1513 BRAKE LAMP SWITCH ADDJUST BRAKE LAMP SWITCH
KM8JN12D16U	9/22/05	20752	36.96	20752 HOOK UP HDS FOUND CODE C1513 BRAKE LITE SWITCH CHK SWITCH NOT WORKING REPLACE BRAKE LITE SWITCH OK COMP	CUSTOMER STATES "ESC" LIGHT COMES ON AND OFF INTERMITTENTLY		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 20752 HOOK UP HDS FOUND CODE C1513 BRAKE LITE SWITCH CHK SWITCH NOT WORKING REPLACE BRAKE LITE SWITCH OK COMP
KM8JN12D96U	12/16/05	28627	33.36		C/S YESTERDAY VEHICLE WOULD NOT GO ABOVE 2500 RPM OR FASTER THAN 45 MPH TODAY VEHICLE RUNNING FINE	C1315 BRAKE LAMP SWITCH CHECK SWITCH PER TSB PASSES OHM TEST BUT PLUNGER STICKS AT TIMES CAUSING NO BRAKE LIGHTS	REPLACED BRAKE LAMP SWITCH AND RETEST 93810R00,N94/C31
KM8JN12D56U	7/15/05	8941	35		C/S ECS LIGHT SOME TIMES COMES ON & STAYS ON	ECS LIGHT STAYING ON- INOPERATIVE STOP LIGHT	REPLACED STOP LIGHT SWITCH 93810R00,N68/C15

KM8JN12D56U	7/15/05	8941	35		C/S C/D PLAYER NOT WORKING RIGHT-1 CD IN DISC ONE BUT STUCK ON DISC 2-WILL NOT LOAD OR UN LOAD ANY OTHER CD	CD PLAYER NOT WORKING SHORT/POOR CONTACT	REPLACED RADIO 96300R00 N94/C15
KM8JN72D96U	8/16/05	15847	36.96		CUST STATES THE ESC LIGHT COMES ON WHEN DRIVING	.	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JM12B46U	7/09/05	14065	36.96	14065 INSPECT VEHICLE SAW THAT THE ESC LIGHT WAS ON DUE TO FAULTY BRAKE SWITCH REPLACED SWITCH AND RESET CODES	CUSTOMER STATES ESC LIGHT STILL COMES ON WHEN DRIVING	.	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 14065 INSPECT VEHICLE SAW THAT THE ESC LIGHT WAS ON DUE TO FAULTY BRAKE SWITCH REPLACED SWITCH AND RESET CODES
KM8JM12B05U	5/13/05	19449	36.64	19449 INSPECT VEHICLE SAW THAT THE ESP LIGHT WAS ON DUE TO FAULTY BRAKE LAMP SWITCH REPLACED BRAKE SWITCH	CUST STATES THE ESP LIGHT STAYS ON	F	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 19449 INSPECT VEHICLE SAW THAT THE ESP LIGHT WAS ON DUE TO FAULTY BRAKE LAMP SWITCH REPLACED BRAKE
KM8JN12D06U	1/23/06	19067	33.36		CUSTOMER STATES ESC OFF LIGHT COMES ON INTERMITTANTLY WHILE DRIVING.. CHECK AND ADVISE	OPEN IN STOP LAMP SWITCH	REPLACE STOP LAMP SWITCH 93810R00 N94/C15
KM8JN12D56U	11/08/05	18314	33.36		C/S ESC LIGHT ON	C1513 BRAKE LAMP SWITCH ELECTRICAL FAILURE BRAKE LIGHT SWITCH INOP INTERMITTANTLY	REPLACED BRAKE LIGHT SWITCH 93810R00,N94/C15
KM8JN12D05U	6/16/05	30824	33.36		CUSTOMER STATES ESP LIGHT COMES ON AND GOES OFF.. CHECK AND ADVISE	C1513	REPLACE 3D BRAKE LAMP SWITCH , CLEAR CODE AND RE TEST OK 93810R00,N94C15
KM8JN12D05U	6/09/05	20936	36.96	20936 HOOK UP HDS FOUND CODE C1513 BRAKE LAMP SWITCH OPEN/SHORT REPLACE BRAKE LAMP SWITCH OK COMP	DRIVER AIR BAG MODULE REPLACEMENT	F	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 20936 REPLACE AIR BAG MODULE COMP
KM8JN12D05U	6/09/05	20936	36.96	20936 HOOK UP HDS FOUND CODE C1513 BRAKE LAMP SWITCH OPEN/SHORT REPLACE BRAKE LAMP SWITCH OK COMP	CUST ST ATE STHE PASS SIDE POWER MIRROR DOES NOT WORK	.	'POWER' WINDOW REG. SWITCH ASS'Y (LH) RE 'POWER' WINDOW REG. SWITCH ASS'Y (LH) RE 20936 CHK POWER MIRROR SWITCH BAD OREDREDNEW POWER MIRROR SWITCH COMP
KM8JN12D26U	7/27/05	25785	35.46		CUSOTMER STATES ESC LIGHT IS COMING ON AND OFF CHECK AND ADVISE	FOUND FATIGUED STOP LAMP SWITCH	NECESSARY TO REPLACE STOP LAMP SWITCH ASSY
KM8JN12D96U	11/08/05	24339	31.26		CUST. STATES ESC OFF LIGHT KEEPS COMING ON, CHECK AND ADVISE	15	TEST AND REPLACE BRAKE LAMP SWITCH STOP LAMP SWITCH ASS'Y RE
KM8JN72D26U	7/27/05	13721	30.94				
KM8JN12D05U	6/09/05	20936	36.96	20936 HOOK UP HDS FOUND CODE C1513 BRAKE LAMP SWITCH OPEN/SHORT REPLACE BRAKE LAMP SWITCH OK COMP	CUST STATES THE ESC LIGHT COMES ON WHILE DRIVING	F	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 20936 HOOK UP HDS FOUND CODE C1513 BRAKE LAMP SWITCH OPEN/SHORT REPLACE BRAKE LAMP SWITCH OK COMP
KM8JM12BX5U	4/22/05	26157	36.64	26157 INSPECT VEHICLE SAW THAT THE ESP LIGHT WAS ON CODE C1513 BRAKE LAMP SWITCH CAME UP REPLACED BRAKE SWITCH	CUST STATES THAT ESP LIGHT COMES ON AND OFF	.	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 26157 INSPECT VEHICLE SAW THAT THE ESP LIGHT WAS ON CODE C1513 BRAKE LAMP SWITCH CAME UP REPLACED BRAKE SWITCH
KM8JM12BX6U	9/02/05	5200	27.3		CUSTOMER STATES "ESC" LIGHT COMES ON PERIODICALLY	.	ADJUSTED BRAKE SWITCH TO RESOLVE ESC LIGHT ISSUE/COMPLETE MINOR DIAGNOSTIC
KM8JN12D16U	11/10/05	28954	31.26				
KM8JN12D96U	10/25/05	23643	31.26				
KM8JN12D46U	11/22/05	28715	30.94				
KM8JM12B75U	5/13/05	33528	31.11	CHECK ESC LIGHT SCAN FOR CODES FOUND C1513 BRAKE LAMP SWITCH SHORTED REPLACED SWITCH ASSEMBLY CLEARED CODES ALL OK AT THIS TIME			
KM8JM12B76U	7/14/05	22886	36.8	22886 CHK BRAKE LITES NOT WORKING CHK FUES OK CHK BRAKE LITE SWITCH NOT WORKING REPLACE BRAKE LITE SWITCH ASSY OK COMP	CUST STATES THE ESC LIGHT COMES ON AND OFF THE REAR BRAKE LIGHTS ARE INOPPT	.	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 22886 CHK BRAKE LITES NOT WORKING CHK FUES OKCHK BRAKE LITE SWITCH NOT WORKING REPLACEBRAKE LITE SWITCH ASSY OK COMP
KM8JM12B15U	7/05/05	33823	36.64	REPLACED BRAKE SWITCH	TECHNICIAN FOUND ESP LIGHT ON	TECHNICIAN FOUND ESPLIGHT ON AFTER TESTDRIVE*FOUND BRAKE SWITCH NOT WORKING	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE REPLACED BRAKE SWITCH
KM8JN12D26U	9/22/05	27938	27.3	27938 BRAKE LIGHT SWITCH HAS TO BE ADJUSTED ADJUSTED BRAKE LIGHT SWITCH	DRIVER AIR BAG MODULE REPLACEMENT	.	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 27938 REQUESTED CAMPAIGN COMP CAMPAIGN[07-01-001]
KM8JN72D36U	10/01/05	41265	31.11	SCANNED FOR CODES HAD CODE C1513 BRAKE LAMP SWITCH ERROR FOUND SHORT IN SWITCH REPLACED SWITCH CLEARED CODE ALL OKAY AT THIS TIME			
KM8JN12D66U	10/25/05	24974	31.11	SCAN FOR CODES FOUND C1513 BRAKE LAMP SWITCH SHORTED REPLACED SWITCH ASSEMBLY AND CLEARED CODES ALL OK AT THIS TIME			

KM8JN12D35U		5/30/05	49776	33.06	49776 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT 5958 DIAGNOSED FOR ESC LIGHT ON.PERFORMED GDS OPERATION.FOUND B1513 BRAKE LAMP SWITCH CODE TO BE PRESENT.TESTED BRAKE LAMP SWITCH.FOUND SWITCH TO HAVE AN OPEN CIRCUIT.REMOVED AND REPLACED BRAKE LAMP SWITCH.CLEARE	CUSTOMER STATES EPS LIGHT IS ON	B1513 BRAKE LAMP SWITCH OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE 49776 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT5958 DIAGNOSED FOR ESC LIGHT ON.PERFORMEDGDS OPERATION.FOUND B1513 BRAKE LAMP SWITCHCODE TO BE PRESENT.TESTED BRAKE LAMP SWITCH.FOUND SWITCH TO HAVE AN OPENCIRCUIT
KM8JN12D26U		9/22/05	27938	27.3	27938 BRAKE LIGHT SWITCH HAS TO BE ADJUSTED ADJUSTED BRAKE LIGHT SWITCH	CUST STATES THE ESC LIGHT COME ON WHILE DRIVING		STOP LAMP SWITCH ASS'Y RE 27938 BRAKE LIGHT SWITCH HAS TO BE ADJUSTEDADJUSTED BRAKE LIGHT SWITCH
KM8JN12D26U		9/22/05	27938	27.3	27938 BRAKE LIGHT SWITCH HAS TO BE ADJUSTED ADJUSTED BRAKE LIGHT SWITCH	CUST STATES THE WINDSHIELD WASHER PUMP HAS A LOW FLOW LIKE IT MAYBE CLOGGED CHECK AND ADVISE		WINDSHIELD WASHER MOTOR &PUMP ASS'Y RE WINDSHIELD WASHER MOTOR &PUMP ASS'Y RE 27938 WASHER PUMP IN OP REPLACED WASHER PUMP
KM8JN12D35U		5/30/05	49776	33.06	49776 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT 5958 DIAGNOSED FOR ESC LIGHT ON.PERFORMED GDS OPERATION.FOUND B1513 BRAKE LAMP SWITCH CODE TO BE PRESENT.TESTED BRAKE LAMP SWITCH.FOUND SWITCH TO HAVE AN OPEN CIRCUIT.REMOVED AND REPLACED BRAKE LAMP	CUSTOMER STATES ABS LIGHT IS ON	SEE LINE B	SEE LINE B FOR REPAIRS SEE LINE B FOR REPAIRS 49776 SEE LINE B 5958
KM8JN12D35U		5/30/05	49776	33.06	49776 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT 5958 DIAGNOSED FOR ESC LIGHT ON.PERFORMED GDS OPERATION.FOUND B1513 BRAKE LAMP SWITCH CODE TO BE PRESENT.TESTED BRAKE LAMP SWITCH.FOUND SWITCH TO HAVE AN OPEN CIRCUIT.REMOVED AND REPLACED BRAKE LAMP	CUSTOMER STATES HORN DOES NOT WORK	CUSTOMER WIL RETURN FOR REPAIRS	SPECIAL ORDER PART SPECIAL ORDER PART 49776 CUSTOMER WIL RETURN FOR REPAIRS 5958SOP HIGH AND LOW PITCH HORNS
KM8JN12D25U		4/18/05	45277	36.96	45277 AFTER DIAG. FOUND BRAKE LIGHT SWITCH TO BE INOP REPLACE BRAKE LIGHT SWITCH	CUSTOMER CAME IN BEFORE WITH PROBLEM WHEN DECELERATING IT FEELS LIKE BRAKING COULD NOT DUPLICATE DOING SAME THING AGAIN CHECK 7 ADVISE	REPALCED BRAKE LIGHTSENSOR SWITCH	STOP LAMP SWITCH ASS'Y RE 45277 AFTER DIAG. FOUND BRAKE LIGHT SWITCH TOBE INOP REPLACE BRAKE LIGHT SWITCH
KM8JM12BX6U		8/29/05	17048	36.8	17048 SCAN ESC LIGHT C1513 BRAKE SWICTH ERROR NEED TO REPLACE BRAKE SWICTH ASSY. REMOVE & INSTALL BRAKE SWICTH ASSY & ADJUST BRAKE SWICTH TEST DROVE CAR.	CUSTOMER STATES THE ESC LIGHT ON	F	STOP LAMP SWITCH ASS'Y RE 17048 SCAN ESC LIGHT C1513 BRAKE SWICTH ERRORNEED TO REPLACE BRAKE SWICTH ASSY. REMOVE &INSTALL BRAKE SWICTH ASSY & ADJUST BRAKESWICTH TEST DROVE CAR.
KM8JM12B36U		11/19/05	20678	27.3	20678 BRAKE LIGHT SWITCH OUT OF ADJUSTMENT REAJUSTED BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING PLS CHECK		TECH ADJUSTED BRAKE LIGHTSWICTH MINOR DIAGNOSTIC 20678 BRAKE LIGHT SWITCH OUT OF ADJUSTMENTREAJUSTED BRAKE
KM8JN12D35U		5/30/05	49776	33.06	49776 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT 5958 DIAGNOSED FOR ESC LIGHT ON.PERFORMED GDS OPERATION.FOUND B1513 BRAKE LAMP SWITCH CODE TO BE PRESENT.TESTED BRAKE LAMP SWITCH.FOUND SWITCH TO HAVE AN OPEN CIRCUIT.REMOVED AND REPLACED BRAKE LAMP	CUSTOMER STATES VEHICLE WILL NOT START	BATTERY TESTED AS BAD	BATTERY ASSY RE BATTERY ASSY RE 50098 BATTERY TESTED AS BAD 6013 PEFORMEDIAGNOSIS/ FOUND BATTERY TO TEST AS BAD WITH0CCA/9.22V/ REPLACED BATTERY AND TEST DROVEVEHICLE FOR 6 MILES/ VEHICLE STARTINGNORMALLY AFTER REPAIR AT THIS TIME
KM8JN12D17U		5/23/06	6170	18.2		CUST STATES THE ESC LIGHT COMES ON WHILE DRIVING		ADJUSTED AND LUBED BRAKE SWITCH MINOR DIAGNOSTIC MINOR DIAGNOSTIC MINOR
KM8JM12B86U		1/10/06	7548	17	7549 C1513 BRAKE LAMP SWITCH ADJUSTED BRAKE SWITCH AND LUBE CONNECTION	CUSTOMER STATES ECS LIGHT KEEPS COMING ON WHEN DRIVING	F	DIAGNOSTIC 7549 C1513 BRAKE LAMP SWITCH ADJUSTED BRAKESWITCH AND LUBE CONNECTION
KM8JM12B77U		11/15/06	6374	36.96	6374 INSPECT VEHICLE SAW THAT THE ESC LIGHT WAS ON DUE TO INTERNAL FAILURE REPLACED SWITCH	CUSTOMER STATES ESC LIGHT IS ON		93810R00 MINOR DIAGNOSTIC 6374 INSPECT VEHICLE SAW THAT THE ESC LIGHTWAS ON DUE TO INTERNAL FAILURE REPLACEDSWITCH
KM8JN12D35U		5/30/05	49776	33.06	49776 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT 5958 DIAGNOSED FOR ESC LIGHT ON.PERFORMED GDS OPERATION.FOUND B1513 BRAKE LAMP SWITCH CODE TO BE PRESENT.TESTED BRAKE LAMP SWITCH.FOUND SWITCH TO HAVE AN OPEN CIRCUIT.REMOVED AND REPLACED BRAKE LAMP SWITCH.CLEARE	CUSTOMER STATES HORNS ARE INOP/SOP	BOTH HORNS INTERNAL SHORT	HORN ASSY (BOTH SIDES) RE HORN ASSY (BOTH SIDES) RE 50098 BOTH HORNS INTERNAL SHORT 5958DIAGNOSED FOR HORN INOP.INSPECTED HORNS.FOUNDBOTH HORNS TO BE INOP.SWAPPED HORNS WITHKNOWN GOOD HORNS.TEST HORN OPERATING WITHNSPEC ON BOTH CIRCUITS.TESTED HORNS FROM
KM8JN12D56U		7/29/05	21893	32.74	21893 B 1513 BREAK LIGHT SWITCH CIRCUIT MAL 6013 PEFORMED GDS DIAGNOSIS FOUND DTC B1513 BRAKE LAMP SWITCH CIRCUIT MAL REPLACED BRAKE LAMP SWITCH CLEARED CODE AND RECHECKED ESC FOR DTCS FOUND NO CODES AT THIS TIME	CUSTOMER STATES CHECK ENGINE LIGHT ON	P0130 O2 SENSOR CIRCUIT MALFUNCTION (B1S1)	SENSOR ASSY-OXYGEN (1.8-4.5 DOHC) RE SENSOR ASSY-OXYGEN (1.8-4.5 DOHC) RE 21893 P0130 O2 SENSOR CIRCUIT MALFUNCTION(B1S1) 6013 PEFORMED DIAGNOSIS USING GDS/FOUND DTC P0130 O2 SENSOR CIRCUITMALFUNCTION(B1/S1) FOUND B1S1 O2 SENSOR TOHAVE OPEN/SHORT/ REPLACED

KM8JM12B87U	11/01/06	5145	36.96	5146 P0455 LARGE LEAK, C 1513 BRAKE LAMP SWITCH CHECK BRAKE SWITCH, FOUND AN OPEN, REPLACED IT CHECK EVAP SYST, LOOSE GAS CAP, TIGHT IT, TESTE EVAP FOR LEAKS, NONE WERE FOUND. ERASE DTC TEST DROVE	CUSTOMER STATES CHECK ENGINE LIGHT IS ON AND ESC LIGHT STAYS ON PLS CHECK	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 5146 P0455 LARGE LEAK, C 1513 BRAKE LAMP SWITCH CHECK BRAKE SWITCH, FOUND AN OPEN, REPLACED IT CHECK EVAP SYST, LOOSE GAS CAP, TIGHT IT, TESTE EVAP FOR LEAKS, NONE WERE FOUND. ERASE DTC TEST DROVE
KM8JN12D15U	7/08/05	7793	32.58		CUSTOMER STATES BRAKE LIGHT ON	OPEN IN STOP LAMP SWITCH	REPLACE STOP LAMP SWITCH
KM8JN12D56U	7/29/05	21893	32.74	21893 B 1513 BREAK LIGHT SWITCH CIRCUIT MAL 6013 PEFORMED GDS DIAGNOSIS FOUND DTC B1513 BRAKE LAMP SWITCH CIRCUIT MAL REPLACED BRAKE LAMP SWITCH CLEARED CODE AND RECHECKED ESC FOR DTCS FOUND NO CODES AT THIS TIME	CUSTOMER STATES CHECK ENGINE LIGHT ON	P0130 O2 SENSOR CIRCUIT MALFUNCTION (B1S1)	SENSOR ASSY-OXYGEN ADD SCAN TOOL OPERATION SENSOR ASSY-OXYGEN ADD SCAN TOOL OPERATION 21893 P0130 O2 SENSOR CIRCUIT MALFUNCTION(B1S1) 6013 PEFORMED DIAGNOSIS USING GDS/FOUND DTC P0130 O2 SENSOR CIRCUITMALFUNCTION(B1/S1) FOUND B1S1 O2 SENSOR TOHAVE OPEN/SHO
KM8JN12D56U	7/29/05	21893	32.74	21893 B 1513 BREAK LIGHT SWITCH CIRCUIT MAL 6013 PEFORMED GDS DIAGNOSIS FOUND DTC B1513 BRAKE LAMP SWITCH CIRCUIT MAL REPLACED BRAKE LAMP SWITCH CLEARED CODE AND RECHECKED ESC FOR DTCS FOUND NO CODES AT THIS TIME	CUSTOMER STATES DR DOOR TRIM COMINGAPART	VEHICLE BIENG SENT TO BODY SHOP FOR REPAIR	TAPE-FRONT DOOR BLACK FRAME REAR (BOTH SIDES) RE TAPE-FRONT DOOR BLACK FRAME REAR (BOTH SIDES) RE 21893 VEHICLE BIENG SENT TO BODY SHOP FORREPAIR 6013 ALLSTAR TOYOTA INSTALL BOTHFRONT DOOR TAPE
KM8JN12D36U	2/24/06	17762	33.04		CUSTOMER STATES: ESC LIGHT WILL COME ON AND THEN GO OFF AT TIMES -UNDER ANY DRIVING CONDITION	C1513 - BRAKE SWITCH MALFUNCTION	REPLACED BRAKE SWITCH - OPERATING AS DESIGNED AT THIS TIME
KM8JN12D36U	2/24/06	17762	33.04		CUSTOMER STATES: DRIVER'S DOOR WEATHERSTRIPPING COMING APART	WEATHER STRIPPING WORN AND SPLITTING	ORDERED PART
KM8JM12B25U	5/17/05	31802	33.04		CUSTOMER STATES: ESP LIGHT STAYS ON, BRAKE LIGHT COMES ON, A/C COMES ON AND OFF AND LIGHTS GO OFF -NO AIR OUT OF VENTS	STOP LAMP SWITCH MALFUNCTION CODE C1513	REPLACED STOP LAMP SWITCH - VEHICLE OPERATING AS DESIGNED AT THIS TIME
KM8JN12D56U	7/29/05	21893	32.74	21893 B 1513 BREAK LIGHT SWITCH CIRCUIT MAL 6013 PEFORMED GDS DIAGNOSIS FOUND DTC B1513 BRAKE LAMP SWITCH CIRCUIT MAL REPLACED BRAKE LAMP SWITCH CLEARED CODE AND RECHECKED ESC FOR DTCS FOUND NO CODES AT THIS TIME	CUSTOMER STATES ESC ON	B 1513 BREAK LIGHT SWITCH CIRCUIT MAL	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21893 B 1513 BREAK LIGHT SWITCH CIRCUIT MAL6013 PEFORMED GDS DIAGNOSIS/ FOUND DTC B1513BRAKE LAMP SWITCH CIRCUIT MAL/ REPLACED BRAKELAMP SWITCH/ CLEARED CODE AND RECHECKED ESCFOR DTCS/ FOUND NO CODES AT THI
KM8JN12D56U	7/29/05	21893	32.74	21893 B 1513 BREAK LIGHT SWITCH CIRCUIT MAL 6013 PEFORMED GDS DIAGNOSIS FOUND DTC B1513 BRAKE LAMP SWITCH CIRCUIT MAL REPLACED BRAKE LAMP SWITCH CLEARED CODE AND RECHECKED ESC FOR DTCS FOUND NO CODES AT THIS TIME	CUSTOMER STATES DR DOOR TRIM COMINGAPART	VEHICLE BIENG SENT TO BODY SHOP FOR REPAIR	SPOT REPAIR SPOT REPAIR 21893 VEHICLE BIENG SENT TO BODY SHOP FORREPAIR 6013 ALLSTAR TOYOTA INSTALL BOTHFRONT DOOR TAPE
KM8JN12D15U	5/23/05	16756	33.04		CUSTOMER STATES: TRACTION CONTROL AND ESP LIGHT IS ON	CODE C1513 BRAKE LAMP SWITCH INOP.	REPLACED SWITCH, CLEARED CODE AND TEST DROVE - OPERATING AS DESIGNED AT THIS TIME
KM8JN72D76U	7/26/05	14993	34.54		CUSTOMER STATES THAT CHECK ENGINE LIGHT IS ON LIGHT IS ON AND OFF 3-4 TIMES A WEEK	N94/C15/93810R00/0.3	BRAKE LAMP SWITCH CODE C1513.TESTED AND REPLACED SHORTED BRAKE LAMP SWITCH.
KM8JN72D76U	7/26/05	14993	34.54		CAMP 079 DRIVER AIR BAG COVER MOD 07-01-001	61B046R0/0.2	REPLACED DRIVERS AIR BAG MODULE COVER.
KM8JN72D46U	7/30/05	21817	34.4		CUST STATES ESC OFF LIGHT COMES ON DRIVING + STAYS ON + WILL NOT GO OFF	N94/C15/93810R00/0.3	SCAN TEST CODE C1513 BRAKE SWITCH.CHECKED ELECTRICAL HARNESSFOR SWITCH OK.REPLACED BRAKE LIGHT SWITCH.
KM8JN12D56U	7/29/05	21893	32.74	21893 B 1513 BREAK LIGHT SWITCH CIRCUIT MAL 6013 PEFORMED GDS DIAGNOSIS FOUND DTC B1513 BRAKE LAMP SWITCH CIRCUIT MAL REPLACED BRAKE LAMP SWITCH CLEARED CODE AND RECHECKED ESC FOR DTCS FOUND NO CODES AT THIS TIME	CUSTOMER STATES DR DOOR TRIM COMINGAPART	VEHICLE BIENG SENT TO BODY SHOP FOR REPAIR	21893 VEHICLE BIENG SENT TO BODY SHOP FORREPAIR 6013 ALLSTAR TOYOTA INSTALL BOTHFRONT DOOR TAPE
KM8JN12D56U	7/29/05	21893	32.74	21893 B 1513 BREAK LIGHT SWITCH CIRCUIT MAL 6013 PEFORMED GDS DIAGNOSIS FOUND DTC B1513 BRAKE LAMP SWITCH CIRCUIT MAL REPLACED BRAKE LAMP SWITCH CLEARED CODE AND RECHECKED ESC FOR DTCS FOUND NO CODES AT THIS TIME	CAMPAIGN T079	SOP AIR BAG COVER	SPECIAL ORDER PART SPECIAL ORDER PART 21893 SOP AIR BAG COVER 6013 SOP AIR BAGCOVER
KM8JN72D46U	7/30/05	28031	34.54	C/S ESC OFF LIGHT KEEPS COMING ON, BRAKE LAMP MALFUNCTION, REPALCED SWITCH	DRIVEW BELT AND TENSIONER.	BELT NOISY	REPLACED BELT AN TENSIONER
KM8JN72D46U	7/30/05	28031	34.54	C/S ESC OFF LIGHT KEEPS COMING ON, BRAKE LAMP MALFUNCTION, REPALCED SWITCH	C/SA ESC OFF LIGHT KEEPS COMING ON.	BRAKE LAMP SWITHC MALFUNTICON	REPLACED SWITCH

KM8JM12B56U	7/14/05	17402	34.86	C/S BRAKE LIGHTS OUT ALONG WITH ASC LIGHT. SWITCH INOP REPLACED STOP SWITCH	CUST STATES ALL BRAKE LIGHTS OUT ALONG WITH ASC LIGHT	ASC LIGHT INOP	REPLACED BRAKE SWITCH
KM8JN12D27U	11/01/06	11	32.74	11 BRAKE LAMP SWITCH OPEN CIRCUIT 5958 DIAGNOSED FOR BRAKES INOP PERFORMED SCAN TOOL DIAGNOSES FOUND BRAKE LAMP SWITCH CODE TO BE PRESENT FOUND BRAKE LAMP SWITCH TO HAVE AN OPEN CIRCUIT REMOVED AND REPLACED BRAKE LAMP SWITCH TESTED BRAKES AFTER REPAIRS B	BRAKE LIGHTS INOP	BRAKE LAMP SWITCH OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 11 BRAKE LAMP SWITCH OPEN CIRCUIT 5958DIAGNOSED FOR BRAKES INOP.PERFORMED SCAN TOOLDIAGNOSES.FOUND BRAKE LAMP SWITCH CODE TO BEPRESENT.FOUND BRAKE LAMP SWITCH TO HAVE ANOPEN CIRCUIT.REMOVED AND REPLACED B
KM8JN12D27U	11/01/06	11	32.74	11 BRAKE LAMP SWITCH OPEN CIRCUIT 5958 DIAGNOSED FOR BRAKES INOP PERFORMED SCAN TOOL DIAGNOSES FOUND BRAKE LAMP SWITCH CODE TO BE PRESENT FOUND BRAKE LAMP SWITCH TO HAVE AN OPEN CIRCUIT REMOVED AND REPLACED BRAKE LAMP SWITCH TESTED BRAKES AFTER REPAIRS B	PRE-DELIVERY INSPECTION	COMPLETED PDI SINEPCTION	PRE-DELIVERY INSPECTION PRE-DELIVERY INSPECTION 11 COMPLETED PDI SINEPCTION 5958 PERFORMEDPDI INSPECTION ON VEHILCE
KM8JN12D56U	11/16/05	12068	34.36		CUSTOMER STATES OCC WHILE DRIVING ECS LIGHT WILL COME ON CANTURN CAR OFF AND RESTAT WILL GO OUT	OPEN CIRCUIT STOP LAMP SWITCH	REPLACED STOP LLAMP SWITCH
KM8JN12D56U	11/16/05	21434	32.4	TECH SCAN TESTED VEHICLE FOUND CODE C1513 FAULTY BRAKE LAMP NECESSARY TO REMOVE AND REPLACE BRAKE LAMP	CUSTOMER STATES ESC LIGHT ON DASH WILL COME ON HAVE TO TURN CAR OFF TO RESET	TEST AND INSPECT FOUND OPEN CIRCUIT STOPLAMP SWITCH	REPLACED SWOTCH
KM8JM12B36U	3/06/06	24924	33.06	24924 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT 5958 DIAGNOSED FOR ESC LIGHT.PERFORMED GDS OPERATION.FOUND CODE B1513 BRAKE LAMP SWITCH.TESTED SWITCH.FOUND SWITCH TO HAVE AN OPEN CIRCUIT.REMOVED AND REPALCED BRAKE LAMP SWITCH.CLEARED CODES.VEHICLE OPERATING WI	CUSTOMER STATES ESC LIGHT IS ON	B1513 BRAKE LAMP SWITCH OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 24924 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT5958 DIAGNOSED FOR ESC LIGHT.PERFORMED GDSOPERATION.FOUND CODE B1513 BRAKE LAMP SWITCH.TESTED SWITCH.FOUND SWITCH TO HAVE ANOPEN CIRCUIT.REMOVED AND REPALCED BRAKE
KM8JM12B36U	3/06/06	24924	33.06	24924 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT 5958 DIAGNOSED FOR ESC LIGHT.PERFORMED GDS OPERATION.FOUND CODE B1513 BRAKE LAMP SWITCH.TESTED SWITCH.FOUND SWITCH TO HAVE AN OPEN CIRCUIT.REMOVED AND REPALCED BRAKE LAMP SWITCH.CLEARED CODES.VEHICLE OPERATING WI	CUSTOMER STATES A/C BLOWER MOTOR ISINOP AT TIMES	SEE LINE C	SEE LINE C FOR REPAIRS SEE LINE C FOR REPAIRS 24924 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT5958 DIAGNOSED FOR ESC LIGHT.PERFORMED GDSOPERATION.FOUND CODE B1513 BRAKE LAMP SWITCH.TESTED SWITCH.FOUND SWITCH TO HAVE ANOPEN CIRCUIT.REMOVED AND REPALCED BRAKE LAM
KM8JM12BX5U	5/13/05	38257	32.4	TECH INSPECTED FOUND OPEN CIRCUIT IN STOP LAMP SWITCH NECESSARY TO REMOVE AND REPLACE STOP LAMP SWITCH	CUSTOMER STATES WHILE DRIVING TRUCK WILL CUT OFF AND HAVE TOBE RECRANKED DID THIS AFTER TANK FILLED AND WENT DOWN TO 1/4	TEST AND INSPECT NO CODES STORED TEST DROVE TEC AND SER MANAGER. 21 MILES	COULD NOT DUPLICATE CUSTOMER COMPLANTE
KM8JM12BX5U	5/13/05	38257	32.4	TECH INSPECTED FOUND OPEN CIRCUIT IN STOP LAMP SWITCH NECESSARY TO REMOVE AND REPLACE STOP LAMP SWITCH	CUSTOMER STATES FUEL GUAGE NOT GOING TO TOP WHEN FILLED	TEST AND INSPECT FOUND SENDING UNIT INCORRECT	REPLACED SENDING UNIT
KM8JM12BX5U	5/13/05	38257	32.4	TECH INSPECTED FOUND OPEN CIRCUIT IN STOP LAMP SWITCH NECESSARY TO REMOVE AND REPLACE STOP LAMP SWITCH	CUSTOMER STATES HORN NOT BLOWING	OPEN CIRCUIT HORN	REPLACED FAILED HORN
KM8JM12B36U	3/06/06	24924	33.06	24924 B1513 BRAKE LAMP SWITCH OPEN CIRCUIT 5958 DIAGNOSED FOR ESC LIGHT.PERFORMED GDS OPERATION.FOUND CODE B1513 BRAKE LAMP SWITCH.TESTED SWITCH.FOUND SWITCH TO HAVE AN OPEN CIRCUIT.REMOVED AND REPALCED BRAKE LAMP SWITCH.CLEARED CODES.VEHICLE OPERATING WI	CUSTOMER STATES ENGINE IS MAKING NOISE WHEN GOING OVER 50MPH	S/O/P COMPRESSOR	SPECIAL ORDER PART SPECIAL ORDER PART 24924
KM8JN12D15U	10/14/04	21717	32.46	21717 BRAKELIGHT SWITCH SHORTED 6131 PERFORMED INSPECTION FOUND CRUISE CONTROL INOP TESTED FOUND BRAKELIGHT SWITCH TO HAVE INTERNAL SHORT AND WILL NOT LET CRUISE OPERATE PROPERLY REMOVED AND REPLACED BRAKELIGHT SWITCH TEST DROVE CRUISE WORKING NORMALLY AT	CUSOTMER STATES CRUISE CONTROL INOP	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 21717 BRAKELIGHT SWITCH SHORTED 6131PERFORMED INSPECTION/FOUND CRUISE CONTROLINOP/TESTED/FOUND BRAKELIGHT SWITCH TO HAVEINTERNAL SHORT AND WILL NOT LET CRUISEOPERATE PROPERLY/REMOVED AND REPLACEDBRAKELIG
KM8JM12BX5U	5/13/05	38257	32.4	TECH INSPECTED FOUND OPEN CIRCUIT IN STOP LAMP SWITCH NECESSARY TO REMOVE AND REPLACE STOP LAMP SWITCH	CUSTOMER STATES OCC WARNING LIGHT COMES ON	TEST AND INSPECT CODE FOR BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JM12B56U	7/13/05	11959	34.36		CUSTOMER STATES, SES LIGHT IS ON	TEST AND INSPECT CODE P1513 STOP LAMP SWITCH	REPLACED SWITCH
KM8JN12D95U	1/25/05	14548	32.12		CUSTOEMR STATES CHECK TRANS FOR PROPER SHIFT	TEST AND INSPECT FOUND HIDDEN CODES FOR STOP LAMP SWITCH	REPLACED SWITCH

KM8JN12D46U	9/22/05	34910	33.06	14 THROTTLE INTAKE GUMMED WITH LOOSENED CARBON FORM INJECTOR SERVICE 6013 PERFORMED DIAGNOSIS/ FOUND THROTTLE INTAKE GUMMED WITH LOOSENED CARBON FROM RECENT INJECTOR SERVICE/ CLEANED OUT THROTTLE ASSEMBLY AND TEST DROVE FOR 5 MILES/ VEHICLE PERFORMING NORM	VEHICLE DIES WHILE DRIVING	THROTTLE INTAKE GUMMED WITH LOOSENED CARBON FORM INJECTOR SERVICE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 14 THROTTLE INTAKE GUMMED WITH LOOSENED CARBON FORM INJECTOR SERVICE 6013 PERFORMED DIAGNOSIS/ FOUND THROTTLE INTAKE GUMMED WITH LOOSENED CARBON FROM RECENT INJECTOR SERVICE/ CLEANED OUT THROTTLE ASSEMBLY AND
KM8JM12B46U	11/29/05	11206	25.26	11206 BRAKE LAMP SWITCH INTERNAL SHORT 5958 DAIGNOSED FOR CHECK ENGINE LIGHT/ESC LIGHT NOT GOING OFF.PERFOREMD GDS OPERATION.FOUND B1513 BRAKE LAMP SWITCH CODE TO BE PRESENT.INSPECTED BRAKE LAMP SWITCH.FOUND SWITCH TO HAVE AN INTERNAL SHORT.REMOVED AND RE	CUSTOMER STATES ESC LIGHT WILL NOT GO OFF	BRAKE LAMP SWITCH INTERNAL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 11206 BRAKE LAMP SWITCH INTERNAL SHORT 5958DAIGNOSED FOR CHECK ENGINE LIGHT/ESC LIGHTNOT GOING OFF.PERFOREMD GDS OPERATION.FOUND B1513 BRAKE LAMP SWITCH CODE TO BE PRESENT.INSPECTED BRAKE LAMP SWITCH.FOUND SW
KM8JM12B25U	7/07/05	37918	51.66	CUST STATES ESP LIGHT COME ON...SCAN CODE C1513REPLACE BRAKE SWITCH...SHORTED.....	CUST STATES ESP LIGHT COMES ON INTERMIT WHILE DRIVING AND STAYS ON UNTIL VEHICLE IS TURNED OFF. CUST STATES HAS OCCURED SEVERAL TIMES WANTS CHECKED AND ADVISE	PERFORMED SCAN TOOL TEST. ESP CODES- C1513 BRAKE LAMP SWITCH. REFERRAL BY TECHLINE AND USING SHOP MANUAL(BR116) 58-6 TO REPLACE BRAKE LAMP SWITCH CASE #277160	REPLACED BRAKE LAMP SWITCH AND RETETS
KM8JN12D16U	1/26/06	14306	30.66	CUST STATES ESC LIGHT IS ON..SCAN FOUND CODE C1513INTERNAL FAILUREREPLACE BRAKE	CHECK FOR CODE P0036 STORED IN COMPUTER.	B1 S1 O2 SENSOR FAILURE.	REPLACE O2 SENSOR, CLEAR CODE AND TEST DRIVE.
KM8JN12D16U	1/26/06	14306	30.66	CUST STATES ESC LIGHT IS ON..SCAN FOUND CODE C1513INTERNAL FAILUREREPLACE BRAKE SWITCH	OWNER HAS CONCERN THAT THE ESC LIGHT WILL COME ON FOR DAYS AT A TIME THEN GO BACK OFF. HE SAYS THIS IS A REOCCURRING CONCERN. CHECK/ADVISE.	SCAN CODE: C1513 BRAKE LAMP SWITCH FAILURE	R & R BRAKE LAMP SWITCH.
KM8JM12B46U	11/29/05	11206	25.26	11206 BRAKE LAMP SWITCH INTERNAL SHORT 5958 DAIGNOSED FOR CHECK ENGINE LIGHT/ESC LIGHT NOT GOING OFF.PERFOREMD GDS OPERATION.FOUND B1513 BRAKE LAMP SWITCH CODE TO BE PRESENT.INSPECTED BRAKE LAMP SWITCH.FOUND SWITCH TO HAVE AN INTERNAL SHORT.REMOVED AND RE	CUSTOMER STATES CHECK ENGINE LIGHT IS ON	SEE LINE B	SEE LINE B FOR REPAIRS SEE LINE B FOR REPAIRS 11206 SEE LINE B 5958 SEE LINE B BRAKE LAMP SWITCH
KM8JN12D86U	10/11/05	37502	32.74	37502 BRAKE LAMP SWITCH OPEN/SHORT 6013 PEFORMED DIAGNOSIS FOUND DTC C1513 BRAKE LAMP SWITCH CIRCUIT MAL C1237 PRIMARY PRESSURE SENSOR SIGNAL TESTSD BRAKE LAMP SWITCH FOUND BRAKE LAMP SWITCH TO HAVE OPEN SHORT REPLACED BRAKE LAMP SWITCH TEST DROVE AND RECH	CUSTOMER STATES ESC LIGHT ON	BRAKE LAMP SWITCH OPEN/SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 37502 BRAKE LAMP SWITCH OPEN/SHORT 6013PEFORMED DIAGNOSIS/ FOUND DTC C1513 BRAKELAMP SWITCH CIRCUIT MAL/ C1237 PRIMARYPRESSURE SENSOR-SIGNAL/ TESTSD BRAKE LAMP SWITCH/ FOUND BRAKE LAMP SWITCH TO HAVEOPEN/SHO
KM8JN12D16U	1/26/06	14306	30.66	CUST STATES ESC LIGHT IS ON..SCAN FOUND CODE C1513INTERNAL FAILUREREPLACE BRAKE SWITCH	OWNER STATES: AT TIMES THE PASSENGER FRONT DOOR LOCK HANGS UP AND WILL NOT RESPOND TO THE KEYLESS REMOTE. HE MUST THEN USE THE KEY TO LOCK AND UNLOCK THE DOOR. LATER IT WILL START WORKING AGAIN. CHECK/ADVISE.	POWER LOCK MONDULE AT TIMES WOULD STICK AND MALFUNCTION ON THE FRONT PASSENGER SIDE.	R&R FRONT PASSENGER SIDE DOOR ACTUATOR/MODULE.
KM8JN12D86U	7/22/05	17353	32.74	FOUND BRAKE LAMP SWITCH FAULTY REPL SWITCH			
KM8JN12D56U	9/08/05	15808	33.06	FOUND BRAKE LAMP SWITCH SHORTED REPL			
KM8JM12B47U	6/16/06	12678	25.26	12679 C1513 BRAKE LAMP SWITCH 6131 PEROFRM GDS OPERATION CODE C1513 PRESENT.BENCHTEST BRAKE LAMP SWITCH.SWITCH OPEN CIRCUIT.REMOVE AND REPLACE SWITCH.TEST DRIVE AFTER REPAIR.NO FURTHER CODES AFTER REPAIR	CUSTOMER STATES CHECK ENGINE LIGHT ON	P0455	DRIVEABILITY / EMISSION DRIVEABILITY / EMISSION 12679 P0455 6131 PERFORM GDS OPERATION.CODEP0455 PRESENT.PERFORM LEAKTEST.PASS 3TIMES.NO LEAK PRESENT.NO CODES PRESENT.PASTCODE HIST STORED
KM8JM12B47U	6/16/06	12678	25.26	12679 C1513 BRAKE LAMP SWITCH 6131 PEROFRM GDS OPERATION CODE C1513 PRESENT.BENCHTEST BRAKE LAMP SWITCH.SWITCH OPEN CIRCUIT.REMOVE AND REPLACE SWITCH.TEST DRIVE AFTER REPAIR.NO FURTHER CODES AFTER REPAIR	CUSTOMER STATES SQUEAKING UNDER VEHICLE WHEN FIRST DRIVING AFTER SITTING OVERNIGHT	CUSTOMER WILL RETUEN	SUSPENSION SUSPENSION 12679 CUSTOMER WILL RETUEN 6131 CUSTOMERWILL RETURN
KM8JN12D16U	11/16/05	18011	68.81	CUSTOMER STATES THE ESC LIGHT IS ON DIA VEH AND FOUND CODE C1513 DIA FURTHER AND FOUND FAULTY BRAKE LIGHT SWITCH REPLACED RECHECKED OK			
KM8JM12B06U	7/11/05	16495	62.28	VERIFIED CNERN FOUND BROKEN RETAINER ON SWITCH REPLACE SWITCH RETEST OPERATION OK			

KM8JN72D86U	11/16/05	9068	60.32	CUSTOMER STATES ESC LIGHT ON DIA VEH AND FOUND CODES C1513.C1616 TESTED CURRENT DATA SCREEN FOR INTER BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH CLEARED CODES RECHECKED OK			
KM8JM12B47U	6/16/06	12678	25.26	12679 C1513 BRAKE LAMP SWITCH 6131 PERFORM GDS OPERATION CODE C1513 PRESENT.BENCHTEST BRAKE LAMP SWITCH.SWITCH OPEN CIRCUIT.REMOVE AND REPLACE SWITCH.TEST DRIVE AFTER REPAIR.NO FURTHER CODES AFTER REPAIR	CAMPAIGN 079 AIRBAG COVER MODULE REPLACEMENT	079 AIRBAG COVER REPLACEMENT	DRIVER AIR BAG MODULE REPLACEMENT(07-01-001) DRIVER AIR BAG MODULE REPLACEMENT(07-01-001) 12679 079 AIRBAG COVER REPLACEMENT 6131PERFORM 079 AIRBAG COVER REPLACEMENT
KM8JM12B47U	6/16/06	12678	25.26	12679 C1513 BRAKE LAMP SWITCH 6131 PERFORM GDS OPERATION CODE C1513 PRESENT.BENCHTEST BRAKE LAMP SWITCH.SWITCH OPEN CIRCUIT.REMOVE AND REPLACE SWITCH.TEST DRIVE AFTER REPAIR.NO FURTHER CODES AFTER REPAIR	CUSTOMER STATES ESC LIGHT GOES ON AND OFF	C1513 BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 12679 C1513 BRAKE LAMP SWITCH 6131 PERFORMGDS OPERATION CODE C1513 PRESENT.BENCHTESTBRAKE LAMP SWITCH.SWITCH OPEN CIRCUIT.REMOVEAND REPLACE SWITCH.TEST DRIVE AFTER REPAIR.NO FURTHER CODES AFTER REPAIR
KM8JN12D16U	8/08/05	17176	53.23	C/S ENGINE STABILITY LIGHT KEEPS GOING ON AND OFF.SCAN SYSTEM FOUND CODE B1513 STOP LAMP SWITCH OPEN REMOVED AND REPLACED STOP LAMP SWITCH TO CORRECT CLEARED CODE.CODE DID NOT RESET			
KM8JN12D37U	10/10/06	34	36.36	UPON INSPECTION FOUND BRAKE LIGHTS STAYING ON R AN ELECTRICAL CHECK TO FIND SHORT CIRCUIT IN BR AKE SWITCH REPLACE BRAKE SWITCH ASSEMBLY O.K AT THIS TIME			
KM8JN12D75U	5/27/05	12049	36.04	UPON INSPECTION FOUND CODE C1513 BRAKE SWITCH M ALFUNCTION REPLACE BRAKE SWITCH ASSEMBLY CLEAR CODE TEST DROVE OK AT THIS TIME			
KM8JN12DX6U	8/13/05	17147	33.8		CUSTOMER STATES THE ESC LIGHT FLICKERS ON AND OFF	CHECK ELECTRICAL SYSTEM, BRAKE LIGHT SWITCH OPEN CIRCUIT	REPLACED THE BRAKE LIGHT SWITCH, TEST DROVE EVERYTHING IS OK AT THIS TIME, SWITCH-N68 C15 93810R00, MINOR WIRE RAPAIR-N66 C15 91000A00
KM8JM12BX6U	7/20/05	10247	33.8		CUSTOMER STATES THERE IS A SHAKE WHEN BRAKING	FRONT BRAKE ROTORS ARE WARPED AND NEED TO BE REPLACED	REPLACED THE FRONT BRAKE ROTORS, TEST DROVE THE VEHICLE, NO VIBRATION ALL OK AT THIS TIME, N29 C09 57712R00
KM8JM12BX6U	7/20/05	10247	33.8		CUSTOMER STATES THE ESC OFF LIGHT FLICKERS ON AND OFF	SCAN TESTED-C1513 BRAKE LAMP SWITCH	REPLACED THE BRAKE LAMP SWITCH, EVERYTHING IS OK AT THIS TIME, N69 C15 32002A00
KM8JN12D77U	10/31/06	887	36.36	UPON INSPECTION FOUND POWER TO BRAKE LAMP SWITC H FOUND BRAKE SWITCH TO HBE OPEN CIRCUIT REPLA CED BRAKE SWITCH ASSEMBLY			
KM8JN12D85U	5/19/05	26818	35.46	REPLACED BRAKE LAMP SWITCH RETEST OK	CUSTOMER STATES ETC LIGHT COMES ON AND OFF PLEASE CHECK AND ADVISE	FOUND C1513 BRAKE LAMP SWITCH FOUND BRAKE LAMP SWITCH STICKING AND WORN	REPLACED BRAKE LAMP SWITCH RETEST OK
KM8JN12D85U	5/19/05	26818	35.46	REPLACED BRAKE LAMP SWITCH RETEST OK	PERFORM RECALL #079 DRIVER BAG AIR COVER MOD REPL (07-01-001	CAMPAIGN	PERFORMED
KM8JM12B36U	8/31/05	24235	32.16				
KM8JM12B16U	9/14/05	21273	32.16		CUSTOMER REQUESTS THAT ESC LIGHT IS ON, CHECK AND ADVISE.	FOUND THAT THE BRAKE LIGHT SWITCH IS BAD AND NEEDS REPLACEMENT.	REPLACED BRAKE LIGHT SWITCH. OP:32002A00/N69/C15/0.2
KM8JN12D15U	6/23/05	33801	32.16				
KM8JN12D85U	5/19/05	26818	35.46	REPLACED BRAKE LAMP SWITCH RETEST OK	CUSTOMER STATES BOTH ACC PLUGS NOT WORKING PLEASE CHECK AND ADVISE	FOUND CIGAR LIGHTER/POWER SOCKET FUSE BLOWN CHECKED POWER SOCKETS BOTH OK	REPLACED FUSE RETEST OK
KM8JM12B46U	1/10/06	25106	35.14		CLIENT STATES CRUISE CONTROL INOP	RAN SCAN TOOL AND FOUND C1513 BRAKE SWITCH ERROR FOUND OPEN/SHORT IN BRAKE SWITCH	REPLACED SWITCH AND RETEST OK
KM8JN12DX5U	5/25/05	39269	35.14		CUSTOMER STATES ESP LIGHT IS STILL COMING ON INTERMITANTLY HAS HAPPENED A COUPLE TIMES PLEASE CHECK AND ADVISE	RAN SCAN TOOL TEST AND FOUND DTC C1513 BRAKE LAMP SWITCH FOUND OPEN SHORT IN STOP LAMP SWITCH	REPLACE SWITCH AND RETESTED OK
KM8JN72D46U	7/27/05	8200	36.12	REPLACED STOP LAMP SWITCH	C/S ESC LIGHT GOES ON AND OFF		STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY REPLACED BRAKE SWITCH
KM8JN72D86U	10/10/05	21320	36.44	REPLACED BRAKE LAMP SWITCH	CHECK ESC LIGHT INOP	CODE C 1513 BRAKE LAMP SWITCH INTERNAL FAILURE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D96U	10/06/05	28018	36.44	REPLACED STOP LAMP SWITCH	C/S ESC LIGHT COMES ON	ESC LIGHT STAYS ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D96U	10/06/05	28018	36.44	REPLACED STOP LAMP SWITCH	C/S INSTALL ACUATOR SOP	BLEND DOOR BINDING	MODE DOOR ACTUATOR RE MODE DOOR ACTUATOR RE TECH REPLACED ACT ASSEMBLY
KM8JN12D56U	10/16/05	24609	35.14		CLIENT STATES ESC LIGHT COMES ON/OFF INTERMITTENTLY	RAN SCAN TOOL AND FOUND P1543 BRAKE SWITCH SIGNAL FAULT FOUND OPEN/SHORT IN STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH AND RETEST OK
KM8JN12D26U	7/28/05	18188	33.66	C/S ESC LIGHT IS ON. REPLACED BRAKE LAMP SWITCH & TEST TO VERIFY REPAIRS			

KM8JN12D16U	10/17/05	23904	38.16	REPLACED BRAKE LAMP SWITCH AND FOUND NO CODES AFTER TEST DRIVE 93810ROO N94 C15.3	CUSTOMER STATES ESC LIGHT STAYS ON. LIGHT COMES ON AND GOES OFF WHEN CAR IS RESTARTED.	SCANNED FOR CODES AND FOUND B1315 BRAKE SWITCH MAL. TESTED BRAKE LAMP SWITCH AND FOUND OPEN CURCUIT	REPLACED BRAKE LAMP SWITCH AND FOUND NO CODES AFTER TEST DRIVE 93810ROO N94 C15.3
KM8JN72D75U	10/14/04	46124	34.73	REPLACED BRAKE LIGHT SWITCH INOP REPLACED	CHECK ESC LIGHT ON	BRAKE LIGHT SWITCH INOP REPLACED	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D35U	2/17/05	22451	34.73	REPLACED STOP LAMP SWITCH SHORTED	CUSTOMER STATES ESP LIGHT GOES ON AND OFF	CODE C1237, C1513 REPLACED SENSOR	PRESSURE SENSOR PRESSURE SENSOR
KM8JN72D35U	2/17/05	22451	34.73	REPLACED STOP LAMP SWITCH SHORTED	CUSTOMER STATES HARD TO START AT TIMES	BRAKE LIGHT SWITCH STICKING REPLACED SENSOR AND SWITCH ASSY	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12DX6U	8/22/05	6116	38.16				
KM8JN12D26U	10/18/05	17266	38.16	REMOVED AND REPLACED SWITCH 93810ROO .30 N94 C15	CUSTOMER STATES ESC LIGHT IS ON COMES ON RANDOMLY- CUSTOMER WANTS TO KNOW WHY?	SCANNED FOR CODES C1513 BRAKE LAMP SWITCH MALFUNCTION SWITCH HAS INTERNAL FAILURE	REMOVED AND REPLACED SWITCH 93810ROO .30 N94 C15
KM8JN12DX6U	7/29/05	19938	63.34	ADD TIME FOR SCAN AND CLEAR CODE C1315			
KM8JN12D16U	8/12/05	23757	36.34				
KM8JN72DX6U	7/26/05	14341	36.44	REPLACED BRAKE LIGHT SWITCH	CHECK ENGINE LIGHT ON	WARNING LIGHT ON	SCAN TOOL OPERATION SCAN TOOL OPERATION SCANNED CHECKED FOR CODES P0130 02 SENSOR FAILED REPLACED CLEARED CODE REPLACED 02SENSOR
KM8JN72DX6U	7/26/05	14341	36.44	REPLACED BRAKE LIGHT SWITCH	CHECK ENGINE LIGHT ON	WARNING LIGHT ON	OXYGEN SENSOR ADD HDS OPERATION OXYGEN SENSOR ADD HDS OPERATION SCANNED CHECKED FOR CODES P0130 02 SENSOR FAILED REPLACED CLEARED CODE REPLACED 02SENSOR
KM8JN72DX6U	7/26/05	14341	36.44	REPLACED BRAKE LIGHT SWITCH	BRAKE LAMP INOP	BRAKE LIGHT OUT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED BRAKE LIGHT SWITCH
KM8JN12D76U	8/09/05	21828	63.66	ADD TIME FOR SCAN AND CLEAR CODE C1513.			
KM8JN12D96U	12/29/05	13170	63.66	ADD TIME FOR SCAN AND CLEAR CODE C1513			
KM8JN12D76U	8/08/05	27796	63.66	ADD TIME FOR SCAN AND CLEAR CODE C1513			
KM8JN12D06U	12/26/05	9635	36.34				
KM8JM12B35U	4/28/05	42836	36.44	CHECK AND REPLACED STOP LAMP SWITCH	C/SW ESC LIGHT CAME ON INSTALL SOP SWITCH	LIGHT ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B35U	4/28/05	42836	36.44	CHECK AND REPLACED STOP LAMP SWITCH	PERFORM OPEN CAMPAIGN 079 AIR BAG COVER MOD		AIR BAG RECALL MISC
KM8JM12B47U	10/30/06	5591	36.44	REPLACED PARKING BRAKE SWITCH INTERNAL FAILURE	CUSTOMER STATES BRAKE LIGHTS DO NOT ALWAYS WORK AND ESC LIGHT GOES ON	INTERNAL FAILURE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12BX7U	11/15/06	29	36.34				
KM8JN12D55U	4/28/05	45119	63.66	ADD TIME FOR SCAN AND CLEAR CODE C1513			
KM8JM12B46U	8/23/05	29638	36.66				
KM8JN12D66U	3/16/06	12394	36.66				
KM8JN72D46U	9/07/05	31068	36.12	REPLACED STOP LAMP SWITCH	OPEN RECALL	OPPEN RECALL	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT
KM8JN72D46U	9/07/05	31068	36.12	REPLACED STOP LAMP SWITCH	ESC LIGHT COMES ON	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D86U	11/23/05	22873	36.12	CHECK AND REPLACED BRAKE LIGHT SWITCH	BRAKE LIGHTS INOP	BRAKE LIGHTS INOP INTERNAL FAILURE REPLACED BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D66U	3/16/06	8710	36.34				
KM8JN12D95U	6/17/05	33811	36.66				
KM8JN12D86U	5/08/06	9452	63.66	ADD TIME FOR SCAN AND CLEAR CODE C1513			
KM8JN72DX6U	3/06/06	12457	36.99	C/S ECS LIGHT COMES ON			
KM8JN12D16U	12/05/05	27781	36.44	CODE C1503 C1513 REPLACED STOP LAMP SWITCH	CUSTOMER STATES ECS LIGHT GOES ON WHILE DRIVING	CODE C1503, C1513 REPLACED STOP LAMP SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D56U	8/12/05	35117	35.84				
KM8JM12B45U	4/14/05	11594	35.3		CUST STATES THAT ESP LIGHT IS ON		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D66U	12/13/05	4636	35.84		CUSTOMER STATES THE ESC LITE IS ON.	SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D16U	11/15/05	29700	36.99	C/S ESC LIGHT IS ON	CUST STATES THAT THE ESC LIGHT "OFF" LIGHT IS COMING ON AND STAYING ON VERY FREQUENTLY. PLEASE ADVISE.	TECH SCANNED CAR FOR CODES. FOUND INTERMITTENT SHORT IN BRAKE SWITCH. 93810R00/N94/C15	REPLACED BRAKE SWITCH. TEST DRIVE CONFIRMED VEHICLE OPERATING PROPERLY.
KM8JN12DX6U	10/06/05	35208	37.26		CUSTOMER STATES ESC LITE ON AND NO BRAKE LITES	STOP LAMP SWITCH	VERIFY CONCERN TESTED DIAGNOSE AND REPLACE BRAKE LIGHT SWITCH RECK OK
KM8JN72D46U	10/11/05	10669	37.26	VERIFY CONCERN REPLACED LAMP SWITCH BRAKE LIGHTS WORKING	CUSTOMER STATES CK BRAKE LIGHTS ARE INOP	FOUND LAMP SWITCH INOP	VERIFY CONCERN REPLACED LAMP SWITCH BRAKE LIGHTS WORKING
KM8JM12B66U	9/13/05	11406	35.84				
KM8JM12B25U	4/14/05	26049	35.84		CUSTOMER STATES ALL BRAKE LIGHTS INOP		REPLACED BRAKE LIGHT SWITCH
KM8JN72D35U	6/10/05	18326	35.3		CUST STATES THAT ESP LIGHT IS ON		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D36U	8/18/05	12723	35.52				
KM8JN72D46U	10/11/05	10669	37.26	VERIFY CONCERN REPLACED LAMP SWITCH BRAKE LIGHTS WORKING	CUSTOMER STATES CK EXCESSIVE MOISTURE BUILD UP ON WINDSHIELD WHILE DRIVING	NOT FOUND	VERIFY CONCERN MOISTURE BUILD IS NORMAL, NO PROBLEM FOUND
KM8JM12B56U	11/04/05	19864	37.26		CUST STATES CK FOR STABILITY CONTROL LIGHT COMING ON ONCE IN A WHILE CHECK AND ADVISE	DIAGNOSIS CHECKED FOR COTUMER CONCERN SCANNED SYSTEM FOUND CODE C1513 FOUND BRAKE SWITCH MALFUCTIONING REPLACE SW	ITCH CLEARED CODE AND RECHECK ALL OK
KM8JN12D95U	11/03/04	21979	63.08	NEC TO REMOVE PARTS FROM STOCK UNIT VEHICLE TO VERIFY PROBLEM			
KM8JN12D76U	8/08/05	22291	35.84				
KM8JN12D06U	3/10/06	8181	35.52				
KM8JN72D06U	9/29/05	16485	35.52				

KM8JN72D55U	2/03/05	27511	32.55	27000 FOUND PROBLEM STOP LIGHT SWITCH REPLACED STOP LIGHT SWITCH	PERFORM 079 CAMPAIGN	F	CAMPAIGN 079 CAMPAIGN 079
KM8JM12B15U	4/27/05	16256	36.8				
KM8JN72D55U	11/23/04	19232	37.58				
KM8JN12D95U	6/03/05	21370	36.8				
KM8JM12B95U	6/07/05	7335	187	P0111/ C1513 - TECH LINE 217149 - CLEAR ADAPTIVE CODES - ALL SYSTEMS CLEAR			
KM8JN72D55U	2/03/05	27511	32.55	27000 FOUND PROBLEM STOP LIGHT SWITCH REPLACED STOP LIGHT SWITCH	CUSTOMER STATES THE CRUISE CONTROL WORKS INTERMITLY	FOUND PROBLEM STOP LIGHT SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 27000 FOUND PROBLEM STOP LIGHT SWITCHREPLACED STOP LIGHT SWITCH
KM8JN72D36U	10/31/05	11676	34.26		CUSTOMER STATES THAT THE ESC LIGHT KEEPS COMING ON	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D06U	12/10/05	19787	33.94		ECS LIGHT COMES ON AND STAYS ON FORA WHILE THEN GOES OUT PLEASE CHECK	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B96U	7/13/05	16953	62.3	EXTRA TIME FOR SCAN AND DIAG. ESC LIGHT FLASHING. CODE C1513. INSTALLED NEW BRAKE SWITCH.			
KM8JN12D96U	9/08/05	13777	36.8				
KM8JN12D85U	4/19/05	10478	36.5		CUSTOMER STATES "ESP" LIGHT COMES ON & OFF CK & ADVISE	C1513 CODE SET BRK LITE SWT ALSO OPEN CAMPAIGN FOR RE-PROGRAM 068	DIAG & REPLACE BRK LITE SWT. PERFORM RE-PROGRAM 32002A00 N69 C15 51B003R0 (CAMPAIGN)
KM8JN72D96U	9/26/05	10808	33.94				
KM8JN72D76U	12/17/05	22173	33.94				
KM8JM72B36U	10/12/05	12218	34.26	12000 CUST STATES ESC LIGHT ON AND STAYING ON VERIFIED CONCERN, PULL CODE C1513 - BRAKE LAMP SWITCH, FOUND BRAKE LAMP SWITCH HAD INTERNAL FAILURE, REPLACED, RESET LIGHT, ROAD TESTED LIGHT DID NOT RETURN.			
KM8JN12D56U	10/31/05	8488	39.8				
KM8JN12D26U	10/08/05	16029	19		CUSTOMER STATES "ESC" INDICATOR LIGHT IS ON CK & ADVISE	RAN SCAN AND FOUND CODE C1513 BRAKE SWITCH CIRCUIT. CHECKED ALL FUSES AND FOUND OK. CHECKED BRAKE LIGHT SWITCH ADJUSTMENT AND FOUND TO BE OUT OF ADJUSTEMENT BY 1MM.	ADJUSTED BRAKE LIGHT SWITCH AND FOUND NO FURTHER PROBLEMS ATTHIS TIME. 32002A00 N69 C40 MILEAGE OUT:16033
KM8JN12D06U	10/10/05	14190	37.84				
KM8JN12D26U	10/08/05	20494	37.84				
KM8JN72D46U	9/09/05	14520	34.7		ESE LIGHT PLEASE INSTALL SOP	F	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN72D56U	10/17/05	21661	34.26				
KM8JN72D06U	10/14/05	6154	33.94		CUSTOMER STATES ESC LIGHT ON PLEASEINSTALL SOP	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12BX6U	8/29/05	26697	34.26	26200 WHEN SCANNING FOR CONCERN ON LINE A ALSO FOUND CODE C-1513 BRAKE LAMP SWITCH FOUND AFTER PERFORMMING CURCUIT TESTS INTERNAL SHORT IN THE BRAKE SWITCH, REMOVE AND REPLACE BRAKE SWITCH, CLEARED BOTH CODES. ROAD TEST TO VERIFY REPAIRS, COMPELTE.	PERFORM 079 CAMPAIGN	F	CAMPAIGN 079 CAMPAIGN 079
KM8JM12B16U	1/03/06	8449	39.8				
KM8JN12D75U	5/04/05	29013	37.84				
KM8JN12D35U	10/04/04	24427	132.56	CUST STATES CRUISE CONTROL WON'T SET-CRUISE LIGHT COMES ON BUT CRUISE WON'T SET. LOSS OF VOLTAGE THRU BRAKE LIGHT SWITCH. INSPECT FUSE #S 33, 6, 31, & 20 ALL GOOD. INSPECT FOR 12V AT CONNECTOR M20-3 PIN #3, HAS 12V. INSPECT FOR 12V AT CONNECTOR C56 PI			
KM8JM12BX6U	8/29/05	26697	34.26	26200 WHEN SCANNING FOR CONCERN ON LINE A ALSO FOUND CODE C-1513 BRAKE LAMP SWITCH FOUND AFTER PERFORMMING CURCUIT TESTS INTERNAL SHORT IN THE BRAKE SWITCH, REMOVE AND REPLACE BRAKE SWITCH, CLEARED BOTH CODES. ROAD TEST TO VERIFY REPAIRS, COMPELTE.	CUST STATES ESC LIGHT ON PLEASE INSTALL SOP	SCAN DATA FOUND CODEC-1260 STEERING ANGLE SENSOR, PERFORM SYSTEM TESTS	SENSOR-ANGULAR VELOCITY SENSOR-ANGULAR VELOCITY 26200 SCAN DATA FOUND CODE C-1260 STEERINGANGLE SENSOR, PERFORM SYSTEM TESTS FOUNDINTERNAL ANGLE SENSOR FAILURE REMOVE ANDREPLACE STEERING ANGLE SENSOR, PLEASE SEE LINE D BELOW FOR SECOND CODE FOUND. COMPLE
KM8JM12B25U	4/25/05	18232	38.16				
KM8JM12BX5U	10/15/04	18191	37.56				
KM8JN12D95U	10/04/04	26250	36.45		CUSTOMER STATES CRUISE IS INOP.	STOP LAMP SWITCH HAS OPEN CIRCUIT	REPLACE STOP LAMP SWITCH, MILAGE OUT 26256 93810R00 N94 C15
KM8JN12D95U	10/04/04	26250	36.45		CUSTOMER STATES CD DELAYS WHEN EJECTING (5 SEC) AND ALSO WHEN FAST FORWARDING ,EJECT LIGHT COMES ON.	INTERNAL FAILURE	REPLACEE RADIO ASSY, NEW RADIO IS INOP 96300R00 N94 C15
KM8JM12BX6U	8/29/05	26697	34.26	26200 WHEN SCANNING FOR CONCERN ON LINE A ALSO FOUND CODE C-1513 BRAKE LAMP SWITCH FOUND AFTER PERFORMMING CURCUIT TESTS INTERNAL SHORT IN THE BRAKE SWITCH, REMOVE AND REPLACE BRAKE SWITCH, CLEARED BOTH CODES. ROAD TEST TO VERIFY REPAIRS, COMPELTE.	FOUND CODE WHEN SCANNING ESC ON LINE A OF C-1513 BRAKE SWITCH	WHEN SCANNING FOR CONCERN ON LINE A ALSOFOUND CODE C-1513 BRAKE LAMP SWITCH FOUND AFTER PERFORMMINGCURCUIT TESTS INTERNAL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 26200 WHEN SCANNING FOR CONCERN ON LINE AALSO FOUND CODE C-1513 BRAKE LAMP SWITCHFOUND AFTER PERFORMMING CURCUIT TESTSINTERNAL SHORT IN THE BRAKE SWITCH, REMOVEAND REPLACE BRAKE SWITCH, CLEARED BOTH CODE
KM8JN72D45U	10/14/04	12	33.27				

KM8JN12D35U	9/21/04	22567	32.55				
KM8JN72D96U	10/19/05	24340	33.94	24340 L.O.F FOUND CODE C1513 STORED BRAKE LIGHT SWITCH NO GOOD REPLACED SWITCH OK NOW			
KM8JM12B36U	10/05/05	14973	37.84				
KM8JN12D96U	11/24/05	17165	35.29	PERFORM HI SCAN OPERATION IN CODE C1513 BAD BRA KE LIGHT SWITCH REMOVE AND REPLACE RECHECK SYST EM NORMAL OPERATION			
KM8JN12D96U	10/04/05	13126	35.61	SCAN TEST AND ROAD TEST CODE C1513 BRAKE SWITCH REPLACED SWITCH AND RETEST			
KM8JN72D35U	6/30/05	29660	35.29				
KM8JM12BX6U	7/16/05	13058	34.26	13058 FOUND BREAKE SWITCH CAME APART AND SHORTED REMOPVE AND REPALCE BRAKE LAMP SWITCH, CLEAR CODE C1513 AND RETEST, COMPELTED.	PLEASE PERFORM OPEN CPN	F	CAMPAIGN 079 CAMPAIGN 079
KM8JM12BX6U	7/16/05	13058	34.26	13058 FOUND BREAKE SWITCH CAME APART AND SHORTED REMOPVE AND REPALCE BRAKE LAMP SWITCH, CLEAR CODE C1513 AND RETEST, COMPELTED.	CUST STATES ECS LIGHT ON	FOUND BREAKE SWITCH CAME APART AND SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 13058 FOUND BREAKE SWITCH CAME APART ANDSHORTED REMOPVE AND REPALCE BRAKE LAMP SWITCH, CLEAR CODE C1513 AND RETEST,COMPELTED.
KM8JM12B86U	8/24/05	11478	34.7		INSTALL S/O PART FOR ESC LIGHT COMMING ON	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D65U	4/28/05	30854	35.29	REPLACED STOP LAMP SWITCH BROKEN	CUSTOMER STATES, CHECK ALL BRAKE LIGHTS-THEY DO NOT WORK	OPEN CIRCUIT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12DX6U	7/27/05	21738	36.8	BRAKE LIGHTS INOP CHECKED BULBS AND SWITCH BRAK E SWITCH INOP REPLACED SWITCH NOW IT WORKS	CUSTOMER STATES; BRAKE LIGHT SWITCHIS FAULTY/REPLACE	REPLACED BRAKE LIGHTSWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE BRAKE LIGHTS INOP CHECKED BULBS AND SWITCHBRAK E SWITCH INOP REPLACED SWITCH NOW ITWORKS
KM8JN72D56U	11/08/05	18710	35.61	REPLACED STOP LAMP SWITCH ASSY			
KM8JN72D66U	10/21/05	21349	33.94				
KM8JM12B56U	7/12/05	39055	30.34	39055 REPLACE DEFECTIVE STOP LAMP SWITCH			
KM8JN72D65U	2/26/05	16710	30.06	SCAN TEST P1237 P1513 REPLACE BRAKE LIGHT SITCH	CUSTOMER STATES BRAKES WENT TO FLOOR / CHECK AND ADVISE		PRESSURE SENSOR PRESSURE SENSOR 16711 ROAD TEST,SCAN TEST P1237 P1513 TESTAND REPLACED PRESSURE TEST AND BRAKE SWITCH.
KM8JN72D96U	7/22/05	10835	35.61	REPLACED STOP LAMP SWITHC INOP			
KM8JM12B56U	9/13/05	35332	35.47		CUSTOMER STATES: ESC LIGHT ON (USE SPO)	SCAN TEST C1513 BRAKE LAMP SWITHC	REPLACED SWITCH TEST CK OK ADJUST
KM8JN72D66U	10/04/05	14363	37.86				
KM8JN72D65U	2/26/05	16710	30.06	SCAN TEST P1237 P1513 REPLACE BRAKE LIGHT SITCH	CUSTOMER STATES BRAKES WENT TO FLOOR / CHECK AND ADVISE		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 16711 ROAD TEST,SCAN TEST P1237 P1513 TESTAND REPLACED PRESSURE TEST AND BRAKE SWTCH.
KM8JN12D65U	5/27/05	16910	32.3	16912 BRAKE LIGHT SWITCH SHORTED FOR ESP CHECKED OUT ESP LIGHT ON RAN SCAN TEST GOT CODE FOR BRAKE LIGHT SWITCH TRYED ADJUSTING CODE CAME BACK REPLACED BRAKE SWITCH RETESTED GOOD	CUSTOMER STATES CREAKING NOISE WHENTURN LEFT (SOP)	NOISE WORN F	BUSHING-CROSSMEMBER MOUNTING (ALL) RE BUSHING-CROSSMEMBER MOUNTING (ALL) RE 16912 CROSS MEMBER BUSHING CREAKING WHENTURNING LEFT CHECKED OUT NOISE WHEN TURNINGLEFT FOUND CROSS MEMBER BUSHING NOISEYREPLACED CROSS MEMBER BUSHING RETESTED GOOD
KM8JN72D96U	11/08/05	15268	37.54				
KM8JN12D46U	9/30/05	13537	37.54				
KM8JN12D36U	9/27/05	32797	37.86				
KM8JM12B95U	6/20/05	46731	37.54				
KM8JN72D95U	6/13/05	6335	35				
KM8JN12D65U	5/27/05	16910	32.3	16912 BRAKE LIGHT SWITCH SHORTED FOR ESP CHECKED OUT ESP LIGHT ON RAN SCAN TEST GOT CODE FOR BRAKE LIGHT SWITCH TRYED ADJUSTING CODE CAME BACK REPLACED BRAKE SWITCH RETESTED GOOD	CUSTOMER STATES ESP LIGHT ON AT TIMES / SOP	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16912 BRAKE LIGHT SWITCH SHORTED FOR ESPCHECKED OUT ESP LIGHT ON RAN SCAN TEST GOTCODE FOR BRAKE LIGHT SWITCH TRYED ADJUSTINGCODE CAME BACK REPLACED BRAKE SWITCH RETESTEDGOOD
KM8JN72D26U	8/17/05	13985	34.86	13985 CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF INSPECTED USED HDS,GOT C1513,TESTED AND BRAKE LIGHT SWITCH STICKING,REPLACED BRAKE LIGHT SWIT			
KM8JN12D86U	9/23/05	30070	32.3	30074 SCAN TEST P1513 TEST AND REPLACED BRAKE SWITCH.	CUSTOMER STATES ESC LIGHT ON	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 30074 SCAN TEST P1513 TEST AND REPLACED BRAKESWITCH.
KM8JM12BX6U	1/09/06	13771	31.26				
KM8JN72D75U	1/12/05	7066	21.6				
KM8JM72B75U	5/27/05	24035	52.54	C/S CHECK ENGINE LIGHT ON, CODE C1513 STORED, OPEN CIRCUIT IN BRAKE SWITCH, REPLACED BRAKE SWITCH AND ADJUST			
KM8JM12B76U	1/10/06	11025	37.84				
KM8JN72D06U	10/06/05	25922	34.26		FOUND BRAKE LIGHTS INOP.	FOUND FAULTY STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH

KM8JN72D56U	8/22/05	27828	34.26		CUSTOMER STATES ESC LIGHT COMES ON AND STAYS ON SO SWITCH HERE	INTERNAL FAULT IN BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JM12B45U	10/21/04	16694	36.68		CUST STATES THE ESP LIGHT IS ON	BRAKE LIGHT SWITCH FAULTY	REPLACE SWITCH, CLEAR CODES AND TEST
KM8JM12B45U	10/21/04	16694	36.68		RECALL 922 ECM REPROGRAM		RECALL COMPLETED
KM8JN72D45U	4/28/05	28785	32.16	REPLACED BRAKE LIGHT SWITCH CLEARED CODES RESET SYSTEM	CUST STATES ESP OFF LIGHT IS HAVING PROBLEMS CHECK AND ADVISE	FOUND CODE B1513 POOR CONNECTION AT BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH CLEARED CODES RESET SYSTEM
KM8JN72D45U	4/28/05	28785	32.16	REPLACED BRAKE LIGHT SWITCH CLEARED CODES RESET SYSTEM	CUSTOMER STATES CHECK ENGINE LIGHT ON SOP	FOUND CODE P0130 POOR SIGNAL FROM O2 SENSOR B1S1	REPLACE RIGHT UP O2 SENSOR CLEARED ALL CODES RESET SYSTEM
KM8JN12D15U	5/19/05	54069	34.26		FOUND BRAKE LIGHTS INOP.	FOUND BRAKE LIGHT SWITCH OPEN	REPLACED BRAKE LIGHT SWITCH
KM8JN72D76U	9/28/05	21268	34.26		CUSTOMER STATES D/S FRT AXLE BOOT IS RIPPED ESC LIGHT COMES ON AND GOES OFF ON ITS OWN	VERIFY BOOT IS RIPPED.	REPLACED DRIVER'S SIDE CV BOOT AND JOINT ASSY
KM8JN72D76U	9/28/05	21268	34.26		CUSTOMER STATES ESC LIGHT COMES ON AND GOES OFF	FOUND CODE C1513 BRAKE LIGHT CIRCUIT- FOUND BRAKE LIGHT SWITCH SHORTING INTERMITTENTLY	REPLACED BRAKE LIGHT SWITCH
KM8JM72B46U	11/24/05	37952	32.16		CUST STATES ESC LIGHT IS ON	SCAN TESTED AND FOUND INTERNAL FAILURE OF BRAKE LIGHT SWITCH, NEEDS NEW	R AND R BRAKE LIGHT SWITCH, RETESTED, ALL OK AT THIS TIME
KM8JM72B96U	10/18/05	56715	32.16	REPLACED BRAKE SWITCH CLEARED CODES REST SYSTEM	PERFORM DRIVER AIR BAG COVER MODULE REPLACEMENT (CAMPAIGN 079)	61B046R0 (.2)	COMPLETED ABOVE CAMPAIGN
KM8JM72B96U	10/18/05	56715	32.16	REPLACED BRAKE SWITCH CLEARED CODES REST SYSTEM	C/S TCS LIGHT ON	SCAN TESTED FOUND CODE C1513 POOR CONNECTION IN BRAKE SWITCH	REPLACED BRAKE SWITCH CLEARED CODES REST SYSTEM
KM8JN72D86U	8/16/05	24505	32.16		ESC OFF LIGHT GOES ON AT TIMES	DEFECTIVE BRAKE LAMP SWITCH CODE # C1503	REPLACED BRAKE LAMP SWITCH RE-CHECKED OK
KM8JN72D15U	7/01/05	32998	34.26	REPLACE BRAKE SWITCH, CLEAR ANY CODES AND TEST	CUST STATES THE BRAKE LIGHT AND ESP LIGHT COME ON WHILE DRIVING	BRAKE SWITCH FAULTY	REPLACE BRAKE SWITCH, CLEAR ANY CODES AND TEST
KM8JN72D16U	10/15/05	39879	34.56		CUST STATES HAD AB LIGHT ON NOW OFF		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D16U	10/15/05	39879	34.56		CUST STATES HAD AB LIGHT ON NOW OFF		SCAN FOR CODES SCAN FOR CODES
KM8JM12B85U	6/09/05	36757	31.84		PERFORM DRIVER AIR BAG COVER MODULE REPLACEMENT (CAMPAIGN 079)	61B046R0 (.2)	COMPLETED ABOVE CAMPAIGN
KM8JM12B85U	6/09/05	36757	31.84		CUST STATES ESP OFF LIGHT HAS BEEN COMING ON AND OFF RANDOMLY. CHECK AND ADVISE	CODE # C1513 BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH CLEARED CODES ROAD TESTED OK
KM8JN72D16U	8/22/05	8870	31.7		CUSTOMER STATES: ESP LIGHT ON - ERRATIC	INTERNAL FAILURE	DIAG ETS LIGHT ON AND REPLACE BRAKE LIGHT SWITCH
KM8JN72D56U	11/29/05	19573	34.56		CUST STATES ESC OFF LIGHT COMING ON INTERMITTENTLY BY ITSELF		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D36U	1/06/06	14374	34.24		CUST STATES "ESC OFF" LIGHT HAS COME ON BY ITSELF ON A COUPLE OF OCCASIONS		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D65U	7/01/05	36907	34.56		CUST STATES ESC OFF LIGHT COMES ON BY ITSELF INTERMITTENTLY		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D76U	12/03/05	6126	34.56		RECALL 079		DRIVER SIDE AIRBAG COVER MOD REPL DRIVER SIDE AIRBAG COVER MOD REPL
KM8JM12B07U	11/09/06	186	50.46	NTT TIME FOR DIAG CODE C1513 GDS	CUSTOMER STATES: ESC LIGHT ON	INTERNAL FAILURE	DIAFG CODE C1913 AND REPLACE BRAKE SWITCH
KM8JN72D56U	1/06/06	10788	35.74	C/S CRUISE CONTROL DOES NOT SET.BRAKE LAMP SWITCH SHORTED.	CUSTOMER STATES CRUISE CONTROL DOESNOT SET.	SHORTED BRAKE LIGHT SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D56U	1/06/06	10788	35.74	C/S CRUISE CONTROL DOES NOT SET.BRAKE LAMP SWITCH SHORTED.	CUST REPORTS NO ADDITIONAL SERVICE CONCERNS AT ALL ***** CUST REPORTS NO ADDITIONAL SERVICE CONCERNS AT ALL *****	RENTAL	
KM8JN72D76U	12/03/05	6126	34.56		CUST STATES ESC LIGHT WAS ON FOR 15MINUTES, SHUT DOWN VEHICLE AND RESTARTED LIGHT WAS OFF		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D15U	4/26/05	26225	34.56		CUST STATES CK ENG LIGHT ON		SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE
KM8JN72D15U	4/26/05	26225	34.56		CUST STATES CK ENG LIGHT ON		SENSOR ASSY-OXYGEN RH ADD4 WHEEL DRIVE SENSOR ASSY- OXYGEN RH ADD4 WHEEL DRIVE
KM8JN12D06U	12/12/05	8013	36.06	ESC LIGHT IS ON.SHORT IN STOP LAMP SWITCH.	CUST STATES SIR BAG LIGHT IS ON	OPEN	WIRE REPAIR TIME (MAJOR)- ADJUSTMENT WIRE REPAIR TIME (MAJOR)-ADJUSTMENT TECH VERIFIED CUSTOMERS COMPLAINT , PERFORMED IAG, FOUND B1702.B1522 BUCKLE PRETENTIONERRES. HIGH, REMOVED SEAT ASSEMBLY AND REPAIREDLOOSE CONNECTION AT BUCKLE ASSY.
KM8JN12D06U	12/12/05	8013	36.06	ESC LIGHT IS ON.SHORT IN STOP LAMP SWITCH.	CUST STATES ESC LIGHT IS ON	SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE TECH VERIFIED CUSTOMERS CONCERN.CODE C1513PRES ENT, BRAKE SWITCH FAULTY, REPLACED BRAKESWITCH , CLEARED CODE
KM8JN72D15U	4/26/05	26225	34.56		CUST STATES CK ENG LIGHT ON		SENSOR ASSY-OXYGEN RH ADDS CAN TOOL OPERATION SENSOR ASSY-OXYGEN RH ADDS CAN TOOL OPERATION

KM8JN72D15U	4/26/05	26225	34.56		CUST STATES ESP LIGHT DONT SHUT OFF	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D66U	1/05/06	13248	34.24		CUSTOMER STATES TO PERFORM RECALL 079	.	DRIVER SIDE AIRBAG COVER MOD REPL DRIVER SIDE AIRBAG COVER MOD REPL
KM8JN72D36U	1/05/06	21153	62.46	ESC OFF LIGHT ILLUMINATING AT TIMES.STOP LAMP SWITCH SHORTED.	CUSTOMER STATES ESC OFF LIGHT ILLUMINATING AT TIMES AND GOES OFF SOMETIMES QUICKLY - NO RESPONSE FROM SWITCH.	SHORTED	ADD SCAN TOOL TIME ADJUSTED SWITCH
KM8JN72D36U	1/05/06	21153	62.46	ESC OFF LIGHT ILLUMINATING AT TIMES.STOP LAMP SWITCH SHORTED.	CUSTOMER STATES ESC OFF LIGHT ILLUMINATING AT TIMES AND GOES OFF SOMETIMES QUICKLY - NO RESPONSE FROM SWITCH.	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D96U	8/15/05	27622	35.74	C/S ESC LIGHT COMES ION AND OFF.FOUND CODE C1513-BRAKE SWITCH OPEN/SHORT.	PERFORM OPEN RECALL 079	079 RECALL	079 RECALL 079 RECALL
KM8JN12D66U	1/05/06	13248	34.24		CUSTOMER STATES TO CHECK ESC RIDE IS ROUGH AND LIGHT ON	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D26U	9/23/05	16169	34.24		RECALL 079	.	DRIVER SIDE AIRBAG COVER MOD REPL DRIVER SIDE AIRBAG COVER MOD REPL
KM8JN12D26U	9/23/05	16169	34.24		CUST STATES "ESC OFF" LIGHT COMES ON INTERMITTANTLYBY ITSELF	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D16U	10/18/05	5976	34.4		CUST STATES TPMS LT IS ON	.	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D96U	8/15/05	27622	35.74	C/S ESC LIGHT COMES ION AND OFF.FOUND CODE C1513-BRAKE SWITCH OPEN/SHORT.	CUSTOMER STATES ESC LIGHT COMES ON AND OFF	ESC LIGHT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D96U	8/15/05	27622	35.74	C/S ESC LIGHT COMES ION AND OFF.FOUND CODE C1513-BRAKE SWITCH OPEN/SHORT.	INSTALL WIPER CAP	REAR WIPER CAP	REAR WIPER COVER ARM ASSY- REAR WIPER
KM8JN72D56U	8/18/05	22775	35.74	C/S CHECK ESC LIGHT GOES ON AND OFF.CODE C1513 BRAKE LIGHT SHORT.	CUST STATES CHECK ESC LIGHT GOES ONAND OFF	ESC LIGHT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D16U	10/18/05	5976	34.4		CUST STATES SPEEDOMETER IS INOP	.	INSTRUMENT CLUSTER ASSY RE INSTRUMENT CLUSTER ASSY RE
KM8JM12B96U	1/04/06	27369	34.56		CUSTOMER STATES ESC LIGHT STAYS ON	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B26U	11/25/05	27742	34.24				
KM8JN12D96U	7/30/05	11387	34.24		CUST STATES TPMS LIGHT ON	.	VALVE ASSY-TPMS VALVE ASSY- TPMS
KM8JN72DX6U	9/23/05	35193	36.06		CUSTOMER STATES WHILE INCHING UP ATSTOP LIGHT FOUND SUDDENLY BRAKE PEDAL UNABLE TO BE PUSHED DOWN AND NO RESPONSE FROM ACCELERATOR / CUSTOMER TURNED OFF IGNITION AND RESTARTED - CAR OK SINCE	SHORTED	ADD SCAN TIME (RESET) ADD SCAN TIME (RESET)
KM8JN72DX6U	9/23/05	35193	36.06		CUSTOMER STATES WHILE INCHING UP ATSTOP LIGHT FOUND SUDDENLY BRAKE PEDAL UNABLE TO BE PUSHED DOWN AND NO RESPONSE FROM ACCELERATOR / CUSTOMER TURNED OFF IGNITION AND RESTARTED - CAR OK SINCE	SHORTED	SENSOR-PRESSURE SENSOR- PRESSURE
KM8JN72DX6U	9/23/05	35193	36.06		RECALL # 079 OPEN CAMPAIGN.	RECALL	079 RECALL 079 RECALL
KM8JN12D96U	7/30/05	11387	34.24		CUST STATES TPMS LIGHT ON	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D46U	10/05/05	13407	36.2		CUSTOMER STATES ESC LIGHTS STAYS ONINTERMITTENTLY	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D26U	10/07/05	19950	34.56		CUST STATES CK ENG LIGHT CAME ON WENT OFF	.	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE
KM8JN72DX6U	9/23/05	35193	36.06		CUSTOMER STATES WHILE INCHING UP ATSTOP LIGHT FOUND SUDDENLY BRAKE PEDAL UNABLE TO BE PUSHED DOWN AND NO RESPONSE FROM ACCELERATOR / CUSTOMER TURNED OFF IGNITION AND RESTARTED - CAR OK SINCE	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D57U	6/20/06	12460	36.06	ESC LIGHT ILLUMINATED.FOUND CODE C1513 - STOP LAMP SWIRCH SHORTED.	CUSTOMER STATES ESC LIGHT COMES ON INTERMITTENTLY	SHORTED BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D46U	7/22/05	23973	35.74	C/S ECS OFF MESSAGE COMES ON AT TIMES.CODE C1513 - BRAKE LAMP SWITCH	CUSTOMER STATES ECS OFF MESSAGE COMES ON AT TIMES	SHORTED SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D26U	10/07/05	19950	34.56		CUST STATES CK ENG LIGHT CAME ON WENT OFF	.	SENSOR ASSY-OXYGEN RH ADDS CAN TOOL OPERATION SENSOR ASSY-OXYGEN RH ADDS CAN TOOL OPERATION
KM8JN12D26U	10/07/05	19950	34.56		CUST STATES ESC LIGHT CAME ON AND COULD NOT SHUT OFF	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B56U	10/21/05	24691	34.24		RECALL 079	.	DRIVER SIDE AIRBAG COVER MOD REPL DRIVER SIDE AIRBAG COVER MOD REPL
KM8JN72D46U	7/22/05	23973	35.74	C/S ECS OFF MESSAGE COMES ON AT TIMES.CODE C1513 - BRAKE LAMP SWITCH	CUSTOMER STATES ECS OFF MESSAGE COMES ON AT TIMES	SHORTED SWITCH	RENTAL CAR GOODWILL RENTAL CAR GOODWILL
KM8JN72D46U	7/27/05	34333	35.74	STOP LAMP SWITCH STICKING	RECALL #079 OPEN CAMPAIGN. INSPECT AND REPORT.	RECALL 079	079 RECALL 079 RECALL
KM8JN72D46U	7/27/05	34333	35.74	STOP LAMP SWITCH STICKING	CUSTOMER STATES MOST TIMES BRAKES LIGHTS (ALL) STAY ILLUMINATED WHEN CAR IS SHUT OFF. INSPECT AND REPORT.	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B56U	10/21/05	24691	34.24		CUST STATES ESC OFF LIGHT COMES ON BY ITSELF. ONLY TURNS OFF WHEN SHUTTING OFF VEHICLE	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE

KM8JM12B47U	10/24/06	5865	34.24		CUST STATES ON HOT AND HUMID DAYS, "ESC OFF" LIGHT STAYS ON AND WILL NOT GO OFF		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B47U	10/24/06	5865	34.24		CUST STATES ON HOT AND HUMID DAYS, "ESC OFF" LIGHT STAYS ON AND WILL NOT GO OFF		SCAN FOR CODES SCAN FOR CODES
KM8JM12B66U	7/12/05	16731	36.2		CUST STATES TCS LIGHT COMES ON AND STAYS ON SOP		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D06U	7/29/05	26086	62.46	ESC LIGHT ILLUMINATED, STOP LAMP SWITCH SHORTED.	CUST STATES ESC LIGHT IS ON.	SHORTED	ADD GDS TIME ADJUSTED SWITCH
KM8JN72D06U	7/29/05	26086	62.46	ESC LIGHT ILLUMINATED, STOP LAMP SWITCH SHORTED.	CUST STATES ESC LIGHT IS ON.	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D26U	10/17/05	22962	36.06	STOP LAMP SWITCH SHORTED.	SPECIAL ORDERED PART	SHORTED SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D16U	8/17/05	31226	29.16	SWITCH FAULTY, REPLACE BRAKE LAMP SWITCH THAT WAS INOP INTERMITTENTLY TO ESC MODULE	C/S ESC LIGHT ON	SWITCH FAULTY	CODE C1513-BRAKE LAMP SWITCH, REPLACED BRAKE LAMP SWITCH THAT WAS INOPERABLE INTERMITTENTLY TO ESC MODULE SWITCH ASSY-STOP LAMP RE
KM8JN72D65U	1/06/05	31821	27.06	BRAKE LAMP SWITCH STICKING, REPLACE SWITCH	C/S CRUISE CONTROL INOPP, WILL NOT RESET AFTER TOUCHING BRAKE	BRAKE LAMP SWITCH STICKING	VERIFY CONCERN, BRAKE LAMP SWITCH STICKING, REPLACE BRAKE LAMP SWITCH ASSY-STOP LAMP RE
KM8JN72D56U	7/16/05	23294	36.06	MIL & ESC LIGHTS ON, C1513 - BRAKE LAMP SWITCH SHORT.	PERFORM OPEN RECALL 079	079 RECALL	079 RECALL 079 RECALL
KM8JN72D56U	7/16/05	23294	36.06	MIL & ESC LIGHTS ON, C1513 - BRAKE LAMP SWITCH SHORT.	CUSTOMER STATES MIL/ESC LIGHTS WERE ON	MIL/ESC	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D85U	5/06/05	73382	34.86				
KM8JN72D56U	7/28/05	4065	25.2	4000 ADJUSTED BRAKE SWITCH REMOVED L100 FROM CAR	C/S CAR WILL NOT START HAPENS INTERMITTENTLY	C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 4000 ADJUSTED BRAKE SWITCH REMOVED L100 FROM CAR
KM8JM72B06U	12/06/05	11762	29.16	ESC LIGHT ON INTERMITTENTLY, REPLACE BRAKE LIGHT SWITCH THAT WAS FAULTY	C/S INSTALL PART ORDERED FROM A PREVIOUS VISIT-SWITCH	FAULTY SWITCH	REPLACED CRUISE SWITCH THAT WAS INOPERATIVE. SET LIGHT WOULD NOT STAY ON-JUST BLINKS SWITCH ASSY-CRUISE CONTROL MAIN RE
KM8JM72B06U	12/06/05	11762	29.16	ESC LIGHT ON INTERMITTENTLY, REPLACE BRAKE LIGHT SWITCH THAT WAS FAULTY	ESC LIGHT ON	SWITCH FAULTY	ESC LIGHT ON INTERMITTENTLY. REPLACED BRAKE LIGHT SWITCH THAT WAS BAD SWITCH ASSY-STOP LAMP RE
KM8JN72D85U	10/14/04	17286	27.06	BRAKE PEDAL SQUEAKS, SWITCH SQUEAKS EVERY TIME PEDAL IS DEPRESSED, REPLACE	C/S BRAKE PEDAL SQUEAKS	SWITCH SQUEAKING	REPLACE BRAKE LIGHT SWITCH THAT WAS SQUEAKING EVERY TIME BRAKE DEPRESSED SWITCH ASSY-STOP LAMP
KM8JM12B66U	7/11/05	22990	36.5	22990 CK ESP LITE ON AND NO BRAKE LITES CODE C1513 R&R BRAKE LITE SWITCH SHORTED	TOWED IN, NO START (NO BRAKE LIGHTS)	D15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 22990 CK ESP LITE ON AND NO BRAKE LITES CODE C1513 R&R BRAKE LITE SWITCH SHORTED
KM8JN12D17U	10/30/06	5918	34.86		C/S ESC OFF LIGHT POPS ON WHILE DRIVING, CEHCK/ADVISE	CODES C1513 BRAKE LAMP SWITCH AND C1237 PRESSURE SENSOR/ OTHER WERE STORED IN COMPUTER. TESTED AND FOUND FAULTY BRAKE LAMP SWITCH AND MASTER CYLINDER PRESSURE SENSOR. BOTH WORK INTERMITTENTLY.	REPLACED BRAKE LIGHT SWITCH, ORDERED PRES. SENSOR, AND CLEARED TROUBLE CODES FROM ABS/ESC MODULE.
KM8JN72D85U	10/14/04	17286	27.06	BRAKE PEDAL SQUEAKS, SWITCH SQUEAKS EVERY TIME PEDAL IS DEPRESSED, REPLACE	C/S MOUNT AND BALANCE TWO NEW TIRES-CHARGE 2 TIRES TO THIS LINE	ABNORMAL TIRE WEAR.	MOUNT AND BALANCE TWO NEW TIRES PER HYUNDAI WARRANTY PER DPSM-JIM. TIRES HAD ABNORMAL TIRE WEAR. DOWN TO WEAR BARS WITH 17,286 MILES TIRE AND/OR WHEEL ASSY (1WHEEL) RE
KM8JN72D85U	10/14/04	17286	27.06	BRAKE PEDAL SQUEAKS, SWITCH SQUEAKS EVERY TIME PEDAL IS DEPRESSED, REPLACE	C/S MOUNT AND BALANCE TWO NEW TIRES-CHARGE 2 TIRES TO THIS LINE	ABNORMAL TIRE WEAR.	TIRE AND/OR WHEEL ASSY (1WHEEL) RE TIRE AND/OR WHEEL ASSY (1WHEEL) RE
KM8JM72B67U	11/02/06	4032	29.16	INTERMITTANT OPERATION, REPLACED BRAKE LAMP SWITCH THAT WORKS INTERMITTENTLY	INSTALL PREVIOUSLY ORDERED BRAKE SWITCH FOR ESC LAMP ON	INTERMITTENT OPERATION	REPLACED BRAKE LAMP SWITCH THAT WORKS INTERMITTENTLY SWITCH ASSY-STOP LAMP RE
KM8JM12B56U	7/22/05	23103	25.2	23103 SCANNED FOR CODE FOUND C1513 FOR BRAKE LIGHT SWITCH DISCONNECTED L100 CLEAR CODE	C/S LITE ON DASH COMES ON	C40	ECM REPROGRAMMING ECM REPROGRAMMING 23103 SCANNED FOR CODES P0111 PRESENT REPROGRAM ECM AS PER TSB 06-36-005
KM8JM12B56U	7/22/05	23103	25.2	23103 SCANNED FOR CODE FOUND C1513 FOR BRAKE LIGHT SWITCH DISCONNECTED L100 CLEAR CODE	C/S VEH WOULDNT START STARTED 20 MINUTES LATER	C15	PARKING BRAKE SWITCH ASSY RE PARKING BRAKE SWITCH ASSY RE 23103 SCANNED FOR CODE FOUND C1513 FOR BRAKE LIGHT SWITCH DISCONNECTED L100 CLEAR CODE
KM8JN72DX5U	4/12/05	22968	34.86		OWNER REQUEST UNIT CHECKED ALOT OF TIME TURN KEY & NOTHING HAPPENS OR VERY SLOW ATTWEMPT, HOLD KEY OVER WILL TURN	BATTERY BAD CELL-REPLACE	REPLACE BATTERY PRINT OUT ON RO
KM8JN72D86U	11/08/05	28439	29.16	FAULTY SWITCH, REPLACED BRAKE LAMP SWITCH, RESET ADAPTIVE MEMORY	C/S RECALL 079	CAMPAIGN 079	REPLACEMENT OF DRIVER AIRBAG MODULE REPLACEMENT OF DRIVER AIRBAG MODULE
KM8JN72D86U	11/08/05	28439	29.16	FAULTY SWITCH, REPLACED BRAKE LAMP SWITCH, RESET ADAPTIVE MEMORY	C/S VEHICLE DOWNSHIFTED ON IT'S OWN AND VEHICLE STALLS AT TIMES, GOING ABOUT 65 MPH. TOOK FOOT OFF ACCELERATOR AND VEHICLE DOWNSHIFTED DRASTICALLY	FAULTY SWITCH	CODE C1513-BRAKE LAMP SWITCH, REPLACED BRAKE LAMP SWITCH THAT WAS FAULTY. ALSO, RESET ADAPTIVE MEMORY IN TCM AND ECM SWITCH ASSY-STOP LAMP RE
KM8JN12D75U	5/30/05	44171	29.16	ESC LIGHT ON & OFF, CHK & FOUND SWITCH FAULTY, REPLACED BRAKE LAMP SWITCH FAULTY	C/S ESC LIGHT HAS GONE OFF ON IT'S OWN A COUPLE OF TIMES	SWITCH FAULTY	ESC LIGHT GOING OFF AND ON. REPLACED BRAKE LAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN72DX5U	4/12/05	22968	34.86		CHECKED FOR CAR NOT STARTING AND FOUND BRAKE CUSTOMER STATES ESC LIGHT IS GOING ON AND OFF CK AND ADVISE	C1513 BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN72D96U	7/22/05	18098	34.86			C1513 BRAKE SWITCH SHORTED OUT	C1513 BRAKE SWITCH CLEARED CODE REPLACED SWITCH

KM8JN12D86U	7/29/05	14458	34.26		CHECK BRAKE LIGHT SWITCH	C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D86U	7/29/05	14458	34.26		C/S CRUISE CONTROL NOT WORKING, SOP	C15	CRUISE CONTROL BRACKET ASSY RE CRUISE CONTROL BRACKET ASSY RE 14458 BAD SWITCH REPLACED CRUISE CONTROL SWITCH
KM8JN72D25U	9/24/04	12744	27.06	WHEN USING CRUISE, LIGHT COMES ON AND OFF, FOUND CRUISE NOT WORKING, DIAG PROBLEM, REPLACE BRAKE LAMP SWITCH	C/S SOMETIMES ON STEEP HILLS WHEN GASING AND BRAKING CAR SHAKES	BRAKE PULSATION	VERIFIED FRONT BRAKES PULSATING. FRONT ROTORS WARPED. REPLACE FRONT ROTORS FRONT BRAKE DISC (BOTH SIDES) RE REAR TIRES ARE LOW ON TREAD. BF GOODRICH #CONC ERNING TIRE WEAR IS 877-788-8899 OR 800-847- VERIFIED CUSTOMER COMPLAINT OF VIBRATION WHILE ACCELERATING. BALANCED ALL 4 TIRES THAT WERE OUT OF BALANCE. WHEEL BALANCE (4 WHEELS) REAR TIRES ARE LOW ON TREAD. BF GOODRICH #CONC ERNING TIRE WEAR IS 877-788- 8899 OR 800-847-343 5
KM8JN72D25U	9/24/04	12744	27.06	WHEN USING CRUISE, LIGHT COMES ON AND OFF, FOUND CRUISE NOT WORKING, DIAG PROBLEM, REPLACE BRAKE LAMP SWITCH	C/S SOMETIMES ON STEEP HILLS WHEN GASING AND BRAKING CAR SHAKES	BRAKE PULSATION	VERIFIED CUSTOMER COMPLAINT OF VIBRATION WHILE ACCELERATING. BALANCED ALL 4 TIRES THAT WERE OUT OF BALANCE. WHEEL BALANCE (4 WHEELS) REAR TIRES ARE LOW ON TREAD. BF GOODRICH #CONC ERNING TIRE WEAR IS 877-788- 8899 OR 800-847-343 5
KM8JN12D45U	6/02/05	21000	28.1	C/S ESC LIGHT COMES ON INTERMITT. SHORTED. ESC LIGHT COMES ON CODE B1513R&R BRAKE LIGHT SWITCH SHORTED	C/S ESC LIGHT COMES ON INTERMITT	SJORTED	CK ESC LITE COMES ON CODE B1513 R&R BRAKE LITE SWITCH SHORTED
KM8JN72D46U	10/15/05	20635	36.5	20635 SCANNED FOR CODE C1513 BRAKE LAMP SWITCH REPLACED FAULTY BRAKE LIGHT SWITCH CLEARED CODE ALSO REMOVED L100	C/S AIR BAG LITE IS ON	C15	WIRE REPAIR TIME (MAJOR) WIRE REPAIR TIME (MAJOR) 20635 SCANNED FOR CODES B1334 PASS FRONT IMPACT SENSOR COMM. ERROR CHECKED SCANNED WAS 1X HJIST CODE CHECKED CONNECTIONS CLEARED CODE NO REPAIR AT THIS TIME CODE DID NOT RETURN
KM8JN72D25U	9/24/04	12744	27.06	WHEN USING CRUISE, LIGHT COMES ON AND OFF, FOUND CRUISE NOT WORKING, DIAG PROBLEM, REPLACE BRAKE LAMP SWITCH	C/S WHEN USING CRUISE CONTROL LIGHT COMES ON THEN WHEN GOING TO USE IT IT GOES AWAY	BRAKE LAMP SWITCH FAULTY	FOUND CRUISE NOT WORKING. DIAGNOSE PROBLEM. PROBLEM IN BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH STOP LAMP SWITCH ASSY RE
KM8JN12D75U	6/16/05	48813	28.84	NO BRAKE LAMPS, FAULTY SWITCH, REPLACE	C/S NO BRAKE LAMPS	FAULTY BRAKE LAMP SWITCH	CODE C1513-BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH THAT WAS INOPERABLE. VEHICLE HAD NO BRAKE LIGHTS SWITCH ASSY-STOP LAMP RE
KM8JN72D25U	4/21/05	13567	28.84	4 WHEEL DRIVE EMERGENCY LIGHT ON, REPLACE FAULTY BRAKE LAMP SWITCH	CUST STATES-RECALL DRIVERS SIDE AIRBAG CONTROL MODULE COVER	CAMPAIGN 079	REPLACEMENT OF DRIVER AIRBAG MODULE REPLACEMENT OF DRIVER AIRBAG MODULE
KM8JN72D46U	10/15/05	20635	36.5	20635 SCANNED FOR CODE C1513 BRAKE LAMP SWITCH REPLACED FAULTY BRAKE LIGHT SWITCH CLEARED CODE ALSO REMOVED L100	C/S SATB CONTROL ENGAGES/DIENGLAGESRANDOMLY	C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 20635 SCANNED FOR CODE C1513 BRAKE LAMP SWITCH REPLACED FAULTY BRAKE LIGHT SWITCH CLEARED CODE ALSO REMOVED L100
KM8JN12D26U	7/19/05	20356	34.54		C/S ESC LIGHT COMES ON INTERMITT, STAYS ON A FEW HOURS	SCANNED COMPUTER FOR ESC AND FOUND CODE C1513 BRAKE LAMP SW FAULT. TESTED AND FOUND SWITCH WORKING INTERMITTENTLY.	REPLACED BRAKE LAMP SWITCH AND CLEARED TROUBLE CODE.
KM8JN12D96U	10/04/05	46400	34.86		CHECK NO START	BRAKE SWITCH SHORTED	REPLACED BRAKE SWITCH SOP 3RD BRAKE LIGHT ASSY
KM8JN72D25U	4/21/05	13567	28.84	4 WHEEL DRIVE EMERGENCY LIGHT ON, REPLACE FAULTY BRAKE LAMP SWITCH	C/S ESP AND 4 WHEEL DRIVE EMERGENCY LIGHT ON	BRAKE LAMP SWITCH FAULTY	CODE C1513-BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH THAT WAS FAULTY. 4 WHEEL DRIVE LAMP OFF SWITCH ASSY-STOP LAMP RE
KM8JN72D76U	8/19/05	20826	28.84	LIGHT ON, CHK & FIND BRAKE LAMP SWITCH STAYING OPEN, REPLACE	RECALL #079-DRIVERS SIDE AIRBAG COVER MODULE REPLACED. THERE IS ONE SET ASIDE IN OUR PARTS DEPT. FOR THIS CUSTOMER	CAMPAIGN 079	REPLACEMENT OF DRIVER AIRBAG MODULE REPLACEMENT OF DRIVER AIRBAG MODULE
KM8JN72D66U	7/27/05	18809	36.5	18809 FOUND L-100 IS FINE - BRAKE LIGHT SWITCH IS NOT WORKING ALL THE TIME. REPLACED BRAKE LIGHT SWCH AND RECHECKED. WORKING AS DESIGNED	C/S HARD TIME STARTING (OK REMOVE L100)	C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 18809 FOUND L-100 IS FINE - BRAKE LIGHT SWITCH IS NOT WORKING ALL THE TIME. REPLACED BRAKE LIGHT SWCH AND RECHECKED. WORKING AS DESIGNED
KM8JM72B75U	4/29/05	3807	25.2		C/S CAR SOMETIMES WILL NOT START, SOPW	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 3807 REPLACED BRAKE SWITCH
KM8JM12B15U	4/09/05	16394	36.5		50B035R1- ECM ESU REPROGRAM	C01	ESP ESU REPROGRAM ESP ESU REPROGRAM 16394 RECALL REPROGRAMMED ESU LOGIC
KM8JN72D76U	8/19/05	20826	28.84	LIGHT ON, CHK & FIND BRAKE LAMP SWITCH STAYING OPEN, REPLACE	CUST STATES-ESC LIGHT ON**CHK & REPORT	SWITCH STAYING OPEN	CODE C1513-BRAKE LAMP SWITCH. BRAKE LAMP SWITCH STAYING OPEN. REPLACED BRAKE LAMP SWITCH-NO BRAKE LIGHTS SWITCH ASSY-STOP LAMP
KM8JN12D16U	7/20/05	15100	28.84	BRAKE SWITCH FAULTY, REPLACE	CUST STATES-ESC LIGHT ON**CHK & REPORT	BRAKE SWITCH FAULTY	CODE C1513-BRAKE LAMP SWITCH. ESC LIGHT ON. REPLACED BRAKE LAMP SWITCH THAT WAS BAD SWITCH
KM8JN72D06U	9/05/05	22158	33.81		CUSTOMER STATES THE EST LIGHT STAYS ON	CHECK OVER CODE C1513 BRAKE LIGHT CIRCUIT FOUND BRAKE LIGHT SWITCH SHORTED	REPLACE SWITCH, RESET SYSTEM

KM8JM12B15U	4/09/05	16394	36.5		TUCSON PARKING BRAKE LEVER CAMPAIGN(51B028R0) AS PER TSB 05-01-006	C01	PARKING BRAKE LEVER (TSB#05-01-006) PARKING BRAKE LEVER (TSB#05-01-006) 16394 RECALL REPLACED PARKING BRAKE LEVER
KM8JM12B15U	4/09/05	16394	36.5		TOWED IN FOR NO START	C15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 16394 CHECKED AND FOUND BRAKE LIGHT SWITCH INOP ORDERED NEW BRAKE LIGHT SWITCH(VIP-CARDOWN) REPLACED BRAKE LIGHT SWITCH
KM8JM12B56U	7/22/05	25108	36.5		CUST STATES REPEAT CONCERN	INOP	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 25124 BRAKE SWITCH C1513 REPLACE BRAKE LIGHTSWITCH
KM8JN72D85U	1/20/05	31345	32.1		CUST.STATES CRUISE CONT. NOT WORKING	FOUND FAULTY SWITCH	REPLACE SWITCH
KM8JN72D26U	8/08/05	15695	33.81		CUSTOMER STATES ESC LIGHT IS ON	TECH SCANNED FAULT CODE C1513 BRAKE LAMP SWITCH LIGHT INT INOP	TECH REPLACED BRAKE LAMP SWITCH ALL OPERATING AS DESIGNED AT THIS TIME
KM8JM12B75U	11/06/04	19794	31.73		CUSTOMER STATES VEHICLE WOULD NOT START CUSTOMER PUSHED WHITE NEUTRAL SWITCH SEVERAL TIMES AND VEHICLE STARTED	SWITCH SHORTING OUT	REPLACE SWITCH BY CLUTCH PEDAL
KM8JN72D05U	10/07/04	15434	32.01		CUST STATES INSTALL SOP BRAKE LIGHT SWITCH ESP LIGHT HAS BEEN COMING ON AND OFF	CODE FOR BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JM12B56U	7/22/05	25108	36.5		C/S ESC LITE COMES ON	C15	REAR WHEEL SPEED SENSOR (LH)- ABS RE REAR WHEEL SPEED SENSOR (LH)- ABS RE 25108 C1513 BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH AND YAW SENSOR
KM8JM12B56U	7/22/05	25108	36.5		C/S ESC LITE COMES ON	C15	REAR WHEEL SPEED SENSOR ADD SCAN TOOL OPERATION REAR WHEEL SPEED SENSOR ADD SCAN TOOL OPERATION 25108 C1513 BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH AND YAW SENSOR
KM8JM12B36U	7/11/05	30607	34.86		TECH FOUND BRAKE LITE SWITCH SHORTED	BRAKE LIGHTS INOP. CHECK BRAKE LIGHT SWITCH ADJUSTMENT OK. FOUND SWITCH INOP	REPLACE BRAKE LIGHT SWITCH COMPLETED.
KM8JN72D66U	9/26/05	12305	37.84		CUSTOMER STATES THE TPMS LIGHT IS ON AGAIN.	PERFORMED DIAG, FOUND BRAKE LAMP SWITCH INTERNAL FAILURE.	TECH REMOVED AND REPLACED THE BRAKE LAMP SWITCH AND CLEARED THE LIGHT NO CODES RETURNED.
KM8JN72D05U	4/23/05	10450	37.84		CUSTOMER STATES ESC LIGHT IS ON, CHECK AND ADVISE...	TECH FOUND FAULTY BRAKE SWITCH	TECH REPLACED FAULTY BRAKE SWITCH AS NEEDED
KM8JN72D05U	4/23/05	10450	37.84		CUSTOMER REQ RECALL 079, DRIVER AIRBAG COVER	SERVICE CAMPAIGN	REPLACED DRIVER AIRBAG COVER AS REQUIRED
KM8JM72B75U	4/29/05	17079	34.86		CUST STATES THE ELECTRONIC SYSTEM SHUTS OFF WHEN DRIVING WILRESET WHEN CAR GETS SHUT OFF AND TURNED BACK ON	PULL BODY CODES ON ESP LIGHT B1513 BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12D06U	11/29/05	27153	34.86		C/S ESC LITE CAME ON WHILE DRIVING A COUPLE OF TIMES NOW IT IS OFF	C1513 RECORDED IN ESC MODULE, FAULTY BRAKE LAMP SWITCH	REPLACE BRAKE LAMP SWITCH AND RECHECK ESC OPERATION
KM8JN12D05U	4/18/05	32393	34.86		C/S ESP LIGHT SAYS OFF WHEN IT WANTS TO WITHOUT PUSHING BUTTON, CEHCK/ADVISE	C1513 BRAKE LAMP SWITCH C1237 PRESSURE SENSOR - OTHER C1260 STEERING W/SENSOR -ABNORMAL	REPLACED BRAKE LAMP SWITCH ORDERED STEERING ANGLE SENSOR ORDERED PRESSURE SWITCH
KM8JN72D36U	7/26/05	14931	38.16	REPLACED BRAKE SWITCH, RECHECKED, OKAY	CUSTOMER STATES ESC LIGHT GOES ON AT TIMES, WILL NOT TURN OFF UNLESS TURN OFF ENGINE AND RESTART	PERFORMED DIAG. CODE C1513 BRAKE SWITCH MALFUNCTION	REPLACED BRAKE SWITCH, RECHECKED, OKAY
KM8JN72D05U	4/21/05	16732	37.84		CUSTOMER STATES ESP LIGHT COMES ON AT TIMES.	TECH FOUND FAULTY BRAKE SWITCH	TECH REPLACED FAULTY BRAKE SWITCH AS NEEDED
KM8JN72D46U	7/30/05	30125	38.16		CUSTOMER STATES BRAKE LIGHTS STAY ON \$98.00 PLUS TAX TO CHECK IF NOT WARRANTY	FOUND BRAKE LIGHT SWITCH SHORTED	REPLACED BRAKE LIGHT SWITCH
KM8JN72D46U	10/13/05	18995	36.5	18995 CHECKED AND FOUND BRAKE LIGHT SWITCH INTERMITT. NOT WORKING. REPLACED BRAKE LIGHT SWITCH, REMOVED L-100, AND REWIRED REMOTE START.	C/S HAVING OFTEN TROUBLE STARTING CAR, SEE KEITH	C15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 18995 CHECKED AND FOUND BRAKE LIGHT SWITCH INTERMITT. NOT WORKING. REPLACED BRAKE LIGHTSWITCH, REMOVED L-100, AND REWIRED REMOTESTART.
KM8JN12D06U	8/22/05	14516	33.43				
KM8JN12D86U	7/28/05	20872	34.86		CUSTOMER STATES STEERING WHEEL LOCKS AND THE BRAKE PEDAL IS STIFF. CAN NOT START THE CAR CK AND ADVISE	CODE C1513	CHECKED AND FOUND CODE C1513 BRAKE SWITCH. REPLACED BRAKE SWITCH AND CLEARED CODE. RECHECKED OK.
KM8JM12B36U	7/14/05	28202	37.84		CUSTOMER STATES REAR BRAKE LIGHTS STAYING ON AT ALL TIMES, \$98.00 PLUS TAX TO CHECK IF NOT WARRANTY	BRAKE LIGHT SWITCH SHORTED	REPLACED BRAKE LIGHT SWITCH
KM8JM12B36U	7/14/05	28202	37.84		CUSTOMER REQ RECALL 079, DRIVER AIRBAG COVER	SERVICE CAMPAIGN	REPLACED DRIVER AIRBAG COVER AS REQUIRED
KM8JN72D86U	9/25/05	26534	38.16		CUSTOMER STATES POWER OUTLET INOP - INSTALL SOP	POWER OUTLET SHORTED	REPLACED POWER OUTLET
KM8JM12B15U	6/15/05	14739	34.54		CUSTOMER STATES ESC LIGHT GOING ON AND OFF CK AND ADVISE	C1513 BRAKE LAMP SWITCH INOP	REPLACED BRAKE LAMP SWITCH
KM8JM12B15U	6/15/05	14739	34.54		CUSTOMER STATES HUSH PANEL DEFORMED	PANEL DEFORMED	REPLACED DRIVERS HUSH PANEL
KM8JN12D86U	9/26/05	14363	36.5				
KM8JM12B75U	6/13/05	13215	34.54		CHECK SOMETIMES CAR WILL NOT START, YOU HAVE TO PLAY WITH BRAKE PEDAL	BRAKE SWITCH	CHECKED AND FOUND CODE C1513 BRAKE SWITCH ERROR. REPLACED BRAKE SWITCH AND RECHECKED OK.

KM8JN72D86U	9/25/05	26534	38.16		CUSTOMER STATES ESL LIGHT COMES ON WHILE DRIVING	FOUND BRAKE LIGHT SWITCH SHORTED	REPLACED BRAKE LIGHT SWITCH
KM8JN72D66U	12/26/05	22680	29.16	CUSTOMER STATES CRUISE INOP. CHECKED AND VERIFIED CONCERN. SCANNED AND FOUND NO CODES. FOUND BRAKE SWITCH SHORTED. REPLACED BRAKE SWITCH. ATT FOR DIAG	CUST STATES CRUISE INOP	CHECKED VERIFIED CONCERN. PERFORMED DIAGNOSIS. SCANNED NO CODES. FOUND BRAKE SWITCH SHORTED	REPLACED BRAKE SWITCH 93810R00 .3/ 93810RP0 .3
KM8JN72D86U	11/02/05	21660	29.16		CUST STATES CRUISE INOP	VERIFIED CONCERN. BRAKE SWITCH MALFUNCTION	REPLACED BRAKE SWITCH 93810R00 .3
KM8JM12B06U	7/14/05	22369	36.5	22369 SCAN CODE C1513 - BRAKE LAMP SWITCH CHECK CIRCUIT - REPLACE SWITCH	C/S SOMETIMES ESC LIGHT COMES ON AND WILL NOT GO OFF, SOP	C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 22369 SCAN CODE C1513 - BRAKE LAMP SWITCH CHECK CIRCUIT - REPLACE SWITCH
KM8JN12D96U	10/19/05	13287	36.5	13287 BRAKE SWITCH. CHECKED AND FOUND CODES C1237 AND C1513 CHECKED CODES AND FOUND BRAKE LIGHT SWITCH STICKING. REPLACED BRAKE LIGHT SWITCH AND ROAD TESTED.	C/E ESC LIGHT ILLUMINATES RANDOMLY AND OFTEN	C69	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 13287 BRAKE SWITCH. CHECKED AND FOUND CODES C1237 AND C1513 CHECKED CODES AND FOUND BRAKE LIGHT SWITCH STICKING. REPLACED BRAKE LIGHT SWITCH AND ROAD TEST
KM8JN72D86U	11/02/05	21660	29.16		CUSTOMER STATES KEY WILL NOT COME OUT OF IGNITION AND IN ORDER TO GO FROM ANY GEAR OR REVERSE INTO PARK YOU REALLY HAVE TO FORCE IT IN. SHIFT KNOB ALSO GO INTO MANUAL SHIFT ALL BY ITSELF. - WHOLE SHIFT ASSEMBLY IS NOT WORKING RIGHT	VERIFIED CONCERN.	REPLACED SHIFTER 43721R00 .6
KM8JN72D36U	11/26/05	4616	52.7	ATT IS FOR SCAN CODE C1513	CUSTOMER STATES ESC LIGHT IS ON.	FOUND CODES C1513, BRAKE LAMP SWITCH SHORTED	REPLACED BRAKE LAMP SWITCH AND RETESTED
KM8JN72D56U	11/11/05	1246	31.58		CUSTOMER STATES ESC LIGHT WILL NOT TURN OFF.	SCANNED CAR FOUND BRAKE SWITCH TO BE SHORTING OUT	REPLACED BRAKE SWITCH, RESCANED WORKING FINE AT THIS TIME
KM8JN72D86U	7/29/05	10951	25.2		CHECK FOR CODES	C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REAR WHEEL SPEED SENSOR (LH)- ABS RE REAR WHEEL SPEED SENSOR (LH)- ABS RE 10953 C1208 - R/L WHEEL SPEED SENSOR GAPC1207 - R/L WHEEL SPEED SENSOR SPEED JUMP. C1513 - BRAKE LAMP SWITCH CHECKED WHEEL SPEED SENSOR OPERATION AND TONE WHEEL CONDITION. FOUND A LOT
KM8JN72D86U	7/29/05	10951	25.2		C/S ABS LIGHT , ESC OFF, AND 4WD LIGHT HAVE BEEN COMING ON	C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 20245 BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH
KM8JN12D05U	4/18/05	20245	36.5	20245 BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH	C/S NO START	C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 20245 BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH
KM8JN12D95U	6/02/05	18074	33.36		CUSTOMER STATES THE ESP OFF LIGHT WILL COME ON AFTER YOU START DRIVING AND WILL NOT TURN OFF	CODES C1283 AND C1513 PRESENT	REPLACED BRAKE LAMP SWITCH ORDERED G SENSOR
KM8JM12B97U	9/28/06	1203	30.04				
KM8JN72D26U	9/02/05	24011	33.04		CUSTOMER REQUESTS DRIVER AIR BAG COVER CAMPAIGN 079 BE COMPLETED	OPEN CAMPAIGN ON VEHICLE	COMPLETED CAMPAIGN 079 - NEW AIR BAG COVER INSTALLED ON
KM8JN72D26U	9/02/05	24011	33.04		ESC LIGHT ON	CODE C1513 PRESENT	REPLACED BRAKE SWITCH. CLEARED CODE CHECKED AND FOUND CODE C1513 BRAKE SWITCH. REPLACED SWITCH NOT WORKING AT TIMES ALSO REMOVED L100.
KM8JN12D85U	5/20/05	11351	34.54		CUSTOMER STATES VEHICLE DOES NOT START INTERMITTENTLY CK FOR L100 AND REMOVE IF NECESSARY	BRAKE LIGHT SWITCH.	
KM8JN12D46U	9/25/05	22768	34.86		CUSTOMER STATES ESC LIGHT IS ON AND VEHICLE INTERMITTENTLY WILL NOT START WHEN STEPPING ON THE BRAKE PEDAL CK AND ADVIS	TC C1513 - STOP LIGHT SW.	REPLACE STOP LIGHT SW.
KM8JM12B35U	6/22/05	27930	36.7		C/S CAR WILL NOT START SOMETIMES HAS TO STEP BRAKE PEDAL MANY TIMES TO START		INSTALLED NEW BRAKE LIGHT SWITCH
KM8JN72D26U	8/08/05	16921	52.7	ATT IS FOR SCAN CODE 1513	CUSTOMER STATES ESC LIGHT IS ON.	FOUND CODES B1513	REPLACED FAULTY BRAKE LAMP SWITCH AND RETESTED OPERATION
KM8JN72D06U	8/19/05	19276	33.04		CUSTOMER STATES THE ESC LIGHT IS ON	FOUND THE BRAKE STOP SWITCH TO BE SHORTING OUT CAUSING THE ESC LIGHT TO BE ON	REPLACE THE BRAKE STOP SWITCH AND REPLACED THE BRAKE STOP SWITCH AT THIS TIME CAR IS OPERATING AS
KM8JN72DX6U	12/15/05	3943	30.04		CUSTOMER REQUESTS DRIVER AIR BAG COVER CAMPAIGN 079 BE COMPLETED	OPEN CAMPAIGN ON VEHICLE	ORDERED PART AT THIS TIME
KM8JN72D16U	7/28/05	33348	34.86	ESC LITE ON COULD NOT RESTART ENG FAULTY STOP LIGHT SWITCH REPLACED	C/S ESC LIGHT WENT ON AND I COULD NOT RESTART ENGINE C/S HAPPENED 1X	FAULTY STOP LAMP SWITCH	TECH REPLACED SWITCH- VERIFIED REPAIR
KM8JN12D75U	6/03/05	18700	36.5		C/S SOMETIMES CAR IS HARD TO GET STARTED, OK TO REMOVE L100, MUST FEATHER BRAKE PEDAL TO START		SCANNED FOR CODES FOUND C1513 FOR BRAKE LIGHT SWITCH IN ESP MODULE REMOVED L100 AND REPLACED BRAKE LIGHT SWITCH CLEAR C
KM8JN12D06U	12/17/05	15480	34.86	ESC LITE ON DASH ONCE C1513 REPLACED BRAKE LITE SWITCH	C/S ESC LITE CAME ON DASH ONCE	C1513	REPLACED BRAKE LAMP SWITCH
KM8JN72DX6U	12/15/05	3943	30.04		CUSTOMER STATES ESC OFF LIGHT IS ON	C1513	TECHNICIAN REPLACED BRAKE SWITCH AND OK AT THIS TIME
KM8JM12B75U	6/14/05	25473	33.36		CUSTOMER REQUESTS DRIVER AIR BAG COVER CAMPAIGN 079 BE COMPLETED	OPEN CAMPAIGN ON VEHICLE	COMPLETED CAMPAIGN 079 - NEW AIR BAG COVER INSTALLED ON
KM8JM12B75U	6/14/05	25473	33.36		CUST STATES CK ESC LIGHT COMES ON	FOUND THE BRAKE STOP SWITCH TO BE SHORTED OUT CAUSING THE ESC LIGHT TO COME ON. PULLED CODE C1513	REPLACED THE BRAKE STOP SWITCH AT THIS TIME

KM8JN12D16U	10/01/05	17000	34.54	C/S EVERY ONCE IN AWHILE IT WONT STARTWHEN IT HAPPENS THE BRAKE IS STIFF AND THE LIGHTD COME ON INSIDE CHECKED AND FOUND BRAKE LIGHT SWITCH INOP REPLACED BRAKE LIGHT SWITCH	C/S EVERY ONCE IN A WHILE IT WONT START WHEN IT HAPPENS THE BRAKE IS STIFF AND THE LIGHTS COME ON INSIDE	CHECKED AND FOUND BRAKE LIGHT SWITCH INOP	REPLACED BRAKE LIGHT SWITCH
KM8JN12D16U	9/13/05	13718	36.5	CAR TOWED IN FOR NO START CHECK/ADVISE FOUND BRAKE LIGHT SWITCH INOP REPLACE BRAKE LIGHT SWITCH COMPLETED	CAR TOWED IN FOR NO START, CEHCK/ADVISE	FOUND BRAKE LIGHT SWITCH INOP.	REPLACE BRAKE LIGHT SWITCH COMPLETED.
KM8JN72D26U	12/02/05	20501	34.86		C/S ESC LIGHT HAS BEEN ON SEVERAL TIMES	C1513 BRAKE LIGHT SWITCH SHORTED	REPLACE BRAKE LIGHT SWITCH
KM8JM12B05U	6/22/05	27051	30.04				
KM8JN72D86U	10/27/05	3673	32		CUSTOMER STATES ESC OFF LIGHT IS ON. BARRY CHECK FOR CODE C1513	VERIFIED INTERNAL SHORT IN BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN72D86U	10/27/05	3673	32		CUSTOMER STATES PASSENGER AIR BAG LIGHT NEVER GOES ON	SCANNED FOUND NO CODES	RESET PADS TESTED OPERATION OK
KM8JN72D86U	10/15/05	16860	34.86	ESC LIGHT IS ON DTC 1531 RECORDED. FOUND SHORTED BRAKE LAMP SWITCH REPLACED SWITCH AND ERASED DTC'S			
KM8JN12D76U	10/13/05	21780	34.54				
KM8JN72DX6U	10/16/05	6710	34.54		C/S CAR TOWED IN WILL NOT START	CODE C1513 BRAKE SWITCH ERROR. TESTED AND FOUND DEFECTIVE BRAKE SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN72D47U	3/15/07	8516	33.36	CUSTOMER STATES LIGHTS FLICKERS SCANNED FOR CODES B1513 SHORT IN BRAKE LIGHT SWITCH REPLACED SWITCH	ESC LIGHT COMES ON INTERMITTENTLY. INSTRUMENT FLICKERS.	SCANNED FOR CODES,	B1513 REPLACED BRAKE LIGHT SWITCH.
KM8JN72D55U	2/23/05	19794	50.46	ATT IS FOR SCAN CODE C1513	CUSTOMER STATES THERE IS WHINING/HUMMING NOISE MORE PROFOUND. VERIFY WHICH SIDE ALSO	UNABLE TO DUPLICATE CUSTOMER'S CONCERN AT THIS TIME. RECOMMEND ROADFORCE BALANCE, VIBRATION ONLY	NOISE COMING FROM TIRES/VIBRATION CONCERN. VEHICLE IS OPERATING NORMALLY AT THIS TIME.
KM8JN72D55U	2/23/05	19794	50.46	ATT IS FOR SCAN CODE C1513	CUSTOMER REQUESTS CHARGING SYSTEM CHECK	CHECKED CHARGE SYSTEM, VEHICLE IS OPERATING NORMALLY AT THIS FOR ALTERNATOR/STARTER/BATTERY WITH LOAD ON/OFF	VEHICLE IS OPERATING NORMALLY AT THIS TIME. FOR CHARGING SYSTEM.
KM8JN72DX5U	6/03/05	13104	34.86		CUSTOMER STATES THE BRAKE PEDAL GETS VERY STIFF AND THE VEHICLE WILL NOT START CK FOR THE L100	TECH FOUND BRAKE SWITCH BINDING C1513	R&R BRAKE SWITCH
KM8JN12D86U	8/10/05	25108	34.54		SES AND ESC LIGHT COME ON INTERMITT	C1513 BRAKE LIGHT SWITCH P0130 B1S1	REPLACE BRAKE LIGHT SWITCH SOP 02 SENSOR
KM8JN12D65U	4/25/05	10723	34.54	C/S ESC LIGHT IS ON SCAN CODE C1513 BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH CHECK CIRCUIT	C/S ESC LIGHT IS ON	SCAN CODE C1513 - BRAKE LAMP SWITCH	REPLACE C BRAKE LAMP SWITCH - CHECK CIRCUIT
KM8JN72D96U	7/26/05	32385	34.86		CUSTOMER STATES PERFORM RECALL RECALL 079	FACTORY REQUIRED	SOP AIR BAG RECALL COMPLETED
KM8JN72D55U	2/23/05	19794	50.46	ATT IS FOR SCAN CODE C1513	CUSTOMER STATES ESP LIGHT STAYS ON SPORATICALLY WHEN IS ON STAYS ON. IS OFF NOW.	VERIFIED, SCANNED CODE, C1513 BRAKE STOP SWITCH MALF, INTERNALLY FAILED.	REPLACED BRAKE STOP SWITCH, REPAIRS COMPLETED. CLEARED CODE.
KM8JN12D55U	1/28/05	217	31.2				
KM8JN72D36U	11/03/05	1113	52.7	ATT IS FOR SCAN CODE C1513	CUSTOMER STATES ESC LIGHT IS ON.	PULLED CODE C1513 BRAKE SWITCH CIRCUIT FOUND THE BRAKE SWITCH IS STICKING	REPLACED THE BRAKE SWITCH AND RECHECKED. CLEARED CODE OK AT THIS TIME
KM8JN72D96U	7/26/05	32385	34.86		CUSTOMER STATES VEHICLE WON'T CRANK AT TIMES , DASH LIGHTS COME ON BUT WON'T CRANK	C1513 BRAKE SWITCH	REPLACED BRAKE SWITCH ASSY CLEARED CODES LABOR OP 93810R00
KM8JN72D76U	7/28/05	20400	34.86		TECH FOUND CODE C1513 BRAKE LIGHT SWITCH INOP	BRAKE LIGHT SWITCH SHORTED OUT	R&R BRAKE LIGHT SWITCH
KM8JN72D56U	7/19/05	33709	34.86		CAR TOWED IN FOR NO START, IS NCE TO PRESS BRAKE PEDAL DOWN HARD TO GET STARTED, OK TO REMOVE L100 IF NEC	FOUND CODE C1513 ESC LIGHT ON, REPLACED SHORTED BRAKE SWITCH	REPLACED BRAKE SWITCH FOR SHORTED
KM8JM12B66U	11/06/05	2174	32		CUSTOMER STATES ESC OFF LIGHT HAS COME ON	FOUND FAULTY BRAKE LAMP SWITCH	REPLACED SWITCH AND RETESTED OPERATION
KM8JM12B45U	6/13/05	20305	33.04		CUSTOMER STATES THE ESC LIGHT WILL COME ON AND WILL NOT SHUT OFF WHEN YOU PUSH THE ESC BUTTON	FOUND THE BRAKE STOP SWITCH TO BE SHORTING OUT	REPLACED THE BRAKE STOP SWITCH AT THIS TIME OPERATING AS DESIGNED
KM8JN72D36U	11/03/05	9539	33.36	PART FAILED AGAIN	CUSTOMER STATES THE BRAKE LIGHTS DO NOT WORK AND THE ESC OFF LIGHT IS ON	FOUND THE BRAKE STOP SWITCH TO BE SHORTING OUT	REPLACED THE BRAKE STOP SWITCH AT THIS TIME
KM8JN12D76U	8/08/05	34974	37.07	34974 DIAG B1513 R+R INOP BRAKE LIGHT SWITCH OK			
KM8JN72DX6U	8/09/05	12602	37.4		C/S ESC LIGHT IS ON.....SOP INSTOCK	SHORT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D65U	5/26/05	34216	37.07	34222 LIGHT ON- ECT,ABS,ESP HOOK UP SCAN TOOL C1513 BRAKE LIGHT SWITCH SHORTY R/R SWITCH TEST OK			
KM8JN72D85U	5/20/05	12516	32		CUSTOMER STATES ESP OFF LIGHT IS ON AND WILL NOT GO OFF	PULLED CODE C1211 WHEEL SPEED SENSOR RIGHT REAR NO SIGNAL C1513 BRAKE SWITCH CIRCUIT. FOUND THE WHEEL SPEED SENSOR TO BE SHORTING OUT AS WELL AS THE BRAKE STOP SWITCH IS SHORTING OUT.	REPLACED THE BRAKE SWITCH AND ORDERED RR WHEEL SPEED SENSOR AND CLEARED CODES AT THIS TIME. OPERATING AS DESIGNED AT THIS TIME CUSTOMER WILL BE NOTIFIED WHEN PART ARRIVES.
KM8JN72D37U	1/20/07	2824	33.36				
KM8JN72D75U	9/03/04	16038	28.07				
KM8JM12B57U	1/19/07	1597	33.04		CUSTOMER STATES ESC OFF LIGHT STAYS ON.	CODE C1513 PRESENT	REPLACED STOP LAMP SWITCH
KM8JN72D36U	10/19/05	19796	35.44	19796 CODE C 1513 BRAKE LAMP SWITCH SHORTY-R/R SWITCH TEST OK			

KM8JN12DX6U	10/18/05	12078	35.44	12078 DID DIAGNOSTIC TEST USING SCAN TOOL. FOUND CODE C1513. FOUND DEFECTIVE BRAKE SWITCH. REPLACED BRAKE SWITCH. ERASED CODE. ROAD TESTED-OK			
KM8JN72D46U	10/04/05	24737	37.07	24737 BRAKE SWITCH SHOWED OPEN CIRCUIT. C 1513 BRAKE LAMP SWITCH MALF REPLACED SWITCH			
KM8JN12D26U	7/29/05	20765	35.44	20765 ESC LIGHT ON + BRAKES STAY ON--HOOK UP SCAN TOOL CODE C1513 BRAKE LAMP SWITCH SHORTY -R/R BRAKE LIGHT SWITCH ASSY TEST OK			
KM8JN72D86U	10/15/05	21335	33.04		CUSTOMER STATES ESC LIGHT COMES ON PERIODICALLY	C1513 PRESENT	REPLACED STOP LAMP SWITCH
KM8JM12B96U	5/08/06	6918	30.04		CUSTOMER REQUESTS DRIVER AIR BAG COVER CAMPAIGN 079 BE COMPLETED	OPEN CAMPAIGN ON VEHICLE	PART HAS BEEN ORDERED CUSTOMER WILL BE NOTIFIED WHEN PART ARRIVES.
KM8JM12B96U	5/08/06	6918	30.04		LAST WEEK ON THE HIGHWAY LOST POWER AND WOULDNT RESOND WHEN GIVING GAS, ESC LIGHT CAME ON, SEEMS OK NOW	NO CODES PRESENT, BRAKE STOP SWITCH FAILED CAUSING ESC LIGHT TO COME ON.	SCAN FOR CODES AND PINPOINT, REPLACE FAULTY BRAKE STOP SWITCH.
KM8JM12B95U	5/24/05	30673	35.76	30673 ENG LIGTH ON CODE C1513 BRAKE LIGTH SHORTY -R/R SWITCH TEST OK			
KM8JN72D96U	9/06/05	10907	34.26				
KM8JM12B66U	7/11/05	25538	34.26				
KM8JN72D05U	6/01/05	12445	52.7	ATT IS FOR SCAN CODE C1237	CUSTOMER STATES CD PLAYER IS INOPERATIVE	INTERNALLY FAILED CD PLAYER, TO BE REPLACED W/ EXCHANGE UNIT.	REPLACED CD PLAYER. TESTED AFTER.. REPAIRS COMPLETED.
KM8JN72D05U	6/01/05	12445	52.7	ATT IS FOR SCAN CODE C1237	CUSTOMER STATES ESP LIGHT IS ON	SCANNED CODE C1237- PRESSURE SENSOR OTHER, C1513 BRAKE LAMP SWITCH, FURTHER DIAGNOSIS NEEDS BRAKE SWITCH INTERNAL FAILURE	REPLACED BRAKE STOP SWITCH, REPAIRS COMPLETED. TESTED CLEARED CODES.
KM8JM12B35U	4/15/05	28839	34.24		PERFORM OPEN CAMPAIGN	CAMPAIGN	CAMPAIGN 079- REPLACE AIRBAG COVER CAMPAIGN 079- REPLACE AIRBAG COVER
KM8JM12B35U	4/15/05	28839	34.24		C/S ESP LIGHT HAS BEEN ON	N69C15	SWITCH - BRAKE LIGHT - REPLACE SWITCH - BRAKE LIGHT
KM8JN12D76U	10/06/05	28618	34.24		PERFORM OPEN CAMPAIGN - SOP	CAMPAIGN	CAMPAIGN 079- REPLACE AIRBAG COVER CAMPAIGN 079- REPLACE AIRBAG COVER CUSTOMER ADVISED - VEHICLE IS DUE FOR SERVICE
KM8JN12D76U	10/06/05	28618	34.24		C/S ESC LIGHT COMES ON - INTERMITTENT - WHILE DRIVING	N69C15	SWITCH - BRAKE LIGHT - REPLACE SWITCH - BRAKE LIGHT
KM8JM12B36U	1/05/06	3565	32		CUSTOMER STATES VEHICLE HAS NO BRAKE LIGHTS - PLEASE CHECK AND ADVISE	FOUND BRAKE SWITCH OPEN CAUSING LIGHTS NOT TO OPERATE	REPLACED BRAKE LAMP SWITCH AND TESTED - BRAKE LIGHTS ARE WORKING NORMALLY AT THIS TIME
KM8JN72D76U	8/09/05	19053	33.04		CUSTOMER REQUESTS DRIVER AIR BAG COVER CAMPAIGN 079 BE COMPLETED	OPEN CAMPAIGN ON VEHICLE	COMPLETED CAMPAIGN 079 - NEW AIR BAG COVER INSTALLED ON
KM8JN72D76U	8/09/05	19053	33.04		CUSTOMER STATES ESC LIGHT IS ON	FOUND THE BRAKE STOP SWITCH TO BE SHORTING OUT	REPALCED THE BRAKE STOP SWITCH AT THIS TIME CAR IS OPERATINGAS DESIGNED AT THIS TIME
KM8JM72B96U	2/09/06	9554	30.04		CUSTOMER STATES ESC OFF LIGHT KEEPS COMING ON.	PERFORM DIAGNOSTICS TO FIND BRAKE STOP SWITCH SHORTED OUT.	REPLACED SWITCH VEHICLE OPERATING AS DESIGNED
KM8JN12D76U	10/06/05	28618	34.24		C/S CIG LIGHTER STOPPED OPERATING	N94C15	REPLACED CIG LIGHTER CIGAR LIGHTER ASSY AND/OR SOCKET RE
KM8JM12B16U	7/15/05	20309	34.24		C/S ESC LIGHT COMING ON SOP	N69C15	SWITCH - BRAKE LIGHT - REPLACE SWITCH - BRAKE LIGHT
KM8JN12D25U	3/23/05	20022	32.85		C/S ESP COMES ON SOMETIMES AND STAYS ON	N69C15	PRESSURE SENSOR PRESSURE SENSOR
KM8JN72D26U	10/15/05	9776	30.04		CUSTOMER STATES THERE ARE NO BRAKE LIGHTS	FOUND THE BRAKE STOP SWITCH TO BE SHORTING OUT CAUSING BRAKE LIGHTS NOT TO OPERATE	REPLACED THE BRAKE STOP SWITCH AT THIS TIME BRAKE LIGHTS ARE OPERATING AS DESIGNED
KM8JN72D97U	8/28/06	2746	30.04		CUSTOMER STATES THE BRAKE LIGHTS ARE OUT	FOUND THE BRAKE STOP SWITCH TO BE STICKING	REPLACED THE BRAKE STOP SWITCH AT THIS TIME
KM8JN72D26U	10/15/05	10067	30.04				
KM8JN12D25U	3/23/05	20022	32.85		CAMP 079	RECALL	CAMPAIGN 079- REPLACE AIRBAG COVER CAMPAIGN 079- REPLACE AIRBAG COVER
KM8JN12D25U	3/23/05	20022	32.85		C/S ESP COMES ON SOMETIMES	N69C15	SWITCH - BRAKE LIGHT - REPLACE SWITCH - BRAKE LIGHT
KM8JN12D06U	4/07/06	3145	34.24		C/S AFTER VEHICLE SAT FOR A WEEK VEHICLE WOULD NOT START HAD TO JUMPSTART	N01C15	BATTERY BATTERY
KM8JN12D06U	4/07/06	3145	34.24		C/S ABS BRAKES JUMPING AND BUMPING NOISE WHEN APPLYING BRAKES	N94C15	PRESSURE SENSOR PRESSURE SENSOR
KM8JM12B16U	2/08/06	9584	32		CUSTOMER STATES CHECK ENGINE LIGHT ON ESC LIGHT COMES ON INTERMITTENTLY.		TECHNICIAN REPLACED CLOSED CANNISTER VALVE AND BRAKE STOP SWITCH. TEST DROVE AND OK AT THIST IME
KM8JN72D76U	1/09/06	2571	52.7	ATT IS FOR SCAN CODE B1513	CUSTOMER STATES THE VEHICLE WANDERS/PULLS LEFT AT TIMES AND RIGHT AT TIMES	FOUND TIRE PRESSURES NOT SET CORRECTLY	SET TIRE PRESSURES TO CORRECT PSI AND RETEST DROVE
KM8JN72D76U	1/09/06	2571	52.7	ATT IS FOR SCAN CODE B1513	CUSTOMER STATES ESC LIGHT COMES ON AT TIMES	FOUND CODES B1513, BRAKE LAMP SWITCH SHORTED	REPLACED BRAKE LAMP SWITCH AND CLEARED CODES
KM8JN12D06U	4/07/06	3145	34.24		FREE MULTI-POINT VEHICLE INSPECTION	CAMP	CAMPAIGN 079- REPLACE AIRBAG COVER CAMPAIGN 079- REPLACE AIRBAG COVER
KM8JN12D06U	4/07/06	3145	34.24		C/S ABS BRAKES JUMPING AND BUMPING NOISE WHEN APPLYING BRAKES	N94C15	SWITCH - BRAKE LIGHT - REPLACE SWITCH - BRAKE LIGHT - REPLACE

KM8JN12D06U	4/07/06	3145	34.24		FREE MULTI-POINT VEHICLE INSPECTION	CAMP	FREE MULTI-POINT VEHICLE INSPECTION FREE MULTI-POINT VEHICLE INSPECTION
KM8JN72D76U	1/09/06	2571	52.7	ATT IS FOR SCAN CODE B1513	CUSTOMER STATES THERE IS A FLUID LEAK PRESENT FROM FRONT OF VEHICLE		COULD NOT VERIFY OR DUPLICATE CONCERN AT THIS TIME
KM8JN72D76U	1/09/06	2571	52.7	ATT IS FOR SCAN CODE B1513	CUSTOMER STATES DOOR LOCKS ARE INOP AT TIMES WITH KEY FOB'S		COULD NOT VERIFY OR DUPLICATE CONCERN AT THIS TIME
KM8JN72D76U	1/09/06	2571	52.7	ATT IS FOR SCAN CODE B1513	CUSTOMER STATES THE KEY CYLINDER DOES NOT LIGHT UP AT TIMES		COULD NOT DUPLICATE OR VERIFY CONCERN AT THIS TIME
KM8JM72B16U	11/05/05	25296	34.56		C/S ESC LIGHT NOT WORKING PROPERLY	N94C15	SWITCH - BRAKE LIGHT - REPLACE SWITCH - BRAKE LIGHT
KM8JN72D76U	9/30/05	37928	34.56		C/S ESC LIGHT GOES OFF WHILE DRIVING - HAS TO SHUT AND RESTART FOR IT TO COME BACK ON	N69C15	SWITCH - BRAKE LIGHT - REPLACE SWITCH - BRAKE LIGHT - REPLACE
KM8JN72DX6U	11/26/05	5429	38.3		CUSTOMER STATES TRACTION CONTROL LIGHT COMES ON SOP	VERIFIED CONCERN	REPLACED FAULTY STOP LIGHT SWITCH DTC CODE C1237 & C1513
KM8JN12D45U	7/01/05	16698	32		CUSTOMER STATES ESP OFF LIGHT ON INTERMITTENT	FOUND SHORT IN BRAKE LAMP SWITCH	REPLACED SWITCH AND OK AT THIS TIME
KM8JM12B37U	11/09/06	508	33.04		CUSTOMER STATES THE BRAKE LIGHTS ARE STAYING ON. NOT ON AT THIS TIME	FOUND THE BRAKE STOP SWITCH TO BE SHORTING OUT	REPLACED THE BRAKE STOP SWITCH AND RECHECKED. OPERATING AS DESIGNED AT THIS TIME
KM8JM12B76U	7/16/05	14374	33.36	CUSTOMER STATES ESC LIGHT ONSCANNED FOR CODES C1513 BRAKE SWITCH SHORTEDREPLACED BRAKE SWITCH	CUSTOMER REQUESTS DRIVER AIR BAG COVER CAMPAIGN 079 BE COMPLETED	OPEN CAMPAIGN ON VEHICLE	UNABLE TO COMPLETE CAMPAIGN, HAD TO SPECIAL ORDER PART.
KM8JN72D06U	10/10/05	14140	38.3	RECEIVED CODE C1513	CUSTOMER STATES ESC LIGHT ON	TECH VERIFIED CUSTOMERS CONCERN, FOUND DTC C1513 FAILED BRAKE LAMP SWITCH	R & R BRAKE LAMP SWITCH, CLEAR CODE AND TEST SYSTEMS OK
KM8JN12D96U	1/05/06	16316	36.66		CUSTOMER STATES - DASH E.S.C. LIGHT IS ON. INSPECT & ADVISE.	TECH VERIFIED DASH E.S.C. LIGHT IS ON. SET VEHICLE ON DIAGNOSTIC SCANNER, FOUND CODE #C1513 - BRAKE LAMP SWITCH. PERFORMED INSPECTION, FOUND INTERNAL OPEN CIRCUIT IN BRAKE LAMP SWITCH. PART NOT REPAIRABLE.	REMOVED AND REPLACE BRAKE LAMP SWITCH. CLEARED CODES. SWITCH TESTED OKAY. CODE DID NOT RETURN.
KM8JN72D95U	7/02/05	23547	36.66		CUSTOMER STATES - DASH E.S.C. LIGHT IS ON. INSPECT & ADVISE.	TECH VERIFIED DASH E.S.C. LIGHT IS ON. SET VEHICLE ON DIAGNOSTIC SCANNER, FOUND CODES C1616, C1611, C1513 BRAKE LAMP SWITCH MALFUNCTION. PERFORMED INSPECTIONS, FOUND INTERNAL OPEN IN THE BRAKE SWITCH. DAMAGE IS NON SERVICABLE.	REMOVED AND REPLACED BRAKE SWITCH. CLEARED CODES. BRAKE SWITCH TESTED OKAY. CODES DID NOT RETURN.
KM8JM12B76U	7/16/05	14374	33.36	CUSTOMER STATES ESC LIGHT ONSCANNED FOR CODES C1513 BRAKE SWITCH SHORTEDREPLACED BRAKE SWITCH	CUSTOMER STATES ESC LIGHT IS ON	SCANNED FOR CODES C1513. BRAKE SWITCH SHORTED	REPLACED BRAKE SWITCH.
KM8JN72D55U	5/31/05	31766	33.36		CUSTOMER REQUESTS DRIVER AIR BAG COVER CAMPAIGN 079 BE COMPLETED	OPEN CAMPAIGN ON VEHICLE	COMPLETED CAMPAIGN 079 - NEW AIR BAG COVER INSTALLED ON
KM8JN72D55U	5/31/05	31766	33.36		CUSTOMER STATES WHEN VEHICLE IS OFF AND KEYS ARE NOT IN IGNITION MARKER LIGHTS AND PEANUT BULBS STAY ON	SCANNED FOR CODES, NO ACTIVE CODES. PIN POINT TESTED TO MULTI FUNCTION SWITCH.	REPLACED MULTIFUNCTION SWITCH.
KM8JM12B15U	12/06/04	33311	34.95		CUSTOMER STATES BRAKE LAMPS DO NOT GO OUT PEDAL MUST BE PRESSED MANY TIMES TO TURN THEM OFF CHECK AND ADVISE	TECH VERIFIED CUSTOMERS CONCERN, FOUND INTERNALLY FAILED BRAKE LAMP SWITCH, OPEN SHORT.	REMOVED AND REPLACED FAILED BRAKE LAMP SWITCH AND TESTED SYSTEMS, OK.
KM8JM12B15U	12/06/04	33311	34.95		CUSTOMER STATED PASSENGER HEADLAMP IS OUT CHECK AND ADVISE	TECH VERIFIED CUSTOMERS CONCERN, FOUND FAILED HEADLAMP BULB ELEMENT, OPEN SHORT.	TECH REMOVED AND REPLACED PASSENGER HEADLAMP BULB AND TESTED SYSTEMS, OK
KM8JN72D55U	5/31/05	31766	33.36		ESC LIGHT IS ON.	SCANNED FOR CODES, C1513. PINPOINT TO BRAKE LIGHT SWITCH.	REPLACED BRAKE LIGHT SWITCH.
KM8JN72D16U	3/14/06	21079	33.36	REPLACED BRAKE LIGHT SWITCH .3 STEERING ANGLE SENSOR ON ORD ER	CUSTOMER REQUESTS DRIVER AIR BAG COVER CAMPAIGN 079 BE COMPLETED	OPEN CAMPAIGN ON VEHICLE	COMPLETED CAMPAIGN 079 - NEW AIR BAG COVER INSTALLED ON
KM8JN72D16U	3/14/06	21079	33.36	REPLACED BRAKE LIGHT SWITCH .3 STEERING ANGLE SENSOR ON ORD ER	CUSTOMER STATES 4 WHEEL DRIVE LIGHT IS BLINKING AND ESC LIGHT IS ON.	FAULTY BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH .3 STEERING ANGLE SENSOR ON ORD ER
KM8JN72D37U	2/01/07	53	36.66		CUSTOMER STATES - DASH E.S.C. LIGHT IS ON. INSPECT & ADVISE.	TECH VERIFIED DASH E.S.C. LIGHT IS ON. SET VEHICLE ON DIAGNOSTIC SCANNER, FOUND CODE C1513 BRAKE SWITCH ERROR. PERFORMED INSPECTION, FOUND BRAKE SWITCH HAS AN INTERNAL OPEN CIRCUIT.	REMOVED AND REPLACED BRAKE SWITCH. CLEARED CODES. SWITCH TESTED OKAY. CODE DID NOT RETURN.
KM8JN72D45U	6/14/05	28432	36.66				
KM8JN72DX6U	7/27/05	15329	65.3		VEHICLE TOWED IN 8/29, NIGHT DROP C/S VEHICLE STALLING, CHECK AND ADVISE	REPLACE ECM AS DIRECTED BY HMA (T.B.)	
KM8JN72D26U	7/26/05	8132	29.46	REPLACED BRAKE SWITCH +	CUSTOMER STATES THE ESC LIGHT GOES ON AND OFF - NOT VERIFIED	FOUND BRAKE SWITCH FAULTY CAUSING LIGHT TO COME ON	REPLACED BRAKE SWITCH +
KM8JN72D26U	7/26/05	8132	29.46	REPLACED BRAKE SWITCH +	CUSTOMER STATES THE BELTS ARE SQUEELING? - NOT VERIFIED	FOUND DRIVE BELT GLAZED	REPLACED DRIVE BELT
KM8JM12B45U	6/03/05	31702	29.14		CUST STATES HTAT AT TIMES WHILE DRIVING THE ESP LIGHT WILL GO ON AND OFF. DID NOT DUPLICATE ON TEST DRIVE.	ALL 4 TIRES WORN OUT CONTRIBUTING TO ESP LIGHT COMING ON	CODE C1513. CODE WAS FOR BRAKE SWITCH THAT WAS PRESENT. REPLACED BRAKE SWITCH AND CODE DID NOT RETURN.

KM8JN72DX6U	7/27/05	15329	65.3		C/S ESC LIGHT GOES ON, WILL NOT GO OFF. CHECK AND ADVISE.	VERIFIED CUSTOMERS CONCERN, FOUND DTC 1513. FOUND FAULTY BRAKE LIGHT SWITCH.	R&R BRAKE LIGHT SWITCH, RESET CODE, OK.
KM8JN72DX6U	10/12/05	12338	38.3		CUSTOMER STATES ESC LIGHT CAME ON ONCE WHILE MAKING TURNS	TECH VERIFIED CUSTOMERS CONCERN, FOUND DTC 1235 FAILED BRAKE LAMP SWITCH SET ON DIAGNOSTIC	R & R BRAKE LAMP SWITCH, CLEAR CODE AND TEST DRIVE OK
KM8JM12B76U	5/08/06	16885	36.34		CUSTOMER STATES - DASH ESC LIGHT COMES ON AND OFF AT TIMES. CYCLES OFF WITH KEY.	SCANNER, CODE #C1513-BRAKE SWITCH CIRCUIT. PERFORMED INSPECTIONS, FOUND INTERNAL BRAKE SWITCH PROBLEM.	REMOVED AND REPLACED BRAKE SWITCH ASSY. SYSTEM TESTED OKAY.
KM8JN72D55U	4/26/05	22388	29.14		CUSTOMER STATES THE ESC LIGHT COMES ON AND GOES OFF NOT DUPLICATED	SCANNED SYSTEM CODE C1513 BRAKE LAMP SWITCH - INTERM FAILURE IN SWITCH	REPLACED SWITCH
KM8JM72B35U	6/21/05	17724	29.9		CUST STATES THAT ESP LIGHT IS ON AND WILL NOT GO OFF. DIAGNOSED ON LAST VISIT. INSTALL SPECIAL ORDER BRAKE SWITCH.	PREV DIAG - BRAKE SWITCH REG. CORRECTLY	REPLACED BRAKE LAMP SWITCH
KM8JM12B66U	7/20/05	50320	29.46	REPLACED BRAKE SWITCH	CUSTOMER STATES ESC LIGHT COMES ON WHEN TURNING QUICK. CYCLEIGNITION, AND LIGHT GOES AWAY	SCANNED SYSTEM CODE B1513 FOUND BRAKE SWITCH INOP INTERNAL FAILURE	REPLACED BRAKE SWITCH
KM8JN12D75U	7/02/05	29520	36.66		CUSTOMER STATES THE ELECTRONIC STABILITY CONTROL LIGHT WAS ON.	TECH VERIFIED DASH LIGHT IS ON. SET VEHICLE ON DIAGNOSTIC SCANNER, CODE #C1611, C1612, C1513-CAN'T COMMUNICATE ECM. PERFORMED INSPECTIONS, FOUND BRAKE SWITCH HAS A OPEN CIRCUIT.	REMOVED AND REPLACED DASH BRAKE PEDAL SWITCH. SYSTEM TESTED OKAY, NO CODES RETURNED.
KM8JN72DX6U	7/27/05	30132	36.34		C/S TPS LIGHT GOES ON AND OFF INTERMITTENTLY CHECK AND ADVISE	TECH VERIFIED CUSTOMERS CONCERN, FOUND DTC 1513 FAILED BRAKE LIGHT SWITCH	R & R BRAKE LIGHT SWITCH AND CLEARED CODE, TEST DROVE VEHICLE, OK
KM8JN72DX6U	7/27/05	30132	36.34		OPEN 079 CAMPAIGN	VERIFIED OPEN CAMPAIGN	PERFORMED 079 CAMPAIGN
KM8JN72D76U	10/13/05	13135	29.46		CUST REQUESTS INSTALLATION ON BRAKE SWITCH. ORDER ON LAST VISIT.	PREV DIAG - CODE C1513 BRAKE LAMP SWITCH - INTERM PROBLEM	REPLACED BRAKE LAMP SWITCH
KM8JN72D76U	1/09/06	10540	29.14				
KM8JN72D56U	10/01/05	15915	29.46		CUSTOMER STATES THAT THE ESC LIGHT IS ON AND OFF SOP SWITCH	FOUND LAMP SWITCH SHORTED REMOVED AND REPLACED BRAKE LAMP SWITCH	RECHECKED OK
KM8JN72DX6U	11/14/05	22437	36.66	REPLACED BRAKE SWITCH.	CUSTOMER STATES - DASH E.S.C.LIGHT IS ON. INSPECT & ADVISE. NOT ON AT THIS TIME.	TECH VERIFIED DASH E.S.C.LIGHT IS ON. SET VEHICLE ON DIAGNOSTIC SCANNER, FOUND CODES #C1237 - PRESSURE SENSOR OTHER, AND C1513 - BRAKE LAMP SWITCH. PERFORMED INSPECTION FOUND BRAKE LAMP SWITCH STICKING. RECOMMEND REPLACE, PART IS NOT REPAIRABLE.	REMOVED AND REPLACED THE BRAKE LAMP SWITCH. CLEARED CODES SWITCH TESTED OKAY.
KM8JN72D76U	8/18/05	8845	36.36		REVERSE LIGHT D/S IS OUT	DIAG FOUND BURNT BULB ELEMENT	REPLACED BULB TESTED COMPLETED
KM8JN72D76U	8/18/05	8845	36.36		CUSTOMER STATES ESC LIGHT IS ON	DIAG SCAN CHECK ENGINE LIGHT ON FOUND OPEN SHORT IN BRAKE SWITCH	REPLACED BRAKE SWITCH CLEARED CODES TESTED COMPLETED
KM8JN72DX5U	4/26/05	27531	27.06	CODE C1513	CUSTOMER STATES : NOISE IN STEERING WHEN TURNING	SUBFRAME	ROAD TEST DIAGNOSE AND REPLACE SUBFRAME ASSEMBLY ALIGN FRONT END ROAD TEST AFTER REPAIR OK
KM8JN72DX5U	4/26/05	27531	27.06	CODE C1513	CUSTOMER STATES : VEHICLE CUT OUT PULLING INTO A PARKING SPACE HAS DONE 3 TIMES BEFORE == SEE ATTACHED CUSTOMER DIScription LETTER ==	BRAKE LAMP SWITCH	ROAD TEST RUN COMPUTER TEST C1513 CODE STORED REPLACE BRAKE LAMP SWITCH CLEAR CODE AND RE-ROAD TEST OK
KM8JM12B86U	9/13/05	15063	28.7		STABILITY LIGHT IS ON	THE RIGHT FRONT WHEEL SPEED SENSOR WILL NEED TO BE REPLACED	REPLACED THE RIGHT FRONT WHEEL SPEED SENSOR
KM8JN72D36U	10/08/05	48350	36.36		CUSTOMER STATES ESC LIGHT IS ON	SCANNED FOR FAULTS C1513 STORED IN SYSTEM, TESTED AND FOUND BRAKE LIGHT SWITCH IS INTERNALLY SHORTED.	REPLACED BRAKE LIGHT SWITCH, CLEARED CODES AND TESTED SYSTEM/VEHICLE IS NOW OPERATING AS DESIGNED.
KM8JN72D36U	10/08/05	48350	36.36		CUSTOMER STATES THE TPMS LIGHT IS ON	SCANNED FOR FAULTS C1313, C1315 STORED IN SYSTEM, FOUND SENSORS LOST PROGRAMMING.	WE REPROGRAMMED SENSORS, CLEARED CODES AND TESTED SYSTEM. VEHICLE NOW OPERATING AS DESIGNED. CAUSAL PART#529331FA00
KM8JN72D75U	4/20/05	14655	63.06	ESP-WARNING LITE ON-PERFORM SYSTEM TEST-MALFUNCTION CODE C1513PRESENT-BRAKE SWITCH MALFUNCTION PRESENT-REPLACE BRAKE SWITCH,CLEAR CODE AND RE-TEST- MALFUNCTION NOT RETURNING,ALL OPERATING NORMAL-.3 TT TIME USED FOR SCAN TOOL ALLOWANCE			
KM8JM12B86U	9/13/05	15063	28.7		CHECK ALL LIGHT OPERATION	WILL NEED BRAKE LAMP SWITCH REPLACED	REPLACED THE BRAKE LAMP SWITCH
KM8JM12B76U	7/22/05	31950	27.06	C1237	CHECK RUBBING NOISE WITH TURNING///AT SLOWER SPEEDS	FOUND ENGINE CRADLE BOLTS A LITTLE LOOSE. BUSHINGS WERE MAKING NOISE.	TIGHTENED ENGINE CRADLE BOLTS.
KM8JM12B76U	7/22/05	31950	27.06	C1237	CUSTOMER STATES-ESC LIGHT GOES ON AND OFF	FOUND CODES-C1237-PRESSURE SWITCH FAULTY. C1513-BRAKE LAMP SWITCH FAULTY	REPLACED BRAKE LIGHT SWITCH AND CLEARED CODES. RCHECKED/ALL OK
KM8JM12B76U	7/22/05	31950	27.06	C1237	HYUNDAI CAMPAIGN THAT IS OPEN	#079	PERFORMED CAMPAIGN AS STATED IN MANUFACTURED INSTRUCTIONS
KM8JN72D86U	10/15/05	14685	36.04		CUSTOMER STATES ECS LIGHT COMES ON AND STAYS ON TILL CAR IS TURNED OFF	TESTED AND FOUND NO B+ AT PIN#21 ON HESC CONTROL MODULE CONNECTOR E37. FOUND BRAKE LIGHT SWITCH INTERNALLY SHORTED.	REPLACED BRAKE LIGHT SWITCH. ROAD TESTED VEHICLE AND NOW OPERATING AS DESIGNED.

KM8JN72D16U	9/30/05	30474	36.36	REPLACED BRAKE LIGHT SWITCH TESTED COMPLETED	CUSTOMER STATES FRONT PASSENGER REGULAR LIGHT BLUB IS OUT PLEASE CHANGE	DIAG FOUND BURNT BULB FOG LIGHT RIGHTH SIDE	REPLACED BULB COMPLETED TESTED
KM8JN72D16U	9/30/05	30474	36.36	REPLACED BRAKE LIGHT SWITCH TESTED COMPLETED	CUSTOMER STATES ESC LIGHT IS ON	DIAG SCANNED CODES CODE C1513 FOUND BRAKE SWITCH OPEN SHORT INTERNAL FAILURE	REPLACED BRAKE LIGHT SWITCH TESTED COMPLETED
KM8JN72D06U	7/22/05	19393	59.74	C STATES ESC LIGHT WAS ON. TECH SCANNED CODE C1513. REPLACED BRAKE LAMP SWITCH. TT IS FOR SCAN TOOL	CUSTOMER STATES ESC LIGHT OFF LIGHT WAS ON AND COULDNT TURN IT OFF WITH BUTTON	TECH SCANNED AND FOUND CODE C1513 BRAKE LAMP SWITCH TECH FOUND INTERNAL FAILURE FOR BRAKE LAMP	TECH REMOVED AND REPLACED BRAKE LAMP SWITCH
KM8JN72DX6U	8/09/05	18009	34.86		CUSTOMER STATES ECS LIGHT COMES ON AT TIMES AND THE ESC OFF LIGHT WILL COME ON BY ITS SELF AS WELL	SCANNED CODE C1513 INTERNAL SHORT	REPLACED BRAKE LIGHT SWITCH
KM8JM72B06U	12/03/05	34045	35.46	REPLACED BRAKE SWITCH	CUSTOMER SATTES AIR BAG LIGHT STAYS ON	DEFECTIVE BUCKLE	REPLACED PASSANGER SEATBELT BUCKLE
KM8JN72D16U	9/30/05	30474	36.36	REPLACED BRAKE LIGHT SWITCH TESTED COMPLETED	CUSTOMER STATES THAT THE CHECK ENGINE LIGHT CAME ON AND GOESOFF OFTEN	DIAG SCANNED CODE P0455 FOUND PURGE VALVE STICKING INTERNAL FAILURE	REPLACED PURGE VALVE CLEARED CODES TESTED COMPLETED
KM8JN72D25U	5/25/05	45798	36.36				
KM8JN72DX6U	7/30/05	15580	38		CUSTOMER STATES ECS LIGHT IS ON (INSTALL SPECIAL ORDER PART)	TESTED AND FOUND BRAKE LIGHT SWITCH INTERNALLY SHORTED.	REPLACED BRAKE LIGHT SWITCH. VEHICLE NOW OPERATING AS DESIGNED.
KM8JM72B06U	12/03/05	34045	35.46	REPLACED BRAKE SWITCH	CUSTOMER STATES ESC LIGHT COMES ON	DEFECTIVE BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JM12B15U	5/20/05	24900	33.34				
KM8JM12B26U	7/11/05	31167	33.34				
KM8JN72DX6U	7/30/05	18464	91.4	TECH FOUND CODE 3C1513. BRAKE SWITCH OUTPUT W/GDS.NO FAULTS FOUND AT THIS TIME.CALLED TECH LINE CASE #238258.SPOKE WITH CARL.HE RECOMMENDED WE REPLACE THE BRAKE SWITCH ADJUST AND RELEASE.	CUSTOMER STATES THE ESC LIGHT OFF LIGHT IS ALWAYS ON EVEN WHEN SHE TRYES TO TURN IT ON.PLEASE CHECK AND ADVISE.	TECH FOUND CODE 3C1513. BRAKE SWITCH OUTPUT W/GDS.NO FAULTS FOUND AT THIS TIME.CALLED TECH LINE CASE #238258.SPOKE WITH CARL.HE RECOMMENDED WE REPLACE THE BRAKE SWITCH ADJUST AND RELEASE.	REPLACED BRAKE SWITCH.TESTED.CAR NOW OPERATES AS DESIGNED.
KM8JN72D45U	5/26/05	28069	36.36		CUSTOMER STATES ESC LIGHT IS ON HAS TO TURN VEHICLE OFF TO MAKE LIGHT GO OUT	HOOKED UP SCAN TOOL AND FOUND CODES C1513 AND C1237. FURTHER LOOKED INTO CODES AND FOUND FAULTY BRAKE SWITCH.	REMOVED AND REPLACED BRAKE SWITCH DUE TO OPEN IN SYSTEM. CLEARED CODES.CONDITION CORRECTED.
KM8JN72D96U	8/18/05	34907	35.46		CUSTOMER STATES ESP LIGHT CAME ON	DEFECTIVE BRAKE PEADAL SWITCH	REPLACED BRAKE PEDAL SWITCH
KM8JN72D36U	8/17/05	29293	33.66				
KM8JN12D96U	3/06/06	9075	33.34				
KM8JN72DX6U	4/28/06	8662	33.34				
KM8JN72D65U	5/31/05	27452	36.36		CUSTOMER STATES ESC LIGHT IS ON	SCANNED FOR FAULTS C1513 STORED IN SYSTEM, TESTED AND FOUND BRAKE LIGHT SWITCH INTERNALLY SHORTED.	REPLCED BRAKE LIGHT SWITCH, CLEARED CODES AND TESTED SYSTEM.VEHICLE NOW OPERATING AS DESIGNED.
KM8JN72D66U	7/23/05	35920	36.36		CUSTOMER STATES ESC LIGHT IS ON REQUEST WE CHECK 4- WHEEL DRIVE SERVICE FOR PROPER OPERATION	HOOKED UP SCAN TOOL AND FOUND CODE C1513 FOR BRAKE LIGHT SWITCH.	REMOVED AND REPLACED BRAKE LAMP SWITCH DUE TO CHECK ENGINE LIGHT AND INTERNAL FAILURE OF SWITCH.CLEARED CODES.
KM8JM12B96U	9/13/05	25317	32.16				
KM8JM12B36U	7/16/05	27825	33.34				
KM8JN72D16U	7/25/05	20539	32.74	ESC LITE ON. CODE 1513.INTERNAL SHORT IN BRAKE LAMP SWITCH.R/R SWITCH.	CUSTOMER STATES CHECK ENGINE LIGHT ON	CODE P0130	TESTED AND FOUND CODE P0130 FOUND 0/2 SENSOR MULTIFUNCTION AT B1/S1 REPLACED SENSOR AND TESTED OK
KM8JN72D16U	7/25/05	20539	32.74	ESC LITE ON. CODE 1513.INTERNAL SHORT IN BRAKE LAMP SWITCH.R/R SWITCH.	CUSTOMER STATES ESC LIGHT IS ON	CODE 1513	TESTED AND FOUND INTERNAL SHORT IN BRAKE LAMP SWITCH REPLACEBRAKE LAMP SWITCH AND CLEARED CODE AND TESTED OK
KM8JN72DX6U	12/12/05	9671	32.16				
KM8JN72D16U	10/13/05	31173	31.84		CUSTOMER STATES: CHECK ENGINE LIGHT IS LIT FOUND CODE PO 130 02 SENSOR CIRCUIT B1/S1	CHECKED 02 SENSORS FOUND 12VOLT/5VOLT GRAPHED CIRCUIT R/R 02 SEBSOR AND REPLACED	CLEARED CODE RETESTED ALL OK ALSO SECOND CODE ESC/C 1513 BRAKE SWITCH CIRCUIT CHECKED POWER 12 VOLTS AND GROUND OK.CHECKED RESISTANCE TO BRAKE SWITCH FOUN 2.34VOLTS IN THE POWER CIRCUIT OF THE SWITCH R/R AND REPLACED.
KM8JN72D16U	10/13/05	31173	31.84		CUSTOMER STATES AIR BAG LIGHT ON FOUND CODE B1701 BUCKLE RESISTANCE HIGH	R/R SWITCH INSTALLED DUMMY SWITCH AND CHECKED RESISTANCE .8 OHMS NEEDS TO BE AT 0.0TO 0.2OHMS	REPLACED BUCKLE CLEARED CODES ALL OK
KM8JM12B66U	7/11/05	10535	33.06	ESC LIGHT TURNS ON AND OFF.POOR CONTACT IN BRAKE LAMP SWITCH.R/R BRAKE LAMP SWITCH.	CUSTOMER STATES ESC LIGHT TURNS ON AND OFF	CODE B1513 STORED DUE TO POOR CONTACT	CORRECTION: REPLACED BRAKE LAMP SWITCH
KM8JN72D96U	12/10/05	13725	32.74	ESC LIGHT IS READING OFF.OPEN IN BRAKE SWITCH CIRCUIT. C1513.R/R STOP SWITCH ASSEMBLY.	CUSTOMER STATES ESC LIGHT IS READING OFF REPORTS ON SOMETIMES SINCE RADIO REPLACEMENT	SCAN TESTED AND FOUND CODE C1513 - BRAKE SWITCH CIRCUIT	REPLACED BRAKE LAMP SWITCH AS REQUIRED.
KM8JM12B85U	5/19/05	45233	33.06	ESC LITE ON.INTERNAL OPEN IN BRAKE LIGHT SWITCH.R/R SWITCH.	ESC LIGHT ON	CAUSE: INTERNAL SHORT/OPEN	CORRECTION: DIAGNOSED - REPLACED BRAKE LIGHT SWITCH
KM8JN72D86U	7/19/05	27089	36.21		CUSTOMER STATES:CHECK FOR OPEN CAMPAIGN 079 DRIVER AIR BAG COVER MODULE REPLACEMENT	CAMPAIGN OPEN	REPLACE DRIVER AIR BAG COVER MODULE AS PER TSB #07-01-001 61B046R0 2
KM8JN72D86U	7/19/05	27089	36.21		CUSTOEMR STATES: ESC LIGHT IS ON PLEASE CK	SCAN TOOL 1513 FOUND BRAKE LAMP SWITCH SHORTED	REPLACED BRAKE LAMP SWITCH AND RETESTED OK
KM8JN72D26U	10/04/05	29695	31.84		CUSTOMER REQUEST CHECK TRANS	FOUND TRANS WILL NOT SHIFT. TEST DROVE IN FAIL SAFE MODE. SCAN FOUND CODES PO 733 PO737.FLUID BLACK. REPLACED PER TSB 03-40-005	INTERNAL FAILURE OF TRANS REPLACED TRANS ROAD TESTED ALL OK. ROAD TESTED 95 MILES
KM8JM12B85U	5/19/05	45233	33.06	ESC LITE ON.INTERNAL OPEN IN BRAKE LIGHT SWITCH.R/R SWITCH.	079 AIR BAG MODULE CAMPAIGN	CAUSE: CAMPAIGN	CORRECTION: REPLACED AIR BAG MODULE THROUGH CAMPAIGN

KM8JM12B85U	5/19/05	45233	33.06	ESC LITE ON.INTERNAL OPEN IN BRAKE LIGHT SWITCH.R/R SWITCH.	CUSTOMER STATES SPEEDOMETER INOPERATIVE - HAS SCANNED - CODES P1205 AND C1513	CAUSE: POOR CONTACT CAUSAL P/N 91202-2E861	CORRECTION: REPAIRED POOR GROUND
KM8JM12B85U	5/19/05	45233	33.06	ESC LITE ON.INTERNAL OPEN IN BRAKE LIGHT SWITCH.R/R SWITCH.	HEADLIGHT BULB OUT	CAUSE: OPEN	CORRECTION: REPLACED HEADLIGHT BULB
KM8JN72D26U	10/04/05	29695	31.84		CUSTOMER STATES TRANSFER CASE LEAKING FOUND LEAKING	CASE SEAL LEAKING NO REPAIR AVAILABLE REPLACED TRANSFER CASE	CHECKED FOR LEAKS OK
KM8JN72D26U	10/04/05	29695	31.84		CUSTOMER STATES BRAKE LIGHT SWITCH INOP FOUND BRAKE LIGHT SHORTED.	REPLACED SWITCH RETESTED ALL OK	
KM8JN12DX6U	9/26/05	27654	32.16				
KM8JM12B85U	5/19/05	45233	33.06	ESC LITE ON.INTERNAL OPEN IN BRAKE LIGHT SWITCH.R/R SWITCH.	CUSTOMER STATES FRONT WIPERS INOPERATIVE	CAUSE: POOR CONNECTION CAUSAL P/N 91700-2E070	CORRECTION: DIAGNOSED - FUSE GOOD - RELAY GOOD - CHECKED POWER AT SWITCH - CHECKED GROUND FROM PIN 14 M20-2 TO G02- FOUND PINCHED WIRE IN HARNESS - PARTIALLY BROKEN - REPAIRED WIRE TO GROUND
KM8JN72D26U	7/16/05	43608	33.06	ESC LIGHT OFF AND ON.INTERNAL OPEN IN BRAKE LAMP SWITCH.R/R SWITCH.	CUSTOMER STATES ACCELERATION IS NOT SMOOTH - CHECK ENGINE LIGHT HAS COME ON - ESC LIGHT OFF AND ON	CAUSE: INTERNAL SHORT/OPEN	CORRECTION: DIAGNOSED CODE C1513 - REPLACED BRAKE LAMP SWITCH - CLEARED CODE
KM8JN72D26U	7/16/05	43608	33.06	ESC LIGHT OFF AND ON.INTERNAL OPEN IN BRAKE LAMP SWITCH.R/R SWITCH.	079 AIR BAG MODULE CAMPAIGN	CAUSE: CAMPAIGN	CORRECTION: REPLACED AIR BAG MODULE
KM8JN72D76U	10/06/05	17945	36.21		CUSTOMER STATES: MAKING A NOISE IN THE SUBFRAME GROANING NOIWHEN TURNING OR GOING OVER BUMPS	VERIFIED CONCERN FOUND SUB FRAME BUSHINGS DRY	LUBED SUB FRAME BUSHINGS AND RETESTED OK
KM8JN72D76U	10/06/05	17945	36.21		CUSTOMER STATES: ESC LIGHT IS COMING ON PLEASE CK	SCAN TOOL C1513 FOUND BRAKE LAMP SWITCH SHORTED	REPLACED BRAKE LAMP SWITCH AND RETESTED OK
KM8JN72D46U	11/27/05	30185	32.16				
KM8JN12D95U	6/17/05	17459	32.16	REPLACED BRAKE LAMP SWITCH AND RETESTED OK			
KM8JN72D56U	11/03/05	14205	32.74	ESC LITE ONOPEN SHORT IN BRAKE LAMP SWITCHR/R SWITCH ASSY.	CUSTOMER STATES THERE GETTING A HIGH PITCH BELT NOISE FROM ENGINE AREA	NO TENSION	FOUND TENSIONER NOT HOLDING TENSION AND CAUSING ABNORMAL WEAR TO BELT R/R TENSIONER AND BELT
KM8JN72D56U	11/03/05	14205	32.74	ESC LITE ONOPEN SHORT IN BRAKE LAMP SWITCHR/R SWITCH ASSY.	C/S ESC LIGHT IS ON	CODE C1513	TESTED AND FOUND OPEN SHORT IN BRAKE LAMP SWITCH R/R BRAKE LAMP SWITCH AND CLEARED CODE AND TESTED OK
KM8JM12B25U	5/03/05	13207	33.8		CUSTOMER STATES:CLOCK INOP AT TIMES INSTALL SOP CLOCK INOP FOUND INTERNAL SHORT REPLACED CLOCK	RESET TIME RETEST OK	
KM8JM12B25U	5/03/05	13207	33.8		CUSTOMER STATES:ESP LIGHT IS ON INSTALL SOP ESP LIGHT GOING ON AND OFF	FOUND INTAL FAULT IN ESP SWITCH REPLACED FOUND INTENAL FAULT IN STOP LAMP SWITCH REPLACED	RETESTED OK
KM8JN72D25U	6/02/05	28660	36.21		CUSTOMER STATES: CHECK ENGINE LIGHT IS LIT	31430	CHECKED FOR CONCERN FOUND COSE P0455 PRESSURE TESTED NO LEAKS
KM8JN72D66U	8/09/05	12017	107.5	TECH FOUND CODES C1237 & C1513, CHECKED FOR CORRECT VOLTAGE AT HECU & BRAKE PRESSURE SENSOR - INCORRECT VOLTAGE - REPALCED SWITCH	C-S ECS LIGHT ON TECH SCANNED C1237 PRESURE SENSOR AND C1513 BRAKE LAMP S	SWITCH.TECH CALLED TECH LINE CASE NUMBER 246875 WAS TOLD TO CHECK FOR PROPPER VOLTAGE AT BRAKE PRESURE SENSOR AND HECU	AND LAMP SWITCH.CHECK VOLTAGE AT C65 PIN 1,BRAKE APPLIED .499 VOLTS.HARSH APPLICATION OF BRAKE 3.63 VOLTS 5.040 AT C65 PIN 2/.28 VOLTS GRAY PIN 1/3.2 VOLTS HARSH DEPRESSION 5.0VOLTS RED PIN 2. TECH CALLED TECH LINE WITH FINDING OF VOLTAGE READINGS WAS TO
KM8JN72DX7U	11/09/06	1095	32.74	ESC LITE ONBRAKE LAMP SWITCH SHORTEDR/R SWITCH	CUSTOMER STATES ESC LIGHT COMES ON AND OFF AT TIMES MOSTLY WHEN HOT OUT	CODE C1513	TESTED SYSTEM FOUND CODE C1513 FOUND BRAKE LAMP SWITCH WITH INTERNAL FAULT R/R SWITCH AND TESTED OK
KM8JN12D16U	11/16/05	17672	32.74		CUSTOMER STATES BLOWER NOISEY - INSTALL SOP	NOISY BLOWER AND FAN ASSEMBLY.	REPLACED BLOWER AND FAN ASSEMBLY AS REQUIRED.
KM8JN12D25U	5/31/05	25688	31.84		CUSTOMER STATES:CHECK FOR OPEN CAMPAIGN 079 DRIVER AIR BAG COVER MODULE REPLACEMENT	CAMPAIGN OPEN	REPLACE DRIVER AIR BAG COVER MODULE AS PER TSB #07-01-001 61B046R0 .2
KM8JN12D25U	5/31/05	25688	31.84		CUSTOMER STATES ESP LIGH TURNS ON DASH WHILE DRIVING	OPEN CIRCUIT BRAKE LAMP SWITCH.CODE-C1513	TECH REPLACED SWITCH AS REQUIRED T
KM8JN72DX5U	6/13/05	16708	33.8		CUSTOMER STATES:ESP OFF LIGHT WILL COME ON AND OFF ON ALL DAY THURS	ESP LIGHT ON SCAN TEST CODE C1237 C1513 FOUND BRAKE LAMP SWITCH SHORTED	REPLACE BRAKE LAMP SWITCH PARTS ON ORDER MASTER CYLINDER PRESSURE SENSOR
KM8JN12D16U	11/16/05	17672	32.74		C/S BRAKE LIGHTS NOT WORKING.	BRAKE LIGHT SWITCH SHORTED.	REPLACED BRAKE LIGHT SWITCH AS REQUIRED.
KM8JN72D96U	9/29/05	19058	34.7		CUSOTMER STATES ECS LIGHT ON - CODE B1513 - INSTALL SOP	CAUSE: INTERNAL SHORT/OPEN	CORRECTION: REPLACED BRAKE LIGHT SWITCH CLEARED CODE
KM8JM12B36U	7/14/05	45658	33.06	EESC OFF, LITE IS ON.OPEN IN BRAKE SWITCH.R/R BRAKE SWITCH.	CUSTOMER STATES ESC OFF LIGHT IS ON	CAUSE: FOUND BRAKE SWITCH BAD	CORRECTION: R&R BRAKE SWITCH
KM8JN72D65U	7/02/05	8870	32.16				
KM8JN72D05U	5/20/05	17045	31.84		CUSTOMER STATES ESC LIGHT GOES ON INTERMITTLY	SCAN FOUND CODE B2553 BACK PEDAL SWITCH	FOUND SWITCH SHORTED REPLACED
KM8JM12B16U	7/13/05	19958	32.16				
KM8JM12B75U	4/29/05	44921	36.21		CUSTOMER STATES:ESP OFF LITE TURN ITSELF OFF/ON BY ITSELF SCANED VEH FOR CODES FOUND C1237 PRIMARY CIRCUIT	INSPECTED PRESSURE SENSOR VOLTAGE DROPS.00 REF OK 12.0VOLTS POWER OK	NEEDS PRESSURE SENSOR ORDERED ALSO CODE CX1513 BRAKE SWITCHRCHCKED 5.0 OK CHECKED GROUND OK OHM TESTED SWITCH FOUND EXCEVISE RESISTANCE REPLACED SWITCH OKI
KM8JN12D06U	9/29/05	23714	33.06	ESC LIGHT GOES ON AND OFF.OPEN CIRCUIT IN LAMP ASSY.R/R LAMP ASSY.	CUSTOMER STATES ESC LIGHT GOES ON AND OFF	CODE C1513 BRAKE LAMP SWITCH OPEN/SHORT - SWITCH HAD AN OPENCIRCUIT	REPLACED BRAKE LAMP SWITCH
KM8JN72D06U	7/30/05	43035	33.06	ESC LIGHT COMING ON.BRAKE SWITCH HAS A SHORT.R/R SWITCH.	CUSTOMER STATES ESC OFF LIGHT KEEPS COMING ON	CAUSE: BRAKE SWITHC SHORT/OPEN	CORRECTION: DIAGNOSED - REPLACED BRAKE SWITCH

KM8JN72D46U	10/06/05	22431	33.06	ESC LIGHT ON.OPEN CIRCUIT IN BRAKE LAMP SWITCH.R/R SWITCH.	CUSTOMER STATES CAR WOULD NOT START AFTER SAT FOR A FEW DAYS	CAUSE: IMPROPER ADJUSTMENT 00201-T5000-FLT	CORRECTION: REPLACED AUDIO UNIT PER BULLETIN 07-90-007
KM8JM12B75U	4/29/05	44921	36.21		CUSTOMER STATES:CHECK FOR OPEN CAMPAIGN 079 DRIVER AIR BAG COVER MODULE REPLACEMENT	CAMPAIGN OPEN	REPLACE DRIVER AIR BAG COVER MODULE AS PER TSB #07-01-001 61B046R0.2
KM8JN72D65U	7/02/05	9538	36.21		CUSTOMER STATES: AIR BAG LIGHT ON INSTALL SOP.	REPLACED SPECIAL ORDER POD ASSY SEAT BOTTOM RIGHT FRONT SEAT	REZERO PODS RETESTED OK
KM8JN72D65U	7/02/05	9538	36.21		CUSTOMER STATES: BRAKE LIGHT HAS COME ON TWICE NOT ON NOW	COULD NOT VERIFY BRAKE LITE CHECKED OVER FOUND BRAKE LIGHTS INTERMITTLY	REPLACED BRAKE LITE SWITCH MECH STUCK RETESTED OK
KM8JN72D46U	10/06/05	22431	33.06	ESC LIGHT ON.OPEN CIRCUIT IN BRAKE LAMP SWITCH.R/R SWITCH.	ESC LIGHT ON	CAUSE: INTERNAL SHORT/OPEN	CORRECTION: DIAGNOSED CODE C1513 - REPLACED BRAKE LAMP SWITCH
KM8JN12D86U	8/08/05	24824	32.74	ESC OFF ILLUMINATED. DOES NOT CHANGE WHEN BUTTON PUSHED.FAILURE IN BRAKE LAMP SWITCH.R/R SWITCH.	CUSTOMER STATES ESC OFF ILLUMINATED - DOES NOT CHANGE WHEN BUTTON PUSHED	CAUSE: CODE 1513 STORED DUDE TO FAULT IN BRAKE LAMP SWITCH	CORRECTION: REPLACED BRAKE LAMP SWITCH AND CLEARED CODE
KM8JN12D45U	5/17/05	37412	28.06		CUSTOMER STATES ESC OFF LIGHT IS ON	SWITCH DEFECTIVE	REPLACE FAULTY BRAKE SWITCH
KM8JN12D85U	6/03/05	25955	32.16				
KM8JN72D76U	9/09/05	20180	36.21		CUSTOMER STATES: CHECK ENGINE LIGHT IS LIT ESC OFF LIGHT ON INTERMITTLY	SCAN TESTED FOUND CODE P0336 CHECK COMPONENTS FOUNF #6 PLUG CRACKED	REPLACED PLUG RETESTED OK
KM8JN72D76U	9/09/05	20180	36.21		CUSTOMER STATES:CHECK FOR OPEN CAMPAIGN 079 DRIVER AIR BAG COVER MODULE REPLACEMENT	CAMPAIGN OPEN	REPLACE DRIVER AIR BAG COVER MODULE AS PER TSB #07-01-001
KM8JN72D36U	12/02/05	16557	37.26		CUSTOMER STATES ESC OFF LIGHT FLICKERS ON AND OFF ALSO BRAKE LIGHT STAYS ON AFTER EBRAKE HANDLE RELEASED	CHECK FOUND FAULTY BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN72D36U	12/02/05	16557	37.26		CENTER CONSOLE IS CRACKED SOP	CHECK FOUND CENTER CONSOLE LID CRACKED	REPLACE CENTER CONSOLE
KM8JN12D76U	9/26/05	19380	37.26		CUSTOMER STATES ESC LIGHT COMES ON WHILE DRIVING.	TECH STATES FOUND BRAKE LIGHT SWITCH STICKING.	REMOVED AND REPLACED BRAKE LIGHT SWITCH.TESTED, OK NOW.
KM8JM12B66U	7/11/05	13186	61.7		CUST STATES ESP LIGHT GOES ON AND OFF	CHECK FOUND DTC C1513 BRAKE SWITCH SHORTED	REPLACE BRAKE SWITCH AND CLEAR STORED DTC
KM8JN72D76U	9/09/05	20180	36.21		CUSTOMER STATES:ESCLIGHTON	SCAN TESTED FOUND CODE C1513 TESTED BRAKE LAMP CIRCUIT	OK TESTED SWITCH OPEN REPLACED SWITCH OK
KM8JN72D36U	8/13/05	27469	32.16		CUSTOMER STATES:CIGARETTE LIGHTER DOES NOT WORK PHONE CHARGER NOT WORKING	CHECK CIG LIGHTER NO POWER FOUND BLOWN FUSE	REPLACE FUSE RE TEST OK SCAN TEST C1513
KM8JM12B57U	11/17/06	844	32.16				
KM8JN72D76U	11/23/05	18029	37.26		CUSTOMER STATES ESC OFF LIGHT IS ON	CHECK FOUND FAULTY BRAKE SWITCH	REPLACE FAULTY BRAKE SWITCH
KM8JN72DX6U	12/10/05	7906	36.94		CUSTOMER STATES ESC LIGHT STAYS ON.	TECH STATES FOUND BRAKE SWITCH DEFECTIVE.	REMOVED AND REPLACED BRAKE SWITCH.
KM8JN72DX6U	12/10/05	7906	36.94		VEHICLE WILL NOT START AFTER SITTING BATTERY IN LOW STATE OF CHARGE	BATTERY CHECKS OKAY- ALTERNATOR UPGRADE NECESSARY	REPLACED ALTERNATOR WITH HIGHER OUTPUT UNIT TO CORRECT
KM8JM12B67U	10/31/06	3063	31.84		CUSTOMER STATES: ESC LIGHT IS COMING ON WHILE DRIVING PLEASE CK LIGHT IS COMING ON AND GOING OFF	SCAN TOOL B1513 CHECKED FRO COCENR FOUND BROKE CIRCUIT IN SWITCH	REPLACED SWITCH AND RETESTED OK
KM8JM12B26U	9/13/05	31820	36.21	CODE# C1513 / C1237.	CUSTOMER CONCERNED WITH HUMMING NOISE WHEN DRIVING VEHICLE PLEASE INSTALL SPECIAL ORDERED RIGHT REAR WHEEL BEARING	VERIFIED CONCERN HUMMING NOISE WHILE DRIVING. RIGHT REAR WHEEL BEARING LOSS OF GREASE AND ROUGH.	REPLACED RIGHT REAR WHEEL BEARING AND RETESTED 52720R0R .5 N29 C11
KM8JM12B26U	9/13/05	31820	36.21	CODE# C1513 / C1237.	CUSTOMER STATES ESC LIGHT COMES ON AND DOES NOT GO OFF WHEN BUTTON IS PUSHED	VERIFIED CONCERN FOUND CODES C1237 AND C1513.CHECKED BRAKE LIGHT SWITCH-OK. C1513 CAUSED BY HIGH RESISTANCE IN SWITCH CONTACTS	REPLACED SWITCH AND RETESTED ALL OK 93810R00 .3 N94 C15
KM8JM12B66U	7/11/05	32194	59.74	DTC C1513. SCAN TOOL TIME	CUSTOMER STATES STABILITY CONTROL LIGHT IS COMING ON.	CHECK FOUND DTC C1513 BRAKE LAMP SWITCH FAILURE	REPLACE FAULTY BRAKE LIGHT SWITCH
KM8JM12B66U	7/11/05	32194	59.74	DTC C1513. SCAN TOOL TIME	PERFORM DRIVER AIR BAG COVER MODULE REPLACEMENT	HYUNDAI CAMPAIGN 079	COMPLETED CAMPAIGN
KM8JN72D86U	1/06/06	16585	37.26		CUSTOMER STATES "ESC" LIGHT KEEPS LIGHTING UP ON DASH, SAYING "ESC OFF"	FOUND BRAKE LIGHT SWITCH FAULTY (C1513)	REMOVED AND REPLACED BRAKE LIGHT SWITCH
KM8JN72D06U	12/17/05	13482	36.21		CUSTOMER CONCERNED WITH ESC LIGHT ON INTERMITTENTLY AND NOW TIRE PRESSURE WARNING LIGHT ON PLEASE ADVISE	TESTED SYSTEM FOUND CODE C1513 FOUND FAULTY BRAKE LIGHT SWITCH CAUSING CONCERN	REPLACED BRAKE LIGHT SWITCH AND RETESTED 93810R00 .3 N94 C15
KM8JN72D96U	10/08/05	23155	36.21		CUSTOMER STATES THE STABILITY LIGHT GOES ON AND OFF AT RANDOM. PLEASE CHECK AND ADVISE.	VERIFIED CONCERN. FOUND C1513 BRAKE SWITCH MALFUNCTION. FOUND HIGH RESISTANCE THROUGH SWITCH CONTACT.	REPLACED BRAKE PEDAL SWITCH. CONCERN CORRECTED. 93810R00 .3 N:94 C:15
KM8JN72D56U	11/26/05	27974	35.89		CUSTOMER STATES THE ESC LIGHT COMES ON BUT BUTTON WON'T PUT LIGHT OUT. PLEASE CHECK AND ADVISE.	FOUND DTC C1513 STOP LAMP SWITCH MALFUNCTION. REMOVED SWITCHFOUND 7.0 OHMS RESISTANCE BETWEEN PIN 1 AND 3	REPLACED STOP LAMP SWITCH. 93810R00 .3 N:94 C:15
KM8JN72D86U	1/06/06	16585	37.26		WHEN MAKING LEFT TURNS, TURN SIGNAL DOES NOT TURN OFF	TECH STATES FOUND TURN SIGNAL SWITCH FAULTY.	REMOVED AND REPLACED TURN SIGNAL SWITCH.
KM8JN72D86U	1/06/06	16585	37.26		PERFORM DRIVER AIR BAG COVER MODULE REPLACEMENT	HYUNDAI CAMPAIGN 079	COMPLETED CAMPAIGN
KM8JN72D66U	7/19/05	21689	37.26	TECHNICIAN REMOVED AND REPLACED THE BRAKE LAMP SWITCH CLEARED CODE-TEST-GOOD	CUSTOMER STATESTHE WHEN THE ESC LIGHT IS OFF THE LIGHT IS ON	TECHNICIAN FOUND CODE-C1513- BRAKE LAMP SWITCH FAILURE THE BRAKE LAMP SWITCH FAILED INTERNALLY	TECHNICIAN REMOVED AND REPLACED THE BRAKE LAMP SWITCH CLEARED CODE-TEST-GOOD

KM8JN72D46U	7/26/05	34943	36.21	TRACE OUT AND FOUND HIGH RESISTANCE BETWEEN PIN 1 AND 2. REPLACED SWITCH, FUNCTION TEST OK. 93810R00 .3 N94/C15	CUSTOMER STATES, ESC LIGHT COMES ON WHEN DRIVING. SEAMS TO DRIVE OK. WHEN TURNING OFF CAR AND RESTARTING LIGHT WILL SOMETIMES STAY ON.	C1513 STOP LAMP SWITCH MALFUNCTION.	TRACE OUT AND FOUND HIGH RESISTANCE BETWEEN PIN 1 AND 2. REPLACED SWITCH, FUNCTION TEST OK. 93810R00 .3 N94/C15
KM8JN12D55U	6/02/05	36425	36.21		CUSTOMER STATES ABS LIGHT IS ON. CHECK AND ADVISE.	VERIFIED CONCERN. FOUND C1513 BRAKE PEDAL SWITCH MAFUNCTION OPEN CIRCUIT WHEN DEPRESSED.	REPLACED PEDAL SWITCH. 93810R00 .3 N-94 C:15
KM8JN72D16U	12/26/05	7453	37.26		CUSTOMER STATES ESC LIGHT CAME ON WHILE DRIVING.	TECH STATES FOUND CODE C1513 BRAKE SWITCH FAULTY	REMOVED AND REPLACED BRAKE LIGHT SWITCH, TESTED, OK NOW.
KM8JM12B26U	5/17/06	5459	36.94		CUSTOMER STATES ESC LIGHT ON	TECH STATES FOUND BRAKE SWITCH DEFECTIVE.	REMOVED AND REPLACED BRAKE SWITCH.
KM8JM12B26U	5/17/06	5459	36.94		CUSTOMER STATES P/S REAR WINDOW INOP	TECH STATES FOUND P/S REAR WINDOW MOTOR HEATING UP FROM INTERNAL SHORT.	REMOVED AND REPLACED P/S REAR WINDOW MOTOR, TESTED, OK NOW.
KM8JN72D85U	4/25/05	28586	36.21	CONCERN-ESP LIGHT ON-ADVISE. VERIFIED CONCERN-FOUND CODE C1513 INTERNAL SHORT IN BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH AND RESET CODE.RECHECK ALL OK AT THIS TIME. COMPLETED	CUSTOMER STATES ESP LIGHT COMES ON INTERMITTENTLY	VERIFIED CONCERN FOUND CODE C1513 FOUND INTERNAL SHORT IN BRAKE LIGHT SWICH	REPLACED BRAKE LIGHT SWITCH AND RESET CODE 93810R00 .3 N94 C15
KM8JM12B86U	7/11/05	46000	33.66	C/S ESP LIGHT IS ON- TECH VERIFIED CUST'S CONCERN FOUND DTC C1513- BRAKE LAMP SWITCH MALFUNCTION- REPLACED FAULTY BRAKE LAMP SWITCH ALL OK			
KM8JN72D76U	10/01/05	13600	33.66	ESC LIGHT ON- CHECKED AND FOUND 1707- FOUND BRAKE LAMP SWITCH FAULTY- FOUND BRAKE LIGHTS STAYING ON STEADY NECC TO REPLACE BRAKE LAMP			
KM8JN72D16U	10/22/05	33456	37.26	REPLACE BRAKE LIGHT SWITCH	ESC OFF LIGHT IS ON	CHECK FOUND FAULTY BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN72D86U	10/22/05	25419	37.26		CUSTOMER STATES ESC LIGHT COMES ON	TECH STATES FOUND BRAKE LIGHT SWITCH DEFECTIVE.	REMOVED AND REPLACED BRAKE LIGHT SWITCH
KM8JN72D86U	10/22/05	25419	37.26		CUSTOMER STATES P/S SEAT BELT WILL NOT RETRACT.	TECH STATES VERIFIED SEAT BELT WILL NOT RETRACT, FOUND PRETENSIONER FAULTY	REMOVED AND REPLACED P/S SEAT BELT ASSEMBLY.
KM8JN72D26U	1/07/06	29634	37.26		CUSTOMER STATES "ESC OFF" LIGHT STAYS ON SOP IN	TECH STATES FOUND BRAKE SWITCH DEFECTIVE.	REMOVED AND REPLACED BRAKE SWITCH, ROAD TESTED TO VERIFY REPAIR.
KM8JM12BX6U	2/24/06	6249	35.3	FOUND SENSOR INOP DUE TO OPEN SHORT, REMOVED AND REPLACED SYSTEM OK	CUST STATES ESC LIGHT IS ON AND WONT GO OFF, CHECK AND REPORT	INOPT OPEN SHORT	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE FOUND SENSOR INOPT DUE TO OPEN SHORT, REMOVED AND REPLACE, SYSTEM OK
KM8JM12B85U	12/09/04	48494	32.23	CHECK ENGINE LIGHT ILLUMINATED- SCANNED FOR CODES- RETRIEVED C1513- BRAKE LAMP SWITCH OPEN/SHORT- FOUND NECC TO REPLACE BRAKE LAMP SWITCH- NO PROBLEMS FOUND THERE			
KM8JN72D85U	6/02/05	16699	35.3	UPON INSPECTION ESC LIGHT WAS ON DUE TO INOP BRAKE SWITCH TO CORRECT , VEHICLE'S BRAKE SWITCH WAS REPLACED AND TESTED , NO WARNING LIGHT WAS ON VEHICLE SYSTEM GOOD	CUST STATES ESC LIGHT STAYS ON, CHECK AND REPORT	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE UPON INSPECTION ESC LIGHT WAS ON DUE TO INOPTB RAKE SWITCH TO CORRECT , VEHICLE'S BRAKESWITCH WAS REPLACED AND TESTED , NO WARNINGLIGHT WAS ON VEHICLE SYSTEM GOOD
KM8JN72D06U	10/04/05	30108	36.5		CUSTOMER STATES CHECK ENGINE LIGHT ON	CHECK FOUND DTC C1513 BRAKE SWITCH FAILURE	REPLACE FAULTY BRAKE SWITCH AND CLEAR STORED DTC
KM8JN72D65U	11/10/04	8000	25.2		CUSTOMER STATES BRAKE LIGHTS WILL NOT GO OUT.	TECH STATES FOUND BRAKE LIGHT SWITCH OUT OF ADJUSTMENT.	ADJUSTED BRAKE LIGHT SWITCH TO SPEC.
KM8JN72D97U	6/09/06	7758	37.26		CUSTOMER STATES THE VEHICLE TAKES SEVERAL TRIES TO GET OUT OF PARK	TECHNICIAN FOUND A PROBLEM WITH THE BRAKE LIGHT SWITCH	TECHNICIAN REMOVED AND REPLACED THE BRAKE LIGHT SWITCH
KM8JN72D36U	11/29/05	20886	33.66	ESC KEEPS COMING ON- VERIFIED CUSTS COMPLAINT FOUND OPEN CIRCUIT ON BRAKE SWITCH- FOUND NECC TO REPLACE BRAKE LIGHT SWITCH			
KM8JN72D45U	6/16/05	49155	33.66	TECH NOTED BRAKE LIGHTS NOT WORKING WHEN APPLYING BRAKES- CHECKED AND FOUND P1501- BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LAMP SWITCH ALL OK			
KM8JN72D05U	6/17/05	23536	33.66	C/S ESC LIGHT IS ON- CHECKED AND FOUNF BRAKE LIGHT SWITCH- SHORT/OPEN FOUND NECC TO REPLACE BRAKE LIGHT SWITCH- ALL OK AT THIS TIME			
KM8JM12B56U	7/14/05	21845	36.94		CUSTOMER STATES BRAKE LIGHTS INOP SOP SWITCH	CHECK FOUND VEHICLE BRAKE SWITCH STICKING	REPLACE FAULTY BRAKE SWITCH
KM8JN72DX6U	7/22/05	40058	36.94		CHECK ESC LIGHT KEEPS COMING ON	CODE-C1513,FAULTY BRAKE LIGHT SWITCH	REMOVE BRAKE LIGHT SWITCH,CLEAR CODE
KM8JM12B06U	7/19/05	18731	64.86	C1513, SCAN TOOL TIME....	CUSTOMER STATES THE ESC LIGHT GOES OFF AND ON	TECHNICIAN FOUND CODE C1513 BRAKE LIGHT SWITCH MAUFUNCTION	TECHNICIAN REMOVED AND REPLACED THE BRAKE LIGHT SWITCH CLEARED CODE-TEST GOOD
KM8JN72D05U	6/17/05	22868	33.66	ESC LIGHT COMES ON AND OFF- VERIFIED CUST'S COMPLAINT- FOUND CODES C1513 C1237- FOUND FAULTY BRAKE LIGHT SWITCH- FOUND NECC TO REPLACE BRAKE LIGHT SWITCH			
KM8JN72D26U	9/28/05	17886	33.34				

KM8JM12B26U	7/22/05	20992	50.46	SCAN TEST AND DIAG FOR BRAKE SWITCH.VEHICLE HAD A CODE C1513			
KM8JN12D96U	11/23/05	17504	30.06	ESC LIGHT ON AND HAS CODE C1513.NO SCAN TEST LABOR OPERATION.			
KM8JN72D56U	7/15/05	29451	37.26		ALL BRAKE LIGHTS OUT	CHECK FOUND FAULTY BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JM12B55U	1/06/05	31157	34.35		CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING	C1513-BRAKE LAMP SWITCH CIRCUIT BRAKE LAMP SWITCH INTERMITTEN OPEN CIRCUIT	REPLACE BRAKE LAMP SWITCH
KM8JM12B55U	1/06/05	31157	34.35		CUSTOMER STATES CRUISE CONMTROL INOPERATIVE	CRUSIE CONTROL SWITCH OPEN CIRCUIT(ORDERED PART)	REPLACE CRUISE CONTROL SWITCH
KM8JN72D36U	8/18/05	27697	50.46	CUSTOMER STATED ESC LIGHT CAME ON TWICE IS OFF NOW.SCANNED FOR DTC FOUND COD C1513 BRAKE SWITCH CIRCUIT. CHECKED CONNECTION REPLACED SWITCH.NOTE:NO SCAN TEST LABOR OPERATION.			
KM8JN12D96U	8/16/05	25632	30.06				
KM8JM12B76U	1/09/06	14170	50.46	SCANNED FOR DTC. FOUND CODE C1513. TESTED STOP LAMP SWITCH. SWITCH SHORTED OUT. R&R STOP LAMP SWITCH. CLEARED DTC.			
KM8JM12B16U	7/11/05	22038	62.46	ESC OFF LIGHT COMES ONC1513 FOUND BRAKE LIGHT SHORTEDREPLACED BRAKE LIGHT CLEAR CODE	CUSTOMER STATES ESC OFF LIGHT COMES ON	C1513 FOUND BRAKE LIGHT SHORTED	REPLACED BRAKE LIGHT CLEAR CODE
KM8JM12B56U	7/22/05	49363	62.46	ESC OFF LIGHT COMES ONSCAN TEST C1513 SHORTING OUT BRAKE LIGHT SWITCH CAUSING PROBLEMREPLACED BRAKE LIGHT SWITCH OK	CUSTOMER STATES ESC OFF LIGHT COMES ON	SCAN TEST C1513 SHORTING OUT BRAKE LIGHT SWITCH CAUSING PROBLEM	REPLACED BRAKE LIGHT SWITCH OK E
KM8JN12D75U	6/20/05	34738	36.06		PERFORM 079 RECALL	OPEN RECALL	REPLACED STEERING WHEEL AIR BAG COVER AS PER RECALL
KM8JN72DX6U	8/16/05	38796	243.66	PERFORMED SCAN TEST AND FOUND CODE C1513 BRAKE LAMP SWITCH. TECHLINE PETE 12:00PM 8/3/07 CONNECTORS AND CONNECTOR CONCERNS BAD M08 AND JOINT CONNECTORS PHOTO 73 CASE # 276545 BRAKE LAMP SWITCH INTERMITTANTLY SHORTING OUT. REPLACED BRAKE LAMP SWITCH AND NO			
KM8JN72D56U	11/26/05	10895	30.5	CUST ST THE ESC OFF LT COMES ON, FOUND THE BRAKE LIGHT SWITCH HAVING A INTERNAL SHORT, R&R BRAKE LT SW, RETEST OK.	CUSTOMER STATES ESC OFF LIGHT COMES ON AT TIMES	SHORT CIRCUIT IN STOPLAMP SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN72D86U	9/23/05	18033	49.7	CUST ST ESC LT ON, DIAG C1237 C1513 PRESENT, FOUND OPEN CKT IN BRAKE LT SWITCH, REPLACED BK LT SW, CLEAR CODES, RETEST OK.	CUSTOMER STATES THAT THE ESC LIGHT IS ON	FOUND BRAKE LIGHT SWITCH FAULTY, REPLACDED SWITCH	
KM8JN12D75U	6/20/05	34738	36.06		CSUTOMER STATES ESC LIGHT WILL OCME ON AND WONT TURN OFF AT TIMES EVEN WITH	C1513-BRAKE SWITCH FAILURE BRAKE SWITCH OPEN CIRCUIT	REPLACE BRAKELAMP SWITCH
KM8JN12D75U	6/20/05	34738	36.06		COURTESY TRANSPORTATION	NO CHARGE LOANER VEHICLE	WE TRY TO PROVIDE ALL OUR CUSTOMERS WITH COURTESY TRANSPORTATION SO THAT OUR CUSTOMERS ARE NOT
KM8JM12B06U	7/14/05	14	36.52		ESC LIGHT ON	OPEN CIRCUIT ON BRAKE LIGHT SWITCH	REPALCED SWITCH
KM8JN72D85U	6/23/05	29413	36.06	REPLACE BRAKE LIGHT SWITCH	PERFORM RECALL 079	PERFORM RECALL 079	PERFORM RECALL 079
KM8JN72DX5U	6/07/05	15040	47.74	CUST ST ESC LT ON, DIAG C1513 AND C1237 PRESENT, FOUND BRAKE LT SW DEFECTIVE, REPLACE BK LT SW, CLEAR CODES, RETEST OK.			
KM8JN72D36U	8/08/05	33311	28.54	CUST ST ABS SYS ACTIVATES AT TIMES, C1513 PRESENT, FOUND BK LT SWITCH DEFECTIVE, R&R BK LT SW, CLEAR CODE, RETEST OK.	CUSTOMER STATES ABS ACTIVATION AT TIMES	C1513 CODE PRESENT, BK LT SWITCH DEFECTIVE	REPLACED BRAKE LIGHT SWITCH
KM8JN72D56U	12/12/05	14173	35.74		CUST STATES ENGINE KEEPS STALLING.	FAULTY TPS SENSOR	REPLACED SENSOR
KM8JN72D85U	6/23/05	29413	36.06	REPLACE BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT OFF COMES ON	C1513-BRAKE SWITCH OPEN CIRCUIT	REPLACE BRAKE LIGHT SWITCH
KM8JN72D85U	6/23/05	29413	36.06	REPLACE BRAKE LIGHT SWITCH	CUSTOMER STATES CHECK ENGINE LIGHT ON	P0150-02 SENSOR MAL. (B2/S1) 02 SENSOR INTERMITTEN OPEN CIRCUIT	REPLACE O2 SENSOR (B2/S1-LEFT SIDE)
KM8JN72D16U	11/07/05	12166	37.7	JR	CUSTOMER STATES ESC LIGHT COMES ON	SOP BRAKE LIGHT SWITCH FOR ESC LIGHT PREV ORDERED	INSTALLED BRAKE LIGHT SWITCH CLEAR MEM OK C1513 CODE
KM8JN72D56U	12/12/05	14173	35.74		CUST STATES ECS LIGHT ON	FAULTY BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN12D66U	11/10/05	9204	35.74		CUST STATES ESC LIGHT KEEPS COMING ON	TECH FOUND BRAKE SWITCH SHORTING AND WIRE SHORTING AT CONTROL MODULE.	REPLACED BRAKE SWITCH AND REPAIRED SHORT IN WIRING. ROAD TEST.
KM8JN12D66U	11/10/05	9204	35.74		CAMPAIGN 079 OPEN	AIR BAG MODULE COVER REPLACEMENT	PERFORM SSC
KM8JN12D06U	11/05/05	29512	36.06		PERFORM RECALL 079	PERFORM RECALL 079	PERFORM RECALL 079
KM8JN12D06U	11/05/05	29512	36.06		CUSTOMER STATES ESC OFF LIGHT COMES ON	C1237 SHORTED BRAKE PRESSURE SENSOR	REPLACED SENSOR
KM8JN12D06U	11/05/05	29512	36.06		CUSTOMER STATES ESC LIGHT OFF COMES ON	C1513 SHORTED BRAKE SWITCH	REPLACED SWITCH
KM8JN12D55U	6/24/05	25515	36.06		CUST STATES ESC LIGHT COMES ON INTERMITTANTLY	CODE FOR BRAKE LIGHT SWITCH MALFUNCTION. TESTED AND FOUND OPEN IN SWITCH	REPLACED SWITCH AND CLEARED CODE.
KM8JN12D55U	6/24/05	25515	36.06		CUST STATES HAS A LOT OF STATIC IN AM RADIO	TECH ROAD TESTED AND SCANNED AM STATIONS.	OPERATING AS DESIGNED

KM8JN12D05U	4/25/05	16181	33.34	CUSTOMER STATES STEERING CONCERN VERIFIED ESP LIGHT STAYING ON-FOUND BRAKE SWITCH FAULTY-REPLACED BRAKE SWITCH	CUSTOMER STATES ESP LIGHT STAYING ON	PERFORM DIAG. FOUND BRAKE SWITCH FAULTY.	REPLACE BRAKE SWITCH
KM8JN12D06U	11/05/05	29512	36.06		COURTESY TRANSPORTATION	NO CHARGE LOANER VEHICLE	WE TRY TO PROVIDE ALL OUR CUSTOMERS WITH COURTESY TRANSPORTATION SO THAT OUR CUSTOMERS ARE NOT
KM8JM12B96U	9/23/05	10176	34.85	TRANS NOT SHIFTING PROPERLY AT TIMES. ESC LIGHT ON. CODE P1513	CUST. STATES TRANS NOT SHIFTING PROPERLY AT TIMES	DIAGNOSED AS NEEDING A BRAKE LITE SWITCH CODE C1513	REPLACED BRAKE LITE SWITCH
KM8JM12B96U	9/23/05	10176	34.85	TRANS NOT SHIFTING PROPERLY AT TIMES. ESC LIGHT ON. CODE P1513	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON VERIFY AND REPORT	DIAGNOSED CODE P0140 FAULTY OXYGEN SENSOR	REPLACED THE OXYGEN SENSOR. RESET SYSTEM
KM8JM12B46U	7/22/05	9738	33.34	CUSTOMER STATES BODY ELECT. CONCERN VERIFIED FOUND CODE C1513 BRAKE SWITCH AT FAULT DUE TO INTERNAL FAILURE-REPLACED SWITCH	TECH FOUND ESC LIGHT STAYING ON.	SCANNED VEH. FOR CODES FOUND C1513 - BRAKE SWITCH AT FAULT DUE TO INTERNAL FAILURE.	REPLACED SWITCH ASSY.
KM8JN72D36U	10/11/05	23772	33.66		CUSTOMER STATES KEY WILL NOT COME OUT OF THE IGNITION	PERFORM DIAG. FOUND SHIFT LOCK CABLE NUT MISSING AND DETACHED FROM THE SHIFTER.	REATATCH SHIFT LOCK CABLE AND REPLACE LOCK NUT
KM8JN72D36U	10/11/05	23772	33.66		CUSTOMER STATES ABS AND ESC LIGHT ON	PERFORM DIAG. FOUND BRAKE SWITCH FAULTY.	REPLACE BRAKE SWITCH.
KM8JN72D26U	7/29/05	30402	33.21	ESC LIGHT AND ISA LITE ON AGAIN. CODES C1274 AND C1513 STORED	CUSTOMER STATES. ESC LIGHT ISA ON AGAIN FOR THE 5TH TIME.	FOUND CODE C 1274, C1513. BRAKE LAMP SWITCH.	REMOVED AND REPLACED BRK. LIGHT LAMP SWITCH.
KM8JM12B75U	6/17/05	21473	36.66		CUSTOMER STATES THROTTLE CABLE STICKS, SOP HERE	THROTTLE BODY CABLE STICKS	DIAG AND ORDERED THROTTLE BODY--REPLACE SOP THROTTLE BODY ASSEMBLY
KM8JM12B75U	6/17/05	21473	36.66		CUSTOMER STATES STOP LAMPS STAY ON	SHORTED LAMP SWITCH	REPLACED SHORTED STOP LAMP SWITCH HIGH MOUNT STOP LAMP DEFECTIVE SOP
KM8JN72D06U	10/05/05	14256	33.34	CUSTOMER STATES ECS LIGHT STAYS ON VERIFIED FOUND CODES C1513 BRAKE LAMP SWITCH INTERNAL SHORT-REPLACED BRAKE LAMP SWITCH ASSY.	CUSTOMER STATES CHK VEH. FOR ECS LIGHT STAYS ON.	SCANNED VEH. FOR CODES FOUND - C1513 BRAKE LAMP SWITCH. INTERNAL SHORT	REPLACED BRAKE LAMP SWITCH ASSY.
KM8JN12DX6U	10/14/05	19190	33.66		TECH FOUND REAR BRAKE SWITCH AT FAULT	SHORTED	REPLACED REAR BRAKE LAMP SWITCH.
KM8JM12B06U	7/15/05	17512	33.34		CUSTOMER STATES CHK VEH. FOR BRAKE LIGHTS NOT TURNING OFF. CUST. HAD TO REMOVE FUSE FOR THEM TO TURN OFF.	SHORT/BLOWN - SCANNED VEH. FOR CODES FOUND (C1513 BRAKE LIGHT SWITCH MALF.)	REPLACED BRAKE LIGHT SWITCH ASSY.
KM8JN72DX6U	8/15/05	38600	36.66		CUSTOMER STATES BRAKE LIGHT ON FLUID IS FULL	VERIFIED CONCERN, FOUND CODE C1513, REMOVED AND	BRAKE LAMP SWITCH, VERIFIED REPAIR
KM8JN72D36U	8/09/05	23708	36.66		CUSTOMER STATES AT TIMES WHEN TURNING ON BLOWER IT WILL NOT COME ON, HAS TO RESTART CAR, SOP SWITCH	VERIFIED CONCERN NECESSARY TO REPLACE BLOWER CONTROL VERIFIED REPAIRS	BLOWER CONTROL SHORTING OUT
KM8JN72D36U	8/09/05	23708	36.66		CUSTOMER STATES BRAKE LIGHT ON ABS	VERIFIED CONCERN NECESSARY TO REPLACE BRAKE LIGHT SWITCH	SWITCH SHORTED OUT
KM8JN72D56U	7/21/05	40075	30.34				
KM8JN12D36U	8/16/05	21072	33.66	ESC LIGHT IS ON SCANNED CAR FOR CODES FOUND C1205 C1202 C1513 BRAKE LAMP SWITCH AT FAULT REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES ESC LIGHT STAYS ON.	SCANNED VEH. FOR FAULTY CODES FOUND (C1205, C1202, C1513) BRAKE LAMP SWITCH AT FAULT -INTERNAL FAILURE	REPLACED BRAKE LAMP SWITCH WILL STILL NEED FURTHER DIAGNOSTICS: VEH. ABLE TO BE DRIVEN WHEN SEAT BUCKLE COMES IN. WILL FURTHER DIAG. ESC CONCERN
KM8JM12BX6U	7/15/05	8765	33.06	CUSTOMER STATES ELECTRONIC STEERING CONTROL INOP-WHEN CAR IS RUNNING AND AFTER USE THE BRAKE YOU CAN'T TURN THE ESP ON VERIFIED FOUND CODE C1513 FAULTY BRAKE LIGHT SWITCH-REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ELECTRONIC STEERING CONTROL IS INOP CUSTOMER STATES WHEN CAR IS RUNNING AND AFTER USE THE BRAKE YOU CAN'T TURN THE ESP ON	FOUND CODE C1513 FAULTY BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12D86U	7/15/05	23316	33.66		CUSTOMER STATES ESC LIGHT STAYS ON.	SCANNED VEH. FOR CODES FOUND (P1513 SHORTED	REPLACED BRAKE LAMP SWITCH ASSY.
KM8JN12D25U	5/26/05	22366	32.3				
KM8JM12B25U	6/10/05	14508	30.34				
KM8JN72D26U	7/27/05	10738	30.06	CUSTOMER STATES CHECK ENGINE LIGHT WAS ON THIS WEEK, OUT NOW. FOUND CODE P0130 O2 SENSOR CIRCUIT B1/S1 AND C1513 BRAKE SWITCH CIRCUIT. EXERCISED CONNECTIONS AND CLEARED CODE. ROAD TESTED ESC CODE RETURNED. REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES CHECK ENGINE LIGHT WAS ON THIS WEEK	CODE C1513 CLEARED AND RETURNED	REPLACE BRAKE LIGHT SWITCH 93810R00 N68 C05 (.3)
KM8JN12D25U	6/29/05	28021	33.66		CUSTOMER STATES ESP LIGHT COMES ON AND OFF	PERFORM DIAG. HAD FAULT CODE FOR DEFECTIVE STOP LAMP SWITCH AND MASTER CYLINDER PRESSURE SWITCH.	REPLACE STOP LLAMP SWITCH AND ORDER NEW MASTER CYLINDER PRESSURE SENSOR
KM8JM12B26U	7/11/05	47369	30.34		CUSTOMER STATES CHECK ENGINE LIGHT ON AND ESC LIGHT IS ON.	SCAN FOR CODES P0455, P0456 EVP LEAK, AND C1513 BRAKE LIGHT SWITCH OPEN. RAN EVAP TEST, FAILED, TIGHTEN GAS CAP, PASSED. CHECK BRAKE LIGHT SWITCH AND FOUND INTERMITTANT OPEN CIRCUIT IN BRAKE LIGHT SWITCH.	REPLACED BRAKE LIGHT SWITCH, CLEARED CODE, OPERATING AS DESIGNED INTENT.
KM8JN12D15U	6/01/05	12352	30.06	CUSTOMER STATES ECS/TCS LIGHT COMES ON AT TIMES. FOUND BRAKE LIGHT SWITCH FAULTY, SHORTED. REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES ESC/TCS LIGHT COMES ON AT TIMES	SHORTED BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH 93810R00 N94 C15 (.3)

KM8JN12D15U	6/01/05	12352	30.06	CUSTOMER STATES ECS/TCS LIGHT COMES ON AT TIMES. FOUND BRAKE LIGHT SWITCH FAULTY, SHORTED. REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES ESC/TCS LIGHT ON	FAULTY BRAKE LIGHT SWITCH	NEEDS BRAKE LIGHT SWITCH (SCAN TIME) 39110RP0 N69 C15 .3
KM8JN72D25U	6/14/05	16579	30.2				STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D56U	7/27/05	29124	30.66		CUSTOMER STATES CHECK ENGINE LIGHT ON (LIGHT HAS BEEN COMING ON AND GOING OFF, YESTERDAY ESC LIGHTCAME ON AND STAYED ON, WOULD NOT RESPOND TO	CHECKED VEHICLE FOR CODES, FOUND C1513 BRAKE LAMP SWITCH. TESTED SWITCH AND FOUND INTERMITTANT CONTACTS IN SWITCH.	REPLACED AND ADJUSTED BRAKE LIGHT SWITCH, ROAD TEST VEHICLE TO VERIFY REPAIR AND OPERATION.
KM8JN12D45U	10/15/04	19937	32.62		CUSTOMER STATES ESP LIGHT ON. (REPLACE SOP) C1237 PRESSURE SENSOR, C1513 BRAKE LT. SWITCH.	BRAKE LIGHT SWITCH AND PRESSURE SENSOR SWITCH HAVE INTER MITTANT OPERATION.	REPLACED BRAKE PRESSURE SWITCH, REPLACED BRAKE LIGHT SWITCH CLEARED DTC'S, ROAD TEST TO VERIFY REPAIR. (59150R00 .5 PRESSURE SENSOR, 93810R00 .3 SWITCH)
KM8JN72D16U	11/24/05	22193	30.34		CUSTOMER STATES ECS LIGHT COMES ON WHILE DRIVING, IS THIS NORMAL	SCANNED SYSTEM, RETRIEVED CODE C1513 BRAKE LAMP SWITCH MALF FOUND SWITCH TO HAVE INTERMITTENT CONTACT	REMOVED AND REPLACED BRAKE LAMP SWITCH, CLEARED CODE, RETEST/FINE AT THIS TIME
KM8JN72D95U	6/23/05	11728	28.56				
KM8JN72D86U	8/17/05	25932	28.56				
KM8JN72D06U	3/14/06	4535	31.4		C/S ESC LIGHT CAME ON-STAYED ON FOR A SHORT TIME THEN WENT OFF.THIS HASHAPPENED 2 TIMES	ESC LIGHT CAME ON,REPLACED FAULTY STOPLIGHT SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D86U	7/26/05	18954	29.76	CUSTOMER STATES THAT THE ESC LIGHT IS ON. REPLACE BRAKE SWITCH.			
KM8JN72D36U	11/28/05	14521	394.34	C.S THE CRUSIE CONTROL IS NOT WORKING. ROAD TEST TO DUPLICATE CONCERN. FOUND SET LIGHT WILL SET FOR A SECOND THEN KICK OFF. TECHLINE CASE 275404			
KM8JN72D56U	7/28/05	4622	32.3		CUSTOMER STATES THAT THERE IS BURNING SMELL WITH AC ON ESC LIGHT IS ON.	RETRIEVED CODE C1513 BRAKE LAMP SWITCH MALFUNCTION. FOUND FORNT 02 SENSOR HARNESS TO BE MAKING CONTACT WITH BOLT FOR HEAT SHIELD.	ADJUSTED POSITION OF WIRE HARNESS, REPLACED BRAKE LAMP SWITCH, CLEARED DTC. VERIFY REPAIR (93810R00 .3)
KM8JN12D86U	12/10/05	21882	29.76	CUSTOMER STATES WHEN BRAKES ARE APPLIED, NO BRAKE LIGHTS. CHECK SWITCH, BAD SWITCH. REPLACE STOP LAMP ASSY.	CUSTOMER STATES THAT THE RPM IS ERADIC WHEN STOPPING FROM 35 40 MPH YOU FEEL THE VEHICLE IS SKIPPING GEAR WHEN YOU STOP AFTER GOING 50 M	CEL IS ON-P0036,C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 22000 CEL IS ON-P0036,C1513 ORDERED OXYGENSENSOR B1/S2
KM8JM12B06U	3/17/06	10327	29.44	TESTED AND FOUND THE BRAKE LIGHT SWITCH HAD FAILED.REPLACED SWITCH	CLIENT STATES TURN SIGNAL WILL NOT CANCEL AT TIMES	SWITCH	SWITCH ASSY-LIGHTING AND/OR TURN SIGNAL RE SWITCH ASSY-LIGHTING AND/OR TURN SIGNAL RE TESTED AND FOUND THE TURN SIGNAL SWITCH FAILED. REPLACED TURN SIGNAL SWITCH
KM8JN72D56U	7/28/05	11765	56	C.S TO CHECK NO START CONCERN. VEHICLE TOWED IN. CHECKED BATTERY AND CHARGING SYSTEM. EVERYTHING OK AT THIS TIME. CHECKED AND FOUND NO CRANK. FOUND BRAKE LIGHT SWITCH OUT OF ADJUSTMENT. ADJUST AND TEST TO VERIFY REPAIRS	CUSTOMER STATES AFTER SHUTTING OFF VEHICLE THIS MORNING WAS UNABLE TO START BACK UP, LIGHTS LIT UP ON DASH, WAS UNABLE TO PUSH THE SHIFT LOCK, AFTER WAITING A WHILE THE CAR DID START, DROVE CAR HOME, CALLED TOW TRUCK DRIVER TO PICK UP, THE SHIFT LOCK BUTT	FOUND BRAKE SWITCH SLIGHTLY OOUT OF ADJUSTMENT	READJUSTED SWITCH AND TEST TO VERIFY REPAIRS
KM8JN12D25U	4/21/05	46309	30.66		CUSTOMER STATES TRACS LIGHT ON FOR HOURS/DAYS/WEEKS AT AT TIME THEN GOES OFF. (INTERMITTANT)	SCAN FOR CODEES C1513 BRAKE LIGHT SWITCH. FOUND POOR CONTACTINTERMITTANT FAILURE.	REPLACED BRAKE LIGHT SWITCH, VERIFY REPAIR AND OPERATION.
KM8JN12D05U	10/28/04	15182	35.62	15	CUST STATES ESP LIGHT COMES ON AND OFF	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B06U	3/17/06	10327	29.44	TESTED AND FOUND THE BRAKE LIGHT SWITCH HAD FAILED.REPLACED SWITCH	CLIENT STATES THE ESC LIGHT IS COMING ON AND STAYING ON	SWITCH	TESTED AND FOUND THE BRAKE LIGHT SWITCH HAD FAILED.REPLACED SWITCH
KM8JN72D16U	11/11/05	19068	29.76	CUSTOMER STATES ELECTRONIC STABILITY CONTROL LIGHT KEEPS COMING ON. BAD BRAKE SWITCH. REPLACE STOP LAMP	C/S ELECTRONIC STABILITY CONTROL LIGHT KEEPS COMING ON...PLEASE CHECK	ESC LIGHT IS ON	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D86U	8/10/05	12344	31.4		CLIENT STATES ESC LIGHT COMES ON AND OFF WHILE DRIVING.	C1513 BRAKE SWITCH CODE IN SYSTEM, DIAGNOSED AND REPLACED BRAKE SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D16U	8/18/05	22311	35.14		CUST STATES ESC LIGHT COMES ON WHILE DRIVING	SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D16U	8/18/05	22311	35.14		LUBRICATION, CHANGE OIL & OIL FILTER.	LOF	LUBRICATION, CHANGE OIL &OIL FILTER. LUBRICATION, CHANGE OIL &OIL FILTER.
KM8JN72D16U	9/24/05	26682	35.46		CUST STATES ABS IGH T ON	SENSOR	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D16U	9/24/05	26682	35.46		CUST STATES ECS INOP	SENSOR G	SENSOR-ABS "G" RE SENSOR-ABS "G" RE 28000
KM8JN72D36U	8/09/05	21854	51.5		CLIENT STATES ESC LITE ON-INSTALL SPO PART	CHECKED AND VERIFIED CONCERN, REPLACED BRAKE LIGHT SWITCH. CLEARED CODE. ROAD TESTED OK.	MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION
KM8JN72D36U	8/09/05	21854	51.5		CLIENT STATES ESC LITE ON-INSTALL SPO PART	CHECKED AND VERIFIED CONCERN, REPLACED BRAKE LIGHT SWITCH. CLEARED CODE. ROAD TESTED OK.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B16U	7/20/05	9437	31.4		CLIENT STATES ESC LIGHT COMES ON	SCAN DETERMINED STOPLIGHT SWITCH DEFECTIVE, REPLACED.	COMPUTER ASSEMBLY ADD SCAN TOOL OPERATION COMPUTER ASSEMBLY ADD SCAN TOOL OPERATION

KM8JN72D96U	9/30/05	10645	35.14		CUST STATES ESC LIGHT KEEPS COMING ON AND OFF	SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D45U	6/17/05	44148	35.46	47000 C1513 ESC LIGHT ON, CHECKED CODES, C1513 BRAKE LAMP SWITCH, CHECKED BRAKE LAMP SWITCH, CHECKED WIRING OK, BRAKE LAMP SWITCH HAS INTERNAL ISSUE, INSTALLED NEW SWITCH ASSEMBLY, CLEARED CODES AND TEST DROVE, OK	CUST STATES VISOR SOP	BROKEN	SUNVISOR ASSY (BOTH SIDES) SUNVISOR ASSY (BOTH SIDES)
KM8JM12B16U	7/20/05	9437	31.4		CLIENT STATES REAR WINDOW LEAKS	ACCESS REAR COMPARTMENT AND WATER TEST, SEALED REAR HATCH AREA, WATER TESTED OK SECOND TIME.	WATER LEAK REPAIR WATER LEAK REPAIR
KM8JM12B16U	7/20/05	9437	31.4		CLIENT STATES ESC LIGHT COMES ON	SCAN DETERMINED STOPLIGHT SWITCH DEFECTIVE, REPLACED.	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B16U	7/20/05	9437	31.4		CLIENT STATES REAR WINDOW LEAKS	ACCESS REAR COMPARTMENT AND WATER TEST, SEALED REAR HATCH AREA, WATER TESTED OK SECOND TIME.	3
KM8JN72D45U	6/17/05	44148	35.46	47000 C1513 ESC LIGHT ON, CHECKED CODES, C1513 BRAKE LAMP SWITCH, CHECKED BRAKE LAMP SWITCH, CHECKED WIRING OK, BRAKE LAMP SWITCH HAS INTERNAL ISSUE, INSTALLED NEW SWITCH ASSEMBLY, CLEARED CODES AND TEST DROVE, OK	CUST STATES ESC LIGHT1	C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 47000 C1513 ESC LIGHT ON, CHECKED CODES, C1513 BRAKE LAMP SWITCH, CHECKED BRAKE LAMP SWITCH, CHECKED WIRING OK, BRAKE LAMP SWITCH HAS INTERNAL ISSUE, INSTALLED NEW SWITCH ASSEMBLY, CLEARED CODES AND TEST DRO
KM8JN72D66U	8/09/05	18557	37.1		CUST STATES CHECK ESC, LIGHT COMES ON AND WONT GO OFF	CAR CARE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D66U	8/09/05	18557	37.1		LUBRICATION, CHANGE OIL & OIL FILTER.	M	LUBRICATION, CHANGE OIL & OIL FILTER. LUBRICATION, CHANGE OIL & OIL FILTER.
KM8JN72D36U	8/19/05	32969	28.05	3 ESC LIGHT ON-NO BRAKE LIGHTS ESTIMATE FOR SATELLITE RADIO \$588.00 PLUS TAX	C/S ESC WARNING LIGHT IS ON...PLEASE CHECK	ESC LIGHT ON-NO BRAKE LIGHTS	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 3 ESC LIGHT ON-NO BRAKE LIGHTS ESTIMATE FOR SATELLITE RADIO \$588.00 PLUS TAX
KM8JN72D56U	9/29/05	17766	29.44	CUST STATES THE ESC LIGHT IS ON AT TIMES, REPLACED FAILED SWITCH	079 RECALL	RECAL	RECALL 079 DRIVER AIRBAF COVER MOD REPL (07-01-001) RECALL 079 DRIVER AIRBAF COVER MOD REPL (07-01-001)
KM8JN72D56U	9/29/05	17766	29.44	CUST STATES THE ESC LIGHT IS ON AT TIMES, REPLACED FAILED SWITCH	CLIENT STATES THE ESC LIGHT IS ON AT TIMES	SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B46U	8/22/05	55596	32.14		CUSTOMER REQUESTS 079 TUCSON AIR BAG MODULE COVER CAMPAIGN 61B046R0 .20	REQUIRED	COMPLETE CAMPAIGN
KM8JM12B46U	8/22/05	55596	32.14		CUSTOMER STATES THE ESC LIGHT WILL NOT RESET. WONT SHUT OFF	SCANNED AND FOUND THE CODE C1513 BRAKE LAMP SWITCH MALFUNCTION.	REPLACED BRAKE LAMP SWITCH. CLEARED CODE AND ROAD TESTED OK
KM8JN72D36U	9/14/05	22030	34.1		CUSTOMER STATES WHEN DRIVING ESP LIGHT WILL AUTOMATICALLY COME ON SEEMS TO BE INTERMITTANT	FOUND CODE P01315 BRAKE SWITCH FAULTY	REPLACED BRAKE SWITCH
KM8JN72D06U	7/27/05	20438	32.74	CUSTOMER STATES ESC LIGHT ON AND NO BRAKE LIGHTS-TECH REPLACED SHORTED BRAKE LIGHT SWITCH AND VERIFIED REPAIR	CUSTOMER STATES ESC LIGHT ON AND NO BRAKE LIGHTS-DIAG AND ADVISE	CUST STATES NO BRAKE LIGHTS REPLACED SHORTED BRAKE LIGHT SWITCH AND VERIFIED REPAIR	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D76U	10/14/05	10961	58.1	CUSTOMER REPORTS ECS LIGHT IS ON-SCANNED CODE C1533 AND REPLACED BRAKE LIGHT SWITCH	ECS LIGHT IS ON	RECIEVED CODE C1533 AND REPLACED BRAKE LIGHT SWITCH AND VERIFIED REPAIR	WIRE REPAIR TIME (MINOR)-ADJUSTMENT WIRE REPAIR TIME (MINOR)-ADJUSTMENT
KM8JN12D76U	10/14/05	10961	58.1	CUSTOMER REPORTS ECS LIGHT IS ON-SCANNED CODE C1533 AND REPLACED BRAKE LIGHT SWITCH	ECS LIGHT IS ON	RECIEVED CODE C1533 AND REPLACED BRAKE LIGHT SWITCH AND VERIFIED REPAIR	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D96U	7/16/05	25830	32.46	REPLACED THE BRAKE LAMP SWITCH, ALL SER	CUSTOMER STATES THE BRAKES LIGHTS WILL NOT SHUT OFF ESC LIGHT WILL NOT GO OFF EITHER	SCANNED AND FOUND THE CODE P1237 PRESSURE SENSOR- OTHER	FOUND THE PRESSURE SENSOR CONNECTOR LOOSE, SECURED AND CLEARED CODE
KM8JN72D96U	7/16/05	25830	32.46	REPLACED THE BRAKE LAMP SWITCH, ALL SER	CUSTOMER STATES THE ECS LIGHT IS ON	FOUND THE CODE C1513 BRAKE LAMP SWITCH FAULTY	REPLACED THE BRAKE LAMP SWITCH, ALL SER
KM8JN72D55U	4/14/05	51618	34.1		CUSTOMER STATES THE ESP LIGHT IS ON	FOUND THE STOP LAMP SWITCH FAULTY	REPLACED THE STOP LAMP SWITCH, CLEARED CODE AND ROAD TESTED OK
KM8JN72D55U	4/14/05	51618	34.1		CUSTOMER REQUEST HPP RENTAL		
KM8JN12D86U	7/21/05	28004	35.46	CUST STATES THAT THE ECU LIGHT COMES ON REC'D CODE C1513 REPLACED SHORTED BRAKE LIGHT SWITCH AND VERIFIED REPAIR			
KM8JN72D26U	11/28/05	14380	35.14	CUSTOMER STATES ECU LIGHT STAYS ON-TECH RECEIVED CODE C1513-TECH REPLACED SHORTED BRAKE LIGHT SWITCH AND VERIFIED REPAIR			
KM8JN72D76U	11/15/05	4343	34.7		CUSTOMER STATES L/F DOOR HANDLE PAINT IS CRACKED	PAINT CRACKING	HANDLE ASSY-FRONT DOOR OUTSIDE (LH) RE HANDLE ASSY-FRONT DOOR OUTSIDE (LH) RE
KM8JN72D55U	10/28/04	22611	30.75		CUSTOMER REQUESTS 079 TUCSON AIR BAG MODULE COVER CAMPAIGN 61B046R0 .20	REQUIRED	COMPLETE CAMPAIGN
KM8JM12B05U	6/07/05	26267	34.1		CUSTOMER STATE THE ESP LIGHT COMES ON WHILE DRIVING CK AND ADVISE	SCANNED AND FOUND THE CODE C1513 BRAKE LAMP SWITCH FAULTY	REPLACED THE STOP LIGHT SWITCH, CLEARED CODE AND ROAD TESTED OK
KM8JM12B05U	6/07/05	26267	34.1		CUSTOMER REQUEST HPP RENTAL		
KM8JN72D76U	11/15/05	4343	34.7		R/F DOOR HANDLE PAINT IS CRACKED	PAINT CRACKING	HANDLE ASSY-FRONT DOOR OUTSIDE (RH) RE HANDLE ASSY-FRONT DOOR OUTSIDE (RH) RE
KM8JN72D76U	11/15/05	4343	34.7		CUSTOMER STATES ECS LIGHT WOULD NOT GO OFF	INTERMITTENT SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE

KM8JN72D76U	11/15/05	4343	34.7		CUSTOMER STATES L/F DOOR HANDLE PAINT IS CRACKED	PAINT CRACKING	FRONT DOOR OUTSIDE HANDLE- LH FRONT DOOR OUTSIDE HANDLE- LH
KM8JN72D26U	7/30/05	16184	32.46		CUSTOMER STATES THE ECS LIGHT KEEPS COMING ON	SCANNED FOR CODES-C1513 BRAKE LAMP SWITCH IS FAULTY	REPLACED BRAKE LAMP SWITCH, TESTED OK
KM8JN72D96U	12/14/05	16607	150.14	1.3 ATT TO TRACE CRUISE HARNESS AND BACK PROB ALL CONNECTIONS TO CHECK FOR POWER. VERIFY ALL GROUNDS AND THEN CHECK RESISTANCE IN EACH CIRCUIT. PIN POINT LOOSE CONNECTION AT SWITCH CONNECTOR WHICH CAUSED HIGH VOLTAGE TO SHORT SWWITCH.			
KM8JN72D35U	1/03/05	16132	35.46				
KM8JN72D35U	1/03/05	496	36.6				
KM8JN72D76U	11/15/05	4343	34.7		R/F DOOR HANDLE PAINT IS CRACKED	PAINT CRACKING	FRONT DOOR OUTSIDE HANDLE- RH FRONT DOOR OUTSIDE HANDLE- RH
KM8JN72D76U	11/15/05	4343	34.7		CUSTOMER STATES L/F DOOR HANDLE PAINT IS CRACKED	PAINT CRACKING	SUBLET ADMINISTRATION ALLOWANCE SUBLET ADMINISTRATION ALLOWANCE
KM8JN72D76U	11/15/05	4343	34.7		CUSTOMER STATES L/F DOOR HANDLE PAINT IS CRACKED	PAINT CRACKING	
KM8JN72D76U	11/15/05	13501	35.46	CUSTOMER STATES ESC LIGHT IS ON. TECH VERIFIED COMPLAINT AND TECH REPLACED SHORTED BRAKE LIGHT SWITCH AND VERIFIED REPAIR			
KM8JM12B95U	5/16/05	26922	36.06				
KM8JN72DX6U	8/11/05	11545	35.74				
KM8JN12D36U	7/22/05	13037	37.7				
KM8JN12D75U	5/16/05	40178	23.54				
KM8JN72D36U	8/12/05	24295	32.46				
KM8JN72D86U	11/11/05	22100	32.14		VEHICLE DOWN SHIFTS ON OCCASIONS STEERING WHEEL OUT OF WACK	BRAKE SWITCH KEPT SENDING SIGNAL CAUSINGTRANS TO KICK DOWN TO LOWER GEAR	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN72D06U	8/16/05	13232	33.06	C/S ECS LIGHT GOES ON AND OFF RANDOMLY. CHECKED CODES, GOT CODE C1513. BRAKE PEDAL LAMP SWITCH MALF. MONITORED PIDS FOUND SWITCH INTERMITTENTLY OPEN. ORDRED SWITCH. REMOVED AND REPLACED SWITCH. VERIFIED REPAIR.			
KM8JN72D46U	11/29/05	24400	30.64				
KM8JN72D25U	2/22/05	94	47.6	TECH ADJUSTED BRAKE LIGHT SWITCH PER INOP BRAKE LIGHTS AND ESP WARNING LAMP ON.			
KM8JN72DX6U	12/12/05	9323	30.64				
KM8JM72B36U	11/30/05	19275	32.16	TT FOR DIAG AS THERE IS NO SCAN OP FOR THIS.			
KM8JN72D45U	4/21/05	30691	27.94		CUSTOMER REQUEST INSTALL BRAKE LAMP SWITCH AS PER PERVIOUS DIAG.	OP CODE=93810R00	INSTALL BRAKE LAMP SWITCH AS PER PERVIOUS DIAG ALL IS OK AT THIS TIME.
KM8JM12B15U	7/07/05	9366	29.9		CUSTOMER STATES ESC LIGHT IS ON, VERIFIED AT PREVIOUS VISIT	FOUND SHORT IN STOP LAMP SWITCH	REPLACED SWITCH AND RECHECKED, ALL OK
KM8JM72B56U	11/05/05	33892	28.26		CUSTOMER REQUEST INSTALL STOP LAMP SWITCH AS PER DIAG.	OP CODE=93810R00	REPLACED STOP LAMP SWITCH TEST DROVE ALL IS OK AT THIS TIME.
KM8JN72DX6U	10/20/05	30394	51.94	CUSTOMER COMPLAINED OF ESC LIGHT ON. TECH SCANNED AND FOUND BRAKE LIGHT SWITCH CODE. DIAGNOSED BRAKE LIGHT SWITCH AS FAULTY AND REPLACED. TT TIME AS THERE IS NO SCAN OP FOR A BRAKE LIGHT SWITCH.			
KM8JN72D55U	5/23/05	30177	32.16				
KM8JN72D05U	5/23/05	12992	32.6				
KM8JM12B36U	12/21/05	9160	29.9		CUSTOMER STATES E.S.C. LIGHT IS ON, PLEASE CHECK AND ADVISE VERIFIED	PULLED DTC CODE (C1513) FOR STOP LAMP SWITCH, PULLED AND CHECKED GROUND AND POWER TO FIND INTERNAL FAILURE WITH	SWITCH, REPLACED STOP LAMP SWITCH AND RECHECKED, CODE CLEARED, ROADTESTED AND RECHECKED, ALL OK
KM8JN72D06U	10/08/05	16930	27.94		CUSTOMER STATES ESC LIGHT CAME ON FOR AN HOUR LAST WEEK, WENT OUT THEN CAME BACK ON AND OUT AGAIN, NOT ON SINCE	COMFRIMED LIGHT IS ON WILL CALL WHEN PART ARRIVES. OP CODE=93810R00	REPLACED BRAKE LAMP SWITCH AS PER NEEDED
KM8JN72D06U	10/08/05	16930	27.94		AIR BAG RECALL, PLEASE PERFORM. CAMPAIGN 079	PER OPCODE=61B046R0	REMOVED ANDREPLACED DRIVER AIR BAG MODULE
KM8JM12BX6U	1/06/06	7664	117.8	CUSTOMER COMPLAINED OF CRUISE NOT SETTING. TECH FOLLOWED DIAGNOSTIC TREES AND CHECKED WIRING TO NARROW ISSUE TO BRAKE PEDAL SWITCH. CHECKED SIGNALS OUT OF SWITCH AND DIAGNOSED AS BAD. REPLACED SWITCH. TT FOR DIAGNOSIS.			
KM8JN12D36U	8/22/05	20093	30.64				
KM8JM12B46U	7/14/05	13077	30.96				
KM8JN72D95U	8/25/04	17973	31.28				
KM8JN72D46U	7/22/05	29645	32.74	CODE C1513 BRAKE LAMP SWITCH-FOUND TRIGGER STICKING-REMOVED & REPLACED SWITCH-CLEAR CODE-R/TEST-OK.	CUST STATES ESP LIGHT HAS COME ON AND OFF	POOR CONTACT	ELECTRICAL ELECTRICAL SCANNED FOR CODES-C1513 BRAKE LAMP SWITCH-INSPECTED SWITCH-FOUND TRIGGERSTICKING-REMOVED & REPLACED SWITCH-CLEAREDCODE-ROAD TEST-OK.

KM8JN72D46U	7/22/05	29645	32.74	CODE C1513 BRAKE LAMP SWITCH-FOUND TRIGGER STICKING-REMOVED & REPLACED SWITCH-CLEAR CODE-	CUSTOMER STATES PERFORM RECALL CAMPAIGN#079 DRIVER AIR BAG COVER MODULE REPLACE	RECALL	RECALL PER BULLETIN RECALL PER BULLETIN INSPECTED & REPLACED AIR BAG COVER MODULE
KM8JN12D46U	2/20/06	16414	33.1		CUSTOMER STATES CHECK ENGINE LIGHT ON	P0456, P0442, PERFORMED VACUUM TEST ON EVAP SYSTEM, NO LEAKS FOUND	POSSIBLE FUEL CAP LOOSE
KM8JN72D96U	10/08/05	17707	30.64				
KM8JM12B76U	9/15/05	6711	32.6				
KM8JN72D86U	9/09/05	16764	52.26	CUSTOMER COMPLAINED OF ESC LIGHT. TECH SCANNED C1513, CONFIRMED BRAKE SWITCH BAD, AND REPLACED. TT FOR DIAGNOSIS, AS THERE IS NO SCAN OP FOR THIS PART.			
KM8JM12B56U	7/22/05	27450	37.77				
KM8JN12D46U	2/20/06	16414	33.1		CUST STATES THE SPEEDOMETER WENT TO 100 MPH, THEN WENT TO 20MPH, HAS CORRECTED ITSELF	CODE C1237, C1513 CHECKED GROUND CONNECTION AT G08, NO WIRING PROBLEM FOUND, CASE #250582	REPLACED BRAKE SWITCH
KM8JN12D75U	4/29/05	36121	31.14		CUSTOMER STATES AT 60 TO 70 MPH CAR LUNGES AND AT STOPS CAR DOWNSHIFTS HARD AND STALLS	TECH TESTED AND PULLED NO FAULT CODES, CONFIRMED CONCERN. TECH CALLED TECH HOTLINE, CASE #268794, WAS ADVISED TO COMPLETE ADAPTIVE RELEARN, IF THAT DID NOT CORRECT DRIVABILITY, REPLACE THROTTLE POSITION SENSOR, RELEARN MADE NO DIFFERENCE	TECH REPLACED TPS, NOW VEHICLE HAS A NORMAL OPERATION
KM8JN72D85U	5/26/05	5124	62.3				
KM8JN12D86U	8/25/05	4398	37.77				
KM8JN72DX5U	6/09/05	14521	36.8				
KM8JM12B57U	11/01/06	3264	32.16				
KM8JN12D75U	4/29/05	36121	31.14		922 RECALL	FACTORY RECALL	TECH COMPLETED 922 CAMPAIGN, ESC ECM
KM8JN12D75U	4/29/05	36121	31.14		CUSTOMER STATES BRAKE LIGHTS DO NOT WORK	TECH INSPECTED AND CONFIRMED CONCERN, TECH HAS NOTED THAT BRAKE LIGHT SWITCH HAS INTERNAL SHORT	TECH REPLACED BRAKE LIGHT SWITCH, NOW BRAKE LIGHTS HAVE A NORMAL OPERATION
KM8JN12D65U	6/02/05	22410	31.14		CUSTOMER STATES ESP OFF LIGHT STAYS ON THEN GOES OFF INTERMITTENTLY	TECH TESTED, PULLED FAULT CODE C1513, TECH HAS NOTED THAT BRAKE LIGHT SWITCH HAS INTERNAL SHORT	TECH REPLACED BRAKE LIGHT SWITCH, CLEARED FAULT CODE, NOW ESP LIGHT IS OFF, VEHICLE HAS A NORMAL OPERATION
KM8JN12D66U	10/11/05	19894	31.7		PENNSYLVANIA STATE INSPECTION + PERFORM REQUIRED EMISSION TEST W/MCI TRANSACTION	TECH REPLACED FAULTED BRAKE LIGHT SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D36U	8/19/05	14948	32.16				
KM8JN72D86U	8/12/05	19397	33.64	SCAN CODE C1513	CHECK IF PARTS HERE FOR 079 RECALL AS OF 6/15/07---SOP--- ARE IN	0	0
KM8JM12B37U	11/09/06	9146	31.46		THE ESC OFF LIGHT IS ON. CHECK AND ADVISE.	TECH TESTED WITH SCAN TOOL, PULLED FAULT CODE C1513, TECH HAS NOTED THAT BRAKE LIGHT SWITCH HAD INTERNAL SHORT	TECH REPLACED BRAKE LIGHT SWITCH, CLEARED FAULT CODE, NOW ESC LIGHT IS OFF, VEHICLE HAS A NORMAL OPERATION
KM8JM12B05U	7/01/05	14140	28.35				
KM8JM12B46U	7/09/05	46611	32.76		C/S THE REAR BRAKE LIGHTS DO NOT WORK AT ALL	CHECK FEEDS AND OPERATION. STOP LAMP SWITCH INTERNAL FAILURE	REPLACE STOP LAMP SWITCH
KM8JN72D86U	8/12/05	19397	33.64	SCAN CODE C1513	SEE JOB # 4--CHECK ENGINE LIGHT	FOUND CODE C1513---BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH FP=HY93810-3K000 OP=93810R00=.3 NC=N94 CC=C15
KM8JN72D86U	8/12/05	19397	33.64	SCAN CODE C1513	FOUND CHECK ENGINE LIGHT ON UPON ARRIVAL GOES ON AND OFF - CAR IS RUNNING FINE ESP ALSO COMES ON--NOTE: DO NOT GO ON AT THE SAME TIME. CHECK ENGINE LIGHT CAME ON ONCE, AND THE ESP LIGHT HAS BEEN ON 2 OR 3 TIMES IN A MONTH	FOUND CODE P0130--02 SENSOR CIRCUIT MALFUNCTIONING B1/S1	REPLACED 02 SENSOR FP=HY39210-37513 OP=39214R00=.9 RPO=.3 NC=N69 CC=C15
KM8JN72D06U	10/05/05	19336	33.96	C/S THE ESC LIGHT IS ON CHECK AND VERIFY CONCERN SCAN FOR CODES NO CODES ELECTRICAL MALFUNCTION WITH THE BRAKE SWITCH REPLACED THE BRAKE SWITCH RETEST ROAD TEST	CUSTOMER STATES THE ESC LIGHT IS ON..VERIFY AND REPORT GOES ON AND OFF. NOW OFF	CHECKED AND VERIFIED CONCERN FOUND THE BRAKE SWITCH CAUSING CONCERN FOUND ELECTRICAL MALFUNCTION WITH THE BRAKE SWITCH	REPLACED THE BRAKE SWITCH FP=HY93810-3K000 OP=93810R00=.3 NC=N94 CC=C15
KM8JN12D25U	4/29/05	25382	34.4		C/S ESP LIGHT STAYS ON	FOUND CODE C1513 BRAKE LAMP SWITCH, FOUND BRAKE LAMP SWITCH INTERMITTANTLY GETS STUCK IN CLOSED POSITION.	REMOVED AND REPLACED BRAKE LAMP SWITCH WITH NEW AND CLEARED CODE FROM PCM.
KM8JN12D25U	4/29/05	25382	34.4		C/S JERKS ON ACCEL. --NO ENG LIGHTS	FOUND CODES P0123, P0121 THROTTLE POSITION SENSOR HIGH INPUT AND THROTTLE POSITION RANGE PERFORMANCE. FOUND SENSOR OUT RANGE RECOMMEND REPLACE WITH NEW.	REMOVED AND REPLACED THROTTLE POSITION SENSOR WITH NEW AND CLEARED CODES FROM PCM. TEST DROVE VEHICLE WITH CONCERN CORRECTED.
KM8JN12D57U	8/22/06	12895	37.41		ESC LIGHT FLICKERS ON AND OFF	FOUND CODE C1513 WITH HI SCAN DUE TO OPEN CIRCUIT INTERNALLY IN SWITCH	CLEARED CODE AND REPLACED STOP LAMP SWITCH. ROAD TESTED OK AT THIS TIME 93810R00 0.3 N69 C15
KM8JN72D16U	8/15/05	27098	33.96	C/S THE ESC LIGHT IS ON CHECK AND VERIFY CONCERN DIAG SCAN FOR CODES C1513 REPLACED THE BRAKE LIGHT SWITCH CLEAR RETEST ROAD	CUSTOMER STATES THE ESC LIGHT IS ON, VERIFY AND REPORT	SCAN TESTED AND FOUND CODE C1513-- REPLACED BRAKE LIGHT SWITCH AND CLEAR CODE	LO/93810R00 FP/93810-3K000 N94 C15
KM8JN72D46U	10/03/05	29853	33.96	C/S THE ESC LIGHT IS STAYING ON CHECK AND VERIFIED CONCERN DIAG SCAN TEST FOR CODES C1513 FAULTY SWITCH REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES THE ESC LIGHT STAY ON AFTER START-- STAYS ON UNTIL NEXT START UP. VERIFY AND REPORT	FOUND CODE C1513 REPLACED BRAKE LIGHT SWITCH AND CLEAR CODE	LO/93810R00 FP/93810-3K000 N94 C15

KM8JN12D55U	5/14/05	14655	37.41	REPLACED BRAKE LAMP SWITCH, REASSEMBLED CLEARED CODES OK 93810R00 .3 N69 C15	CUST. STATES ESOP LIGHT WAS ON.	FOUND CODE C1513- BRAKE LAMP SWITCH FOUND SWITCH TO BE STUCK CLOSED CAUSING INOP BRAKE LAMPS AND MIL	REPLACED BRAKE LAMP SWITCH, REASSEMBLED CLEARED CODES OK 93810R00 .3 N69 C15
KM8JM12B45U	2/23/05	29953	35.7		CUST. STATES CRUISE WANT RESUME	FOUND BRAKE SWITCH HAS SHORT INTERNALLY CAUSING TO READ BRAKE STILL DEPRESSED WHEN BRAKE PEDAL FREE ADJUSTMENT IS OK.	REPLACED STOP LAMP SWITCH AND ROAD TESTED. CRUISE CONTROL WORKING OK AT THIS TIME 93810R00 0.3 N94 C15
KM8JN12D17U	11/08/06	6466	37.09		CUST. STATES ESC LIGHT IS COMING ON.	PERFORMED DIAGNOSIS WITH SCANNER AND FOUND DTC C1513 BRAKE LAMP SWITCH MALFUNCTION. FOUND THAT IT INTERMITTENTLY. BRAKE SWITCH WILL GET OPEN/SHORT.	REPLACED BRAKE LAMP SWITCH AND CLEARED TROUBLE CODES. NO CODES AFTER REPAIRS. OPD CODE 92810R00 .3 93810ATT .3 N69 C15
KM8JN72D46U	10/03/05	29853	33.96	C/S THE ESC LIGHT IS STAYING ON CHECK AND VERIFIED CONCERN DIAG SCAN TEST FOR CODES C1513 FAULTY SWITCH REPLACED BRAKE LIGHT SWITCH RETEST	CUSTOMER STATES HEARS A SPRING SCRAPING SOUND WHEN YOU TURN CORNER TO THE LEFT OR GOES OVER BUMPS--VERIFY AND REPORT SOUND COMING FROM THE LEFT HAND SIDE	REPLACED LEFT REAR CROSSMEMBER BUSHING FOR NOISE	LO/62456R00 FP/62486-2E000 N29 C10
KM8JN72D56U	7/28/05	24641	33.96	C/S THINKS THE BRAKE LIGHT IS ON CHECK AND VERIFY CONCERN SCAN FOR CODES C1513 REPLACED THE BRAKE LIGHT SWITCH RETEST ROAD TEST	079--DRIVER SIDE AIR BAG MODULE COVER RECALL	COMPLETED	COMPLETED 079 RECALL LO/61B046R0
KM8JN72D56U	7/28/05	24641	33.96	C/S THINKS THE BRAKE LIGHT IS ON CHECK AND VERIFY CONCERN SCAN FOR CODES C1513 REPLACED THE BRAKE LIGHT SWITCH RETEST ROAD TEST	CUSTOMER STATES THE ESP LIGHT IS ON. VERIFY AND REPORT GOES ON AND OFF	REPLACED BRAKE LIGHT SWITCH--HAD CODE C1513	LO/93810R00 FP/93810-3K000 N94 C15
KM8JM12B45U	7/08/05	24912	37.41		CUST. STATES BRAKE LIGHTS NOT WORKING AT TIMES AND ESC LIGHT STAYING ON	TROUBLE CODE C1513 BRAKE LAMP SWITCH. STOP LAMP SWITCH SHORTED OUT.	REPLACED STOP LAMP SWITCH. OP CODE 93810R00, TIME 0.3, N94- C40
KM8JN12D05U	4/12/05	29962	27.84		CUSTOMER STATES CHECK ENGINE LIGHT ON	TROUBLE CODE P0301 CYL 1 MISFIRE. FUEL INJECTOR NUMBER #1 SHORTED OUT.	REPLACED INJECTOR #1. OP CODE 35311R00, TIME 1.2, N69-C15. OP CODE 35311RP0, TIME 0.3
KM8JN12D05U	4/12/05	29962	27.84		CUST. STATES ESC LIGHT COMES ON AT TIMES	TROUBLE CODE C1513 BRAKE LAMP SWITCH. STOP LAMP SWITCH SEIZED.	REPLACED STOP LAMP SWITCH. OP CODE 32002A00, TIME 0.2
KM8JN72D36U	7/29/05	14641	53.9		CUSTOMER SAYS ESU LIGHT COMES ON AT TIMES	SCAN TESTED AND FOUND CODE C1513--REPLACED BRAKE SWITCH AND CLEARED CODE	LO/39110RPO--3....93810R00--3 FP/93810-3K000 N94 C15
KM8JN72D55U	4/19/05	15310	33.64		CUSTOMER STATES THE REAR SEAT BELT (CENTER) BROKE WHEN TRYING TO USE, VERIFY AND REPORT (PART ORDERED WITH DAVE--7-16)	TECH VERIFIED THE REAR SEAT BELT BUCKLE IS BROKEN	TECH REPLACED THE REAR SEAT BELT BUCKLE (CENTER) FP89830-2E500 OP89831R00 .4HR N94 C06
KM8JN12D06U	7/22/05	15973	33.96	C/S THE ESC LIGHT STAYS ON CHECK AND VERIFIED CONCERN FOUND THE VEHICLE ALSO HAD NO STOP LIGHTS BRAKE SWITCH CAUSING CONCERN SWITCH SHORTED REPLACED BRAKE LIGHT SWITCH RETEST	079--RECALL--DRIVERS SIDE AIR BAG PART TAGGED BY TROY	0	0
KM8JN12D65U	4/26/05	12652	37.41		CUST. STATES CAR DIES WHILE SLOWING OR BRAKING.	VEHICLE OPERATING NORMAL NO STALLING CONDITION. ESP LIGHT COMES ON TRIGGERING CODE C1513 STOP LAMP SWITCH.	REPLACED STOP LAMP SWITCH. OP CODE 93810R00, TIME 0.3, N69-C15.
KM8JN12D65U	4/26/05	12652	37.41		CAMP 079 AIRBAG COVER	REPLACED AIR BAG COVER	REPLACED AIR BAG COVER. OP CODE 61B046R0, TIME 0.2
KM8JM12B15U	6/01/05	126	29.4	TOWED IN-CHECKED ELECTRICAL SYSTEM NO PROBLEM FOUND AFTER DIAGNOSIS			
KM8JN12D06U	7/22/05	15973	33.96	C/S THE ESC LIGHT STAYS ON CHECK AND VERIFIED CONCERN FOUND THE VEHICLE ALSO HAD NO STOP LIGHTS BRAKE SWITCH CAUSING CONCERN SWITCH SHORTED REPLACED BRAKE LIGHT SWITCH RETEST	CUSTOMER STATES THE ESC LIGHT STAY ON ALL THE TIME VERIFY AND REPORT	CHECKED AND VERIFIED CONCERN FOUND THE VEHICLE ALSO HAD NO STOP LIGHTS FOUND THE BRAKE LIGHT SWITCH CAUSING SWITCH SHORTED = =	REPLACED THE BRAKE LIGHT SWITCH FP=HY93810-3K000 OP=93810R00=.3 NC=N94 CC=C15
KM8JN72D96U	9/09/05	21328	33.96		CUSTOMER STATES ESC LIGHT COMING ON, VERIFY AND REPORT	FOUND CODE C1513 REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE	LO/93810R00 FP/93810-3K000 N94 C15
KM8JN12D76U	12/27/05	16183	40.56		CUST STATES ECS LIGHT COMES ON WHILE DRIVING	FOUND CODE C1513 BRAKE LAMP SWITCH FOUND BRAKE LIGHT SWITCH OPEN CIRCUIT	INSTALL NEW BRAKE LIGHT SWITCH TO CORRECT
KM8JN12D66U	8/18/05	21439	40.56		CUST STATES ECS LIGHT COMES ON WHILE DRIVING	FOUND CODE C1513 BRAKE LAMP SWITCH OPEN	REMOVED AND REPLACED BRAKE LAMP SWITCH TO CORRECT
KM8JM12B26U	7/11/05	19569	40.56				
KM8JN12D15U	9/14/04	5016	38.4				
KM8JM12B45U	3/17/05	24787	58.76		FOUND THE ESP LIGHT WAS ON (NOT SRS) ON - VERIFY AND REPORT	CHECKED AND VERIFIED CONCERN FOUND CODE=C1513 FOUND THE BRAKE SWITCH CAUSING CONCERN SWITCH SHORTED	REPLACED BRAKE LIGHT SWITCH FP=HY93810-38110 OP=93810R00=.3 RPO=.3 NC=N94 CC=C15
KM8JM12B55U	6/03/05	20126	33.96	C/S BRAKE LIGHTS ARE NOT WORKING CHECK AND VERIFY CONCERN FOUND SWITCH SHORTED REPLACED BRAKE LIGHT SWITCH RETEST	CUSTOMER STATES THE BRAKE LIGHTS ARE NOT WORKING (INTERMITTENT CONCERN)--VERIFY AND REPORT	CHECKED AND VERIFIED CONCERN FOUND THE BRAKE SWITCH CAUSING CONCERN SWITCH SHORTED	REPLACED THE BRAKE LIGHT SWITCH FP=HY93810-3K000 OP=93810R00=.3 NC=N94 CC=C15
KM8JN72D75U	11/05/04	6273	32.7				
KM8JM12B55U	11/23/04	111	38.07				
KM8JN12D85U	12/15/04	6385	38.4				
KM8JN12D15U	7/07/05	20143	40.56		CUST STATES WHEN DOING ABOUT 20-40MPH AND APPLYING HALF THROTTLE, THE VEHICLE BOGS REALLY BAD AND WONT ACCEL	SCANNED FOR CODES, FOUND DEFECTIVE THROTTLE POSITION SWITCH	REMOVED AND REPLACED TO CORRECT
KM8JM12B95U	6/01/05	27226	33.96	C/S THE ESC LIGHT KEEPS COMING ON CHECK AND VERIFY CONCERN SCAN FOR CODES C1513 REPLACED FAULTY BRAKE LAMP SWITCH RETEST ROAD	CUSTOMER STATES THE ESC LIGHT KEEPS COMING ON--VERIFY AND REPORT	TECH SCAN FOR CODES: C1513 BRAKE LAMP SWITCH IS FAULTY	TECH REPLACED THE BRAKE LAMP SWITCH FP93810-3K000 OP93810R00 .3HRS N94 C15

KM8JM72B66U	11/04/05	46371	33.64	SCAN CODE C1513			
KM8JN72DX5U	6/17/05	16642	32.6		CUSTOMER STATES INSTALL SOP STOP LAMP SWITCH - CAUSE THE ESPLIGHT IS ON	LO/93810R00	FP/93810-3K000 N94----C15
KM8JN12D15U	7/07/05	20143	40.56		CUST STATES ESP OFF LIGHT COMES ON BY ITSELF	FOUND ESP LIGHT CHECK FOR CODES.	REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT
KM8JN12D16U	11/18/05	19079	40.56		CUSTOMER STATES THE ESC LIGHT IS ON CHECK AND ADVISE	FOUND CODE C1513 BRAKE LAMP SWITCH FAILED	REPLACED BRAKE LIGHT SWITCH TO CORRECT
KM8JN12D05U	5/20/05	30688	40.24		CUSTOMER STATES SPECIAL ORDERED PART ESP LIGHT COMES ON INTERMITTANTLY	CODE C1513	REPLACED SWITCH E
KM8JN12D76U	9/23/05	19833	40.56		CUST STATES AT 30-35MPH STEERING WHEEL SHAKES	FOUND ROTORS OUT OF ROUND	RESURFACED FRONT ROTORS TO CORRECT
KM8JN12D56U	10/04/05	12313	33.64	C/S THE ESC LIGHT IS ON CHECK AND VEIRFY CONCERN DIAG SCAN TEST FOR CODES FOUND CODES C1237 C1513 BRAKE LAMP SWITCH ELECTRICAL MALFUNCTION CHECK WIRING HARNESS AND BRAKE PRESSURE SENSOR REPLACED THE BARKE LAMP SWITCH RETEST ROAD	CUSTOMER STATES THE ESC LIGHT IS ON..VERIFY AND REPORT COMES BACK ON WHILE DRIVING	CHECKED AND VERIFIED CONCERN SCANNED FOR CODES FOUND CODES FOUND CODES=C1237.C1513 FOUND THE BRAKE LAMP SWITCH ELECTRICAL MALFUNCTION CHECKED THE WIRING HARNESS AND BRAKE PRESSURE SENSOR OK	REPLACED THE BRAKE LAMP SWITCH FP=HY93810-3K000 OP=93810R00=.3 NC=N69 CC=C15
KM8JN72D16U	10/20/05	16780	33.64		CUSTOMER SAYS ESU LIGHT COMES ON EVERY DAY	REPLACED BRAKE LIGHT SWITCH	LO/93810R00 FP/93810-3K000 N94 C15
KM8JN12D76U	9/23/05	19833	40.56		CUST STATES ESC OFF LIGHT STAYS ON	FOUND BRAKE LIGHT SWITCH INTERNALLY FAILED	REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT
KM8JN72D25U	5/20/05	15946	40.56	REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT	CUST STATES ESP LIGHT WILL STAY ON AT TIMES	FOUND FAILED BRAKE LIGHT SWITCH	REMOVED AND REPLACED BRAKE LIGHT SWITCH TO CORRECT
KM8JM12B96U	9/02/05	25201	40.24		CUST STATES ESC LIGHT IS ON	FOUND FAIED BRAKE LIGHT SWITCH	REPLACED SWITCH TO CORRECT
KM8JN72D66U	11/26/05	11370	33.96	C/S THE ESC LIGHT KEEPS GOING ON AND OFF CHECK AND VERIFY CONCERN SCAN TEST FOR CODES C1513 REPLACED BRAKE LAMP SWITCH RETEST ROAD	CUSTOMER STATES THE ESC LIGHT KEEPS GOING ON AND OFF-VERIFY AND REPORT	SCAN TESTED AND FOUND CODE C1513 REPLACED BRAKE LAMP SWITCH AND CLEARED CODE	LO/93810R00 FP/93810-3K000 N94 C15
KM8JN72D35U	5/19/05	16836	33.96	CUSTOMER STATES THE TRACTION CONTROL LIGHT STAYS ON CHECK AND VERIFY CONCERN SCAN FOR CODES C1513 FAULTY BRAKE SWITCH REPLACED BRAKE SWITCH	CHECK THE TRACTION CONTROL LIGHT STAYS ON AFTER DRIVING A WHILE	FOUND CODE C1513--- REPLACED BRAKE SWITCH AND CLEAR CODE	LO/93810R00 FP/93810-3K000 N94 C15
KM8JN72D06U	12/03/05	15753	31.84	15753 CODE B1315 SCANNED FOR CODES AND FOUND B1315. REPLACED STOP LAMP SWITCH AND CLEARED THE CODE. ALL OK			
KM8JM12B16U	8/29/05	29699	36.36		CUST STATES BRAKE LIGHTS DON'T WORK, SHE WAS TOLD THAT SHE NEEDS A BRAKE LIGHT SWITCH		REPLACE BRAKE LAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JM12B95U	5/13/05	25738	63.06	CUST COMPALINS OF STEERING WHEEL LOCKING UP AT TIMES AND CAN'T GET KEY OUT. CHECK IGNITION SWITCH & LOCK, CHECK PARK NUETRAL SWITCH, FOUND BRAKE LAMP SWITCH SHORTED OUT AND NOT RELEASING,REPL BRAKE LAMP SWITCH			
KM8JN72D96U	12/16/05	69	36.04		CHECK FOR NO HORN REPLACE CLOCK SPRING		SPRING ASSY-CLOCK (WITH AIR BAG) SPRING ASSY-CLOCK (WITH AIR BAG)
KM8JN72D95U	5/20/05	19781	32.16	19781 POOR CONTACT TSB #06-50-006 SCANNED FOR CODES AND FOUND B1513. REPLACED THE STOP LAMP SWITCH AS PER TSB #06-50-006			
KM8JN72D95U	5/20/05	19511	22.5	19511 CODE B1513 ADJUST STOP LAMP SWITCH			
KM8JN72D26U	9/16/05	21545	31.84	21545 POOR CONTACT TECH REPLACED THE BRAKE LAMP SWITCH FOR CODE C1513. CLEARED CODE AND RECHECKED ALL OK			
KM8JN72D16U	10/21/05	11434	32.16	11434 POOR CONTACT CODE C1513/TSB # 06-50-006 TECH REPLACED THE STOP LAMP SWITCH FOR CODE C1513. CLEARED CODE AND RECHECKED ALL OK			
KM8JN72D96U	12/16/05	69	36.04		CHECK FOR NO BRAKE LIGHTS		REPLACE STOP LAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JN72D45U	5/19/05	36409	36.04		CUSTOMER STATES BRAKE LIGHTS NOT WORKING AT TIMES		REPLACE STOP LAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JM12B66U	9/05/05	31216	36.36		CUSTOMER STATES ECS LIGHTS KEEP COMING ON		REPLACE BRAKE LAMP SWITCH SWITCH ASSY-STOP LAMP RE
KM8JM12B66U	7/12/05	25157	34.69				
KM8JN72D05U	5/14/05	10133	32.3	10133 INTERNAL FAILURE TECH REPLACED THE BRAKE LAMP SWITCH FOR INTERNAL FAILURE AND RECHECKED ALL OK AT THIS TIME	C/S"THE ESP OFF LIGHT WAS ON NOW OFF/SOP PRESSURE SENSOR"	INTERNAL FAILURE CODE C1237	SENSOR-PRESSURE SENSOR-PRESSURE 10133 INTERNAL FAILURE ' TECH REPLACED THEPRESSURE SWITCH FOR INTERNAL FAILURE. CLEAREDCODE AND RECHECKED ALL OK AT THIS TIME
KM8JN72D05U	5/14/05	10133	32.3	10133 INTERNAL FAILURE TECH REPLACED THE BRAKE LAMP SWITCH FOR INTERNAL FAILURE AND RECHECKED ALL OK AT THIS TIME	C/S"THE BRAKE LIGHTS ARE INOP AT TIMES/SOP BRAKE SWITCH"	INTERNAL FAILURE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 10133 INTERNAL FAILURE TECH REPLACED THEBRAKE LAMP SWITCH FOR INTERNAL FAILURE ANDRECHECKED ALL OK AT THIS TIME
KM8JM12B16U	1/06/06	24811	36.04		CUSTOMER STATES ESC OFF LIGHT STAYS ON	SCANNED FOR FAULT CODES- B1913 STOP LT SWITCH	REPLACED THE STOP LIGHT SWITCH AND CLEARED FAULT CODES
KM8JN12D26U	7/12/05	13607	36.04		CUSTOMER STATES ESC LIGHT COMES ON INTERMITTANTLY	CODE C1513 BRAKE SWITCH FAILURE	REPLACED BRAKE PEDAL SWITCH ASSEMBLY

KM8JN72D75U	6/10/05	46596	32.16	46596 TSB #06-50-006 TECH REPLACED BRAKE LAMP SWITCH FOR CODEC1513 AS PER TSB #06-50-006. CLEARED THE CODE AND RECHECKED, ALL OK			
KM8JN72D75U	6/10/05	46596	22.5	46596 TSB #06-50-006 SCANNED FOR CODES AND FOUND C1513, ADJUSTED THE BRAKE LAMP SWITCH AS PER TSB #06-50-006			
KM8JN72D05U	5/14/05	21942	32.16	21942 POOR CONTACT TECH REPLACED STOPLAMP SWITCH DUE TO ESP LIGHT COMING ON			
KM8JM12BX6U	8/23/05	13044	32				
KM8JN12D96U	7/12/05	14193	205.65	ESC LIGHT COMES ON/OFF WHEN MAKING TURNS AND DRIVING STRAIGHT, CODES C1611 LOST COMM WITH ECM, C1612 LOST COMM W/TCM, C1235 PRIMARY PRESSURE SENSOR, C1282 YAW RATE G-SENSOR, C1259 STEERING ANGLE SENSOR, C1513 BRAKE SWITCH CKT , FOUND SWITCH OPEN	CUSTOMER STATES THE VEHICLE IS PULLING TO THE LEFT WHEN THE BRAKES ARE APPLIED	TECHNICIAN INSPECTED BRAKING SYSTEM AND FOUND NOTHING NEEDING ATTENTION. ROAD TESTED AND UNABLE TO DUPLICATE ANY PULLING TO THE LEFT	TECHNICIAN FOUND NOTHING NEEDING ATTENTION WITH THE BRAKING SYSTEM, ROAD TESTED AND UNABLE TO DUPLICATE
KM8JN12D96U	7/12/05	14193	205.65	ESC LIGHT COMES ON/OFF WHEN MAKING TURNS AND DRIVING STRAIGHT, CODES C1611 LOST COMM WITH ECM, C1612 LOST COMM W/TCM, C1235 PRIMARY PRESSURE SENSOR, C1282 YAW RATE G-SENSOR, C1259 STEERING ANGLE SENSOR, C1513 BRAKE SWITCH CKT , FOUND SWITCH OPEN	CUSTOMER STATES THE VEHICLE IS PULLING TO THE RIGHT ON ACCELERATION AND WHILE DRIVING STRAIGHT DOWN THE ROAD	TECHNICIAN ROAD TESTED VEHICLE AND FOUND THE VEHICLE ALIGNMENT IN. TORQUE STEER ON MODERATE ACCELERATION NORMAL CHARACTERISTIC OF FRONT WHEEL DRIVE. NO PULLING ON STRAIGHT ROADS.	TECHNICIAN ROAD TESTED AND FOUND ALIGNMENT IN SPECS NO PULLING FOUND.
KM8JN72D56U	10/12/05	21626	32				
KM8JN72D66U	9/28/05	14427	32				
KM8JN12D86U	7/30/05	18661	32.16				
KM8JN72D66U	7/30/05	9138	30.19		CERTAIN 2005-2007 TUCSONS MAY HAVE BEEN BUILT WITH DRIVER SIDE AIR BAG COVERS THAT REQUIRE REPLACEMENT.	DEALERS WILL INSPECT THE AIR BAG COVER, AND IF NECESSARY, INSTALL A NEW DESIGN COVER #56960-2E000-++QQH	REPLACE DRIVER AIR BAG MODULE COVER - OP CODE - 61B046R0 0.2 M/H
KM8JN12D96U	7/12/05	14193	205.65	ESC LIGHT COMES ON/OFF WHEN MAKING TURNS AND DRIVING STRAIGHT, CODES C1611 LOST COMM WITH ECM, C1612 LOST COMM W/TCM, C1235 PRIMARY PRESSURE SENSOR, C1282 YAW RATE G-SENSOR, C1259 STEERING ANGLE SENSOR, C1513 BRAKE SWITCH CKT , FOUND SWITCH OPEN	CUSTOMER STATES THE DRIVER'S WIPER IS NOT CLEANING WELL CK AND ADVISE	FOUND THE WIPER REFILL CURVED AND NOT CLEANING WELL GOODWILL PER SERVICE MGR	TECHNICIAN REPLACED THE WIPER REFILL AND VERIFIED OPERATIONS
KM8JN12D96U	7/12/05	14193	205.65	ESC LIGHT COMES ON/OFF WHEN MAKING TURNS AND DRIVING STRAIGHT, CODES C1611 LOST COMM WITH ECM, C1612 LOST COMM W/TCM, C1235 PRIMARY PRESSURE SENSOR, C1282 YAW RATE G-SENSOR, C1259 STEERING ANGLE SENSOR, C1513 BRAKE SWITCH CKT , FOUND SWITCH OPEN	CUSTOMER STATES THE ESC LIGHT COMES ON/OFF WHEN MAKING TURNS WHEN DRIVING STRAIGHT	TECHNICIAN SCANNED FOR FAULT CODES- C1611 LOST COMM WITH ECM-1612 LOST COMM W/TCM, C1235 PRIMARY PRESSURE SENSOR, C1282 YAW RATE G-SENSOR, C1259 STEERING ANGLE SENSOR, C1513 BRAKE SWITCH CKT. MONITORED DATA LIST- FOUND SWITCH OPEN	TECHNICIAN REPLACED THE BRAKE LIGHT SWITCH AND CLEARED FAULT CODES. TECHNICIAN ROAD TESTED MULTIPLE DRIVE CYCLES TO VERIFY REPAIRS SERVICE MGR ROAD TESTED VEHICLE OVERNIGHT AND FOUND THE VEHICLE OPERATING AS DESIGNED.
KM8JM12B86U	3/31/06	17230	78.34	ADDITIONAL TIME REQUIRED TO PERFORM IDS SYSTEM PINPOINT TESTS AS OUTLINED IN THE SHOP MANUAL. NO LABOR TIME LISTED			
KM8JM12B75U	4/29/05	34663	30.51		079 LEFT AIR BAG RECALL	CHECKED AS PER RECALL	NECESSARY TO REPLACE COVER
KM8JM12B75U	4/29/05	34663	30.51		ESC LIGHT CAME ON	CHECKED AND FOUND OPEN IN BRAKE SWITCH	NECESSARY TO REPLACE BRAKE SWITCH
KM8JM12B55U	6/08/05	37104	36.65		CUSTOMER STATES ESP OFF LIGHT COMES ON AT TIMES WHEN STARTINOR WHEN DRIVING AT TIMES	CODE 1513 BRAKEW LAMP SWITCH FAULT	REPLACED BRAKE LAMP SWITCH
KM8JN12D65U	6/23/05	33150	36.36		REAR BRAKE LIGHTS INOP	BRAKE SWITCH FAILED	REPLACED BRAKE LAMP SWITCH
KM8JM12B45U	5/24/05	15051	112.7	ESP LIGHT STAYS ON, CODE C1513, CALLED TECH LINE CASE #228915, REPL BRAKE LIGHT SWITCH, CHECKED VOLTAGE AT PINS 16-47, CHECKED EMOS	CUSTOMER STATES ESP LIGHT STAYS ON SOP IN BRAKE SWITCH	CODE C1513 CALLED TECH LINE CASE# 228915	REPLACED BRAKE LIGHT SWITCH, CHECKED VOLTAGE AT PINS16-47 CHECKED EMOS
KM8JM12B27U	11/01/06	1661	30.51		CUSTOMER STATES ESC LIGHT STAYS ON	CHECKED AND FOUND STOP LAMP SWITCH FAILURE	NECESSARY TO REPLACE STOP LAMP SWITCH 93810R00.3/N69-C15
KM8JN12D76U	7/19/05	15492	30.45		CUSTOMER STATES ESP LIGHT STAYS ON.PART WAS ORDERED	CHECKED AND FOUND CODE C1513 RAN DIAG. TEST FOUND BRAKE SWITCH INTERNAL OPEN	NECESSARY TO REPLACE SWITCH AND RETEST 93810R00.3
KM8JN12D06U	11/10/05	6907	35.6	REPLACED BRAKE LAMP SWITCH. 93810R00.3 N94 C15			
KM8JN12D75U	9/14/04	31831	34.65		CUSTOMER STATES THE ESP OFF LIGHT IS COMING ON	TECHNICIAN SCANNED FOR FAULT CODES- C1513 BRAKE SWITCH CIRCUIT, C1260 STEERING ANGLE SENSOR SIGNAL. TRACED TO BRAKE SWITCH OPEN AND STEERING	TECHNICIAN REPLACED THE BRAKE SWITCH AND STEERING ANGLE SENSOR AND CLEARED FAULT CODES- ROAD TESTED TO VERIFY REPAIRS
KM8JN12D75U	9/14/04	31831	34.65		CUSTOMER STATES THE POWER STEERING NOISEY	TECHNICIAN VERIFIED STEERING PUMP MAKING EXCESSIVE NOISE, FROM PUMP ASSEMBLY	TECHNICIAN FLUSHED THE POWER STEERING FLUID WITH HYUNDAI P4 NOISE STILL PRESENT, REPLACED THE POWER STEERING PUMP AND VERIFIED NOISES WERE
KM8JM12B15U	5/20/05	13764	36.36				
KM8JN12D75U	4/06/05	11108	35.6	REPLACED STIP LAMP SWITCH. 93810R00.3 N94 C15	C/S RIGHT TAIL LIGHT IS OUT ALL OF THE TIME AND THE LEFT TAIL LIGHT ISOUT INTERMITTANT.	BULBS OK. WIRES TO TAILLAMP SOCKET BROKEN IN CONNECTORS.	WIRE REPAIR TIME (MAJOR) WIRE REPAIR TIME (MAJOR) REPAIRED WIRING. PINTWIST CONNECTORS.91001A00.9 N66 C15

KM8JN12D75U	4/06/05	11108	35.6	REPLACED STIP LAMP SWITCH. 93810R00 .3 N94 C15	C/S ESP LIGHT WILL ALWAYS STATE THAT IT IS OFF INTERMITTANT.	CODE C1513. BRAKE LAMP SWITCH SHORTED.	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED STIP LAMP SWITCH. 93810R00 .3 N94C15
KM8JN12D75U	4/06/05	11108	35.6	REPLACED STIP LAMP SWITCH. 93810R00 .3 N94 C15	C/S WHEN ACCELERATING FROM A STOP THE TRANSMISSION SEEMS TO HANG IN GEAR/ DOESNT SEEM LIKE IT WANTS		RELATED TO LINE A RELATED TO LINE A
KM8JN12D96U	10/25/05	12855	34.69		CUSTOMER STATES THE CD'S ARE NOT ADVANCING TO THE NEXT SONGSHAPENS WITH ALL CD'S	TECHNICIAN PLAYED PERSONAL CD AND CUSTOMERS CD AND WAS UNABLE TO DUPLICATE. PLAYING/OPERATING AS DESIGNED	NO REPAIRS MADE, FOUND TO BE OPERATING AS DESIGNED
KM8JN12D96U	10/25/05	12855	34.69		CUSTOMER STATES THE ESC LT COMES ON INTERMITTENTLY	TECHNICIAN SCANNED FOR FAULT CODES- C1513 BRAKE LIGHT SWITCH	TECHNICIAN REPLACED THE BRAKE LIGHT SWITCH AND CLEARED FAULT CODES
KM8JM12B77U	11/13/06	1015	36.36		CUSTOMER STATES ESC OFF LIGHT COMES ON WHEN DRIVING	CODE B1513	REPLACED BRAKE SWITCH ASSEMBLY
KM8JM12B76U	10/10/05	17545	33.64	REPLACED BRAKE SWITCH. 93810R00 .3 N94 C15	C/S THAT THE BRAKE LIGHTS DONT WORK.	CODE C1513. BRAKE SWITCH SHORTED.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACED BRAKE SWITCH. 93810R00 .3 N94 C15
KM8JN12D06U	7/19/05	26420	37.41		CUST STATE SSTHAT ESC LITE COMES ON	HAD CODE C1513 BRAKE LAMP SWITCH . LOW VOLTAGE CAUSING THE CODE . 02V	REPLACE BRAKE LITE SWITCH . 93810R00 .3 N69 C15
KM8JM12B75U	5/09/05	31382	37.41		CUST STATES THAT ESP LITE ON	HAD CODE C1513 BRAKE SWITCH SWITCH NOT RESPONDING TO THE PCM CAUSING THE ESP LIGHT .	REPLACE BRAKE SWITCH AND CLEAR CODE . 93810R00 .3 N69 C15
KM8JN12D96U	8/09/05	31669	36.04		CUSTOMER STATES THE CD PLAYER IS NOT ACCEPTING OR EJECTING DISCS	INTERNAL AUDIO MALFUNCTION	ORDERED AUDIO UNIT
KM8JN12D96U	8/09/05	31669	36.04		CUSTOMER STATES THE ESC OFF LIGHT COMES ON AT TIMES	TECHNICIAN SCANNED FOR FAULT CODES- C1513 STOP LIGHT SWITCH - TRACED TO SWITCH	TECHNICIAN REPLACED THE STOP LIGHT SWITCH AND CLEARED FAULT CODES.
KM8JM12BX5U	6/16/05	29742	34.69		CUSTOMER STATES THE ESC OFF LIGHT IS STAYING ON	TECHNICIAN SCANNED FOR FAULT CODES- BRAKE LIGHT SWITCH TRACED TO SWITCH	TECHNICIAN REPLACED THE BRAKE LIGHT SWITCH AND CLEARED FAULT CODE
KM8JM12BX7U	10/28/06	8939	37.41		CUST STATES THAT ESC LITE ON AND NO BRAKE LITES	HAD CODE C1513 BRAKE SWITCH NO VOLTAGE CAUSING THE ESC LIGHT .	REPLACE BRAKE SWITCH AND CLEAR CODE . 93810R00 .3 N69 C15
KM8JN12D05U	6/11/05	7728	34.26		CUST. STATES ESP LIGHT HAS COME ON AND OFF A COUPLE OF TIMES	HAD CODE C1513 BRAKE LAMP SWITCH ,INTERNAL FAILURE	REPLACE BRAKE SWITCH .93810R00 .3 N94 C06
KM8JN12D26U	12/08/05	31096	37.41	REPLACE BRAKE SWITCH AND CLEAR CODE 93810R00 .3 N69 C15	HAS HESITATION AND STALLS OUT AT TIMES	HAD CODE P0123 TPS HIGH INPUT TPS NOT RESPONDING TO THE PCM CAUSING THE CODE .	REPLACE TPS AND CLEAR CODE . 35102R00 .3 35102RP0 .3 N69 C15
KM8JN12D76U	8/10/05	5702	34.69		CUSTOMER STATES THE ESC OFF LIGHT IS STAYING ON	TECHNICIAN TRACED TO INTERMITTENTLY OPEN STOP LIGHT SWITCH	TECHNICIAN REPLACED THE STOP LIGHT SWITCH ASSEMBLY
KM8JN12D56U	11/18/05	14730	34.69		CUSTOMER STATES THE ESC OFF LIGHT COMES ON/OFF AT TIMES	TECHNICIAN SCANNED FOR FAULT CODES- C1513 BK LAMP SWITCH TRACED TO SWITCH	TECHNICIAN REPLACED THE BRAKE LIGHT SWITCH AND CLEARED FAULT CODE
KM8JN12D36U	7/20/05	22925	36.04		CUSTOMER STATES ESC LIGHT COMES ON & STAYS ON INTERMITTANTLY	BRAKE SWITCH FAILING	REPLACED BRAKE LAMP SWITCH
KM8JN12D26U	12/08/05	31096	37.41	REPLACE BRAKE SWITCH AND CLEAR CODE 93810R00 .3 N69 C15	ESC LIGHT ON	HAD CODE C1513 BRAKE SWITCH MAL. LOW VOLTAGE CAUSING THE CODE .	REPLACE BRAKE SWITCH AND CLEAR CODE 93810R00 .3 N69 C15
KM8JN12D46U	2/24/06	17717	37.41	REPLACE BRAKE SWITCH AND CLEAR CODE .93810R00 .3 N69 C15	CUST STATES THAT ESC LITE ON	HAD CODE C1513 BRAKE LAMP SWITCH LOW VOLTAGE CAUSING THE CODE .	REPLACE BRAKE SWITCH AND CLEAR CODE .93810R00 .3 N69 C15
KM8JN12D95U	6/02/05	32487	34.54		ESP LIGHT ON	HAD CODE C1513 BRAKE SWITCH BRAKE SWITCH INTERNAL FAILURE . CAUSING THE ESP LIGHT.	REPLACE BRAKE SWITCH . AND CLEAR ESP LIGHT . 93810R00 .3 N69 C15
KM8JN12D96U	8/09/05	33920	36.04		CUSTOMER STATES THE ECS LIGHT COMES ON/OFF AT TIMES	TECHNICIAN SCANNED FOR FAULT CODES- STOP LIGHT SW TRACED TO STOP LIGHT SWITCH	TECHNICIAN REPLACED THE STOP LIGHT SWITCH AND CLEARED FAULT CODES,
KM8JN72D76U	11/30/05	19357	37.84		CHECK CUSTOMER STATES ESC LIGHT COMES ON INTERMITTANTLY	CHECKED WITH SCAN TOOL AND PULLED CODE C1513 CHECKEDAND FOUND BRAKE LIGHT SWITCH FAILED	REPLACED BRAKE LIGHT SWITCH
KM8JN72D66U	7/19/05	27796	38.16		CUST STATES THE ECS LIGHT IS ON AT TIMES CK/REPORT	PERFORMED SCAN TOOL TEST AND BRAKE SWITCH SHORTED C1513	REPLACED BRAKE SWITCH AND CLEARED CODE TESTED OK
KM8JN12D26U	12/14/05	21014	37.41		CUST STATES THAT ESC LITE COMES ON	HAD CODE C1513 BRAKE SWITCH . LOW VOLTAGE . 2V CAUSING THE CODE .	REPLACE SWITCH AND CLEAR CODE . 93810R00 .3 N69 C15
KM8JN12D75U	5/24/05	16328	26.14		ESP LIGHT GOES ON AND OFF	HAD CODE C1513 BRAKE LAMP SWITCH . SWITCH LOW VOLTAGE .2V CAUSING A POOR SIGNAL FROM THE SWITCH.	REPLACE BRAKE LAMP SWITCH . AND CLEAR CODE . 93810R00 .2 N69C15
KM8JN12D65U	5/24/05	23123	34.54		CUST STATES THAT VEHICLE STALLS AT TIMES AND TAKE FOOT OFF PEDAL AND RPMS RAISE UP HIGH AND DOWN SHIFTS	HAD CODES P0123 THROTTLE POSITION SENSOR MAL AND C1513 BRAKE SWITCH . BOTH BRAKE SWITCH AND TPS NO RESPONSE TO PCM CAUSING THE CODES .	REPLACE TPS AND BRAKE SWITCH AND CLEAR CODES . 35102R00 .3 35102RP0 .3 93810R00 .3 N69 C15 .
KM8JN72D25U	4/15/05	53046	37.84		C/A ESP LIGHT COMES ON WHILE DRIVING	SCAN TESTED CODE C1513	REPLACED BRAKE SWITCH AND CLEARED CODE
KM8JN72D36U	10/15/05	37353	37.84		CHECK CUSTOMER STATES ESC OFF LIGHT COMES ON INTERMITTANTLY	CHECKED AND FOUND BRAKE LIGHT SWITCH FAILED	REPLACED BRAKE LIGHT SWITCH
KM8JN72D66U	8/17/05	33471	37.84		C/S BRAKE LIGHTS OUT	BRAKE LAMP SWITCH FAILURE	REPLACED BRAKE LAMP SWITCH
KM8JN72D56U	7/18/05	15229	38.16		C/S ESC LIGHT COMES ON WHILE DRIVING	SCAN TESTED CODE C1513	REPLACED STOP LAMP SWITCH AND CLEARED CODE
KM8JN72D46U	12/15/05	21476	33.94				
KM8JN12D86U	10/09/05	28149	33.94		CUSTOMER STATES ESC LIGHT COMES ON	FOUND C1513 BRAKE LAMP SWITCH CHECKED SWITCHED FOR RESISTANCESPEC WAS OUT OF SPECS	REPLACED SWITCH..CLEARED CODE..93810R00 .3 N/68 C/15
KM8JN12D55U	5/20/05	22343	35.59		ESP LITE COMES ON AND ENG TRIES TO STALL AT LITES SOMETIMES LITE FLASHES	USED SCAN TOOL FOUND C1513 BRK LAMP SWITCH	R/R BRK LAMP SWITCH DONE

KM8JM12B26U	7/22/05	28269	38.16		CUSTOMER STATES ESC LIGHT IS ON DASH	FOUND CODE C1513 BRAKE LIGHT SWITCH	REMOVED & REPLACED BRAKE LIGHT SWITCH BRAKES LIGHT WORK & ESC LIGHT IS OFF
KM8JM12B56U	5/04/06	9345	37.84		CHECK CUSTOMER STATES ESC LIGHT IS ON	CHECKED WITH SCAN TOOL AND PULLED CODEU513 CHECKED AND FOUND BRAKE LIGHT SWITCH FAILED	REPLACED BRAKE LIGHT SWITCH
KM8JN72D66U	7/23/05	30455	38.16	REPLACED BRAKE LIGHT SWITCH	CHECK CUSTOMER STATES ESC LIGHT COMES	CHECKED WITH SCAN TOOL AND PULLED CODE C1513 CHECKED AND FOUND BRAKELIGHT SWITCH FAILED	REPLACED BRAKE LIGHT SWITCH
KM8JN12D55U	5/20/05	22343	35.59		SEE LINE ONE	USED SCAN TOOL	CLEARED CODES DONE
KM8JN12D35U	5/10/05	41171	35.59		C/S ESC LITE ON/OFF	FOUND BAD BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN12D35U	5/10/05	41171	35.59		C/S SES LITE ON-OFF NOW	CODE P0130	REPLACED B1S1 O2 SENSOR
KM8JN12D26U	11/18/05	14122	35.59		C/S ESC OFF LITE ON	FOUND BAD BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN72D56U	10/15/05	12807	38.16	REMOVED & REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT CAME ON DASH	FOUND BRAKE LIGHT SWITCH INOP FOUND CODE C1513	REMOVED & REPLACED BRAKE LIGHT SWITCH
KM8JN72D76U	11/03/05	15030	38.16				
KM8JM12B55U	4/26/05	21160	37.84				
KM8JN12D55U	3/21/05	759	34.2				
KM8JN12D85U	5/25/05	23445	35.91	REPLACED BRAKE SWITCH	C/S ESC LITE ON-OFF	FOUND BRAKE SWITCH SHORTED	REPLACED BRAKE SWITCH
KM8JM12B46U	11/29/05	21056	35.91		C/S ESC LITE COMES ON	FOUND BRAKE SWITCH SHORTED	REPLACED BRAKE SWITCH
KM8JM12B17U	11/03/06	2539	38.16	REPLACED SWITCH CLEARED CODE	CUSTOMER STATES ESC LIGHT IS ON	FOUND BRAKE LIGHT SWITCH MALF	REPLACED SWITCH CLEARED CODE
KM8JN72D06U	7/19/05	30202	37.84		CHECK CUSTOMER STATES ESC LIGHT INTERMITTANTLY COMES ON WHEN DRIVING	CHECKED WITH SCAN TOOL AND PULLED CODE C1513 CHECKED AND FOUND BRAKE LIGHT SWITCH FAILED	REPLACED BRAKE LIGHT SWITCH
KM8JN72D76U	10/18/05	25676	38.16		CUST STATES THE ESC LIGHT IS ON AT TIMES	PERFORMED SCAN TOOL TEST AND FOUND CODE C1513	INTERNAL FAILURE IN BRAKE SWITCH REPLACED BRAKE LIGHT SWITCH
KM8JN12D46U	11/09/05	16413	35.91		C/S ESC LITE COMING ON	FOUND BRAKE SWITCH SHORTED	REPLACED BRAKE SWITCH
KM8JN12D35U	4/06/05	13843	33.49	OPEN CIRCUIT			
KM8JM12B86U	7/11/05	14914	35.45	OPEN CIRCUIT BRAKE SWITCH			
KM8JN12D06U	10/20/05	26055	33.49	OPEN CIRCUIT IN SWITCH			
KM8JN12D17U	11/22/06	644	38.16		CUST STATES ESC LIGHT IS ON	PERFORMED SCAN TOOL TEST AND FOUND CODE C1513 BRAKE SWITCH OPEN	REPLACED BRAKE SWITCH AND CLEARED CODE TESTED OK AT THIS TIME
KM8JN12D46U	9/06/05	14962	38.16	REPLACED BRAKE LIGHT SWITCH	CHECK CUSTOMER STATES ESC LIGHT COMES ON INTERMITTANTLY	CHECKED WITH SCAN TOOL AND PULLED CODES C1513 C1611 C1612 CHECKED AND FOUND BRAKE LIGHT SWITCH FAILED	REPLACED BRAKE LIGHT SWITCH
KM8JN72D65U	7/02/05	7374	38.16		CHECK CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING	CHECKED AND FOUND CODE C1513	CHECKED AND FOUND BRAKELIGHT SWITCH FAILED REPLACED BRAKE LIGHT SWITCH
KM8JN12D76U	8/11/05	19269	33.49	OPEN CIRCUIT			
KM8JN12DX5U	5/26/05	16799	33.49	OPEN SWITCH			
KM8JN12D56U	10/26/05	18910	33.49	OPEN CIRCUIT IN SWITCH			
KM8JM12B66U	8/31/05	14682	33.49	FAULTY SWITCH			
KM8JN72D26U	7/30/05	13508	38.16		C/S E S C LIGHT ON,CK AND ADVISE	TECH VERIFIED CONCERN,FOUND BRAKE SWITCH,WHEN APPLIED DELAYED IN COMMING ON,NECESSARY TO REPLACE	TECH REMOVED AND REPLACED BRAKE SWITCH
KM8JN12D66U	8/16/05	9536	38.16	REPLACED BRAKE LIGHT SWITCH CLEARED CODE	CUSTOMER STATES WHILE DRIVING ESC LIGHT WILL NOT GO ON OR OFF	FOUND BRAKE LIGHT SWITCH SHORTED C1513	REPLACED BRAKE LIGHT SWITCH CLEARED CODE
KM8JN12D76U	7/29/05	18845	38.16		CUSTOMER STATES CHECK DASH FOR PROPER OPERATION POSSIBLE CHECK ENGINE LIGHT??	FOUND SPARE TIRE ON VEH. CAUSING TPMS LIGHT TO COME ON ALSO FOUND ABS LIGHT ON BRAKE SWITCH MALF/	REPLACED BRAKE SWITCH CLEARED CODE FOR ABS-CUSTOMER DECLINES REPAIRS FOR TIRE REPLACEMENT
KM8JN12D15U	5/23/05	30202	33.49	OPEN CIRCUIT			
KM8JN12D16U	7/22/05	21494	33.49	CODE P1513-OPEN BRAKE			
KM8JN12D75U	5/24/05	25952	33.66				
KM8JN12DX5U	5/13/05	22647	33.34	CHECKED VEHICLE. FOUND BRAKE LIGHTS INOPERATIVE. BRAKE LIGHT SWITCH NEEDS TO BE REPLACED			
KM8JN12D76U	7/29/05	18845	38.16		PERFORM RECALL FOR D/S AIRBAG COVER	RECALL	RECALL COMPLETE REPLACED D/S AIRBAG COVER
KM8JN12D05U	6/03/05	41486	38.16		WHILE PERFORMING SVC TECH,NOTICED THE THE ESC LIGHT ON	PERFORMED SCAN TOOL TEST AND FOUND CODE C1513 FAILURE	REPLACED BRAKE SWITCH CLEARED CODE TESTED OK
KM8JN72D86U	10/08/05	10479	63.34	SCANNED FOR CODES C1513 C1611,DIAG BRAKE LAMP SWITCH	ESC OFF LIGHT AND ANOTHER LIGHT ON DASH CAME ON,LIGHTS ARE OFF NOW,CHECK AND ADVISE	SCANNED FOR CODES,C1513- BRAKE LAMP SWITCH,C1611-CAN TIMEOUT-EMS,TESTED,FOUND SHORT IN BRAKE LAMP SWITCH	REPLACED SWITCH AND CLEARED CODES,OPERATING AS DESIGNED NOW
KM8JN12D06U	10/01/05	25806	33.66				
KM8JN12D66U	10/09/05	23888	30.34	RAN SCAN FOUND CODE B1362. REPLACED STOP LIGHT SWITCH.			
KM8JN12D07U	11/02/06	3585	30.34		CUSTOMER STATES ESC LIGHTS COMES ON AT TIMES AT STOPS	ESC LIGHT MALF.	REPLACED STOP LIGHR SWITCH
KM8JM12B46U	9/14/05	14431	27.66		C/S ESC LIGHT IS ON	BRAKE LAMP SWITCH BROKEN	REPLACED SWITCH
KM8JM12BX5U	6/13/05	11252	36.34		EPS LIGHT ON FOR A WEEK NOT ON AS OF NOW	BRAKE SWITCH-C1513	REPLACE SWITCH
KM8JN12D36U	9/24/05	20384	38.16		CUSTOMER STATES AIR BAG LIGHT STAYS ON.	VERIFIED CUSTOMER COMPLAINT. FOUND CODE B1706 PASSENGER BUCKLE PT RESISTANCE HIGH. PASSENGER AIR BAG SENSOR DISTURBED. CHECK AND REATTACHED CONNECTOR. CLEARED DTC'S.	CHECK AND REATTACHED CONNECTOR. OPERATION GOOD.
KM8JN12D36U	9/24/05	20384	38.16		CUSTOMER STATES ESC LIGHT STAYS ON.	VERIFIED CUSTOMER COMPLAINT. FOUND BRAKE LAMP SWITCH FAULTY.	REPLACED BRAKE LAMP SWITCH PER TSB. RECHECK. OPERATION GOOD.
KM8JN72D65U	5/31/05	46364	35.01	TECH REPLACED BRAKE SWITCH ASSY. AND CONFIRMED REPAIRS 37-5633	CUSTOMER STATES ESP LIGHT COMING ONWHEN DRIVING, SOP BRAKE SWITCH	BRAKE SWITCH ASSY.	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE TECH REPLACED BRAKE SWITCH ASSY. ANDCONFIRMED REPAIRS 37-5633
KM8JN72D65U	5/31/05	50300	26.56	TECH SCANNED FOR DTC' AND FOUND C1237 & C1513. TECH REPLACED BRAKE LAMP SWITCH AND CONFIRMED REPAIRS 37-5633			

KM8JN72D46U	10/21/05	15383	35.01	TECH SCANNED FOR DTC'S AND FOUND BRAKE LAMP SWITCH CODED. TECH REPLACED AND CLEARED CODES WITH H SCANNER REPAIR COMPLETE 37-5633	CUSTOMER STATES ESC & BRAKE LIGHT IS ON. PLEASE INSTALL *SOP* PARTS	BRAKE SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE TECH SCANNED FOR DTC'S AND FOUND BRAKE LAMP SWITCH CODED. TECH REPLACED AND CLEARED CODES WITH H SCANNER REPAIR COMPLETE 37-5633
KM8JN12D36U	9/08/05	25313	81.66	ESC LIGHTS TURN OFF AND ON ITS OWN STATES CUSTOMER. TESTED SYSTEM TRACED TO SHORT IN LAP SWITCH, RRR AND			
KM8JN72D86U	12/05/05	3197	35.6	INSPECTED AND FOUND BRAKE LIGHT SWITCH BAD. RE PLACED BRAKE LIGHT SWITCH, TESTED OPERATION, OK AFTER REPAIR	C/S TCS LIGHT ILLUMINATED. PART ORDERED AT LAST VISIT	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE INSPECTED AND FOUND BRAKE LIGHT SWITCH BAD RE PLACED BRAKE LIGHT SWITCH, TESTED OPERATION, OK AFTER REPAIR
KM8JN72D46U	12/28/05	11583	35.01	TECH FOUND CODED BRAKE SWITCH/ESC LIGHT ON. TECH H REPLACED BRAKE SWITCH AND RECHECK OPERATION AND CLEAR CODE, COMPLETED	079 DAB COVER	RECALL	DRIVERS AIR BAG RECALL DRIVERS AIR BAG RECALL TECH REPLACED DAB COVER PER RECALL, COMPLETED
KM8JN72D46U	12/28/05	11583	35.01	TECH FOUND CODED BRAKE SWITCH/ESC LIGHT ON, TECH H REPLACED BRAKE SWITCH AND RECHECK OPERATION AND CLEAR CODE, COMPLETED	CUSTOMER STATES THE ESC OFF LIGHT IS ON. PLEASE CHECK AND ADVISE	CODED BRAKE SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE TECH FOUND CODED BRAKE SWITCH/ESC LIGHT ON, TECH H REPLACED BRAKE SWITCH AND RECHECK OPERATION AND CLEAR CODE, COMPLETED
KM8JN12D25U	6/09/05	28657	29.74		CUSTOMER STATES VIBRATION WHEN BRAKING	ROTORS WARPED	MACHINED BOTH FRONT ROTORS
KM8JN72D56U	8/25/05	13827	33.96	FOUND BRAKE LIGHT SWITCH INOP. REPLACED SWITCH OK NOW.	C/S BRAKE LIGHTS INOP INTERMITTENTLY	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE FOUND BRAKE LIGHT SWITCH INOP. REPLACED SWITCH OK
KM8JN72D86U	12/05/05	10452	228.36	REPLACED BRAKE LIGHT SWITCH PER RICK R. DUANE AND ROLF DIAG.	PER RICK READINGER HMA FIELD ENGINEER TO LOOK AT VEHICLE. NEED MORE INFO AT WRITE UP	F	STRAIGHT TIME STRAIGHT TIME REPLACED BRAKE LIGHT SWITCH PER RICK R. DUANE AND ROLF DIAG.
KM8JN72D86U	12/05/05	10452	228.36	REPLACED BRAKE LIGHT SWITCH PER RICK R. DUANE AND ROLF DIAG.	PER RICK READINGER HMA FIELD ENGINEER TO LOOK AT VEHICLE. NEED MORE INFO AT WRITE UP	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED BRAKE LIGHT SWITCH PER RICK R. DUANE AND ROLF DIAG.
KM8JN12D25U	6/09/05	28657	29.74		CUST STATES ESC LIGHT GOES ON/OFF	C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN72D45U	12/07/04	15517	29.46		CUST STATES CHECK ENGINE LIGHT CAME ON NOW LIGHT IS OFF	P0173 FUEL TRIM B2, P0170 FUEL TRIM B1, P0130 O2 SENSOR B1/S1, ESP LAMP COMIN ON WHILE DRIVING C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH AND ROAD TESTED
KM8JN72D55U	9/14/04	26658	28.35		CUST STATES CRUISE CONTROL IS INOP-SOP HERE	INTERNAL SHORT IN BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN72D86U	12/05/05	10452	75	RENTAL CAR PER RICK READINGER	RENTAL BILL AUTHORIZED BY RICK R FOR RO 29430	.	PREVENTATIVE MAINTENANCE
KM8JN72D86U	12/05/05	10452	75	RENTAL CAR PER RICK READINGER	RENTAL BILL AUTHORIZED BY RICK R FOR RO 29430	.	SUBLET REPAIRS
KM8JN72D86U	12/05/05	4999	35.6	REPLACED SWITCH OK NOW. ORIGINAL CLAIM WAS DEBITED FOR INCORRECT MILEAGE.			
KM8JN72DX6U	11/16/05	23781	30.06	REPLACE SWITCH			
KM8JN72D57U	9/18/06	23495	43.26	UPON PERFORMING INSPECTION TECH NOTED ON TEST DRIVE THE ABS LIGHT IS ON. TECH CHECKED AND FURTHER DIAGNOSED CONCERN. TECH SCANNED SYSTEM AND FOUND FAULT CODE C1513 FOR FAILURE OF BRAKE LAMP SWITCH. TECH TESTED AND FOUND THE BRAKE LAMP SWITCH TO BE FAULTY			
KM8JM12B66U	1/11/06	13886	31.39		CUSTOMER STATES THE ESC LIGHT COMES ON WHILE DRIVING AND WILL NOT GO OFF WITH SWITCH	P1513 BRAKE LIGHT SWITCH FAILURE	REPLACED BRAKE LIGHT SWITCH CLEARED CODES OK
KM8JM12B45U	7/02/05	9726	100.4	INTERMITTANT FAILURE OF BRAKE LIGHT SWITCH. EXTENSIVE DIAG. REQUIRED TO VERIFY MALFUNCTION. REPLACED BRAKE LIGHT SWITCH. OK NOW.	C/S TCS LIGHT ILLUMINATED. SEE HISTORY	F	STRAIGHT TIME STRAIGHT TIME REPLACED BRAKE LIGHT SWITCH. TEST DROVE OK AFTER REPAIR
KM8JM12B45U	7/02/05	9726	100.4	INTERMITTANT FAILURE OF BRAKE LIGHT SWITCH. EXTENSIVE DIAG. REQUIRED TO VERIFY MALFUNCTION. REPLACED BRAKE LIGHT SWITCH. OK NOW.	C/S TCS LIGHT ILLUMINATED. SEE HISTORY	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED BRAKE LIGHT SWITCH. TEST DROVE OK AFTER REPAIR
KM8JM12B95U	10/29/04	18054	32.25	PERFORMED COMPUTER SCAN DIAGNOSIS, FOUND CODE C 1513. BRAKE LIGHT SWITCH MALFUNCTION. REPLACE D BRAKE LIGHT SWITCH AND TESTED OPERATION, OK AFTER	RECALL 079-DRIVERS AIR BAG MOD COVER	F	RECALL 079 RECALL 079 COMPLETED RECALL 079
KM8JM12B66U	1/11/06	15632	31.39		CUSTOMER STATES THE ESC LIGHT COMES ON WHILE DRIVING WILL NOT GO OFF TILL NEXT KEY CYCLE	SCANTEST CODE P1513 BRAKE LAMP SWITCH FAILURE	REPLACED BRAKE LAMP SWITCH AND CLEARED CODE AND TEST OPERATING TO SPEC
KM8JM12B66U	1/11/06	15632	31.39		CUSTOMER STATES THERE IS A RATTLING NOISE IN ENGINE WHEN IDLING IN GEAR	TEST WITH ANOTHER VEHICLE	OPERATING TO SPEC
KM8JM12B66U	1/14/06	7551	33.35		CUSTOMER STATES ESC LIGHT COMING ON	SCANTEST CODE C1513 BRAKE LIGHT SWITCH FAILURE	REPLACED BRAKE LIGHT SWITCH AND TESTED

KM8JM12B95U	10/29/04	18054	32.25	PERFORMED COMPUTER SCAN DIAGNOSIS, FOUND CODE C 1513. BRAKE LIGHT SWITCH MALFUNCTION. REPLACE D BRAKE LIGHT SWITCH AND TESTED OPERATION, OK AFTER REPAIR	C/S DRIVERS BRAKE LIGHT GOES OUT WHEN BRAKE IS DEPRESSED. HITCH WASINSTALLED AT NON HYUNDAI ESTABLISHMENT. BRAKE LIGHTS ARE NOWINOP TOTALLY.	A	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE PERFORMED COMPUTER SCAN DIAGNOSIS, FOUND CODEC 1513. BRAKE LIGHT SWITCH MALFUNCTION.REPLACE D BRAKE LIGHT SWITCH AND TESTEDOPERATION, OK AFTER REPAIR
KM8JN72D96U	9/16/05	11407	33.96	RAN HI SCAN COMPUTER DIAGNOSIS AND C1315. REPLACED BRAKE LIGHT SWITCH AND TEST DROVE, OK AFTER REPAIR	C/S INTERMITTENTLY ESC OFF LIGHT COMES ON	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE RAN HI SCAN COMPUTER DIAGNOSIS AND C1315.REPLACED BRAKE LIGHT SWITCH AND TEST DROVE,OK AFTER REPAIR
KM8JN12D45U	4/01/05	1919	33.67		CUSTOMER STATES THE CRUISE WILL NOT LOCK ON SPEED BUT LIGHT COMES ON SOP IN	BRAKE LIGHT SWITCH STICKING AND CRUISE SET SWITCH INOPERATIV	REPLACED BRAKE LIGHT SWITCH AND CRUISE SET SWITCH
KM8JN12D75U	12/10/04	21788	50	ABS AND ESP LIGHT ON FOUND BRAKE SWITCH INOP REPLACED FAILED BRAKE SWITCH	ABS AND ESP LIGHTS COME ON.	FOUND BRAKE SWITCH INOP PFP#93810-38110 OPCODE#93810R00 0.3 N94 C15	PERFORMED SCAN TEST, FAULT C1513. PINPOINT TEST AND REPLACEDFAILED BRAKE SWITCH
KM8JN12D75U	12/10/04	21788	50	ABS AND ESP LIGHT ON FOUND BRAKE SWITCH INOP REPLACED FAILED BRAKE SWITCH	CUSTOMER STATES THAT TRANS HAS A HESITATION		ROADTESTED 20 MILES, NO ABNORMAL SHIFTING CONCERNS
KM8JN72D85U	11/04/04	8100	35.92	INSPECTED AND VERIFIED CONCERN. REPLACEDBRAKE LIGHT SWITCH. TESTED OPERATION, OKAFTER REPAIR	C/S CHECK ENGINE LIGHT ILLUMINATED.PART ORDERED ON LAST VISIT	F	OXYGEN SENSOR ASSY LH (UP) RE OXYGEN SENSOR ASSY LH (UP) RE COMPLETED HI-SCAN COMPUTER DIAGNOSIS, FOUNDCOD E P0153, OXYGEN SENSOR B2S1 SLOW TORESPOND. R EPLACED OXYGEN SENSOR. CLEAREDCODES AND TEST
KM8JN72D85U	11/04/04	8100	35.92	INSPECTED AND VERIFIED CONCERN. REPLACEDBRAKE LIGHT SWITCH. TESTED OPERATION, OKAFTER REPAIR	C/S CHECK ENGINE LIGHT ILLUMINATED.PART ORDERED ON LAST VISIT	F	OXYGEN SENSOR ASSY LH ADDSCAN TOOL COMPLETED HI-SCAN COMPUTER DIAGNOSIS, FOUNDCOD E P0153, OXYGEN SENSOR B2S1 SLOW TORESPOND. R EPLACED OXYGEN SENSOR. CLEAREDCODES AND TEST
KM8JN72D85U	11/04/04	8100	35.92	INSPECTED AND VERIFIED CONCERN. REPLACEDBRAKE LIGHT SWITCH. TESTED OPERATION, OKAFTER REPAIR	C/S ESP LIGHT ILLUMINATED. PARTS ORDERED ON PREVIOUS VISIT	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE INSPECTED AND VERIFIED CONCERN. REPLACEDBRAKE LIGHT SWITCH. TESTED OPERATION, OKAFTER REPAIR
KM8JN12D75U	12/10/04	21788	50	ABS AND ESP LIGHT ON FOUND BRAKE SWITCH INOP REPLACED FAILED BRAKE SWITCH	FRONT END SHIMMIES ALL SPEEDS WORSE AT HIGHER SPEEDS		ROADTESTED BY TECH , ADVISOR AND MANAGER, UNABLE TO DUPLICATE AND ABNORMAL VIBRATIONS AT THIS TIME
KM8JN12D75U	12/10/04	21788	50	ABS AND ESP LIGHT ON FOUND BRAKE SWITCH INOP REPLACED FAILED BRAKE SWITCH	ENGINE WOULD CRANK BUT NOT START		UNABLE TO DUPLICATE NO START CONCERN ATTEMPTED SEVERAL TIMES
KM8JN12D75U	12/10/04	21788	50	ABS AND ESP LIGHT ON FOUND BRAKE SWITCH INOP REPLACED FAILED BRAKE SWITCH	RENTAL CAR		
KM8JN12DX6U	10/04/05	13421	33.96	VERIFIED CONCERN, FOUND BRAKE SWITCH INTERMITTN ETLY INOP. REPLACED, RETEST, OPERATING AS DESIG NED AT THIS TIME. CUSTOMER TO MONITOR	C/S THE ESC LIGHT COMES ON AND OFF WHILE DRIVING. WHEN LIGHT COMES ON IF YOU SHUT OFF THE CAR AND RESTARTIT WILL GO OFF.	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE VERIFIED CONCERN, FOUND BRAKE SWITCHINTERMITTN ETLY INOP. REPLACED, RETEST,OPERATING AS DESIG NED AT THIS TIME. CUSTOMERTO MONITOR
KM8JN72D76U	1/16/06	14453	33.64	REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ELECTRONIC STABILITY LIGHT IS ON IN DASH	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED BRAKE LIGHT SWITCH
KM8JM12B96U	7/11/05	22075	37.56	C/S THAT THE ESC LIGHT KEEPS COMING ON FOUND CODE C1513			
KM8JN12D75U	12/10/04	21788	36.78		ABS AND ESP LIGHTS COME ON.	FOUND BRAKE SWITCH INOP PFP#93810-38110 OPCODE#93810R00 0.3 N94 C15	PERFORMED SCAN TEST, FAULT C1513. PINPOINT TEST AND REPLACEDFAILED BRAKE SWITCH
KM8JN12D75U	12/10/04	21788	36.78		CUSTOMER STATES THAT TRANS HAS A HESITATION		ROADTESTED 20 MILES, NO ABNORMAL SHIFTING CONCERNS
KM8JN12D75U	12/10/04	21788	36.78		FRONT END SHIMMIES ALL SPEEDS WORSE AT HIGHER SPEEDS		ROADTESTED BY TECH , ADVISOR AND MANAGER, UNABLE TO DUPLICATE AND ABNORMAL VIBRATIONS AT THIS TIME
KM8JN12D75U	12/10/04	21788	36.78		ENGINE WOULD CRANK BUT NOT START		UNABLE TO DUPLICATE NO START CONCERN ATTEMPTED SEVERAL TIMES
KM8JN12D26U	3/14/06	14839	37.56	C/S THAT THE ESC LIGHT IS ALWAYS OFF TECH FOUND CODE C1513			
KM8JN12D35U	5/20/05	17289	32.74		CUSTOMER STATES THE ECS LIGHT WILL COME ON THEN GO BACK OFF. SHE HAD HER OIL CHANGE COMPLETED AND THE LIGHT HAS NOT COME ON SINCE THE OIL CHANGE DONE.	VERIFIED CONCERN. SCANNED WITH GDS AND FOUND CODE C1513, BRAKE SWITCH CIRCUIT. TESTED AND FOUND THE STOP LAMP SWITCH INTERMITTENTLY GOES TO OPEN CIRCUIT.	REPLACED STOP LAMP SWITCH TO PERFORM REPAIR. CLEARED CODES, RE-TESTED, ALL OPERATING AS DESIGNED AT THIS TIME
KM8JN12D75U	12/10/04	21788	36.78		RENTAL CAR		
KM8JN12D75U	12/10/04	39769	36.43				
KM8JN12D95U	11/29/04	254	38.4				
KM8JM12B37U	7/05/06	23862	33.06		CUSTOMER STATES THE ESC LIGHT CAME ON AFTER SHE HAD TURNED IT OFF. WAS SITTING AT LIGHT AND THE ESC LIGHT WENT OUT WITHOUT THE BUTTON BEING PRESSED.	SCANNED,RETRIEVED 2 TROUBLE CODES C1513 AND C1237. FOR C1513 INSPECTED AND FOUND BRAKE LIGHT SWITCH INTERMITTENTLY STICKING.	REPLACED BRAKE LIGHT SWITCH FOR INTERMITTENT PROBLEM. INSPECTED AND FOUND CONNECTORS,WIRING,CIRCUIT RESISTANCE VOLTAGE ALL OPERATING PROPERLY AT THIS TIME
KM8JM12B06U	5/03/06	3228	21.15				
KM8JN72D46U	8/17/05	33490	30.49				

KM8JN12D25U	1/19/05	4224	34.72		REPLACE THE STOP LAMP SWITCH AS PER TONY HMA		
KM8JN12D36U	10/09/05	22940	37.06		CUSTOMER STATES THAT ESC LIGHT COMES ON AT TIMES , USUALLY WHILE DRIVING IN RAIN	CODE#C1513 FAULTY BRAKE SWITCH PFP#93810-3K000 OP CODE#93810R00 0.3 N94/C15	PERFORMED SCAN TEST, FOUND FAULT CODE#C1513, PINPOINT TEST SHOWED BRAKE ACTIATION WITHOUT PEDAL DEPRESSED, REPLACED SWITCH AND RETESTED
KM8JN12D36U	10/09/05	22940	37.06		ONE FOG LIGHT IS OUT	BULB BURNT OUT PFP#18647-27009 OP CODE#18642R00 0.2 N94 C15	REPLACED LEFT FOG LIGHT BULB
KM8JM12B36U	7/11/05	26878	37.86		AT TIMES ESC OFF LIGHT COMES ON.	FAILED STOP LAMP SWITCH PFP#93810-3K000 OP CODE#93810R00 0.3 N94 C15	SCAN TEST REVEALED FAULT CODE#C1513, TRACED CIRCUITS AND REPLACED FAILED STOP LAMP SWITCH
KM8JN12D25U	1/19/05	4224	34.72		THE ESP SYSTEM IS INOP AT TIMES SOP PART IS IN STOCK	REPLACED THE PRESURE SENSOR	
KM8JN12DX6U	9/15/05	61494	33.66		CUST STATES THAT THE VEH IS SLUGGISH TO START	BATTERY TEST BAD	REPLACED BATTERY ASSY.
KM8JN12DX6U	9/15/05	61494	33.66		ESC LIGHT IS STAYING ON	BRAKE LIGHT SWITCH MALFUNCTION	R&R BRAKE LAMP SWITCH- RECHECK AND FOUND OPERATING TO FACTORY SPECS
KM8JN12D75U	8/30/04	23669	36.78		ESP LIGHT IS ON.	C:FOUND FAILED BRAKE LAMP SWITCH PFP:93810-38110 OP CODE#93810R00 0.3 N94 C15	PERFORMED SCAN TEST, CODE C1513 IN MEMORY, PINPOINT TEST AND REPLACED BRAKE LAMP SWITCH
KM8JN72D46U	8/19/05	19929	37.86		ESC LIGHT ON SOME TIME WHEN DRIVING	TECH FOUND A INTURNAL FAILURE TO THE BRAKE SWITCH	TECH REPLACED THE BRAKE SWITCH
KM8JN72D46U	8/19/05	19929	37.86		CUSTOMER STATES TIRE LIGHT ON	TECH FOUND A BAD TRANSMITTER IN THE RIGHT	TECH REPLACED THE TRANSMITTER
KM8JN72D16U	10/04/05	49065	36.66				
KM8JN12D16U	7/15/05	31375	33.34		CUSTOMER STATES ALL BRAKE LIGHTS INOP	DIAG. FOUND BRAKE LIGHT SWITCH BAD	REPLACED SWITCH 93810R00
KM8JN12D46U	9/30/05	20600	59.3	ESC LIGHT ON DIAG BY SCAN 1513 BRAKE LIGHT SWITCH SHORTED REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES VEHICLE STALLS WHEN DRIVING	CONTACTED TECHLINE, MARK FROM HYUNDAI FIELD ENGINEERING REVIEW VEHICLE AT DEALERSHIP	REPLACED THROTTLE BODY AND CAM POSTION SENSOR TEST DROVE MULTIPLE TIMES ALL OK
KM8JN72D45U	11/06/04	20915	25.2		CUSTOMER STATES:ESP SWITCH INOP CHECK & REPORT	FOUND CODE C1513 BRAKE LIGHT SWITCH	ADJUST BRAKE LIGHT SWITCH CLEAR CODE FROM COMPUTER 93810R00 .2 93810RP0 .3 N69 C15
KM8JN12D16U	7/27/05	31925	36.66				
KM8JN12D75U	5/24/05	53588	84.86	ADD ON TIME FOR SCANNING TWICE AND REMOVING WHOLE LAMP ASSEMBLY. HAD TO SCAN TWICE TO CHECK FOR MORE CODES AFTER REPLACEMENT, NONE FOUND	CUST STATES TRAC LIGHT IS ON	SCANNED CODE IN COMPUTER FOUND CODE NUMBERS C1503 C1513 STOP LIGHT SWITCH INOP INTERNAL PROBLEM	REMOVED AND REPLACED STOP LIGHT SCANNED COMPUTER ONCE MORE AND NO CODES FOUND CLEARED LIGHT
KM8JN12D75U	5/24/05	53588	84.86	ADD ON TIME FOR SCANNING TWICE AND REMOVING WHOLE LAMP ASSEMBLY. HAD TO SCAN TWICE TO CHECK FOR MORE CODES AFTER REPLACEMENT, NONE FOUND	CUSTR STATES HEAD LIGHT IS OUT	FOUND RIGHT FRONT HEAD LIGHT INOP	REMOVED AND REPLACED RIGHT FRONT HEADF LIGHT
KM8JN72D45U	11/06/04	20915	25.2		PERFORM OPEN RECALL #922		RECALL #922 COMPLETED
KM8JN12D26U	12/22/05	11514	33.94	11514 SCANN FOR CODES NONE PRESENT TEST BRAKE LIGHT SWITCH FOR CONTINUITY FOUND OPEN IN SWITCH REPLACED SWITCH REPLACED SWITCH	CUSTOMER STATES CRUISE CONTROL WILLNOT SET INTERMITTENTLY (SEE HISTORY)		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 11514 SCANN FOR CODES NONE PRESENT TEST BRAKELIGHT SWITCH FOR CONTINUITY FOUND OPEN INSWITCH REPLACED SWITCH REPLACED SWITCH
KM8JN12D76U	1/04/06	10312	32.21	10312 ESC SCAN TOOL REPLACED STOP LAMP SWITCH PER PREVIOUS RO	CUSTOMER STATES ESC LIGHT WILL NOT TURN OFF (INSTALL SOP)		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 10312 ESC SCAN TOOL REPLACED STOP LAMP SWITCHPER PREVIOUS RO
KM8JN12D56U	8/16/05	15761	38.3		CUSTOMER STATES ESC LIGHT COMES ON AND THEN GOES OFF- ALSO ESC LIGHT GOES ON WHEN OPENNING THE TAIL GATE	TECH FOUND BRAKE LIGHT SWITCH SHORTED OUT CODE STOREDC1513 BRAKE LIGHT SWITCH INOP	REPLACED BRAKE LIGHT SWITCH
KM8JN12D56U	8/16/05	15761	38.3		CUSTOMER STATES THE LEFT REAR DOOR PAINT HAS A DEFECT IN IT		SENT TO BODY SHOP FOR REPAIRS
KM8JN72D25U	5/17/05	45315	28.14				
KM8JN12D26U	10/28/05	25636	34.26	25636 ECS C 1513 FOUND INTEMITTINGLY OPEN STOP LAMP SWITC REPLACED SWITCH	CUST. RQSTS RECALL #079/DS ABM COVER SOP INSTALL		CAMAPIGN 079 - DRIVER AIRBAG MODULE REPLACEMENT CAMAPIGN 079 - DRIVER AIRBAG MODULE REPLACEMENT 25636 CAMP REPLACED AIR BAG COVER
KM8JN12D26U	10/28/05	25636	34.26	25636 ECS C 1513 FOUND INTEMITTINGLY OPEN STOP LAMP SWITC REPLACED SWITCH	CUST. STATES ESC LIGHT IS ON/WILL NOT GO OFF SOP INSTALL		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 25636 ECS C 1513 FOUND INTEMITTINGLY OPENSTOP LAMP SWITC REPLACED SWITCH
KM8JN72DX5U	6/02/05	22777	32.21	22777 ESC INSTALLED SOP SWITCH FOR STOP LAMPS SEE PREV RO	CUSTOMER STATES CAR WILL HESITATE BADLY WHEN TRYING TO ACCELERATE FROM A SLOW SPEED OF ABOUT 5 MPH (INSTALL SOP)		SENSOR ASSY-AIR FLOW RE SENSOR ASSY-AIR FLOW RE 22777 HESITATES REPLACED MAAS AIR FLOW CLAMPSPER PREVIOUS RO NEEDS TO COME TO COMPLETE STOPTO DOWN SHIFT
KM8JN12D85U	5/23/05	25474	37.54				
KM8JN12D16U	9/28/05	1137	37.54				
KM8JN72D46U	9/29/05	17364	37.54				
KM8JN72D45U	5/31/05	26836	37.86				
KM8JN72DX5U	6/02/05	22777	32.21	22777 ESC INSTALLED SOP SWITCH FOR STOP LAMPS SEE PREV RO	CUSTOMER STATES CAR WILL HESITATE BADLY WHEN TRYING TO ACCELERATE FROM A SLOW SPEED OF ABOUT 5 MPH (INSTALL SOP)		SENSOR ASSY-AIR FLOW ADD SCAN TOOL OPERATION SENSOR ASSY-AIR FLOW ADD SCAN TOOL OPERATION 22777 HESITATES REPLACED MAAS AIR FLOW CLAMPSPER PREVIOUS RO NEEDS TO COME TO COMPLETE STOPTO DOWN SHIFT

KM8JN72DX5U	6/02/05	22777	32.21	22777 ESC INSTALLED SOP SWITCH FOR STOP LAMPS SEE PREV RO	CUSTOMER STATES ESP OFF LIGHT COMES ON RANDOMLY WILL NOT TURN OFF WITH SWITCH (INSTALL SOP)		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 22777 ESC INSTALLED SOP SWITCH FOR STOP LAMPSSEE PREV RO
KM8JN12D75U	5/13/05	13	16				
KM8JN12D15U	12/24/04	16862	16				
KM8JN12D76U	12/08/05	23171	33.34				
KM8JN72D86U	12/28/05	34007	36.06				
KM8JN12DX5U	5/21/05	24336	36.06				
KM8JN12D56U	12/30/05	10504	33.94	10504 CRUISE SCAN TOOL C 1513 STOP LAMP SWITCH SHORTED OPEN REPLACED SWITCH	CUST STATES CRUISE CONTROL IS INOP INSTALL S/O SWITCH		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 10504 CRUISE SCAN TOOL C 1513 STOP LAMPSWITCH SHORTED OPEN REPLACED SWITCH
KM8JN12D16U	8/16/05	23214	58.54	23214 SCANN FOR CODES FOUND ON PREVIOUS RO REPLACE BRAKE LITE SWITCH. SCANN CODE P0 1513.	CUST. RQST RECALL #079/DS AIRBAG/SOP HERE		CAMAPIGN 079 - DRIVER AIRBAG MODULE REPLACEMENT CAMAPIGN 079 - DRIVER AIRBAG MODULE REPLACEMENT 23214 PERFORM RECALL AIR BAG
KM8JN12D16U	8/16/05	23214	58.54	23214 SCANN FOR CODES FOUND ON PREVIOUS RO REPLACE BRAKE LITE SWITCH. SCANN CODE P0 1513.	CUST. STATES ESC LIGHT ALWAYS ON/SOP HERE		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 23214 SCANN FOR CODES FOUND ON PREVIOUS ROREPLACE BRAKE LITE SWITCH
KM8JN12DX6U	12/07/05	25217	36.06				
KM8JN12D15U	1/20/05	16893	31.95				
KM8JN12D85U	5/30/05	25004	35.74				
KM8JN12B96U	8/23/05	39960	33.34				
KM8JM12B36U	7/16/05	14282	33.94	14282 ESC LITE ON SCANN FOR CODES NONE PRESENT TEST BRAKE LITE SWITCH FOUND SWITCH GETS STUCK AT TIMES REPLACE BRAKE LITE SWITCH	CUSTOMER STATES ESC LIGHT STAYS ON INTERMITTENTLY WILL NOT TURN OFF WITH SWITCH (INSTALL SOP)		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 14282 ESC LITE ON SCANN FOR CODES NONEPRESENT TEST BRAKE LITE SWITCH FOUND SWITCHGETS STUCK AT TIMES REPLACE BRAKE LITE SWITCH
KM8JM12B66U	7/19/05	25968	34.26	25968 ESC SCAN TOOL B 1828 SCAN TOOL C 1513 STOP LAMP SWITCH REPLACED SWITCH	CUST.STATES;INSTALL SOP STOP LAMP SWITCH/ESCLO		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 25968 ESC SCAN TOOL B 1828 SCAN TOOL C 1513STOP LAMP SWITCH REPLACED SWITCH
KM8JM12B56U	11/18/05	26792	33.34				
KM8JM12B75U	4/16/05	13011	33.34				
KM8JN12D76U	11/23/05	29513	36.06				
KM8JM12B16U	7/11/05	35645	34.26	35645 LIGHTS SCAN TOOL C 1513 STOP LAMP SWITCH SHORTED REPLACED SWITCH	079 RECALL		CAMAPIGN 079 - DRIVER AIRBAG MODULE REPLACEMENT CAMAPIGN 079 - DRIVER AIRBAG MODULE REPLACEMENT 35645 CAMP REPLACED AIR BAG COVER
KM8JM12B16U	7/11/05	35645	34.26	35645 LIGHTS SCAN TOOL C 1513 STOP LAMP SWITCH SHORTED REPLACED SWITCH	CUSTOMER STATES BRAKES LIGHTS ARE NOT WORKING		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 35645 LIGHTS SCAN TOOL C 1513 STOP LAMPSWITCH SHORTED REPLACED SWITCH
KM8JM12B66U	7/14/05	20806	34.26	20806 ESC SCAN TOOL C 1513 BRAKE LAMP SWITCH SHORTED REPLACED SWITCH	CUST.STATES; ESC LAMP COMES ON AT RANDOM WHILE DRIVING.		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20806 ESC SCAN TOOL C 1513 BRAKE LAMP SWITCHSHORTED REPLACED SWITCH
KM8JN72D36U	11/10/05	30301	29.7	30301 C1513 BRAKE SWITCH OPEN/SHORT. BRAKE LIGHTS INOP. REPLACED BRAKE LIGHT SWITCH,BRAKE LIGHT WORKING AGAIN.	CUST STATES ESC LIGHT KEEPS COMING ON AND CAR IS DYING AT STOPS ADVISE		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 30301 C1513 BRAKE SWITCH OPEN/SHORT. BRAKELIGHTS INOP. REPLACED BRAKE LIGHTSWITCH,BRAKE LIGHT WORKING AGAIN.
KM8JN72D36U	11/10/05	30301	29.7	30301 C1513 BRAKE SWITCH OPEN/SHORT. BRAKE LIGHTS INOP. REPLACED BRAKE LIGHT SWITCH,BRAKE LIGHT WORKING AGAIN.	CUST STATES ESC LIGHT KEEPS COMING ON AND CAR IS DYING AT STOPS ADVISE		93810ATT ACTUAL TIME 30301 C1513 BRAKE SWITCH OPEN/SHORT. BRAKELIGHTS INOP. REPLACED BRAKE LIGHTSWITCH,BRAKE LIGHT WORKING AGAIN.
KM8JN72D06U	9/16/05	13181	39.36	13181 SCANNED FOR CODES, FOUND C1513 BRAKE LAMP SWITCH. DETERMINED SWITCH TO BE OPEN. REPLACED SWITCH WITH NEW, AND CLEARED CODE. OPERATING AS DESIGNED, NO CODES PRESENT AT THIS TIME. OP CODE 93810R00 NATURE CODE N94 CAUSE CODE C15	CUST TATES ESC LIGHT IS ON	SCANNED FOR CODES, FOUND C1513 BRAKE LAMP SWITCH.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 13181 SCANNED FOR CODES, FOUND C1513 BRAKELAMP SWITCH. DETERMINED SWITCH TO BE OPEN.REPLACED SWITCH WITH NEW, AND CLEARED CODE.OPERATING AS DESIGNED, NO CODES PRESENT ATTHIS TIME. OP CODE 93810R00 NATURE
KM8JM12B05U	6/03/05	31432	32.76	HI SCAN DIAG C1513 BRAKE SWITCH FAILURE-REPLACE D SWITCH-TESTED-OPERATING AS DESIGNED			
KM8JN12D56U	12/22/05	17403	32.44				
KM8JN12D65U	12/23/04	24057	31.33	TESTED AND REPLACED BRAKE LIGHT SWITCH.C1513 CODE.VERIFIED REPAIR.OPERATING AS DESIGNED.	CS ESP LIGHT IS ON	SHORTED SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE TESTED AND REPLACED BRAKE LIGHT SWITCH.C1513CODE.VERIFIED REPAIR.OPERATING AS
KM8JN12DX5U	6/09/05	17811	32.3				
KM8JN12D25U	2/22/05	8373	36.37	8373FOUND BRAKE SWITCH SQUEAKING. REPLACED BRAKELIGHT SWITCH			

KM8JN72D96U	10/14/05	9524	39.04	9524 C1237 PRIMARY PRESSURE SNSR SIGNAL C1513 BRAKE SWITCH CITCUIT MAL FOUND BRAKE SWITCH TO HAVE AN INTERMITANT OPEN/SHORT AND CAUSING THE CODES TO SET AND ESC LIGHT TO FLICKER OVER BUMPS. REPLACED SNSR AND ROAD TESTED VEHICLE, OPERATING AS DESIGNED AT T	CUST SAYS--ESC LITE COMES ON WHILEGOING OVER BUMPS	C1237 PRIMARY PRESSURE SNSR SIGNAL C1513BRAKE SWITCH CITCUIT MAL	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 9524 C1237 PRIMARY PRESSURE SNSR SIGNAL C1513BRAKE SWITCH CITCUIT MAL FOUND BRAKE SWITCHTO HAVE AN INTERMITANT OPEN/SHORT AND CAUSINGTHE CODES TO SET AND ESC LIGHT TO FLICKEROVER BUMPS. REPLACED SNSR AND
KM8JM12B75U	6/15/05	32165	32.3				
KM8JM12B56U	12/15/05	14574	32.3				
KM8JN72D16U	1/05/06	38779	35.89	CUSTOMER STATES ESC OFF LIGHT COMES ON INTERMITTENTLY. CODE B1513.	CUSTOMER STATES THE REAR HATCH OPEN LIGHT ON THE DASH STAYS LITE, AND THE DOOR IS NOT OPEN	TECH REMOVED REAR HATCH COVERING AND FOUND A CHAFED WIRE NEAR THE LATCH	REPAIRED WIRE OP CODE -- 91000A00-- N66 -- C07
KM8JN72D16U	7/29/05	43712	58.54	SCAN TEST C1513	CUSTOMER STATES THE ESC LIGHT COMES ON AT TIMES	INTERMITTENT OPEN SCAN TESTED CODE C1513 BRAKE SWITCH CIRCUIT	INSPECTED AND REPLACED BRAKE SWITCH, CONCERN REPAIRED
KM8JN12D46U	12/28/05	32543	58.86	ATT-CALLED TECHLINE, TOLD TO CHECK VOLTAGE ON PIN 11 FOR 1.5, READ 0, REMOVED BROKEN SWITCH AND TRIED KNOWN GOOD PART. SWITCH WORKED. REPLACED BROKEN SWITCH	CUSTOMER STATES CRUISE CONTROL DOES NOT SET	BRAKE SWITCH DEFECTIVE	INSPECTED AND VERIFIED NO SETTING OF CRUISE. CALLED TECH LINE, STATES TO CHECK VOLTAGES AT THE SWITCHES IN THE STEERING COLUMN. ALL OK. REPLACED BRAKE LIGHT SWITCH, CONCERN REPAIRED
KM8JN72D16U	1/05/06	38779	35.89	CUSTOMER STATES ESC OFF LIGHT COMES ON INTERMITTENTLY. CODE B1513.	CUSTOMER STATES THE ESC OFF LIGHT COMES ON INTERMITTENTLY	FOUND CODE B1513, FOUND BRAKE LIGHT SWITCH TO BE OPEN CIRCUIT	REPLACED DEFECTIVE BRAKE LIGHT SWITCH OP CODE -- 93810R00--0.30 -- N66 -- C15
KM8JN72D16U	1/05/06	38779	35.89	CUSTOMER STATES ESC OFF LIGHT COMES ON INTERMITTENTLY. CODE B1513.	PERFORM CAMPAIGN 079 DRIVER AIR BAG COVER MODULE REPLACEMENT.	DESIGN IMPROVEMENT	REPLACED DRIVERS AIR BAG MODULE
KM8JM12B16U	9/09/05	29874	36.21	REPLACED BRAKE LIGHT SWITCH. 93810R00/N94/C15	CUSTOMER STATES "E.S.C." LIGHT IS ON/OFF INTERMITTENTLY WHILE DRIVING	BRAKE LIGHT SWITCH ON BRAKE PEDAL STAYING OPEN INTERMITTENTLY.	REPLACED BRAKE LIGHT SWITCH. 93810R00/N94/C15
KM8JN72D26U	8/08/05	21385	58.86	ATT-SCAN CODE B1513	CUSTOMER STATES THE ECS OFF LIGHT IS ON AGAIN AND WONT SHUT OFF WHEN HITTING THE BUTTON EITHER - SEE HISTORY	SCAN TESTED CODE B1513 BRAKE SWITCH HISTORY CHECKED SERVICE BULLETINS AND REPLACED THE	BRAKE SWITCH CONCERN REPAIRED
KM8JN72D66U	1/23/06	17197	58.54	ATT-SCAN CODE C1513	CUSTOEMR STATES THERE IS A LIGHT ON THE DASH THAT STATES 'ESC OFF'. THE BUTTON THAT CONTROLS THIS DOESNT SEEM TO MAKE ANY DIFFERENCE WHEN PRESSED	CODE C1513	SCAN TESTED AND FOUND CODE IN SYSTEM FOR BRAKE SWITCH REPLACED BRAKE SWITCH AND CLEARED CODES, CONCERN REPAIRED
KM8JN72D95U	6/24/05	19081	35.9		CUSTOMER STATES AT TIMES THE 'ESP' LIGHT COMES ON, REPLACE SOP BRAKE SWITCH	INTERMITTENT OPEN CIRCUIT 21 FOR ESP HECU IN THE BRAKE SWITCH	INSPECTED AND REPALCED THE BRAKE SWITCH, CONCERN REPAIRED
KM8JM12B16U	9/09/05	29874	36.21	REPLACED BRAKE LIGHT SWITCH. 93810R00/N94/C15	PERFORM CAMPAIGN 079 DRIVER AIR BAG COVER MODULE REPLACEMENT.	DESIGN IMPROVEMENT	REPLACED DRIVERS AIR BAG MODULE 61B046R0
KM8JM12B67U	9/13/06	14361	36.21		CUSTOMER STATES THAT BRAKES LIGHTS ARE OUT	OBSERVED DURING SERVICE THAT ALL THREE BRAKE LIGHTS ARE OUT AND BRAKE LIGHT SWITCH HAS OPEN CIRCUIT AND NEEDS TO BE REPLACED	PERFORMED DIAGNOSTIC TEST; REPLACED BRAKE LIGHT SWITCH OP CODE #93810R00(.3)/N94/C15
KM8JN72D46U	7/22/05	24300	35.89				
KM8JN72D95U	6/24/05	19081	35.9		PROVIDED COURTESY TRANSPORTATION		FOR CUSTOMER SATISFACTION
KM8JN12D96U	7/20/05	59872	58.86	ATT - SCAN TEST CODE C1513 & C1237	CUSTOMER STATES REPLACE ENGINE ACCESSORY DRIVE BELT TENSIONER.	ADD ON OPERATION 10-24-07 LEAKING TENSIONER	REMOVED AND REPLACED ENGINE ACCESSORY DRIVE BELT TENSIONER.
KM8JN12D96U	7/20/05	59872	58.86	ATT - SCAN TEST CODE C1513 & C1237	CUSTOMER STATES AT TIME THE ESC OFF LIGHT COMES ON AND WONT SHUT BACK OFF WITH THE BUTTON	SCANNED CODES C1513 AND C1237	SCANNED AMD FOUND FAULTY BRAKE LIGHT SWITCH, CONCERN REPAIRED
KM8JN12D46U	8/08/05	24272	32.44	REMOVED AND REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES ESCOFF LIGHT WILL INTERMITTENTLY COME ON WHILE DRIVING- CAR DRIVES DIFFERENT WHENLIGHT COMES ON. MAKES SURE BUTTON HAS NOT BEEN PUSHED.	FOUND BRAKE LAMP SWITCH INOP.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REMOVED AND REPLACED BRAKE LAMP SWITCH
KM8JN12D46U	8/08/05	24272	32.44	REMOVED AND REPLACED BRAKE LAMP SWITCH	CUSTOMER REQUESTS CAMPAIGN 079		61B046R0 RECALLS PERFORMED OPEN CAMPAIGN
KM8JM12B66U	9/14/05	25598	32.76	25598 FOUND CODE C1513 BRAKE LIGHT SWITCH WITH INTERNAL SHORT REMOVED AND REPLACED BRAKE LIGHT SWITCH ASSEMBLY 93810ROO N-94 C-15	CUSTOMER STATES ESP LIGHT IS ON	FOUND CODE C1513 BRAKE LIGHT SWITCH WITHINTERNAL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 25598 FOUND CODE C1513 BRAKE LIGHT SWITCHWITH INTERNAL SHORT REMOVED AND REPLACEDBRAKE LIGHT SWITCH ASSEMBLY 93810ROO N-94C-15
KM8JN12D96U	7/20/05	59872	58.86	ATT - SCAN TEST CODE C1513 & C1237	CUSTOMER STATES CHECK ENGINE LAMP ON - PERFORMANCE NOT AFFECTED	CODE P0455 LARGE EVAP LEAK NOTED	SCANNED AND RAN SELF TEST, PASSED ALL THE TIME, CLEARED CODES, NO REPAIRS NECESSARY AT THIS TIME
KM8JM12B36U	8/19/05	21042	58.86	INSPECTED AND FOUND BRAKE LIGHTS INOPERATIONAL. REPLACED BRAKE LIGHT SWITCH, CONCERN REPAIREDATT-SCAN CODE C1513	CUSTOMER STATES THE ESC LIGHT IS ON ON THE DASH AND WONT SHUT OFF. BUTTON DOES NOTHING TODAY HAD TO SLAM ON BRAKES HARD AND THEN IT WENT OFF. ADVISE	C1513 BRAKE LAMP SWITCH CODE	INSPECTED AND FOUND BRAKE LIGHTS INOPERATIONAL. REPLACED BRAKE LIGHT SWITCH, CONCERN REPAIRED
KM8JN12D66U	12/27/05	14531	26.26		CUST STS ESC OFF LIGHT GOES ON WHILE DRIVING, CAN'T TURN OFFBY HITTING BUTTON, BVT CYCLING KEY THEN WORKS NORMALLY	BAD BRAKE SWITCH	REPLACE BRAKE SWITCH
KM8JM12B66U	9/14/05	25598	32.76	25598 FOUND CODE C1513 BRAKE LIGHT SWITCH WITH INTERNAL SHORT REMOVED AND REPLACED BRAKE LIGHT SWITCH ASSEMBLY 93810ROO N-94 C-15	RECALLS	61B046R0	RECALLS RECALLS 25598 PERFORMED CAMPAIGN 079 61B046R0

KM8JN12D36U	12/31/05	19313	32.44	19313 FOUND INTERNAL SHORT IN BRAKE LAMP SWITCH REMOVED AND REPLACED BRAKE LAMP SWITCH 93810ROO N-94 C-15	CUSTOMER STATES THAT ESC LIGHT IS ON.	FOUND INTERNAL SHORTIN BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 19313 FOUND INTERNAL SHORT IN BRAKE LAMP SWITCH REMOVED AND REPLACED BRAKE LAMP SWITCH 93810ROO N-94 C-15
KM8JN72D26U	11/17/05	10303	34.24		CUST STS ESC OFF LIGHT COMES ON, PUSHING BUTTON DOESN'T CHANGE ANYTHING	DEFECTIVE BRAKE LAMP SWITCH	REPLACED SWITCH TO CORRECT
KM8JN72D26U	11/17/05	10303	34.24		CUST STS RECALL IS OPEN	OPEN CAMPAIGN	COMPLETED CAMPAIGN AS PER FACTORY INSTRUCTIONS
KM8JM72B55U	7/05/05	14771	34.56	CST STS ESP LIGHT COMES ON WHILE DRIVING. SCANNED FOR CODES. C1513 BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH TO CORRECT.	CUST STS ESP LIGHT COMES ON WHILE DRIVING	BAD BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH TO CORRECT
KM8JM12BX6U	7/22/05	28978	32.44	28978 FOUND CODE C1513 STOP LAMP SWITCH IS OPEN REMOVED AND REPLACED STOP LAMP SWITCH 32002AOO N-69 C-15	CUSTOMER STATES THAT ESC OFF LIGHT COMES ON FOR NO REASON	FOUND CODE C1513 STOP LAMP SWITCH IS OPEN	FUSE-BLADE RE FUSE-BLADE RE 28978 FOUND CODE C1513 STOP LAMP SWITCH IS OPEN REMOVED AND REPLACED STOP LAMP SWITCH 32002AOO N-69 C-15
KM8JM12BX6U	7/22/05	28978	32.44	28978 FOUND CODE C1513 STOP LAMP SWITCH IS OPEN REMOVED AND REPLACED STOP LAMP SWITCH 32002AOO N-69 C-15	CUSTOMER STATES THAT ESC OFF LIGHT COMES ON FOR NO REASON	FOUND CODE C1513 STOP LAMP SWITCH IS OPEN	FUSE-BLADE ADD SCAN TOOL OPERATION FUSE-BLADE ADD SCAN TOOL OPERATION 28978 FOUND CODE C1513 STOP LAMP SWITCH IS OPEN REMOVED AND REPLACED STOP LAMP SWITCH 32002AOO N-69 C-15
KM8JN72D65U	4/26/05	12847	33.5		ESP OFF LIGHT BLINKS ON AND OFF	DEFECTIVE BRAKE LAMP SWITCH	REPLACE SWITCH 93810ROO .3 94 15
KM8JN12D86U	11/16/05	29244	33.36	TECH SCAN TESTED FOUND CODE C1513 FAULTY BRAKE LAMP SWITCH NECESSARY TO REMOVE AND REPALCE FAULTY BRAKE LAMP SWITCH TESTED FOR PROPER OPERATION AND CLEARED CODES	CUSTOEMR STATES WARRNINT LIGHT COMES ON	SCAN/TESTED, C1513-INTERNAL FAILURE IN BRAKE LAMP SWITCH	REPLACED FAULTY BRAKE LAMP SWITCH, CLEARED CODES, TESTED FOR PROPER OPERATION
KM8JN12D86U	11/16/05	29244	33.36	TECH SCAN TESTED FOUND CODE C1513 FAULTY BRAKE LAMP SWITCH NECESSARY TO REMOVE AND REPALCE FAULTY BRAKE LAMP SWITCH TESTED FOR PROPER OPERATION AND CLEARED CODES	CUSTOMER STATES HAVING TO JUMP TRUCK OFF AFTER SITTING	INSPECT/TESTED, RADIO INTERMITTENTLY TURNING ON WHEN VEHICLE TURNED OFF CAUSING BATTERY TO DRAIN - INTERNAL FAILURE IN RADIO	REPLACED FAULTY RADIO, TESTED FOR PROPER OPERATION
KM8JM12BX6U	7/22/05	28978	32.44	28978 FOUND CODE C1513 STOP LAMP SWITCH IS OPEN REMOVED AND REPLACED STOP LAMP SWITCH 32002AOO N-69 C-15	CUSTOMER STATES THAT AUX. OUTLETS ARE NOT WORKING	CK FOR WSC LIGHT INOP. CODE C1513 STOP LAMP SWITCH OPEN CK REPLACE STOP LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 28978 FOUND THAT FUSE WAS BLOWN DUE TO EXTERNAL ELECTRICAL CONNECTION, REMOVED AND REPLACED FUSES, NO PROBLEMS FOUND AT THISTIME
KM8JN12D66U	7/28/05	21145	32.76	21145 FOUND CODE C1513 BRAKE LAMP SWITCH INTERNAL SHORT REMOVED AND REPLACED BRAKE LAMP SWITCH 93810ROO N-94 C-15	CUSTOMER STATES THAT ESC LIGHT GOES ON AND OFF	FOUND CODE C1513 BRAKE LAMP SWITCH INTERNAL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21145 FOUND CODE C1513 BRAKE LAMP SWITCH INTERNAL SHORT REMOVED AND REPLACED BRAKE LAMP SWITCH 93810ROO N-94 C-15
KM8JN12D66U	7/28/05	21145	32.76	21145 FOUND CODE C1513 BRAKE LAMP SWITCH INTERNAL SHORT REMOVED AND REPLACED BRAKE LAMP SWITCH 93810ROO N-94 C-15	RECALLS	61B046R0	RECALLS RECALLS 21145 PERFORMED CAMPAIGN 079 TSB 07-01-0010P CODE 61B046R0
KM8JN72D06U	12/06/05	31439	33.36	TECH INSPECTED FOUND OPEN CIRCUIT IN BRAKE LAMP SWITCH SCNA TESTED FOUND CODE C1513 NECESSARY TO REMOVE AND REPLACE FAULT BRAKE LAMP SWITCH	CUSTOMER STATES ESC LIGHT	OPEN CIRCUIT IN BRAKE LAMP SWITCH SCANTEST CODE C1513	REMOVED AND REPLACED BRAKE LAMP SWITCH
KM8JN12D76U	1/09/06	57158	33.36	TECH SCAN TESTED FOUND CODE B1513 INSPECTED FOUND INTERMITTANT SHORT IN STOP LAMP SWITCH NECESSARY TO REMOVE AND REPALCE SWITCH AND RESET SYSTEM	CUSTOMER STATES ESC LIGHT ON	SCAN TESTED FOUND INTERMITTANT SHORT IN STOP LAMP SWITCH	REMOVED AND REPALCED STOP LAMP
KM8JN12D15U	7/15/05	21701	34.4	REMOVED AND REPLACED BRAKE SWITCH	CUSTOMER STATES ESC LIGHT GOES ON AND OFF. PARTS ORDERED	FOUND BRAKE SWITCH STICKING.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REMOVED AND REPLACED BRAKE SWITCH
KM8JM12B66U	9/02/05	34665	32.44	34665 FOUND CODE C1513 BRAKE LIGHT SWITCH INOP. REMOVED AND REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES THAT ESC LIGHT KEEPS COMING OUN.	FOUND CODE C1513 BRAKE LIGHT SWITCH INOP.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 34665 FOUND CODE C1513 BRAKE LIGHT SWITCH INOP. REMOVED AND REPLACED BRAKE LIGHTSWITCH.
KM8JN12D46U	8/08/05	20994	32.44	REMOVED AND REPLACED STOP LAMP SWITCH.	CUSTOMER STATES THAT ESC LIGHT IS ON.	FOUND CODE IN COMPUTER FOR STOP LAMP SWITCH.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REMOVED AND REPLACED STOP LAMP SWITCH.
KM8JN12D36U	1/05/06	14870	33.36	TECH INSPECTED FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH NECESSARY TO REMOVE AND REPLACE FAULTY BRAKE LIGHT SWITCH	CUSTOMER STATES BRAKE LAMP INOP	TEST AND INSPECT OPEN CIRCUIT BRAKE LIGHT SWITCH	REPLACED FAILED SWITCH
KM8JN72D56U	7/27/05	13703	29.16		CUSTOMER STATES ESC LIGHT ON EVEN WHEN SHUT OFF ??? TURNED OFF LAST NIGHT...HAS STAYED OFF.	FAULTY BRAKE SWITCH	SCAN FOR CODES C1503 TCS /ESP SWITCH, C1513 BRAKES SWITCH REPLACED BRAKES SWITCH AND CLEAR CODES

KM8JN72DX6U	8/11/05	13307	35.14	CUST STATES THAT THE ESC LIGHT IS ON. LIGHT DOES NOT SHUT OFF. FOUND THAT THE BRAKE SWITCH HAD AN INTERNAL SHORT. C1513 BRAKE LAMP SWITCH. REPLACED BRAKE SWITCH. ALL OK NOW.	CUST STATES THAT THE ESC LIGHT IS ON LIGHT DOES NOT SHUT OFF	FOUND THAT THE BRAKE SWITCH HAD AN INTERNAL SHORT C1513 BRAKE LAMP SWITCH	REPLACED BRAKE SWITCH ALL OK NOW
KM8JN12D46U	8/08/05	33030	32.76	33030 FOUND THAT BRAKE PEDAL SWITCH HAS AN INTERNAL SHORT REMOVED AND REPLACED BRAKE SWITCH. NO OTHER PROBLEMS FOUND AT THIS TIME 32002AOO N-69 C-15	CUSTOMER STATES THAT ESC LIGHT COMES ON AT TIMES	FOUND THAT BRAKE PEDAL SWITCH HAS AN INTERNAL SHORT	SWITCH ASSY-STOP LAMP RE 33030 FOUND THAT BRAKE PEDAL SWITCH HAS AN INTERNAL SHORT REMOVED AND REPLACED BRAKE SWITCH. NO OTHER PROBLEMS FOUND AT THIS TIME 32002AOO N-69 C-15
KM8JM12BX6U	8/31/05	18918	32.76	18918 FOUND SHORT IN BRAKE LIGHT SWITCH REMOVED AND REPLACED BRAKE LAMP SWITCH 93810ROO N-94 C-15	CUSTOMER STATES THAT BRAKE LIGHTS ARE NOT ON	FOUND SHORT IN BRAKE LIGHT SWITCH	SWITCH ASSY-STOP LAMP RE 18918 FOUND SHORT IN BRAKE LIGHT SWITCH REMOVED AND REPLACED BRAKE LAMP SWITCH 93810ROO N-94 C-15
KM8JM12B96U	1/09/06	24112	35.14	CUST STATES ESC LIGHT IS ON. TECH TESTED THE SYSTEM FOUND CODE C1513. FOUND THE BRAKE SWITCH TO BE INTERMITTENTLY STICKING. TECH REPLACED THE BRAKE SWITCH AS NEEDED TO REPAIR.	CUST STATES ESC LITE IS ON	TECH TESTED THE SYSTEM. FOUND CODE C1513. FOUND THE BRAKE SWITCH TO BE INTERMITTENTLY STICKING.	TECH REPLACED THE BRAKE SWITCH AS NEEDED TO REPAIR. JJ
KM8JN12D55U	12/23/04	35231	31.41		THE CRUISE CONTROL DOESNT WORK INTERMITTENTLY	FOUND AT TIMES DOESNT WORK FOUND BRAKE LITE SWITCH DEFECTIVE	REPLACED BRAKE LITE SWITCH. TEST DROVE ON 4 DIFFERENT OCCASIONS IN 4 DAYS, AND DID NOT FAIL. TOTALLING 30 MILES-
KM8JN12D55U	7/07/05	16684	56	ADD TIME FOR SCAN AND CLEAR CODE C1513, C1611	CUSTOMER STATES HAS NO BRAKE LIGHTS	FOUND THE BRAKE LIGHT SWITCH IS FAILED	REPLACED THE BRAKE LIGHT SWITCH
KM8JN12D86U	1/10/06	17302	33.66		C/S ESC AND ABS LIGHTS ARE ON PART IS IN	BAD BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN12D26U	10/06/05	15161	35.3		CUSTOMER STATES ESC LIGHT ON	SHORT	PERFORM ELECTRICAL SYSTEMS DIAGNOSIS. REPLACE BRAKE SWITCH
KM8JN72D76U	10/18/05	43026	58.26	CS ESC OFF LIGHT COMES ON AT RANDOM. WILL GO OFF WHEN TURN CAR OFF. MAY COME BACK ON WHEN START CAR AGAIN OR MAY NOT. FAULTY BRAKE LIGHT SWITCH. REPLACE BRAKE LIGHT SWITCH.	CUSTOMER STATES ESC OFF LIGHT COMES ON AT RANDOM. WILL GO OFF WHEN TURN CAR OFF. MAY COME BACK ON WHEN START CAR AGAIN OR MAY NOT	FAULTY BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN12D55U	12/23/04	43884	30.3		CUSTOMER STATES THE CRUISE CONTROL DOESNT WORK, CRUISE LIGHT COME ON THOUGH	INSPECTING BRAKE LIGHT VOLTAGE ON CONSTANT HOT SIDE FOUND WHEN LETTING GO OF PEDAL VOLTAGE SIGNAL WAS DELAYED BY APPROXIMATELY 1 SECOND-DUE TO BRAKE LIGHT SWITCH STICKING	REPLACED BRAKE LIGHT SWITCH WITH SUPERCEDED (UPDATED) PART- TEST DROVE AND CHECKED FOR VOLTAGE, VOLTAGE GOOD
KM8JM12BX5U	7/05/05	9624	70.9	SCAN/CLEAR CODE C1513. ALSO CONNECTION NOT SECURE. RECONNECTED.	THE ESP OFF POPS ON WHEN SHE IS DRIVING, HAS HAPPENED SEVERAL TIMES NOW. SHE IS NOT TURNING IT OFF.	INSPECTION FOUND CODE C1513- BRAKE LITE SWITCH IS OPEN AT TIMES	REPLACED BRAKE LITE SWITCH
KM8JN12D25U	6/01/05	23089	27.66	ESC LIGHT ON, HIGH-SCAN SHOWED C1513-BRAKE SWITCH ERROR-HAS INTERNAL SHORT			
KM8JN12D86U	9/08/05	27334	30.85	STOP LAMP SWITCH HAS OPEN CIRCUIT. REPLACE SWITCH			
KM8JN12D05U	5/27/05	41504	30.53				
KM8JN12D76U	10/11/05	34077	30.85	ESC LIGHT ON. BRAKE SWITCH HAS OPEN CIRCUIT. REPLACE STOP LAMP SWITCH	ESC LIGHT ON. PARTS ORDERED	STOP LAMP SWITCH HAS OPEN CIRCUIT	REPLACE STOP LAMP SWITCH
KM8JM12BX5U	7/05/05	9624	70.9	SCAN/CLEAR CODE C1513. ALSO CONNECTION NOT SECURE. RECONNECTED.	THE GAS DOOR DOESNT OPEN WITH INSIDE SWITCH	THE CONNECTION HAS WORN	RE CONNECTED AND SECURED NOW WORKS
KM8JM12BX5U	2/19/05	3086	33.75				
KM8JM12B56U	7/20/05	11421	33.65		CUSTOMER STATES THE ESP LIGHT ON AT TIMES	DETECT FAILED BRAKE SWITCH/ OPEN AT TIMES	REPLACED THE BRAKE SWITCH AS PER MANUAL. RECHECK AND IS OK
KM8JN12D66U	3/16/06	6123	31.69				
KM8JM12B15U	11/08/04	2519	36.57				
KM8JN12DX5U	6/07/05	11887	62.3		CUSTOMER STATES VEHICLE STALLS OUT SLOWING DOWN MAKING LF TURNS JUST HAPPEN TODAY	NO TROUBLE CODE ON ENGINE OR TRANS /ROAD TEST 3 MILES	COULD NO DUPLICATE CUSTOMER COMPLAINT AT THIS TIME TECH#3014
KM8JN12DX5U	6/07/05	11887	62.3		CUSTOMER STATES THE ESP LIGHT COMES ON & OFF/SOP HERE	OPEN CIRCUIT CODE C1513 ESP LIGHT ON	REPLACED FAULTY STOP LIGHT SWITCH LAMP TECH#3014
KM8JN12D66U	3/16/06	3204	48.55	TT TIME FOR SCAN AND CLEAR CODE C1513 AND C1611	CUSTOMER STATES THE DOME LITE DOESNT WORK PROPERLY, GOES OFF THEN COMES ON BY ITSELF, OR LIGHT IS OFF AND STAYS ON	INSPECTED WITH CUSTOMER, SHOWED THAT THE DOME LITE AND SECURITY SYSTEM FEATURES ARE WORKING CORRECTLY. TO HIS	SATISFACTION
KM8JN12D66U	3/16/06	3204	48.55	TT TIME FOR SCAN AND CLEAR CODE C1513 AND C1611	CUSTOMER STATES THE ESC SHOWS UP ON THE DASH THAT IT'S OFF, DOESNT RELATE TO ANY CONDITION, JUST POPS ON THAT IT IS OFF.	SCAN TOOL FOUND CODE C1513 AND C1611 BRAKE LAMP SWITCH OPEN AT TIMES AND EMS SYSTEM INOP BRAKE LAMP SWITCH IS BROKEN, INTERNAL FAILURE	REPLACED BRAKE LAMP SWITCH AND CLEARED CODES
KM8JN12D95U	9/04/04	23985	35.62		TCS LIGHT STAYS ON	SCANNED FOR CODES FOUND CODES C1211, C1208 AND C1513. MALFUNCTIONING RIGHT REAR AND LEFT REAR WHEEL SPEED SENSORS	REPLACED RIGHT AND LEFT REAR WHEEL SPEED SENSORS
KM8JM12BX6U	7/22/05	24589	34.26		CUSTOMER STATES CHECK ENGINE LIGHT IS ON	15	SCAN TEST FOUND LARGE EVAP LEAK, NO LEAKS FOUND AT THIS TIME POSSIBLY HA A LOOSE GAS CAP MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION
KM8JM12BX6U	7/22/05	24589	34.26		CUSTOMER STATES ESC LIGHT WAS ON IS OFF NOW	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE

KM8JN72D15U	9/13/04	4011	117.67	15			
KM8JM12B35U	4/07/05	12678	33.94				
KM8JN12D95U	9/04/04	23985	35.62		BRAKE LIGHTS INOP	CODE C1513 PRESENT, NO VOLTAGE OUT OF BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12D55U	11/10/04	16456	35.62		INSTALL ORDERED BRAKE SWITCH , CRUISE CONTROL , WILL ENGUAGE , WILL SHUT OFF .	BRAKE LIGHT SWITCH IS DEFECTIVE SHUTTING OFF CRUISE CONTROL	REPLACED BRAKE LIGHT SWITCH
KM8JN12D55U	11/10/04	16456	35.62		PERFORM CAMPAIGN # 922 ECM UPDATE	SOFTWARE UPDATE REQUIRED	REPROGRAMED ECM
KM8JN12D36U	7/26/05	16138	34.26				
KM8JN12D56U	7/15/05	20673	33.94		CUSTOMER STATES ESC OFF LIGHT WAS ON FOR 2 DAYS AND WOULD NOT GO OUT WITH BUTTON	15	MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION
KM8JN12D56U	7/15/05	20673	33.94		CUSTOMER STATES ESC OFF LIGHT WAS ON FOR 2 DAYS AND WOULD NOT GO OUT WITH BUTTON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D55U	11/10/04	16456	35.62		INSTALL ORDERED DRIVER SIDE OUTSIDE MIRROR COVER	LEFT SIDE MIRROR COVER BROKEN	REPLACED LEFT SIDE MIRROR COVER
KM8JN12D96U	7/21/05	40084	31.56		ESC LIGHT STAYS ON ---CHECK AND ADVISE	REPLACED PRIMARY PRESSURE SENSOR	AND BRAKE SWITCH
KM8JM12B96U	1/12/06	22316	60.64	ESC LIGHT TURNS ON OFF WITHOUT HER TOUCHING IT. INSPECT C1513 BRAKE SWITCH MALFUNCTION. REPLACE SWITCH SCAN TOOL OPERATION.			
KM8JM12B76U	1/06/06	19997	33.94		CUSTOMER STATES ESC LIGHT COMES ON AND VEHICLE HESITATES AT TIMES	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D46U	8/23/05	15702	34.26		CUSTOMER STATES ESC LIGHT COMES ON	E	MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION
KM8JN72D46U	8/23/05	15702	34.26		CUSTOMER STATES ESC LIGHT COMES ON	E	SENSOR-ANGULAR VELOCITY SENSOR-ANGULAR VELOCITY
KM8JN12D86U	9/24/05	27	23.25	CUST STATES VEHICLE WILL NOT START. BATTERY DEAD. BATTERY DISCHARGED. CHECK BATTERY-OK-NEED CHARGE DUE TO DRAIN FROM CONSTANT BRAKE LAMP APPLY DUE TO DEFECTIVE SWITCH. RECHARGE BATTERY.			
KM8JN12D86U	9/24/05	27	34.13	CUST STATES LAST NIGHT SHE NOTICED BRAKE LIGHTS ON WHILE THERE WAS NOBODY IN VEHICLE. CUST STEP ON BRAKES LIGHTS WENT OFF, A COUPLD OF HOURS LATER ON AGAIN. CONFIRM BRAKE LAMP SWITCH STAYING ENGAGED. UNABLE TO ADJUST. SWITCH SHORTED. REPLACED SWITCH. REC			
KM8JN72D06U	11/02/05	15565	34.55	STOP LAMP SWITCH STICKING. CONFIRM CONDITION. REPLACE STOP LAMP SWITCH. RECHECK, OK.	STOP LAMP SWITCH STICKING	STOP LAMP SWITCH STICKING	REPLACE SWITCH AND RETEST OK
KM8JN72D46U	8/23/05	15702	34.26		CUSTOMER STATES ESC LIGHT COMES ON	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D46U	8/23/05	15702	34.26		CUSTOMER STATES ESC LIGHT COMES ON	E	SUBLET
KM8JN72D35U	6/02/05	33557	34.26		CUSTOMER STATES ESC OFF LIGHT COMES ON AT TIMES	15	MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION
KM8JN72D35U	6/02/05	33557	34.26		CUSTOMER STATES ESC OFF LIGHT COMES ON AT TIMES	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D45U	7/01/05	44535	32.59	CUST STATES ESC LIGHT ON. SCAN CK-C1237 PRESSURE SENSOR SIGNAL AND C1513 BRAKE SWITCH CKT. REPLACED BRAKE SWITCH AND ORDERED PRESSURE SENSOR.			
KM8JM12B07U	10/31/06	3406	61.26	REAR BRAKE LIGHTS ARE NOT WORKING. SCAN TEST CODE C1513 BRAKE LIGHT SWITCH, REPLACED STOP LAMP SWITCH ASSY.			
KM8JN12D25U	6/08/05	20002	35.46	SCAN TEST, C1513, BRAKE SWITCH. REPLACED BRAKE SWITCH ASSY, INTERNAL SHORT	CONNOLLY LOANER VEHICLE	R2,R5	CONNOLLY LOANER CONNOLLY LOANER
KM8JM12B46U	7/13/05	19857	35.9		CUSTOMER STATES ESC OFF LIGHT IS ON	15	COMPUTER ASSEMBLY ADD SCAN TOOL OPERATION COMPUTER ASSEMBLY ADD SCAN TOOL OPERATION
KM8JM12B46U	7/13/05	19857	35.9		CUSTOMER HAS OPEN RECALL 922 ECM REPROGRAM	CPN	ECM REPROGRAM RECALL 922 ECM REPROGRAM RECALL 922
KM8JM12B46U	7/13/05	19857	35.9		CUSTOMER STATES ESC OFF LIGHT IS ON	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D25U	6/08/05	20002	35.46	SCAN TEST, C1513, BRAKE SWITCH. REPLACED BRAKE SWITCH ASSY, INTERNAL SHORT	C/S ESC BUTTON WILL NOT WORK CHECK AND ADVISE	69,15	OXYGEN SENSOR ASSY RH (UP) RE OXYGEN SENSOR ASSY RH (UP) RE CHECK ENGINE LIGHT ON, SCAN TEST P0133, B1S1, REPLACE B1 O2 SENSOR (OUT OF RANGE)
KM8JN12D25U	6/08/05	20002	35.46	SCAN TEST, C1513, BRAKE SWITCH. REPLACED BRAKE SWITCH ASSY, INTERNAL SHORT	C/S ESC BUTTON WILL NOT WORK CHECK AND ADVISE	69,15	OXYGEN SENSOR ASSY RH ADDSCAN TOOL OXYGEN SENSOR ASSY RH ADDSCAN TOOL CHECK ENGINE LIGHT ON, SCAN TEST P0133, B1S1, REPLACE B1 O2 SENSOR (OUT OF RANGE)

KM8JN12D25U	6/08/05	20002	35.46	SCAN TEST, C1513, BRAKE SWITCH. REPLACED BRAKE SWITCH ASSY, INTERNAL SHORT	C/S FRONT LEFT WHEEL IS SQUEALING AND GRINDING ON THE HIGHWAY	94,15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE SCAN TEST, C1513, BRAKE SWITCH. REPLACED BRAKE SWITCH ASSY, INTERNAL SHORT
KM8JM12B46U	7/13/05	19857	35.9		CUSTOMER STATES BELT SQUEALS AT TIMES		SUBLET
KM8JN72D66U	8/31/05	16393	30.8		CUSTOMER STATES ESC LIGHT IS ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D66U	8/31/05	16393	30.8		TOUCHUP	15	FALL PARTS COUPON FALL PARTS COUPON
KM8JM12B86U	5/15/06	8	30.8		CUSTOMER STATES BRAKE LIGHTS ARE INOP	06	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D25U	6/08/05	20002	35.46	SCAN TEST, C1513, BRAKE SWITCH. REPLACED BRAKE SWITCH ASSY, INTERNAL SHORT	CONNOLLY LOANER VEHICLE	R2,R5	MISC. SHOP CHARGES
KM8JM12B66U	7/19/05	20998	60.94	CUST: ESC LIGHT IS COMING ON RANDOMLY. TECH: SCAN TEST CODE C1513, BRAKE SWITCH MALFUNCTION, REPLACED BRAKE SWITCH. CLEARED CODE. OK.	C/S ESC LIGHT IS COMING ON RANDOMLY	94,06	SCAN TOOL TEST SCAN TOOL TEST SCAN TEST CODE C1513, BRAKE SWITCH MALFUNCTION, REPLACED BRAKE SWITCH, CLEARED CODE. OK.
KM8JM12B66U	7/19/05	20998	60.94	CUST: ESC LIGHT IS COMING ON RANDOMLY. TECH: SCAN TEST CODE C1513, BRAKE SWITCH MALFUNCTION, REPLACED BRAKE SWITCH. CLEARED CODE. OK.	CONNOLLY LOANER VEHICLE	R2,R5	LOANER VEHICLE LOANER VEHICLE
KM8JN12DX5U	5/30/05	24183	70.26	SCANNED FOR CODES. DTC C1513 PRESENT, CK'D AND FOUND VEH TO NEED BRAKE LAMP SWITCH. REPLACED BRK LAMP SWITCH. CLEARED CODE. CK'D OPERATION. OK.			
KM8JN72D85U	1/28/05	37024	58.33	SCAN TEST C1513 BRAKE LAMP SWITCH			
KM8JN72D85U	1/28/05	30813	33		CUST STATES VEHICLE STABILITY TROUBLE LIGHT WAS ON DASH, LIGHT OFF NOW. CK & ADVISE.	E	CHECK ENGINE LIGHT ON CHECK ENGINE LIGHT ON
KM8JM12B66U	7/19/05	20998	60.94	CUST: ESC LIGHT IS COMING ON RANDOMLY. TECH: SCAN TEST CODE C1513, BRAKE SWITCH MALFUNCTION, REPLACED BRAKE SWITCH. CLEARED CODE. OK.	C/S ESC LIGHT IS COMING ON RANDOMLY	94,06	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE SCAN TEST CODE C1513, BRAKE SWITCH MALFUNCTION, REPLACED BRAKE SWITCH, CLEARED CODE. OK.
KM8JM12B66U	7/19/05	20998	60.94	CUST: ESC LIGHT IS COMING ON RANDOMLY. TECH: SCAN TEST CODE C1513, BRAKE SWITCH MALFUNCTION, REPLACED BRAKE SWITCH. CLEARED CODE. OK.	CONNOLLY LOANER VEHICLE	R2,R5	MISC. SHOP CHARGES
KM8JN12D45U	5/21/05	23126	29.52	THE ESP OFF LIGHT IS COMING ON WHILE DRIVING REPLACED BRAKE LIGHT SWITCH			
KM8JM12BX6U	10/24/05	8694	43.48		CUSTOMER STATES ESC LIGHT FLASHING OFF, SWITCH BUTTON WILL NOT TURN BACK ON	CODE C1513, BRAKE LAMP SWITCH	REPLACE BRAKE LAMP SWITCH
KM8JN72D16U	7/27/05	9030	33.94		ECS LIGHT COMING ON/ADVISE	INTERNAL FAILURE	REPOLACED BRAKE LIGHT SWITCH
KM8JN12D76U	12/06/05	34092	33.94				
KM8JN12D26U	1/11/06	36859	34.26		ECS LIGHT COMES ON DASH AT TIMES	C1237 AND C1513	REPLACED STOP LAMP SWITCH AND CLEARED CODE STORED AT THIS TIME CASE#277589
KM8JN12D75U	5/19/05	44255	29.84	ESP LIGHT IS ON OPEN CIRCUIT IN BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH			
KM8JM12B36U	11/17/05	53226	27.66		C-STATES ESC LIGHT CUTS ITSELF OFF	INTERNAL FAILURE IN BRAKE LIGHT SWITCH	REPLACED SWITCH AND RESET
KM8JN12D86U	8/25/05	18001	52.18	TT IS TO CLEAR CODES AND RESET			
KM8JN12D75U	10/02/04	33121	36.61				
KM8JN12D57U	11/05/06	6179	34.26	REPLACED BRAKE LAMP SWITCH			
KM8JM12B95U	3/17/05	4032	33.22		CUSTOMER STATES ESP OFF LIGHT ON WHEN BRAKES APPLIED	FOUND NO BRAKE LIGHTS SWITCH FAILED INTERNALLY	REPLACED BRAKE LIGHT SWITCH
KM8JN72D86U	8/31/05	15669	35.44	15669 C1513 BRAKE LIGHT SWITCH OPEN THE BRAKE LIGHT SWITCH WAS INTER OPEN' REPLACED THE BRAKE LIGHT SWITCH	CUST STATES ESC LIGHT WONT GO OFF-DID NOT COME ON TODAY-HAS TRIED TO TURN OFF	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 15669 C1513 BRAKE LIGHT SWITCH OPEN THE BRAKE LIGHT SWITCH WAS INTER OPEN' REPLACED THE BRAKE LIGHT SWITCH
KM8JN12DX6U	9/28/05	22395	35.83				
KM8JN12D06U	4/07/06	553	35.27				
KM8JN12D66U	7/20/05	21326	41.55		RECALL 079	RECALL 079	RECALL 079 61B046R0, 0.2 M/H
KM8JM12B05U	4/14/05	31817	35.44	31820 C1513 BRAKE LIGHT SW/INTERR.OPEN IN THE SW. INSTALL THE HI SCAN AND CK FOR DTCS.RECORD AND CLEAR.TEST RELATED WIRING.THERE IS A INTERR.OPE N IN THE SW.REPLACE THE BRALE LAMP SW.VERIFY REPAIR.	CUST STATES THE BATTERY WAS DEAD AFTER SITTING AT A PARK AND RIDE FOR 14 DAYS & NOW THE RADIO WILL NOT COME ON	FAILING VOLTAGE TESTING	BATTERY ASSY RE BATTERY ASSY RE 31817 BATTERY FAILED MIDTRONICS AND LOAD TESTING W/VAT INSTALL MIDTRONICS AND TEST BATTERY.FAILED INSTALL VAT AND LOAD TEST THE BATTERY.FAILED 8.4 VOLTS AT HALF THE CCA FOR 15 SECONDS. INSTALL A AMMETER AND CHECK FOR A DRAW ONLY
KM8JM12B05U	4/14/05	31817	35.44	31820 C1513 BRAKE LIGHT SW/INTERR.OPEN IN THE SW. INSTALL THE HI SCAN AND CK FOR DTCS.RECORD AND CLEAR.TEST RELATED WIRING.THERE IS A INTERR.OPE N IN THE SW.REPLACE THE BRALE LAMP SW.VERIFY REPAIR.	WHILE SERVICING VEHICLE FOUND THE ESP LIGHT COMING ON	OPEN SWITC	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 31820 C1513 BRAKE LIGHT SW/INTERR.OPEN IN THE SW. INSTALL THE HI SCAN AND CK FOR DTCS.RECORD AND CLEAR.TEST RELATED WIRING.THERE IS A INTERR.OPE N IN THE SW.REPLACE THE BRALE LAMP SW.VERIFY REPAIR.
KM8JN12D66U	7/20/05	21326	41.55		CUSTOMER STATES BRAKE LIGHTS INOP CHECK AND ADVISE	INTERNAL Failer BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH 93810R00, 0.3 N94 C15

KM8JN72D26U	12/02/05	16738	37.86	REMOVE AND REPLACE BRAKE LIGHT SWITCH AND ALL RELATED PARTS	CUSTOMER STATES ESC LIGHT IS ON	PERFORM SCAN DIAGNOSTICFOUND FAULT CODE FOR BRAKE LIGHT SWITCH	REMOVE AND REPLACE BRAKE LIGHT SWITCH AND ALL RELATED PARTS
KM8JN72D06U	12/05/05	14987	37.86		CUSTOMER STATES ESC LIGHT IS OFF	PERFORM SELF DIAGNOSTIC.....FOUND CODE C1513 BRAKE LIGHT SWITCH	TECH REMOVE AND REPLACE BRAKE LIGHT SWITCH AND ALL RELATED PARTS
KM8JN12D36U	10/14/05	23312	35.76	23315 C1513 SET BK SWITCH OPEN CK/CLEAR DTC C1513 REPLACE BK SWITCH	CUSTOMER STATED HEARS A GRINDING NOISE WHILE TURNING WHEEL TO THE RIGHT HAPPENS ALL THE TIME	WORN L/REAR BUSHING	BUSHING-CROSSMEMBER MOUNTING (ALL) RE BUSHING-CROSSMEMBER MOUNTING (ALL) RE 23312 WORN L/REAR SUBFRAME BUSHING REPLACEWORN/NOISY L/REAR SUBFRAME BUSHING
KM8JN12D36U	10/14/05	23312	35.76	23315 C1513 SET BK SWITCH OPEN CK/CLEAR DTC C1513 REPLACE BK SWITCH	CUSTOMER STATES THAT THE ESC LIGHT COMES ON AND HAS TO TURN OFF CAR TOMAKE IT GO AWAY	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 23315 C1513 SET BK SWITCH OPEN CK/CLEAR DTC C1513 REPLACE BK SWITCH
KM8JN12D35U	6/10/05	17921	30.96		CUST STATES ESP LIGHT STAYS ON AND ONE OTHER LIGHT CAME ON AND WENT OFF. PLEASE CHECK FOR STORED CODES	BROKEN LAMP SWITCH	REPLACED LAMP SWITCH
KM8JN12D35U	6/10/05	17921	30.96		CUSTOMER STATES PERFORM OPEN CAMPAIGN 079, DRIVER AIR BAG MODULE REPLACEMENT	CAMPAIGN 079	PERFORMED CAMPAIGN 079, REPLACEMENT IF AIR BAG MODULE COVER
KM8JN72D46U	8/09/05	31448	30.96	RPLACED BRAKE LIGHT SWITCH	CUST STATES ESC LIGHT COMES ON OFTEN	FOUND CODE C1513	RPLACED BRAKE LIGHT SWITCH
KM8JN72D46U	8/09/05	31448	30.96	RPLACED BRAKE LIGHT SWITCH	CUST STATES AIR BAG LIGHT ON - SOP	FOUND CODES B1701 & B1522	REPLACED DIVER SIDE SEATBELT BUCKLE
KM8JN12D06U	10/11/05	19730	35.76	19730 C1513 BRAKE LIGHT SWITCH OPEN REPLACED THE BRAKE LIGHT SWITCH AND CLEARED THE CODE.	CUS STATES WHEN TURNING CAR SQUEEKSNOISE MORE NOTICABLE FTOM LEFT SIDE THEN RIGHT	F	BUSHING-CROSSMEMBER FRONTREAR MOUNT LH BUSHING-CROSSMEMBER MOUNTING (ALL) RE 19730 SUBFRAME BUSHING IS WORN ON THE FRONTSUBFRAME THE DRIVERS SIDE REAR BUSHINGS ISWORN ON LOOSE REPLACED THE
KM8JN12D06U	10/11/05	19730	35.76	19730 C1513 BRAKE LIGHT SWITCH OPEN REPLACED THE BRAKE LIGHT SWITCH AND CLEARED THE CODE.	CUS STATES ESC LIGHT IS FLASHING ONAND OFF	F	SWITCH ASSY-PARKING BRAKERE SWITCH ASSY-PARKING BRAKERE 19730 C1513 BRAKE LIGHT SWITCH OPENREPLACED THE BRAKE LIGHT SWITCH AND CLEAREDTHE CODE.
KM8JN72D86U	9/30/05	12700	35.76	12700 FAILED BK SWITCH C1513 SET CK/CLEAR DTC C1513 REPLACE OPEN BK SWITCH	CUST STATES ESC LIGHT COMES ON AT TIMES - SOME TIMES IT GOES RIGHT OFF & OTHER TIMES IT STAYS ON TILL CAR IS SHUT OFF	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 12700 FAILED BK SWITCH C1513 SET CK/CLEAR DTC C1513 REPLACE OPEN BK SWITCH
KM8JN12D95U	4/27/05	26184	30.96	REPLACE BRAKE SWITCH	CUST STATES ESC LIGHT ON = SOP	STEERING ANGLE SENSOR FAILURE	SCANNED FOR CODES, FOUND CODES C1260, C1513, REPLACED STEERING AGNLE SENSOR AND BRAKE SWITCH.
KM8JN12D95U	4/27/05	26184	30.96	REPLACE BRAKE SWITCH	CUSTOMER STATES BRAKE ESC LIGHT ON	SCAN FOR CODES C1513 BRAKE SWITCH CIRCUIT	REPLACE BRAKE SWITCH
KM8JN12D06U	12/12/05	19738	70.54	ATT FOR FOUND CODE C1513 BRAKE SWITCH SHORTED CHECKED SWITCH FOUND SWITCH NOT DOING 12V TO OV CYCLE AT TIMES REPLACED			
KM8JN12D75U	6/13/05	13580	37.4	13581 OPEN BK SWITCH DTC C1513 STORED CK/CLEAR DTC B1513, REPLACED OPEN BK SWITCH	CUSTOMER STATES THAT THE ESP LIGHT KEEPS COMING ON- DOES NOT KNOW WHY. ALSO, WOULD LIKE EXPLANATION OF WHAT ESP IS-NOT IN MANUAL	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 13581 OPEN BK SWITCH DTC C1513 STOREDCK/CLEAR DTC B1513, REPLACED OPEN BK SWITCH
KM8JN72D36U	7/29/05	25349	35.44	25349 FAULTY BRAKE LIGHT SWITCH SCAN TEST DIAGNOSIS C1513 BRAKE LIGHT SWITCH INT LOOSING CONTACT REPLACE BRAKE LIGHT SWITCH	CUST HAS AN AIR BAG RECALL TOLD PART WAS HERE	RECALL	DRIVERS AIR BAG COVER MODULE REPLACEMENT 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT 079 25349 RECALL RECALL REPLACE AIR BAG MODCOVER
KM8JM12BX6U	9/09/05	29285	39.94	TECH VERIFIED INTERNAL FAILURE. TECH REPLACED SWITCH ASSY. OKAY NOW.			
KM8JM12BX7U	10/18/06	8112	70.86	ATT TIME FOR SWITCH ASSY. TECH VERIFIED AND FOUND CODE C1513 TESTED BRAKE LAMP SWITCH FOR PROPER ADJUSTMENT. TESTED FOR POWER TO BRAKE LIGHT, FOUND INT OPERATION ON SWITCH CAUSING NO BRAKE LIGHTS AND ABS LIGHT TO COME ON. TEHC REPLACED SWITCH TO CORRECT.			
KM8JN12D56U	12/26/05	24799	70.86	ATT TIME FOR SWITCH ASSY. TECH FOUND CODE C1513 BRAKE LAMP SWITCH MALF, CHECKED FOR PROPER ADJUSTMENT, OK, SWITCH SHORTED. TECH REPLACED BRAKE SWITCH ASSY TO CORRECT. OKAY NOW.			
KM8JN72D36U	7/29/05	25349	35.44	25349 FAULTY BRAKE LIGHT SWITCH SCAN TEST DIAGNOSIS C1513 BRAKE LIGHT SWITCH INT LOOSING CONTACT REPLACE BRAKE LIGHT SWITCH	CUST STATES STABLIITY LIGHT COMES ON	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 25349 FAULTY BRAKE LIGHT SWITCH SCAN TESTDIAGNOSIS C1513 BRAKE LIGHT SWITCH INTLOOSING CONTACT REPLACE BRAKE LIGHT SWITCH

KM8JN72D36U	7/29/05	25349	35.44	25349 FAULTY BRAKE LIGHT SWITCH SCAN TEST DIAGNOSIS C1513 BRAKE LIGHT SWITCH INT LOOSING CONTACT REPLACE BRAKE LIGHT SWITCH	RENTAL/LOANER MUST BE RETURNED WITHIN 4 HOURS OF NOTIFICATION OF YOUR VEHICLE BEING COMPLETED. EASY PASS MUST NOT BE USED ON RENTAL/LOANER VEHICLES.FINES AND EXTRADAY CHARGES WILL BE PASSED ALONG TO THE CUSTOMER.	LOANER	SUBLET REPAIRS
KM8JN12D65U	5/13/05	21324	70.86	ATT TIME FOR SWITCH ASSY. TECH SCANNED AND RETRIEVED CODE C1513 BRAKE LAMP SWITCH MALF SHORTED. TECH REPLACED BRAKE SWITCH AND CLEARED CODES. OKAY NOW.			
KM8JN72D06U	7/19/05	17694	39.94	WHEN VEHICLE ON ESC BUTTON DOES NOT WORK. WHEN VEHICLE OFF LIEGHT GOES ON AND OFF. FOUND CODE C1513 REPLACED BRAKE SWITCH.			
KM8JN12D75U	5/16/05	32927	70.86	ATT TIME FOR SWITCH ASSY. TECH VERIFIED BRAKE LAMP SWITCH MALFUNCTION. REPLACED BRAKE LAMP SWITCH TO CORRECT PROBLEM. OKAY			
KM8JN72D36U	7/29/05	25349	35.44	25349 FAULTY BRAKE LIGHT SWITCH SCAN TEST DIAGNOSIS C1513 BRAKE LIGHT SWITCH INT LOOSING CONTACT REPLACE BRAKE LIGHT SWITCH	RENTAL/LOANER MUST BE RETURNED WITHIN 4 HOURS OF NOTIFICATION OF YOUR VEHICLE BEING COMPLETED. EASY PASS MUST NOT BE USED ON RENTAL/LOANER VEHICLES.FINES AND EXTRADAY CHARGES WILL BE PASSED ALONG TO THE CUSTOMER.	LOANER	RENTAL/LOANER MUST BE RETURNED WITHIN 4 HOURS OF NOTIFICATION OF YOUR VEHICLE BEING COMPLETED. EASY PASS MUST NOT BE USED ON RENTAL/LOANER VEHICLES.FINES AND EXTRADAY CHARGES WILL BE PASSED ALONG TO THE CUSTOMER.
KM8JN72D45U	4/22/05	26133	35.44	26133 FAULTY BRAKE LIGHT SWITCH SCAN TEST DIAGNOSIS C1513 BRAKE SWITCH LOOSING CONTACT INT REPLACE BRAKE LIGHT SWITCH	CUSTOMER STATED ESP LIGHT GOES OFF AND ON/DASH PANEL BY DRIVER WHEEL CAN NOT TURN ON IF OFF	OPEN IN BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 26133 FAULTY BRAKE LIGHT SWITCH SCAN TESTDIAGNOSIS C1513 BRAKE SWITCH LOOSING CONTACTINT REPLACE BRAKE LIGHT SWITCH
KM8JN72D05U	1/07/05	11222	38.32		CHECK ENTIRE BRAKE SYSTEM ESP LIGHT CAME ON	BRAKE SWITCH SHORTED	REPLACED BRAKE LIGHT SWITCH
KM8JN12DX6U	10/26/05	23295	39.94	TECH SCAN COMPUTER, C1237 AND C1513. TECH FOUND BRAKE LAMP SWITCH MALFUNCTION. TECH INSTALLED NEW BRAKE SWITCH, CLEARED TROUBLE CODES. ROAD TESTED TO CONFIRM PROPER OPERSTION NOW.			
KM8JM12B66U	11/24/05	17933	40.26	TECH CHECKED LAMPS, FOUND THEY ARE OKAY. FOUND SWITCH HAS OPEN CIRCUIT. TECH REPLACED SWITCH. OKAY NOW.			
KM8JN12DX5U	4/20/05	37718	70.86	ATT FOR SCAN TOOL CODE C1260 TECH FOUND INTERNAL FAILURE, TECH REPLACED SWITCH...			
KM8JN72D05U	1/07/05	11222	38.32		CUSTOMER REQUESTS PERFORM RECALLS 922	RECALL	PERFORMED RECALL 922
KM8JN72D36U	9/27/05	16950	38.29		ESC LIGHT COMES ON AND OFF CUSTOMER STATES	C1513 SHORTED	REPLACED BRAKE SWITCH AND CLEARED CODES 93810R00 .30 69/15
KM8JN72D95U	4/20/05	16963	38		C/S ESP WARNING LIGHT SAYS OFF INSPITE OF DEPRESSING BUTTON WILL GO OFF TURNING OFF AND ON CAR ADVISE	INOP SHORTED LOP 938810R00 .3 N94 C15	REPLACE BRAKE LIGHT SWITCH
KM8JN12D25U	10/14/04	26679	105.75	ATT FOR OP CODE 93770R00 0.3 FOR SWITCH ASSY-CRUISE FOUND CRUISE CONTROL NOT OPERATING. DUE TO POOR CONTINUITY.			
KM8JN12D76U	11/11/05	15142	39.94	TECH FOUND CODE C1513 BRAKE SWITCH ERROR, FOUND BRAKE SWITCH SHORTED OUT INTERNALLY. TECH REPLACED BRAKE SWITCH TO CORRECT PROBLEM.			
KM8JN72D66U	1/17/06	32194	70.86	ATT TIME FOR SWITCH ASSEMBLY. TECH FOUND CODES C1221 C1513 TESTED AIR GAP AND TONE TINGS AT RR SENSOR OK COMPARED SPEEDS ON ROAD TEST TO OTHER WHEELS IDENTICAL FOUND BRAKE LAMP SWITCH SH. TECH REPLACED BRAKE SWITCH. OKAY NOW.			
KM8JN12D16U	12/07/05	17415	39.94	TECH FOUND BRAKE LIGHT SWITCH DTC C1513. TECH REPLACED BRAKE LIGHT SWITCH. OKAY NOW.			
KM8JN72D06U	8/11/05	28006	38.61	BRAKE LIGHTS INO, CODE C1513, BRAKE SWITCH SHORTED, REPLACED STOP SWITCH	BRAKE LIGHTS INOP	CODE RECOGNIZED C1513 INTERNAL SHORT .	REPLACE BRAKE LAMP SWITCH
KM8JN72D06U	8/11/05	28006	38.61	BRAKE LIGHTS INO, CODE C1513, BRAKE SWITCH SHORTED, REPLACED STOP SWITCH	CHECK ENGINE LIGHT COMES ON	CODE RECOGNIZED P0154 B1 S2 NO ACTIVITY	SCAN TEST REPLACE BANK 1 SENSOR 2 OXYGEN SENSOR CLEAR CODES PASSED
KM8JN72D06U	8/11/05	28006	38.61	BRAKE LIGHTS INO, CODE C1513, BRAKE SWITCH SHORTED, REPLACED STOP SWITCH	CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON LIMP MODE IN WRONG GEAR 3RD HESITATES ETC	CODE P0734 #4 GEAR RATIO STUCK IN FAIL SAFE MODE .	SCAN TEST REPLACE TRANSMISSION FLUSH COOLER LINES

KM8JN72D96U	1/03/06	31468	40.26	TECH VERIFIED CONCERN AND FOUND BRAKE LAMP SWITCH HAS OPEN CIRCUIT. TECH REPLACED BRAKE LAMP SWITCH TO CORRECT. VERIFIED REPAIRS, OKAY NOW.			
KM8JN12D96U	1/03/06	16578	40.26	TECH VERIFIED CONCERN AND FOUND BAD BRAKE LUGHT SWITCH, OPEN CIRCUIT. TECH REPLACED SWITCH TO CORRECT. VERIFIED CORRECT REPAIRS, OKAY NOW.			
KM8JN72D95U	9/17/04	24475	38.55				
KM8JN72D06U	8/11/05	28006	38.61	BRAKE LIGHTS INO, CODE C1513, BRAKE SWITCH SHORTED, REPLACED STOP SWITCH	CUSTOMER REQUESTS PERFORM RECALLS 079 AIR BAG MODULE	RECALL OPEN	PERFORM RECALL 079 .
KM8JN12D26U	9/09/05	27251	38.61	ESC WARNING LIGHT IS ON, CODE B1513, SHORT IN BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES NEEDS THE BRAKES CHECKED, SEVERE PULSATE ON APPLICATION ESP HIGH SPEED SEE HISTORY	ESC WARNING LIGHT ON CODE B1513 SHORTED LOP 93810R00.3 N94 C15	REPL BRAKE LIGHT SWITCH ROAD TEST ON INSPECTED BRAKES OK
KM8JN12D06U	10/20/05	17968	38.29		CUSTOMER STATES THE ESC LIGHT COMES ON INTERMITTENTLY WHEN STARTING AND STAYS ON UNTILL THE NEXT DRIVE CYCLE	POOR CONTACT	REPLACED THE BRAKE LIGHT SWITCH 93810R00 0.3 94/15
KM8JM12B75U	6/01/05	29906	40.26	TECH VERIFIED, FOUND BRAKE LAMP HAS OPEN CIRCUIT CAUSING NO BRAKE LIGHTS AND ESP LIGHT TO BE ON. TECH INSTALLED NEW BRAKE LAMP SWITCH. OKAY NOW. EVERYTHING WORKING AS			
KM8JN72D26U	7/27/05	12291	33.34				
KM8JN12D56U	1/12/06	18378	40.65				
KM8JN12D16U	9/28/05	13566	35.3				
KM8JN12D06U	10/20/05	17968	38.29		CUSTOMER REQUESTS PERFORM RECALLS 079	CAMPAIGN	REPLACED THE DRIVERS AIR BAG MODULE COVER 61B046R0 0.2
KM8JN12D75U	6/02/05	5896	38.29		CUSTOMER STATES ESP LIGHT GOES OFF BY ITSELF, AND WHEN ESP BUTTON IS PUSHED THE INDICATOR WILL NOT ILLUMINATE	SHORT	RETRIEVED DTC C1513, REPLACED THE BRAKE PEDAL SWITCH, RESET THE ABS MODULE. 93810R00 0.3 94/15
KM8JN12D75U	6/02/05	5896	38.29		CUSTOMER REQUESTS PERFORM RECALLS 079	CAMAPIGN	REPLACED THE DRIVERS AIR BAG COVER 61B046R0 0.2
KM8JM12B26U	10/07/05	15333	33.66				
KM8JN12D95U	5/27/05	11543	33.66				
KM8JN12D46U	9/27/05	23783	33.66				
KM8JM12B16U	8/30/05	14837	33.66				
KM8JN72D76U	9/27/05	16865	38.61		CUSTOMER STATES THE ESC LIGHT COMES ON INSTALL SOP	POOR CONTACT	REPALCED THE STOP LIGHT SWITCH 93810R00 0.3 94/15
KM8JN72D76U	10/05/05	21125	67.4	VEHICLE CAME IN WITH ESC LITE ON. HAD TO PERFORM GLOBAL SYSTEM TEST CODE C1513			
KM8JM12B87U	11/08/06	7990	37.71	ESC LITE ON C1513			
KM8JM12B67U	11/03/06	3657	37.39	ECS LITE ON CODE C1513			
KM8JM12B36U	7/15/05	24074	34.86	24074 STOP LAMP SWITCH HAS SHORT IN IT. REMOVED AND REPLACED STOP LAMP SWITCH BRAKE LAMPS ARE NOW OPERATING AS DESIGNED.			
KM8JN72D16U	10/21/05	17385	34.54	17385 C1513 BRAKE SWITCH STICKING Y REPLACE SWITCH	THE "ESC" LIGHT IS ON		STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 17385 C1513 BRAKE SWITCH STICKING Y REPLACESWITCH
KM8JN12D15U	10/08/04	48458	33.15	48458 FAULTY BRAKE SWITCH INSTALLED SOP PART FOR THE CRUISE CONTROL. R&R OLD BRAKE/CRUISE CONTROL SWITCH ADJUSTED SWITCH TO ENSURE PROPER OPERATION OF THE BRAKE LIGHTS AND CRUISE CONTROL. VERIFIED FIX...			
KM8JM12B86U	1/06/06	16046	37.39	CODE C1513			
KM8JN72D06U	9/29/05	18401	37.71	ESC LITE ON C1513 NEED RQ0 OPER #			
KM8JN72D26U	9/28/05	40356	65.76	VEHICLE CAME IN WITH CODES C1237/C1260/C1513 HAD TO DO SCAN TEST NO RQ0 OPER #			
KM8JN12D45U	3/25/05	1889	35.7				
KM8JM12B56U	7/11/05	30199	34.54	30207 BRAKE LIGHT SWITCH GDS SCAN TEST ESC SYSTEM. CODE 2513 SET. TEST CIRCUIT ON TERMINAL 21 OF THE HECU CONNECTOR OK. REMOVED THE TRIM ON THE DASH TO ACCESS MC12, MC11, AND EM06. ALL CONNECTORS OK AND HARNESS OK REPLACE BRAKE LIGHT SWITCH AND CLEAR CODES			
KM8JN72D46U	9/22/05	26541	31.4	CUSTOMER STATES ESC LIGHT WILL TURN ITSELF OFF TECH ESC OFF LIGHT COMES ON THEN OFF USE SCANNER AND FOUND C-1513 CODE C1237 BR SW CODE USE SCANNER DIAGNOSIS TECH REPLACED DEFECTIVE BRAKE SWITCH STICKS AND CLEARED 1513 / 1237	CUST STATES ESC LIGHT WILL TURN ITSELF OFF ESC OFF LIGHT COMES ON THEN OFF	USE SCANNER FOUND C-1513 CODE,C-1237 BR SW CODE	USE SCANNER- DIAGNOSIS,ORDERED BRAKE SWITCH REPLACED DEFECTIVE BRAKE SWITCH STICKS- 1515/1237CLEARED
KM8JM12B46U	7/09/05	14709	32.14				

KM8JN72D26U	7/28/05	21808	33.34	ESC LIGHT COMES ON WHILE DRIVING. TECH LINE REF 269151. CK RESISTANCE BETWEEN PIN #2 AT HECU AND PIN 4 AT BRAKE SWITCH FOUND .30HM AT RESISTANCE. MEASURED VOLTAGE BETWEEN TERMINAL 21 OF HECU AND BODY GROUND FOUND 0VOLT WITH THE PEDAL PRESSED AND 10V WITH			
KM8JN72D66U	7/27/05	14935	29.76	CUSTOMER STATES THAT OUTPUT SIGNAL ERRATIC AND SIGNAL LOSS INTERMITTENT TPS FAULTY TECH REPLACED BRAKE LIGHT SWITCH			
KM8JN72D66U	7/27/05	7725	31.4	CUSTOMER STATES ECS LIGHT IS ON TECH SCANNED AND FOUND DTC C1513 BRAKE LIGHT SWITCH SHORT /OPEN TECH REPLACED BRAKE LIGHT SWITCH CLEARED CODES NO PROBLEMS FOUND AT THIS TIME	CUSTOMER SAYS ECS LIGHT IN ON SOP	SCANNED AND FOUND DTC C1513 BRAKE LIGHT SWITCH SHORT/OPEN.	REPLACED BRAKE LIGHT SWITCH CLEARED CODE NO PROBLEMS FOUND AT THIS TIME.
KM8JN72D46U	7/27/05	26222	29.44	CUSTOMER STATES ESC LIGHT WILL COME ON AND OFF TECH PULLED TWO CODES C1513 BRAKE LAMP SWITCH AND C1235 PRESSURE SENSOR TOLD BY TERRY TO REPLACE BRAKE LAMP SWITCH FIRST TECH REPLACED BRAKE LAMP SWITCH AND RECHECKED AND LIGHT WAS OFF	CUSTOMER SAYS ESC LIGHT WILL COME ON AND OFF	PULLED TWO CODES C1513 BRAKE LAMP SWITCH AND C1235 PRESSURE SENSOR	TOLD BY TERRY TO REPLACE BRAKE LAMP SWITCH FIRST. REPLACED BRAKE LAMP SWITCH.
KM8JN12D16U	9/29/05	13274	36.66	VEHICLE HAS NO BRAKE LIGHT. FOUND BRAKE LAMP SWITCH SHORTED OUT. REPALCE FAULTY BRAKE LAMP SWITCH.	AS PER INSPECTION TECH FOUND THAT THE VEHICLE HAS NO BRAKE LIGHTS. TECH TESTED BULBS, ALL GOOD. CHECKED	TECH CHECKED ALL CONNECTIONS - GOOD. TECH FOUND AN OPEN IN THE BRAKE LAMP SWITCH CIRCUIT.	TECH REMOVED AND REPLACED THE BRAKE LAMP SWITCH. TESTED OAKY
KM8JN12D16U	9/29/05	13274	36.66	VEHICLE HAS NO BRAKE LIGHT. FOUND BRAKE LAMP SWITCH SHORTED OUT. REPALCE FAULTY BRAKE LAMP SWITCH.	PERFORM RECALL 079	RECALL	COMPLETED RECALL REPLACED DRIVERS AIR BAG COVER MODULE.
KM8JN72D16U	7/20/05	10910	34.54		CUST STATES ESO LIGHT CAME ON IN DASH OFF NOW	PERFORM SCAN FOUND CODE1513 BRAKE LAMP SWITCH IS STICKING, REPL SWITCH	93810R00
KM8JN72D35U	6/30/05	13779	29.44	CUSTOMER STATES SOMETIMES STOP LAMPS DONT WORK TECH USED SCANN TOOL TO FIND INTERMITTANT OPEN CIRCUIT P1573 BRAKE CIRCUIT TECH REPLACED BRAKE SWITCH			
KM8JM12B56U	10/20/05	37320	31.41		C/S AIRBAG LIGHT WAS ON-PART IS HERE	RECALL 079 (WARR)	REPLACED AIR BAG COVER
KM8JM12B56U	10/20/05	37320	31.41		C/S ESC LIGHT CAME ON FOR A DAY	HIGH RESISTANCE IN BRAKE LAMP SWITCH (WARR)	DAIGNOSED C1513 AND REPLACED BRAKE LAMP SWITCH
KM8JN72D06U	8/12/05	17121	34.54		C/S ESC LIGHT COMES ON DASH AT TIMES CK ADVSE	FOUND CODE C1513 BRAKE SWITCH THAT SHORTED CAUSING ESC LIGHT	TECH R&R BRAKE SWITCH RESET SYSTEM OK AT THIS TIME
KM8JN12D05U	4/25/05	10882	34.54		SEE PARTS DEPT. TO INSTALL PREVIOUSLY ORDERED PART(S) BRAKE SWITCH	TECH RAN SCAN CODE FOUND C1513 BRAKE LAMP SWITCH SHORTED	REPLACED STOP SWITCH
KM8JN72D66U	10/17/05	13999	36.5		CUST STATES WHEN DRIVING ESP LIGHT COMES ON, SHUTS TRUCK OFFRESTARTS LIGHT OUT	CODE B1513 BRAKE SWITCH SHORTED REPLACED BRAKE SWITCH	
KM8JM12B65U	5/20/05	33315	26.46	REPLACED FAULTY BRAKES SWITCH	CUST STATES ESP LIGHT COMES ON	FOUND CODE C1513 BRAKE LAMP SWITCH	REPLACED FAULTY BRAKES SWITCH
KM8JM12B56U	10/20/05	37320	31.41		C/S CONSOLE WILL NOT SHUT-PART IS HERE	CONSOLE LID DEFECTIVE (WARR)	REPLACED CONSOLE LID
KM8JM12B56U	10/20/05	37320	31.41		P/S GRAB HANDLE IS BROKEN=PART HERE	PASSENGER SIDE GRAB HANDLE BECAME DETACHED (WARR)	REPLACED HANDLE
KM8JM12B15U	12/24/04	5041	31.42				
KM8JN12D36U	10/12/05	16234	29.16	REMOVED AND REPLACED SHORTED BRAKE LIGHT SWITCH	CUST STATES ESC LIGHT ON/OFF	SCAN CODE FOR BRAKE LIGHT SWITCH	BODY ELECTRICAL BODY ELECTRICAL REMOVED AND REPLACED SHORTED BRAKE LIGHTSWITCH
KM8JN12D56U	11/24/05	21536	34.86		CUSTOMER STATES ESC LIGHT IS ON AND WHEELS LOCK	SCAN TESTED FOR CODES FOUND CODE P1513 BRAKE LIGHT SWITCH SHORTED	REMOVED AND REPLACED BRAKE LIGHT SWITCH CLEARED CODE
KM8JM12B66U	7/11/05	5583	36.5		CUST STATE ESP LIGHT ON - S/O/P LAST VISIT CODE P01501 BRAKE SWITCH OPEN	REPLACED STOP LIGHT SWITCH AND CLEAR CODE	
KM8JM12B66U	7/11/05	13858	26.46	REMOVED AND REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ESP LIGHT GOES ON AND OFF AS DRIVING VEHICLE	SCAN TESTED FOUND CODE B1513 BRAKE LIGHT SWITCH	REMOVED AND REPLACED BRAKE LIGHT SWITCH
KM8JN72D25U	6/10/05	680	31.12		CUSTOMER STATES THAT CRUISE IS INOPERATIVE	CHECKED AND FOUND CRUISE CONTROL STOP LAMP SWITCH INOPERATIVE	REPLACED SWITCH
KM8JN72D17U	9/16/06	3806	32.76	C1235 C1237 B1513 REPLACE BRAKE LIGHT SWITCH			
KM8JN72D35U	6/10/05	10440	32.76	REPLACED STOP LAMP SWITCH	ESC LIGHT COMES ON	F	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE REPLACED STOP LAMP SWITCH F
KM8JN12D05U	5/31/05	20871	34.54				
KM8JM12B27U	7/18/06	10214	34.86		C/S WHEN DRIVING CAR AND HITTING BRAKES ON SOME INCLINE ABS KICKS IN VERY HARD	TECH RAN SCAN CODE FOUND C1513 STOP SWITCH SHORTED	REPLACED STOP SWITCH
KM8JM12B27U	7/18/06	10214	34.86		RECALL 079		RECALL 079
KM8JN72D55U	5/24/05	37974	32.76	C1209 C1513 P1753 REPLACE WHEEL SPEED SENSOR REPLACE BRAKE LIGHT SWITCH - WHEEL SPEED SENSOR FOUND BRAKE LIGHT SWITCH SIGNAL SLOW SOMETIMES	ESP LIGHT ON	SIGNAL SLOW AT TIMES	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE C1209 C1513 P1753 REPLACE WHEEL SPEED SENSORREPLACE BRAKE LIGHT SWITCH - WHEEL SPEEDSENSOR FOUND BRAKE LIGHT SWITCH SIGNAL SLOW SOMETIMES

KM8JN72D66U	9/29/05	26620	32.76	REPLACE BRAKE LIGHT SWITCH	CUSTOMER STATES THE ESC LIGHT COME ON BY ITSELF WHEN IT IS TURNED OFF	15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE REPLACE BRAKE LIGHT SWITCH
KM8JN12D06U	7/29/05	17781	32.3	ESC LIGHT ON- C1513 BRAKE LIGHT CIRCUIT MAL 3- REPL BRAKE LIGHTSWITCH	ESC LIGHT IS ON	C1513 BRAKE LIGHT CIRCUIT MAL.3 INTERMITTENT	REPLACED BRAKE LIGHT SWITCH. OPCODE 93810R00 .3
KM8JN72D56U	8/25/05	25741	34.86		CUST STATES ESC LIGHT COMES ON WHEN DRIVING	CODE C1513 BK LAMP SW MA 1 FOUND STOP LAMP SWITCH SHORTED	REPLACED STOP LAMP
KM8JN72D56U	8/09/05	22702	26.46		CUST STATES ESC LITE IS ON	FOUND BRAKE LAMP SWITCH MALFUCTION	REPALCED STOP LAMP
KM8JN72D15U	12/08/04	31528	33.15		CUST STATES TRACTION CONTROL LIGHT COMES ON WHEN MAKING TURNS - LAST VISIT ORDERED PRESSURE TANK SENSOR/BRAKE LAMP SWITCH	CHECKED AND FOUND CODES C1513 BRAKE SWITCH ERROR AND CODE C1504 PRESSURE SWITCH LEAKING	REPLACED PRESSURE SWITCH AND BRAKE LIGHT SWITCH, CLEAR CODES
KM8JN72D36U	7/29/05	11585	36.5				
KM8JN12DX5U	7/09/05	27501	31.1	TCS LIGHT ON- REPLACE SWITCH	TCS LIGHT ON-SPECIAL ORDER PART TO INSTALL		REPLACED BRAKE LIGHT SWITCH LABOR 93810R00 0.3
KM8JN72D45U	6/10/05	13101	31.1	ESP LIGHT COMES ON & OFF- CODE FOR STOP LAMP SWITCH- REPLACE	ESP LIGHT COMES ON AND GOES OFF AT TIMES	B1513 BRAKE SWITCH CIRCUIT.	CHECKED CLEARANCE ON BRAKE SWITCH.OK REPLACED BRAKE SWITCH. OPCODE 93810R00 LABOR 3
KM8JM12B06U	10/06/05	7213	30.34	ESC LIGHT GOES ON/OFF- C1513- DEFECTIVE BRAKE LIGHT SWITCH- REPLACE	ESC LIGHT GOES ON/OFF	C1513 DEFECTIVE BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH AND ADJUSTED OPCODE 93810R00 .3
KM8JN72D36U	7/29/05	10919	25.2		C/S HAS ESE LIGHT ON FOR FEW DAYS AND THEN WENT OFF	PERFORMED SCAN C1513 BRAKE SWITCH CIRCUIT FOUND BRAKE LIGHT SWITCH LOOSE	ADJUST AND TIGHTEN BRAKE LIGHT SWITCH
KM8JN72D25U	6/20/05	6235	36.5		CUST STATES ESP LIGHT STAYS ON - S/O/P LAST VISIT	FOUND BRAKE LIGHT SWITCH SHORTED	REPLACED BRAKE LIGHT SWITCH
KM8JM12B26U	7/15/05	7771	25.2		CUST STATES ELECTRONIC STABILITY LIGHT CAME ON AND STAYED ON 2-3 DAYS. NOW OFF	CODE G1513 BRAKE LAMP SWITCH MISADJUSTED ADJUSTED SWITCH	
KM8JM12B06U	10/06/05	7213	30.34	ESC LIGHT GOES ON/OFF- C1513- DEFECTIVE BRAKE LIGHT SWITCH- REPLACE	BRAKE LIGHT OUT		REPLACED LEFT BULB OPCODE 18642R00 .2
KM8JN12D16U	11/01/05	17283	51.34	ESC LIGHT GOES ON/OFF-CODE FOR BRAKE SWITCH- REPLACE	ESC LIGHT GOES ON/OFF	DIAG WITH SCAN TOOL C1513 BRAKE SWITCH SHORTED OR OPEN	REPLACED BRAKE LIGHT SWITCH 93810R00 .3, 93810RPO .3, TOTAL .6
KM8JN12DX6U	7/29/05	12017	34.4		CUSTOMER STATES ESC LIGHT WILL NOT DISENGAGE	SCAN TOOL CODE C1513 - FAULTY BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH N94 C15
KM8JN72DX6U	10/17/05	17434	34.54		C/S THE ESC WARNING LITE COMES ON INTERMITT	CODE C1513 FAULTY BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN72DX6U	10/17/05	17434	34.54		RECALL 079 D/S AIRBAG		PERFORMED RECALL
KM8JN72D36U	7/29/05	26778	34.86		C/S ESC LIGHT ON DASH CK ADVISE	TECH FOUND CODE C1513 BRAKE LIGHT SWITCH ALSO CAUSED TAIL LIGHT FAILER	TECH R&R SWITCH RESET SYSTEM OK AT THIS TIME
KM8JN12DX6U	7/29/05	12017	34.4		CUSTOMER STATES REAR CENTER SEAT BELT CRACKED	VERIFIED CUSTOMER CONCERN	REPLACED REAR CENTER SEAT BELT
KM8JN12DX6U	9/26/05	22016	55.54	TECH FOUND WARNING LIGHTS ON, SCANNED VEH.	CUST STATES THAT THE ECS LIGHT KEEPS COMING ON WHILE DRIVING	BRAKE LIGHT SWITCH FOUND TO HAVE OPEN SHORT	REPLACED BRAKE LIGHT SWITCH ASSMBLY
KM8JN12D76U	7/20/05	19776	55.54	TECH FOUND CODE C1513, REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES THAT THE ESC LIGHT COMES ON WHILE DRIVING AND WONT SHUT OFF UNLESS HE RESTARTS VEH.	TECH FOUND CODE C1513, BRAKE SWITCH CIRCUIT.	REPLACED BRAKE LIGHT SWITCH, CLEARED CODE. RETESTED OKAY.
KM8JN12D76U	7/25/05	6	33.38	BRAKE LIGHTS INOP	CUSTOMER STATES BRAKE LIGHTS ARE INOP AND ECS LIGHT IS ON	SCANNED AND FOUND CODE 1513 SEE ATTACHED STORY FOR COMPLETE DIAGNOSIS	REPLACED STOP LIGHT SWITCH AFTER DIAGNOSIS OK NOW TT TIME
KM8JN72D35U	4/22/05	12115	32.59				
KM8JN72DX6U	10/21/05	14578	32.91				
KM8JN12D26U	1/06/06	8805	32.59				
KM8JM12B36U	9/13/05	13451	55.86	TECH FOUND BRAKE LAMP SWITCH INTERNAL FAILURE, REPLACED SWITCH CLEARED CODE C1513, RECHECKED OKAY, USED ATT FOR SCAN TOOL OP.	CUSTOMER STATES THE ESC LIGHT HAS BEEN COMING ON WHEN DRIVING. NOTE IT IS NOT ON AT THIS TIME	TECH FOUND CODE C1513 SET, BRAKE LAMP SWITCH. INTERNAL FAILURE.	REPLACED BRAKE LAMP SWITCH, ERASED DTC, RECHECKED OKAY AT THIS TIME.
KM8JN12D86U	7/29/05	8509	23.1		CUSTOMER STATES ESC LIGHT HAS COME ON WHEN SETTING AT IDLE	SCAN TOOL CODE C1513 AND C1237	TESTED STOP LAMP SWITCH - NO FAULTS FOUND FOUND INCORRECT CLEARANCE ON STOP LAMP SWITCH, ADJUSTED STOP LAMP SWITCH, CLEARED CODES AND VERIFIED PROPER
KM8JN12D65U	6/22/05	12869	34.4		CUSTOMER STATES ESC LIGHT CAME ON THE OTHER DAY BUT IS OFF TODAY	SCAN TOOL CODE C1513 BRAKE LIGHT SWITCH FAULTY	REPLACED BRAKE LIGHT SWITCH AND CHECK FOR NORMAL OPERATION
KM8JN72D96U	8/11/05	25350	56.16	CODE C1513 STORED - TT TIME CLAIMED FOR			
KM8JN72D35U	10/06/04	1863	34.32				
KM8JN12D86U	8/11/05	20711	30.94				
KM8JN12D26U	10/09/05	25944	30.94				
KM8JN12D57U	11/10/06	7938	55.86	VEH. CAME IN ESC LIGHT DISPLAYED, SCANNED VEH. FOUND CODE C1513, FAULTY BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH, CLEARED CODE, RETESTED OKAY.	CUSTOMER STATES ESC LIGHT CAME ON TODAY BUT GOES AWAY ONCE SHE RESTARTS THE VEHICLE	SCAN TOOL CODE C1513 FAULTY BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH AND TEST DROVE VEHICLE FOR NORMAL OPERATION
KM8JN72DX6U	10/18/05	18303	23.7		CUSTOMER STATES THAT ESC LIGHT WILL COME ON AND STAY ON WHILE DRIVING, HAS NOW GONE OFF	BRAKE SWITCH IS STICKING	REPLACED BRAKE SWITCH
KM8JN12D35U	5/19/05	18537	42.2		BRAKE LIGHTS INOP MOST TIMES. BRAKE SWITCH FAILED.		REPLACED BRAKE SWITCH. BRAKE LIGHTS WORK FINE NOW.
KM8JN12D35U	5/19/05	18537	42.2		CAR RENTAL -- HPP		
KM8JN12D56U	8/08/05	30147	47.16		CUSTOMER STATES "ESC OFF" LIGHT COMES ON RANDOMLY. HAPPENS ABOUT 10% OF THE TIME.	FAULT CODE FOUND IN SYSTEM. C1513 PERFORMED INSPECTION. FOUND BRAKE LIGHT SWITCH OPEN CIRCUIT CAUSING ESC OFF LIGHT COMING ON.	REPLACED AND ADJUSTED BRAKE SWITCH. CLEAR CODE. ROAD TEST. OK NOW.
KM8JN72DX6U	10/18/05	18303	23.7		RIGHT FRONT AND LEFT REAR WHEEL FLAIR STRIPS FADED INSTALL SOP	MATERIAL DEFECT	SUBLET TO BODY SHOP

KM8JN72D76U	7/29/05	15182	33.36		CUSTOMER STATES- ESC LIGHT ON- CHECK AND ADVISE	SCANNED FOR CODES PULLED C1616 CAN BUS OFF 1611 LOCT COMM. 1612 LOST COM WITH TCM 1613 WRONG MESS, 1513 BRAKE SWITCH	REPLACED BRAKE SWITCH- CLEARED CODES
KM8JN72D06U	8/18/05	38059	49.16	ATT FOR DIAG TIME	CUSTOMER STATES ESC LIGHT WILL COME ON INTERMITTENTLY	TRACED SOURCE OF CONCERN TO BRAKE SWITCH - NO ALWAYS MAKING PROPER CONTACT - CODE 1513	REPLACED BRAKE SWITCH
KM8JN72D56U	8/11/05	23360	33.66				
KM8JN12D95U	11/15/04	50383	36.43		CUSTOMER REPORTS, CHECK ENGINE LIGHT IS ON (MIL) CHECK FOR CAUSE AND REPORT. RECORD DTC'S STORED	FAULT CODE P0130,BANK 2,OXYGEN SENSOR 1 HAS LESS MOVEMENT THAN OTHER BANK	REPLACED OXYGEN SENSOR,CLEARED CODE
KM8JN12D95U	11/15/04	50383	36.43		REPLACE HOSE CLAMPS FOR AIR INTAKE TUBE PER TSB	CLAMPS NOT HOLDING HOSE IN PLACE	REPLACED CLAMPS
KM8JN12D95U	11/15/04	50383	36.43		CUSTOMER STATES ESC LIGHT IS ON AND OFF WHILE DRIVING	FAULT CODES,C1208,C1237,C1211,C1260,C1513.STOP LIGHT SWITCH INTERMITTENT OPEN CIRCUIT	REPLACED STOP LIGHT SWITCH
KM8JM12B55U	6/01/05	19981	35.3				
KM8JM12B75U	10/27/04	34486	35.3				
KM8JN12D26U	9/22/05	3527	36.6		CUSTOMER STATES ESC OFF LIGHT COMES ON WHEN DRIVING.	VERIFIED CONCERN SCANED FOR CODES FOUND C1513 BRAKE LAMP SWITCH. FOUND BRAKE LAMP SWITCH IS BROKEN	REPLACED BRAKE LAMP SWITCH AND CLEARED CODE 93810R00 .3 N94-C15
KM8JN72D86U	12/02/05	20688	37.54	CUSTOMER STATES ESC LIGHT IS ON WHILE DRIVING. TECH VERIFIED CONCERN AND FOUND STOP LIGHT SWITCH INOP. TECH REPLACED STOP LIGHT SWITCH TO CORRECT CONCERN.	CUSTOMER REPORTS THAT THE SECOND ROW LEFT SIDE SEAT BELT BUCKLE IS COMING APART AT THE SEAM	BUCKLE COVERS CAME APART	SNAPPED BACK TOGETHER
KM8JN72D86U	12/02/05	20688	37.54	CUSTOMER STATES ESC LIGHT IS ON WHILE DRIVING. TECH VERIFIED CONCERN AND FOUND STOP LIGHT SWITCH INOP. TECH REPLACED STOP LIGHT SWITCH TO CORRECT CONCERN.	CUSTOMER REPORTS ESC LIGHT ON WHILE DRIVING	STOP LIGHT SWITCH INOP,OPEN CIRCUIT	REPLACED STOP LIGHT SWITCH
KM8JN72D66U	12/03/05	14449	37.86	REPLACED BRAKE STOP LIGHT SWITCH	CUSTOMER STATES THAT INTERMITTENTLY THE ESC WARNING LIGHT COEMS ON,STAYS ON UNTIL IGNITION	FAULT CODE C1513,BRAKE SWITCH HAS OPEN CIRCUIT	REPLACED BRAKE STOP LIGHT SWITCH
KM8JN12D26U	9/22/05	3527	36.6		CUSTOMER STATES BRAKE LIGHTS DO NOT GO OFF.	VERIFIED CONCERN SEE JOB 2	
KM8JM12B16U	7/12/05	55328	31.26		CUST STATES BRAKE LAMPS INOP	BRAKE LIGHT SWITCH SHORTED	REPLACED THE BRAKE LIGHT SWITCH
KM8JM12B56U	7/21/05	25980	31.26		CUST STATES ESC LIGHT KEEPS COMING ON - ONLY COMES ON PERIODICALLY - HAS TO SHUT DOWN VEH TO RESTART AND CLEAR	C1513 BRAKE LAMP SWITCH BRAKE LIGHT SWITCH SHORTED	REPLACED THE BRAKE LIGHT SWITCH
KM8JN12D85U	8/31/04	156	90				
KM8JN12D46U	11/01/05	32194	37.86		CUSTOMER REPORTS, CHECK ENGINE LIGHT IS ON (MIL) CHECK FOR CAUSE AND REPORT. RECORD DTC'S STORED	FAULT CODE P0130,OXYGEN SENSOR MALFUNCTION	ORDERED OXYGEN SENSOR
KM8JN12D46U	11/01/05	32194	37.86		CUSTOMER STATES ESC WARNING LIGHT ON AND OFF WHILE DRIVING	FAULT CODE C1503,C1513,STOP LIGHT SWITCH MALFUNCTION	REPLACED STOP LIGHT SWITCH
KM8JN12D46U	11/01/05	32194	37.86		CUSTOMER STATES, SOUND SYSTEM HAS THE FOLLOWING CONCERNS: LOADED 1 CD,ACCEPTED CD,WOULD NOT PLAY CD,DISPLAY SAYS NO CD,HAS NOT TRIED ANOTHER CD	INTERNAL RADIO FAILURE	REPLACED RADIO
KM8JM12B96U	8/22/05	26304	113.95	26304 VERIFIED CONCERN ESC LIGHT WAS ON PULLED CODES AND FOUND BRAKE LAMP SWITCH CODE CHECKED BRAKE SWITCH FOUND THE CIRCUIT WAS OPEN WHEN SWITCH WAS ON REPLACED SWITCH ALSO FOUND BROKEN WIRE IN BRAKE SWITCH HARNESS REPAIRED HARNESS CLEARED CODES ALL OK A	CUSTOMER STATES THERE IS A CLUNKINGNOISE COMING FROM THE FRONT END OF THE VEHICLE SOP	SEPERATED	LOWER ARM BUSHING (FRONT,RH) LOWER ARM BUSHING (FRONT,RH) 26304 NOISE FROM FRONT END OVER BUMPS,VERIFIED PROBLEM DURING ROAD TEST. FOUND RT.FRONT LOWER FOWARD CONTROL ARM BUSHINGSEPERATED FROM SLEEVE MAKING NOISE OVERBUMPS. REMOVED LOWER CONTROL ARM AND P
KM8JN72D55U	5/19/05	7611	37.54	CUSTOMER STATES ESP LIGHT IS ON WHILE DRIVING. TECH VERIFIED CONCERN AND FOUND STOP LIGHT SWITCH HAS INTERNAL OPEN. TECH REPLACED STOP LIGHT SWITCH TO CORRECT CONCERN.	CUSTOMER CONCERN THAT THE RIGHT SIDE REAR DOOR BODY SIDE MOULDING LOOSE	SEALER IN CHANNEL	REMOVED SEALER,REINSTALLED MOULDING
KM8JN72D55U	5/19/05	7611	37.54	CUSTOMER STATES ESP LIGHT IS ON WHILE DRIVING. TECH VERIFIED CONCERN AND FOUND STOP LIGHT SWITCH HAS INTERNAL OPEN. TECH REPLACED STOP LIGHT SWITCH TO CORRECT CONCERN.	CUSTOMER STATES BRAKES FEEL STIFF. CHECK AND ADVISE.		DONE YESTERDAY
KM8JN72D55U	5/19/05	7611	37.54	CUSTOMER STATES ESP LIGHT IS ON WHILE DRIVING. TECH VERIFIED CONCERN AND FOUND STOP LIGHT SWITCH HAS INTERNAL OPEN. TECH REPLACED STOP LIGHT SWITCH TO CORRECT CONCERN.	CUSTOMER STATES PERFORM RECALL 079, AIR BAG MODULE COVER	RECALL	INSTALLED NEW COVER

KM8JM12B96U	8/22/05	26304	113.95	26304 VERIFIED CONCERN ESC LIGHT WAS ON PULLED CODES AND FOUND BRAKE LAMP SWITCH CODE CHECKED BRAKE SWITCH FOUND THE CIRCUIT WAS OPEN WHEN SWITCH WAS ON REPLACED SWITCH ALSO FOUND BROKEN WIRE IN BRAKE SWITCH HARNESS REPAIRED HARNESS CLEARED CODES ALL OK A	CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF AND THE BRAKE LIGHTS ARE IN OP-ADVISE!	BROKEN WIRE IN HARNESS CAUSING BRAKE LAMP SWITCH TO FAIL AND BLOW A FUSE-CONTACTED TECH LINE AND ROGER LAFLUER ASSISTED WITH CLAIM	REPLACE STOP LAMP SWITCH REPLACE STOP LAMP SWITCH 26304 VERIFIED CONCERN ESC LIGHT WAS ON PULLED CODES AND FOUND BRAKE LAMP SWITCH CODE CHECKED BRAKE SWITCH FOUND THE CIRCUIT WAS OPEN WHEN SWITCH WAS ON REPLACED SWITCH ALSO FOUND BROKEN WIRE IN BRAKE SWITCH
KM8JM12B96U	8/22/05	26304	113.95	26304 VERIFIED CONCERN ESC LIGHT WAS ON PULLED CODES AND FOUND BRAKE LAMP SWITCH CODE CHECKED BRAKE SWITCH FOUND THE CIRCUIT WAS OPEN WHEN SWITCH WAS ON REPLACED SWITCH ALSO FOUND BROKEN WIRE IN BRAKE SWITCH HARNESS REPAIRED HARNESS CLEARED CODES ALL OK A	CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF AND THE BRAKE LIGHTS ARE IN OP-ADVISE!	BROKEN WIRE IN HARNESS CAUSING BRAKE LAMP SWITCH TO FAIL AND BLOW A FUSE-CONTACTED TECH LINE AND ROGER LAFLUER ASSISTED WITH CLAIM	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 26304 VERIFIED CONCERN ESC LIGHT WAS ON PULLED CODES AND FOUND BRAKE LAMP SWITCH CODE CHECKED BRAKE SWITCH FOUND THE CIRCUIT WAS OPEN WHEN SWITCH WAS ON REPLACED SWITCH ALSO FOUND BROKEN WIRE IN BRAKE SWITCH
KM8JN72D55U	5/19/05	7611	37.54	CUSTOMER STATES ESP LIGHT IS ON WHILE DRIVING. TECH VERIFIED CONCERN AND FOUND STOP LIGHT SWITCH HAS INTERNAL OPEN. TECH REPLACED STOP LIGHT SWITCH TO CORRECT CONCERN.	CUSTOMER STATES LEFT PASSENGER DOOR MOULDING HAS COME LOOSE ON DOOR AND BODY OF VEHICLE. CHECK AND ADVISE.	SEALER WAS DOWN IN CHANNEL AND PREVENTING MOULDING FROM SEATING	REMOVED SEALER AND REINSTALLED MOULDING
KM8JN72D55U	5/19/05	7611	37.54	CUSTOMER STATES ESP LIGHT IS ON WHILE DRIVING. TECH VERIFIED CONCERN AND FOUND STOP LIGHT SWITCH HAS INTERNAL OPEN. TECH REPLACED STOP LIGHT SWITCH TO CORRECT CONCERN.	CUSTOMER STATES ESP LIGHT READS OFF WHILE DRIVING. CAR SAT FOR 2 MONTHS.	STOP LIGHT SWITCH HAS INTERNAL OPEN	REPLACED STOP LIGHT SWITCH
KM8JM12BX5U	5/16/05	14854	33.66	14854 VERIFIED CONCERN BRAKES LIGHTS ARE NOT WORKING CHECKED BRAKE SWITCH FOUND AN INTERMITTANT OPEN CIRCUIT INTERNALLY NEEDS A BRAKE SWITCH REPLACED CONDITION CORRECTED	CUSTOMER STATES BRAKE LIGHT ARE INTERMITTANTLY NOT WORKING-SOP	VERIFIED CONCERN REAR BRAKES INTERMITTANT NOT WORKING-REPLACED BRAKE LAMP STOP LAMP SWITCH CONDITION CORRECTED	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 14854 VERIFIED CONCERN BRAKES LIGHTS ARE NOT WORKING CHECKED BRAKE SWITCH FOUND AN INTERMITTANT OPEN CIRCUIT INTERNALLY NEEDS A BRAKE SWITCH REPLACED CONDITION CORRECTED
KM8JN72D06U	8/17/05	33517	33.66	33517 ESP LIGHT ON. VERIFIED PROBLEM. USED GDS TO PULL CODE C1513 BRAKE SWITCH. VERIFIED NO BRAKE LIGHTS. FOUND SWITCH OPEN INTERNALLY. INSTALLED NEW BRAKE SWITCH. OK AT THIS TIME.	CUSTOMER STATES-ESP LIGHT ON-CHECK-ADVISE	VERIFIED CONCERN-ESC LIGHT ON ALSO NO BRAKE LIGHTS-FOUND STOP LAMP SWITCH OPEN CIRCUIT-REPLACED SWITCH CO CONDITION CORRECTED	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 33517 ESP LIGHT ON. VERIFIED PROBLEM. USED GDS TO PULL CODE C1513 BRAKE SWITCH. VERIFIED NO BRAKE LIGHTS. FOUND SWITCH OPEN INTERNALLY. INSTALLED NEW BRAKE SWITCH. OK AT THIS TIME.
KM8JN12D15U	4/14/05	18518	33.06	ESP LIGHT COMES WHILE DRIVING. FOUND BRAKE SWITCH MALFUNCTION. REPLACED			
KM8JN12D36U	11/23/05	23444	33.06	ECS LIGHT ON. SCAN TEST FOUND CODE E1237. PRESSURE SENSOR, AND E4513 BRAKE LAMP SWT MALFUNCTION. REPLACED BRAKE STOP SWT	CUSTOMER STATES ECS LIGHT IS ON CHECK AND ADVISE	HI-SCAN FOUND E1237 PRESSURE SENSOR, E4513 BRAKE LAMP SWITCH BRAKE LAMP SWITCH FAILURE INTERNAL MALF.	REPLACED
KM8JN12D26U	9/23/05	16744	32.74		CUSTOMER STATES ESC LIGHT SOMETIMES DOES NOT WANT TO TURN OFF WHILE DRIVING. CHECK & ADVISE	SCAN TEST: CODE C1237, C1513 PRESSURE SENSOR, BRAKE LIGHT SWITCH MALFUNCTION. FOUND BRAKE LIGHT SWITCH MALFUNCTION	REPLACED BRAKE LIGHT SWITCH AND RETEST OK
KM8JN72D86U	8/10/05	36620	57.66	36620 CHECK FOR CODE SET AND REASON FOR ESC LIGHT. CODE C1513 BRAKE SWITCH CKT. CHECK OPERATION OF SWITCH W/SCAN TOOL. AT TIMES YOU HAVE TO PRESS HARD TO GET SWITCH TO OPERATE PROPERLY. NEEDS REPLACEMENT. REPLACE AND ADJUST BRAKE LIGHT SWITCH. CLEAR CODE	CUSTOMER STATES THE ESC LIGHT COMES AND CUSTOMER IS NOT TURNING IT OFF-ADVISE!	INTERNAL FAILURE	ESC LIGHT SCAN ESC LIGHT SCAN 36620 CHECK FOR CODE SET AND REASON FOR ESC LIGHT. CODE C1513 BRAKE SWITCH CKT. CHECK OPERATION OF SWITCH W/SCAN TOOL. AT TIMES YOU HAVE TO PRESS HARD TO GET SWITCH TO OPERATE PROPERLY. NEEDS REPLACEMENT. REPLACE
KM8JN72D86U	8/10/05	36620	57.66	36620 CHECK FOR CODE SET AND REASON FOR ESC LIGHT. CODE C1513 BRAKE SWITCH CKT. CHECK OPERATION OF SWITCH W/SCAN TOOL. AT TIMES YOU HAVE TO PRESS HARD TO GET SWITCH TO OPERATE PROPERLY. NEEDS REPLACEMENT. REPLACE AND ADJUST BRAKE LIGHT SWITCH. CLEAR CODE	CUSTOMER STATES THE ESC LIGHT COMES AND CUSTOMER IS NOT TURNING IT OFF-ADVISE!	INTERNAL FAILURE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 36620 CHECK FOR CODE SET AND REASON FOR ESC LIGHT. CODE C1513 BRAKE SWITCH CKT. CHECK OPERATION OF SWITCH W/SCAN TOOL. AT TIMES YOU HAVE TO PRESS HARD TO GET SWITCH TO OPERATE PROPERLY. NEEDS REPLACEMENT. REPLACE
KM8JN12DX6U	7/22/05	7635	62.5		CUSTOMER STATES VEHICLE STALLED AGAIN WHILE SLOWING. CHECK AND ADVISE	SCAN TEST: CODES C1503 ESC/TCS SWITCH, BRAKE SWITCH SPOKE TO HYUNDAI TECH LIGHT AND ADVISE TO REPLACE BRAKE SWITCH.	REPLACED BRAKE SWITCH AS PER TECH LINE (CASE#233337) CLEAR CODES, TEST DROVE VEHICLE FOR 25 MILES AND DROVE NORMAL.
KM8JN12DX6U	7/22/05	7635	62.5		CUSTOMER STATES ESC LIGHT ON DASH COMES ON AND OFF RANDOMLY. CHECK AND ADVISE	SEE JOB 1	
KM8JN12DX6U	7/22/05	7635	62.5		FRANK TOYOTA RENTAL	FT38078 1812-39	
KM8JM12B76U	10/12/05	18649	57.66	ATT TIME .3 FOR SCAN TOOL NO OP CODE FOR THIS OPERATION ESC LIGHT ON PULLED CODE C1513 BRAKE LIGHT SWITCH CIRCUIT CHECKED ADJUSTMENT OF BRAKE SWITCH WAS IN SPEC INSPECTED BRAKE SWITCH FOUND INTERNAL CONTACTS WERE LOOSE RECOMMEND REPLACE REPLACE BRAKE LIGHT	CUSTOMER STATES-ESC LIGHT IS ON-SOP	INTERNAL FAILURE	ESC LIGHT SCAN ESC LIGHT SCAN 18649 VERIFIED CONCERN FOUND ESC LIGHT ON PULLED CODE C1513 BRAKE LIGHT SWITCH CIRCUIT CHECKED ADJUSTMENT OF BRAKE SWITCH WAS IN SPEC INSPECTED BRAKE SWITCH FOUND INTERNAL CONTACTS WERE LOOSE RECOMMEND REPLACE REPLACE BRAKE LIGHT

KM8JN12DX6U	7/22/05	7635	34.7		CUSTOMER STATES VEHICEL STALLED AGAIN WHILE SLOWING. CHECK AND ADVISE	SCAN TEST:CODES C1503 ESC/TCS SWITCH, BRAKE SWITCH SPOKE TO HYUNDAI TECH LIGHT AND ADVISE TO REPLACE BRAKE SWITCH.	REPLACED BRAKE SWITCH AS PER TECH LINE (CASE#233337) CLEAR CODES, TEST DROVE VEHICLE FOR 25 MILES AND DROVE NORMAL.
KM8JN12DX6U	7/22/05	7635	34.7		CUSTOMER STATES ESC LITE ON DASH COMES ON AND OFF RANDOMLY. CHECK AND ADVISE	SEE JOB 1	
KM8JN12DX6U	7/22/05	7635	34.7		FRANK TOYOTA RENTAL	FT38078 1812-39	
KM8JN12D15U	4/14/05	10119	34.7		CUSTOMER STATES ESP LIGHT IS COMING ON CHECK & ADVISE	SCAN TEST:CODE C1513 BRAKE LAMP SWITCH MALFUNCTION	REPLACED LAMP SWITCH, CLEAR CODE AND RETEST OK
KM8JM12B76U	10/12/05	18649	57.66	ATT TIME 3 FOR SCAN TOOL NO OP CODE FOR THIS OPERATION ESC LIGHT ON PULLED CODE C1513 BRAKE LIGHT SWITCH CIRCUIT CHECKED ADJUSTMENT OF BRAKE SWITCH WAS IN SPEC INSPECTED BRAKE SWITCH FOUND INTERNAL CONTACTS WERE LOOSE RECCOMEND REPLACE REPLACE BRAKE LIGH	CUSTOMER STATES-ESC LIGHT IS ON-SOP	INTERNAL FAILURE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 18649 VERIFIED CONCERN FOUND ESC LIGHT ONPULLED CODE C1513 BRAKE LIGHT SWITCH CIRCUITCHECKED ADJUSTMENT OF BRAKE SWITCH WAS INSPEC INSPECTE D BRAKE SWITCH FOUND INTERNALCONTACTS WERE LOOSE RECCOMEND REPL
KM8JM12B55U	6/24/05	20920	57.34	20920 CUSTOMERS STATED THAT THE ESC LIGHT IS ON. LIGHT WAS NOT ON WHEN DRIVING CAR INTO THE BAY. WITH HI-SCAN A C1513 BREAK LIGHT SWITCH CODE WAS FOUND IN MEMORY. AT TIME OF INSPECTION FOUND BRAKE SWITCH INTERNALLY SHORTED, LOSING SIGNAL, REPLACED BRAKE	CUSTOMER REQUEST- CHECK RECALLS-----DRIVER AIRBAG COVER MOD REPL (07-01-001)	COMPLETED 079	DRIVERS AIR BAG MODULE REPLACEMENT DRIVERS AIR BAG MODULE REPLACEMENT 20920 CUSTOMER REQUESTED THAT RECALL07-01-001 AIR BAG COVER REPLACEMENT BEPERFORMED. 07-01-001 AIR BAG COVERREPLACEMENT RECALL WAS PERFORMED ASREQUESTED.
KM8JN12D56U	8/16/05	12700	32.74		CUSSTOMER STATES CD IS INOP. CHECK AND ADVISE	INTERNAL MALFUNCTION OF RADIO	REPLACE RADIO
KM8JN12D56U	8/16/05	12700	32.74		CUSTOMER STATES ESC LIGHT IS ON. CHECK AND ADVISE.	SCAN TEST:CODE C1513 BRAKE LAMP SWITCH MALFUNCTION	REPLACE BRAKE SWITCH, CLEAR CODE AND RETEST OK
KM8JN12D86U	10/10/05	24715	33.06	ESC LIGHT ON WHILE DRIVING, FOUND CODE C1513 BRAKE LAMP SWT MALFUNCTIONING, REPLACED SWT	CUSTOMER STATES ESC LIGHT IS ON WHILE DRIVING CHECK & ADVISE	SCAN TEST FOUND CODE C1513 BRAKE LAMP SWITCH MALFUNCTION	REPLACED PEDAL SWITCH ASSY. CLEARED CODES RETEST OK
KM8JM12B55U	6/24/05	20920	57.34	20920 CUSTOMERS STATED THAT THE ESC LIGHT IS ON. LIGHT WAS NOT ON WHEN DRIVING CAR INTO THE BAY. WITH HI-SCAN A C1513 BREAK LIGHT SWITCH CODE WAS FOUND IN MEMORY. AT TIME OF INSPECTION FOUND BRAKE SWITCH INTERNALLY SHORTED, LOSING SIGNAL, REPLACED BRAKE	CUSTOMER STATES- ESC OFF LIGHT IS ON	RAN COMPUTER CHECK- C1513, BRAKE SWITCH LOSING SIGNAL, REPLACED SWITCH, CONDITION CORRECTED.	ESC LIGHT SCAN ESC LIGHT SCAN 20920 CUSTOMERS STATED THAT THE ESC LIGHT ISON. LIGHT WAS NOT ON WHEN DRIVING CAR INTO THE BAY. WITH HI-SCAN A C1513 BREAK LIGHTSWITCH CODE WAS FOUND IN MEMORY. AT TIME OFINSPECTION THE FOUND BRAKE SWITCH INTERNALLYSHORTED, LO
KM8JM12B55U	6/24/05	20920	57.34	20920 CUSTOMERS STATED THAT THE ESC LIGHT IS ON. LIGHT WAS NOT ON WHEN DRIVING CAR INTO THE BAY. WITH HI-SCAN A C1513 BREAK LIGHT SWITCH CODE WAS FOUND IN MEMORY. AT TIME OF INSPECTION FOUND BRAKE SWITCH INTERNALLY SHORTED, LOSING SIGNAL, REPLACED BRAKE	CUSTOMER STATES- ESC OFF LIGHT IS ON	RAN COMPUTER CHECK- C1513, BRAKE SWITCH LOSING SIGNAL, REPLACED SWITCH, CONDITION CORRECTED.	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 20920 CUSTOMERS STATED THAT THE ESC LIGHT ISON. LIGHT WAS NOT ON WHEN DRIVING CAR INTO THE BAY. WITH HI-SCAN A C1513 BREAK LIGHTSWITCH CODE WAS FOUND IN MEMORY. AT TIME OFINSPECTION THE FOUND BRAKE SWITCH
KM8JM12B56U	7/19/05	24603	34.7		CUSTOMER STATES ECS LIGHT STAYS ON ALL THE TIME, EVEN WHEN PRESSING BUTTON, TURNS OFF VEHICLE AND THEN COME BACK AND ITOFF. CHECK &	SCAN TEST:CODE C1513 BRAKE LAMP SWITCH MALFUNCTION	REPLACED BRAKE LAMP SWITCH AND RETEST OK
KM8JN12D35U	11/02/04	20473	34.88	ESP LIGHT ON ALL THE TIME REPLACED SWT	CUSTOMER STATES ESP LIGHT WAS ON AL LAST NIGHT. CHECK & ADVISE	SCAN TEST:CODE C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LIGHT SWITCH AS PER TSB 02-36-035
KM8JN12D35U	11/02/04	20473	34.88	ESP LIGHT ON ALL THE TIME REPLACED SWT	HYUNDAI SERVICE LOANER		
KM8JM12B96U	9/23/05	13465	59.3	13465 CUSTOMER STATED THAT THE ESC LIGHT WILL COME ON AND CAN NOT BE TURNED OFF BY THE ESC SWITCH. VARAFIED THE CUSTOMERS COMPLAINT. FOUND THAT THE BREAK SWITCH HAD A OPEN SHORT. SWITCH WILL NEED TO BE REPLACED FOR PROPER OPERATION.	CUSTOMER STATES- ESC LIGHT COMES ON- WILL NOT SHUT OFF BY SWITCH	RAN COMPUTER CHECK- FOUND BRAKE SWITCH WITH OPEN SHORT, REPLACED BRAKE SWITCH, CONDITION CORRECTED	ESC LIGHT SCAN ESC LIGHT SCAN 13465 CUSTOMER STATED THAT THE ESC LIGHT WILLCOME ON AND CAN NOT BE TURNED OFF BY THE ESCSWITCH. VARAFIED THE CUSTOMERS COMPLAINT.FOUND THAT THE BREAK SWITCH HAD A OPEN SHORT.SWITCH WILL NEED TO BE REPLACED FOR PROPEROPERATIO
KM8JM12B96U	9/23/05	13465	59.3	13465 CUSTOMER STATED THAT THE ESC LIGHT WILL COME ON AND CAN NOT BE TURNED OFF BY THE ESC SWITCH. VARAFIED THE CUSTOMERS COMPLAINT. FOUND THAT THE BREAK SWITCH HAD A OPEN SHORT. SWITCH WILL NEED TO BE REPLACED FOR PROPER OPERATION.	CUSTOMER STATES- ESC LIGHT COMES ON- WILL NOT SHUT OFF BY SWITCH	RAN COMPUTER CHECK- FOUND BRAKE SWITCH WITH OPEN SHORT, REPLACED BRAKE SWITCH, CONDITION CORRECTED	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 13465 CUSTOMER STATED THAT THE ESC LIGHT WILLCOME ON AND CAN NOT BE TURNED OFF BY THE ESCSWITCH. VARAFIED THE CUSTOMERS COMPLAINT.FOUND THAT THE BREAK SWITCH HAD A OPEN SHORT.SWITCH WILL NEED TO BE REPLA
KM8JM12B75U	4/26/05	12301	34.7		CUSTOMER STATES ECS/TCS LIGHT TURN ON WHILE DRIVING CHECK & ADVISE	SCAN TEST: C1513 BRAKE LAMP SWITCH. UPON INSPECTION FOUND BRAKE SWITCH MALFUNCTIONING.	REPLACED BRAKE SWITCH. CLEARED CODES. TEST DROVE OK.
KM8JN72D45U	1/03/05	20318	41.55		CUSTOMER REQUEST PERFORM RECALL 922--ECM REPROGRAMMING	CAMPAIGN	ESC ECM REPROGRAMMING - CAMPAIGN 922 ESC ECM REPROGRAMMING - CAMPAIGN 922 20320 COMPLETED CAMPAIGN PERFORMEDREPROGRAM O.K.

KM8JN72DX6U	8/16/05	25287	57.66	ATT FOR SCAN TOOL 3 NO OP CODE FOR THIS ECS LAMP CAME ON THEN SHUT OFF INSPECT FOR CODES CODE C1513 BRAKE LAMP SWITCH BRAKE LAMP SWITCH IS ADJUSTED PROPERLY SWITCH HAS INTERNAL DAMAGE REMOVE AND REPLACE BRAKE LAMP SWITCH AND ADJUST TO SPECS CLEAR CODES	CUSTOMER STATES THE ESC LIGHT HAS COME ON AND SHUT OFF-ADVISE!	INTERNAL FAILURE	ESC LIGHT SCAN ESC LIGHT SCAN 25287 CUSTOMER STATES THE ECS LAMP CAME ON THEN SHUT OFF INSPECT FOR CODES CODE C1513BRAKE LAMP SWITCH BRAKE LAMP SWITCH ISADJUSTED PROPERLY SWITCH HAS INTERNAL DAMAGEREMOVE AND REPLACE BRAKE LAMP SWITCH ANDADJUST TO SPECS
KM8JN72DX6U	8/16/05	25287	57.66	ATT FOR SCAN TOOL 3 NO OP CODE FOR THIS ECS LAMP CAME ON THEN SHUT OFF INSPECT FOR CODES CODE C1513 BRAKE LAMP SWITCH BRAKE LAMP SWITCH IS ADJUSTED PROPERLY SWITCH HAS INTERNAL DAMAGE REMOVE AND REPLACE BRAKE LAMP SWITCH AND ADJUST TO SPECS CLEAR CODES	CUSTOMER STATES THE ESC LIGHT HAS COME ON AND SHUT OFF-ADVISE!	INTERNAL FAILURE	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 25287 CUSTOMER STATES THE ECS LAMP CAME ON THEN SHUT OFF INSPECT FOR CODES CODE C1513BRAKE LAMP SWITCH BRAKE LAMP SWITCH ISADJUSTED PROPERLY SWITCH HAS INTERNAL DAMAGEREMOVE AND REPLACE BRAKE LAMP
KM8JN72D45U	1/03/05	20318	41.55		CUSTOMER STATES CRUISE CONTROL NONOP-CHECK AND ADVISE	BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20320 COMPLETED CHECK OF THE VEHICLE TESTDROVE THE VEHICLE VERIFIED THE COMPLAINTFOUND THE CRUISE CONTROL INOP TESTED THE SYSTEM TESTED AT CONNECTOR C54 PIN 2 GROUND O.K. PIN 11 5 VOLTS BACK PROBED WITH PL
KM8JN72D45U	1/03/05	20318	41.55		CUSTOMER REQUEST PERFORM RECALL 079-D/S AIRBAF COVER MOD. REPL.	ORDERED PARTS	SPECIAL ORDERED PART SPECIAL ORDERED PART 20318 UNABLE TO PERFORM RECALL AT THISTIME. PARTS NOT IN STOCK
KM8JN72D96U	12/13/05	9631	43.26				
KM8JN72DX6U	8/16/05	22236	64	22236 CHECK FOR CODES C1513 AND C1237 CHECK FUSES OK, CHECK OPERATION OF BRAKE SWITCH AND PRESSURE SENSOR, OK.CHECK FOR BULLETINS FOUND A REPROGRAM, PERFORM REPROGRAM FROM 344GOA2T19 TO 344GAP2T19 SYSTEM WORKING OK. VIN # WAS OFF BY 2 DAYS TO QAULIFY FOR	CUSTOMER STATES-ESC LIGHT OFF IS ON-WILL NOT TURN OFF-CHECK-ADVISE!	INTERNAL FAILURE	REPLACE STOP LAMP SWITCH REPLACE STOP LAMP SWITCH 22236 CHECK FOR CODES C1513 AND C1237 CHECKFUSES OK, CHECK OPERATION OF BRAKE SWITCH ANDPRESSURE SENSOR, OK.CHECK FOR BULLITENS FOUND A REPROGRAM, PERFORM REPROGRAM FROM344GOA2T19 TO 344GAP2T19 SYSTEM WORKI
KM8JM12B05U	12/13/04	7886	156.26	S.T. TO CHECK CRUISE OP.FOUND SET LIGHT WOULD FLASH BUT NOT SET.CHECKED ALL INPUTS AND CIRCUITS.CK'D SERV.MAN.NO DIAG AVAILABLE.CK'D BULLETINS, CALLED TECH LINE CASE 241841.CK'D SW.VOLTAGE. CK'D WITH LIKE VEH.FOUDN BRAKE LIGHT SW.HAD 2.0 OHM AND THIS	CUSTOMER STATES CRUISE CONTROL WON'T SET EVERY TIME-IS INTERMIT-CHECK AND REPORT	CRUISE/STOP LAMP SWITCH	STOP LAMP SWITCH - STRAIGHT TIME STOP LAMP SWITCH - STRAIGHT TIME 7886 ROAD TEST CRUISE OPP AND FOUND SET LIGHTWOULD FLASH BUT NOT SET. CHECKED ALL INPUTS TO CRUISE MOD. ALL CIRCUITS CHECKED OK.CHECKED IN SERVIC MANUAL FOR DIAG CHECKINGAND FOUND FOUND
KM8JM12B05U	12/13/04	7886	156.26	S.T. TO CHECK CRUISE OP.FOUND SET LIGHT WOULD FLASH BUT NOT SET.CHECKED ALL INPUTS AND CIRCUITS.CK'D SERV.MAN.NO DIAG AVAILABLE.CK'D BULLETINS, CALLED TECH LINE CASE 241841.CK'D SW.VOLTAGE. CK'D WITH LIKE VEH.FOUDN BRAKE LIGHT SW.HAD 2.0 OHM AND THIS	CUSTOMER STATES CRUISE CONTROL WON'T SET EVERY TIME-IS INTERMIT-CHECK AND REPORT	CRUISE/STOP LAMP SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 7886 ROAD TEST CRUISE OPP AND FOUND SET LIGHTWOULD FLASH BUT NOT SET. CHECKED ALL INPUTS TO CRUISE MOD. ALL CIRCUITS CHECKED OK.CHECKED IN SERVIC MANUAL FOR DIAG CHECKINGAND FOUND FOUND CRUISE SWITCH AND
KM8JN72D36U	7/30/05	9823	56.3	9823 ECS LIGHT ON. VARAFIED CUSTOMERS COMPLAINT. FOUND BREAK SWITCH TO STUCK OPEN. SWITCH WILL NEED TO BE REPLACED. PART WAS ORDERED. REPLACED SWITCH AND RESET LIGHT. TEST DROVE CAR. NO FURTHER PROBLEMS WERE FOUND AT THIS TIME.	CUSTOMER STATES- CHECK FOR A CLICKING NOISE WHEN TURNING- ORDERED	FOUND RIGHT FRONT AXLE BOOT TORN, REPLACED RIGHT FRONT AXLE BOOT	FRT AXLE WHEEL SIDE BOOT KIT (RH) FRT AXLE WHEEL SIDE BOOT KIT (RH) 9823 CLICKING NOISE. TEST DROVE CAR ANDVARAFIED CUSTOMERS COMPLAINT. FOUND RIGHTFRONT OUTER CV BOOT TO BE TORN. CV BOOT WILL NEED TO BE REPLACED. PART ON ORDER. REPLACEDRIGHT FRONT OUTER
KM8JN72D36U	7/30/05	9823	56.3	9823 ECS LIGHT ON. VARAFIED CUSTOMERS COMPLAINT. FOUND BREAK SWITCH TO STUCK OPEN. SWITCH WILL NEED TO BE REPLACED. PART WAS ORDERED. REPLACED SWITCH AND RESET LIGHT. TEST DROVE CAR. NO FURTHER PROBLEMS WERE FOUND AT THIS TIME.	CUSTOMER STATES- ECS LIGHT IS ON- ORDERED	RAN COMPUTER CHECK- FOUND BRAKE SWITCH STUCK OPEN, REPLACED BRAKE SWITCH	ESC LIGHT SCAN ESC LIGHT SCAN 9823 ECS LIGHT ON. VARAFIED CUSTOMERSCOMPLAINT. FOUND BREAK SWITCH TO STUCK OPEN.SWITCH WILL NEED TO BE REPLACED. PART WASORDERED. REPLACED SWITCH AND RESET LIGHT. TEST DROVE CAR. NO FURTHER PROBLEMS WEREFOUND AT THIS TIME.
KM8JN12D06U	8/09/05	17466	31.54	FOUND CODE C1513, REPLACED STOP LAMP SWITCH			
KM8JN12D36U	8/10/05	47129	31.86	FOUND ESC LIGHT ON REPLACED SWITCH			
KM8JN12DX5U	4/21/05	4348	15.8	ESP LIGHT STAYS ON ALL THE TIME.C1260.C1513BRAKE LAMP SWITCH AND STEERING SENSOR MALFUNCTION.CHECK BRAKE SWITCH CIRCUIT GOOD.STEERING WHEEL SENSOR	CUSTOMER STATES THAT THE CAR STILL PULLS LEFT	UNABLE TO DUPLICATE	ALIGNMENT ALIGNMENT NO PROBLEM FOUND
KM8JN72D36U	7/30/05	9823	56.3	9823 ECS LIGHT ON. VARAFIED CUSTOMERS COMPLAINT. FOUND BREAK SWITCH TO STUCK OPEN. SWITCH WILL NEED TO BE REPLACED. PART WAS ORDERED. REPLACED SWITCH AND RESET LIGHT. TEST DROVE CAR. NO FURTHER PROBLEMS WERE FOUND AT THIS TIME.	CUSTOMER STATES- ECS LIGHT IS ON- ORDERED	RAN COMPUTER CHECK- FOUND BRAKE SWITCH STUCK OPEN, REPLACED BRAKE SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 9823 ECS LIGHT ON. VARAFIED CUSTOMERSCOMPLAINT. FOUND BREAK SWITCH TO STUCK OPEN.SWITCH WILL NEED TO BE REPLACED. PART WASORDERED. REPLACED SWITCH AND RESET LIGHT. TEST DROVE CAR. NO FURTHER PROBLEMS WERE

KM8JN72D36U	8/08/05	27962	59.3	27962 CUSTOMER STATES THAT THE ESC LIGHT IS ON. VARAFIED CUSTOMERS COMPLAINT. C1513 CODE WAS FOUND. TESTED CONTINUITY OF BREAK SWITCH. SWITCH FAILED TEST. REPLACED BREAK SWITCH AND CLEARED CODES. NO FURTHER PROBLEM WAS FOUND AT THIS TIME.	CUSTOMER STATES- ESC LIGHT IS ON	RAN COMPUTER CHECK- C1513- FOUND OPEN CIRCUIT IN BRAKE SWITCH, REPLACED SWITCH	ESC LIGHT SCAN ESC LIGHT SCAN 27962 CUSTOMER STATES THAT THE ESC LIGHT IS ON. VARAFIED CUSTOMERS COMPLAINT. C1513 CODE WAS FOUND. TESTED CONTINUITY OF BREAK SWITCH. SWITCH FAILED TEST. REPLACED BREAK SWITCH AND CLEARED CODES. NO FURTHER PROBLEM WAS FOUND AT TH
KM8JN12DX5U	4/21/05	4348	15.8	ESP LIGHT STAYS ON ALL THE TIME. C1260, C1513 BRAKE LAMP SWITCH AND STEERING SENSOR MALFUNCTION. CHECK BRAKE SWITCH CIRCUIT GOOD. STEERING WHEEL SENSOR	CUSTOMER STATES THAT THE REAR END HAS A VIBRATION (POSSIBLY DUE TO TIRES OUT OF BALANCE WE PUT ON LAST MONTH)	UNABLE TO DUPLICATGE	TIRES AND WHEELS TIRES AND WHEELS NO PROBLEM FOUND
KM8JN12DX5U	4/21/05	4348	15.8	ESP LIGHT STAYS ON ALL THE TIME. C1260, C1513 BRAKE LAMP SWITCH AND STEERING SENSOR MALFUNCTION. CHECK BRAKE SWITCH CIRCUIT GOOD. STEERING WHEEL SENSOR	CUSTOMER STATES THAT THE "ESP" LIGHT STAYS ON ALL THE TIME	C1260 STEERING SENSOR MALFUNCTION. C1513 BRAKE LAMP SWITCH. BRAKE SWITCH CIRCUIT CHECKS GOOD. STEERING WHEEL SENSOR IS BAD.	BODY ELECTRICAL BODY ELECTRICAL ORDERED NEW SENSOR
KM8JM12B86U	11/21/05	20865	33.21	REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES VEHICLE HAS NO BRAKE LIGHTS	FOUND BLOWN FUSE AND BAD BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN72D36U	8/08/05	27962	59.3	27962 CUSTOMER STATES THAT THE ESC LIGHT IS ON. VARAFIED CUSTOMERS COMPLAINT. C1513 CODE WAS FOUND. TESTED CONTINUITY OF BREAK SWITCH. SWITCH FAILED TEST. REPLACED BREAK SWITCH AND CLEARED CODES. NO FURTHER PROBLEM WAS FOUND AT THIS TIME.	CUSTOMER STATES- ESC LIGHT IS ON	RAN COMPUTER CHECK- C1513- FOUND OPEN CIRCUIT IN BRAKE SWITCH, REPLACED SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 27962 CUSTOMER STATES THAT THE ESC LIGHT IS ON. VARAFIED CUSTOMERS COMPLAINT. C1513 CODE WAS FOUND. TESTED CONTINUITY OF BREAK SWITCH. SWITCH FAILED TEST. REPLACED BREAK SWITCH AND CLEARED CODES. NO FURTHER
KM8JN72D16U	10/10/05	14356	31.52				
KM8JN12D37U	12/13/06	14553	29.88	BRAKE WARNING LIGHT ON INTERNAL SHORT IN BRAKE LAMP SWITCH REMOVE AND REPLACE BRAKE LAMP SWITCH			
KM8JM12B86U	11/21/05	20865	33.21	REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES PERFORM CAMPAIN 079	ORDERED PART	SPECIAL ORDER PARTS. CUSTOMER WILL BE NOTIFIED WHEN PARTS ARRIVE.
KM8JN12D36U	9/14/05	14011	34.54	CUSTOMER STATES LIGHTS INOP. FOUND BRAKE SWITCH HAD INTERNAL SHORT CAUSING STOP LAMP NOT TO WORK. REPLACE BRAKE LIGHT SWITCH TESTED ALL OK	CUST STATES BRAKE LIGHTS INOP	FOUND BRAKE SWITCH HAD INTERNAL SHORT CUSING STOP LAMP NOT TO WORK	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACE BRAKE LIGHT SWITCH TESTED ALL OK
KM8JM12B85U	2/15/05	4257	33.9				
KM8JM12B45U	6/13/05	31888	34.09		CU/ST ESC LIGHT CAME ON-WENT OFF-CHECK & ADVISE	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D96U	10/11/05	23291	34.09		CUST STATES ESC LIGHT FLASHES INSTALL S.O.P	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B26U	7/11/05	49845	34.41		079 RECALL DRIVERS SIDE AIRBAG COVER	.	079 RECALL DRIVERS SIDE AIRBAG COVER 079 RECALL DRIVERS SIDE AIRBAG COVER
KM8JN12D86U	8/17/05	38587	60.06	CUSTOMER STATES ESC LIGHT IS COMING ON. CODE C1513 LAMP BRAKE SWITCH HAS INTERNAL FAILURE. REPLACE BRAKE LAMP SWITCH RESET LIGHT ALL WORKING AS DESIGN	C/S PASSENGER SIDE AIRBAG INT. KEEP SHUTTING ON & OFF	CODE STORED B1448 OCPASS SENSOR MAT DEFECTED (INTERMITENT)- INTERNAL FAILURE IN SEAT MAT	CUSHION ASSY-FRONT SEAT (RH) CUSHION ASSY-FRONT SEAT (RH) REPLACE RT FRONT SEAT CUSHION RESET CODE RE TEST ALL WORKING AS DESIGN .
KM8JN12D86U	8/17/05	38587	60.06	CUSTOMER STATES ESC LIGHT IS COMING ON. CODE C1513 LAMP BRAKE SWITCH HAS INTERNAL FAILURE. REPLACE BRAKE LAMP SWITCH RESET LIGHT ALL WORKING AS DESIGN	C/S ESC LIGHT IS COMING ON	CODE C1513 LAMP BRAKE SWITCH-BRAKE LAMP SWITCH HAS INTERNAL FAILURE	SCAN TOOL TIME STOP LAMP SWITCH ADJUSTMENT REPLACE BRAKE LAMP SWITCH RESET LIGHT ALL WORKING AS DESIGN
KM8JN12D86U	8/17/05	38587	60.06	CUSTOMER STATES ESC LIGHT IS COMING ON. CODE C1513 LAMP BRAKE SWITCH HAS INTERNAL FAILURE. REPLACE BRAKE LAMP SWITCH RESET LIGHT ALL WORKING AS DESIGN	C/S ESC LIGHT IS COMING ON	CODE C1513 LAMP BRAKE SWITCH-BRAKE LAMP SWITCH HAS INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACE BRAKE LAMP SWITCH RESET LIGHT ALL WORKING AS DESIGN
KM8JM12B26U	7/11/05	49845	34.41		CUST STATES D/S DOOR LOCK INOP	31	INSIDE DOOR HANDLE ROD- DRIVERS SIDE INSIDE DOOR HANDLE CABLE PASSENGER SIDE
KM8JM12B26U	7/11/05	49845	34.41		CUST STATES ESC LIGHT IS ON	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D96U	9/14/05	30979	34.09		079 RECALL DRIVERS SIDE AIRBAG COVER	E	079 RECALL DRIVERS SIDE AIRBAG COVER 079 RECALL DRIVERS SIDE AIRBAG COVER
KM8JN12D86U	8/17/05	38587	60.06	CUSTOMER STATES ESC LIGHT IS COMING ON. CODE C1513 LAMP BRAKE SWITCH HAS INTERNAL FAILURE. REPLACE BRAKE LAMP SWITCH RESET LIGHT ALL WORKING AS DESIGN	C/S A/C BLOWER NOISEY ON 1&2 SETTINGS	A/C BLOWER MAKING NOISE (COMING APART)	MOTOR AND FAN ASSY-AIR CONDITIONING BLOWER RE MOTOR AND FAN ASSY-AIR CONDITIONING BLOWER RE REPLACE A/C FAN BLOWER MOTOR
KM8JN12D86U	8/17/05	38587	60.06	CUSTOMER STATES ESC LIGHT IS COMING ON. CODE C1513 LAMP BRAKE SWITCH HAS INTERNAL FAILURE. REPLACE BRAKE LAMP SWITCH RESET LIGHT ALL WORKING AS DESIGN	C/S COOLANT LEAKING (COOLANT ALL OVER ENGINE COMPARTMENT)	NO PROBLEM FOUND	PRESSURE TEST COOLANT SYSTEM FOUND NO LEAKS AT THIS TIME- UNABLE TO CONFIRM CUSTOMER COMPLAINT. COOLING SYSTEM
KM8JN12D96U	9/14/05	30979	34.09		CU/ST TPMS LIGHT ON	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D96U	9/14/05	30979	34.09		CU/ST ESC LIGHT ON	15	NEEDS TIRES NO CHARGE FOR THIS OPERATION
KM8JN12D16U	8/15/05	42449	32.7		CUST STATES WONT COME OUT OF GEAR	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE

KM8JN12D86U	8/17/05	38587	60.06	CUSTOMER STATES ESC LIGHT IS COMING ON. CODE C1513 LAMP BRAKE SWITCH HAS INTERNAL FAILURE.REPLACE BRAKE LAMP SWITCH RESET LIGHT ALL WORKING AS DESIGN	RENTAL CAR	R2	ENTERPRISE RENTAL SUBLET
KM8JN12DX6U	12/24/05	39907	34.54	ESC OFF LIGHT KEEPS COMING ON. C1513 BRAKE LAMP SWITCH INTERNAL FAILURE OPEN SHORT HAS BAD CONNECTION. REPLACE BRK LAMP SWITCH TEST SWITCH OK	ESC OFF LIGHT KEEPS COMING ON	CODE C1513 BRAKE LAMP SWITHC INTERNAL FAILURE OPEN/SHORT HASBAD CONNECTION.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACE BRK LAMP SWITCH TEST SWITCH OK
KM8JN12DX6U	12/24/05	39907	34.54	ESC OFF LIGHT KEEPS COMING ON. C1513 BRAKE LAMP SWITCH INTERNAL FAILURE OPEN SHORT HAS BAD CONNECTION. REPLACE BRK LAMP SWITCH TEST SWITCH OK	C/S CHECK ENGINE LITE IS ON	PART ON ORDER	CODE P0130 02 SENSOR CIRCUIT MAL(B1/S1) PART ON ORDER C/S CHECK ENGINE LITE IS ON
KM8JN12D66U	10/14/05	27498	59.16	DTC 1513 BRAKE LIGHT INOP/CK ADJUSTMENT OF SWITCH OK SWITCH SHORTED REPLACE SWITCH	CU/ST ESC LIGHT IS ON	15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN12D66U	10/14/05	27498	59.16	DTC 1513 BRAKE LIGHT INOP/CK ADJUSTMENT OF SWITCH OK SWITCH SHORTED REPLACE SWITCH	CU/ST ESC LIGHT IS ON	15	SCAN ESC LIGHT SCAN ESC LIGHT
KM8JN12D86U	8/25/05	30165	34.41		CU/ST AC BLOWS WARM AIR..	06	EVACUATE AND CHARGE-AIR CONDITIONING-ADJUSTMENT EVACUATE AND CHARGE-AIR CONDITIONING-ADJUSTMENT
KM8JN12D86U	8/25/05	30165	34.41		CU/ST ECS LIGHT ON.	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D45U	5/20/05	29483	60.06	CUSTOMER STATES ESC LIGHT COMES ON. C1513 BRAK LIGHT SWITCH ERROR - BRK LIGHT SWITCH HAS INTERNAL FAILURE. REPLACED STOP LIGHT SWITCH.	C/S GAS DOOR WONT OPEN SOP IN	FUEL FILLER DOOR HINGE WARPED NOT ALLOWING DOOR TO OPEN R & R TO SENDOUT TO PAINT	DOOR ASSY-FUEL FILLER RE DOOR ASSY-FUEL FILLER RE REPLACE FUEL FILLER DOOR AFTER PAINT CK FORPRO PERLY OPENING & CLOSING WORK AS DEISGN
KM8JN12D45U	5/20/05	29483	60.06	CUSTOMER STATES ESC LIGHT COMES ON. C1513 BRAK LIGHT SWITCH ERROR - BRK LIGHT SWITCH HAS INTERNAL FAILURE. REPLACED STOP LIGHT SWITCH.	C/S ESC LIGHT COMES ON SOP IN	CODE C1513 BRK LIGHTSWITCH ERROR- BRK LIGHT SW HAS INTERNALFAILURE	STOP LAMP SWITCH ADJUSTMENT STOP LAMP SWITCH ADJUSTMENT
KM8JN12DX6U	9/29/05	3113	36.05		CUST STATES ESC LIGHT DOESNT COME ON, WHEN YOU HIT THE BRAKE THE LIGHT WILL COME ON	15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN12D86U	10/19/05	21474	34.41		CUST STATES BRAKE LIGHT ON DASH INTERMITANTLY GOES ON & OFF	15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN12DX6U	9/29/05	5800	34.09		CU/ST ESC LIGHT SAYS OFF AT TIMES	15	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN12D45U	5/20/05	29483	60.06	CUSTOMER STATES ESC LIGHT COMES ON. C1513 BRAK LIGHT SWITCH ERROR - BRK LIGHT SWITCH HAS INTERNAL FAILURE. REPLACED STOP LIGHT SWITCH.	C/S ESC LIGHT COMES ON SOP IN	CODE C1513 BRK LIGHTSWITCH ERROR- BRK LIGHT SW HAS INTERNALFAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D45U	5/20/05	29483	60.06	CUSTOMER STATES ESC LIGHT COMES ON. C1513 BRAK LIGHT SWITCH ERROR - BRK LIGHT SWITCH HAS INTERNAL FAILURE. REPLACED STOP LIGHT SWITCH.	C/S GAS DOOR WONT OPEN SOP IN	FUEL FILLER DOOR HINGE WARPED NOT ALLOWING DOOR TO OPEN R & R TO SENDOUT TO PAINT	REPLACE FUEL FILLER DOOR AFTER PAINT CK FORPRO PERLY OPENING & CLOSING WORK AS DEISGN
KM8JM12BX6U	9/05/05	11998	36.5	ECS LIGHT GOES ON AND OFF BY ITSELF. CODE C1237 & C1513 FOUND BRAKE SWITCH WITH INTERMITTENT INTERNAL SHORT.REPLACE BRAKE LIGHT SWITCH ALL OK.	CUST STATES ECS OFF LIGHT COMES OFFAND ON BY ITSELF	FOUND CODE C1237 & C1513 FOUND BRAKE SWITCH WITH INTERNAL SHORT AT TIMES.	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE REPLACE BRAKE LIGHT SWITCH ALL OK.
KM8JN12D26U	12/07/05	14347	31.84		ESC OFF LIGHT COMES ON, USUALLY AFTER 15 MINS. GOES OFF IF SHUT OFFAND RESTARTED	INOP	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN12DX6U	10/07/05	18525	31.84		DRIVER AIR BAG COVER MODULE REPLACEMENT 61B046R0 2	RECALL 079	RECALL 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT RECALL 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT
KM8JN12DX6U	10/07/05	18525	31.84		TSC LIGHT WAS ON, CURRENTLY OFF	NO GOOD	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JM12B85U	6/24/05	19985	34.54	CUSTOMER STATES ESPOFF LIGHT COME ON ALL THE TIME THEN GOES OFF. CODE C1513 BRAKE SWITCH CIRCUIT SWITCH HAS INTERNAL SHORT CAUSING ESP LIGHT TO COME ON.REPLACE BRAKE SWITCH REST CODE ALL OK	079 DRIVER AIRBAG COVER MOD REPL 07-01-001	PERFORM RECALL 079 AIR BAG MODULE	DRIVERS AIR BAG MODULE REPLACEMENT DRIVERS AIR BAG MODULE REPLACEMENT COMPLETE RECALL 079 AIR BAG MODULE
KM8JM12B85U	6/24/05	19985	34.54	CUSTOMER STATES ESPOFF LIGHT COME ON ALL THE TIME THEN GOES OFF. CODE C1513 BRAKE SWITCH CIRCUIT SWITCH HAS INTERNAL SHORT CAUSING ESP LIGHT TO COME ON.REPLACE BRAKE SWITCH REST CODE ALL OK	CUST STATES ESP OFF LITE COMES ON ALL THE TIME THEN GOES OFF	CODE C1513 BRAKE SWITCH CIRCUIT SWITCH HAS INTERNAL SHORT CAUSING ESP LITE TO COME ON	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACE BRAKE SWITCH REST CODE ALL OK
KM8JN72D96U	1/26/06	24304	33.36		CUST STATES TIRES PRES LIGHT STAYS ON	NO GOOD	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN72D26U	12/08/05	22577	33.36		CUSTOMER STATES SERVICE ENGINE SOONLITE COMES ON:	P0500	INPUT SPEED SENSOR RE INPUT SPEED SENSOR RE
KM8JN72D26U	12/08/05	22577	33.36		CUSTOMER STATES SERVICE ENGINE SOONLITE COMES ON:	P0500	ADD ON INPUT SPEED SENSOR ADD SCAN TOOL OPERATION RE
KM8JN72D26U	12/08/05	22577	33.36		FLUID IS LEAKING AT TRANSFER CASSE	LEAKING	REPLACE TRANSMISSION OUTPUT SHAFT SEAL & TOP OFF OIL SEAL (4WD) RE
KM8JN72D66U	12/15/05	18347	28.84	CHECKED FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH	CUSTOMER STATES CHECK ENGINE LIGHT ON	CHECKED FOUND CODE P0121 OPEN CIRCUIT IN THROTTLE POSITION SENSOR	REMOVED AND REPLACED THROTTLE POSITION SENSOR

KM8JN72D66U	12/15/05	18347	28.84	CHECKED FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH	CUSTOMER STATES ABS LIGHT ON	CHECKED FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH	REMOVED AND REPLACED BRAKE LIGHT SWITCH
KM8JN12D25U	6/15/05	19986	28.84	CHECKED FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT STAYS ON	CHECKED FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH	REMOVED AND REPLACED BRAKE LIGHT SWITCH
KM8JN72D26U	12/08/05	22577	33.36		VEH HAS HUMMING NOISE IN LEFT FRONT	NOISY - INOP	FRONT HUB BEARING (LH) RE FRONT HUB BEARING (LH) RE
KM8JN72D26U	12/08/05	22577	33.36		ESC LIGHT IS ON	INOP	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D46U	9/30/05	16040	33.8		CUST STATES ESC LIGHT COMES ON INTER WHILE DRIVING	ESC LIGHT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B76U	12/30/05	22700	28.84	CHECKED FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT STAYS ON	CHECKED FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH	REMOVED AND REPLACED BRAKE LIGHT SWITCH
KM8JN12D25U	5/27/05	25909	616	SEE COMMENTS ON JOB 1	CUSTOMER STATES THE ESP OFF LIGHT CAME ON WHILE DRIVING AND WOULD NOT GO OFF.WHILE CAR WAS RUNNING WE RETRIEVED FAULT CODES C1513-BRAKE LAMP SWITCH AND C1237-PRESSURE SENSOR - OTHER.LIGHT WENT OFF WHEN KEY WAS CYCLED IN THE IGNITION.		CASE# 247134 SHOP PAGE BR-20 BRAKE SWITCH ADJ..TALK TO TECH LINE AND REQUEST TO CHECK CONECTORS C54,C35.MC02.MC01,EM06, E39,C06,AND C65.FOR LOOSE CONNECTON AND THEN TEST DRIVE FOR 60 SECONDS WITH FOOT ON BRAKE PEDAL.LIGHT CAME ON AS TEST COMPLET SHOP FORM
KM8JN72D05U	4/21/05	26369	31.84		CUSTOMER STATES 071 PARKING BRAKE LEVER RECALL		PARKING BRAKE LEVER (TSB#05-01-006) PARKING BRAKE LEVER (TSB#05-01-006)
KM8JN72D05U	4/21/05	26369	31.84		CUSTOMER STATES ESP LIGHT COMES ON	ESP LIGHT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D46U	9/30/05	29685	31.84		ESC OFF LIGHT INTERMITTENTLY FLASHES ON AND OFF.UNABLE TO RESET WITH RESET BUTTON	INOP	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D25U	5/27/05	25909	147.4	BRAKE SWITCH ADJ.TALK TO TECH LINE.REQUESTED TO CK CONNECTORS C54 C35 MC02 MC01 EM06 E39 C06 & C65 FOR LOOSE CONN&THENTEST DRIVE FOR 60 SECONDS WITH FOOT ON BRAKE PEDAL.LIGHT CAME ON AS TEST COMPLETED.SHOP FORMAN WAS W/TEST.CAR WAS DOWN.CUST WAS I	CUSTOMER STATES THE ESP OFF LIGHT CAME ON WHILE DRIVING AND WOULD NOT GO OFF.WHILE CAR WAS RUNNING WE RETRIEVED FAULT CODES C1513-BRAKE LAMP SWITCH AND C1237-PRESSURE SENSOR - OTHER.LIGHT WENT OFF WHEN KEY WAS CYCLED IN THE IGNITION.		CASE# 247134 SHOP PAGE BR-20 BRAKE SWITCH ADJ..TALK TO TECH LINE AND REQUEST TO CHECK CONECTORS C54,C35.MC02.MC01,EM06, E39,C06,AND C65.FOR LOOSE CONNECTON AND THEN TEST DRIVE FOR 60 SECONDS WITH FOOT ON BRAKE PEDAL.LIGHT CAME ON AS TEST COMPLET.SHOP FORM
KM8JN12D25U	5/27/05	18779	31.4	REPLACE STOP LAMP SWITCH	CUSTOMER STATES THE ESP OFF WARNING LIGHT IS ON AND THE TRANSMISSION IS SHIFTING ROUGH.	STICKING 93810R00 .3 N94 C15	CODE C1513 CHECK AND REPLACE STOP SWITCH
KM8JN72D65U	4/21/05	40482	31.84		DRIVER AIR BAG COVER MODULE REPLACEMENT 61B046R0 .2	RECALL 079	RECALL 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT RECALL 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT
KM8JN72D65U	4/21/05	40482	31.84		CHECK AT TIMES WONT GO ALL THE WAY INTO PARK	INOP	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D25U	4/15/05	20015	31.84				
KM8JN72D15U	9/21/04	21225	31.56		922 ECM REPROGRAMING REAR	RECALL	CAMPAIGN 922 ESC ECM REPROGAMMING CAMPAIGN 922 ESC ECM REPROGAMMING NEEDS 2 REAR TIRES
KM8JN12D25U	5/27/05	45005	29.76	REPLACE STOP LAMP SWITCH ONE MORE TIME AS PER JIMMY PEYSON.(REP) CODE P1513.			
KM8JN12D25U	5/12/05	30571	36.34	30571 CUSTOMER STATES ESP LIGHT COME ON/OFF WHILE DRI 93810R00=.3/N94-C15 .3 ESP SYSTEM DIAGNOSE CODE-C1513 RECIEVED-BRAKE LAMP SWITCH INTERNAL SHORT REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES ESP LIGHT COME ON/OFF WHILE DRIVING	E	CHASSIS ELECTRICAL CHASSIS ELECTRICAL 30571 CUSTOMER STATES ESP LIGHT COME ON/OFFWHILE DRI 93810R00=.3/N94-C15 .3 ESP SYSTEMDIAGNOSE CODE-C1513 RECIEVED-BRAKE LAMP SWITCH INTERNAL SHORT REPLACED BRAKE LAMP SWITCH
KM8JN72D15U	9/21/04	21225	31.56		WHEN USING CRUISE CONTROL.AFTER BRAKING VEHICLE CRUISE CONTROL WILL CANCEL.BUT CAN NOT BE RESET USING RESUME SWITCH	CRUISE CONTROL	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D16U	10/03/05	24312	32.16				
KM8JM12B37U	11/02/06	2812	31.84		ESC LIGHT HAS BEEN COMING ON AT TIMES	ESC LIGHT ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D05U	6/07/05	23327	36.66	23327 ESP BUTTON INOP INTERMITTENTLY 93810R00=.3/N94-C15 030 ESP SYSTEM DIAGNOSE CODE-C1513 RECEIVED-BRAKE SWITCH INTERNAL SHORT REPLACED BRAKE SWITCH ASSY	CUSTOMER STATES HARD TO START COLD,DIES OUT-CHECK ENGINE LIGHT IS ON-ENGINE VIBRATES ON ACCELERATION	CUSTOMER STATES HARDTO START COLD DIES OUT CHECK ENGINE LIGHT IN ON	DRIVEABILITY REPAIRS DRIVEABILITY REPAIRS 23327 CUSTOMER STATES HARD TO START COLD DIESOUT CHECK ENGINE LIGHT IN ON31430R00=.5/31430RP0=.3/N94-C15 080 ENGINESYSTEM DIAGNOSE CODE-P0036-P0455-P0456RECEIVED- SOP 02 SENSOR B1/S2...CANISTERCLOSE VALVE STUCK IN
KM8JN12D05U	6/07/05	23327	36.66	23327 ESP BUTTON INOP INTERMITTENTLY 93810R00=.3/N94-C15 030 ESP SYSTEM DIAGNOSE CODE-C1513 RECEIVED-BRAKE SWITCH INTERNAL SHORT REPLACED BRAKE SWITCH ASSY	ESP BUTTON INOP INTERMITTENTLY	ESP BUTTON INOP INTERMITTENTLY	BRAKE SYSTEM BRAKE SYSTEM 23327 ESP BUTTON INOP INTERMITTENTLY93810R00=.3/N94-C15 030 ESP SYSTEM DIAGNOSECODE-C1513 RECEIVED BRAKE SWITCH INTERNALSHORT REPLACED BRAKE SWITCH ASSY
KM8JN12D15U	5/17/05	21338	38.3	21338 ESP LIGHT ON 93810ROO=.3 / N94-C15 .3 STOP LAMP SWITCH INTERNAL SHORTED REPLACED STOP LAMP SWITCH CODE C1513 RECEIVED	CUSTOMER STATES ESP LIGHT COME ON	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21338 ESP LIGHT ON 93810ROO=.3 / N94-C15 .3STOP LAMP SWITCH INTERNAL SHORTED REPLACEDSTOP LAMP SWITCH CODE C1513 RECEIVED

KM8JN12D25U		4/15/05	10729	33.8		CUSTOMER STATES ESC LIGHT COMES ON AND OFF (CK RECORDS PART ORDERED LAST TIME	ESC LIGHT	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN72D56U		10/06/05	30714	37.26		CUSTOMER STATES ENGINE RPMS ARE VERY HIGH WHILE DRIVING - VEHICLE JOLTS	OPEN CIRCUIT	SENSOR ASSY-THROTTLE POSITION RE SENSOR ASSY-THROTTLE POSITION RE
KM8JN72D56U		10/06/05	30714	37.26		CUSTOMER STATES ENGINE RPMS ARE VERY HIGH WHILE DRIVING - VEHICLE JOLTS	OPEN CIRCUIT	SENSOR ASSY-THROTTLE POS ADD SCAN TOOL OPERATION SENSOR ASSY-THROTTLE POS ADD SCAN TOOL OPERATION
KM8JN12D15U		5/17/05	21338	38.3	21338 ESP LIGHT ON 93810ROO= 3 / N94-C15 .3 STOP LAMP SWITCH INTERNAL SHORTED REPLACED STOP LAMP SWITCH CODE C1513 RECEIVED	C/S REAR WIPER CAME OFF	E	BLADE ASSY-REAR WINDOW WIPER BLADE ASSY-REAR WINDOW WIPER 21338 REAR WIPER BLADE FELT-OFF AND MISSING98801ROO= 2 / N94-C06 .2 REAR WIPER FELT OFFWHILE DRIVING INSTALLED NEW REAR WIPER BLADE
KM8JN12DX6U		11/07/05	38993	36.34	38993 ESC LIGHT ON 93810ROO= 3 / N69-C15 .3 ESC CONTROL SYSTEM DIAGNOSE - CODE C1513 RECEIVED - STOP LAMP SWITCH INTERNAL FAILURE REPLACED STOP LAMP SWITCH	CAMPAIGN 079 - DRIVER AIRBAG COVER MOD REPL (07-01-001)	E	AIRBAG RECALL AIRBAG RECALL 38993 RECALL 61B046RO= 2 .2 REPLACED A/B COVER
KM8JN72D56U		10/06/05	30714	37.26		CUSTOMER STATES ENGINE STALLS WHEN COMING TO A	OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D45U		4/11/05	61878	37.26		TECH FOUND THE TIMING BELT TENSIONER LEAKING	IMPROPER SEALING	TENSIONER ASSY-TIMING BELT RE TENSIONER ASSY-TIMING BELT RE TECH REPLACED LEAKING TIMING BELT
KM8JN72D45U		4/11/05	61878	37.26		CUSTOMER STATES ESC LIGHT COMES ON AND CAN'T BE SHUT OFF WITHOUT RESTARTING CAR	STICKING	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE TECH REPLACED STICKING BRAKE SWITCH - FAILURECODE B
KM8JN72D45U		4/11/05	61878	37.26		HYUNDAI LOANER CAR	LOANER	HYUNDAI LOANER CAR HYUNDAI LOANER CAR
KM8JN12DX6U		11/07/05	38993	36.34	38993 ESC LIGHT ON 93810ROO= 3 / N69-C15 .3 ESC CONTROL SYSTEM DIAGNOSE - CODE C1513 RECEIVED - STOP LAMP SWITCH INTERNAL FAILURE REPLACED STOP LAMP SWITCH	CUST STATES ESC LIGHT IS ON	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 38993 ESC LIGHT ON 93810ROO= 3 / N69-C15 .3ESC CONTROL SYSTEM DIAGNOSE - CODE C1513RECEIVED - STOP LAMP SWITCH INTERNAL FAILUREREPLACED STOP LAMP SWITCH
KM8JN12DX6U		11/07/05	38993	36.34	38993 ESC LIGHT ON 93810ROO= 3 / N69-C15 .3 ESC CONTROL SYSTEM DIAGNOSE - CODE C1513 RECEIVED - STOP LAMP SWITCH INTERNAL FAILURE REPLACED STOP LAMP SWITCH	2007 PARTS 1Q - FREE 34-POINT INSPECTION	E	2007 PARTS 1Q 2007 PARTS 1Q 38993 DONE
KM8JN12DX6U		11/07/05	38993	36.34	38993 ESC LIGHT ON 93810ROO= 3 / N69-C15 .3 ESC CONTROL SYSTEM DIAGNOSE - CODE C1513 RECEIVED - STOP LAMP SWITCH INTERNAL FAILURE REPLACED STOP LAMP SWITCH	2007 PARTS 1Q - FREE TOUCH-UP PAINTAPPLICATOR	E	2007 PARTS 1Q 2007 PARTS 1Q
KM8JN72D06U		9/26/05	27064	36.94	TECH REPLACED BRAKE LAMP SWITCH FOR ESC LIGHT.	AIR BAG SYSTEM DIAGNOSIS	CIRCUIT OPEN	BUCKLE ASSY-FRONT SEAT BELT (RH) RE BUCKLE ASSY-FRONT SEAT BELT (RH) RE TECH REPLACED PASSENGER BUCLE, CODE B1706.
KM8JN72D06U		9/26/05	27064	36.94	TECH REPLACED BRAKE LAMP SWITCH FOR ESC LIGHT.	CUSTOMER STATES ESC LIGHT ON	CIRCUIT OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE TECH REPLACED BRAKE LAMP SWITCH FOR ESCLIGHT.
KM8JN72D06U		9/26/05	27064	36.94	TECH REPLACED BRAKE LAMP SWITCH FOR ESC LIGHT.	HYUNDAI LOANER CAR	LAONER CAR	HYUNDAI LOANER CAR HYUNDAI LOANER CAR
KM8JN12D15U		6/01/05	26661	36.34	CODE 1513 RECEIVED STOP LAMP SWITCH INTERNAL STICKING INTERMITTENT REPLACE STOP LAMP SWITCH.	C/S CK BRAKE PEDDLER LOW	E	MISC MAINT. MISC MAINT. 26661 BRAKE LOW N/C BRAKE SYSTEM INSPECTEDOK BRAKE SYSTEM PERFORMING TO THEMANUFACTURE SPEC... - COULD NOT DUPLICATE
KM8JN12D15U		6/01/05	26661	36.34	CODE 1513 RECEIVED STOP LAMP SWITCH INTERNAL STICKING INTERMITTENT REPLACE STOP LAMP SWITCH.	C/S ESP LIGHT ON ADVISE IF NOT WARRANTY	E	MISC MAINT. MISC MAINT. 26661 ESP LIGHT ON 93810ROO= 3 / N94-C31 .3EPS SUSTEM DIAGNOSE - CODE C1513 RECEIVEDSTOP LAMP SWITCH INTERNAL STICKINGINTERMITTENT REPLACED STOP LAMP SWITCHPERFORMED VEHICLE ROAD TEST
KM8JN72D16U		10/17/05	18959	37.13	TTECH REPLACED STICKING STOP LAMP SWITCH.	CUSTOMER STATES THE ESC OFF LIGHT COMES ON WHILE DRIVING -SOP-	STICKING	SWITCH ASSY-ESP SWITCH ASS'Y ESP TECCH REPLACED STICING ESC SWITCH
KM8JN72D16U		10/17/05	18959	37.13	TTECH REPLACED STICKING STOP LAMP SWITCH.	CUSTOMER STATES THE BRAKE LIGHT SWITCH STICKS-SOP	STICKING	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE TTECH REPLACED STICKING STOP LAMP SWITCH.
KM8JN72D05U		5/06/05	55161	37.26	TEST AND REPLACE MALFUNCTIONING STOP LAMP SWITCH	CUSTOMER STATES CRUISE CTRL DIDN'T DESENGAGED WHEN HE USED THE BRAKES	OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE TEST AND REPLACE MALFUNCTIONING STOP LAMP SWITCH
KM8JN12D15U		6/01/05	30183	36.34	30183 STATES ESP LIGHT GOES ON/OFF BY ITSELF INTERMI 93810ROO= 3/N94-C15 .3 ESP SYSTEM DIAGNOSE CODE-C1513 RECIEVED-PERFORMED TSB-06-50-006 REPLACED BRAKE SWITCH			
KM8JN12D15U		5/27/05	13095	37.8		C/S BRK LIGHT IS COMING ON ON THE DASH AND AT TIMES TCS LIGHT NAD BRK FLUID WAS LOW	FOUND C1513 BRK SWITCH	R/R BRK SWITCH AND CLEARED CODES

KM8JN12D15U	5/27/05	13095	37.8		C/S SQUIKING NOISE IN THE AM FROM THE WHEELS	FOUND C1237 BRK PRESSURE SNSR	R/R PRESSUR SWITCH SNSR DONE
KM8JM12B06U	7/09/05	15539	26.5		C/S ESC OFF ILLUMINATES ON CLUSTER WHILE DRIVING	FOUND BRAKE SWITCH HAS OPEN CIRCUIT USED ST FOUND C1513	R/R BRAKE LAMP SWITCH DONE
KM8JN72D36U	8/16/05	23543	37.26	INSPECT AND REPLACE MALFUNCTIONING STOP LAMP SWITCH	CUSTOMER STATES CLUNCK AND JOLT WHEN COMING TO A STOP WHEN IN 4WD	OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE INSPECT AND REPLACE MALFUNCTIONING STOP LAMP SWITCH
KM8JN72D46U	10/20/05	14701	36.94	TECH FOUND NO TRAC LIGHT ON. TECH CHECKED FOR FAILURE CODES AND VERIFIED A PROBLEM WITH THE BRAKE LIGHT SWITCH NOT DISENGAGING PROPERLY, WHICH WOULD CAUSE A PROBLEM FOR TRACTION CONTROL. TECH REPLACED SWITCH.	CUSTOMER STATES LIGHT CAME ON OVER WEEKEND AND JUST SHUT OFF	CIRCUIT OPEN	COMPUTER ASSEMBLY ADD SCAN TOOL OPERATION COMPUTER ASSEMBLY ADD SCAN TOOL OPERATION TECH SCANNED FOR CODES AND COULD NOT VERIFY A PROBLEM.
KM8JM12B06U	7/09/05	15539	26.5		SOP IN - A/C COMPRESSOR C/S AC COMPRESSOR MAKES EXCESSIVE TICKING NOISE	FOUND A/C COMPRESSOR NOISY EVACUATED A/C SYSTEM	R/R A/C COMPRESSOR, RECHARGED FREON. TESTED VEHICLE OK AFTER REPAIRS. DONE
KM8JN12D45U	5/31/05	25718	35.84		SOP PART IN	USED S/T FOUND C1513 BRAKE LAMP SWITCH OPEN	R/R SWITCH, RESET LIGHT DONE
KM8JN12D05U	6/01/05	13206	37.8		CUST STATES BRAKE LIGHT SWITCH IS INOP CRUISE CONTROL INOP	REPLACE BRAKE LIGHT SWITCH HAD INTERNAL SHORT	DONE
KM8JN72D46U	10/20/05	14701	36.94	TECH FOUND NO TRAC LIGHT ON. TECH CHECKED FOR FAILURE CODES AND VERIFIED A PROBLEM WITH THE BRAKE LIGHT SWITCH NOT DISENGAGING PROPERLY, WHICH WOULD CAUSE A PROBLEM FOR TRACTION CONTROL. TECH REPLACED SWITCH.	079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	CAMPAIGN 079	CAMPAIGN 079 - DAB MODULE07-01-001 CAMPAIGN 079 - DAB MODULE07-01-001
KM8JN72D46U	10/20/05	14701	36.94	TECH FOUND NO TRAC LIGHT ON. TECH CHECKED FOR FAILURE CODES AND VERIFIED A PROBLEM WITH THE BRAKE LIGHT SWITCH NOT DISENGAGING PROPERLY, WHICH WOULD CAUSE A PROBLEM FOR TRACTION CONTROL. TECH REPLACED SWITCH.	CUSTOMER STATES CRACKING SOUND FROM FRONT PASS. SIDE	TORN	BUSHING-CROSSMEMBER MOUNTING (ALL) RE BUSHING-CROSSMEMBER MOUNTING (ALL) RE
KM8JN12D05U	6/10/05	43309	36.16		C/S ESP OFF LIGHT WILL COME ON WHEN DRIVING IN WET WEATHER, WONT SHUT OFF UNTILL CAR IS RESTARTED	USED ST FOUND CODE C1513 BRAKE LAMP SWITCH OPEN	R/R BRAKE LAMP SWITCH DONE
KM8JM12BX5U	11/12/04	43834	26.5				
KM8JM12BX5U	11/12/04	43775	34.73		C/S ESP LIGHT ON	U S/T CODE C1513 BREAK LAMP SWITCH OPEN/SHORTED	R/R BREAK LAMP SWITCH CLEAR CODE DONE
KM8JM12BX5U	11/12/04	43775	34.73		C/S AIR BAG LIGHT ON	CAMPAIGN DAB COVER	R/R DAB MODULE
KM8JN72D46U	10/20/05	14701	36.94	TECH FOUND NO TRAC LIGHT ON. TECH CHECKED FOR FAILURE CODES AND VERIFIED A PROBLEM WITH THE BRAKE LIGHT SWITCH NOT DISENGAGING PROPERLY, WHICH WOULD CAUSE A PROBLEM FOR TRACTION CONTROL. TECH REPLACED SWITCH.	CUSTOMER STATES TRAC LIGHT WONT TURN OFF	STICKING	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE TECH FOUND NO TRAC LIGHT ON.
KM8JM12B06U	12/15/05	42	37	CUST ST NO START ADJUSTED NEUTRAL SAFTEY SWITCH	CUSTOMER STATES TAHT THE ENGINE WILL NOT START WHEN THE KEY IS TURNED - REPORT	TECH FOUND THAT THE NEUTRAL SAFTEY SWITCH WAS OUT OF ADJUSTMENT AND CAUSING THE CUSTOMERS CONCERNS	TECH READJUSTED THE NEUTRAL SAFTEY SWITCH TO FACTORY SPEC. ALL WORKING TO FACTORY SPEC AT THIS TIME.
KM8JM12B55U	1/15/05	37833	32.4				
KM8JM12BX5U	1/06/05	16485	29.83	REPLACED BRAKE SWITCH, SWITCH HAD INTERNAL SHORT, RECHECKED, OK	CUSTOMER STATES WHEN TURNING STEERING WHEEL A SOUND IS HEARD	C15	SENSOR-ANGULAR VELOCITY
KM8JM12BX5U	1/06/05	16485	29.83	REPLACED BRAKE SWITCH, SWITCH HAD INTERNAL SHORT, RECHECKED, OK	CUSTOMER STATES WHEN VEHICLE IS IN IDLE AND IN PARK THE ESP LIGHT TURNS ON	C15	SWITCH ASSY-STOP LAMP RE
KM8JM12B46U	10/05/05	14659	30.94	REPLACED SWITCH ASSEMBLY, RECHECKED, OK	CUSTOMER STATES BRAKE LIGHTS DONT WORK	C15	SWITCH ASSY-STOP LAMP RE
KM8JN72D36U	11/25/05	12104	69.8	OPEN CIRCUIT IN BRAKE SWITCH PROBLEM INTERMITANT AND SETTING CODE1513	CUSTOMER STATES:TCS LIGHT COMES ON/STAYS ON	ROAD TEST - NO LIGHT EVIDENT SCAN CODES 1515 BRAKE SWITCH	DIAG/REPLACE BRAKE SWITCH & CLEAR CODE...ROAD TEST GOOD
KM8JN72D46U	7/15/05	15902	30.8	TCS LITE STAYING ON CODE 1235/1513	CUSTOMER STATES TCS LIGHT ON SOP BRAKE SWITCH	CHECKED AND FOUND FAULTY BRAKE LIGHT SWITCH	REPLACED BRAKE SWITCH
KM8JN72D36U	11/25/05	22459	33.34	CODE 1513	CUSTOMER STATES:VEHICLE HESITATED - STORED BRAKE SWITCH CODE	1513	DIAG/REPLACE BRAKE SWITCH & CLEAR CODE
KM8JN72D46U	7/15/05	27936	33.66	CODE 1513/ESC LITE ON INTERMITANTLY	CUSTOMER STATES: ESC LITE COMES ON BYITSELF INTERMITANTLY	CODE 1513	DIAG AND REPLACE BRAKE LTE SWITCH
KM8JN12D66U	10/25/05	18249	31.26	CUSTOMER COMPLAINT IS OF EXC LIGHT TURNING ON AT TIMES, RETRIEVED DTC BELOW, REPLACED BRAKE SWTCH, RECHECKED, OK	CUST. STATES ESC LIGHT TURNS ON AT TIMES.	C15	SWITCH ASSY-STOP LAMP RE
KM8JN12D56U	10/26/05	17662	31.26	REPLACED BRAKE SWITCH ASSEMBLY, BRAKE SWITCH HAS INTERNAL SHORT CAUSING WARNING LIGHT ON, RECHECKED, OK	CUSTOMER STATES ESC OFF LIGHT IS ON.	C15	SWITCH ASSY-STOP LAMP RE
KM8JN12D45U	9/01/04	58438	29.83	REPLACED SWITCH, RECHECKED, OK	CUSTOMER STATES A/C STARTS TO BLOW HOT AIR AT TIMES.	C38	EVACUATE AND CHARGE-AIR CONDITIONING-ADJUSTMENT
KM8JN72D46U	9/09/05	33368	33.66		CUSTOMER STATES CHECK ENGINE LIGHT IS ON	SCANNED SYSTEM CODE C1513 BRAKE LAMP SWITCH FAULTY	REPLACED BRAKE LAMP SWITCH
KM8JN72D46U	9/09/05	33368	33.66		CUSTOMER STATES CHECK ENGINE LIGHT ON CAR RUNNING ROUGH	SCANNED SYSTEM CODE P0304 CAM SENSOR FAULTY	REPLACED CAM SENSOR

KM8JN72D16U	9/22/05	10918	30.8	CODE 1513	CUSTOMER STATES CHECK ENGINE LIGHT ON	SCANNED SYSTEM..BRAKE LIGHT CODE FAULTY BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12D45U	9/01/04	58438	29.83	REPLACED SWITCH, RECHECKED, OK	PERFORM CAMPAIGN 922 ECM REPRO.	F	ESC ECM REPROGRAMMING 06-01 001
KM8JN12D45U	9/01/04	58438	29.83	REPLACED SWITCH, RECHECKED, OK	PERFORM CAMPAIGN 079 DRIVER AIR BAGCOVER MODULE RPLAC.	F	CAMPAIGN 079 DRIVER AIR BAG MODULE REPLACED
KM8JN12D45U	9/01/04	58438	29.83	REPLACED SWITCH, RECHECKED, OK	CUSTOMER STATES CRUISE CONTROL WOULD ENGAGE PERFECTLY OR SOMETIMES IT WOULD ENGAGE/DISENGAGEON ITS OWN AT TIMES.	C15	SWITCH ASSY-STOP LAMP RE
KM8JM12B56U	1/12/06	37116	33.34		CUSTOMER STATES SERVICE ENGINE SOON LITE IS ON	SCANNED SYSTEM CODE P0449 EVAP SYSTEM FAULTY CABISTER VALVE	REPLACED CANISTER VALVE
KM8JM12B56U	1/12/06	37116	33.34		CUSTOMER STATES CHECK ENGINE LIGHT ON SPECIAL ORDER FUEL PRESSURE SENSOR AND CANISTER VALVE	SCANNED SYSTEM CODE P0449 EVAP SYSTEM LEAK FAULTY CANISTER VALVE	REPLACED CANISTER VALVE
KM8JM12B56U	1/12/06	37116	33.34		CUSTOMER STATES ESC LIGHT ON SPECIAL ORDER BRAKE	SCANNED SYSTEM CODE C1513 FAULTY BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN12D75U	5/10/05	53703	30.06	UPON INSPECTION FOUND SWITCH TO BE BAD. REMOVE AND REPLACE SWITCH.	CS BRAKES LIGHT IS NOT WORKING	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D45U	5/10/05	36216	29.74	RAN SCAN TOOL FOR CODES. FOUND C1513 BRAKE LAMP SWITCH. UPON TESTING AND INSPECTION FOUND SWITCH TO BE STICKING. REMOVE AND REPLACE SWITCH. CLEARED CODES.	CS TO PRE3FORM CAMPAIGN 079	01	CAMPAIN079 AIR BAG DRIVERSIDE CAMPAIN079 AIR BAG DRIVERSIDE 36216 PERFORMED CAMPAIGN 079
KM8JN12D45U	5/10/05	36216	29.74	RAN SCAN TOOL FOR CODES. FOUND C1513 BRAKE LAMP SWITCH. UPON TESTING AND INSPECTION FOUND SWITCH TO BE STICKING. REMOVE AND REPLACE SWITCH. CLEARED CODES.	CS ESP LIGHT IS ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 36216 RAN SCAN TOOL FOR CODES. FOUND C1513BRAKE LAMP SWITCH. UPON TESTING ANDINSPECTION FOUND SWITCH TO BE STICKING. R&R SWITCH CLEARED CODES.
KM8JM12B56U	1/12/06	37116	33.34		CUSTOMER STATES HEADLAMPS OUT	BOTH LOW BEAM HEADLAMPS BURNT OUT	REPLACED BOTH LOW BEAM HEADLAMP BULBS
KM8JN72D55U	9/06/04	28141	55.95	CODE1513 ESC LITE KICKS ON WHILE DRIVING NEED SCAN TOOL TO DIAGNOSE AND CLEAR CODE			
KM8JN72D06U	9/15/05	37177	33.66	ESC LITE STAYS ON DEFECTIVE SWITCH	CUSTOMER STATES ESC LIGHT ON	CHECKED AND FOUND FAULTY STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH
KM8JN12D96U	11/16/05	3929	31.7	RETRIVE CODES IN ABS SYSTEM FOUND CODE C1513. CK BRAKE LAMP SYTCH. FOUND BRAKE LAMP SWITCH OUT OF ADJUSTMENT. READJUST SWITCH. TEST DRIVE SHOWS SWITCH STICKING. REPLACE	CS CK ENG LIGHT IS ON	69	CANISTER CLOSE VALUE ADD SCAN TOOL OPERATION CANISTER CLOSE VALUE ADD SCAN TOOL OPERATION
KM8JN12D96U	11/16/05	3929	31.7	RETRIVE CODES IN ABS SYSTEM FOUND CODE C1513. CK BRAKE LAMP SYTCH. FOUND BRAKE LAMP SWITCH OUT OF ADJUSTMENT. READJUST SWITCH. TEST DRIVE SHOWS SWITCH STICKING. REPLACE	CS ECS LIGHT COMES ON AND OFF	94	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D26U	9/16/05	7331	35.3	CODE 1153	CUSTOMER STATES ESC WAS ON..WENT OFF	FAULT CODE C1513 BRAKE LAMP SWITCH FAULTY	REPLACED BRAKE LAMP SWITCH
KM8JN72D36U	9/15/05	22970	33.66	CODE C1513	CUSTOMER STATES ESC LIGHT COMES ON AT TIMES ESC LIGHT STAYS ON	SCASNED SYSTEM CODE C1513..BRAKE SWITCH FAULTY	REPLACED BRAKE SWITCH
KM8JM12B35U	11/08/04	5842	66.82	SCAN, CODE C1513	CUST STATES THE ESP OFF LIGHT COMES ON WHILE DRIVING IF CUST PRESSES ON ESP OFF BUTTON IT WILL NOT GO OUT	RD TST, SCAN CODE C1513. BRAKE LITE SWITCH, INPECT AND TST, BRAKE LITE SWITCH OPEN, BRAKE LITES INOP	REPLACE BRAKE LITE SWITCH
KM8JM12B75U	4/19/05	3196	36.98		ESP LIGHT COMES ON AT TIMES- SOP HERE	OPEN CIRCUIT- CODE C1513	REPLACE STOP LAMP SWITCH ASSY
KM8JN12D16U	12/14/05	23141	50.14	PULLED CAN TOOL. FOUND CODE 1513. CHECK FOR LOOSE WIRE AND CONNECTION. CHECK AND ADJUST BRAKE SWITCH CONCERN STILL PRESENT AT TIMES. BRAKE SWITCH HAS OPEN CIRCUIT. REMOVE AND REPLACE BRAKE SWITCH.	CS ESC LIGHT ON THEN OFF	15	TO SCANTOOL TO SCANTOOL 23141 15. PULLED SCANTOOL FOUND CODE 1513 CKFOR LOOSE WIRE AND CONNECTION CK AND ADJBRAKE SWITCH CONCERN STILL PRESEAT AT TIMESREPLACE BRAKE SWITCH HAS OPEN CIRCUIT
KM8JN12D16U	12/14/05	23141	50.14	PULLED CAN TOOL. FOUND CODE 1513. CHECK FOR LOOSE WIRE AND CONNECTION. CHECK AND ADJUST BRAKE SWITCH CONCERN STILL PRESENT AT TIMES. BRAKE SWITCH HAS OPEN CIRCUIT. REMOVE AND REPLACE BRAKE SWITCH.	CS ESC LIGHT ON THEN OFF	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 23141 15 PULLED SCANTOOL FOUND CODE 1513 CKFOR LOOSE WIRE AND CONNECTION CK AND ADJBRAKE SWITCH CONCERN STILL PRESEAT AT TIMESREPLACE BRAKE SWITCH
KM8JN12D45U	5/30/05	18459	31.7	CK GROUND WIRES CK FUSE CONTACTS, CK CONNECTIONS. FOUND BRAKE LIGHT SWITCH STICKING	CS BRAKE LIGHTS WORKES AT TIMES	15	STOP LAMP SWITCH ASS'Y RE
KM8JM12B75U	5/20/05	6347	37.72		BRAKE LIGHTS NOT WORKING AT TIMES		INSP. AND FOUND BRAKE LIGHT SWITCH BROKE. REMOVE AND REPLACE BRAKE LIGHT SWITCH AND TEST. OK
KM8JM12B75U	5/20/05	6347	37.72		SUN VISOR LABEL COMING OFF PASS SIDE.		REMOVE AND REPLACE SUN VISOR PASS. SIDE.
KM8JM12B75U	5/20/05	6347	37.72		SUN VISOR LABEL COMING OFF DRIVER SIDE		REMOVE AND REPLACE DRIVER SIDE SUN VISOR

KM8JN12D36U	11/22/05	784	31.28	UPON INSPECTION RAN SCAN TOOL FOUND CODE P1513 UPON TESTING FOUND BRAKE SWITCH TO HAVE AN OPEN CIRCUIT R&R BRAKE SWITCH. CLEARED CODES AND TEST DROVE.	CS ECS LIGHT COMES ON AND OFF		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B45U	5/16/05	38538	30.06	ECS LIGHT KEEPS COMING ON AND OFF. UPON INSPECTION FOUND OPEN CIRCUIT. REMOVE AND REPLACE SWITCH.	CS ECS LIGHT COMES ON AND OFF	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D95U	5/24/05	19660	30.2	BRAKE LIGHT SWITCH SHORTED OUT REPLACED BRAKE LIGHT SWITCH			
KM8JN12D76U	12/19/05	22399	32.67				
KM8JM12B65U	5/23/05	11080	32.9				
KM8JN12D56U	2/07/06	21041	30.94				
KM8JN12D86U	10/25/05	20964	50.14	PULLED CODES C1513-BRAKE LIGHT SWITCH UPON INSPECTION AND TESTING FOUND BRAKE LAMP SWITCH TO BE STICKING R&R SWITCH ASSEMBLY AND CLEARED CODES			
KM8JN12D86U	10/25/05	20964	30	PULLED CODES C1513-BRAKE LAMP SWITCH UPON INSPECTION AND TESTING FOUND BRAKE LAMP SWITCH TO BE STICKING R&R SWITCH ASSEMBLY AND CLEARED CODES			
KM8JM12B35U	5/10/05	15815	28.35	PERFORM SCAN TOOL CHECK. NO CODES FOUND. CHECK CURRENT DATA FOR CIRCUIT OPERATION. FOUND BRAKE LAMP SWITCH STICKING AT TIMES. REPLACE AND ADJUST SWITCH. RECHECK OPERATION WITH SCAN TOOL. CHECKS OK.	CS MY CAR SQUEALS WHEN TURN IT ON SOMETIMES WHEN TURN THE STEERING WHEEL. ALSO WHEN ACCELL	07	BELT-V OR DRIVE BELT RE BELT-V OR DRIVE BELT RE 15806 CHECK DRIVE BELTS, FOUND ALT BELT COMING APART. REPLACE BELT AND ADJUST TENSION. RECHECK FOR NOISE AND OPERATION, CHECKS OK.
KM8JN72D96U	7/16/05	25263	28.24	CHECKED ESC CYSTEM FOR WIRING PROBLEM (FOUND NONE). CHECKED SYSTEM UNIT AND SWITCHES, FOUND BAD BRAKE LIGHT SWITCH. REPLACED SWITCH. CORRECTED			
KM8JM12B06U	1/09/06	17074	64.54	EXTRA TIME TO DIAG AND CHECK FOR CODES AND POOR GROUNDS	ESC LIGHT ON	ESC LIGHT ON CODE C1513, DIAG AND TEST, FOUND BRAKE LIGHT SWITCH BAD AND REPLACED	EXTRA TIME TO DIAG AND CHECK FOR CODES AND POOR GROUNDS EXTRA TIME TO DIAG AND CHECK FOR CODES AND
KM8JM12B06U	1/09/06	17074	64.54	EXTRA TIME TO DIAG AND CHECK FOR CODES AND POOR GROUNDS	ESC LIGHT ON	ESC LIGHT ON CODE C1513, DIAG AND TEST, FOUND BRAKE LIGHT SWITCH BAD AND REPLACED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B35U	5/10/05	15815	28.35	PERFORM SCAN TOOL CHECK. NO CODES FOUND. CHECK CURRENT DATA FOR CIRCUIT OPERATION. FOUND BRAKE LAMP SWITCH STICKING AT TIMES. REPLACE AND ADJUST SWITCH. RECHECK OPERATION WITH SCAN TOOL. CHECKS OK.	CS ESP LIGHT WAS ON NOW IT IS OFF	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 15806 PERFORM SCAN TOOL CHECK. NO CODES FOUND. CHECK CURRENT DATA FOR CIRCUIT OPERATION. FOUND BRAKE LAMP SWITCH STICKING AT TIMES. REPLACE AND ADJUST SWITCH. RECHECK OPERATION WITH SCAN TOOL. CHECKS OK
KM8JN12D36U	11/25/05	5465	31.7	PULLED CODES C1503, C1513 UPON INSECTOPM AND TESTING FOUND STOP LAMP SWITCH TO HAVE AN OPEN CIRCUIT R&R SWITCH AND CLEARED CODES.	CS ESC OFF LIGHT IS ON	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B97U	10/31/06	7799	62.1	DIAG ESC LIGHT ON AND CK ALL CONECTORS AND REASEAT	DIAG CUST STATES ESC LIGHT COMES ON WHILE DRIVING, CAN XHUT VEH OFF AND VEH WILL STAY OFF FOR ABOUT AN HOUR OR TWO AND THEN WILL COME BACK ON	DIAG ESC LIGHT COMING ON AND CK WITH GDS, CK SYSTEM AND ALL CONNECTORS AND RESEAT BRAKE SWITCH CONNECTOR AND RETEST OK AT THIS TIEM, CODE C1	DIAG ESC LGTH ON AND CK ALL CONNECTORS AND RESEAT. RECHECK DIAG ESC LIGHT ON AND CK ALL CONNECTORS AND RESEAT. RECHECK
KM8JN12D86U	10/17/05	16810	23.74		CUSTOMER STATES ESC LIGHT COMES ON AND OFF AT TIMES	BARKE LAMP SWITCH MALF.	REPLACED BRAKE LAMP. SWITCH TEST DROVE OK 32002A00
KM8JN72D86U	1/20/06	22237	30.94		CUSTOMER STATES BRAKE LIGHT ARE STAYING ON .	INTERNAL FAILURE OF STOP LAMP SWITCH .	REPLACED STOP LAMP SWITCH . TEST DROVE OK 93810R00
KM8JN12D36U	11/25/05	10178	31.7	PERFORM SCAN TOOL CK. FOUND CODE C1513. CK WIRIES ADN CONNECTION. CK OK. CK SWITCH FOUND SWITCH STICKING AT TIMES. REPLACE SWITCH. TEST DRIVE CK OK.	CS CK BRAKLIGHT IS ON	15	STOP LAMP SWITCH ASSY RE
KM8JN12D35U	6/17/05	39145	77.66	CK FOR CODES FOUND P0150 C1513 FOUND THE CONNECTOR C26 HAD A BAD CONNEC TION AT PIN 1 B2/S1 REPLAIED PIN TENSION AT CONNECTOR C26 PIN 1 AND FOUND THAT THE BRAKE LAMP SWITCH HAS AND OPEN CIRCUIT AT TIMES CAUSING THE ABS TO APPLY REPLACE BRAKE LAMP SWITCH	CS CAR IS SURGING AND DIES AT STOP SIGNS AT TIMES RPM GOES TO 500	15	WIRE REPAIR TIME (MINOR)- ADJUSTMENT WIRE REPAIR TIME (MINOR)-ADJUSTMENT 39145 CK FOR CODES FOUND P0150 C1513 FOUND THE CONNECTOR C26 HAD A BAD CONNECTION AT PIN1 B2/S1 REPAIED PIN TENSION AT CONNECTOR C26 PIN 1 AND FOUND THAT THE BRAKE LAMP SWITCH HAS AN
KM8JN12D06U	11/23/05	13778	36.43				
KM8JN12D75U	5/21/05	39549	36.75	INTERNAL FAILURE IN BRAKE SWITCH, REPLACE BRAKE	CUSTOMER STATES ESC LIGHT COMES ON AT TIMES S.O.P IN	INTERNAL FAILURE	INTERNAL FAILURE IN BRAKE SWITCH. REPLACE BRAKE
KM8JN12D25U	4/14/05	35281	36.75		CUSTOMER STATES THE ESP LIGHT COMES ON WHILE DRIVING	CODE C1513	FOR INTERNAL ELECTRICAL FAILURE FROM BRAKE LIGHT SWITCH CAUSING ESP LIGHT TO COME ON, REPLACED BRAKE SWITCH 93810R00 .3

KM8JN12D35U	6/17/05	39145	77.66	CK FOR CODES FOUND P0150 C1513 FOUND THE CONNECTOR C26 HAD A BAD CONNECTION AT PIN 1 B2/S1 REPAIRED PIN TENSION AT CONNECTOR C26 PIN 1 AND FOUND THAT THE BRAKE LAMP SWITCH HAS AND OPEN CIRCUIT AT TIMES CAUSING THE ABS TO APPLY REPLACE BRAKE LAMP SWITCH	CS CAR IS SURGING AND DIES AT STOP SIGNS AT TIMES RPM GOES TO 500	15	TO SCANTOOL TO SCANTOOL 39145 CK FOR CODES FOUND P0150 C1513 FOUND THE CONNECTOR C26 HAD A BAD CONNECTION AT PIN1 B2/S1 REPAIRED PIN TENSION AT CONNECTOR C26PIN 1 AND FOUND THAT THE BRAKE LAMP SWITCH HAS AND OPEN CIRCUIT AT TIME CAUSING THE ABSTO APPLY R
KM8JN12D35U	6/17/05	39145	77.66	CK FOR CODES FOUND P0150 C1513 FOUND THE CONNECTOR C26 HAD A BAD CONNECTION AT PIN 1 B2/S1 REPAIRED PIN TENSION AT CONNECTOR C26 PIN 1 AND FOUND THAT THE BRAKE LAMP SWITCH HAS AND OPEN CIRCUIT AT TIMES CAUSING THE ABS TO APPLY REPLACE BRAKE LAMP SWITCH	CS CAR IS SURGING AND DIES AT STOP SIGNS AT TIMES RPM GOES TO 500	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 39145 CK FOR CODES FOUND P0150 C1513 FOUND THE CONNECTOR C26 HAD A BAD CONNECTION AT PIN1 B2/S1 REPAIRED PIN TENSION AT CONNECTOR C26PIN 1 AND FOUND THAT THE BRAKE LAMP SWITCH HAS AND OPEN CIRCUIT AT TIME
KM8JN12D25U	4/14/05	35281	36.75		CUSTOMER REQUESTS TO PERFORM RECALL #079 AIR BAG RECALL SOP IN	RECALL	REMOVE, INSPECTED AND REPLACE DRIVERS AIRBAG PER RECALL 61B046R0.2
KM8JN12D46U	1/24/06	20634	36.75	93810R00 REPALCED SWITCH, INTERNAL FAILURE	CUSTOMER STATES ECS LIGHT WOULD COME ON AND OFF	INTERNAL FAILURE	93810R00 REPALCED SWITCH
KM8JN12D86U	10/21/05	18701	36.43		CUSTOMER STATES ESC LIGHT FLASHES	INTERNAL FAILURE IN BRAKE SWITCH	93810R00 NO POWER COMING OUT-REPLACED BRAKE LIGHT SWITCH
KM8JM12B26U	7/12/05	14370	31.7	PERFORM GDS CHECK, FOUND CODE 1539 BRAKE LAMP SWITCH. CHECK CONNECTION AND WIRING, CHECKS OK REPLACE BRAKE LAMP SWITCH, CLEAR CODES. TEST DROVE OK	CS ESC LIGHT IS ON AT TIMES	E	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 14370 PERFORM GDS CHECK, FOUND CODE 1539BRAKE LAMP SWITCH. CHECK CONNECTION ANDWIRING, CHECKS OK REPLACE BRAKE LAMP SWITCH,CLEAR CODES. TEST
KM8JM12B56U	7/11/05	41638	35.16	ESC LIGHT STAYS ON, SCANNED, C1503, C1513 REPLACED BRAKE SWITCH	ESC LIGHT STAYS ON	SCANNED, C1503 TCS/ESP SWITCH, C1513 BRAKE LT SWITCH, REPLACED BRAKE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B97U	11/02/06	3170	34.84	ESC LIGHT COMES ON WHILE DRIVING, SCANNED, C1513 BRAKE LAMP SWITCH, SWITCH STICKING, CLEARED CODES REPLACED SWITCH	ESC LIGHT COMES ON WHILE DRIVING	SCANNED, C1513 BRAKE LAMP SWITCH, SWITCHSTICKING, CLEARED CODES, REPLACED SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D26U	11/25/05	27712	36.75		CUSTOMER STATES CHECK ENGINE LIGHT ON	OXYGEN SENSOR 39214RP0/0.3-39214R00/0.9	REPLACED OXYGEN SENSOR
KM8JN12D26U	11/25/05	27712	36.75		CUSTOMER STATES THE ECS LIGHT WAS ON YESTERDAY	BRAKE LIGHT SWITCH MALFUNCTION 93810R00/0.3	REPLACED BRAKE LIGHT SWITCH
KM8JN12D75U	6/02/05	11537	38.39				
KM8JM12B66U	3/07/06	18332	36.75		CUSTOMER STATES BRAKE LIGHTS INTERMITTALLY WILL NOT WORK	INTERNAL FAILURE	REPLACED BRAKE SWITCH CONNECTOR 83870R00.3
KM8JN72D46U	11/19/05	16528	36.5				
KM8JN12D96U	7/16/05	15375	36.04		CUSTOMER STATES THE VEHICLE IS STALLING INTERMITT-WHEN STOPPING	CK DTCS P0123 TPS HI INPUT CK TPS FOUND INTERMITTENT RESPONSE	REPLACE TPS RETEST OK
KM8JN12D96U	7/16/05	15375	36.04		C/S ESC OFF LIGHT COMES ON AND OFF	CK ECS DTCS C1513 BRAKE SWITCH CIRCUIT TEST AND INSPECT BRAKE SWITCH ,INTERMITTENT OPEN	REPLACE BRAKE LIGHT SWITCH AND PROPERLY ADJUST ROAD TEST OK
KM8JM12B56U	11/29/05	21853	34.84				
KM8JN72D76U	9/26/05	11444	33.66	REPLACE SWITCH AND ADJUST CLEAR CODE - OK	CUSTOMER STATES ESC LIGHT COMES ON SPORADICALLY	SCAN SYSTEM CODE C1213 BRAKE SWITCH	REPLACE SWITCH AND ADJUST CLEAR CODE - OK
KM8JN12D16U	7/16/05	6539	33.66	SCAN. CODE C1513 PRESENT. REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT WILL GO ON AND OFF SPORADICALLY WHILE DRIVING	SCAN SYSTEM CODE C1513 FAULTY BRAKE SWITCH	REPLACE FAULTY BRAKE SWITCH CLEAR CODE - ALL OK
KM8JN72D56U	7/28/05	28927	36.36		CUSTOMER STATES THE ESC LIGHT COMES ON SPORADICALLY	PO1513 SHORT IN BRAKE SWITCH	REPL. SWITCH
KM8JM12BX5U	4/14/05	20102	36.04		CUSTOMER STATES THE BRAKE LIGHTS STAY ON	SHORT IN BRAKE SWITCH	REPLACE
KM8JN12D65U	5/17/05	15415	36.36	RPLACED BRAKE LIGHT SWITCH AND CLEARED CODES	CUSTOMER STATES THE ESC LIGHT IS ON	C121 RR W/SENSOR- AIRGAP, C1611- CAN TIMEOUT- EMS C1612 CAN TIMEOUT-TCM C1513 BRAKE LAMP SWITCH	RPLACED BRAKE LIGHT SWITCH AND CLEARED CODES
KM8JM12B16U	9/14/05	25957	36.36		CUSTOMER STATES ABS LIGHT IS COMING ON IN VEHICLE AND ESC LIGHT IS ON	C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH AND CLEARED CODES
KM8JM12BX6U	12/06/05	13354	33.66	REPLACED BRAKE LIGTH SWITCH PER TECH ASSIST	CUSTOMER STATES CRUISE CONTROL DOES NOT WORK INTERMITTLY	ROAD TEST VEHICLE TALKED TO TECH ASST SAID TO REPLACE BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN72D46U	7/22/05	17394	33.66	REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES BRAKE LIGHTS NOT WORKING	FOUND FAILED BRAKE LAMP SWITCH	REPLACE BRAKE LAMP SWITCH
KM8JN72D46U	7/22/05	17394	33.66	REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES DRIVERS SIDE DOOR GASKET FALLING OFF	FOUND LEFT FRONT BODY SIDE WEATHERSTRIPPING FAULTY	SPECIAL ORDER PART
KM8JM12BX7U	10/24/06	10918	36.36		CUSTOMER STATES THE ESC OFF LIGHT IS STAYING ON IN THE VEHICLE	PULLED CODE C1513-BRAKE LAMP SWITCH	REPLACED SWITCH
KM8JM12B86U	7/20/05	32131	36.04		CUSTOMER STATES THE ESP LIGHT IS ON	C1503 TCS/ESP SWITCH AND C1513 BRAKE LAMP SWITCH PROBLEM	REPLACED BRAKE LAMP SWITCH
KM8JM12B86U	11/25/05	14417	36.5		CUST STATES E.S.C LITE STAYS ON HAS TO TURN OFF CAR TO GET LITE TO GO OFF	PULLED CODE C1513-BRAKE SWITCH MAL	REPLACED BRAKE LIGHT SWITCH, ERASED DTC
KM8JN72D45U	3/02/05	37573	29.55	SCAN. CODE P1513 IN SYSTEM. REPLACED BRAKE LAMP SWITCH.	CUSTOMER STATES THAT SERVICE ENGINE LIGHT IS ON	FOUND FAILED BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN72D45U	3/02/05	37573	29.55	SCAN. CODE P1513 IN SYSTEM. REPLACED BRAKE LAMP SWITCH.	CUSTOMER STATES THE 079 CAMPAIGN NEEDS COMPLETED	VERIFY AIR BAG MODULE NEEDS REPLACED	REPLACED DRIVER'S SIDE AIR BAG MODULE PER CAMPAIGN
KM8JN12D76U	1/05/06	692	32.9		CUSTOMER STATES ECS LAMP WAS ON, PULLED TO RIGHT, OFF NOW	FAULTY BRAKE LIGHT SWITCH (CODE C1532)	SCAN SYSTEM, REPLACE BRAKE LIGHT SWITCH, CLEAR CODES, ROAD TEST, O.K.
KM8JM12B86U	7/20/05	14380	36.5				
KM8JN12D35U	11/12/04	15124	36.6				

KM8JM12B45U	5/25/05	14574	36.36		CUSTOMER STATES THE ESC LIGHT IS STAYING ON ON/OFF	PULLED CODE C1513 PERFORMED DIAG AND FOUND BRAKE LAMP SWITCH TO BE FAULTY	REPLACED SWITCH CLEARED CODE AND ROAD TESTED NO CODES AFTER REPAIR
KM8JN72D56U	10/18/05	30254	36.36				
KM8JM12B26U	7/19/05	15692	33.66	REPLACE BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT IS ON INTERMITTLY IF YOU PUSH THE BUTTON IT DOES NOT MAKE A DIFFERENCE	SCAN VEHICLE FOUND FAILED BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JM12B96U	7/20/05	2852	30.66		CUSTOMER STATES THE ESP/TCS LIGHT WAS ON REPLACE SPECIAL ORDERED BRAKE SWITCH	FOUND BRAKE LIGHT SWITCH OPEN SHORT	REPLACE BRAKE LIGHT SWITCH
KM8JM72B06U	10/05/05	29096	31.86				
KM8JN72D46U	9/02/05	28787	31.86				
KM8JN72D66U	9/30/05	14864	36.36		CUSTOMER STATES THE ESC LIGHT IS ON	C1513 BRAKE LAMP SWITCH FAULT	REPLACED BRAKE LAMP SWITCH
KM8JN72D55U	6/11/05	31245	36.5		S.O.PART CUP HOLDER	SPRING LOADED FINGERS THAT HOLD CUPS BROKEN	REPLACE SOP CUPHOLDER
KM8JN72D55U	6/11/05	31245	36.5		SOP SENSOR	FAULTY BRAKE LIGHT SWITCH INT LOSING SIGNAL TO LIGHTS	REPLACE BRAKE LIGHT SWITCH
KM8JN72DX6U	10/10/05	17164	31.86				
KM8JN72D66U	9/29/05	15583	31.86				
KM8JN12D76U	8/10/05	25552	37.98	DTC C1513	C/S ESC LIGHT STAYS ON AT ALL TIMES	TECH FOUND CODE C1513 BRAKE LAMP SWITCH HAS INTERNAL FAILURE	TECH REMOVED AND REPLACED BRAKE LAMP SWITCH
KM8JN72D46U	10/04/05	15269	36.36		CUST STATES ESC LITE COMES ON AND CANT TURN OFF	PULLED CODE C1513 PERFORMED DIAG AND FOUND BRAKE LIGHT SWITCH SHORTED OUT	REPLACED SWITCH CLEARED CODE AND ROAD TESTED NO CODES AFTER REPAIR
KM8JN12D96U	10/31/05	15171	34.84	15171 BRAKE LAMP SWITCH FAILURE SCANNED FOR ESC CODES FOUND C 1513 REPLACED B BRAKE LAMP SWITCH CODES			
KM8JN72D65U	11/09/04	33899	33.45	33901 CHECK FOR ESC LIGHT COMES ON. CODE #C1513. SHORT IN BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE.			
KM8JM12B66U	7/13/05	7384	37.3		C/S ESC LIGHT STAYS ON AT ALL TIMES INSTALL SOP SWITCH	BRAKE SWITCH SHORTED	REMOVED AND REPLACED BRAKE SWITCH
KM8JN72D76U	10/22/05	15043	37.66	DTC C1513			
KM8JN12D55U	5/20/05	16870	32.6	CUST STTS ESP LIGHT IS ON FAULTY BRAKE LAMP SWITCH REPLACED SWITCH AND RE CHECK	CUSTOMER REPORTS HORN DOES NOT OPERATE. ADVISE.	FAULTY HORN	REPLACE HORN. 96600R00 .2 N94 C15
KM8JN12D55U	5/20/05	16870	32.6	CUST STTS ESP LIGHT IS ON FAULTY BRAKE LAMP SWITCH REPLACED SWITCH AND RE CHECK	CUSTOMER REPORTS ESP LIGHT IS ON. CHECK AND ADVISE.	ISOLATED TO FAULTY BRAKE LAMP SWITCH	REPLACED BRAKE LIGHT SWITCH AND RECHECKED / OK 938140R00 .3 // N94 C15
KM8JN12D16U	10/18/05	14024	34.84	14024 BRAKE LAMP SWITCH FAILURE SCANNED FOR CODES FOUND C1513 REPLACED BRAKE LAMP SWITCH CLEARED CODE			
KM8JN72D76U	11/10/05	23191	60.66	23193 CHECK FOR ESC LIGHT COMES ON. CODE #C1513. BRAKE LIGHT SWITCH WAS STICKING. REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE.			
KM8JN12D35U	12/08/04	8007	33.45		CUSTOMER STATES ESP LIGHT ON INTERMITTANTLY FOR PAST 2 WEEKS.	SHORT	SENSOR-ANGULAR VELOCITY SENSOR-ANGULAR VELOCITY 8010 CHECK FOR ESP LIGHT COMES ON. CODE#C1260 AND C1513. POOR CONTACT IN SAS AND STICKING IN BRAKE LIGHT SWITCH. REPLACED STEERING ANGLE SENSOR AND BRAKE LIGHT SWITCH. CLEARED CODES.
KM8JN12DX5U	11/16/04	35849	29.25	CUST STTS ESP MIGHT COMES ON PULL DTC C1513 STORED IN SYSTEM CHECK CIRCUIT FOUND FAULTY STOP LAMP SWITCH / OPEN CIRCUIT REPLACED STOP LAMP SWITCH AND TEST FOR PROPER OPERATION	ESP LIGHT COMES ON	FAULTY STOP LAMP SWITCH C1513	REPLACED STOP LAMP SWITCH 93810R00 .3 N94/C15
KM8JN12D05U	10/05/04	39492	59.23	CUSTOMER STTS ESP LIGHT ON PULL DTC C1513 OPEN IN BRAKE LAMP SWITCH REPLACE BRAKE LAMP SWITCH CLEAR CODES AND RETURN TO SERVICE ATT TIME FOR DIAG CHECK TIME TO PULL DTC	CUSTOMER REPORTS ESP LIGHT COMES ON & GOES OFF	FAULTY BRAKE LAMP SWITCH, C1513 BRAKE LAMP MALF.	REPLACED BRAKE LAMP SWITCH, NO OTHER PROBLEMS 93810R00 .3 93810RP0 .3 N94/C15
KM8JN12D35U	12/08/04	8007	33.45		CUSTOMER STATES ESP LIGHT IS ON	SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D15U	5/20/05	25631	34.84	25631 INSTALL SOP. ESP LIGHT COMES ON. CODE #C1513. SHORT IN BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE.			
KM8JN72D96U	10/18/05	34318	35.16	34320 CHECK FOR ESC LIGHT COMES ON. CODE #C1513. OPEN IN BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE.			
KM8JM12B85U	5/04/05	19035	60.66	19036 SCANNED FOR CODES AND FOUND CODES AND FOUND CODE FOR BRAKE LITE SWITCH. CHECKED BRAKE LITE SWITCH AND FOUND SWITCH OPEN. REPLACED SWITCH AND TESTED OK. CODE C1513			

KM8JN12D05U	10/05/04	39492	59.23	CUSTOMER STTS ESP LIGHT ON PULL DTC C1513 OPEN IN BRAKE LAMP SWITCHREPLACE BRAKE LAMP SWITCH CLEAR CODES AND RETURN TO SERVICEATT TIME FOR DIAG CHECK TIME TO PULL DTC	OPEN CAMPAIGN	DCS SHOWS OPEN CAMPAIGN	REPLACED DRIVERS AIR BAG MODULE 61B046R0 .2
KM8JN12D55U	8/27/04	47408	29.25	CUST STTS ESP LIGHT CAME ON PULL DTC 1513 BRAKE LAMP SWITCH OPEN SHORTREPLACED BRAKE LAMP SWITCH CLEAR CODES AND CK FOR PROPER OPERATION RETURN TO SERVICE			
KM8JN12D05U	12/16/04	10	41.67	BRAKE SWITCH IS NOT WORKING.			
KM8JN12D6U	9/28/05	19177	38.9		THE BRAKE LIGHTS ARE INOP AND THE ECS LIGHT IS ON THE BRAKE LIGHT SWITCH WAS SHORTED AND CAUSING THE	ECS LIGHT AND THE BRAKE LIGHTS TO STOP WORKING	REPLACED THE STOP LAMP SWITCH
KM8JM12B75U	5/16/05	22402	37.26		CUST STATES:TAIL LIGHTS STAY ON AT TIMESCHECK AND REPORT THE SHOP LAMP SWITCH WAS SHORTED	REPLACED THE STOP LAMP SWITCH	AND RESET THE CODES
KM8JM12B76U	7/11/05	12156	38.9	C/S THE ECS LIGHT IS ON, SOP PART IS IN STOCK, THE STOP LAMP SWITCH IS SHORTED AND TURNING ON THE ECS LIGHT, INSTALLED THE NEW STOP LIGHT SWITCH	THE ECS LIGHT IS ON SOPPART IS IN STOCK	THE STOP LAMP SWITCH IS SHORTED AND TURNING ON THE ECS LIGHTINSTALLED THE NEW STOP LIGHT SWITCH	
KM8JN12D06U	8/10/05	69413	34.26		CUSTOMER STATES BRAKES WENT TO THE FLOOR AND MADE GRINDING NOISE SEE PREVIOUS	INSP FOUND CODE C1513 BRAKE SWITCH FAULT, LOOKED AT FREEZE FRAME, SWITCH STUCK OPEN, WILL POSSIBLE SET SBS CONDITION NEED TO START WITH SWITCH	REPLACED SWITCH, CLEARED CODE, DID NOT NOT RESET BUT CANNOT DRIVE VEHICLE TO VERIFY DUE TO NO FUEL IN VEHICLE (1 TIME GOODWILL AS PER DPSM) C99-2F526
KM8JN12D46U	12/27/05	14817	34.26		CUST STATES VEH ECS LIGHT COMES ON INTERMITTENTLY	FOUND FAULTY BRAKE SWITCH (DTC #C1513)	REPLACED FAULTY BRAKE SWITCH
KM8JN12D26U	7/29/05	21394	33.94		CUSTOMER STATES: TPMS LIGHT ON & ESC OFF LIGHT STAYS ON SEE HISTORY	INSP FOUND TPMS CODE C1312 RF SENSOR FAULT AND ABS CODE C1513 BRAKE SWITCH FAULT. FOUND SWITCH OPEN.	REPLACED STOP SWITCH TO CORRECT ABS CODE. RECALIBRATED RF TIRE PRES SENSOR TO CORRECT TPMS CODE NOTE: PREVIOUS VISIT L/F SENSOR FAULT FOR TPMS FAULT. L/F SENSOR READING PROPERLY.R/F SENSOR LOST COMMUNICATION. REPROGRAMMED
KM8JN72D66U	10/07/05	26513	36.94		CUSTOMER STATES THE ECS OFF LIGHT IS ON UPON INSPECTION FOUND DTC C1513	BRAKE SWITCH INTERNALY OPEN/SHORTED	REPLACED BRAKE SWITCH CLEARED CODE TEST DROVE VEHICLE NORMAL OPERATION
KM8JM12B95U	4/26/05	14583	36.94				
KM8JM12B56U	9/23/05	28339	36.94				
KM8JN12D16U	10/22/05	10514	33.94		CUSTOMER STATES: ENGINE STALLS WHEN AT A STOP SIGN	DROVE VEH W/GDS, NO CODES AT PRESENT TIME. NOTED NOISE IN TPS CIRCUIT.	REPLACED TPS TO CORRECT. UPON FINAL DRIVE P0102 MAF FAULT. REPLACED MAF TO CORRECT.
KM8JN12D16U	10/22/05	10514	33.94		CUSTOMER STATES: ESC OFF LIGHT KEEPS COMING ON	FOUND CODE P1513 BRAKE SWITCH FAULT. TESTED SWITCH, CIRCUIT OPEN	REPLACED SWITCH TO CORRECT
KM8JN12D16U	10/22/05	10514	33.94		CUSTOMER STATES: DRIVER SIDE BRAKE LIGHT INOP.	VERIFIED CONCERN, UPON INSPECTION TECH FOUND BULB BLOWN .	REPLACED BURNT BULB TO CORRECT
KM8JM12B95U	4/26/05	21263	37.26				
KM8JN72D86U	10/07/05	12306	37.26	C/S AFTER DRIVING THE ESC LIGHT WILL TURN ON AND OFF, BRAKE LIGHT SWITCH WAS SHORTED AND SET THE ESC LIGHT CODE C1513, REPL THE BRAKE LIGHT SWITCH AND CLEARED THE CODE	CUSTOMER STATES :AFTER DRIVING THE ESC LIGHT WILL TURN OF AND WILL NOT TURN OFF	THE BRAKE LIGHT SWITCH WAS SHORTED AND SET THE ECS LIGHT CODE 1513	REPLACED THE BRAKE LIGHT SWITCH AND CLEARED THE CODE
KM8JN12D26U	10/01/05	13313	37.26		CUSTOMER STATES ENGINE WILL NOT CRANK THE VEHICLE HAD TO BE JUMPED TO START	THE BATTERY FAILED THE LOAD TEST AND WOULD NOT HOLD A CHARGE	REPLACED THE BATTERY
KM8JN12D85U	6/03/05	31510	34.26		CUSTOMER STATES: WHEN SLOWING DOWN & TURNING VEHICLE STALLS	DROVE VEHICLE, NEVER ABLE TO DUPLICATE STALL CONDITION, BUT HAD GDS IN VEHICLE WATCHING TPS AND MAF VOLTAGE, FOUND NOISEIN TPS CIRCUIT, AND HESITATION ON ACCEL DURING WHICH FOUND MAF VOLTAGE DROPPED OUT ON GRAPH, LOSS OF SIGNAL.	REPLACED TPS AND MAF SENSOR, RESET ADAPTS AND DROVE VEHICLE OPERATING AS DESIGNED AT THIS TIME
KM8JN12D85U	6/03/05	31510	34.26		ESP LIGHT STAYS ON	FOUND CODES, C1237 PRESSURE SENSOR FAULT AND C1257 BRAKE SWITCH FAULT. TESTED CIRCUIT FOR MASTER PRESSURE SENSOR HAVE 5.02 SUPPLY VOLTAGE AND .50V AT BRAKE PEDAL REST AND 2.05V W/PEDAL DEPRESSED. GDS 0PSI AT REST AND 1107PSI PEDAL DEPRESSED.	REPLACED BRAKE SWITCH TO CORRECT, CLEARED ALL CODES. VEHICLEOPERATING AS DESIGNED AT THIS TIME.
KM8JN12D75U	9/16/04	39549	45.45				
KM8JN12D16U	12/15/05	28881	47.16		CUSTOMER REPORTS BRAKE PEDAL GOES ALL THE WAY TO THE FLOOR	CODE C1513 IN COMPUTER- SHORT/OPEN BRAKE SWITCH	TECH REPLACED BRAKE SWITCH- RESET COMPUTER AND RECHECKED- NO CODES NOW PRESENT
KM8JN12D75U	9/16/04	39549	30				
KM8JN72D77U	11/02/06	7196	47.16		THE CUSTOMER REPORTS ESC OFF LIGHT COMES ON OFTEN	CODE C1513- BRAKE LIGHT SWITCH MALFUNCTION	TECH REPLACED SWITCH- OK NOW
KM8JN12D26U	12/13/05	10687	35.44	E-BRAKE LIGHT IS ONB1513/ SWITCH			
KM8JN12D66U	8/17/05	15790	61.54	ESC LIGHT COME ON WHILE DRIVING/ SWITCH OPEN CIRCUITCODE 1513/ ATT TIME FOR NO RPO			

KM8JN12D96U	7/28/05	11626	35	EPC LIGHT COMING ON/ OPEN CIRCUITREPALCED SWITCH			
KM8JN12DX5U	5/20/05	12412	35	ESP LIGHT IS ONOPEN CIRCUITREPALCED CODE C1513			
KM8JN12D06U	7/15/05	28334	36.36	CUST STATES ESC LIGHT IS ON, OPEN CIRCUIT IN BRAKE SWITCH,R REPLACED STOP LAMP SWITCH	CUSTOMER STATES ESC LIGHT COMES ON INTERMITTANTLY	OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACED BRAKE LIGHT SWITCH ASSY
KM8JN72D36U	8/08/05	31845	37.56				
KM8JN72D46U	9/22/05	31709	37.56				
KM8JN72D86U	10/13/05	11298	37.24				
KM8JN12D66U	8/17/05	20487	35.76	ESC IGHIT IS ONOPEN CIRCUIT CODE C1513REPLACED SWITCHSPW			
KM8JN72D45U	4/26/05	48534	58.7	LAMP NOT WORKINGATT TIME FOR NO RPO FOR DIAG			
KM8JN12DX5U	3/03/05	7068	35.32				
KM8JN12D56U	7/29/05	17347	56.74	ESC LIGHT COMES ONDAIG B1513 STORE ATT TIME FOR NO RPO			
KM8JN72D56U	11/19/05	14896	65.14	CUSTOMER STATES THAT INTERMITTANTLY IN INCREMENTAL WEATHER CONDITIONS (RAIN,SNOW) ECS OFF LIGHT WILL COME ON UNDER DIFFERENT DRIVING CONDITIONS (TURNING CORNERS, ACCELERATING FROM A STOP, COMING TO A STOP ETC....) COULD NOT DUPLICATE			
KM8JN12D95U	1/10/05	15441	44.23	NA			
KM8JN12D06U	8/08/05	13212	43.95	NA			
KM8JN72D26U	11/25/05	13843	35.44	ESC LIGHT COMES ON/OFF C1513 ON BRAKE LAMP SWITCH OPEN CIRUCITREPALCED			
KM8JN12D16U	12/31/05	4330	35.76	ESC LIGHT STAYS ON/B1513 SWITCH FAULTYREPLACED			
KM8JM12B85U	2/25/05	22252	60.43	WHILE ACELERATIONG ON A INCLINE VEHICLE LIKE IS SLIPSOPEN CIRCUIT ATT TIME FOR DIAG C1513			
KM8JM12B15U	6/03/05	47976	35.76	ESC LIGHT COMES ON/ STOP LAMP SWITCH FAULTYREPLACED			
KM8JN12D15U	6/10/05	6756	45.34				
KM8JM72B46U	10/15/05	16441	45.34	NA			
KM8JM12B86U	3/29/06	10476	45.34	NA			
KM8JM12B26U	11/22/05	15176	69.34	ADDTL TIME NEEDED FOR SCAN TOOL OPERATION			
KM8JM12BX6U	1/03/06	14892	61.54	CRUISE CONTROL WILL NOT SET/ OPEN CIRCUITOPEN CAMP PARTS ORDER 079REPLACED SWITCH/ATT TIME FOR CODE DIAG/1513			
KM8JM12B96U	3/29/06	10004	33.04				
KM8JM12B86U	7/16/05	23331	33.04				
KM8JN12D25U	5/04/05	35349	45.34	NA			
KM8JN72DX7U	11/10/06	4123	38.91	4123 TECH PULLED C1513 BRAKE LAMP SWITCH, TECH FOUND SWITCH TO BE INTERNALLY SHORTED, CAUSING THE ESC OFF LIGHT TO COME ON AND THE BRAKE LIGHTS TO INTERMITANTLY NOT WORK, TECH REPLACED BRAKE LAMP SWITCH AS NEEDED, EVERYTHING WORKS AS DESIGNED.	CUSTOMER STATES THE ECS OFF LIGHT IS ON, ADVISE.		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 4123 TECH PULLED C1513 BRAKE LAMP SWITCH,TECH FOUND SWITCH TO BE INTERNALLY SHORTED,CAUSING THE ESC OFF LIGHT TO COME ON AND THEBRAKE LIGHTS TO INTERMITANTLY NOT WORK, TECHREPLACED BRAKE LAMP SWITCH A
KM8JN72D86U	11/18/05	7138	62.46	CUSTOMER STATES ESC LIGHT IS ON, SCANNED FOR CODES AND FOUND CODE C1513. BRAKE LAMP SWITCH OPEN			
KM8JN12D65U	7/01/05	31255	62.46	ADDITIONAL TIME FOR SCAN TOOL TEST, CODE C1513			
KM8JN12D65U	7/01/05	14336	26.4	ADJUSTED SWITCH ASSY			
KM8JN12D85U	10/08/04	18990	35.46				
KM8JN72D06U	4/03/06	13737	38.59	CODE C1515, TECH MONITORED BRAKE LAMP SENSOR SI GNAL, TECH FOUND NO SIGNAL SENT WHEN BRAKE PEDAL DEPRESSED, TECH REPLACED BRAKE LAMP SWITCH AS NEEDED, CLEARED CODES AND RETESTED, WORKS AS DESIGNED	PERFORM 079 CAMPAIGN		CAMAPIGN 079 CAMAPIGN 079
KM8JN72D06U	4/03/06	13737	38.59	CODE C1515, TECH MONITORED BRAKE LAMP SENSOR SI GNAL, TECH FOUND NO SIGNAL SENT WHEN BRAKE PEDAL DEPRESSED, TECH REPLACED BRAKE LAMP SWITCH AS NEEDED, CLEARED CODES AND RETESTED, WORKS AS DESIGNED	CUSTOMER STATES ESC LIGHT WILL COMEON OCCASIONALLY, ADVISE		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE CODE C1515, TECH MONITORED BRAKE LAMP SENSORSI GNAL, TECH FOUND NO SIGNAL SENT WHEN BRAKEPEDAL DEPRESSED, TECH REPLACED BRAKE LAMP SWITCH AS NEEDED, CLEARED CODES AND RETESTED,WORKS AS DESIGNED
KM8JM12B16U	7/13/05	30618	36.06				
KM8JN72D55U	10/08/04	54663	138.75	.9 OLH DIAGNOSIS CRUISE CONTROL OPERATION			
KM8JM72B95U	4/29/05	18268	44		CUSTOMER STATES BRAKE LIGHT GOES OFF AND ON.	BRAKE LITE SWITCH SHORTED	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED BRAKE LIGHT SWITCH
KM8JN12D45U	11/06/04	21695	40.28	EPS LIGHT COMES ON. STICKING BRAKE LAMP SWITCH. DIAG.REPLACE UNDER WARRANTY. RENTAL 1 DAY UNDER HPP	RENTAL,ENTERPRISE...PO#161936 ..OK'DBY P.MADRAZO.	XX	SUBLET SUBLET XX

KM8JN72D06U	4/03/06	13737	38.59	CODE C1515, TECH MONITORED BRAKE LAMP SENSOR SIGNAL, TECH FOUND NO SIGNAL SENT WHEN BRAKE PEDAL DEPRESSED, TECH REPLACED BRAKE LAMP SWITCH AS NEEDED, CLEARED CODES AND RETESTED, WORKS AS DESIGNED	CUSTOMER STATES ESC LIGHT WILL COME ON OCCASIONALLY, ADVISE		ADD SCAN TOOL OPERATION ADD SCAN TOOL OPERATION CODE C1515, TECH MONITORED BRAKE LAMP SENSOR SIGNAL, TECH FOUND NO SIGNAL SENT WHEN BRAKE PEDAL DEPRESSED, TECH REPLACED BRAKE LAMP SWITCH AS NEEDED, CLEARED CODES AND RETESTED, WORKS AS DESIGNED
KM8JN72D25U	2/24/05	11391	38.31	TECH FOUND BRAKE SWITCH SHORTING OUT CAUSING TRACTION CONTROL LIGHT AND ABS LIGHT TO COME ON, TECH REPLACED STOP LAMP SWITCH AS NEEDED.	CUSTOMER STATES THE ABS AND TRACTION CONTROL LIGHT FLASH ON WHEN DRIVING, ADVISE		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE TECH FOUND BRAKE SWITCH SHORTING OUT CAUSING TRACTION CONTROL LIGHT AND ABS LIGHT TO COME ON, TECH REPLACED STOP LAMP SWITCH AS NEEDED.
KM8JN12D45U	11/06/04	21695	40.28	EPS LIGHT COMES ON, STICKING BRAKE LAMP SWITCH, DIAG, REPLACE UNDER WARRANTY, RENTAL 1 DAY UNDER HPP	CUSTOMER STATES HE DROVE OFF A VERY SHORT DISTANCE AND THE EPS LIGHT CAME ON, INSPECT/ADVISE	BAD BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE CHECKED OUT, FOUND CODE C1513, NECESSARY TO RE-PLACE BRAKE LAMP SWITCH, INSTALLED NEW SWITCH, CLEARED CODE-OK NOW.
KM8JN12D45U	11/06/04	21695	40.28	EPS LIGHT COMES ON, STICKING BRAKE LAMP SWITCH, DIAG, REPLACE UNDER WARRANTY, RENTAL 1 DAY UNDER HPP	RENTAL, ENTERPRISE... PO#161936 ..OK'D BY P.MADRAZO.	XX	SUBLET REPAIRS XX
KM8JN72D56U	12/15/05	17292	38.59	CODES C1237 PRESSURE SENSOR-OTHER/ C1260 STEERING WHEEL SENSOR ABNORMAL/ C1513 BRAKE LAMP SWITCH, TECH CHECKED AND FOUND BRAKE LAMP SWITCH NO MAKING CONTACT CORRECTLY, TECH FOUND INTERNAL FAILURE OF BRAKE LAMP SWITCH, TECH REPLACED BRAKE LAMP SWITCH AS	CUSTOMER STATES ESC LIGHT KEEPS COMING ON, ADVISE		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE CODES C1237 PRESSURE SENSOR-OTHER/ C1260 STEERING WHEEL SENSOR ABNORMAL/ C1513 BRAKE LAMP SWITCH, TECH CHECKED AND FOUND BRAKE LAMP SWITCH NO MAKING CONTACT CORRECTLY, TECH FOUND INTERNAL FAILURE OF BRAKE
KM8JN72D75U	10/11/04	921	37.47	TECH CALLED TECH ASSISTANCE CASE #180685 FOUND SHORT IN BRAKE LAMP SWITCH CAUSING ESP LIGHT TO STAY ON ALSO CHECKED FOR CODES IN ESP AND FOUND C1513 BRAKE LAMP SWITCH CODE REPLACED SWITCH AND RETEST			
KM8JN72D96U	10/14/05	16789	40.55	TECH FOUND ESP LIGHT STAYING ON, BRAKE STOP LAMP FAILURE, TECH FOUND STOP LAMP SWITCH NOT OPERATING CORRECTLY, TECH REPLACED SWITCH AS NEEDED.	SALES STATES ESC LIGHT ON, ADVISE		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE TECH FOUND ESP LIGHT STAYING ON, BRAKE STOP LAMP FAILURE, TECH FOUND STOP LAMP SWITCH NOT OPERATING CORRECTLY, TECH REPLACED SWITCH AS NEEDED.
KM8JM12B76U	12/23/05	6784	35.86	6784 BRAKES OPEN SHORT W CODES C1513 I CHECKED FOR TSB NONE, SO I REPLACED THE BRAKES TAMP SWITCH.	CUSTOMER STATES THAT FLOOR MAT HOLDER CAME OFF	E	INSTALLED SCREW EXTERIOR REPAIRS 6784 I INSTALLED THE OLD CARPET SCREW OUR CLIP, WORKING FINE LINE C IS THE SAME
KM8JM12B76U	12/23/05	6784	35.86	6784 BRAKES OPEN SHORT W CODES C1513 I CHECKED FOR TSB NONE, SO I REPLACED THE BRAKES TAMP SWITCH.	CUSTOMER STATES THAT CUP HOLDER IS BROKEN-TAB CAME OFF	E	HAD TO SPECIAL ORDER THE PART NEEDED TO REPAIR THIS CONCERN. HAD TO SPECIAL ORDER THE PART NEEDED TO REPAIR THIS CONCERN. 6784 ORDER PART DAVE
KM8JM12B76U	12/23/05	6784	35.86	6784 BRAKES OPEN SHORT W CODES C1513 I CHECKED FOR TSB NONE, SO I REPLACED THE BRAKES TAMP SWITCH.	CUSTOMER STATES THAT FLOOR MAT CARPET CAME APART	E	HAD TO SPECIAL ORDER THE PART NEEDED TO REPAIR THIS CONCERN. HAD TO SPECIAL ORDER THE PART NEEDED TO REPAIR THIS CONCERN.
KM8JN72D56U	11/16/05	31461	38.91	31200 TECH PULLED C1513 BRAKE LAMP SWITCH, FOUND BRAKE LAMP SWITCH TO BE SHORTED, TECH REPLACED SWITCH AS NEEDED.	CUSTOMER STATES THE CAR KEPT DOWN SHIFTING AND ACTING LIKE IT WAS GOING TO DIE, ADVISE., SEE HISTORY		THROTTLE POSITION SENSOR ASSY RE THROTTLE POSITION SENSOR ASSY RE 31470 TECH PULLED PO123 THROTTLE P. SENSOR HIGH INPUT, FOUND THAT THE VOLTAGE OUTPUT WAS NOT IN SPEC, NOT CYCLING BETWEEN .5 AND 4.8V, TECH REPLACED TPS AS NEEDED.
KM8JN72D56U	11/16/05	31461	38.91	31200 TECH PULLED C1513 BRAKE LAMP SWITCH, FOUND BRAKE LAMP SWITCH TO BE SHORTED, TECH REPLACED SWITCH AS NEEDED.	CUSTOMER STATES THE CAR KEPT DOWN SHIFTING AND ACTING LIKE IT WAS GOING TO DIE, ADVISE., SEE HISTORY		THROTTLE POSITION SENSOR ADD SCAN TOOL OPERATION THROTTLE POSITION SENSOR ADD SCAN TOOL OPERATION 31470 TECH PULLED PO123 THROTTLE P. SENSOR HIGH INPUT, FOUND THAT THE VOLTAGE OUTPUT WAS NOT IN SPEC, NOT CYCLING BETWEEN .5 AND 4.8V, TECH REPLACED TPS AS
KM8JM12B76U	12/23/05	6784	35.86	6784 BRAKES OPEN SHORT W CODES C1513 I CHECKED FOR TSB NONE, SO I REPLACED THE BRAKES TAMP SWITCH.	CUSTOMER STATES THAT ONE TIME WHEN IT WAS COLD ESC LIGHT CAME ON AND WASN'T ABLE TO SHUT IT OFF FOR ABOUT 3 HRS AND THEN WENT OFF AND WAS FINE.	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 6784 BRAKES OPEN SHORT W CODES C1513 I CHECKED FOR TSB NONE, SO I REPLACED THE BRAKES TAMP SWITCH.

KM8JN12D86U	11/11/05	23866	33.9	23866 C1513 BRAKE LIGHT SWITCH CIRCUIT FAILURE BRAKE LIGHT SWITCH IS INTERMITTENTLY GOING OPEN WARR TESTED THE VRAKE LIGHT SWITCH AND IT IS INTERMITTENTLY OPEN WHEN IT SHOULD BE CLOSED REPLACED THE SWITCH AND CLEARED CODE OK AT THIS TIME			
KM8JN12D56U	11/11/05	35637	34.22	35637 C1513 BRAKE LIGHT SWITCH OPEN.FOUND INTERMITTEN OPEN IN THE BRAKE LIGHT SWITCH WARR REPLACED THE BRAKE LIGHT SWITCH OK AT THIS TIME			
KM8JM12B56U	11/29/05	28208	38.91	28000 . TECH FOUND CODE C1513/BRAKE LAMP SWITCH, TECH CHECKED SWITCH AND FOUND TO HAVE EXCESSIVE RESISTANCE WHEN DEPRESSED, TECH REPLACED BRAKE LAMP SWITCH AS NEEDED, WORKS AS DESIGNED AND CODES DID NOT RETURN	CUSTOEMR STATES PASSENGER SIDE HEADLIGHT IS OUT, ADVISE		HEADLAMP BULB HEADLAMP BULB 28000 . TECH CONFIRMED PASSENGER SIDEHEADLAMP INOP. TECH CHECKED AND FOUND GOODPOWER AND GROUND, TECH FOUND HEADLIGHT BULBFILAMENT BURNT OUT, TECH REPLACED PASSENGERHEADLIGHT BULB AS NEEDED, WORKS AS DESIGNED
KM8JM12B56U	11/29/05	28208	38.91	28000 . TECH FOUND CODE C1513/BRAKE LAMP SWITCH, TECH CHECKED SWITCH AND FOUND TO HAVE EXCESSIVE RESISTANCE WHEN DEPRESSED, TECH REPLACED BRAKE LAMP SWITCH AS NEEDED, WORKS AS DESIGNED AND CODES DID NOT RETURN	PERFORM 079 CAMPAIGN		CAMAPIGN 079 CAMAPIGN 079
KM8JN72D26U	7/20/05	17312	35.86	17312 C1513 BRAKE SWITCH CIRCUIT INTERMITTENTLY OPEN WARR REPALCED THE BRAKE LIGHT SWITCH OK AT THIS TIME	CUSTOMER STATES WHEN COMING DOWN THE HILL THIS MORNING,THE ESC LIGHTCAME ON AND STAYED ON UNTIL CUSTOMER CYCLED THE KEY.	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 17312 C1513 BRAKE SWITCH CIRCUITINTERMITTENTLY OPEN WARR REPALCED THE BRAKELIGHT SWITCH OK AT THIS TIME
KM8JM72B46U	1/07/06	33595	34.22	33595 C1513 OPEN SHORT W I REPLACED THE BRAKES SWITCH NO MORE CODES.			
KM8JN72D96U	9/09/05	26280	32.76	ESC LIGHT ON FOUND CODE B1513 BRAKE LAMP SWITCH OPEN/SHORT REMOVED AND REPLACED THE BRAKE LIGHT SWITCH TO CORRECT CONCERN AT THIS TIME, RE CHECK OK			
KM8JM12B56U	11/29/05	28208	38.91	28000 . TECH FOUND CODE C1513/BRAKE LAMP SWITCH, TECH CHECKED SWITCH AND FOUND TO HAVE EXCESSIVE RESISTANCE WHEN DEPRESSED, TECH REPLACED BRAKE LAMP SWITCH AS NEEDED, WORKS AS DESIGNED AND CODES DID NOT RETURN	CUSTOMER STATES ESC OFF LIGHT WILL COME ON OCCASIONALLY, ADVISE		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 28000 . TECH FOUND CODE C1513/BRAKE LAMP SWITCH, TECH CHECKED SWITCH AND FOUND TO HAVEEXCESSIVE RESISTANCE WHEN DEPRESSED, TECHREPLACED BRAKE LAMP SWITCH AS NEEDED, WORKSAS DESIGNED AND CODES DID NOT RE
KM8JN72DX6U	12/26/05	13167	38.59	TECH CONFIRMED CUSTOMERS CONCERN, FOUND CRUISE CONTROL INOP. TEECH CHECKED WITH SCAN TOOL AND FOUND CODE C1513 BRAKE SWITCH CIRCUIT. TECH CHEC KED AND FOUND BRAKE SWITCH TO BE BAD. TECH REPL ACED BRAKE SWITCH AS NEEDED. SYSTEM OPERATING A S DESIGNED.	CUSTOMER STATES CRUISE CONTROL WORKS ONLY INTERMITTENTLY, ADVISE		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE TECH CONFIRMED CUSTOMERS CONCERN, FOUNDCRUISE CONTROL INOP. TEECH CHECKED WITH SCANTOOL AND FOUND CODE C1513 BRAKE SWITCHCIRCUIT. TECH CHEC KED AND FOUND BRAKE SWITCHTO BE BAD. TECH REPL ACED BRAKE SWITCH
KM8JN12D56U	10/24/05	15081	55.54	CUST STS ESC LIGHT ON FOUND CODE C1315 INTERNAL FAILURE WITH BRAKE LIGHT SWITCH REMOVED AND REPLACED BRAKE LIGHT SWITCH			
KM8JN72DX5U	2/18/05	33037	31.03		CUSTOMER STATES DRIVER DOES NOT LOCK BY SWITCH OR REMOTE CHECK AND ADVISE.	INSPECT CONFIRM:DOOR LOCK DOES NOT OPEN FROM SWITCH,FURTHER DIAGNOSIS SHOWS DOOR LOCK SWITCH INTERNAL FAILURE.	PART NOT IN STOCK CUSTOMER TO RETURN FOR REPAIR.
KM8JN72D26U	12/24/05	11809	37.63		THE OWNER STATES THAT THE ESC OFF LIGHT IS ILLUMINATED, THISHAS HAPPENED ABOUT 8 TIMES IN THE PAST. RANDOM CONDITIONS. AN ELEC. BURNING SMELL IS PRESENT WHEN THE LIGHT IS ILLUMINATED. NO DIRT ROADS, NO HARD BRAKING TOTALLY RANDOM. THE SWITCH WILL NOT TURN	CODE C1513 BRAKE LAMP SWITCH, VERIFIED THE BRAKE LAMP SWITCHTO HAVE AN OPEN SHORT.	REPLACE BRAKE LAMP SWITCH AND RETEST, SYSTEM OPERATES AS DESIGNED AT THIS TIME.
KM8JN72D56U	12/02/05	17206	37.63		CUSTOMER STATES THE ENGINE STALLS WHEN DRIVING INTER - STALLWHEN SLOWING DOWN AND WILL RESTART - 3 TIMES THIS WEEK	FOUND TPS OPERATING OUT OF SPEC AT TIME	REPLACED TPS
KM8JN72D56U	12/02/05	17206	37.63		CUSTOMER STATES ECS LIGHT COMES ON AND WILL NOT TURN OFF	OPEN CIRCUIT IN BRAKE LAMP SWITCH FOUND CODE C1513 FOR BRAKE LIGHT SWITCH FAULTY	REPLACED SWITCH

KM8JN72DX5U	2/18/05	33037	31.03		CUSTOMER STATES ESP LIGHT ON ALL THE TIME, CHECK AND ADVISE.	INSPECT FOR CONCERN: CONFIRM ESP LIGHT ON DOES NOT GO OUT USING SWITCH. SCANNED VEHICLE CODE C1513 PRESENT. INSPECT SWITCH, FOUND SWITCH STUCK CLOSED AT TIMES. REPLACED SWITCH, CLEARED CODES, RECHECKED OPERATION PERFORMING AS DESIGNED.	PERFORMED SERVICE AS DESCRIBED ABOVE.
KM8JN12D75U	5/20/05	51770	32.14		CUSTOMER STATES ESC LIGHT COMING ON, STAYS ON EVEN WITH SWITCH IN OFF POSITION.	INSPECT CONFIRM ESC LIGHT IS ON. SCANNED VEHICLE FOUND CODE C1237 AND C1513 PRESENT. PRESSURE SENSOR PIN CHECK 1 AND 3 5.0V GOOD PIN READING. PIN 2 3.5V DUE TO BRAKE LIGHT SWITCH INTERNAL FAILURE OPEN CIRCUIT. REPLACED SWITCH CLEARED CODE ROAD TEST VEHICLE PERFORM.	PERFORM SERVICE AS DESCRIBED ABOVE.
KM8JN12D65U	5/20/05	13586	33.34				
KM8JN72D56U	12/02/05	17206	37.63		CUSTOMER STATES THE REAR SEAT BELT BUCKLE DOES NOT WORK ANYMORE, SOP IS IN, REFER TO R/O #38824	FOUND BELT WILL NOT BUCKLE	REPLACED ASSY
KM8JM72B85U	7/05/05	16850	39.27				
KM8JN12D36U	10/17/05	22742	37.63		CUSTOMER CEL IS ON, REF TO R/O 37687, CODE C1513 AND PART WAS ORDERED, BRAKE LIGHT SWITCH	BRAKE LAMP SWITCH HAS SHORT INTERNALLY	REPLACED BRAKE LAMP SWITCH(SOP), OPERATES AS DESIGNED
KM8JN12D66U	10/14/05	12850	33.34	REPLACE INTERMITTENT INOP SWITCH			
KM8JM12B36U	2/09/06	14995	35.16		CUSTOMER STATES ESC OFF LIGHT COMES ON & STAYS ON WHILE DRIVING. CUSTOMER STATES PUSHING THE ESC BUTTON DOES NOT DO ANYTHING. ESC OFF LIGHT WILL STAY ON UNTIL VEHICLE IS TURNED OFF. LIGHT IS OFF AT	FAULTY BRAKE LAMP SWITCH ASSY. INTERMITTENT SEIZING ON CLOSE CIRCUIT.	REPLACED BRAKE LAMP SWITCH ASSY. RESET MODULE & CLEARED CODE C1513.
KM8JN12D46U	7/19/05	26313	60.66	CUSTOMER STATES ESC LIGHT IS ON AND OFF INTERMITTENTLY HOOKED UP SCAN TOOL AND CODE C1513 WAS STORED. SWITCH STICKING AND WONT RELEASE FAULTY BRAKE LIGHT SWITCH ASSY. REMOVED AND REPLACED BRAKE LIGHT SWITCH AND RESET THE LIGHT	CUSTOMER STATES ESC LIGHT COMES ON AND OFF INTERMITTENTLY SOP HERE!	C1513 BRAKE LAMP SWITCH BRAKE LIGHT INOP INTERMITTENTLY. INSPECT BRAKE LIGHT SWITCH STICKING AND WONT RELEASE. FAULTY BRAKE LIGHT SWITCH ASSEMBLY.	REMOVED AND REPLACED BRAKE LIGHT SWITCH AND RESET THE LIGHT.
KM8JN12D96U	8/13/05	28970	60.34	ESC LIGHT ON, SCAN, CODE C1513, BRAKE SWITCH INTERMITTENTLY WORKING, REPLACED, OK.	CUSTOMER STATES THAT ESC LIGHT COMING ON INTERM. ALSO STATES THAT PUSHES BUTTON IN AND NOTHING HAPPENS.	FOUND CODE C1513 BRAKE SWITCH FAILURE. FOUND BRAKE SWITCH INTERMITTENTLY NOW WORKING.	REPLACED BRAKE SWITCH AND RETESTED NOW IT IS WORKING PROPERLY.
KM8JN72D06U	9/23/05	20579	60.34	ESC LIGHT ON, SCAN, C1513, CLEARED FAULT, MONITORED SWITCH IN CURRENT DATA AND FOUND INOP RECHECKED FAULT AND IS WAS BACK. REPLACED SWITCH AND CLEARED FAULT.	CUSTOMER STATES ESC LIGHT IS ON IN THE DASH	FOUND FC C1513 FOR BRAKE LAMP SWITCH CLEARED FAULT AND MONITORED SWITCH IN CURRENT DATA AND FOUND INOP RECHECKED FAULT AND IS WAS BACK.	REPLACED SWITCH AND CLEARED FAULT.
KM8JN12D96U	1/24/06	23360	31.2	INSPECT AND ADJUST BRAKE LIGHT SWITCH	CUSTOMER REPORTS THAT AT TIMES THE ESC OFF LIGHT COMES ON	TECH FOUND CODE#C1513 BRAKE SWITCH CIRCUIT / FOUND THAT THE SWITCH WAS OUT OF ADJUSTMENT	READJUST BRAKE LIGHT SWITCH. REMOVED CODE. NORMAL OPERATION AFTER REPAIR HAD BEEN COMPLETED.
KM8JN12D96U	1/24/06	23360	31.2	INSPECT AND ADJUST BRAKE LIGHT SWITCH	CUSTOMER REQUEST REPAIR AS PER RECALL #079 / REPLACE THE DRIVER AIR BAG MODUL COVER.	RECALL	REPAIRED AS PER RECALL #079 - REPLACED THE DRIVER AIR BAG MODUL COVER. - COMPLETED.
KM8JN12D96U	1/05/06	10489	37.24	REPLACED BRAKE LIGHT SWITCH, RECHECKED AND THE LIGHTS OPERATES PROPERLY NOW			
KM8JN72D35U	2/15/05	15854	33.45	REPLACED FOR CRUISE CONTROL NOT SETTING	CUSTOMER STATES CRUISE LIGHT COMES ON AND FLASHES NOT SETTING AND ACTIVATING? CHECK AND ADVISE.	CHECK CRUISE OPERATION- FOUND CRUISE INTERMITTENTLY INOP. SET LIGHT WOULD JUST FLASH. CHECK VOLTAGES AT CRUISE MODULE. PIN 4-12.82 VOLTS-OK. PIN 1-CHARGING VOLTAGE-PEDAL RELEASED, NO VOLTAGE-PEDAL DEPRESED, PIN 5-NO VOLTAGE-PEDAL RELEASED, 12.67 VOLTS-PEDAL	DIAG BY TODD P. INSTALLED SOP PART BY JEFF W. REPLACED CRUISE CONTROL MODULE.
KM8JM12B76U	7/09/05	13565	17	ESC LIGHT ON, SCAN, CODE C1513, ADJUST BRAKE SWITCH, OK.	CUSTOMER STATES ELC ELECTRONIC STABILITY CONTROL LIGHT ON VEHICLE SEEMS FINE, CHECK AND ADVISE	C1513, BRAKE LAMP SWITCH.	ADJUST BRAKE LAMP SWITCH.
KM8JN12D56U	8/08/05	14161	38.6		CUST. STATES ESC LIGHT WAS ON. (ON FOR ONE WHOLE DAY) THEN ON AND OFF THE REST OF THE TIME	FOUND SHORT FOR BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN12DX6U	12/02/05	36169	42.66	C/S CAR STILL ACCELERATES WHEN PEDAL IS RELEASED. NEC TO REPLACE BRAKE LIGHT SWITCH			
KM8JN12D96U	8/26/05	21022	42.66	C/S BRAKE LIGHTS STAY ON ALL THE TIME. FOUND BRAKE LIGHT SWITCH PLUNGER IS STICKING. INTERNAL MALFUNCTION. REPLACE SWITCH			
KM8JM12B16U	7/20/05	12699	44.3		CUSTOMER STATES THE CAR IDLES ROUGH AND VERY LOW	R	SENSOR ASSY-THROTTLE POSITION RE SENSOR ASSY-THROTTLE POSITION RE
KM8JN12D96U	11/19/05	32231	40.26		CUSTOMER STATES ESC LIGHT KEEPS COMING ON.	SCANNED AND FOUND C1503 TCS1 ESP SWITCH- NOT	REPLACED SWITCH
KM8JN12D96U	11/19/05	32231	40.26		CUSTOMER STATES BRAKES LIGHTS DO NOT ALWAYS WORK	FOUND C1513 BRAKE LAMP SWITCH INTERMITTENTLY SHORTING	REPLACED SWITCH

KM8JN12D96U	11/19/05	32231	40.26		079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	PERFORMED 079	079 COMPLETED
KM8JN12D76U	11/08/05	15867	39.94		CUSTOMER STATE DRIVERSIDE REAR DOOR OUTER HANDLE(TOWARDS BACK OF VEHICLE SEEMS TO BE LOOSE	FOUND DRIVERSIDE DOOR HANDLE BROKEN	REPLACED DOOR HANDLE
KM8JM12B16U	7/20/05	12699	44.3		CUSTOMER STATES THE CAR IDLES ROUGHAND VERY LOW	R	SENSOR ASSY-THROTTLE POS ADD SCAN TOOL OPERATION SENSOR ASSY-THROTTLE POS ADD SCAN TOOL OPERATION
KM8JM12B16U	7/20/05	12699	44.3		CUSTOMER REPORTS THAT "ABS" WARNINGLIGHT IS ON, CHECK FOR FAULTS AND REPORT ON CAUSE. / /	DTO	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B55U	5/20/05	24026	60.96	ESP LIGHT COMES ON, DTC C1513 BRAKE LAMP SWITCH SHORT/OPEN REPLACED BRAKELAMP SWITCH, OK NOW	CUST STATES THAT THE ESP LIGHT COMES ON CHECK AND ADVISE	DTC C1513 BRAKE LAMP SWITCH SHORT/OPEN	ELECTRICAL MISC. 24026 DTC C1513 BRAKE LAMP SWITCH SHORT/OPEN REPLACED BRAKELAMP SWITCH, OK NOW
KM8JN12D76U	11/08/05	15867	39.94		CUSTOMER STATES AC DOES NOT SEEM TO BLOW VERY COLD	CHECKED AC NOT BLOWING COLD 54DEGREES CHECKED SYSTEM-RECHARGED SYSTEMED AND ADDED DYE..	RECHECKED WITH LEAK DETECTOR AND FOUND ORING ON TOP OF COND ENSOR LEAKING-FOUND LOOSE- RETIGHTEND AND RECHECKED-
KM8JM12BX6U	7/13/05	36828	40.26	ESC LIGHT COMES ON & OFF. (PART IN SOP) C1513 BRAKE LIGHT SWITCH. SHORTED BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH.	ESC LIGHT COMES ON AND OFF (PART IN SOP)	C1513 BRAKE LIGHT SWITCH, SHORTED BRAKE LAMP SWITCH	RELACED BRAKE LAMP SWITCH AND OK NOW 93810R00.3
KM8JM12BX6U	7/13/05	31841	30.6	CUST STATES ESC LIGHT COMES ON AT TIMES. REF TECH TIP STOP LAMP SWITCH ADJUSTMENT. ORDERED STOP			
KM8JN12D35U	6/02/05	25426	74.14	ESP LIGHT KEEPS GOING ON/OFF, FALUT CODE C1513 BRAKE LAMP SWITCH MALFUNCTION INTERMITTANTLY STICKING ON, CK WIRING DUE TO LIGHTS BEING OF FOR SHORT CIRCUIT IN HARNESS OK; REMOVED AND TESTED SWITCH CONTINUITY INTERMITTANT CONTINUITY W/SWITCH OFF, REPLACED	CUST. REPORTS THE ESP LIGHT KEEPS GOING OFF & ON AT TIMES (ADVISE)	DIAGNOSED, FAULT CODE #C1513 BRAKE LAMP SWITCH MALFUNCTIONING, SWITCH INTERMITTANT STICKING.	ELECTRICAL, MISC. 25426 DIAGNOSED, FAULT CODE #C1513 BRAKE LAMP SWITCH MALFUNCTIONING, SWITCH INTERMITTANT STICKING. CHECKED WIRING DUE TO LIGHTS BEING ON, CHECKED FOR SHORT CIRCUIT IN HARNESS, TEST BRAKE LAMP SWITCH CONTINUITY, REPLACED BRAKE LAMP SWITCH.
KM8JN72D86U	12/16/05	12465	40.26		CUST STATES ESC OFF LIGHT WILL COME ON AND OFF AT TIMES	SCANNED DTC'S-C1513 FOR BRAKE LAMP SWITCH	REPLACED FAULTY BRAKE LAMP SWITCH
KM8JN72D86U	12/16/05	12465	40.26		CUST STATES CD UNIT WILL NOT ACCEPT CD NO.2 CD LIGHT KEEPS FLASHING	INTERNAL SHORT WITH HEAD UNIT	REPLACED HEADUNIT
KM8JN12D35U	6/02/05	25426	74.14	ESP LIGHT KEEPS GOING ON/OFF, FALUT CODE C1513 BRAKE LAMP SWITCH MALFUNCTION INTERMITTANTLY STICKING ON, CK WIRING DUE TO LIGHTS BEING OF FOR SHORT CIRCUIT IN HARNESS OK; REMOVED AND TESTED SWITCH CONTINUITY INTERMITTANT CONTINUITY W/SWITCH OFF, REPLACED	THANK YOU FOR YOUR PATRONAGE. YOU WILL BE RECEIVING A SURVEY FROM HYUNDAI MOTORS AMERICA IN A FEW DAYS. ONLY YOU CAN HELP US BE #1. A RATING OF 900 OR BETTER WILL BE GREATLY APPRECIATED.		THANK YOU FOR YOUR PATRONAGE. YOU WILL BE RECEIVING A SURVEY FROM HYUNDAI MOTORS AMERICA IN A FEW DAYS. ONLY YOU CAN HELP US BE #1. A RATING OF 900 OR BETTER WILL BE GREATLY APPRECIATED.
KM8JN12D35U	4/14/05	14253	74.14	ESP OFF LIGHT STAYS ON, ALL TIMES, DIAGNOSED, FAULT CODE #C1513 BRAKE LAMP SWITCH INTERMITTANT STUCK REPLACED SWITCH ASSY, ALL OPERATING AS DESIGNED NOW.	CUSTOMER STATES, ESP OFF LIGHT STAYS ON AT ALL THE TIME, CHECK & ADVISE	FAULT CODE #C1513 BRAKE LAMP SWITCH INTERMITTANT STUCK	ELECTRICAL, MISC. 14253 FAULT CODE #C1513 BRAKE LAMP SWITCH INTERMITTANT STUCK REPLACED SWITCH ASSY, ALL OPERATING AS DESIGNED NOW.
KM8JN12D35U	4/14/05	14253	74.14	ESP OFF LIGHT STAYS ON, ALL TIMES, DIAGNOSED, FAULT CODE #C1513 BRAKE LAMP SWITCH INTERMITTANT STUCK REPLACED SWITCH ASSY, ALL OPERATING AS DESIGNED NOW.	CUSTOMER STATES, CENTER DASH COIN TRAY WILL NOT COME OUT AND WILL NOT STAY IN PLACE, CHECK & ADVISE	INSPECTED AND FOUND ASHTRAY DEFECTIVE	BODY, INTERIOR 14253 INSPECTED AND FOUND ASHTRAY DEFECTIVE ORDERED A NEW ASHTRAY, WILL CALL WHEN IN.
KM8JN12D06U	7/28/05	22078	40.26	CUST STATES ABS LIGHT AND ESC LIGHTS (OFF AT TIME) WHEN LIGHTS WERE ON THERE WAS A GRINDING NOISE. C1203 (HISTORY), C1513 BRAKE LAMP SWITCH SHORTED. REPLACED BRAKE LAMP SWITCH. CLEARED TROUBLE CODES.	CUST STATES ABS LIGHT AND ESC LIGHTS (OFF AT TIME) WHEN LIGHTS WERE ON THERE WAS A GRINDING NOISE	C1203 (HISTORY), C1204, C1513 BRAKE LAMP SWITCH SHORTED	REPLACED BRAKE LAMP SWITCH, CLEARED TROUBLE CODES AND OK NOW. 93810R00.3
KM8JN72D86U	8/12/05	27933	40.26	REPLACED BRAKE LAMP SWITCH, CLEARED TROUBLE CODE	CUST STATES ESC LIGHT COMES ON	C1513 BRAK LAMP SWITCH INOP, SHORTED	REPLACED BRAKE LAMP SWITCH, CLEARED TROUBLE CODE
KM8JN72D86U	8/12/05	27933	40.26	REPLACED BRAKE LAMP SWITCH, CLEARED TROUBLE CODE	CUSTOMER STATES ESC LIGHT COMES ON AT TIMES.	C1237 PRESSURE SENSOR SWITCH, SHORTED	REPLACED PRESSURE SENSOR SWITCH AND OK NOW
KM8JN12D06U	1/10/06	31993	35.31	ECS LIGHT COMES ON AND STAYS ON, C1513 BRAKE SWITCH CIRCUIT OPEN/SHORT REPLACED BRAKE SWICTH, OK NOW	CUST STATES THAT THE ECS LIGHT COMES ON AND STAYS ON SOP IS IN	C1513 BRAKE SWITCH CIRCUIT OPEN/SHORT	ELECTRICAL MISC. 31993 C1513 BRAKE SWITCH CIRCUIT OPEN/SHORT REPLACED BRAKE SWICTH, OK NOW
KM8JN12D06U	1/10/06	31993	35.31	ECS LIGHT COMES ON AND STAYS ON, C1513 BRAKE SWITCH CIRCUIT OPEN/SHORT REPLACED BRAKE SWICTH, OK NOW	CUST STATES THAT THE TURN SIGNAL WILL NOT RETURN WHEN TURNING LEFT SOP IS IN	RETURN TAB BROKEN	ELECTRICAL MISC. 31993 RETURN TAB BROKEN REPLACED TURN SIGNAL SWITCH, OK NOW
KM8JM12B06U	7/15/05	33045	39.94		CUSTOMER STATES ESC LIGHT OFF WILL APPEAR AT TIMES WHILE DRIVING-TRIED HITTING BUTTON AND NOTHING	FOUND FAULTY BRAKE SWITCH- SCANNED FOR FAULTS AND TEST DROVE CHECKED SWITCH - INTERNALLY SHORT NOT	REPLACED SWITCH
KM8JM12B06U	7/15/05	33045	39.94		CUSTOMER STATES THAT THERE IS A RECALL ON HER DRIVERSIDE AIRBAG	PERFORMED 079 CAMPAIGN	079 COMPLETED
KM8JM12B66U	7/16/05	20568	39.94		CUST STATES ESC LIGHT CAME ON A WEEK AGO AND OFF AT TIME.	C1513 FOUND BRAKE SWITCH OUT OF SPECIFICATIONS	REPLACED BRAKE SWITCH, CLEARED TROUBLE CODE AND OK NOW
KM8JM12B86U	7/16/05	16892	39.94				
KM8JN12D06U	1/10/06	31993	35.31	ECS LIGHT COMES ON AND STAYS ON, C1513 BRAKE SWITCH CIRCUIT OPEN/SHORT REPLACED BRAKE SWICTH, OK NOW	CUST STATES THAT AIR DOES NOT BLOW FROM CENTER DASH VENTS SOP IS IN	BLOWER MODE MOTOR INOP	AIR CONDITIONING MISC. 31993 BLOWER MODE MOTOR INOP REPLACED MODE MOTOR, BLEND CONTROLS WORKING GOOD NOW

KM8JN12D75U	9/16/04	32098	33.88	SPEED CONTROL INIO, CRUISE SWITCH BAD, DURING REPAIRS FOUND OPEN IN BRAKE SWITCH REPLACED CRUISE SWITCH STILL WORKING INTERMITTENTLY, FOUND OPEN IN BRAKE SWITCH, REPLACED BRAKE SWITCH OK NOW	CUST. REPORTS. SPEED CONTROL INOP. PARTS WERE ORDER	CRUISE SWITCH BAD, DURING REPAIRS FOUND OPEN IN BRAKE SWITCH	ELECTRICAL MISC. 32098 CRUISE SWITCH BAD, DURING REPAIRS FOUND OPEN IN BRAKE SWITCH REPLACED CRUISE SWITCH STILL WORKING INTERMITTENTLY, FOUND OPEN IN BRAKE SWITCH, REPLACED BRAKE SWITCH OK NOW
KM8JN12D25U	6/15/05	12581	35.6	ESP LIGHT STAYS ON, BRAKE LAMP SWITCH MALFUNCTION, REPLACED BRAKE LIGHT SWITCH.	CUST. REPORTS. ESP LIGHT STAYS ON AT TIME PARTS WERE ORDER	BRAKE LAMP SWITCH MALFUNCTIONED.	ELECTRICAL, MISC. REPLACED BRAKE LIGHT SWITCH.
KM8JN72D25U	10/16/04	26625	100.06	CHECKED FUSES, GOOD. CHECKED GROUND G21. FOUND LOOSE GROUND. TIGHTENED GROUND AND ROAD TESTED. STILL INOP. CHECKED POWER AND GROUNDS. FOUND NO VOLTS AT C56 TERMINAL 1. CHECK FOR VOLTAGE AT BRAKE LIGHT SWITCH. VOLTAGE AT C54 TERMINAL 3 OK, NO VOLTAGE AT TE	CUSTOMER STATES CRUISE IS INOP-TRIED SWITCH LAST TIME NO FIX	CHECKED FUSES, GOOD. CHECKED GROUND G21. FOUND LOOSE GROUND. TIGHTENED GROUND AND ROAD TESTED. STILL INOP. CHECKED POWER AND GROUNDS. FOUND NO VOLTS AT C56 TERMINAL 1. CHECK FOR VOLTAGE AT BRAKE LIGHT SWITCH. VOLTAGE AT C54 TERMINAL 3 OK, NO VOLTAGE AT TER	REPLACED BRAKE LIGHT SWITCH. RECHECKED. 9831038110 93810R00.3
KM8JN72D25U	10/16/04	26625	100.06	CHECKED FUSES, GOOD. CHECKED GROUND G21. FOUND LOOSE GROUND. TIGHTENED GROUND AND ROAD TESTED. STILL INOP. CHECKED POWER AND GROUNDS. FOUND NO VOLTS AT C56 TERMINAL 1. CHECK FOR VOLTAGE AT BRAKE LIGHT SWITCH. VOLTAGE AT C54 TERMINAL 3 OK, NO VOLTAGE AT TE	CUSTOMER REQUESTS HYUNDAI SERVICE LOANER VEHICLE HYUNDAI SERVICE LOANER PROVIDED - NO CHARGE TO CUSTOMER		COMPLIMENTARY SERVICE LOANER PROVIDED TO CUSTOMER
KM8JN12D66U	1/14/06	11005	35.31	ESC OFF LIGHT ON DASH CAME ON WHILE DRIVING AND ONLY WAY TO CLEAR IS BY SHUTTING OFF ENGINE, DIAGNOSED, FAULT CODE #C1513 BRAKE LIGHT SWITCH INTERNAL FAILURE. REPLACED BRAKE LAMP SWITCH, ALL GOOD NOW.	CUSTOMER STATES, ESC OFF LIGHT ON DASH CAME ON WHILE DRIVING AND THE ONLY WAY TO CLEAR IT WAS BY SHUTTING ENGINE OFF, CHECK & ADVISE	DIAGNOSED, FAULT CODE #C1513 BRAKE LIGHTSWITCH INTERNAL FAILURE.	ELECTRICAL MISC. 11005 DIAGNOSED, FAULT CODE #C1513 BRAKE LIGHT SWITCH INTERNAL FAILURE. REPLACED BRAKE LAMP SWITCH, ALL GOOD NOW.
KM8JN12D66U	1/14/06	11005	35.31	ESC OFF LIGHT ON DASH CAME ON WHILE DRIVING AND ONLY WAY TO CLEAR IS BY SHUTTING OFF ENGINE, DIAGNOSED, FAULT CODE #C1513 BRAKE LIGHT SWITCH INTERNAL FAILURE. REPLACED BRAKE LAMP SWITCH, ALL GOOD NOW.	CUSTOMER STATES, A/C SYSTEM FEELS LIKE STOPS GETTING COLD WHILE DRIVING, CHECK & ADVISE	OPERATING NORMAL AT THIS TIME.	AIR CONDITIONING MISC. 11005 OPERATING NORMAL AT THIS TIME. NO REPAIRS MADE.
KM8JN12D46U	10/25/05	8503	39.94		CUST STATES THEY WERE ADVISED BY FIRESTONE THAT CAMBER IS OUT OF SPEC.	SUBLET FOR ALIGNMENT CHECK. FOUND TOE AND CAMBER OUT OF SPEC.	ALIGNED AND INSTALLED CAMBER BOLTS BOTH FRONT SIDE.
KM8JN12D46U	10/25/05	8503	39.94		CUST. STATES ESC OFF LIGHT IS ON FREQUENTLY.	SCAN FOR CODES. C1513 BRAKE LAMP SWITCH. CHECKED CIRCUIT. FOUND BRAKE LAMP SWITCH HAS INTERMITTANT	REPLACED BRAKE LAMP SWITCH AND RECHECKED. CAUSAL 938103K000
KM8JN12D15U	5/19/05	31391	40.26	CUST STATES ESP LIGHT COMES ON AT TIMES. FOUND FAULT FOR BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES PART OF THE ARMREST IS BROKEN (SHORTER PART)	ARMREST LID HINGE WEAKEND	REPLACED ARMREST LID
KM8JN12D66U	1/14/06	11005	35.31	ESC OFF LIGHT ON DASH CAME ON WHILE DRIVING AND ONLY WAY TO CLEAR IS BY SHUTTING OFF ENGINE, DIAGNOSED, FAULT CODE #C1513 BRAKE LIGHT SWITCH INTERNAL FAILURE. REPLACED BRAKE LAMP SWITCH, ALL GOOD NOW.	CUSTOMER STATES, CENTER CONSOLE MIDDLE TRAY BROKEN OFF WHILE DRIVING, CHECK & ADVISE	WEAK MATERIALS	BODY INTERIOR 11005 WEAK MATERIALS ORDERED PART, WILL CALL WHEN PART ARRIVES.
KM8JN12D65U	5/26/05	27580	60.96	ESP LIGHT COMES ON AND STAYS ON. DTC C1513 BRAKE LAMP SWITCH INSPECTED VEHICLE WITH SCAN TOOL DTC C1513 PRESENT BRAKE LAMP SWITCH SHORT REPLACED BRAKE LAMP SWITCH OK NOW	CUST STATES THAT THE ESP LIGHT COMES ON AND STAYS ON CHECK AND ADVISE	DTC C1513 BRAKE LAMP SWITCH	ELECTRICAL MISC. 27580 DTC C1513 BRAKE LAMP SWITCH INSPECTED VEHICLE WITH SCAN TOOL DTC C1513 PRESENT BRAKE LAMP SWITCH SHORT REPLACED BRAKE LAMP SWITCH OK NOW
KM8JN12D15U	5/19/05	31391	40.26	CUST STATES ESP LIGHT COMES ON AT TIMES. FOUND FAULT FOR BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES ESP LIGHT COMES ON AT TIMES	FOUND FAULT FOR BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12D15U	5/19/05	31391	40.26	CUST STATES ESP LIGHT COMES ON AT TIMES. FOUND FAULT FOR BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH.	PERFORM 079	PERFORMED 079	079 COMPLETED
KM8JN12BX6U	7/13/05	23776	41.9		CUST STATES TRACTION CONTROL LIGHT ON, RUNS FINE	SCANNED FOUND FAULT FOR C1518 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN12D35U	5/27/05	23152	35.31	ESC LIGHT COMES ON AND STAYS ON, C1513 BRAKE LAMP SWITCH OPEN/SHORT REPLACED BRAKE LAMP SWITCH AND CLEARED COMPUTER OK NOW	CUST STATES THAT ESC LIGHT COMES ON CHECK AND ADVISE	C1513 BRAKE LAMP SWITCH OPEN/SHORT	ELECTRICAL MISC. 23152 C1513 BRAKE LAMP SWITCH OPEN/SHORT REPLACED BRAKE LAMP SWITCH AND CLEARED COMPUTER OK NOW
KM8JN12D35U	5/27/05	23152	35.31	ESC LIGHT COMES ON AND STAYS ON, C1513 BRAKE LAMP SWITCH OPEN/SHORT REPLACED BRAKE LAMP SWITCH AND CLEARED COMPUTER OK NOW	CUST STATES THAT THE VEHICLE IS CRANKING SLOW CHECK AND ADVISE	BATTERY TESTS BAD	ELECTRICAL MISC. 23152 BATTERY TESTS BAD REPLACED BATTERY, HYUNDAI TO PAY 25% PERCENT OF BATTERY AND LABOR CHARGES.
KM8JN12DX5U	5/27/05	31760	60.96	WHEN DOING SAFETY TECH NOTED, NO BRAKE LIGHTS & ESP LIGHT ON, STOP LIGHT SWITCH DEFECTIVE, REPLACED			
KM8JN12D06U	10/16/05	22555	40.26		CUSTOMER STATES ON FIRST STARTS AT TIMES ESC OFF LIGHT WILL STAY ON	FOUND FAULT C1513 BRAKE LAMP SWITCH FAULT-TESTED IT NOT RESPONDING	REPLACED SWITCH
KM8JN12D06U	10/16/05	22555	40.26		PERFORM RECALL 079	PERFORMED 079 COMPLETED	079 COMPLETED

KM8JN12DX6U	7/29/05	40237	40.26	REPLACED DEFECTIVE SWITCH, RECHECKED OPERATIONS AND ROAD TEST	TSC LIGHT COMES ON AT TIMES WHEN DRIVING CHECK AND ADVISE	CHECKED OPERATIONS SCANNED FOR CODES C1513 BRAKE LAMP SWITCH SHORT AT TIMES TO GROUND	REPLACED DEFECTIVE SWITCH, RECHECKED OPERATIONS AND ROAD TEST
KM8JN12D66U	1/06/06	4805	60.96	ECS LIGHT IS ON, FAULT CODE #C1513 BRAKE LAMP SWITCH INTERNAL FAILURE. REPLACED BRAKE LAMP SWITCH, CLEARED FAULT CODE, RE-TESTED SYSTEM, ALL OPERATING			
KM8JM12B55U	6/01/05	23961	60.96	ESP LIGHT IS FLASHING, BRAKE LIGHT SWITCH STICKING, INTERNAL FAILURE, CAUSING ESP LIGHT TO STAY ON OFF, REPLACED STOP LAMP SWITCH ASSY, NOW OPERATING PER			
KM8JM12B57U	11/01/06	2576	64.26	CUST STATES BOTH BRAKE LIGHT BULBS INOP. SCANNED FOR CODES - C1513 AND C1237 PRESENT. REPLACED SHORTED OUT BRAKE LIGHT SWITCH. OK AT THIS TIME. TT FOR SCAN			
KM8JM12B35U	4/09/05	14521	65.9	C1513 ATT IS FOR SCAN NO LABOR OP			
KM8JN12D66U	8/17/05	19674	64.26	CUST STATES CEL ON - SCANNED C1513. RR BRAKE LIGHT SWITCH. TT FOR SCAN	CUST STATES CHECK ENGINE LIGHT ON ECS LIGHT COMES ON INTERMITTENTLY - NOISE UNDER DRIVERS FOOT	RUN DIAGNOSTICS ON CODE C1513	TESTED AND REPLACED BRAKE LIGHT SWITCH
KM8JN12D36U	9/24/05	13631	33.64	CUSTOMER STATES ESC OFF LIGHT COMES AND STAYS WHILE DRIVING, CODE C1513 BRAKE SWITCH ERROR DUE TO OPEN CIRCUIT. REPLACED BRAKE SWITCH, ALL OPERATING AS DESIGNED NOW.	CUSTOMER STATES, ESC OFF LIGHT COMES AND STAYS ON WHILE DRIVING AND ESC BUTTON WILL NOT TURN IT BACK ON, INTERMITTANT, CHECK & ADVISE	CODE #C1513 BRAKE SWITCH ERRO DUE TO OPEN CIRCUIT.	ELECTRICAL, MISC. 13631 CODE #C1513 BRAKE SWITCH ERRO DUE TO OPEN CIRCUIT. REPLACED BRAKE SWITCH, ALLOPERATING AS DESIGNED NOW.
KM8JN12D36U	9/24/05	13631	33.64	CUSTOMER STATES ESC OFF LIGHT COMES AND STAYS WHILE DRIVING, CODE C1513 BRAKE SWITCH ERROR DUE TO OPEN CIRCUIT. REPLACED BRAKE SWITCH, ALL OPERATING AS DESIGNED NOW.	CUSTOMER STATES, RIGHT SIDE PANEL UNDER STEERING WHEEL COLUMN WILL NOT STAY IN PLACE, CHECK & ADVISE	FOUND BROKEN CLIPS FROM PANEL POSSIBLY FROM PANEL REMOVAL WHEN INSTALLING AN AFTERMARKET ALARM, NOT WARRANTY CONCERN.	BODY, INTERIOR 13631 FOUND BROKEN CLIPS FROM PANEL POSSIBLY FROM PANEL REMOVAL WHEN INSTALLING AN AFTERMARKET ALARM, NOT WARRANTY CONCERN. NO REPAIRS MADE AT THIS TIME, (ESTIMATE ON PART 84750-2E550-Z9 = \$30.00
KM8JN12D16U	8/12/05	19908	64.26	CUST STATES ESC LIGHT COMES ON INTER - SEEMS TO BE MORE WHEN DAMP OUT. SCANNED - C1513 - FOUND FAULTY STOP LAMP SWITCH. RR SWITCH. OK.			
KM8JN12D86U	7/26/05	10982	36.64				
KM8JM12B46U	7/22/05	19540	36.64	CUST STATES ESC LIGHT KEEPS COMING ON. FOUND SHORTED OUT BRAKE SWITCH. REPLACED. OK AT THIS TIME.			
KM8JN12DX6U	10/27/05	28678	100.34	TT IS FOR MINOR WIRING AND SCAN C1513			
KM8JN12D76U	10/24/05	30229	35.31	CHECK ENGINE LIGHT ON DISGNOSED, FAULT CODE #C1513 BRAKE LAMP SWITCH MALFUNCTIONING. REPLACED BRAKE LAMP SWITCH, ALL OPERATING NORMAL NOW.	CUSTOMER STATES, ESC OFF LIGHT ON DASH COMES ON AND WILL NOT GO OFF WHILE DRIVING, INTERMITTANT, CHECK & ADVISE	DIAGNOSED, FAULT CODE #C1513 BRAKE LAMP SWITCH MALFUNCTIONING.	ELECTRICAL MISC. 30229 DIAGNOSED, FAULT CODE #C1513 BRAKE LAMP SWITCH MALFUNCTIONING. REPLACED BRAKE LAMP SWITCH, ALL OPERATING NORMAL NOW.
KM8JN12D76U	10/24/05	30229	35.31	CHECK ENGINE LIGHT ON DISGNOSED, FAULT CODE #C1513 BRAKE LAMP SWITCH MALFUNCTIONING. REPLACED BRAKE LAMP SWITCH, ALL OPERATING NORMAL NOW.	CHECK ENGINE LIGHT COMES ON, ORDERED PART IS IN	DIAGNOSED, FAULT CODE #P0036 BANK 1 SENSOR 2 HEATER CONTROL MALFUNCTIONING.	TEST & DIAGNOSES FOR CHECK ENGINE LIGHT STAYING ON. 30229 DIAGNOSED, FAULT CODE #P0036 BANK 1 SENSOR 2 HEATER CONTROL MALFUNCTIONING. REPLACED BANK 1 SENSOR 2 OXYGEN SENSOR, CLEARED CODES, RE-TESTED SYSTEM, ALLOPERATING NORMAL NOW.
KM8JN12D96U	9/13/05	19059	37.11		CHECK AND ADVISE CUSTOMER STATES THAT ESC LIGHT WILL COME ON AND GO OFF	CODE C1513	CHECKED AND TESTED SYSTEM AND REPLACED FAULTY BRAKE SWITCH RESET LIGHT AND ROAD TESTED VEHICLE
KM8JN12D86U	8/31/05	4751	63.94	C1513 ATT IS FOR SCAN NO LABOR OP			
KM8JN12DX6U	10/27/05	48090	64.26	CUST STATES ESC LIGHT ON. SCANNED - C1513 - REPLACED BRAKE SWITCH. OK. TT FOR SCAN			
KM8JN72D56U	1/09/06	11057	64.26	CUST STATES ESC LIGHT IS ON - SCAN - C1513 - FOUND BRAKE SWITCH INOP. REPLACED. OK. TT FOR SCAN			
KM8JN12D05U	10/15/04	38212	35.4		CUSTOMER STATES CRUISE CONTROL SETS AND WILL NOT STAY ENGAGED. SOP PARTS IN.	CRUISE SET SWITCH AND BRAKE SWITCH FAILURE	REPLACED CRUISE SET SWITCH AND BRAKE SWITCH.
KM8JN12D05U	10/15/04	38212	35.4		PERFORM AIR BAG RECALL	RECALL	REPLACED AIR BAG MODULE
KM8JN12D16U	10/10/05	13379	38.75		CUSTOMER STATES ABS LIGHT STAYS ON. CHECK & ADVISE..	TEAT SYSTEM RECIVED CODES. OF C2402 AIR BAG MODULE...	REMOVED AND REPLACED ABS MODULE..... CLEARED ALL CODES..TEST DROVE VEHICAL OK
KM8JN12D75U	8/30/04	20439	35.53	CUST STATES CRUISE INOP - FOUND BRAKE LIGHT SWITCH INOP. REPLACED. OK.			
KM8JN12D36U	12/08/05	7380	42.2				
KM8JN12D36U	12/17/05	18455	42.04				
KM8JN12D36U	12/17/05	18455	10				
KM8JN12D16U	10/10/05	13379	38.75		CUSTOMER STATES ESC STAYS ON & OFF..CHECK & ADVISE..	FOUND BRAKE LIGHT SWITCH BAD..	REMOVED AND REPLACED BRAKE LIGHT SWITCH...
KM8JM12B86U	7/13/05	19992	38.75		CUSTOMER STATES ESC LIGHT STAYS ON CHECK & ADVISE..	FOUND BRAKE LAMP SWITCH BAD..	FIXED ON CONCERN #1
KM8JM12B86U	7/13/05	19992	38.75		CUSTOMER STATES REAR BRAKES INOP. CHECK & ADVISE..	FOUND CODES..BRAKE LIGHT SWITCH..	REMOVED AND REPLACED BRAKE LIGHT SWITCH.. TEST OPERATION OK...

KM8JM12B96U	1/12/06	13569	34.41		CUSTOMER STATES ESC LIGHT STAYS ON. ADVISE	B1513 BRAKE LIGHT SWITCH MALFUNCTION	REPLACED BRAKE LIGHT SWITCH CLEARED CODE
KM8JM12B96U	1/12/06	13569	34.41		CUSTOMER STATES DO RECALL 079	UP DATE	PERFORMED RECALL 079
KM8JN12DX5U	6/02/05	35018	34.41		CUSTOMER STATES ESP LIGHT STAYS ON. ADVISE	C1513 BRAKE LIGHT SWITCH MALFUNCTION OPEN CIRCUIT	REPLACED BRAKE LIGHT SWITCH
KM8JN12DX5U	6/02/05	35018	34.41		CUSTOMER STATES OPEN RECALL TO BE PERFORMED ON VEH. ORDERED PART ON 11-09.	UP DATED	PERFORMED RECALL 079
KM8JN12D05U	6/15/05	32164	36.79		ESP LIGHT IS ON ALL THE TIME. PLEASE CHECK AND ADVISE.	TECH INSPECTED WITH CONSULT FINDING DTC C1513 BRAKE SWITCH MALFUNCTION.	REMOVED AND REPLACED BRAKE SWITCH, CLEARED CODE. TEST DROVE CHECKS OK.
KM8JN12D05U	6/15/05	32164	36.79		CUSTOMER STATES DRIVER'S DOOR WINDOW RUN FAILED, ALLOWING WIND NOISE LEAKAGE. INSTALL SOP.	TECH INSPECTED AND VERIFIED RUN FAILURE.	REMOVED AND REPLACED DRIVER'S DOOR WINDOW RUN TO RESOLVE, CHECKS OK.
KM8JN12D56U	11/03/05	18299	37.11		CUSTOMER STATES ESC WARNING LIGHT GOES ON INTERMITTENTLY, REMOVE AND REPLACE BRAKE SWITCH, SOP IN.	TECH INSPECTED WITH CONSULT FINDING DTC P0571 BRAKE SWITCH MALFUNCTION CODE STORED.	REMOVED AND REPLACED BRAKE SWITCH AND RESET PCM TO RESOLVE, CHECKS OK.
KM8JN72D25U	11/27/04	15995	33.81	TCS LIGHT ON. FOUND CODES P1765, C1237, AND C1513. FOUND BRAKE LIGHT SWITCH TO HAVE INTERNAL OPEN CIRCUIT. REPLACED BRAKE LAMP SWITCH AND CLEARED CODES.	CUSTOMER STATES THAT THE TCS LIGHT IS STAYING ON NOW IS OFF	BRAKE LAMP SWITCH C1513	REPLACED BRAKE LAMP SWITCH
KM8JN72D05U	6/14/05	24379	33.06	ESP LIGHT COMES ON. FOUND CODE C1513-BRAKE LIGHT . FOUND BRAKE LIGHT TO HAVE OPEN CIRCUIT IN SWITCH. REPLACED BRAKE LIGHT SWITCH.	CUST STATES ESP LIGHT COMES AT TIMES PLEASE ADVISE	FOUND VEH CODED P1513 BRAKES SWITCH	REPLACED SWITCH
KM8JN12D16U	12/16/05	23025	64.24	CUST STATES ESC INDICATOR BLINKS ON AND OFF WHILE DRIVING CODE HOOKED UP SCNAN TOOL AND CODE C1513 STORED REPLACED SWITCH	CUSTOMER STATES STEERING WHEEL DOESN'T TURN FREELY AND IS SQUEEING. ADDITIONALLY, VEHICLE IS PULLING TO THE LEFT, CHECK AND ADVISE.	TECH INSPECTED AND VERIFIED FRONT TIRES WORN OUT/NEVER ROTATED AND LEFT FRONT TIRE HAS TWO SEPARATE METAL PUNCTURESAND RECOMMENDED REPLACING FRONT TWO TIRES. NON WARRANTY REPAIR.	CUSTOMER DECLINED RECOMMENDED REPAIR AT THIS TIME.
KM8JN12D16U	12/16/05	23025	64.24	CUST STATES ESC INDICATOR BLINKS ON AND OFF WHILE DRIVING CODE HOOKED UP SCNAN TOOL AND CODE C1513 STORED REPLACED SWITCH	CUSTOMER STATES ESC INDICATOR LIGHT BLINKS ON AND OFF WHILE DRIVING, CHECK AND ADVISE.	TECH INSPECTED AND VERIFIED BRAKE SWITCH FAILURE.	REMOVED AND REPLACED BRAKE SWITCH TO RESOLVE, CHECKS OK.
KM8JN12D76U	10/24/05	22626	34.41		CUSTOMER STATES ESC OFF STAYS ON. ADVISE IT WILL JUST COME ON AND STAY ON AND UNTIL YOU SHUT THE CAR OFF IT RESETS	C1513 BRAKE LIGHT SWITCH OPEN CIRCUIT	REMOVED AND REPLACED BRAKE LIGHT SWITCH CLEARED LIGHT
KM8JN12D45U	4/22/05	30171	34.41		CUSTOMER STATES:ESC LIGHT COMES ON AT TIMES	BRAKE LIGHT SWITCH HAS A BAD CONNECTION	REPLACED BRAKE LIGHT SWITCH
KM8JN12D45U	4/22/05	30171	34.41		CUSTOMER STATES SUV HAD SOME COME FROM UNDER THE HOOD AND CAR WAS MAKING A WINE NOISE AND UNABLE TO STEER BATTERY & BRAKE LIGHT CAME ON	HARMONIC BALANCER SEPRATING CAUSING BELT TO RIDE INTO LOWER TIMING BELT COVER & DAMAGE SERP BELT TENSIONER & IDLERWITH RUBBER FROM BALANCER	REPLACED BALANCER BELT,BELT TENSIONER IDLER AND LOWER TIMING COVER
KM8JN12D16U	12/16/05	23025	64.24	CUST STATES ESC INDICATOR BLINKS ON AND OFF WHILE DRIVING CODE HOOKED UP SCNAN TOOL AND CODE C1513 STORED REPLACED SWITCH	CUSTOMER STATES LOW BEAMS DON'T WORK, CHECK AND ADVISE.	TECH INSPECTED AND VERIFIED BULB FAILURES.	REMOVED AND REPLACED LEFT AND RIGHT HEADLAMP BULBS TO RE- SOLVE, CHECKS OK.
KM8JN12D16U	12/16/05	23025	64.24	CUST STATES ESC INDICATOR BLINKS ON AND OFF WHILE DRIVING CODE HOOKED UP SCNAN TOOL AND CODE C1513 STORED REPLACED SWITCH	CUSTOMER STATES CRUISE CONTROL ONLY WORKS INTERMITTENTLY, CHECK AND ADVISE.	TECH INSPECTED AND VERIFIED BRAKE SWITCH FAILURE.	REPLACED BRAKE SWITCH ON LINE 4 OF THIS REPAIR ORDER TO RESOLVE, CHECKS OK.
KM8JM12B15U	5/19/05	49623	36.36	SCAN TEST CODE C1513 BRAKE SWITCH OPEN IN SWITCH CAUSING LIGHT TO COME ON REMOVED & REPLACED BRAKE			
KM8JN12D45U	4/22/05	30171	34.41		CUSTOMER STATES DO RECALL 922	UP DATE	PERFORMED RECALL 922
KM8JN12D45U	4/22/05	30171	34.41		CUSTOMER STATES DO RECALL 079	UP DATE	PERFORMED RECALL 079
KM8JM12B55U	6/07/05	26543	34.41	ESP LIGHT ON. FOUND CODE C1513-BRAKE LIGHT SWITCH. FOUND SWITCH TO HAVE OPEN CIRCUIT. REPLACED SWITCH.	CUSTOMER STATES MASTER CYLINDER SWITCH IS LEAKING	C1513 BRAKE LIGHT SWITCH HAS OPEN SHORT	REPLACED BRAKE LIGHT SWITCH
KM8JN12D56U	8/17/05	13263	62.74	INSPECTED VEHICLE AND SCANNED FOR CODES,FOUND CODE C1237 PRIMARY PRESSURE SENSOR-SIGNAL AND C1513 BRAKE SWITCH CIRCUIT.CHECKED SYS AND FOUND THAT THE VEHICLE NEEDS A BRAKE PRESSURE SWITCH AND A BRAKE SWITCH.THERE WOULD BE NO			
KM8JN72D05U	12/01/04	826	38.32				
KM8JM12B06U	7/14/05	14316	36.36	DIAGONSED CAR REASON FOR THE ESC LIGHT COMING ON AND FOUND CODE C1513 BRAKE SWITCH PULLED SWITCH OUT AND CHECKED FOUND REPLACED WITH NEW ONE CHECKED THE NEW NE WORKS, ERASED TROUBLE			
KM8JM12B55U	6/07/05	26543	34.41	ESP LIGHT ON. FOUND CODE C1513-BRAKE LIGHT SWITCH. FOUND SWITCH TO HAVE OPEN CIRCUIT. REPLACED SWITCH.	CUSTOMER STATES DO OPEN RECALL 079	UP DATED	PERFORMED RECALL 079
KM8JM12B55U	6/07/05	26543	34.41	ESP LIGHT ON. FOUND CODE C1513-BRAKE LIGHT SWITCH. FOUND SWITCH TO HAVE OPEN CIRCUIT. REPLACED SWITCH.	CUSTOMER STATES DO OPEN RECALL 922	UP DATED	PERFORMED RECALL 922

KM8JM12B96U	9/05/05	36576	34.41	ESC LIGHT ON. OFUND CODE C1573-BRAKE LIGHT ON. FOUND SWITCH TO HAVE OPEN CIRCUIT. REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES ESC LIGHT COMES ON & OFF	C1573 BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH & CLEARED CODE
KM8JN12D56U	7/12/05	12366	30.95		CUSTOMER STATES THAT THE ESC LIGHT IS SHOWING AT ALL TIMES. CHECK.	TESTED WITH HI-SCAN AND FOUND DTC-C1513 BRAKE LIGHT SWITCH.	REPLACED BRAKE LIGHT SWITCH AND CLEARED CODES. TEST DROVE AND RECHECKED. OK AT THIS TIME.
KM8JN12D56U	7/12/05	49325	29.31		CUSTOMER STATES CHECK ESC LIGHT IS ON AND WILL NOT GO OFF	SCANNED FOR DTCS FOUND C1513. HAS HAD BRAKE LAMP SWITCH REPLACED BEFORE. CHECKED CONNECTION. CONNECTIONS GOOD CIRCUIT MALFUNCTION IN BRAKE LIGHT SWITCH CLEAR CODES AND IMMEDIATELY RETURN	REPLACED BRAKE LAMP SWITCH AND CLEARED CODES. NO CODES RETURNED AT THIS TIME
KM8JM12B96U	9/05/05	36576	34.41	ESC LIGHT ON. OFUND CODE C1573-BRAKE LIGHT ON. FOUND SWITCH TO HAVE OPEN CIRCUIT. REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES DO RECALL 079 SOP	UP DATE	PERFORMED RECALL 079
KM8JM12B45U	4/22/05	18693	34.41				
KM8JN12D46U	9/09/05	24489	34.26	CHECK FOUND BRAKE LAMP SWITCH BAD. REPLACED FAULTY SWITCH	CUSTOMER STATES ESC LIGHT IS ON.	N94	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D46U	8/08/05	20488	34.26	PULLED CODE C1513 CHECK AND FOUND BRAKE LAMP SWITCH BAD. REPLACED FAULTY LAMP	CUSTOMER STATES OCS LIGHT IS ON	N69	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12DX6U	1/13/06	21271	29.31	REPLACED BRAKE LAMP SWITCH AND CLEARED CODES	CUSTOMER STATES CHECK ESC LIGHT IS ON	CHECKED AND FOUND DTC FOR BRAKE LIGHT SWITCH	REPLACED BRAKE LAMP SWITCH AND CLEARED CODES
KM8JN12D36U	12/07/05	18348	28.99		CUSTOMER STATES CHECK OPERATION OF WEIGHT SYSTEM FOR PASSENGER AIRBAG. SEEMS TO GO OFF AND ON FREQUENTLY	CHECKED AND FOUND OPERATING NORMALLY WHEN PROPERLY SEATED	NO REPAIR NECESSARY AT THIS TIME
KM8JN12D36U	12/07/05	18348	28.99		CUSTOMER STATES CHECK ESC OFF LIGHT HAS BEEN ON	TESTED AND FOUND DTC FOR BRAKE LAMP SWITCH FAILURE	REPLACED BRAKE LAMP PEDAL SWITCH
KM8JN12D85U	5/24/05	19947	29.31		CUSTOMER STATES ESC LIGHT IS ON	FOUND DTC FOR BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH. ALL CHECKS OK AT THIS TIME
KM8JN12DX5U	5/26/05	32837	30.71				
KM8JN12D47U	11/09/06	3675	30.71		C/S ESC LITE ON AND THEN OFF	SCAN COMPUTER CODE C1513 TRACE TO BRAKE LITE SWITCH SHORTED ON ECS TER	REPLACE SWITCH ASSY
KM8JM12B86U	1/12/06	1102	30.95		C/S ESC LITE WHEN OFF AND WOULD NOT COME BACK ON WITH BUTTOM UNTIL KILL ENGINE	SCAN COMPUTER CODE C1513 AND C1616 LOW AMPS TO BRAKE LITE SWITCH	REPLACE SWITCH ASSY CASE 235690
KM8JN12D76U	8/29/05	22073	30.95		CHECK BRAKE LIGHTS ARE NOT WORKING	TESTED AND FOUND BRAKE LIGHT SWITCH INOPERATIVE	REPLACED BRAKE LIGHT SWITCH
KM8JN72D76U	12/10/05	18986	28.99				
KM8JN12D56U	12/30/05	11464	28.01				
KM8JM12B25U	5/17/05	40816	30.39		CUSTOMER STATES CHECK ENGINE LIGHT ON ANS ESP LITE ON ANDS OFF	SCAN CODES C1611, C1237 AND C1513 TRACE TO BEAKES LIGHT SWITCH SHORTED	REPLACE SWITCH ASSY
KM8JM12B25U	5/17/05	40816	30.39		C/S NOISE ON REAR OVER BUMPS	TRACE TO REAR STRUTS LEAKAGE AND MOUNTS WORN	REPLACE REAR SRTUTS AND UPPER MOUNTS
KM8JM12B25U	5/17/05	40816	30.39		C/S RADIO WONT PLAY CDS	ELECT TEST RADIO WILL TAKE CD	REPLACE RADIO ASSY PARTS REPLACEMENT 4-13-07 R05715
KM8JN12D85U	6/02/05	31543	30.39		C/S ESP LITE ON AND TTHEN OFF	SCAN COMPUTER CODE C1513 BRAKE LITE SWITCH SHORTED	REPLACE SWITCH ASSY
KM8JN12D26U	1/06/06	18986	28.01				
KM8JN12D77U	8/18/06	7807	27.69				
KM8JN12D96U	8/30/05	38546	28.01				
KM8JN12D87U	11/10/06	6356	28.01				
KM8JM12B16U	7/11/05	46854	28.01				
KM8JN12DX5U	5/20/05	37223	33.66				
KM8JM12B45U	7/05/05	24697	59.3	ESP LIGHT ON SCAN TEST FOUND CODE C1513 BRAKE LAMP SWITCH INOP REPLACED BRAKE LIGHT SWITCH			
KM8JM12B45U	7/05/05	59713	33.34				
KM8JN12D96U	8/13/05	30717	33.66				
KM8JN12D86U	8/25/05	21472	32				
KM8JN12D56U	10/23/05	29963	89.83				
KM8JN12D16U	4/19/06	5	32.3				
KM8JN12D66U	11/10/05	21243	32.76				
KM8JN12D96U	8/13/05	25666	33.66				
KM8JN72D76U	1/10/06	22506	32.91	CUSTOMER STATES ESC LAMP STAYS ON. C1513 BRAKE LIGHT SWITCH. FOUND FAULTY BRAKE LIGHT SWITCH. REPLACED SWITCH AND CLEARED CODES.			
KM8JN12D95U	6/09/05	30155	33.05	CUSTOMER STATES ESP LIGHT IS STAYING ON. C1513 BRAKE SWITCH ERROR. REPLACED BRAKE SWITCH.			
KM8JN12D25U	6/21/05	25728	32.76				
KM8JN12D15U	5/18/05	12275	31.24				
KM8JN12DX5U	4/27/05	28447	31.24				
KM8JN12D96U	8/12/05	4103	31.24				
KM8JN72D75U	4/14/05	11603	30.66	NA			
KM8JN12D66U	7/18/05	15738	60.34	ESC LIGHT IS ON-S CANNED FOR CODES C1513- DEFECTIVE BRAKE LIGHT SWITCH. CLEARED CODE AND REPLACED SWITCH. RETESTED, ALL FINEPAID ADD'L TIME FOR SCAN TIME	ESC OFF LIGHT WILL DISPLAY	C1513 BAD BRAKE LIGHT SWICTH	REPLACED BRAKE LIGHT SWICTH CLEAR CODE CKED SYSTEM
KM8JN72D26U	7/21/05	11936	60.34	ESC LIGHT IS ON. SCANNED FOR CODES C1513- BRAKE LIGHT SWITCH HAS OPEN- REMOVED AND REPLACED BRAKE LIGHT SWITCH. CLEARED CODE AND RETESTED, ALL FINEPAID ADD'L .3 FOR SCAN TIME	ESC LIGHT COMES ON AFTER REPROGRAM	C1513 BAD BRAKE LIGHT SWICTH	REPLACED BRAKE LIGHT SWICTH CLEAR CODE
KM8JM12B56U	8/26/05	13822	31.56				
KM8JN12D67U	11/21/06	21	31.24				
KM8JN12D06U	8/08/05	23321	31.24				

KM8JN12D66U	8/10/05	12463	31.24				
KM8JN72D35U	6/09/05	20134	35.16		C/S THE ALL REAR BRAKE LIGHTS ARE OUT. ADVISE	FAILED SWITCH	REPLACED BRAKE SWITCH. ALL LIGHTS WORKING
KM8JN12D66U	7/18/05	13871	60.66	PAID ADD'L TIME FOR SCAN TIME C1513	ESC LIGHT IS ON THEN GOES OFF. COMES ON AFTER DRIVING 10 MIN OR SO	SCAN CHECKED CODE C1513 BRAKE SWITCH	REPLACED BRAKE SWITCH AND CLEARED CODE. TEST DROVE OK
KM8JM12B26U	7/13/05	24871	60.66	PAID ADD'L TIME FOR SCAN TIME C1513	BRAKE PEDAL GOES ALL THE WAY TO THE FLOOR	MASTER CYLINDER OUT OF FLUID. BRAKE FLUID LEAK.	REPLACED MASTER CYLINDER, REPLACED ABS PUMP ON PRIOR LINE STILL NOT OPERATING CORRECTLY, REPLACED MASTER CYLINDER
KM8JN12D25U	6/03/05	20292	31.24				
KM8JN12D36U	7/28/05	22257	31.24				
KM8JN12D26U	7/29/05	24421	31.24				
KM8JN12D76U	12/23/05	9020	31.56				
KM8JM12B26U	7/13/05	24871	60.66	PAID ADD'L TIME FOR SCAN TIME C1513	ESC OFF LIGHT STAYS ON	SCAN CHECKED FAILED BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH CLEARED CODE
KM8JM12B26U	7/13/05	24871	60.66	PAID ADD'L TIME FOR SCAN TIME C1513	BRAKE LIGHT STAYS ON	OUT OF BRAKE FLUID. FOUND ASB PUMP LEAKING	REPLACED ABS PUMP, UNABLE TO BLEED BRAKE SYSTEM. REPLACED BRAKE MASTER CYLINDER. BLEAD BRAKE SYSTEM TEST DROVE. OK CHECKED FOR LEAKS, NO LEAKS FOUND
KM8JN72D85U	5/13/05	28801	62.3	.3 ATT TIME TO RUN SCAN, THERE IS NO LABOR OP FOR SCANNING WITH THIS REPAIR. SCAN CODE P1513- ESP, AIR BAG AND ABS LIGHTS FLASHING- REPLACED BRAKE LAMP SWITCH AND CLEARED CODE	ESP AIR BAG AND ABS LITES FLASHING.SEE HISTORY SOP HERE		REPLACED BRAKE LAMP SWITCH AND CLEARED CODE P1513
KM8JN12D55U	6/24/05	16688	31.56				
KM8JN72D45U	9/16/04	11394	29.85				
KM8JN12D36U	9/30/05	8641	33.2				
KM8JN12D36U	9/30/05	15106	31.56				
KM8JN12D75U	5/24/05	45952	34.84		SPECIAL ORDERED BRAKE SWITCH EPS LIGHT STAYS ON	CODE C1513. FAILED BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN12DX6U	12/05/05	16119	30.66				
KM8JN72D25U	5/19/05	42850	42.34	42850 INSTALL SOP BRAKE SWITCH DIAG ON PREVIOUS RO			
KM8JN12DX6U	7/29/05	25525	31.24				
KM8JN12D95U	5/20/05	12460	33.2				
KM8JN12D95U	5/20/05	12460	33.2				
KM8JN12D26U	9/25/05	7968	31.24				
KM8JN12DX6U	12/30/05	11695	39.34		CUSTOMER STATES ESC LIGHT IS ON , ADVISE	FOUND CODE C1513 BRAKE LIGHT SWITCH, CHECKED ADJUSTMENT OF SWITCH, GOOD, HOOKED UP OHN METER AND PRESSED PEDAL AND FOUND BRAKE SWITCH TO HAVE AN INTERMITTENT OPEN/SHORT NEED TO REPLACE BRAKE LAMP SWITCH TO CORRECT ESC LIGHT	COMPLETED, CLEARED CODES
KM8JN12DX6U	12/30/05	11695	39.34		FACTORY RECALL 079 DRIVERS AIRBAG COVER MODULE	PER RECALL	COMPLETED
KM8JN72D95U	1/20/05	24259	39.06		CUSTOMER STATES, ESP LIGHT IS ON.	FOUND BRAKE SWITCH TO BE INT. FAILING. REC. REPLACE SWITCH. REPLACED SWITCH, ADJUSTED CORRECTLY.ERASED CODES. TESTED GOOD	COMPLETED
KM8JN72D95U	1/20/05	24259	39.06		CUSTOMER STATES,BATTERY KEEPS DYING, ADVISE	TESTED FOR PARASITIC DRAW AND FOUND IT COMING FROM RADIO. REC. REPLACE RADIO AND RETEST. REPLACED RADIO. TESTED GOOD	COMPLETED
KM8JN12D26U	9/27/05	20228	31.24				
KM8JN12D46U	11/21/05	13179	31.56				
KM8JN12D26U	7/19/05	16515	31.24				
KM8JN12D36U	12/08/05	18067	40.99		CUSTOMER STATES ESC LIGHT COMES ON AT TIMES	FOUND CODE C1513, FOUND BRAKE LIGHT SWITCH SHORTED	REPLACED BRAKE LIGHT SWITCH
KM8JN72D95U	1/20/05	24259	39.06		CUSTOMER STATES, CD PLAYER NOT WORKING, ADVISE	FOUND CD PLAYER WILL NOT INSERT OR EJECT CD'S. REC. REPLACE.REPLACED CD PLAYER. TESTED GOOD.	COMPLETED
KM8JN12D56U	12/30/05	7983	39.34	CUSTOMER STATES THE ESC LIGHT COMES ON INTERMITTENTLY. TECH VERIFIED ESC LIGHT COMING ON. FOUND CODE C1513 BRAKE LAMP SWITCH OPEN/SHORT. NEED TO REPLACE SWITCH. TECH REPLACED BRAKE LAMP SWITCH. NO MORE PROBLEM AT THIS TIME	CUSTOMER STATES THE ESC OFF LIGHT COMES ON, INTERMITTENT ADVISE	FOUND CODE C1513 BRAKE LAMP SWITCH OPEN/SHORT FOUND THE BRAKE LAMP SWITCH IS INTERMITTENTLY OPEN, NEED TO REPLACE SWITCH TO CORRECT CONCERN	COMPLETED, CLEARED CODES, TEST DRIVE GOOD
KM8JN12D16U	7/27/05	11253	41.31		UPON INSPECTION FOUND BRAKE LIGHTS INOP	FOUND BRAKE LIGHTS INOP	REPLACED BRAKE LIGHT SWITCH
KM8JN72D76U	1/24/06	25809	40.99		CUSTOMER STATES ESC LIGHT COMES ON AT TIMES	FOUND CODE C1513	FOUND BRAKE LIGHT SWITCH SHORTED REPLACED BRAKE LIGHT SWITCH
KM8JN12D85U	5/25/05	14856	41.31	REPLACE BRAKE LIGHT SWITCH AND CLEAR CODES	CUSTOMER STATES ESC LIGHT COMES ON	CODE C1211 1208 1611 AND 1513	REPLACE BRAKE LIGHT SWITCH AND CLEAR CODES
KM8JM12B76U	7/12/05	20925	41.3		CUST STATES ESP LIGHT COMES ON --WONT WORK WITH SWITCH		REPLACE ESP SWITCH
KM8JN72D36U	12/09/05	7259	41.3		CUSTOMER STATES THE ECS OFF LIGHT IS ON, ON THE DASH		FOUND SWITCH FAILED REPLACE SWITCH
KM8JN12D56U	11/09/05	700	30	THEESC LIGHT IS ON AGAIN. PERFORMED TEST AND FOUND CODE C1513 BRAKE SWITCH. CHECKED SWITCH AND IS FINE AT THIS POINT. TEST DROVE AND CLEARED CODES. OK NOW	CUSTOMER STATES THE ESC LIGHT IS ON AGAIN, ADVISE	CODE C1513 BRAKE SWITCH ERROR, PERFORMED TESTS FOR C1513 ANDFOUND SWITCH TO BE WORKING PROPERLY AT THIS TIME	NO PROBLEMS FOUND TEST DROVE 10 MILES, GOOD
KM8JN12D56U	11/09/05	700	30	THEESC LIGHT IS ON AGAIN. PERFORMED TEST AND FOUND CODE C1513 BRAKE SWITCH. CHECKED SWITCH AND IS FINE AT THIS POINT. TEST DROVE AND CLEARED CODES. OK NOW	CUSTOMER STATES THE VEHICLE PULLS TO THE RIGHT, ADVISE	CONFIRMED	COMPELTED ALIGNMENT, TEST DROVE GOOD, NO MORE PULL

KM8JM12B76U	7/12/05	20925	41.3		R 922		PERFORM REPROGRAM
KM8JN12DX6U	8/09/05	24061	41.31	REPLACED BRAKE LIGHT SWITCH	CUST STATES ESC LIGHT COMES ON	FOUND C1513 FOUND BRAKE LIGHT SWITCH SHORTED	REPLACED BRAKE LIGHT SWITCH
KM8JN12D25U	1/25/05	4	30.9				
KM8JN12DX6U	1/04/06	7413	39.66	CUST STATES ESC LIGHT COMES ON WHILE DRIVING. VERIFIED CUSTOMER CONCERN OF ESC LIGHT ON. FOUND CODE C1513 BRAKE SWITCH LAMP. CLEARED CODE. CODE RETURNED. INTERNAL BRAKE SWITCH SHORT. REPLACED BRAKE SWITCH. FUNCTIONS AS DESIGNED AFTER REPAIR.	CUSTOMER STATES ESC LIGHT COMES ON WHILE DRIVING PLEASE CHECK AND ADVISE	VERIFIED CUSTOMER CONCERN SCAN TOOL CODE C1513 BRAKE SWITCH LAMP. CLEARED CODE. CODE RETURNED INTERNAL BRAKE SWITCH	SHORT REPLACED BRAKE SWITCH CLEARED CODE ADJUSTED SWITCH AS PER TSB ROAD TESTED NO CODE OR LIGHT RETURNED AT THIS TIME
KM8JN12D96U	12/12/05	10645	39.34	CUSTOMER STATES ESC LIGHT ON. TECH CONFIRMED AND FOUND CODE C1513 BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH. NO FURTHER PROBLEM AT THIS TIME.	CUSTOMER STATES ESC LIGHT ON	FOUND CODE C1513, PER TSB 06-50-006 BRAKE LAMP SWITCH	REPLACE SWITCH COMPLETED
KM8JN12D55U	7/08/05	17607	33.64	MO 17609	CUSTOMER STATED ESC LIGHT FLICKER WHILE DRIVING.	RAN SCAN TEST FOUND CODE C1513 BRAKE SWITCH ERROR	REPLACED BRAKE SWITCH CLEARED CODE AND TEST
KM8JN12DX6U	12/27/05	5580	33.64	MO 5585	CUSTOMER STATES 3 TIMES LAST MONTH, WOULDN'T START. JUMP IT & IT WOULD BE FINE FOR AWHILE..	TEST BATTERY WITH TESTER FOUND BAD BATTERY REPLACE SEE ATTACHED	REPLACE BATTERY AND TEST CHARGING SYSTEM PASSED SEE ATTACHED
KM8JN12DX6U	12/27/05	5580	33.64	MO 5585	CUSTOMER STATES ESC OFF LIGHT IS ON.	SCAN WITH GDS FOUND CODE C1513 IN ESC MODULE FOUND BRAKE SWITCH OPEN SHORT	REPLACE BRAKE SWITCH CLEAR CODE TEST DRIVE 5 MILE CODE DID NOT RETURN
KM8JM12B36U	2/10/06	13447	39.34		CUSTOMER STATES WHILE TAKING TURNS IN HER TUCSON, HER ESC OFF LIGHT IS ON ALL THE TIME AT ALL SPEEDS -20MPH ADVISE	CONFIRMED, FOUND THE CODE C1513 BRAKE LAMP SWITCH CIRCUIT, FOUND THE BRAKE SWITCH BAD, HAS POWER AND GROUND NEED TO REPLACE BRAKE SWITCH DUE TO INTERNAL FAILURE	COMPLETED, CLEARED CODES, TEST DRIVE GOOD
KM8JM12B06U	5/18/06	34396	39.66	CUST STATES GEAR SHIFT WILL NOT GO INTO PARK AND KEYS ARE STUCK IN IGNITION. CONFIRMED CONCERN AND FOUND SHIFTER ASSEMBLY BROKEN DUE TO CUST ATTEMPT TO REMOVE KEYS. AFTER REPLACING BROKEN SHIFTER PARTS RETESTED AND FOUND BRAKE LAMP SWITCH WORN BEYOND USEFUL	CLIENT STATES GEAR SHIFT WILL NOT GO INTO PARK AND KEYS ARE LOCKED IN IGNITION. CHECK INSPECT AND ADVISE ON REPAIRS	VERIFIED CLIENTS CONCERN. TRACED ISSUES TO SHIFTER ASSEMBLY WORN BEYOND USEFUL TOLERANCES. DISASSEMBLED SHIFTER ASSEMBLY REPLACED DEFECTIVE COMPONENTRY. RETESTED AND FOUND BRAKE SWITCH WORN BEYOND USEFUL TOLERANCES. REMOVED AND REPLACED BRAKE SWITCH AND	AFTER REPAIRS PERFORMED ON VEHICLE NO EVIDENCE OF CLIENTS PREVIOUS ISSUES DISCOVERED AT THIS TIME. PERFORMED AND PASSED QUALITY CONTROL INSPECTION
KM8JN12D06U	12/26/05	12191	33.64		CUSTOMER STATES ESC LIGHT WAS ON OFF NOW.	OPEN	SCAN TEST CODES C1503 & C1513. TEST & REPLACE BRAKE LIGHT SWITCH
KM8JN12D35U	7/08/05	24509	33.96	SCAN TEST CODE C1513. TEST & REPLACE BRAKE LIGHT SWITCH	CUSTOMER STATES: ESP LIGHT COMES ON INTERMITTENTLY.	OPEN.	SCAN TEST CODE C1513. TEST & REPLACE BRAKE LIGHT SWITCH
KM8JN12DX6U	12/29/05	10994	33.96		CUSTOMER SAYS ESC LIGHT COMES ON THEN OFF	OPEN.	SCAN TEST CODE B1513. REPLACE BRAKE SWITCH
KM8JN12DX6U	12/29/05	10994	33.96		PERFORM SAFETY RECALL	SAFETY RECALL	REPLACE AIR BAG AS PER
KM8JM12B16U	7/19/05	21538	10	CUST CONCERN NOISE ON LEFT TURNS ONLY AND ECS LIGHT ON. FOUND CODE C1513 BRAKE SWITCH FAILURE. FOUND BRAKE SWITCH OUT OF ADJUSTMENT. ADJUSTED. TEST DROVE. NOISE GONE	CUSTOMER STATES THERE IS A NOISE ON LEFT TURNS ONLY AND ECS OFF LIGHT IS ON, ADVISE	FOUND CODE C1513 BRAKE SWITCH FAILURE. FOUND BRAKE SWITCH OUT OF ADJUSTMENT, ADJUSTED. TEST DROVE. NOISE GONE	COMPLETED
KM8JM12B16U	7/19/05	21538	10	CUST CONCERN NOISE ON LEFT TURNS ONLY AND ECS LIGHT ON. FOUND CODE C1513 BRAKE SWITCH FAILURE. FOUND BRAKE SWITCH OUT OF ADJUSTMENT. ADJUSTED. TEST DROVE. NOISE GONE	FACTORY RECALL 079 DRIVER AIR BAG COVER	PER RECALL	COMPLETED
KM8JN12D05U	7/07/05	21417	35.6	MO 21420	CUSTOMER STATED ESP LAMP WILL COME ON, HAVE TO TURN OFF VEHICLE AND RESTART TO HAVE LIGHT GO OUT.	RAN SCAN TEST FOUND BRAKE LAMP SWITCH OPEN/SHORTED, CODE C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH CLEARED CODE AND TEST DROVE
KM8JN12DX6U	9/28/05	30990	33.96		CUSTOMER STATES DOME LIGHT NOT WORKING. ORDERED PARTS ARE IN	BURNED OUT. BULB MISSING CUSTOMER REMOVED BULB	REPLACE DOME BULB.
KM8JN12DX6U	9/28/05	30990	33.96		CUSTOMER STATES ABS LIGHT ON. ORDERED BRAKE LIGHT SWITCH IS IN.	OPEN/	SCAN TEST CODE B1315, REPLACE BRAKE SWITCH
KM8JN12D76U	8/08/05	4228	39.34	CONCERN, ESC LIGHT STAYS ON, DIAG CODE C1513, BRAKE SWITCH ERROR, TECH TESTED SWITCH, SWITCH FAILED, REPLACE SWITCH, COMPLETED	CUSTOMER STATES, ESC LIGHT WILL STAY ON FOR A DAY OR SO AND THEN GO OFF.	PULLED CODES AND FOUND BRAKE SWITCH ERROR CODE C1513. TESTED SWITCH FOUND IT NOT WORKING INT. REPLACED SWITCH, CLEARED CODE, NO FURTHER PROBLEMS FOUND.	COMPLETED
KM8JN12D76U	8/08/05	4228	39.34	CONCERN, ESC LIGHT STAYS ON, DIAG CODE C1513, BRAKE SWITCH ERROR, TECH TESTED SWITCH, SWITCH FAILED, REPLACE SWITCH, COMPLETED	FACTORY RECALL 079 DRIVER AIR BAG COVER	PER RECALL	COMPLETED
KM8JN12D86U	10/08/05	18602	39.34	CUSTOMER STATES THE ECS OFF LIGHT COMES ON AND OFF. TECH INSPECTED VEHICLE AND FOUND CODE C1513 BRAKE LAMP SWITCH. TECH FOUND BRAKE LAMP SWITCH INOPERABLE. TECH REPLACED BRAKE LAMP SWITCH AND CLEARED CODE. NO MORE PROBLEM AT THIS TIME.	CUSTOMER STATES THE ECS OFF LIGHT COMES ON AND OFF. PLEASE CHECK AND ADVISE.	TECH INSPECTED VEHICLE AND FOUND CODE-C1513-BRAKE LAMP SWITCH. TECH FOUND TSB 06-50-006-FOR FAILED BRAKE LAMP SWITCH.	TECH REMOVED AND REPLACED THE BRAKE LAMP SWITCH AND CLEARED CODE.
KM8JN12D05U	7/07/05	53112	33.96		CUSTOMER STATES: INTERMITTENTLY STALLING OUT AT IDLE. SURGES & RPM'S GO TO 3000.DOE ONLY WHEN DRIVING AROUND TOWN	FOUND CODE P0102 AIR FLOW LOW INPUT, MAF NOT READING CORRECTLY NEED TO REPLACE	REPLACED MAF SENSOR ROAD TESTED OK

KM8JN12D05U	7/07/05	53112	33.96		CUSTOMER STATES ESC LIGHT COMES ON & OFF.	C1513 BRAKE LAMP SWITCH CODE FOUND BRAKED LAMP SWITCH NOT RESPONDING WHEN STEPPING ON PEDAL NEED TO REPLACE SWITCH	REPLACED SWITCH AND CHECKED OPERATING AS DESIGNED
KM8JN12D05U	7/07/05	53112	33.96		RECALL 079 DRIVERS AIRBAG COVER MOD REPL	SAFETY RECALL	COMPLETED RECALL
KM8JN72D75U	12/16/04	42103	38.23	CUSTOMER STATES ESC LIGHT CAME ON AND WOULD NOT RESPOND TO SWITCH. LUGHT WENT OFF AGAIN IN THE MORNING. NO LIGHT ON PRESENT. SCAN CODE C1513 BRAKE LAMP SWITCH. FOUND INTERNAL FAILURE IS BRAKE SWITCH. REPLACED BRAKE LAMP SWITCH. FUNCTIONS AS DESIGNED.	CUSTOMER STATES ESP LIGHT CAME ON AND WOULD NOT RESPOND TO SWITCH. LIGHT WENT OFF THIS MORNING. PLEASE CHECK AND ADVISE	LIGHT IS OFF PULLED CODE C1513 BRAKE LAMP SWITCH CLEARED CODE REPLACED BRAKE LAMP SWITCH WORKING AS DESIGNED AT THIS	TIME
KM8JN12D96U	8/11/05	19159	29.74	TECH SCAN ESC SYSTEM FOUND CODE #C1513 NECC TO REPLACE BRAKE LIGHT SWITCH	CUST STATES ESP LIGHT ON ALL THE TIME	OPEN CIRCUIT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE. TECH SCAN ESC SYSTEM FOUND CODE #C1513 NECC TO REPLACE BRAKE LIGHT SWITCH
KM8JN12D16U	11/18/05	17639	33.96		CUSTOMER STATED W/TURNING, SLOWLY, OR WAITING AT STOPS, VEHICLE WILL STALL.	PLAY IN SHAFT	TEST DRIVE & CHECK FOR CODES. CHECK THROTTLE BODY & REPLACE THROTTLE BODY & RECHECK OPERATION.
KM8JN12D16U	11/18/05	17639	33.96		CUSTOMER STATED ESC LAMP OFF ????	BRAKE SWITCH OPEN.	SCAN TEST CODE B1513 & B1237. REPLACE BRAKWL LAMP SWITCH & TEST & ORDER PRESSURE SWITCH
KM8JM12B16U	7/14/05	11505	35.6		CUST STATES ESC LITE COMES ON AT TIMES	SCAN TESTED, C1513 BRAKE LAMP SWITCH OPEN/SHORT	REPLACED BRAKE LAMP SWITCH, CLEARED CODE
KM8JN12DX7U	6/12/06	137	35.76	CRUISE CONTROL INOP. REPLACE BRAKE SWITCH.	CUSTOMER STATES CURISE CONTROLL INOP	CONFRIM COMPLAINT	REPLACE BRAKE SWITCH
KM8JN72D56U	1/05/06	21341	174	CRUSE CONTROL WILL TURN ON BUT NOT SET WHEN DRIVING. CRUISE CONTROLL INOP. REPLACE CRUISE MODULE SWAP WITH STOCK UNIT. CASE NUMBER 3155092	CUSTOMER STATES CURISE CONTROLL WILL TURN ON BUT NOT SET WHEN DRIVING	CONFIRM COMPLAINT FOUND CRUISE CONTROLL INOP	REPLACE CRUISE MODULE SWAP WITH STOCK UNIT HY11886
KM8JM12B06U	7/12/05	27585	31.26	STOP LAMP SWITCH SHORTED C1611 C1612 C1513	CUSTOMER STATES ECS LIGHT IS ON	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE STOP LAMP SWITCH SHORTED C1611 C1612 C1513
KM8JM12B26U	7/13/05	14747	33.64		CUSTOMER STATES ESC LIGHT COME ON & OFF.	OPEN.	SCANNTEST CODE C1513. TEST & REPLACE BRAKE SWITCH
KM8JM12B75U	1/05/05	13365	36.38	MI OUT 13366	CUSTOMER STATED ESP LAMP COMES ON ANYTIME IT WANTS W/DRIVINGALREADY HAD RECALL	INOP	SCAN CODES. C1513. CHECK AND REPLACE BRAKE LAMP SWITCH AND CLEAR CODE. ROAD TEST.
KM8JM12B66U	8/25/05	32062	33.64		ESC LIGHT ON SOP	OPEN ERATIC	REPLACE BRAKE LIGHT SWITCH
KM8JN12DX5U	9/03/04	35320	29.83	C1237 C1260 C1513 STOP LAMP SWITCH SHORTED	CK ENG LMAMP ON	E	REPLACEMENT/AIR INTAKE HOSE CLAMPS(TSB 05-20-003) REPLACEMENT/AIR INTAKE HOSE CLAMPS(TSB 05-20-003) PER TSB 05-20-003 REPL AIR INTAKE HOSE CLAMPS
KM8JN12DX5U	9/03/04	35320	29.83	C1237 C1260 C1513 STOP LAMP SWITCH SHORTED	PERFORM CAMPAIGN 079	E	079 079
KM8JN12DX5U	9/03/04	35320	29.83	C1237 C1260 C1513 STOP LAMP SWITCH SHORTED	CUSTOMER STATES DASH CIGARETTE ASH TRAY POPS OPEN BY SELF	E	ASHTRAY ASSY - FRONT ASHTRAY ASSY - FRONT ASHTRAY LOCKING MECHANISM
KM8JM12B66U	8/25/05	32062	33.64		CUSTOMER STATES: CARPET IN PASS AREA IS DISENTEGRATING. INSTALL SOP CARPET ASSY.	SEPARATING	REPLACE PASS COMPARTMENT CARPET
KM8JM12B66U	8/25/05	32062	33.64		AIRBAG RECALL NOTICE. AIRBAG IN STOCK.	RECALL	REPLACE AIR BAG AS PER RECALL
KM8JM12B06U	7/13/05	15623	34.7		CUSTOMER STATES ESP LIGHT IS ON-INSTALL SOP	C1513 OPEN CIRCUIT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE SCAN FOR CODE C1513 BRAKE LAMP SWITCH OPENCIRC UIT IN BRAKE SWITCH REPLACED SWITCH
KM8JN12DX5U	9/03/04	35320	29.83	C1237 C1260 C1513 STOP LAMP SWITCH SHORTED	CUSTOMER STATES ESC LIGHT INTERMITANTLY COMES ON WILL NOT TURN OFF UNLESS NAKE HARD TURN	E	SENSOR-ANGULAR VELOCITY SENSOR-ANGULAR VELOCITY STEERING ANGLE SENSOR OPEN
KM8JN12DX5U	9/03/04	35320	29.83	C1237 C1260 C1513 STOP LAMP SWITCH SHORTED	CUSTOMER STATES CHECK ENGINE LIGHT ON	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE C1237 C1260 C1513 STOP LAMP SWITCH SHORTED
KM8JM12B66U	7/19/05	26261	30.94	C1513 BRAKE LAMP SWITCH OPEN	CUSTOMER REQUEST RECALL 79	E	079 079
KM8JN12D35U	7/08/05	25686	32.74		RECALL -- 922 ECM REPROGRAMMING(06-01-001)	RECALL	ESC ECM REPROGRAMMING ESC ECM REPROGRAMMING REPROGRAM ECM AS PER RECALL
KM8JN12D35U	7/08/05	25686	32.74		RECALL -- 079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	RECALL	DRIVER AIR BAG COVER MODULE REPLACEMENT DRIVER AIR BAG COVER MODULE REPLACEMENT REPLACED AIRBAG COVER AS PER RECALL
KM8JN12D35U	7/08/05	25686	32.74		CUSTOMER STATES ESP LIGHT IS ON INTERMITANTLY -- CHECK AND ADVISE	C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE SCAN FOR CODE C1513 BRAKE LAMP SWITCH OPENCIRC UIT IN SWITCH REPLACED BRAKE LAMP SWITCHASSEMBLY
KM8JM12B66U	7/19/05	26261	30.94	C1513 BRAKE LAMP SWITCH OPEN	CUSTOMER STATES ECS LIGHT IS ON	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE C1513 BRAKE LAMP SWITCH OPEN
KM8JN12DX6U	1/11/06	28725	31.26	STOP LAMP SWITCH SHORTED	CUSTOMER STATES ECS LIGHT STAYS ON NEED TO TURN CAR OFF TO RESET	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE STOP LAMP SWITCH SHORTED

KM8JN72D86U	7/22/05	30776	78.36	INSPECTED, REPL BRAKE LIGHT SWITCH - ATT - RP0 TIME NOT INCLUDED WITH OP. CODE - ECT LIGHT ON - DTC C1513 - REPLACE FAILED BRAKE LAMP SWITCH TO CORRECT.	CUSTOMER STATES; INTERM ECT LIGHT IN DASH COMES ON. VARIES IN LENGTH OF TIME AND WHEN IT OCCURS CHECK AND ADV	HAD A CODE C1513- TRACED TO BAD BRAKE LIGHT	INSPECTED, REPL BRAKE LIGHT SWITCH
KM8JN12D35U	7/08/05	25686	32.74		CSUTOMER STATES DRIVERS SIDE CENTERVENT IS BROKEN -- CHECK AND ADVISE	BROKEN	NOZZLE ASSY-CENTER AIR VENT NOZZLE ASSY-CENTER AIR VENT REPLACED VENT ASSEMB.Y
KM8JN12DX5U	6/24/05	19342	33.06		CUSTOMER STATES CRUISE CONTROL INOP- SOP	INOP	ACTUATOR ASSY-CRUISE CONTROL RE ACTUATOR ASSY- CRUISE CONTROL RE R&R CRUISE CONTROL ACTUATOR AND INSTALLED NEWS WITCH
KM8JN12DX5U	6/24/05	19342	33.06		ENTERPRISE RENTAL	RENTAL	SUBLET REPAIRS PROVIDED RENTAL
KM8JN12DX5U	6/24/05	19342	33.06		ENTERPRISE RENTAL	RENTAL	ENTERPRISE RENTAL ENTERPRISE RENTAL PROVIDED RENTAL
KM8JN72D86U	7/22/05	30776	78.36	INSPECTED, REPL BRAKE LIGHT SWITCH - ATT - RP0 TIME NOT INCLUDED WITH OP. CODE - ECT LIGHT ON - DTC C1513 - REPLACE FAILED BRAKE LAMP SWITCH TO CORRECT.	CUSTOMER REQUEST; PERFORM 079 DRIVERS AIRBAG COVER MOD CAMPAIGN	PER HYUNDAI	INSPECTED, ORDERED AIRBAG COVERS
KM8JN12D86U	10/10/05	21015	78.04	ATT - RQ0 TIME NOT INCLUDED WITH OP. CODE - ESC LIGHT CAME ON BUT NOW IT IS OFF - DTC C1513 - REPLACE STOP LAMP SWITCH ASSY. TO CORRECT.	CUSTOMER STATES; WHEN DRIVING THE ESC LIGHT IN DASH CAME ON IS NOW OFF CHECK AND ADV	CODEN C1513	SCANNED COMPUTER FOR CODES. TESTED SYSTEM. REPL BRAKE SWITCH
KM8JN12D36U	11/19/05	15824	43.69				
KM8JN12D25U	11/02/04	10899	46.8	SCAN FOR CODES RECORDED C1513 CHECKED BRAKE SWITCH CIRCUIT AND BRKE LAMP CIRCUIT AT HECU CONNECTOR BOTH SWITCHES TURN ON AND OFF TEST DROVE 10 MILES CODE DID NOT RESET	CUSTOMER STATES RECALL 922	RECALL NOTICE	ESC ECM REPROGRAMMING ESC ECM REPROGRAMMING REPROGRAMMED ECM FOR ESP
KM8JN12D25U	11/02/04	10899	46.8	SCAN FOR CODES RECORDED C1513 CHECKED BRAKE SWITCH CIRCUIT AND BRKE LAMP CIRCUIT AT HECU CONNECTOR BOTH SWITCHES TURN ON AND OFF TEST DROVE 10 MILES CODE DID NOT RESET	CUSTOMER STATES ESP LIGHT WAS ON, IS OFF NOW	BRAKE SWITHC LAMP CIRCUIT OPEN	STRAIGHT TIME STRAIGHT TIME. CONDITION NO LONGER PRESENT CALLED TECH LINECASE NUMBER ASSIGNED
KM8JN12DX6U	7/16/05	18581	35.99		CUSTOMER STATES THAT ESC OFF LIGHT COMES ON WHEN STARTING & WILL NOT SHUT OFF UNTIL THE VEHICLE IS TURNED OFF INSTALL SOP	INT/FAIL HAS CODE C1513	INSTALL BRAKE SWITCH ASSY
KM8JM12B05U	2/12/05	21665	34.28		CUSTOMER STATES THAT THE CRUISE CONTROL IS INOPERATIVE. WILLSET SPEED BUT THEN WILL NOT RESUME WHEN OR COME ON AFTER SYSTEM IS SHUT OFF. CHECK AND ADVISE.	TESTED AND FOUND ACTUATOR INOP ON RESUME AND SYSTEM SHUTS OFF WHEN RESETTING. BOTH LIGHTS GO OUT. TRACED TO BAD ACT- UATOR AND BOTH ENGAGEMENT SW AND BRAKE SWITCH INTERMITTANT DUE TO ACTUATOR FAILURE.	REPLACED CRUISE ACTUATOR, ENGAGEMENT SW, AND BRAKE SWITCH. SOP PARTS IN.
KM8JM12B05U	2/12/05	21665	34.28		PERFORM CAMPAIGN 079 DRIVER AIRBAG MODULE COVER.	CAMPAIGN	PERFORMED CAMPAIGN, INSTALLED MODULE COVER
KM8JN12D26U	7/15/05	15188	34.7		CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF AT ONE TIME WHEN TURNING RIGHT THE VEHICLE STALL CAR STALLED ATLEAST 3 TIMES	SCAN TEST FOUND CODE C1513 BRAKE LAMP SWITCH.FOUND BRAKE SWITCH OPEN TEST DROVE COULD NOT VERIFY STALL CONDITION	REPLACED BRAKE SWITCH.
KM8JN12DX5U	6/23/05	48116	35.99		CUSTOMER STATES THAT HER ESP OFF LIGHT IS ON CHECK AND ADV	USED SCAN TOOL. C1513 BRAKE LAMP SWITCH. FOUND BRAKE SWITCH HAS INTERNAL OPEN	REPLACED BRAKE SWITCH, CLEARED CODES,
KM8JN12DX5U	6/23/05	48116	35.99		CUSTOMER STATES THAT HER CHECK ENGINE LIGHT IS ON CHECK AND ADVISE	USED SCAN TOOL. P0455 EVAP SYS LARGE LEAK. FOUND GAS CAP LOOSE	TIGHTENED GAS CAP, CLEARED CODES
KM8JN12DX5U	6/23/05	48116	35.99		INCOMPLETE RECALL 079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	RECALL	REPLACED AIRBAG COVER
KM8JN12D47U	10/31/06	3785	29.4		OWNER STATES THE ESC LIGHT IS ON	PERFORM COMPUTER SCAN TEST CODE #C1513 STORED BRAKE LAMP SWITCH OUT OF ADJUSTMENT CAUSING ESC LIGHT TO COME ON.	ADJUST BRAKE LAMP SWITCH.CLEAR CODE,ROADTEST VEHLCE 3.4 MILES,OKAY.
KM8JN12D47U	10/31/06	3785	55.5	2 DAYS RENTAL	OWNER STATES THE ESC LIGHT IS ON	PERFORM COMPUTER SCAN TEST CODE #C1513 STORED BRAKE LAMP SWITCH OUT OF ADJUSTMENT CAUSING ESC LIGHT TO COME ON.	ADJUST BRAKE LAMP SWITCH.CLEAR CODE,ROADTEST VEHLCE 3.4 MILES,OKAY.
KM8JM12B06U	1/06/06	9444	39.06		OWNER STATES THE CRUISE IS INOP.	TECH FOUND THE BRAKE LIGHT SWITCH DEFECTIVE.	REPLACE BRAKE LIGHT SWITCH.
KM8JN12D55U	5/23/05	13728	34.7		CUSTOMER STATES THE ESP INDICATOR LIGHT COMES ON AND OFF	CODE IN SYSTEM. C1513 BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN12D55U	5/23/05	13728	34.7		CUSTOMER REQUEST RECALL # 079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	ORDERED PART	WILL CALL CUSTOMER UPON PART ARRIVAL
KM8JN12D96U	7/29/05	30844	35.99		CUSTOMER STATES THAT THE ESC LIGHT OFF IS ON CHECK ADVISE	FOUND C1513 BRAKE SWITCH	REPLACED BRAKE SWITCH TO CORRECT PROBLEM
KM8JN12D45U	9/14/04	386	38.67				
KM8JN72D75U	11/21/04	708	38.67				
KM8JM12B85U	6/08/05	17327	25.35				
KM8JM12B07U	8/14/06	36	22.14	C/S BRAKE LIGHT INOP-TECH R&R BRAKE LAMP SWITCH DUE TO NO BRAKE LAMPS. LABOR CLAIM ONLY. PART PAID ON PREVIOUS CLAIM. COMPLETE			

KM8JN12D16U		12/30/05	4676	34.7		CUSTOMER STATES THAT HER STABILITY CONTROL LIGHT COMES ON AND GOES OFF ALSO WHEN SHUTTING OFF THE CAR IT SHUTS OFF AND COMES AFTER ABOUT FEW MINUTES OR DAYS	USED SCAN TOOL, C1513 BRAKE LAMP SWITCH, FOUND BRAKE SWITCH.INTERMITANTLY GOING OPEN	REPLACED BRAKE SWITCH
KM8JN12D16U		7/28/05	10857	34.7		CUSTOMER STATES THE CD PLAYER IS INOP-IT DOES NOT EJECT CD'S	CD PLAYER WOULD NOT PLAY OR EJECT CD'S	PULLED IOD FUSE OUT FOR 5 MINUTES TO RESET PER TSB
KM8JN12D16U		7/28/05	10857	34.7		CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF-WHEN IT DOES COME ON,ONCE SHE TURNS IT OFF AND START IT BACK ON THE ESC LIGHT WILL DISAPPEAR	USED SCAN TOOL, FOUND C1513 BRAKE LAMP SWITCH FOUND BRAKE SWITCH INTERNALLY OPEN	REPLACED BRAKE SWITCH
KM8JN12D36U		8/10/05	15141	30.75	C/S ESC LIGHT COMES ON AFTER DRIVING SHORT DISTANCE-TECH TEST DROVE VEHICLE AND OBTAINED CODES C1513 CIRCUIT TEST BRAKE LAMP SWITCH & R&P; WIRING. R&P; R BRAKE LAMP SWITCH DUE TO SWITCH INOP. COMPLETE.			
KM8JM12B96U		7/20/05	20997	31.48	C/S ECS LIGHT COMES ON-TECH VERIFIED CUST CONCERN AND OBTAINED DTC'S WITH HIGH SCAN CIRCUIT TEST (C1513)-BRAKE LAMP SWITCH/WIRING. R&P; R BRAKE LAMP SWITCH- CLEARED CODES-COMLETE.			
KM8JN72D76U		11/06/05	38356	55.86	CK STABILITY CONTROL. STAYS ON ALL THE TIME.BRAKE LITE INTERNAL FAULT C1513 CODE.CK ALL SYSTEMS INVOLVED. ALL OPERATIONAL.RESET CODES.REPL BRAKE LITE SWITCH.TT TIME .40 DIAG TIME			
KM8JN12D65U		6/10/05	15445	34.7		CUSTOMER STATES THAT HER ESP LIGHT COMES ON AND GOES OFF CHECK AND ADVISE	BRAKE SWITCH HAS INTERNAL OPEN	REPLACED BRAKE SWITCH
KM8JN12D65U		6/10/05	15445	34.7		CUSTOMER STATES THAT AT TIMES HER A/C BLOWS ON HER FEET WITHOUT CHANGING CYCLES CHECK AND ADVISE	CHECKED FOR CONCERN	COULD NOT VERIFY CONCERN
KM8JN12D65U		6/10/05	15445	34.7		922 ECM REPROGRAMMING (06-01-001)	RECALL	>PERFORM RECALL
KM8JN12D96U		11/22/05	6445	31.1		CUSTOMER STATES ESC OFF LIGHT WILL NOT GO OFF	OPEN CIRCUIT	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN12D96U		11/22/05	6445	31.1		CUSTOMER STATES A/C UNIT LEAKING FREON SOP	LEAKS	CONDENSER ASS'Y (**) RE CONDENSER ASS'Y (**) RE
KM8JN72D36U		8/10/05	22360	29.46	ESC LITE ON. REPL STOP LAMP SWITCH			
KM8JN12D85U		6/14/05	26997	32.74		CUSTOMER STATES THE ESP LIGHT INDICATOR ON DASH TURNS ON AND OFF INTERMITTENTLY-CHECK AND ADVISE	C1513-BRAKE LAMP SWITCH; INTERMITTENT SHORT OF SWITCH CAUSING ESP LIGHT TO COME ON	REPLACED BRAKE LIGHT SWITCH
KM8JN12D87U		11/09/06	925	32.74		CUSTOMER STATES AT TIMES HIS ESC LIGHT WILL COME ON AND STAYON, WILL NOT TURN OFF -> AT TIMES CHECK AND ADVISE	C1237 AND C1513	SCANNED FOR DTC'S USING HY SCAN. REPLACED BRAKE LAMP SWITCH
KM8JM12B76U		7/14/05	28844	35.99	REPLACED BRAKE SWITCH, CLEARED CODES, ROAD TESTED	CUSTOMER STATES THAT THE PASSENGER AIR BAG OFF LIGHT STAYS ON WHEN A PASSENGER OVER 100 LBS IS SITTING IN IT CHECK AND ADVISE	USED SCAN TOOL, B1495 BELT TENSION SNSR DEFECT	ORDERED PART
KM8JM12B46U		8/08/05	19970	36.51	19970 ELECTRICAL SHORT IN BRAKE SWITCH REPLACED BRAKE SWITCH DUE TO ELECTRICAL SHORT IN SWITCH			
KM8JN12D16U		9/13/05	12553	31.84	ESC LIGHT COMES ON. C1513 BRAKE LIGHTS WITCH. C1237 PRESSURE SENSOR OTHER. REPLACED BRAKE LIGHT SWITCH. INT STUCK ON CAUSING LIGHT TO ILLUMINATE.	CUSTOMER STATES AT TIMES ESC LIGHT COMES ON AT TIMES WHILE DRIVING	DTC C1513 BRAKE LIGHT SWITCH. C1237 PRESSURE SENSOR OTHER STRUCK ON CAUSING PROBLEM	REPLACED BRAKE LIGHT SWITCH
KM8JM12B66U		7/13/05	23426	54.66	ESC LIGHT ON AT DASH, C1513 BRAKE LIGHT SWITCH CIRCUIT, BRAKE SWITCH MALFUNCTION, REPLACED SWITCH. ATT FOR			
KM8JM12B76U		7/14/05	28844	35.99	REPLACED BRAKE SWITCH, CLEARED CODES, ROAD TESTED	CUSTOMER STATES THAT WHEN DRIVING AND THE A/C IS ON THE ESP LIGHT WILL COME ON CHECK AND ADVISE	USED SCAN TOOL, C1513 BRAKE LAMP SWITCH, FOUND BRAKE SWITCH OPEN	REPLACED BRAKE SWITCH, CLEARED CODES, ROAD TESTED
KM8JM12B76U		7/14/05	28844	35.99	REPLACED BRAKE SWITCH, CLEARED CODES, ROAD TESTED	CUSTOMER STATES THAT IT FEELS LIKE SOMETHING IS LOOSE WHEN MAKING LEFT TURNS CHECK AND ADVISE	TESTED,COULD NOT VERIFY CUST CONCERN	NO REPAIRS NEEDED OR MADE
KM8JN12D46U		8/09/05	31793	35.99		CUSTOMER STATES THAT HER ESC LIGHT COMES ON AND GOES OFF CHECK AND ADVISE	C1513 BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH TO CORRECT PROBLEM
KM8JM12B16U		7/12/05	18245	33.8		CUSTOMER STATES CHECK ENGINE LIGHT ON AT DASH RUNS OK DTC P0111 STORED IN ECM REPROGRAMMED ECM PER TSB #06-36-005		
KM8JM12B16U		7/12/05	18245	33.8		CUSTOMER STATES ESC LIGHT COMES ON AT TIMES (RELATED TO JOB 1?)	BRAKE LIGHT SWITCH DEFECTIVE CAUSING MIL TO ILLUMINATE REPLACED SWITCH.	
KM8JN12D86U		8/09/05	14297	33.8		CUSTOMER STATES TIRE PRESSURE LIGHT ON AT DASH (CHECK ALL TIRES AND ADVISE	N/C TIRE PRESSURE LOW ALL FOUR 24.4 -24.8 PSI REGISTERED. SET TIRE PRESS. TO SPECS 32 PSI NO PUNCTURES OR VISUAL	EVIDENCE OF LEAKS

KM8JN12D46U	8/09/05	31793	35.99		CUSTOMER STATES CHECK ENGINE LIGHT IS ON CHECK AND ADVISE	PO455 EVAP LARGE LEAK.	GAS CAP LOOSE. TIGHTEN GAS CAP.
KM8JN12D65U	3/04/05	35089	35.48		CUSTOMER STATES THE CRUISE CONTROL IS INOPERATIVE, IT DOES NOT SET THE CRUISE CONTROL HOWEVER THE SWITCH BUTTON LIGHT DOES TURN ON	SCAN TEST FOUND CODE C1211 RR WHEEL SPEED SENSOR-AIRGAP, C1708 RR WHEEL SPEED SENSOR-AIRGAP, C1611 CAN TIME EMS, C1513 BRAKE LAMP SWITCH, P0703 BRAKE SWITCH OPEN/SHORT. BRAKE SWITCH OPEN/SHORT	REPLACED BRAKE SWITCH-TEST DROVE ALL SYSTEM OPERATING NORMALLY
KM8JN12D86U	8/09/05	14297	33.8		CUSTOMER STATES C/D PLAYER WILL NOT TAKE C/DS OR PLAY POSS TSB FOR RADIO REBOOT	ORDERED REPLACEMENT RADIO	
KM8JN12D86U	8/09/05	14297	33.8		CUSTOMER STATES AT TIMES ESC LIGHT IS ON AT DASH AND WILL NOT TURN OFF WITH SWITCH HAS TO SHUT CAR OFF RESTART AND THAT ONLY SHUTS IT OFF AT TIMES	DIAG TROUBLE CODE C1513 STORED IN ABS HECU. INSPECTED BRAKE LIGHT SW. CONNECTOR & HARNESS OK REPLACED FAULTY SWITCH.	
KM8JM12B86U	7/12/05	18053	32.16	ESC OFF LIGHT STAYS ON. FOUND BRAKE SWITCH SHORTED, REPLACED SWITCH	CLIENT STATES ECS OFF LIGHT STAYING ON	FOUND BRAKE SWITCH SHORTED	REPLACED SWITCH
KM8JN72DX5U	6/14/05	15867	33.8		CK FOR BRAKES LIGHTS BRAKE LIGHT SWITCH IS DEFECTIVE	REPLACED SWITCH STOP LAMP SWITCH.	
KM8JN12D37U	11/02/06	3768	35.99		CUSTOMER STATES THAT HIS ESC OFF LIGHT COMES ON AROUND 40% OF THE TIME WHEN DRIVING CHECK AND ADVISE	C1513 BRAKE LAMP SWITCH	R/R BRAKE LAMP SWITCH
KM8JM12B96U	7/11/05	7243	35.99		CUSTOMER STATES THAT HER ESC LIGHT COMES ON AND GOES OFF	USED SCAN TOOL. C1513, BRAKE LIGHT SWITCH OPEN/SHORT	REPLACED SWITCHED, CLEARED CODE. RESCANED.
KM8JM12B86U	10/14/05	30156	35.99		CUSTOMER STATES THAT HER BRAKE LIGHTS ARE INOP CHECK AND ADVISE	BRAKE LAMP SWITCH INOP	USED SCAN TOOL REPLACED BRAKE LAMP SWITCH
KM8JM12B86U	10/14/05	30156	35.99		INCOMPLETE RECALL 079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	OPEN CAMPAIGN	REPLACED DRIVERS AIR BAG COVER
KM8JN12D65U	4/20/05	23503	33.8		CUSTOMER STATES ESP LIGHT ON AT DASH AT TIMES	BRAKE LAMP SWITCH CUSTOMER HAD ESP LIGHT COMING ON FOUND BRAKE LAMP SWITCH INOP. HAD TO REPLACE SWITCH WITH NEW ONE.	
KM8JN72D26U	7/28/05	18350	32.16	ESC LIGHT ON, C1513 BRAKE SWITCH, FOUND INTERMITTANT OPEN/SHORT, REPLACED SWITCH	CUSTOMER STATES 2 OF THE REAR SEAT SEATBELT BUCKLES MISSING	MISSING	REPLACED REAR SEAT BELT BUCKLES E
KM8JN12D45U	4/27/05	19186	56.3	ADDL TIME FOR SCAN TOOL	CUST STATES ESP OFF LIGHT STAYS ON WHEN DRIVING	WAR	ADDL TIME FOR SCAN TOOL ADDL TIME FOR SCAN TOOL
KM8JN12D45U	4/27/05	19186	56.3	ADDL TIME FOR SCAN TOOL	CUST STATES ESP OFF LIGHT STAYS ON WHEN DRIVING	WAR	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D16U	9/13/05	22979	54.34	ADDL TIME FOR SCAN TOOL	DRIVER AIRBAG MODULE REPLACEMENT (61B046R0) 0.2 07-01-001	CPN	DRIVER AIRBAG COVER MODULE REPLACEMENT (61B046R0) 0.2 DRIVER AIRBAG COVER MODULE REPLACEMENT (61B046R0) 0.2
KM8JN72D26U	7/28/05	18350	32.16	ESC LIGHT ON, C1513 BRAKE SWITCH, FOUND INTERMITTANT OPEN/SHORT, REPLACED SWITCH	CUSTOMER STATES ESC LIGHT ON AT DASH AT TIMES	DTC C1513 BRAKE SWITCH. FOUND INTERMITTANT OPEN/SHORT BRAKE SWITCH	REPLACED BRAKE SWITCH AND VERIFIED OPERATION
KM8JN12D26U	3/10/06	10967	31.84	C1513 BRAKE LAMP SWITCH. ESC LIGHT COMES ON. REPLACED SWITCH.	CUSTOMER STATES ESC LIGHT COMES ON AT TIMES AND GOES OFF BY ITSELF	DTC C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12D06U	7/16/05	28752	32.16	ESC LIGHT ON, C1513 BRAKE SWITCH CIRCUIT, REPLACED OPEN BRAKE LIGHT SWITCH			
KM8JN12D26U	3/10/06	19381	32.16	C1513 BRAKE SWITCH FAULT, FOUND SWITCH STICKING, REPLACED SWITCH	CLIENT STATES WHEEL WELL TRIM IS DELAMINATING SOP HERE	FOUND WHEEL FLARE MOULDING COLOR MISMATCHED ON BOTH SIDES	REPLACED TRIM FLARE MOULDINGS
KM8JN12D16U	9/13/05	22979	54.34	ADDL TIME FOR SCAN TOOL	RANDOMLY THE ESC LIGHT WILL GO ON AND OFF WHILE DRIVING, ADVISE	C1513 BRAKE MALFUNCTION	ADDL TIME FOR SCAN TOOL ADDL TIME FOR SCAN TOOL
KM8JN12D16U	9/13/05	22979	54.34	ADDL TIME FOR SCAN TOOL	RANDOMLY THE ESC LIGHT WILL GO ON AND OFF WHILE DRIVING, ADVISE	C1513 BRAKE MALFUNCTION	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D16U	9/13/05	22979	54.34	ADDL TIME FOR SCAN TOOL	CUST STATES CD PLAYER SKIPS CD'S, CUST EVEN CLEANED WITH LENS CLEANER, DID NOT WORK, EVEN WITH STORE BOUGHT NEW CD'S	CD PLAYER INTERNAL FAILURE	ETR RADIO ASSY RE ETR RADIO ASSY RE
KM8JN12D26U	3/10/06	19381	32.16	C1513 BRAKE SWITCH FAULT, FOUND SWITCH STICKING, REPLACED SWITCH	CLIENT STATES ESC LIGHT IS ON CHECK AND ADVISE	DTC C1237 PRESSURE SENSOR. FOUND INTERNAL LEAKING AND C1513 CAME FOR BRAKE SWITCH.	REPLACED SENSOR AND TEST DROVE
KM8JN12D26U	3/10/06	19381	32.16	C1513 BRAKE SWITCH FAULT, FOUND SWITCH STICKING, REPLACED SWITCH	CLIENT STATES ECS LIGHT IS ON	DTC C1513 BRAKE SWITCH. FOUND SWITCH STICKING	REPLACED SWITCH AND TEST DROVE 7 MILES. NO PROBLEM AT THIS TIME.
KM8JN12D26U	3/10/06	19381	32.16	C1513 BRAKE SWITCH FAULT, FOUND SWITCH STICKING, REPLACED SWITCH	0	1	HYUNDAI LOANER CAR
KM8JN12D56U	1/26/06	14998	54.34	ADDL TIME FOR SCAN TOOL			
KM8JM12BX7U	11/13/06	809	54.66	ADDL TIME FOR SCAN TOOL	CUST STATES INTERMITTENTLY ESC OFF LIGHT WILL COME ON AND NOT GO OFF UNTIL IGNITION SHUT OFF	C1513	ADDL TIME FOR SCAN TOOL ADDL TIME FOR SCAN TOOL
KM8JM12BX7U	11/13/06	809	54.66	ADDL TIME FOR SCAN TOOL	CUST STATES INTERMITTENTLY ESC OFF LIGHT WILL COME ON AND NOT GO OFF UNTIL IGNITION SHUT OFF	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D36U	7/29/05	12569	31.84	BRAKES LIGHTS INOP. ESC LIGHTS ON. REPLACED SWITCH ASSY FOR STOPLAMP. INTER DAMAGE.	CLIENT STATES BRAKE LIGHTS INOP AND ESC LIGHT IS ON BRAKE LIGHTS WORK IF YOU WIGGLE SWITCH	FOUND BRAKE LIGHT SWITCH INTERMITTANTLY	REPLACED BRAKE LIGHT SWITCH
KM8JN12D86U	8/17/05	17175	32.16	ESC LIGHT SWITCH INOP, B1513 BRAKE LAMP SWITCH, REPLACED BRAKE LIGHT SWITCH DUE TO INTERNAL FAILURE	CUSTOMER STATES CHECK ENGINE LIGHT ON AT DASH RUNS OK MAY BE A LITTLE SLUGGISH ON ACCEL	DTC P0159 O2 SLOW RESPONSE B2/S2. O2 SENSOR INOP	REPLACED B2/S2 O2 SENSOR

KM8JN12D55U	5/19/05	19565	31.84		DRIVER AIRBAG MODULE REPLACEMENT (61B046R0) 0.2 07-01-001	CPN	DRIVER AIRBAG COVER MODULE REPLACEMENT (61B046R0) 0.2 DRIVER AIRBAG COVER MODULE REPLACEMENT (61B046R0) 0.2
KM8JN12D55U	5/19/05	19565	31.84		CUST STATES INTERMITTENTLY ESC OFF LIGHT COMES ON AND STAYS ON UNTIL IGNITION TURNED OFF	FAILING	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D36U	1/13/06	3896	31.84		DRIVER AIRBAG MODULE REPLACEMENT (61B046R0) 0.2 07-01-001	CPN	DRIVER AIRBAG COVER MODULE REPLACEMENT (61B046R0) 0.2 DRIVER AIRBAG COVER MODULE REPLACEMENT (61B046R0) 0.2
KM8JN12D86U	8/17/05	17175	32.16	ESC LIGHT SWITCH INOP, B1513 BRAKE LAMP SWITCH, REPLACED BRAKE LIGHT SWITCH DUE TO INTERNAL FAILURE	CUSTOMER STATES TPMS LIGHT ON AT DASH	FOUND TIRE PRESSURE AT 22 PSI	SET TIRE PRESSURE AT 32 PSI
KM8JN12D86U	8/17/05	17175	32.16	ESC LIGHT SWITCH INOP, B1513 BRAKE LAMP SWITCH, REPLACED BRAKE LIGHT SWITCH DUE TO INTERNAL FAILURE	CUSTOMER STATES ESC LIGHT SWITCH INOP AT TIMES AND LIGHT COMES ON AT TIMES	DTC B1513 BRAKE LAMP SWITCH, SWITCH FAILURE	REPLACED SWITCH AND CHECKED OPERATION.
KM8JN12D86U	8/17/05	17175	32.16	ESC LIGHT SWITCH INOP, B1513 BRAKE LAMP SWITCH, REPLACED BRAKE LIGHT SWITCH DUE TO INTERNAL FAILURE	HYUNDAI LOANER	1	HYUNDAI LOANER CAR
KM8JN12D36U	1/13/06	3896	31.84		CUST STATES ESC OFF LIGHT PERIODICALLY COMES ON AND STAYS ON WHILE DRIVING	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D36U	1/13/06	3896	31.84		CUST STATES CD PLAYER SKIPS WHEN PLAYING CD'S WHILE DRIVING ONLY, WILL NOT SKIP WHEN VEHICLE IS STATIONERY SOMETIMES IT WILL NOT TAKE CD AND OTHER TIMES IT WILL EJECT CD'S	F	ETR RADIO ASSY RE ETR RADIO ASSY RE
KM8JN12DX5U	4/20/05	19737	31.58		CUST STATES AFTER DRIVING 20 YARDS OR SO, ESP OFF LIGHT COMES ON	BAD SWITCH	ADDL TIME FOR DIAG ADDL TIME FOR DIAG
KM8JM12B56U	9/14/05	9150	33.66		CUSTOMER SAYS THAT ESC OFF LAMP COMES ON EVERY TIME VEHICLE IS STARTED & PUT INTO GEAR - CHECK	RAN DIAGNOSTICS - CODE C1513 - BRAKE LAMP SWITCH FAILURE	REMOVED & REPLACED BRAKE LAMP SWITCH
KM8JN72D66U	12/08/05	26027	33.66	REMOVED & REPLACED BRAKE LAMP SWITCH	CUSTOMER SAYS ESC LAMP IS ON - CHECK & ADVISE	RAN DIAGNOSTICS - CODE B1513 - BRAKE LAMP SWITCH MALFUNCTION	REMOVED & REPLACED BRAKE LAMP SWITCH
KM8JN72D66U	12/08/05	26027	33.66	REMOVED & REPLACED BRAKE LAMP SWITCH	CUSTOMER SAYS TPMS LAMP IS ON - CHECK & ADVISE	CHECKED VEHICLE - FOUND OPEN CIRCUIT TO TO TPMS DUE TO WIRE PINCHED NEAR CONNECTOR MF04	REPAIRED WIRING HARNESS CONNECTOR & RECHECKED - OK
KM8JN12DX5U	4/20/05	19737	31.58		CUST STATES AFTER DRIVING 20 YARDS OR SO, ESP OFF LIGHT COMES ON	BAD SWITCH	ANGULAR VELOCITY SENSOR ANGULAR VELOCITY SENSOR
KM8JN12DX5U	4/20/05	19737	31.58		CUST STATES AFTER DRIVING 20 YARDS OR SO, ESP OFF LIGHT COMES ON	BAD SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12DX5U	4/20/05	19737	31.58		CUSTOMER REQUESTS LOANER	LOANER	SUBLET REPAIRS
KM8JN12DX5U	4/20/05	19737	31.58		CUSTOMER REQUESTS LOANER	LOANER	CUSTOMER REQUESTS LOANER CUSTOMER REQUESTS LOANER
KM8JN72D66U	12/08/05	26027	33.66	REMOVED & REPLACED BRAKE LAMP SWITCH	CUSTOMER SAYS THAT THERE IS A WHIRRING NOISE COMING FROM ACBLOWER FAN INTERMITTENTLY - CHECK & ADVISE	CHECKED A/T OPERATION - BLOWER FAN HAS SOMETHING CAUGHT IN IT MAKING NOISE - ADVISE CUSTOMER MAY BE NOT WARRANTY	DECLINED REPAIRS AT THIS TIME...
KM8JN12D95U	1/24/05	28094	31.95		CUSTOMER SAYS CRUISE INOP - CHECK	CHECKED CRUISE OPERATION - FOUND CRUISE INOP DUE TO BRAKE SWITCH MALFUNCTION	REMOVED & REPLACED BRAKE SWITCH NOTE: ALSO HAS TCS CODE 1237 - BRAKE PRESSURE SWITCH ORDERED
KM8JN12D95U	1/24/05	28094	31.95		CUSTOMER SAYS THAT VEHICLE BOGGS DOWN ON ACCELERATION & WILL JERK, HAS DIFFICULTY ON INCLINES ETC WHEN UNDER STRAIN - CK	RAN DIAGNOSTICS & TEST DROVE - FOUND AIRFLOW METER LOSING SIGNAL DUE TO LOOSE PIN AT AIRFLOW METER CONNECTOR	TIGHTENED PINS IN AIRFLOW METER CONNECTOR & RETEST DROVE - OK
KM8JM12B66U	7/14/05	16725	54.34	ADDL TIME FOR SCAN TOOL	CUST STATES INTERMITTENTLY ESC LIGHT COMES ON, ADVISE	C1513	ADDL TIME FOR SCAN TOOL ADDL TIME FOR SCAN TOOL
KM8JM12B66U	7/14/05	16725	54.34	ADDL TIME FOR SCAN TOOL	CUST STATES INTERMITTENTLY ESC LIGHT COMES ON, ADVISE	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D05U	4/22/05	22369	31.84		CUSTOMER STATES THE CHECK ENGINE LIGHT IS ON, ENGINE RUNS ROUGH	P0122 P0121 TPS WAS MAKING POOR CONTACT WITH THROTTLE BODY HAD TO ADJUST NEW PART AND THEREFORE DID NOT CAUSE HYUNDAI ANOTHER TPS	ADJUST NEW TPS TO MAKE THROTTLE BODY WORK THROTTLE BODY ASSY AND/OR GASKET RE
KM8JN12D95U	1/24/05	28094	31.95		CUSTOMER SAYS THAT VEHICLE DIFFICULT ON START UPS & WILL TAKE A FEW TRIES TO GET STARTED - INTERMITTENT - CHECK	RAN DIAGNOSTICS & TEST DROVE - NO CODES STORED & OPERATION NORMAL AFTER REPAIRS ON LINE 1	UNABLE TO DUPLICATE CONCERN
KM8JN12D35U	5/31/05	7314	35.3		CUSTOMER SAYS ESP LIGHT WILL COME ON AND OFF INTERMITTENTLY - SOP - CHECK	FOUND STOP LAMP SWITCH BAD	REMOVED & REPLACED STOP LAMP SWITCH - RECHECKED - OPERATION NORMAL
KM8JN12D35U	5/31/05	7314	35.3		CUSTOMER SAYS DRIVER SIDE FRONT INSIDE DOOR HANDLE IS NOT FLUSH WITH HANDLE HOUSING - SOP - CHECK	CHECKED DRIVERS DOOR HANDLE - FOUND NOT FITTING PROPERLY INTO DOOR HANDLE HOUSING	REMOVED & REPLACED DRIVERS FRONT INSIDE DOOR HANDLE ASSEMBLY - RECHECKED - OPERATION NORMAL
KM8JN12D05U	4/22/05	22369	31.84		CUST STATES ESP LIGHT ON	INTERMIT FAILURE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D45U	4/25/05	21918	22.5	SCAN COMPUTER, NO CODES, CHECKED FOR PROPER OPERATION OF STOP LAMP SWITCH, ALL THE WAY BOTTOMED OUT, ADJUSTED SWITCH	CUST STATES ESC OFF INTERMITTENTLY COMES ON AND STAYS ON	MISADJUSTED	ADJUST STOP LAMP SWITCH STOP LAMP SWITCH ASSY RE SCAN COMPUTER, NO CODES, CHECKED FOR PROPER OPERATION OF STOP LAMP SWITCH, ALL THE WAY BOTTOMED OUT, ADJUSTED
KM8JM12B35U	4/22/05	19937	54.66	ADDL TIME FOR SCAN TOOL	CUST STATES ESP OFF LIGHT COMES ON AND WILL NOT GO OFF UNTIL IGNITION IS TURNED	C1513	ADDL TIME FOR SCAN TOOL ADDL TIME FOR SCAN TOOL

KM8JM12BX6U	12/06/05	28782	33.66		CUSTOMER SAYS ESC & CHECK ENGINE LAMPS HAVE BEEN ON & OFF RECENTLY - CHECK & ADVISE	RAN DIAGNOSTICS - CODE C1513 - BRAKE LAMP SWITCH MALFUNCTION	REMOVED & REPLACED BRAKE LAMP SWITCH
KM8JN12DX6U	9/23/05	40267	33.66		CUSTOMER SAYS CHECK ENGINE LIGHT IS ON - CHECK & ADVISE	RAN DIAGNOSTICS - FOUND CODE P0442 EVAPORATION SYSTEM SMALL LEAK	GAS CAP SEAL DIRTY AND LOOSE CLEANED AND ADJUSTED GAS CAP - CLEARED CODES - RECHECKED - OPERATION
KM8JM12B35U	4/22/05	19937	54.66	ADDL TIME FOR SCAN TOOL	CUST STATES ESP OFF LIGHT COMES ON AND WILL NOT GO OFF UNTIL IGNITION IS TURNED	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D56U	9/24/05	16204	31.84	BRAKE LAMP SWITCH ELECTRICAL FAILURE, REPLACED B RAKE LAMP SWITCH	CUST STATES PASSENGER FOG LAMP INOP	INTERNAL OPEN CIRCUIT	BULB RE BULB RE
KM8JN12D56U	9/24/05	16204	31.84	BRAKE LAMP SWITCH ELECTRICAL FAILURE, REPLACED B RAKE LAMP SWITCH	DRIVER AIRBAG MODULE REPLACEMENT (61B046R0) 0.2 07-01-001	CPN	DRIVER AIRBAG COVER MODULE REPLACEMENT (61B046R0) 0.2 DRIVER AIRBAG COVER MODULE REPLACEMENT (61B046R0) 0.2
KM8JN12DX6U	9/23/05	40267	33.66		CUSTOMER SAYS THAT ELECTRONIC STABILITY CONTROL LAMP IS ON CHECK	RAN DIAGNOSTICS - FOUND CODES C1513 BRAKE LAMP SWITCH, P1237PRESSURE SENSOR INOP	REMOVE & REPLACED BRAKE LAMP SWITCH - RECHECKED - OPERATION NORMAL - ORDERED PRESSURE SENSOR
KM8JN12DX6U	8/10/05	13032	35.3		CUSTOMER SAYS ESC OFF LIGHT CAME ON AND WOULDN'T GO OFF - CHECK & ADVISE	CHECKED VEHICLE FOR CODES - FOUND CODES FOR BRAKE LAMP SWITCH FAILURE - BAD SWITCH	REMOVED & REPLACED BRAKE LAMP SWITCH RETESTED - OPERATION NORMAL
KM8JN12D96U	11/07/05	19955	37.56		CUST STATES THE VEHICLE STALLS AT ANY SPEED, EASY RESTART DRIVING LIKE STUCK IN A LOWER GEAR, RPMs ARE VERY HIGH	DIAG FOUND P0121, 0123 TPS SENSOR	REPLACED SENSOR, CLEARED CODES RETEST OK 35102R00, 35102RP0 N06 C15
KM8JN12D56U	9/24/05	16204	31.84	BRAKE LAMP SWITCH ELECTRICAL FAILURE, REPLACED B RAKE LAMP SWITCH	CUST STATES ESC OFF LIGHT COMES ON WHILE DRIVING, CAN NOT TURN OFF LIGHT UNTIL IGNITION RESET	INTERNAL OPEN CIRCUIT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE BRAKE LAMP SWITCH ELECTRICAL FAILURE, REPLACED B RAKE LAMP SWITCH ASSY RE
KM8JN12D85U	5/31/05	14984	32		CUST STATES INTERMITTENTLY BRAKE LIGHTS INOP	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D85U	5/31/05	14984	32		CUSTOMER REQUESTS LOANER	LOANER	SUBLET REPAIRS
KM8JN12D96U	11/07/05	19955	37.56		CUST STATES THE ESC DASH LIGHT IS ON	DIAG CODE C1513 FAILED BRAKE LAMP SWITCH	REPLACED SWITCH CLEARED CODE, RETEST OK 93910R00 N94 C15
KM8JN12D96U	11/07/05	19955	37.56		CUST STATES THE WIPERS ARE INOP	DIAG AS FAULTY WIPER RELAY	REPLACED WIPER RELAY, RECHECK OK 95220R00 N94 C15
KM8JN12D96U	11/07/05	19955	37.56		CUST STATES THE SPEEDO DROPS TO ZERO THEN COMES BACK THE DASH LIGHT FOR TIRE PRESSURE ARE ON AND OFF (SOMTIMES GOES OFF ON A RESTART)	DIAG FOUND POOR COMMON GROUND IN ENGINE COMPARTMENT	CLEANED OFF GROUND CONNECTION TIGHTENED CONNECTION. RECHECK OK 91001A00 N66 C15 CAUSAL 91219-2E051
KM8JN12D85U	5/31/05	14984	32		CUSTOMER REQUESTS LOANER	LOANER	CUSTOMER REQUESTS LOANER CUSTOMER REQUESTS LOANER
KM8JM12B46U	8/23/05	19371	33.8		CUST STATES IN THE MIDDLE OF DRIVING SOMETIMES ESC OFF LIGHT WILL ILLUMINATE AND NOT GO OFF UNTIL IGNITION KEY IS TURNED OFF	C1513 INTERNAL SHORT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B46U	8/23/05	19371	33.8		CUSTOMER REQUESTS LOANER	LOANER	SUBLET REPAIRS
KM8JM12B46U	8/23/05	19371	33.8		CUSTOMER REQUESTS LOANER	LOANER	CUSTOMER REQUESTS LOANER CUSTOMER REQUESTS LOANER
KM8JN72D76U	7/28/05	14565	65.46	REPLACED BRAKE LAMP SWITCH, RETEST OK. CLEARED LIGHT 93810R00, 93810RP0 N69 C15 TT TIME TO SCAN CODE P0420	CUSTOMER STATES TRACTION CONTROL LIGHT COMES ON BY ITSELF ESC LIGHT	SCAN CODE C1513 BRAKE LAMP SWITCH FAULTY	REPLACED BRAKE LAMP SWITCH, RETEST OK. CLEARED LIGHT 93810R00, 93810RP0 N69 C15
KM8JN72D36U	7/13/05	36374	35.16	C/S ESC LT COMES ON	RECALL #079, DRIVER AIRBAG COVER MOD REPL (07-01-001)	PER OPEN RECALL	OPEN RECALL 36374 PER OPEN RECALL. REPLACED DRIVER SIDE AIRBAG MODULE. 61B046R0, 20
KM8JN72D36U	7/13/05	36374	35.16	C/S ESC LT COMES ON	CUST. STATES THAT THE ESC LIGHT KEEPS STAYING ON	INTERNAL FAILURE IN THE BRAKE LIGHT SWITCH	ELECTRICAL 36374 INTERNAL FAILURE IN THE BRAKE LIGHT SWITCH
KM8JM12B37U	9/23/06	7169	54.66	ADDL TIME FOR SCAN TOOL C1513	CUST STATES ESC LIGHT COMES ON, ADVISE	C1513	ADDL TIME FOR SCAN TOOL ADDL TIME FOR SCAN TOOL
KM8JM12B37U	9/23/06	7169	54.66	ADDL TIME FOR SCAN TOOL C1513	CUST STATES ESC LIGHT COMES ON, ADVISE	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B45U	10/18/04	33173	30.45		DRIVER AIRBAG MODULE REPLACEMENT (61B046R0) 0.2 07-01-001	CPN	DRIVER AIRBAG COVER MODULE REPLACEMENT (61B046R0) 0.2 DRIVER AIRBAG COVER MODULE REPLACEMENT (61B046R0) 0.2
KM8JN72D36U	7/13/05	36374	35.16	C/S ESC LT COMES ON	CUST. STATES THAT THE REAR WINDOW DOES NOT SEAL, WATER IS RUNNING DOWN THE MIDDLE OF THE BACK WINDOW	SPECIAL ORDERED REAR WINDOW SEAL	GLASS/TRIM RELATED. 36374 SPECIAL ORDERED REAR WINDOW SEAL
KM8JN72D36U	7/28/05	12090	35.16	C/S ESC LT ON	CUSTOMER STATES THAT ESC LIGHT COMES ON WHILE DRIVING, AND WILL NOT TURN OFF	VERIFIED CUSTOMERS CONCERN	ELECTRICAL 12090 VERIFIED CUSTOMERS CONCERN. FOUND CODE C1513 BRAKE LIGHT SWITCH FAULT. FOUND BRAKE LIGHT SWITCH TO HAVE AN INTERMITTENT OPEN CIRCUIT. REPLACED BRAKE LIGHT SWITCH. TO CORRECT, CLEARED CODES. TEST DROVE OK AT THIS. 93810R00
KM8JN12D66U	8/12/05	23559	33.04	23559 CHECKED FOR FAULT CODES WITH THE HI-SCAN. C1513 BRAKE LAMP SWITCH. REPLACED THE BRAKE LAMP SWITCH, CLEARED THE FAULT CODE AND VERIFIED PROPER OPERATION.			
KM8JM12B45U	10/18/04	33173	30.45		CUST STATES INTERMITTENTLY CRUISE CONTROL IS INOP - INSTALL SOP	INOP	CRUISE CONTROL MAIN SWITCH ASSY RE CRUISE CONTROL MAIN SWITCH ASSY RE
KM8JM12B45U	10/18/04	33173	30.45		CUST STATES INTERMITTENTLY CRUISE CONTROL IS INOP - INSTALL SOP	INOP	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D36U	8/08/05	43226	54.34	ADDL TIME FOR SCAN TOOL C1513	CUST STATES ESC OFF LIGHT STAYS ON INTERMITTENTLY	C1513	ADDL TIME FOR SCAN TOOL ADDL TIME FOR SCAN TOOL

KM8JN12D16U	7/15/05	20918	33.36	20918 CHECKED FOR FAULT CODES WITH THE HI-SCAN. C1513 BRAKE SWITCH CIRCUIT. BRAKE SWITCH IS ADJUSTED CORRECTLY. TESTED AND FOUND BRAKE SWITCH IS SHORTED. REPALED THE BRAKE SWITCH, CLEARED THE FAULT CODE AND VERIFIED PROPER OPERATION.			
KM8JN72D05U	10/05/04	24300	40.18				
KM8JN12D76U	9/22/05	37285	73.56	ESC LIGHT WILL COME ON. FOUND CODE C1513-BRAKE SWITCH. REPLACED THE BRAKE SWITCH.	CUSTOMER STATES THAT THE ESC LIGHT WILL COME ON. SAYS THAT IIT IS RANDOM THAT IT WILL COME OFF AND ON. CHECK AND ADVISE.	TECH CHECKED AND FOUND CODE C1513-BRAKE SWITCH FOUND NEEDS REPLACING.	TECH REPLACED THE BRAKE SWITCH AS NEEDED. ALL OK AT THIS TIME.
KM8JN12D36U	8/08/05	43226	54.34	ADDL TIME FOR SCAN TOOL C1513	CUST STATES ESC OFF LIGHT STAYS ON INTERMITTENTLY	C1513	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE GEAR SHIFT LEVER KNOB RE GEAR SHIFT LEVER KNOB RE
KM8JM12B15U	6/23/05	14670	33.8	SCANNED COMPUTER FOR ABS ESP SYSTEM DTC C1513 B RAKE LAMP SWITCH,REPLACED BRAKE LAMP SWITCH	CUST STATES TOP TO TRANS SHIFTER ISLOOSE	LOOSE	REMOVED SHIFTER KNOB,REPLACED SHIFTER TOPSCREW WITH LOCK TIGHT
KM8JM12B15U	6/23/05	14670	33.8	SCANNED COMPUTER FOR ABS ESP SYSTEM DTC C1513 B RAKE LAMP SWITCH,REPLACED BRAKE LAMP SWITCH	CUST STATES ESP OFF INDICATOR LIGHTINTERMITTENTLY WILL ILLUMINATE AND STAY ON INSTRUMENT CLUSTER AFTER START-UP	ELECTRICAL FAILURE	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE SCANNED COMPUTER FOR ABS ESP SYSTEM DTC C1513B RAKE LAMP SWITCH,REPLACED BRAKE LAMP SWITCH
KM8JN12DX6U	9/23/05	16259	30.96				
KM8JN12DX6U	9/23/05	15268	28.4	ADJUSTED SWITCH, CLEARED CODES, TEST DRIVE, CODES DID NOT RETURN			
KM8JM12B66U	9/26/05	20907	33.66				
KM8JN12D16U	1/13/06	22346	63.66	ADDL TIME FOR SCAN TOOL			
KM8JN12D26U	7/20/05	24261	67.76	TT: TIME TO DIAGNOSIS			
KM8JN72D46U	7/28/05	36184	59.46	TT:HISCAN CODE C1513			
KM8JM12B36U	8/18/05	17335	32.44		DRIVERS AIR BAG MODULE REPLACEMENT	CPN	DRIVERS AIR BAG MODULE REPLACEMENT DRIVERS AIR BAG MODULE REPLACEMENT
KM8JM12B36U	8/18/05	17335	32.44		SOP BRAKE SWITCH	WR	REPLACE BRAKE SWITCH REPLACE BRAKE SWITCH
KM8JN72D15U	5/20/05	30836	33.66				
KM8JN12D76U	1/25/06	7567	33.34				
KM8JN12DX6U	7/23/05	11067	33.34				
KM8JN12D06U	7/16/05	20515	60.66	AT TIME FOR SCAN CODE C1513	CUSTOMER STATES THE ESC OFF LIGHT COMES ON AT TIMES.	FOUND CODE C1513-BRAKE SWITCH CIRCUIT. FOUND THAT THE BRAKE SWITCH HAS AN INTERNAL FAULT.	R&R BRAKE SWITCH-ESC LIGHT STAYS OFF NOW. 93810R00 .3 93810NTT .3 N69 C15
KM8JN72D06U	7/29/05	18999	34.84				
KM8JM12B15U	4/08/05	18779	35.16		DURING ROADTEST AFTER REPAIRS ON JOB#1 TECHNICIAN NOTICED THE ESC LIGHT WAS ON. SCANNED AND FOUND CODE FOR BRAKE LAMP SWITCH	FOUND HIGH RESISTANCE BETWEEN BRAKE LAMP SWITCH TERMINALS	REPLACED WITH NEW, CLEARED CODE AND RE-ROAD TESTED VEHICLE. 93810R00 N69 C15
KM8JN12DX6U	11/05/05	23728	34.16		C/S THE BRAKE LIGHTS DO NOT WORK	STOP LAMP SWITCH SHORTED INTERNALLY	REMOVED AND REPLACED STOP LAMP SWITCH. RECHECK, OK AFTER REPAIRS
KM8JN12D65U	5/30/05	35984	34.16	REPLACED BRAKE SWITCH AND RECHECKED, OK AFTER REPAIRS	CUSTOMER STATES CHECK ENGINE LIGHT ON ESP LIGHT IS ON	BRAKE SWITCH SHORTED INTERNALLY	REPLACED BRAKE SWITCH AND RECHECKED, OK AFTER REPAIRS
KM8JN72D35U	4/22/05	25023	36.14		CUSTOMER STATES REAR BRAKE LIGHTS WONT OPERATE.	DIAG,FOUND FAULTY REAR STOP LAMP LAMP SWITCH	REPLACE REAR STOP LAMP SWITCH.
KM8JM12B15U	4/08/05	18779	35.16		CUSTOMER STATES THERE IS A RATTILING NOISE FROM UNDER THE VEHICLE WHENEVER IS CHANGES DIRECTION OR SHIFTS. STARTING AND STOPING. TURNING. HITTING BUMPS... ETC DURING WRITE UP CUST. EXPRESSED THAT AFTER FURTHER REVIEW IT IS POSSIBLE THE NOISE IS COMING FROM	CROSSMEMBER BUSHINGS - RUBBER INSULATORS SEPERATING FROM OUTER METAL SHEATHING.	REPLACE WITH NEW. 62465R00 4.0 N29 C11
KM8JN72D85U	5/19/05	20645	60.66	AT TIME FOR SCAN	CUSTOMER STATES THE "ESC OFF" LIGHT IS TURNING ON AND OFF.	C1513-BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH ASSY. CLEARED CODE CODE DID NOT COME BACK ON. 93810R00 .3 93810NTT .3 (SCAN) N69 C15
KM8JN72D85U	5/19/05	20645	60.66	AT TIME FOR SCAN	PERFORM CAMPAIGN 079: DRIVER AIR BAG COVER MODULE REPL.	FACTORY UPDATE	INSTALL UPDATED DRIVER AIR BAG MODULE.
KM8JN72D75U	10/21/04	2889	59.4				
KM8JN72D35U	4/22/05	11820	64.26	JCUST STATES ESP OFF LIGHT IS STUCK ON, CODE C1513 BRAKE LIGHT SWITCH, DIAG AND REPLACE BRAKE LIGHT SWITCH CLEAR CODES ALL WORKING AS DESIGNED. TT TIME FOR SCAN TIME SEPERATE PUNCH TIMES AND MANAGER APPROVED	CUSTOMER STATES ESP OFF LIGHT IS STUCK ON	CODE C1513,BRAKE LIGHT SWITCH	DIAGNOSE AND REPLACE BRAKE LIGHT SWITCH,CLEAR CODES,ALL WORKING AS DESIGNED
KM8JN72DX6U	11/16/05	4765	28.95		CUSTOMER STATES ESC LIGHT KEEPS COMING ON AND GOING OFF	BRAKE LAMP SWITCH FAULTY	SCAN TEST, CODES 12371513, TRACED TO BRAKE LAMP SWITCH REPLACED SWITCH
KM8JN12D45U	5/23/05	21338	60.34	AT TIME FOR BRAKE LITE SWITCH	CUSTOMER STATES THE ESC OFF LIGHT IS ON WHILE DRIVING	SCAN C1513 BRAKE LITE SW	REPLACE BRAKE LITE SWITCH 93810R00 .3 93810NTT .3 (SCAN TIME) N69 C15
KM8JN72D66U	10/04/05	30396	60.34	AT TIME FOR SCAN			
KM8JN12D76U	10/16/05	20947	35.16		UPON ARRIVAL TECH NOTED THE ESC OFF LIGHT WAS ON	FOUND CODES C1513 AND C1503-TCS/ESP SWITCH ERROR AND BRAKE SWITCH CIRCUIT. FOUND THAT THE BRAKE SWITCH HAS AN INTERNAL FAULT AND IS PART OF BOTH CIRCUITS.	R&R BRAKE SWITCH-LIGHT STAYS OFF NOW.
KM8JN72DX6U	11/16/05	4765	28.95		CUSTOMER STATES HAS A PLASTIC PIECE STICKING UP IN BACK SEAT	HINGE TRIM BROKEN	REPLACED BOTH REAR SEAT INNER HINGE COVERS

KM8JN72D16U	8/17/05	48302	62.3	TT TIME REQUEST FOR SCAN TIME MANGER APPROVED AND FOREMAN TECH. CUST STATES ESC LIGHT COMES ON SCANNED FOUND C1513 BRAK SWITCH INT OPEN IN BRAKE SWITCH REPLACE BRAKE LAMP SWITCH			
KM8JN72D95U	12/16/04	7366	85.42	CUST STATES ESC LIGHT COMES ON AND STAY ON AT TIMES UNTIL SHUT ENGINE OFF. SCAN TEST C1237 PRESSURE SENSOR. OTHER C1513 BRAKE LAMP SWITCH CLEAR CODES, ROADTEST MLES OUT 7369, MLS IN 7373 WITH GDS INT, OPEN IN BRAKE SWITCH, REPLACE BRAKE SWITCH. PIN TENSION	RECALL 922	RECALL	REPROGRAM ESP
KM8JN12DX6U	7/11/05	23814	94.66	AT TIME FOR SCAN AND WIRE INSPECTION			
KM8JN72D46U	7/27/05	22032	54.06	PLEASE AUTH TT TIME FOR DIAGNOSIS-ESC LIGHT ON, OFF. SCAN SYSTEM, CHECK CODES, CK POWER TO SWITCH, ETC	CUSTOMER STATES THE CK ENGINE LIGHT COMES ON AND OFF	SCANNED FOR DTCS P0456 P0130, SMALL EVAP LEAK DETECTED, AND O2 SENSOR B1S1, TESTED EVAP FOR LEAKS PASSED, MONITORED CURRANT DATA O.K FOUND LOOSE CLAMP ON MAF INLET TUBE	SCANNED FOR DTCS WITH GDS, TESTED EVAP SYSTEM PASSED, TIGHTEN CLAMP ON AIR INLET TUBE 39210RWO .5
KM8JN72D95U	12/16/04	7366	85.42	CUST STATES ESC LIGHT COMES ON AND STAY ON AT TIMES UNTIL SHUT ENGINE OFF. SCAN TEST C1237 PRESSURE SENSOR. OTHER C1513 BRAKE LAMP SWITCH CLEAR CODES, ROADTEST MLES OUT 7369, MLS IN 7373 WITH GDS INT, OPEN IN BRAKE SWITCH, REPLACE BRAKE SWITCH. PIN TENSION	CUSTOMER STATES ESC LIGHT COMES ON AND STAYS ON AT TIMES UNTIL SHUT ENGINE OFF	OPEN IN BRAKE SWITCH	SCAN TEST, CODE 1237 AND 1513, CLEAR CODES, ROAD TEST WITH GDS, REPLACED BRAKE SWITCH, PIN TENSION OK OP
KM8JN72D95U	12/16/04	7366	85.42	CUST STATES ESC LIGHT COMES ON AND STAY ON AT TIMES UNTIL SHUT ENGINE OFF. SCAN TEST C1237 PRESSURE SENSOR. OTHER C1513 BRAKE LAMP SWITCH CLEAR CODES, ROADTEST MLES OUT 7369, MLS IN 7373 WITH GDS INT, OPEN IN BRAKE SWITCH, REPLACE BRAKE SWITCH. PIN TENSION	CUSTOMER STATES BAR IN FRONT OF SUNROOF VIBRATES AND RATTLES, SEE BOB	SUNROOF MOTOR RATTTLING	ROAD TEST, TRACED RATTLE TO SUNROOF MOTOR, ISOLATE LINE AND BRACKET AND MOTOR, DRIVE AGAIN, NOISE GONE OP 81648R00 2.1 RED .6 N29 C09 CP 81648-2E000
KM8JN72D46U	7/27/05	22032	54.06	PLEASE AUTH TT TIME FOR DIAGNOSIS-ESC LIGHT ON, OFF. SCAN SYSTEM, CHECK CODES, CK POWER TO SWITCH, ETC	CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF	SCAN FOR DTCS C1237 PRESSURE SENSOR, C1513 BRAKE SWITCH ERROR, TESTED POWER TO SWITCH O.K HAS FAULTY SWITCH	SCANNED DTCS WITH GDS 95660RPO .3 93810ROO .3 REPLACED BRAKE LAMP SWITCH OPEN CIRCUIT
KM8JN72DX5U	5/21/05	23160	31.86	REPLACE BRAKE LAMP SWITCH ADJUST SWITCH CLEAR CODES RETEST OK	CUSTOMER STATES THE ESC LIGHT WILL STAY ON WHILE DRIVING. PLEASE CHECK AND ADVISE.	CHECKED FOR CODES FOUND C1513 RAN TEST FOUND BRAKE LAMP SWITCH SHORTED INT	REPLACE BRAKE LAMP SWITCH ADJUST SWITCH CLEAR CODES RETEST OK
KM8JN12D35U	1/04/05	14718	76.63	TT TIME IS TO SCAN DUE TO ESP LIGHT BEING ON. CODES 1260 STEERING ANGLE SENSOR AND C1513 FOR THE BRAKE LIGHT SWITCH. CASE # 278021.	C/S: HER ESP LIGHT HAS BEEN INTERMITTENTLY COMING ON.	CODES 1260 STEERING ANGLE SENSOR AND C1513 BRAKE LIGHT SWITCH	CALLED TECH LINE CASE 278021 LANCE SAYS THE CODES COME UP TOGETHER REPLACE BRAKE SWITCH ERASE CODE REPLACE BRAKE SWITCH TEST DROVE NEITHER CODE RETURNED
KM8JN72D06U	7/29/05	14432	35.82		ESP LIGHT COMES ON SRERATICALLY	SCAN TEST C15B BRAKE SWITCH CHECKED INTERNAL OPEN IN BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN12D56U	1/23/06	20058	36.14	ESC LIGHT IS ON. SCANT EST CODE 1513 BRAKE SWITCH. FOUND BRAKE SITCH OPEN. REPLACE SWITCH.	CUSTOMER STATES ESC LIGHT IS ON, CODE 1513 STORED, BRAKE LIGHT SWITCH	BRAKE SWITCH OPEN	SCAN TEST CODE 1513 BRAK SWITCH. FOUND BRAKE SWITCH OPEN. REMOVED AND REPLACES SWITCH
KM8JN72D15U	4/12/05	20209	62.62	TT TIME REQUEST FOR SCAN TIME. ESC LIGHT IS ON SCAN TEST C1513, C1237. INTERMITTANT OPEN IN BRAK SWITCH REPLACE BRAKE SWITCH. MANAGER APPROVE TT TIME			
KM8JN12D95U	4/19/05	28440	43.54		CUSTOMER STATES ESP LIGHT IS ON	SCAN VEH FOUND CODE C1513 BRAKE SWITCH FAILURE	REPLACED BRAKE SWITCH CLEARD CODE
KM8JN12D95U	4/19/05	28440	43.54		CUSTOMER STATES FOG LIGHT IS INOP	FOG LIGHT BULB IS BURNED OUT	REPLACED BULB
KM8JN72D56U	9/07/05	18464	78.06	TT TIME TO SCAN DUE TO ESC LIGHT BEING ON. CODE C1513.			
KM8JM72B35U	7/05/05	14975	35.82		FACTORY RECALL	RECALL	RECALL 079
KM8JM72B35U	7/05/05	14975	35.82		CUSTOMER STATES ESP LIGHT STAYED ON FOR A FEW DAYS, NOW IS OFF	SCANNED C15L3 CIRCUIT SWITCH OPEN INTERMITANTLY	REPLACED BRAKE SWITCH
KM8JM72B86U	11/06/05	27276	36.14		FACTORY RECALL 079	RECALL	REPLACED AIRBAG COVER
KM8JM72B86U	11/06/05	27276	36.14		CUSTOMER STATES ESC OFF LIGHT COMES ON INTERMITTANTLY	BRAKE SWITCH OPEN	SCAN TEST, CODE 1513, REPLACED BRAKE SWITCH
KM8JN12D86U	1/10/06	14895	43.54				
KM8JN12D05U	6/09/05	32361	43.86				
KM8JM12B06U	7/28/05	7465	40.7		CUSTOMER STATES THAT THE BRAKE SWITCH IS FAULTY.		INTERMITTENT SHORT IN THE SWITCH.
KM8JM12B06U	7/28/05	7465	40.7		CUSTOMER STATES THAT THE LOWER CONSOLE AREA IS PEELING. SOP PART IS HERE.		** REPLACED PEELING COVER.
KM8JM72B86U	11/06/05	27276	36.14		CUSTOMER STATES RIGHT REAR GRAB HANDLE IS COMING OFF, PLEASE CHECK ALL OF THEM	GRAB HANDLE COMING LOOSE	REINSTALL HANDLE PROPERLY
KM8JN72D85U	12/20/04	16455	34.43		CUSTOMER REQUESTS CHARGING SYSTEM CHECK HAD REPLACED BATTERY AND IF SETS 2 DAYS IT IS DEAD AGAIN TAIL LIGHTS OR BRAKE LIGHTS STAY ON OVERNIGHT	BRAKE LIGHT SWITCH SHORTING INTERNALLY	TEST BATTERY, OK, REPLACED BRAKE LIGHT SWITCH DUE TO SHORTING OUT

KM8JM72B06U	11/14/05	19960	33.55	FOUND C1513 BRAKE SWITCH MALFUNCTION. INSTALLED BRAKE SWITCH OK NOW.			
KM8JM12B06U	7/28/05	7465	40.7		CUSTOMER STATES THAT THE PASSENGER FRONT DOOR PANEL IS PEELING.		OEDER NEW PASS FRONT DOOR PANEL
KM8JN12D26U	7/15/05	15004	39.34		CUST STATES HAS OPEN CAMPAIGN TO REPLACE DRIVERS AIR BAG MODULE. LABOR OP 61B046R0_2	PRODUCT CAMPAIGN	REPLACED AIR BAG MODULE
KM8JN12D26U	7/15/05	15004	39.34		CUSTOMER STATES THE ESC OFF LIGHT WILL STAY ON INTERMITTENTLY	LIGHT OFF AT TIME OF INSPECT SCANED FOR CODES FOUND C1513 BRAKE SWITCH CIRCUIT	REPLACED BRAKE LIGHT SWITCH, CLEARED CODE RETEST OK
KM8JM12B85U	4/20/05	27763	31.59	BRAKE SWITCH FOUND ERATIC REPLACED SWITCH OK NOW.			
KM8JN12D66U	8/10/05	8983	30.5		CUSTOMER STATES PASSENGER SIDE AIR BAG IS STICKING UP HIGHER THAN THE REST OF THE DASH	TECHNICIAN STATES PANEL OVER PASSENGER AIR BAG HAD COME LOOSE	REPAIR PANEL AND PUT BACK INTO PLACE
KM8JN12D66U	8/10/05	8983	30.5		CUSTOMER STATES ESC LIGHT HAS COME ON TWICE BUT NOT ON NOW	TECHNICIAN STATES BRAKE SWITCH IS STICKING	TEST HECU PER SHOP MANUAL TEST WIRING HARNESS. TEST AND REPLACE BRAKE SWITCH--ALL OK AT THIS TIME
KM8JN72D46U	12/05/05	11129	91.3	CUST STATES CRUISE CONTROL INOP VERIFIED CONCERN FOUND SET LIGHT WOULD COME ON THEN TURN OFF IMMEDIATELY TESTED AND FOUND BRAKE SWITCH FAULTY CAUSING CRUISE NOT TO SET REPLACED BRAKE SWITCH OPERATE OK	CUST STATES--CRUISE CONTROL INOP.	VERIFIED CONCERN--FOUND SET LIGHT WOULD COME ON, THEN TURN OFF IMMEDIATELY--TESTED AND FOUND BRAKE SWITCH FAULTY CAUSING CRUISE TO NOT SET.	REPLACED BRAKE SWITCH--OPERATES OK NOW.
KM8JN72D46U	12/16/05	12622	86.07		CUST STATES HAS OPEN CAMPAIGN TO REPLACE DRIVERS AIR BAG MODULE. LABOR OP 61B046R0_2	PRODUCT CAMPAIGN	REPLACED AIR BAG MODULE
KM8JN72D46U	12/16/05	12622	86.07		C/S: CUSTOMER STATES THE ESC OFF LIGHT STAYS ON	VERIFIED CONCERN--SCANNED VEHICLE AND FOUND C1513--BRAKE LAMP SWITCH MALFUNCTION--REPLACEMENT NECESSARY.	REPLACED BRAKE LAMP SWITCH ASSEMBLY--CLEARED CODES AND ROAD TESTED--OK NOW.
KM8JN72D15U	3/24/05	27990	31.05		CUSTOMER STATES CRUISE IS NOT WORKING PROPERLY--LIGHT ON DASH GOES OUT WHEN BRAKE IS APPLIED AND SOMETIMES WILL NOT RESET	TECH STATES FOUND BRAKE SWITCH WAS STICKING	R&R BRAKE SWITCH AND RETEST ALL OK AT THIS TIME
KM8JM12B46U	7/22/05	13665	32.76		CUSTOMER STATES THE ESC OFF LIGHT KEEPS COMING ON	TECH STATES FOUND CODE C1513--CHECK BRAKE SWITCH FOUND IT TO BE SHORTING OUT INTERMITTENTLY	R&R BRAKE SWITCH--CLEARED CODE--RETEST ALL OK AT THIS TIME
KM8JN72D56U	7/15/05	40177	32.44	TECH STATES HE REPLACED THE BRAKE SWITCH AND RECHECKED OK			
KM8JM72B96U	10/08/05	22065	78.06	CUST STATES ESC OFF LIGHT COMES ON DASH INTERMITTENTLY VERIFIED CONCERN SCANNED VEHICLE AND FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION FOUND BRAKE LAMP SWITCH FAULTY REPLACEMENT NECESSARY REPLACED BRAKE LAMP SWITCH AND CLEARED CODE--OK NOW.	CUST STATES--ESC OFF LIGHT COMES ON ON DASH INTERMITTENTLY.	VERIFIED CONCERN--SCANNED VEHICLE AND FOUND C1513--BRAKE LAMP SWITCH MALFUNCTION--FOUND BRAKE LAMP SWITCH FAULTY--REPLACEMENT NECESSARY.	REPLACED BRAKE LAMP SWITCH AND CLEARED CODE--OK NOW.
KM8JN12D66U	11/03/05	30616	43.86	CUST STATES THE ESC OFF LIGHT CAME ON ONCE IT IS OFF NOW SCAN FOR CODES AND FOUND C1513 BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH. CLEARED CODE RETEST	CUST STATES ESC OFF LIGHT CAME ON ONCE. IT IS OFF NOW	SCAN FOR CODES FOUND C1513 BRAKE LIGHT SWITCH.	REPLACED BRAKE LIGHT SWITCH, CLEARED CODE RETEST OK.
KM8JN12D26U	12/08/05	17113	32.76	R&R BRAKE SWITCH AND CLEARED CODE--RETEST ALL OK AT THIS TIME			
KM8JN12D36U	11/19/05	15673	32.76	REMOVED AND REPLACED BRAKE LAMP SWITCH AND CLEAR CODE. OK NOW			
KM8JN72DX5U	4/21/05	30664	32.76		CUSTOMER STATES ALL THREE OF HIS BRAKE LIGHTS ARE NOT WORKING	TECH STATES FOUND CODE C1513 BRAKE LAMP SWITCH IS BAD	TECH STATES HE REPLACED THE BRAKE LAMP SWITCH AND THE ESP LIGHT STAYED OFF
KM8JN12D16U	10/16/05	12130	69.34	CUST STATES THE ESC OFF LIGHT STAYS ON SCAN TEST C1315 BRAKE SWITCH MALFUNCTION REPLACED BRAKE SWITCH OK NOW	C/S: CUSTOMER STATES THE ESC OFF LIGHT STAYS ON	SCAN TEST C1315 BRAKE SWITCH MALFUNCTION	REPLACED BRAKE SWITCH
KM8JM12B36U	12/28/05	11964	78.06	CUST STATES THE ESC LIGHT COMES ON INTERMITTENTLY VERIFIED CONCERN SCANNED VEHICLE AND FOUND C1513 BRAKE MAP SWITCH MALFUNCTION REPLACED BRAKE LAMP SWITCH CLEARED CODES OK NOW	CUSTOMER STATES THE ESC LIGHT COMES ON INTERMITTENTLY	VERIFIED CONCERN--SCANNED VEHICLE AND FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION--	REPLACED BRAKE LAMP SWITCH--CLEARED CODES--OK NOW.
KM8JM12B36U	7/14/05	30039	31.54	CUSTOMER STATES ESC LIGHT OFF STAY ON REPLACED BRAKE LIGHT SWITCH			
KM8JM12B86U	1/05/06	32749	32.76		CUSTOMER STATES THE ESC OFF LIGHT CAME ON LAST NIGHT	TECH STATES FOUND CODE B1513 CHECKED BRAKE SWITCH OPERATION BRAKE LIGHT WERE NOT WORKING BRAKE SWITCH IS BAD	TECH STATES REMOVED AND REPLACED THE BRAKE SWITCH CLEARED THE CODES AND RECHECKED OK

KM8JM12B55U	12/21/04	20302	32.76	CUSTOMER STATES AT TIMES CRUISE WILL NOT SET. PERFORMED TEST DRIVE AND VERIFIED CONCERN. TEST BRAKE SWITCH ON TEST DRIVE AND FOUND BAD. REMOVED AND REPLACED BRAKE SWITCH AND DRIVE AGAIN, CRUISE WORKING OK NOW.	CUSTOMER STATES AT TIMES CRUISE WILL NOT SET	PERFORMED TESTDRIVE AND VERIFIED CONCERN,TEST BRAKE SWITCH ON TESTDRIVE AND FOUND BAD	REMOVED AND REPLACED BRAKE SWITCH AND DRIVE AGAIN,CRUISE WORKING OK NOW
KM8JM12B26U	7/20/05	54261	32.76	R&R BRAKE SWITCH-RETEST ALL OK AT THIS TIME	CUSTOMER STATES BRAKE LIGHTS NOT WORKING	TECH STATES VERIFIED CONCERN-CHECKED BRAKE SWITCH WIRING ANDCONNECTOR OK-TEST BRAKE SWITCH FOUND	R&R BRAKE SWITCH-RETEST ALL OK AT THIS TIME
KM8JN12D75U	11/03/04	19020	28.35	ESP LIGHT WILL NOT GO OFF--SCAN FOR CODES C1513REPLACE BRAKE LIGHT			
KM8JN72D06U	7/21/05	16514	41	CHECKED AND RETRIEVED CODE C1513. FOUND BRAKE L AMP SWITCH OUT OF ADJUSTMENT. ADJUSTED BRAKE LA MP SWITCH AND RECHECKED-OK	CUSTOMER STATES THAT THE BRAKE LIGHTS ARE INOP-CHECK AND ADVISE		ADJUSTED STOP LAMP SWITCH ADJUSTED STOP LAMP SWITCH CHECKED AND RETRIEVED CODE C1513. FOUND BRAKEL AMP SWITCH OUT OF ADJUSTMENT. ADJUSTEDBRAKE LA MP SWITCH AND RECHECKED-OK
KM8JN72D86U	7/21/05	12283	58.86	TECHNICIAN CHECKED FOR CUSTOMERS CONCERN, CONNE CTED SCAN TOOL RETRIEVED CODE B1513 BRAKE SWITC H CIRCUIT. PERFORMED CHECK AND FOUND BRAKE SWIT CH OUT OF ADJUSTMENT. ADJUSTED BRAKE SWITCH CHE CKED AND VERIFIED REPAIR OPERATING AS DESIGNED. SR CUSTOMER RET			
KM8JN72D15U	10/15/04	40310	31.05		CUSTOMER STATES WHILE DRIVING ON HIGHWAY ESP LIGHT CAME ON ACTED LIKE BRAKES LOCKED UP AND JERK THE CAR HARD TO THE RIGHT-COULD BARELY GET UP TO 55MPH-THIS HAPPENED TWICE IN A ROW	TECH STATES FOUND CODE C1513-CHECK BRAKE SWITCH FOUND TO BE STICKING	R&R BRAKE SWITCH-RETEST ALL OK AT THIS TIME
KM8JN12D26U	8/18/05	17913	32.76		CUSTOMER STATES THE ESC LIGHT COMES ON EVERY NOW AND THEN	TECH STATES HE CHECKED SWITCHES AND HARNESS FOUND SWITCH STICKING	TECH STATES HYE REMOVED AND REPLACED THE BRAKE SWITCH RECHECKED OK
KM8JM12BX6U	7/11/05	35236	32.76		CUSTOMER STATES THE ESC OFF LIGHT CAME ON	TECH STATES CHECK FOR CODES FOUND A BAD BRAKE SWITCH	TECH STATES HE REMOVED AND REPLACED THE BRAKE SWITCH RECHECKED OK
KM8JN72D76U	7/29/05	24748	82	TECHNICIAN CHECKED FOR CUSTOMERS CONCERN, SCANE D FOR CODES CHECKED ESP FOUND C1513 BRAKE SWI TCH- PERFORMED BRAKE SWITCH ADJUSTMENT CLEARED C ODES SELECT ESP DATA MONITOR BRAKE SWITCH OK. V ERIFIED REPAIR. SR	CUSTOMER STATES THAT THE CHECK ENGINE LIGHT IS ON CHECK AND ADVISE		ADJUSTED STOP LAMP SWITCH ADJUSTED STOP LAMP SWITCH TECHNICIAN CHECKED FOR CUSTOMERS CONCERN,SCANE D FOR CODES CHECKED ESP FOUND C1513BRAKE SWI TCH- PERFORMED BRAKE SWITCHADJUSTMENT CLEARED C ODES SELECT ESP DATAMONITOR BRAKE SWITCH OK. V ERIFIED REPAIR.
KM8JN72D96U	11/23/05	20218	33.94	TECHNICIAN CHECKED FOR AND VERIFIED CUSTOMER SC ONCERN. CHECKED FOR CODES C1513 BRAKE SWITCH RE PERFORMED PIN POINT TEST AND FOUND SWITCH FAULT T REPLACED SWITCH AND VERIFIED REPAIR OK. SR	CUSTOMER STATES THAT THE DASH LIGHTS DONT WORK CHECK AND ADVISE		FUSE-BLADE RE FUSE-BLADE RE TECHNICIAN CHECKED FOR AND VERIFIED CUSTOMERSC ONCERN, PERFORMED ELECTRICAL TEST AND FOUNDFUS E 3 10A BLOWN REPLACED FUSE AND VERIFIEDOEPRAT ION OK. SR
KM8JN12D76U	9/15/05	25636	32.76	TECH STATES HE REMOVED AND REPLACED THE BRAKE SWITCH AND CLEARED THE CODES	CUSTOMER STATES THE ESC LIGHT WAS ON	TECH STATES HE FOUND CODE B1513 CHECKED THE BRAKE LIGHTS ANDBRAKE SWITCH FOUND IT TO BE WORKING INTERMITTINLY	TECH STATES HE REMOVED AND REPLACED THE BRAKE SWITCH AND CLEARED THE CODES
KM8JM12B86U	9/02/05	22673	32.44		CUSTOMER STATES CK ENGINE LIGHT ON ALL THE TIME	PERFORMED DIAGNOSTICS.FOUND CODE P0170-FUEL TRIM B1 MALFUNCTION-CK DATA,CK FOR AIR LEAKS,FOUND PCV HOSE COLLPSED	REMOVED AND REPLACED PCV HOSE AND CLEAR CODE AND RESET ADDAPTIVES AND PERFORMED SEVERAL TESTDRIVES,LIGHT NEVER CAME BACK ON
KM8JN72D96U	11/23/05	20218	33.94	TECHNICIAN CHECKED FOR AND VERIFIED CUSTOMER SC ONCERN. CHECKED FOR CODES C1513 BRAKE SWITCH RE PERFORMED PIN POINT TEST AND FOUND SWITCH FAULT T REPLACED SWITCH AND VERIFIED REPAIR OK. SR	CUSTOMER STATES THAT WHEN HITTING THE BRAKES HARD THE ESC LIGHT TURNSON WITHOUT HITTING THE BUTTON-CHECKAND ADVISE		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE TECHNICIAN CHECKED FOR AND VERIFIED CUSTOMERSC ONCERN. CHECKED FOR CODES C1513 BRAKESWITCH RE PERFORMED PIN POINT TEST AND FOUNDSWITCH FAULT T REPLACED SWITCH AND VERIFIEDREPAIR OK. SR
KM8JN72D25U	4/30/05	5070	39.8		CUSTOMER STATES SOMETIMES IGNITION KEY GETS STUCK IN SWITCH,CHECK ABD ADVISE	FOUND BRAKE SWITCH ASSEMBLY FAILING	REPLACE BRAKE SWITCH ASSEMBLY
KM8JM12B86U	9/02/05	22673	32.44		CUSTOMER STATES AT TIMES ESC LIGHT WILL START FLASHING WHILE DRIVING	PRFORMED DIAGNOSTICS,FOUND CODES C1513,C1209-CK BRAKE LIGHTSAND HAD NONE,CK FUSE AND TEST BRAKE SWITCH AND FOUND BRAKE	SWITCH BAD-REPLACED BRAKE SWITCH AND RECK,ALL WORKING OK NOW
KM8JN72D36U	10/12/05	24158	30.06		CUSTOMER STATES THAT THE AIR BAG LIGHT IS ON	INSPECTED AND FOUND THAT THERE IS A CODE OF B1706 (PRETENSIONER FAILURE ON THE PASSENGER SIDE BUCKLE)	REMOVED SEAT AND REPLACED BUCKLE ASSEMBLY RD01
KM8JN72D36U	10/12/05	24158	30.06		CUSTOMER STATES THAT THE ESC LIGHT IS ON	FOUND CODE OF C1513 (BRAKE SWITCH CIRCUIT FAILURE)	REPLACED BRAKE SWITCH ASSEMBLY RD01
KM8JM12B75U	6/14/05	16153	39.8		CUST STATES ESP LITE COMES ON OCCASSIONALLY (SOP IN)	STOP LITE SWITCH HAS OPEN CIRCUIT	REPLACED STOP LITE SWITCH AND CLEARED CODES WITH SCAN TOOL

KM8JM12B46U	7/21/05	34148	268.3	SHAFT STICKING CLOSED, NEEDED TO REPLACE SHAFT AND SWITCH TO CORRECT ESC LAMP ON.			
KM8JN12D95U	5/19/05	29153	62.14	ADDITIONAL TIME NEEDED FOR REPAIR			
KM8JM12B77U	8/09/06	617	35.9				
KM8JN72D36U	10/12/05	24158	30.06		TUCSON DRIVER AIR BAG COVER MODULE REPLACEMENT CAMPAIGN 079	CHECKED TO ENSURE THAT VEHICLE WAS INVOLVED IN CAMPAIGN	REPLACED DRIVER AIR BAG MODULE RD01
KM8JN72D25U	7/06/05	10042	36.34		WOP - ESP TRACTION CONTROL LIGHT GOES ON AND OFF	FOUND BRAKE LAMP SWITCH FAULTY CAUSING ESP LIGHT TO GO ON AND OFF	REPLACED BRAKE LAMP SWITCH, OPERATION OK
KM8JN72D66U	10/14/05	15320	36.66		CUSTOMER STATES THAT INTERMITTENTLY THERE IS A RATTLE FROM UNDER THE DRIVER'S SEAT	TEST DROVE AND HEARD A POPPING/CRACKING NOISE FROM THE FRONT SUSPENSION - BELIEVE NOISE TO BE FROM A BUSHING	NEW CONTROL ARM BUSHING IS ON ORDER - YOU WILL BE NOTIFIED WHEN IT IS RECEIVED
KM8JN72D95U	1/15/05	11674	36.76		CUSTOMER STATES THE BRAKE LAMPS STAY ON INTERMITTANTLY		REPLACED BRAKE LAMP SWITCH
KM8JN72D95U	1/15/05	11674	36.76		CUSTOMER STATES THE DRIVERS SIDE WINDOW HAS AN INTERMITTANT WIND NOISE, CHECK & ADVISE		REPLACED LEFT FRONT WINDOW GLASS RUN SWITCH
KM8JN72D95U	1/15/05	11674	36.76		LOANER CAR		COMPLETED
KM8JN72D66U	10/14/05	15320	36.66		CUSTOMER STATES ESC LIGHT GOES ON AND OFF	RECOVER C1513 - BRAKE SWITCH - TESTED REAR BRAKE LIGHTS AND FOUND THEM TO BE NON-WORKING AT TIMES	REPLACED BRAKE SWITCH - TEST
KM8JM12B45U	4/08/05	31958	36.34		CUSTOMER STATES BRAKE LIGHTS ARE NOT WORKING	ESC LIGHT ON, CODE C1513 - BRAKE LAMP SWITCH STUCK IN OFF POSITION.	REPLACED BRAKE LAMP SWITCH.
KM8JM12B45U	4/08/05	31958	36.34		CUSTOMER STATES AIRBAG LIGHT IS ON	CODE B1334 - PASS FIS COMM. ERROR. (HISTORY CODE). CLEARED CODE. CODE NO LONGER PRESENT. PERFORMED WIGGLE TEST ON F15	CONNECTOR & WIRING - NO PROBLEM FOUND
KM8JN72D85U	9/22/04	21280	64.46	0.3 TT TIME FOR SCAN TOOL TEST. PULLED CODE C1513	CUST STATED ESP LIGHT STAYS ON AND WILL NOT GO OFF, SOP PARTS REFER TO RO 44744		REPLACED BRAKE LIGHT SWITCH
KM8JN72D45U	4/26/05	18667	66.7	STRAIGHT TIME FOR SCAN TEST- CODE C1513	CUSTOMER STATES THERE IS A CLICKING/GRINDING NOISE FOR ABOUT 10 SECONDS AFTER YOU TURN THE KEY TO THE ON POSITION.	INSPECT & VERIFY- PERFORM NVH DIAG- FOUND CRUISE CONTROL MODULE NOISEY ON START UP. ORDERED PARTS.	REPLACED CRUISE CONTROL MODULE & VERIFY PROPER OPERATION.
KM8JN72D45U	4/26/05	18667	66.7	STRAIGHT TIME FOR SCAN TEST- CODE C1513	CUSTOMER STATES THE BRAKE LIGHTS ARE INOP, CHECK & ADVISE.	INSPECT & VERIFY- BRAKE LIGHTS INOP, ESC OFF LIGHT "ON" ALSO. SCAN TEST- C1513, FOUND STOP LAMP SWITCH OPEN	REPLACED STOP LAMP SWITCH & VERIFY PROPER OPERATION.
KM8JM12B36U	7/13/05	15952	36.66		CUSTOMER STATES CHECK ENGINE LIGHT ON LIGHT HAS BEEN ON SINCE MONDAY - CUSTOMER STATES VEHICLE DRIVES FINE	RECOVER P0111 - INTERNAL AIR TEMPERATURE ABNORMAL	PERFORM TSB 06-36-005 TO RESOLVE ISSUE. REFLASHED PCM.
KM8JM12B36U	7/13/05	15952	36.66		CUSTOMER STATES ESC LIGHT COMES ON DASH. CUSTOMER STATES LIGHT IS INTERMITTENT.	RECOVER C1513 - BRAKE LAMP SWITCH FOUND SWITCH INOPERATIVE	REPLACED BRAKE LAMP SWITCH - TEST
KM8JN72D26U	7/29/05	42464	36.66		CUSTOMER STATES ESC LIGHT CAME ON BUT NOW IS OFF	FAULTY BRAKE SWITCH.	REPLACED BRAKE SWITCH.
KM8JN72D96U	12/31/05	9905	38.99				
KM8JN72D85U	2/28/05	5571	17.2				
KM8JN72D85U	2/28/05	5571	17.2				
KM8JN72D75U	1/15/05	2582	40.42	FOUND STOP LAMP SWITCH TO HAVE AN OPEN/SHORT. REPLACED STOP LAMP SWITCH			
KM8JN12D36U	9/13/05	25044	36.34		SOP - CUSTOMER STATES THAT "ESC OFF" LIGHT GOES ON AND OFF. CUSTOMER STATED THAT THE LAST TIME THE WARNING LAMP WAS LIT, SHE CHECKED AND ALL BRAKE LIGHTS WERE WORKING	RECOVER CODE C1513 - BRAKE LAMP SWITCH ALL BULBS OPERATIONAL	REPLACED SWITCH
KM8JN12D36U	9/13/05	25044	36.34		SOP - CUSTOMER STATES CD PLAYER INOPERATIVE	CD WILL NOT EJECT	REPLACED CD PLAYER
KM8JN72D06U	7/15/05	12147	36.34		SOP - "ESC OFF" LAMP IS LIT	C1513 BRAKE LAMP SWITCH, FOUND SWITCH AT TIMES STICKING OPEN CIRCUIT	REPLACED SWITCH ASSY. OPERATION COMPLETED
KM8JN12DX6U	10/01/05	21201	36.66	REPLACED BRAKE SWITCH.	CUSTOMER STATES CHECK ENGINE LIGHT ON.	FAULTY OXYGEN SENSORS, UPSTREAM LEFT AND RIGHT, CODES P0130 AND P0150	REPLACED UPSTREAM RIGHT OXYGEN SENSOR.
KM8JN72D46U	7/21/05	23277	39.71	23277 CODES C 1237 PRIMARY PRESSURE SENSOR SIGNAL. C1513 BRAKE SWITCH CIRCUIT. FOUND BRAKE SWITCH TO BE INOPERATIVE. REPLACED BRAKE SWITCH. CLEARED CODES. ESC OPERATING NORMAL AT THIS TIME.			
KM8JN72D16U	1/19/06	20614	39.71	20614 SWITCH VEHICLE HAD CODE C1513 (BRAKE SWITCH CIR.) IN MEMORY. INSPECTED STOP LAMP SWITCH AND FOUND SWITCH TO BE ADJUSTED WITHIN SPECIFICATIONS AND HARNESS TO BE UNDEAMAGED AND PIN TENSION TO BE OKAY. REPLACED STOP LAMP SWITCH, CLEARED CODE AND TEST DR	CUSTOMER STATES ESC/TCS LIGHT IS ON	BRAKE LIGHT SWITCH FAILING	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20614 SWITCH VEHICLE HAD CODE C1513 (BRAKESWITCH CIR.) IN MEMORY. INSPECTED STOP LAMP SWITCH AND FOUND SWITCH TO BE ADJUSTED WITHIN SPECIFICATIONS AND HARNESS TO BE UNDEAMAGED AND PIN TENSION
KM8JN12DX6U	10/01/05	21201	36.66	REPLACED BRAKE SWITCH.	CUSTOMER STATES CHECK ENGINE LIGHT ON GOING ON AND OFF	FAULTY OXYGEN SENSORS UPSTREAM RIGHT AND LEFT. CODES P0130, P0150	SCANNED FOR CODES. REPLACED OXYGEN SENSOR UPSTREAM LEFT.
KM8JN12DX6U	10/01/05	21201	36.66	REPLACED BRAKE SWITCH.	CUSTOMER STATES ESC LIGHT ON.	FAULTY BRAKE SWITCH. CODE C1513.	REPLACED BRAKE SWITCH.

KM8JN72DX6U	11/11/05	3732	37.96	VERIFIED LIGHT IS ON. HIGH SCAN C1513 BRAKE LAMP SWITCH OPEN CIRCUIT. REPLACED SWITCH AND TESTED. NORMAL OPERATION AT THIS TIME			
KM8JN72D36U	11/10/05	5936	37.96	CONFIRMED COMPLAINT. FOUND BRAKE LAMP SWITCH WITH AN OPEN CIRCUIT. REPLACED SWITCH AND TESTED. NORMAL OPERATION AT THIS TIME			
KM8JN72D66U	11/05/05	4504	36	4505 CONFIRMED COMPLAINT. HI SCAN DIAGNOSTICS C1513 BRAKE LAMP SWITCH OPEN CIRCUIT. REPLACED BRAKE LAMP SWITCH, CHECK OPERATION OK.			
KM8JN72D26U	8/29/05	19900	36.32	19901 CONFIRMED COMPLAINT. HI SCAN DIAGNOSTICS C1513 BRAKE LAMP SWITCH OPEN CIRCUIT. REPLACED SWITCH, CHECK OPERATION OK.			
KM8JN12D96U	11/08/05	10264	72.86	FOUND SHORT IN BRAKE SWITCH, REPLACE SWITCH, WORKS AS DESIGN 93810R00/.3 93810NTT/.5 N94 C15.C/S ESC LIGHT ALWAYS COMES ON WHEN YOU PUT VEHICLE IN DRIVE. TECH DUP. CONCERN. FOUND CODE C1513 BRAKE LAMP SWITCH CODE IN ABS. CHECKED OPERATION OF REAR BRAKE LI	CUSTOMER STATES THE ESC LIGHT ALWAYS COMES ON WHEN YOU PUT INTO DRIVE.	DUPLICATED CONCERN. FOUND CODE C1513 BRAKE LAMP SWITCH CODE IN ABS. CHECK OPERATION OF REAR BRAKE LIGHTS, INOP	FOUND SHORT IN BRAKE SWITCH, REPLACE SWITCH, WORKS AS DESIGN 93810R00/.3 93810NTT/.5 N94 C15
KM8JN72D85U	5/21/05	32759	33.04	C/S BRAKE LIGHTS ARE OUT. INTERNAL FAILURE OF BRAKE LIGHT SWITCH. REPL. BRAK LIGHT SWITCH. VERIFIED PROPER OPERATION.			
KM8JM12B36U	9/07/05	24880	33.36	C/S THE ESC LIGHT COMES ON. WILL NOT GO OFF WITH OPERATION OF MANUAL BUTTON. TECH FOUND CODE C1513 BRAKE SWITCH CIRCUIT MALFUNCTION. INTERNAL FAILURE OF BRAKE SWITCH. REPL. BRAKE SWITCH & RE-TESTED-OKAY. OPERATING AS DESIGNED.	CUSTOMER STATES CHECK ENGINE LIGHT IS ON.	TECH PERFORMED DIAG FOUND CODE P0455 FOR EVAP LARGE LEAK DETECTED. TECH RAN PRESSURE TEST FOUND PURGE VALVE LEAKING.	TECH ORDERED PURGE VALVE TO CORRECT CONCERN.
KM8JN72D85U	2/02/05	14842	34.89	14844 CRUISE CONTROL DOES NOT WORK. BRAKE LIGHT SWITCH OPEN CIRCUIT. NEEDS REPLACEMENT BRAKE LIGHT SWITCH. R+R BRAKE LIGHT SWITCH. CRUISE CONTROL WORKS CORRECTLY.			
KM8JN72D55U	9/18/04	26053	34.61	26056 CONFIRMED COMPLAINT. HI SCAN DIAGNOSTICS C1513 BRAKE LAMP SWITCH OPEN CIRCUIT. REPLACED SWITCH, CHECK OPERATION OK.			
KM8JN72D36U	10/05/05	26102	36	26103 OPEN CIRCUIT CONFIRMED COMPLAINT. HI SCAN DIAGNOSTICS C1513 BRAKE LAMP SWITCH OPEN CIRCUIT. REPLACED SWITCH, CHECK			
KM8JM12B36U	9/07/05	24880	33.36	C/S THE ESC LIGHT COMES ON. WILL NOT GO OFF WITH OPERATION OF MANUAL BUTTON. TECH FOUND CODE C1513 BRAKE SWITCH CIRCUIT MALFUNCTION. INTERNAL FAILURE OF BRAKE SWITCH. REPL. BRAKE SWITCH & RE-TESTED-OKAY. OPERATING AS DESIGNED.	CUSTOMER STATES THE ESC LIGHT COMES ON, WILL NOT GO OFF WITH OPERATION ON MANUAL BUTTON.	TECH FOUND CODE C1513 BRAKE SWITCH CIRCUIT MALFUNCTION. TECH FOUND INTERNAL FAULT IN BRAKE SWITCH	TECH REPLACED BRAKE SWITCH AND RETESTED OK
KM8JN72D76U	10/05/05	13871	33.36	C/S CRUISE IS INOP. TECH FOUND INTERNAL FAILURE OF STOP LAMP SWITCH. REPL. SWITCH. VERIFIED PROPER OPERATION.	CUSTOMER STATES THAT CRUISE IS INOP PART HERE	STOMP LAMP SWITCH FAILUR	REPLACED SWITCH 93810R00 .3 N94 C06
KM8JN72D76U	9/22/05	31353	36.32	31353 CONFIRMED COMPLAINT. FOUND THAT THE BRAKE LAMP SWITCH IS INTERMITTANTLY NOT WORKING CAUSING PROBLEM. REPLACED SWITCH, CHECK OPERATION OK.			
KM8JM72B46U	10/08/05	2779	37.96	HI SCAN DIAG FOUND CODE C1513 BRAKE LAMP SWITCH OPEN CIRCUIT, REPLACED SWITCH CHECK OPERATION OK			
KM8JN72D46U	11/04/05	6793	36	6793 CONFIRMED COMPLAINT. HI SCAN DIAGNOSTICS C1513 BRAKE LAMP SWITCH MALFUNCTION. FOUND THAT THE STOP LAMP SWITCH HAS AN OPEN CIRCUIT. REPLACED SWITCH, CHECK OPERATION OK.			
KM8JN12D55U	4/21/05	12324	40.85	12324 FOUND FAULT C1513- BRAKE LAMP SWITCH REPLACED THE BRAKE LAMP SWITCH UNDER WARRANTY	CUST. STATES THAT THE ESP LIGHT WILL COME ON DASH AT TIMES. WON'T SHUT OFF UNLESS HE TURNS CAR OFF & RESTARTS IT	BRAKE SWITCH FAILED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 12324 FOUND FAULT C1513- BRAKE LAMP SWITCH REPLACED THE BRAKE LAMP SWITCH UNDER WARRANTY
KM8JM12BX6U	7/12/05	17030	40.85	17030 C1513 BRAKE SWITCH MALF. R&R BRAKE SWITCH ASSY.	CUST STATES ESC LIGHT INOP INSTALL PRTS SOP	REPLACED SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 17030 C1513 BRAKE SWITCH MALF. R&R BRAKESWITCH ASSY.

KM8JN72D16U	11/06/05	12706	36	12706 CONFIRMED COMPLAINT. FOUND THAT THE BRAKE LAMP SWITCH HAS AN OPEN CIRCUIT. REPLACED SWITCH, CHECK OPERATION OK.			
KM8JM72BX6U	1/09/06	11997	150.98	12000 CONFIRMED COMPLAINT. OPENED CASE WITH TECH LINE #260472. CHECK ALL INPUTS TO CRUISE MODULE AND FOUND THAT THERE WAS NO SIGNAL COMING FROM CLUTCH PEDAL SWITCH. FOUND THAT THE SWITCH WAS PHYSICALLY BROKEN CAUSING AN OPEN CIRCUIT. REPLACED SWITCH, TEST			
KM8JM72BX6U	1/09/06	11997	25	12000 CONFIRMED COMPLAINT. OPENED CASE WITH TECH LINE #260472. CHECK ALL INPUTS TO CRUISE MODULE AND FOUND THAT THERE WAS NO SIGNAL COMING FROM CLUTCH PEDAL SWITCH. FOUND THAT THE SWITCH WAS PHYSICALLY BROKEN CAUSING AN OPEN CIRCUIT. REPLACED SWITCH, TEST			
KM8JN12D06U	11/22/05	9297	38.89	9297 P0455 EVAP LARGE LEAK FREEZE FRAME DATA INDICATES VEHICLE WAS RUNNING WHILE FILLING UP EERASED FAULT AND PERFORMED EVAP SELF-TEST 3 TIMES-PASSED	CUSTOMER STATES THAT MALFUNCTION INDICATOR LIGHT IS ON	EVAP CODE	RELAY OR RESISTOR WITH DIODE RE RELAY OR RESISTOR WITH DIODE RE 9297 P0455 EVAP LARGE LEAK FREEZE FRAME DATAINDICATES VEHICLE WAS RUNNING WHILE FILLINGUP EERASED FAULT AND PERFORMED EVAP SELF-TEST3 TIMES-PASSED
KM8JN12D06U	11/22/05	9297	38.89	9297 P0455 EVAP LARGE LEAK FREEZE FRAME DATA INDICATES VEHICLE WAS RUNNING WHILE FILLING UP EERASED FAULT AND PERFORMED EVAP SELF-TEST 3 TIMES-PASSED	CUSTOMER STATES RED BRAKE LIGHT CAME ON STILL ON	BAD BRAKE LIGHT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 9297 BRAKE LIGHT SW OPEN CIRCUIT REMOVEDLOWER DASH KICK PANEL, REPLACED BRAKE LIGHTSW
KM8JM12B66U	7/16/05	10929	40.85	10929 C1513 BRAKE SWITCH MALF. R&R BRAKE SWITCH.	CUSTOMER STATES ESC LIGHT GOES ON AND OFF/SOP	F	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 10929 C1513 BRAKE SWITCH MALF. R&R BRAKESWITCH.
KM8JM12B57U	11/13/06	4358	36	CUSTOMER STATES HTE ESC OFF LIGHT WILL STAY ILLUMINATEDCONFIRMED COMPLAINT HI SCAN DIAGNOSTICS C1513 BRAKE LAMP SWITCH OPEN CIRCUIT REPLACED SWITCH CHECK			
KM8JN12D06U	12/26/05	12744	39.34	C/S ESC LIGHT TURNS ON AND OFF INTERMITTENTLY. FOUND OPEN CIRCUIT AT BRAKE SWITCH CAUSING B1513 BRK SYS INOP. NEC TO REPLACE SWTICH ASSY			
KM8JN12D66U	8/13/05	18449	39.34	C/S ESC OFF LIGHT IS ON. CK AND FOUND BRAKE LAMP SWITCH FAULTY. REPLACED SWITCH ASSY			
KM8JN12D15U	5/03/05	31737	41.14	31740 ESP LIGHT ON FOR THREE TROUBLE CODES BRAKE PRESSURE SWITCH ELECTRICAL MALFUNCTION STEERING ANGLE SENSOR ABNORMAL SIGNAL BRAKE SWITCH FAULT REPLACED BRAKE PRESSURE SWITCH AND REPLACED BRAKE SWITCH DUE TO FAULTY SENSORS. MONITORED CURRENT DATA TO SEE			
KM8JN72DX5U	6/13/05	12620	40.85	12620 C1315 BRAKE SW OPEN/SHORT REPLACED BRAKE SW, ADJUSTED NEW BRAKE SWITCH	CUSTOMER STATES THE ESP LIGHT IS ON	REPLACED SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 12620 C1315 BRAKE SW OPEN/SHORT REPLACEDBRAKE SW, ADJUSTED NEW BRAKE SWITCH
KM8JN12D16U	11/21/05	9846	41.14	9846 C1513 BRAKE LAMP SWITCH. R&R BRAKE SWITCH.			
KM8JN12D45U	1/25/05	16040	39.06				
KM8JM12B85U	2/28/05	8	39.9				
KM8JN12D45U	4/23/05	20597	39.34	C/S ESP LIGHT GOES ON AND			
KM8JN72D76U	11/22/05	7073	41.46	7073 ESC LIGHT ON FOR FAULTY BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH			
KM8JN12DX6U	12/16/05	10759	69.66	THE ESC LIGHT COMES ON AND WILL STAY ON TILL CAR SHUT OFF ADVISE OPEN SWITCH FOLLOWED FLOW CHART FOUND AND REPLACED BAD BRAKE SWITCH	CUSTOMER STATES INTERMITTENTLY WHILE DRIVING THE ESC LIGHT COMES ON AND WILL STAY ON TILL CARE SHUT OFF ADVISE	OPEN SWITCH	SCANNED FOR CODES C1513 FOLLOWED FLOW CHART FOUND AND REPLACED BAD BRAKE SWITCH 93810R00. 3 93810RPO .3 N69/C15
KM8JN12D26U	8/29/05	24228	39.66		CUSTOMER STATES ESC LIGHT IS ON, INSTALL SOP	BRAKE SWITCH SHORTED	REPLACED BRAKE SWITCH AND RECHECKED OK 93810ROO-.30 N94 C15
KM8JN12D46U	8/31/05	4193	39.34	C/S EPC LIGHT IS ON	CUST STATES CEL WAS ON ON SUNDAY AND TURNED OFF , LIGHT NEVER RETURNED	LOOSE WIRING CONNECTION	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE 4193 LOOSE WIRING CONNECTION SCANNEDVEHICLE DTC AND FOUND DTC P0130 O2 SENSR, MALB1S1 , INSPECTED SENSOR AND FOUND GOOD ,INSPECTED TERMINAL AND FOUND LOOSECONNECTION, SECURED CONNECTION AND CL

KM8JN12D46U	8/31/05	4193	39.34	C/S EPC LIGHT IS ON	TUCSON DRIVER AIR BAG COVER MODULE REPLACEMENT(SERVICE CAMPAIGN 079)	OPEN RECALL	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 4193 OPEN RECALL. REPLACED DAB COVER
KM8JN12D46U	8/31/05	4193	39.34	C/S EPC LIGHT IS ON	CUST STATES ESC LIGHT IS ON	FOUND BRAKE LAMP SWITCH SHORTING OUT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 4193 FOUND BRAKE LAMP SWITCH SHORTING OUTSCANNED ESP CODE AND FOUND C1517 BRAKE LAMP SWITCH, TESTED SWITCH SHORTING OUT, P&A SWITCH, REPLACED SWITCH AND TESTED OPERATION AND
KM8JN12D06U	12/29/05	17113	39.66		CUSTOMER STATES- CRUISE IS INOP. PLEASE CHECK SOP	FOUND BRAKE SWITCH SHORTED	REPLACED BRAKE SWITCH 93810R00-30 N94 C15
KM8JM12B36U	7/23/05	14872	69.66	ESC LIGHT GOES ON AND OFF FLOW CHART FOUND OPEN INTERMITTENT BRAKE SWITCH REPLACED AND CLEARED CODES RETESTED OK	CUSTOMER STATES ESC LIGHT GOES ON AND OFF	SCANNED FOR CODES C1513 CURRENT	FOLLOWED FLOW CHART FOUND OPEN INTERMITTENT BRAKE SWITCH REPLACED AND CLEARED CODES RETESTED OK 93810R00.3 N69C15 93810RP0.3
KM8JN12D56U	12/07/05	23173	39.66	ESC LIGHT COMES ON INTERMITTENT REPLACED THE STOP SWITCH			
KM8JM12B76U	7/13/05	17439	39.66	17439 BRAKE LAMP SWITCH INOPERABLE REPLACED B/O PART ON VEHICLE, BRAKE LAMP SWITCH AND TESTED OPERATION AND FOUND GOOD			
KM8JN72D56U	9/13/05	14485	39.34	CUSTOMER STATES ESC LIGHT HAS BEEN GOING ON AND OFF INTERMITTENTLY FOR THE LAST WEEK. TECH SCAN FOUND DTC C1523 FOR BRAKE LAMP SWITCH. TECH CHECK FOUND FAILED SWITCH. TECH RPL BRAKE LAMP SWITCH, TEST DROVE, NO OTHER CODES. OK			
KM8JN72D56U	9/13/05	14050	39.34	ESC LIGHT ON. BRAKE LAMP SWITCH FAULTY. REPLACED			
KM8JN12D56U	7/18/05	20176	39.66	REPLACED BRAKE SWITCH AND RETESTED OK CUSTOMER STATES VEHICLE HAS NO BRAKE LIGHTS INTERMITTENTLY OWNER HAS BEEN TOLD SEVERAL TIMES THERE WHERE NO BRAKE LIGHTS CAR CAME IN TODAY LIGHTS WERE WORKING FOUND BRAKE SWITCH OPEN	CUSTOMER STATES VEHICLE HAS NO BRAKE LIGHTS INTERMITTENTLY - OWNER HAS BEEN TOLD SEVERAL TIMES THERE WHERE NO BRAKE LIGHTS CAR CAME IN TODAY LIGHTS WERE WORKING - ADVISE	FOUND BRAKE SWITCH OPEN	REPLACED BRAKE SWITCH AND RETESTED OK
KM8JN12D96U	7/28/05	19776	69.66	ESC LIGHT IS ON ALL THE TIME WILL CIME ON AFTER THEVEHICLE HAS BEEN DRIVEN OPEN SWITCH INTERMITTENTLY REPLACED BRAKE SWITCH GOING OPEN INTERMITTENTLY LEARED CODES NONE RETURNED ON ROAD TEST	CUSTOMER STATES ESC LIGHT IS ON ALL THE TIME WILL COME ON AFTER THE VEHICLE HAS BEEN DRIVEN	OPEN SWITCH INTERMITTENTLY	SCANNED FOR CODES C1237/C1260/C1513 - FOLLOWED FLOW CHART FOUND AND REPLACED BRAKE SWITCH GOING OPEN INTERMITTENTLY CLEARED CODES NONE RETURNED ON ROAD TEST 93810R00.3 N69 C15 93810RPO.3
KM8JN72D66U	11/02/05	17887	71.3	ECS LIGHT ON.CONNECTED HYSKAN TO VEHICLE & RESET DTC	CUSTOMER STATES ESC LIGHT IS ON. SPECIAL ORDER PARTS IN	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 17887
KM8JN72D66U	11/02/05	17887	71.3	ECS LIGHT ON.CONNECTED HYSKAN TO VEHICLE & RESET DTC	CUSTOMER STATES ESC LIGHT IS ON. SPECIAL ORDER PARTS IN	E	93810ATT EASY TRIM 17887
KM8JN12D46U	12/17/05	2859	39.34	C/STATES ESC LIGHT TURNS ON AND OFF INTERMITTENTLY. FOUND BRAKE LIGHT SWITCH SHORTED OUT. REPLACE BRAKE LIGHT SWITCH			
KM8JM12B46U	7/12/05	33421	34.24		CUSTOMER STATES BRAKE LIGHTS NOT WORKING CH AND ADVISE	TESTED FUSES OK, CHECKED TAIL LIGHT BULBS OK CHECKED POWER AND GROUND TO BRAKE LIGHT SWITCH FAILURE	REPLACED BRAKE LIGHT SWITCH AND TESTED OK
KM8JN12DX6U	9/28/05	10553	33.8		CUSTOMER STATES ENGINE STALLS	NO CODES TECH LINE CASE 240880	REPLACED TPS SENSOR ANC TESTED DRIVE NO STALL
KM8JN12DX6U	9/28/05	10553	33.8		CUST STATES ESC LIGHT TURNED ON THEN VEHICLE TURNED OFF CH AND ADVISE	OSC CODES C1237 C1513 240880	REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE
KM8JN12D16U	1/05/06	13047	43.94	13047 C1513 OPEN CIRCUIIT BRAKE LAMP SWITCH. SCANNED SYSTEM AND DETECTED C1513 BRAKE LAMP SWITCH. PERFORMED COMPONENT INSPECTION AND TESTED SWITCH, OPEN CIRCUIT. REPLACED BRAKE LAMP SWITCH ASSEMBLY AND TESTED			
KM8JM12B46U	7/15/05	15477	39.34	C/S ESC LIGHT COMES ON WHEN ACCELERATING, MOSTLY WHEN GOING UPHILL.FOUND BRAKE LIGHT SWITCH FAULTY.REPLACED SWITCH ASSY.			
KM8JN12D66U	12/07/05	7617	39.34	C/S ESC LIGHT ON DASH WAS ON BUT TURNED OFF NOW.REPLACED ASM SWITCH			
KM8JN12D26U	7/28/05	18450	32.01		CUST STATES ESC LIGHT ON	BRAKE SWITCH DEFECTIVE	REPLACE BRAKE SWITCH
KM8JN12D06U	7/15/05	19536	33.8		CUSTOMER STATES ECS LIGHT COMES ON INTERMIT WITH OUT PRESSING ECS BUTTON CHECK & ADVISE	C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN12D06U	7/15/05	19536	33.8		CUSTOMER REQUESTS RECALL PERFORMED AIR BAG MODULE REPLACEMENT	CAMPAIGN	REPLACED AIRBAG MODULE
KM8JN12D76U	4/11/06	11104	34.24		CUSTOMER STATES ESC OFF LIGHT COMES ON BY ITSELF	C1513 CODE BRAKE LIGHT SWITCH INTERMITTEN SHORT OR	REPLACED BRAKE LIGHT SWITCH CLEARED CODES AND TESTED OK

KM8JN12D26U	7/28/05	18450	32.01		CUST STATES VEHICLE SQUEEKS GOING OVER BUMPS.	CRADLE BUSHINGS WORN	ORDER BUSHINGS.
KM8JN12D55U	5/14/05	29263	37.56		079 RECALL OPEN	61B046R0 .2	REPLACED DRIVER'S AIR BAG MODULE PER RECALL
KM8JN12D55U	5/14/05	29263	37.56		ALL BRAKE LIGHTS INOP	93810R00 .3 N94 C15	REPLACED BRAKE LAMP SWITCH
KM8JN72D85U	6/01/05	12925	37.24		RECALL 922	50B035R1 .3	PERFORMED RECALL
KM8JN12D76U	4/11/06	11104	34.24		CUSTOMER STATES CD PLAYER FAILURE SOP IN	CD PLAYER WONT TAKE CDS	REPLACED CD PLAYER
KM8JN12D76U	4/11/06	11104	34.24		CUSTOMER REQUESTS RECALL PERFORMED AIRBAG MODULE REPLACEMENT	OPEN	REPLACED AIRBAG MODULE
KM8JN12D56U	12/15/05	16109	33.8		CUSTOMER STATES HEARS NOISE FROM FRONT OF VEHICLE WHEN ACCELERATING AND TURNING HAPPENS INTERMITTINLY RUBING OR BUMPING NIOSE CH AND ADVISE	HEARD NIOSE AND CALLED TECH LINE C1237 PRESSURE SENSOR OTHER C1282 YAW ROTE LATERAL C1283 YAW ROTE LATERAL ELECTRICAL ABNORMAL OPEN TSB 05-50-005	YAW SENSOR CHECKED ALL PINS FROM YAW SENSOR TO ESP CONTRLLER ATACHED TESTING . AFTER PLUGGING ALL CONNECTORS TEST DRIVE AND UNABLE TO DUPLICATE CONCERN, PRESSURE SENSOR PIN 1 AND 3 5.1VOLTS OPERATING AS DESIGNED
KM8JN72D85U	6/01/05	12925	37.24		BRAKE LIGHTS INOP	93810R00 .3 N94 C15	REPLACED BRAKE LAMP SWITCH
KM8JN12D96U	7/18/05	6165	39.2				
KM8JN12D15U	4/19/05	15961	36.13		C/S BRAKE LIGHTS INOP	93810R00 .3 N94 C15	REPLACED BRAKE LIGHT SWITCH
KM8JN12D56U	12/15/05	16109	33.8		CUSTOMER REQUEST OBIEN RENTAL VEHICLE	REQUESTED 35.00 DOLLAR CHARGE PER DAY	RETURNED RENTAL
KM8JN12D25U	4/29/05	31403	33.8		CUSTOMER STATES IGNITION SWITCH HARD TO TURN CHECK AND LUBE (ELECTRIC LUBE) IF NEEDED	LUBE NOT NEEDED	UABLE TO DUPLICATE CUSTOMERS CONCERN
KM8JN12D25U	4/29/05	31403	33.8		CUSTOMER STATES ESF OFF LIGHT COMES ON BY ITSELF WHILE DRIV ING	C1513 BRAKE LAMP SWITCH CODE	REPLACED SWITCH AND TESTED OK CLERED CODE
KM8JN12D86U	7/28/05	11336	37.56		ESC LIGHT IS ON SOP IN BRAKE LIGHT SWITCH	93810R00 N94 C15	REPLACE BRAKE LIGHT SWITCH
KM8JN12D66U	10/18/05	13282	37.24		CUST STATES EST LIGHT WILL COME ON BUT IT WILL SAT EST OFF	93810R00 N69 C15	REPLACE BRAKE SWITCH
KM8JN12D66U	10/18/05	13282	37.24		CUSTOMER STATES CHECK ON RECALL	61B046R0 -- 079	RECALL COMPLETED 079
KM8JN12D85U	10/01/04	26856	35.85		CUST STATES CRUISE IS INOP	93810R00 N 94 C15	INSTALL BRAKE LIGHT SWITCH WAS SHORTING OUT CRUZ SWITCH
KM8JN12D25U	4/29/05	31403	33.8		CUSTOMER STATES CRUISE CONTROL CUTS OFF BY ITSELF WHILE DRIVING	SWITCH FAILURE	PART ORDERED
KM8JM12B35U	5/21/05	50051	34.56	REPLACED SWITCH	CUSTOMER STATES ESP LIGHT COMES ON & OFF CHECK &	FAULTY SWITCH	REPLACED SWITCH
KM8JN12D16U	8/08/05	20967	34.56		CUSTOMER STATES ESP LIGHT CAME ON / BUT TODAY IS OFF / WHEN LIGHT IS ON THE RELEASE BUTTON GETS STUCK	SCANNED FOR CODES C1513 BRAKE LAMP SWITCH INOP	REPLACED BRAKE LAMP SWITCH OPERATING AS DESIGNED
KM8JN12D36U	7/15/05	25334	34.56		CUSTOMER STATES ESC LIGHT OFF INDICATOR ON IN DASH CHECK AND ADVISE	SCANNED FOR CODES C1513 NEEDS BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN12D85U	10/01/04	26856	35.85		CRUZ IS INOP	3770R00 N94 C15	REPLACE CRUISE SWITCH
KM8JN12D75U	4/13/05	9997	65.46	A TIME FOR SCAN TIME, INTERMITTENT SWITCH FAILURE, REPLACE BRAKE SWITCH	INTERMITTENTLY ESC OFF LIGHT COMES ON WHILE DRIVING.HITTING BUTTON WON'T CHANGE IT.MUST TURN OFF IGNITION	93810R00 .3 / 93810ATT .3 N-69,C-15 CODED C1573 TECH NOTES: A TIME FOR SCAN TIME/INTERMITTEN SWITCH FAILURE	REPLACED BRAKE SWITCH
KM8JN72D55U	5/25/05	26518	37.56		ESP LIGHT CAME ON	93810R00 N94 C15	REPLACE BRAKE LIGHT SWITCH
KM8JM12B47U	11/15/06	12712	34.56	REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE	CUSTOMER STATES TCS LIGHT COMES ON AND OFF	FOUND BRAKE LIGHT SWITCH FAILURE	REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE
KM8JM12B26U	7/11/05	8923	34.24		CUSTOMER STATES ESC LIGHT STAYS ON ALL THE TIME	SCANNED CODE C1513 BRAKE LAMP SWITCH INTERMEDIATE OPEN CIRCUIT	REPLACED BRAKE LIGGHT SWITCH
KM8JM12B96U	7/13/05	18854	32.3		HYUNDAI MUTIPOINT INSPECTION COMPLETED	SWITCH INOP	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JM12B96U	7/13/05	8347	32.9		ECS LIGHT COMES ON ABOUT ONCE A WEEK PART IN	C1513	REPLACED BRAKE LAMP SWITCH 93810R00 .3 N94 C15
KM8JN12D35U	9/14/04	1001	31.8				
KM8JN12D36U	9/23/05	25336	31.26		ESC LIGHT COMES ON PART IN	C1513 BRAKE LIGHT SWITCH FAULT	REPLACED BRAKE SWITCH 93810R00 .3 N94 C15
KM8JN12D46U	7/21/05	23120	31.26		ESC OFF LIGHT INTER COMES ON	C1513 BRAKE SWITCH FAULT	REPLACED BRAKE SWITCH 32002A00 .2 N94 C15
KM8JM12B96U	7/13/05	18854	32.3		AC FAN MAKING NOISE	BLOWER NOISEY	AIR CONDITIONING MOTOR AND FAN BLOWER ASS'Y RE AIR CONDITIONING MOTOR AND FAN BLOWER ASS'Y RE
KM8JN12D45U	5/14/05	22637	30.34				
KM8JM12B25U	6/03/05	53498	30.34				
KM8JN12D96U	10/21/05	11278	30.94				
KM8JN12D56U	7/19/05	17294	39.95	REMOVED & REPLACED BRAKE LITE SWITCH	CUST STATES ESC LITE OFF DIDN'T WANT TO GO OUT, SWITCH INOP - INSTALL S.O.P.	C15 OPEN CIRCUIT	PARKING BRAKE SWITCH ASS'Y RE PARKING BRAKE SWITCH ASS'Y RE REMOVED & REPLACED BRAKE LITE SWITCH
KM8JN12D75U	10/06/04	7530	40.27	REMOVED & REPLACED STOP LAMP SWITCH	CUST STATES ESP LITE SHOWED OFF. DEPRESSING BUTTON WOULD NOT DO ANYTHING. SHUT CAR OFF, NOW IT'S OKAY	C15 OPEN CIRCUIT	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE REMOVED & REPLACED STOP LAMP SWITCH
KM8JN12D46U	9/05/05	12004	32.3		CUST SAYS THAT ESC LIGHT COMES ON ALL THE TIME-EVEN IF THE BUTTON IS DEPRESSED WILL STAY ON FOR HOURS , CHECK AND ADVISE.		TEST AND DIAGNOSE - REPLACED BRAKE LIGHT SWITCH, RETEST PASS
KM8JN12D46U	9/05/05	12004	32.3		PERFOR CAMPAIGN 079 DRIVERS AIR BAGCOVER		COMPLETED RECALL
KM8JN12D16U	9/14/05	20783	30.66				
KM8JN12D16U	8/08/05	17951	30.66				
KM8JM12B46U	7/22/05	18984	181.24	RMVD AND RPL STOP LMP RD TST RPRD BRAKE LT SWITCH WIRING HARN CONNECT RD TEST 8 MLS			
KM8JN72D66U	10/06/05	27559	40.24	REMOVED & REPLACED BRAKE LAMP SWITCH			

KM8JN12D65U	9/10/04	24158	42.26	REMOVED & REPLACED BRAKE LITE SWITCH	CUST STATES ESP OFF LITE ON	C15 OPEN CIRCUIT	ANGULAR VELOCITY SENSOR ANGULAR VELOCITY SENSOR REMOVED & REPLACED STEERING ANGLE SENSOR
KM8JN12D36U	8/10/05	23511	30.34		CUST SAYS THAT ESC LIGHT CAME ON-CUST PUSHED BUTTON- NOTHING HAPPENED-AFTER TURNING VEH OFF AND RESTARTING LIGHT WAS OFF	REPLACED BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D56U	9/29/05	41167	30.66				
KM8JN12D76U	10/12/05	28116	30.66				
KM8JN12D86U	11/01/05	8833	32.3		ESC LIGHT FLASHES, CHECK AND ADVISE	C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D65U	9/10/04	24158	42.26	REMOVED & REPLACED BRAKE LITE SWITCH	BRAKE LITE SWITCH INOP, SEE LINE B	C15 OPEN CIRCUIT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REMOVED & REPLACED BRAKE LITE SWITCH
KM8JN12D65U	9/10/04	24158	42.26	REMOVED & REPLACED BRAKE LITE SWITCH	CUST STATES CHECK ENGINE LITE WAS ON NOW OFF	C40	TCM REPROGRAMING (TSB 05-40-013) TCM REPROGRAMING (TSB 05-40-013) REPROGRAM TCM FOR DTC P0736 REVERSE GEARINCCORR ECT RATIO PER BULLETIN 05-40-013
KM8JN72D06U	10/26/05	16581	40.24	REMOVED & REPLACED BRAKE LITE SWITCH CODE C1237 & C1513			
KM8JN12D86U	11/01/05	8833	32.3		FREE 34-POINT SAFETY INSPECTION (HYUNDAI REALITY COUPON)...	PAINT PEN	FREE 34-POINT SAFETY INSPECTION (HYUNDAI REALITY COUPON)...
KM8JN12D86U	11/01/05	8833	32.3		PERFORM OIL/FILTER SERVICE - TOP OFF FLUIDS & ADJUST TIRE PRESSURE.	E	FREE 34-POINT SAFETY INSPECTION (HYUNDAI REALITY COUPON)...
KM8JM12B96U	7/13/05	11750	32.9		CCSP OIL CHANGE	MAINTENANCE	PERFORM OIL CHANGE SERVICE, REPLACE ENGINE OIL, ENGINE OIL FILTER, REPLACE DRAIN PLUG GASKET, INSPECT AND TOP OFF ALL
KM8JN12D96U	7/16/05	16776	40.24	CODE C1513, C1611, C1612. REMOVED & REPLACED BR AKE LAMP SWITCH			
KM8JM12B26U	7/28/05	29209	40.56	REMOVED & REPLACED BRAKE SWITCH			
KM8JN12D46U	8/25/05	17774	40.24				
KM8JN72D86U	7/26/05	22828	36.34	22828 SCAN CODE C1513 TEST REPLACE BRAKE LIGHT SWITCH	CHECK THE R/R DOOR OUTSIDE TRIM IS LOOSE	LOOSE	REPLACED THE CLIPS FOR THE R/R OUTSIDE DOOR TRIM PANEL ASSY-REAR DOOR TRIM(RH) RE 22828 REPLACE ALL CLIPS AND ATTACHMENTTAPE 2 CLIPS ON CAR 10 MISSING
KM8JM12B96U	7/13/05	11750	32.9		ESC LIGHT FLASHES		REPLACED FAULTY BRAKE LIGHT SWITCH
KM8JM12B96U	7/13/05	11750	32.9		WASHER FLUID RUNS OUT		FOUND MOUSE HAS EATEN INTO SPRAY HOSES, CUSTOMER WILL NEED TO RETURN FOR R&R WIPER COWLING FOR REPAIRS
KM8JM12B16U	1/12/06	11967	32.9		CHECK ENGINE LIGHT ON, CHECK AND ADVISE		REPLACE BRAKE LIGHT SWITCH
KM8JM12B16U	1/12/06	11967	32.9		ESC LIGHT WOULD NOT SHUT		SEE ABOVE REPAIR
KM8JN72D86U	7/26/05	22828	36.34	22828 SCAN CODE C1513 TEST REPLACE BRAKE LIGHT SWITCH	CHECK THE ESC LIGHT WAS ON	INOP	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 22828 SCAN CODE C1513 TEST REPLACE BRAKELIGHT SWITCH
KM8JN72D16U	9/09/05	24836	39.06		CUSTOMER STATES ESC LITE STAYS ON NOW OFF PLEASE CHECK & ADVISE	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B45U	10/13/04	15370	38.46		CUST STYATES ESP LITE COMES ON	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D06U	8/08/05	23397	31.26	FOUND FAILED BRAKE LIGHT SWITCH REPLACE SWITCH C1513			
KM8JM12B26U	7/19/05	18473	32.9		INSTALL SOP BRAKE LIGHT SWITCH		
KM8JN12D66U	9/23/05	27043	31.26				
KM8JN72D86U	7/29/05	19814	39.06		CUSTOMER STATES ESP LITE WAS ON NOWOFF SOP	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D86U	7/29/05	19814	39.06		CUSTOMER STATES ESP LITE WAS ON NOWOFF SOP	15	ESP LITE ON GDS ESP LITE ON GDS
KM8JN12D97U	11/10/06	3	38.74	REPLACED STOP LAMP SWITCH - VERIFIED PROPER OPE RATION	UPON INSPECTION FOUND ESC OFF LAMP ALWAYS ON PLEASE CK AND ADVISE	CAUSED BY FAULTY STOP LAMP SWITCH	ADD SACN TOOL INSPECTION E.S.C.E.C.T. SWITCH ADD SCAN TOOL OPERATION SCAN ELECTRONIC STABILITY CONTROL SYSTEM WITHG .D.S. - C1237 PRIMARY PRESSURE SIGNAL /C1513 B RAKE SWITCH CIRCUIT- CUSED BY FUALTYSTOP LAMP SWITCH - CLEAR CODES/ VERIFIEDPROPER OPERATION
KM8JM12B36U	7/14/05	19410	30.94		ESC LIGHT WONT TURN ON SOP SWITCH IS IN	FOUND C1512 BRAKE LIGHT SWITCH FAILURE DUE TO AN OPEN CIRCUION BRAKE LIGHT	REPLACED BRAKE LIGHT SWITCH NOW OPERATING AS DESIGNED
KM8JM12B56U	7/14/05	18287	52.54	SCAN TOOL TIME	CUSTOMER STATES ESC LIGHT WILL NOT TURN OFF	CHECKED SYSTEM WITH HI-SCAN AND FOUND CODE B1345- BRAKE LIGHT SWITCH DEFECTIVE	REPLACED BRAKE LIGHT SWITCH
KM8JM12B26U	7/19/05	48671	52.86	SCAN TIME.	ESC LIGHT IS ON	BAD SWITCH	REPLACED SWITCH
KM8JN12D06U	11/10/05	14968	30.94		CHECK ENGINE LIGHT ON, CHECK AND ADVISE SEE ATTACHED LIST FOR CODES FOUND THEN	1513 - BRAKE LIGHT SWITCH. BAD CONTACT IN SWITCH	REPLACE BRAKE LIGHT SWITCH
KM8JN12D97U	11/10/06	3	38.74	REPLACED STOP LAMP SWITCH - VERIFIED PROPER OPE RATION	UPON INSPECTION FOUND BRAKE LIGHTS INOP	SHORTED	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED STOP LAMP SWITCH - VERIFIED PROPEROPE RATION
KM8JN12D97U	11/10/06	3	38.74	REPLACED STOP LAMP SWITCH - VERIFIED PROPER OPE RATION	PRE-DELIVERY INSPECTION	PDI	PRE-DELIVERY INSPECTION PRE- DELIVERY INSPECTION COMPLETED PDI

KM8JN12D87U	11/10/06	1493	52.86	BRAKE LIGHTS INOP. CODE B1513 REPALCE BRAKE LAMP SWITCH			
KM8JM12B86U	7/09/05	21187	31.26				
KM8JN12D45U	11/04/04	5044	52.26	TT TIME FOR ESP LIGHT OFF, SCANNER FOUND C1513, REPLACED SWITCH AND RESET COMPUTER	"ESP OFF" LIGHT STAYS ON AFTER CAR IS PUT IN GEAR	SCAN TOOL USED - CODE FOUND C1513 - FOUND BRAKE SWITCH CIRCUIT OPEN. ALSO FOUND NO BRAKE LIGHTS. BAD SWITCH	REPLACE BRAKE LIGHT SWITCH AND CLEARED CODE NO OPERATION FOR SCAN TOOL USE.
KM8JN12D97U	11/10/06	3	29.4	SCAN ELECTRONIC STABILITY CONTROL SYSTEM WITH G .D.S. - C1237 PRIMARY PRESSURE SIGNAL / C1513 B RAKE SWITCH CIRCUIT- CUSED BY FUALTY STOP LAMP SWITCH - CLEAR CODES/ VERIFIED PROPER OPERATION	UPON INSPECTION FOUND ESC OFF LAMP ALWAYS ON PLEASE CK AND ADVISE	CAUSED BY FAULTY STOP LAMP SWITCH	ADD SACTN TOOL INSPECTION E.S.C.E.C.T. SWITCH ADD SCAN TOOL OPERATION SCAN ELECTRONIC STABILITY CONTROL SYSTEM WITHG. D.S. - C1237 PRIMARY PRESSURE SIGNAL /C1513 B RAKE SWITCH CIRCUIT- CUSED BY FUALTYSTOP LAMP SWITCH - CLEAR CODES/ VERIFIEDPROPER OPERATION
KM8JN12D97U	11/10/06	3	29.4	SCAN ELECTRONIC STABILITY CONTROL SYSTEM WITH G .D.S. - C1237 PRIMARY PRESSURE SIGNAL / C1513 B RAKE SWITCH CIRCUIT- CUSED BY FUALTY STOP LAMP SWITCH - CLEAR CODES/ VERIFIED PROPER OPERATION	UPON INSPECTION FOUND BRAKE LIGHTS INOP	SHORTED	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED STOP LAMP SWITCH - VERIFIED PROPEROPERATION
KM8JN12D97U	11/10/06	3	29.4	SCAN ELECTRONIC STABILITY CONTROL SYSTEM WITH G .D.S. - C1237 PRIMARY PRESSURE SIGNAL / C1513 B RAKE SWITCH CIRCUIT- CUSED BY FUALTY STOP LAMP SWITCH - CLEAR CODES/ VERIFIED PROPER OPERATION	PRE-DELIVERY INSPECTION	PDI	PRE-DELIVERY INSPECTION PRE- DELIVERY INSPECTION COMPLETED PDI
KM8JN12D95U	4/28/05	9786	30.94		ESC "OFF" LIGHT WILL COME ON AND WONT TURN LIGHT OFF WITH SWITCH.	C1530 CODED IN HI SCAN	REPLACE DEFECTIVE SWITCH AND CLEARED CODES
KM8JN12D55U	5/14/05	9626	52.54	SCAN TIME	CUSTOMER STATES RIGHT FRONT PASSENGER ROOF HANDLE IS LOOSE	SCREWS WERE LOOSE	TIGHTENED SCREWS AND ALSO FOUND THAT BRAKE LIGHT SWITCH WAS SHORTED OUT (REPLACED SWITCH)
KM8JN12D16U	7/12/05	20357	35.3	.3	CUSTOMER STATES CK FOR CUTTING OFF	USED SCAN TOOL FOUND C1513 BRAKE LAMP SWITCH INT. OPEN SHORT IN SWITCH	CHECKED SWITCH WITH GDS NOT RESPONDING R&R SWITCH FOUND NO TSB'S FOR THIS VEHICLE. ONLY SONATA. 93810R00 N-94 C-15
KM8JM12B96U	7/15/05	24709	39.06	VERIFIED CONCERN - GDS SCAN C1513 - TESTED - FAI LED COMPONENT TESTING - REPLACED STOP LAMP SWITC H - CLEARED CODES VERIFIED REPAIR	CUST STATES ESC LIGHT WAS GOING ON AND OFF INTERMITTANTLY PLEASE CK AND ADVISE	SHORT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE VERIFIED CONCERN - GDS SCAN C1513 - TESTED -FAI LED COMPONENT TESTING - REPLACED STOP LAMP SWITC H - CLEARED CODES VERIFIED REPAIR
KM8JM12B96U	7/15/05	24709	39.06	VERIFIED CONCERN - GDS SCAN C1513 - TESTED - FAI LED COMPONENT TESTING - REPLACED STOP LAMP SWITC H - CLEARED CODES VERIFIED REPAIR	HYUNDAI LOANER VEHICLE CUSTOMERS INSURANCE IS PRIMARY ON ALL LOANER VEHICLES AND IS RESPONSIBLE FOR ALL DAMAGE AND GAS AND IS TO BE RETURNED WITH SAME AMOUNT OF GAS		MISC. SHOP CHARGES
KM8JN12D96U	10/06/05	41131	34.86	C/S ESC LIGHT COME ON INT. C1513 BRAKE LAMP SWITCH FOUND INTERMITTEN CONTACT IN SWITCH REPLACED SWITCH	079 CAMPAIGN DRIVER AIRBAG COVER MOD REPL	RECALL 079 AIR BAG DRIVER SIDE	REPLACED DRIVER AIR BAG WITH PART UPDATE
KM8JN12D96U	10/06/05	41131	34.86	C/S ESC LIGHT COME ON INT. C1513 BRAKE LAMP SWITCH FOUND INTERMITTEN CONTACT IN SWITCH REPLACED SWITCH	CUSTOMER STATES ESC LIGHT COMES ON INT.	C1513 BRAKE LAMP SWITCH FOUND INTERMITTEN CONTACT IN SWITCH	REPLACED BRAKE SWITCH AND TESTED SYSTEM- OK AT THIS TIME
KM8JN12D15U	9/21/04	53729	31.95	93810ROO.3 93810RPO.3 N94 C15	CUSTOMER STATES ESP LIGHT COMES ON INT. WHILE DRIVING AT HWY SPEEDS	CHECKED COMPLETE SYSTEM,BRAKE LIGHT SWITCH HAS SHORT.	REMOVED & REPLACED SWITCH AND RECHECKED SYSTEM.
KM8JM12B96U	7/15/05	24709	39.06	VERIFIED CONCERN - GDS SCAN C1513 - TESTED - FAI LED COMPONENT TESTING - REPLACED STOP LAMP SWITC H - CLEARED CODES VERIFIED REPAIR	HYUNDAI LOANER VEHICLE CUSTOMERS INSURANCE IS PRIMARY ON ALL LOANER VEHICLES AND IS RESPONSIBLE FOR ALL DAMAGE AND GAS AND IS TO BE RETURNED WITH SAME AMOUNT OF GAS		SLOANAZZ LOANER STK#H1858VIN 5NPET46C28H308985 PLATE AG KHAKI '08 SONATA IN SERVICE 7/17/07. HAS I-PASS SLOANAZZ LOANER STK#H1858VIN 5NPET46C28H308985 PLATE AG KHAKI '08 SONATA IN SERVICE
KM8JN72D46U	7/29/05	15819	39.06		079 CAMPAIGN. LOP 61B046R0.	CPN	079 CAMPAIGN. LOP 61B046R0. 079 CAMPAIGN. LOP 61B046R0.
KM8JN72D46U	7/29/05	15819	39.06		CUSTOMER STATES SQUEALING NOISE COMING FROM ENGINE COMPARTMENT	ABNORMAL NOISE	BELT-V OR DRIVE BELT RE BELT-V OR DRIVE BELT RE
KM8JN12DX5U	5/24/05	34629	35.3	.3	CUSTOMER STATES ESP LIGHT FLASHING ON AND OFF SOP IN	USED SCAN-TOOL C-1513,INTER; SHORT TO GROUND.	R&R STOP LAMP SWITCH,CLEARED CODE.TEST DROVE. USED TSB-06-40- 005.93810R00.N-69 C-15
KM8JN12DX5U	5/24/05	50469	34.54	C/S ESP OFF LIGHT COMES ON FOR NO REASON CODE SET C1513 BRAKE LAMP SWITCH ALSO BRAKE LIGHT INTERMITTANTLY ARE INOP CK WIRING AT THE SWITCH IT HAD BATTERY VOLTAGE ON 2 PINS AND I WAS ABLE TO JUMP THE WIRE AND MAKE THE BRAKE LIGHT COME ON REMOVED AND REPLACE	CUSTOMER STATES ESP OFF LIGHT COMES ON INT FOR NO REASON	CODE SET C1513 BRAKE LAMP SWITCH ALSO THE BRAKE LIGHT INTER-MITTANTLY ARE INOP CHECKED THE WIRING AT THE SWITCH IT HAD BATTERY VOLTAGE ON 2 PINS AND I WAS ABLE TO JUMP THE WIRE AND MAKE THE BRAKE LIGHTS COME ON EVERY TIME REMOVED THE STOP LAMP SWITCH AND	REPLACED THE STOP LAMP SWITCH DUE TO AN INTERMITTANT OPEN CIRCUIT OP.CODES:93810R00 0.3
KM8JN72D46U	7/29/05	15819	39.06		CUST STATES WHEN PULLING OUT OF DRIVE WAY SQUEAKING NOISE HEARD FROM LEFT FRONT SUSPENSION PLEASE CK AND ADVISE	MATERIAL FAILURE	BUSHING-STABILIZER BAR (LH,4WD) BUSHING-STABILIZER BAR (LH,4WD) VERIFIED CONCERN - ROADTESTED WITH CHASISEARS - FOUND LEFT FRONT SWAY BAR BUSHINGMATERIAL FA ILURE - REPLACED LEFT FRONT

KM8JN72D46U	7/29/05	15819	39.06		CUST STATES ESC OFF LIGHT IS ON PLEASE CK AND ADVISE	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D66U	11/06/05	22363	58.34	VERIFIED CONCERN - USING GDS C1513 BRAKE SWITCH CIRCUIT OPEN / SHORT - REPLACED BRAKE SWITCH	CUST STATES ECS OFF LIGHT ON WHILE DRIVING - SOP BRAKE SWITCH IS IN	SHORTED	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY VERIFIED CONCERN - USING GDS C1513 BRAKESWITCH CIRCUIT OPEN / SHORT - REPLACED BRAKESWITCH
KM8JN12DX5U	5/24/05	50469	34.54	C/S ESP OFF LIGHT COMES ON FOR NO REASON CODE SET C1513 BRAKE LAMP SWITCH ALSO BRAKE LIGHT INTERMITTANTLY ARE INOP CK WIRING AT THE SWITCH IT HAD BATTERY VOLTAGE ON 2 PINS AND I WAS ABLE TO JUMP THE WIRE AND MAKE THE BRAKE LIGHT COME ON REMOVED AND REPLACE	CUSTOMER STATES AC IS NOT COOLING	TURNED A/C ON FAN TURNED ON BUT THE COMPRESSOR DID NOT CHECKED A/C CHARGE AND IT WAS FULL,REMOVED THE CONNECTOR FROM THE A/C COMPRESSOR AND IT HAD BATTERY VOLTAGE WITH THE A/C ON BUT THE COMPRESSOR DID NOT ENGAGE	EVAC. AND RECHARGED A/C SYSTEM AND REPLACED THE A/C COMP. BECAUSE AN A/C CLUTCH WAS NOT AVAIL.. OP.CODE:97701R001.0, 09760A00 0.5,97701RTT 0.5
KM8JN12D66U	11/06/05	22363	58.34	VERIFIED CONCERN - USING GDS C1513 BRAKE SWITCH CIRCUIT OPEN / SHORT - REPLACED BRAKE SWITCH	CUST STATES ECS OFF LIGHT ON WHILE DRIVING - SOP BRAKE SWITCH IS IN	SHORTED	COMPUTER ASSEMBLY ADD SCAN TOOL OPERATION COMPUTER ASSEMBLY ADD SCAN TOOL OPERATION VERIFIED CONCERN - USING GDS C1513 BRAKESWITCH CIRCUIT OPEN / SHORT - REPLACED BRAKESWITCH
KM8JM12B56U	7/22/05	10851	42.91		CUST STATES,ESC LIGHT FLASHES AT TIMES AT STOPS	15	SCAN SYSTEM,C1513 STOP LAMP ERROR.FOUND NO BRAKELAMPS.REPLACE STOP LIGHT SWITCH,CK OK STOP LAMP SWITCH ASSY RE
KM8JN12D75U	6/16/05	26749	43.27		CUST STATES ESC OFF LIGHT COMES ON AND OFF	15	SCANNED SYSTEM C1513, FOUND BRAKE LIGHT SWITCH OPEN CIRCUIT INTERNALLY - R/R BRAKE LIGHT SWITCH. SWITCH ASSY- STOP LAMP RE
KM8JN12D16U	12/14/05	11555	34.54	C/S ESC OFF LIGHT COMES ON INT. WHEN MAKING TURNS ESC LOGHT CODE C1513 BRAKE LAMP FAILURE BRAKE LIGHT ONLY WORKING HALF OF THE TIME FOLLOWED TSB 0650006 ALL CONTINUITY CHECK WERE GOOD BUT WITH THE OLD SWITCH IN CAR BRAKE LIGHT ONLY WORS PART OF THE TIME C	CAMPAIGN #079 AIRBAG COVER	CAMPAIGN	COMPLETED CAMPAIGN PER INSTRUCTIONS 61B046R0. 2
KM8JN12D16U	12/14/05	11555	34.54	C/S ESC OFF LIGHT COMES ON INT. WHEN MAKING TURNS ESC LOGHT CODE C1513 BRAKE LAMP FAILURE BRAKE LIGHT ONLY WORKING HALF OF THE TIME FOLLOWED TSB 0650006 ALL CONTINUITY CHECK WERE GOOD BUT WITH THE OLD SWITCH IN CAR BRAKE LIGHT ONLY WORS PART OF THE TIME C	CUSTOMER STATES ESC OFF LIGHT COMES ON INT WHEN MAKING TURNS	ESC LIGHT CODE C1513 BRAKE LAMP SWITCH FAILURE BRAKE LIGHT ONLY WORKING HALF OF THE TIME	FOLLOWED TSB 06-50-006 ALL CONTINUITY CHECKS WERE GOOD BUT WITH THE OLD SWITCH IN CAR BRAKE LIGHT ONLY WORK PART OF THE TIME CHECKED WITH KNOWN GOOD ONE AND BRAKE LIGHT WOK ALL OF THE TIME REPLACED BRAKE LAMP SWITCH 93810R00. 3 N94 C15
KM8JN12D56U	11/21/05	22693	43.27		CUST STATES,NO BRAKE LIGHTS AT TIMES	15	FOUND BRAKE SWITCH SHORTED,REPLACE SWITCH ASSY,CK OK SWITCH ASSY-STOP LAMP RE
KM8JN72D16U	8/08/05	23006	43.67				
KM8JN12D55U	5/19/05	44724	43.67		BELTS NOISEY ON START UP	11	FOUND DRIVE BELT NOISEY,REPLACE DRIVE BELT BELT-V OR DRIVE BELT RE
KM8JN12D16U	12/14/05	11555	34.54	C/S ESC OFF LIGHT COMES ON INT. WHEN MAKING TURNS ESC LOGHT CODE C1513 BRAKE LAMP FAILURE BRAKE LIGHT ONLY WORKING HALF OF THE TIME FOLLOWED TSB 0650006 ALL CONTINUITY CHECK WERE GOOD BUT WITH THE OLD SWITCH IN CAR BRAKE LIGHT ONLY WORS PART OF THE TIME C	CUSTOMER STATES SMALL LIGHT TO LEFT OF RIGHT HEADLIGHT IS OUT	PARKING LIGHT BULB IS BLOWN	REPLACED PARKING LAMP BULB 18653R00 .2 N94 C15
KM8JN12DX6U	10/31/05	24804	34.86	C/S ESC LOGHT IS ON FOUND CODE C1513 PERFORMED TSB REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ECS LIGHT IS ON	FOUND CODE C1513	REPLACED BRAKE LAMP SWITCH
KM8JN12D46U	7/30/05	14451	34.54	C/S ESC LIGHT COMES ON INT. CODE 1513 BRAKE LAMP SWITCH FOUND INTERMITTEN CONTACT PROBLEM WITH SWITCH REPLACED SWITCH	CUSTOMER STATES ESC LIGHT COMES ON INT.	CODE C1513 BRAKE LAMP SWITCH FOUND INTERMITTEN CONTACT PROBLEM WITH SWITCH	REPLACED SWITCH AND TESTED SYSTEM- OK AT THIS TIME
KM8JN12D55U	5/19/05	44724	43.67		ESP LIGHT ON	15	SCAN SYSTEM,C1513 BRAKE LAMP SWITCH SHORTED,REPLACE BRAKE LAMP SWITCH SWITCH ASSY-STOP
KM8JN12D55U	5/19/05	44724	43.67		OWNER REPORTS SERVICE ENGINE SOON LIGHT IS ON	15	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE
KM8JN12D55U	5/19/05	44724	43.67		OWNER REPORTS SERVICE ENGINE SOON LIGHT IS ON	15	SCAN SYSTEM,P0130 B1/S1 SLOW RESPONSE.REPLACE O2 SENSOR,CLEAR CODES SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION
KM8JN12D46U	7/30/05	14451	34.54	C/S ESC LIGHT COMES ON INT. CODE 1513 BRAKE LAMP SWITCH FOUND INTERMITTEN CONTACT PROBLEM WITH SWITCH REPLACED SWITCH	CUSTOMER STATES CHECK ENGINE LIGHT ON	CODE P0130 B1/S1 O2 MALF. FREEZEFRAME DATA SHOWED B1 28.9% B2 -1.6 %	REPLACED B1/S1 O2 SNSR
KM8JN12D36U	1/19/06	15244	32.69	ESC LIGHT WORKS OFF AND ON: CODE B1513 FOUND. REPLACED FAULTY BRAKELIGHT SWITCH.	CUSTOMER STATES ESC LIGHT WORKS EVERY ONCE IN AWHILE INSTALLSOP	FAULTY BRAKE LIGHT SWITCH CODE 1513	REPLACE BRAKE LIGHT SWITCH
KM8JN12D36U	1/19/06	15244	32.69	ESC LIGHT WORKS OFF AND ON: CODE B1513 FOUND. REPLACED FAULTY BRAKELIGHT SWITCH.	CUSTOMER STATES AC IS MAKING NOISE FROM VENTS INSTALL SOP	FOUND SHORT IN ACTUATOR	REPLACED ACTUATOR

KM8JM12B56U	8/29/05	25850	27.96		CUSTOMER STATES INSTALL SPECIAL ORDERED BRAKE SWITCH PER ESCOFF LIGHT COMING ON	TECH FOUND BRAKE SWITCH HAS INTERNAL SHORT AND NEEDS REPLACED	TECH INSTALLED NEW BRAKE SWITCH AND CLEARED CODE
KM8JN12D35U	5/18/05	14985	34.86				
KM8JN12D46U	7/23/05	21072	35.56	21072 BRAKE LAMP SWITCH OPEN PULL CODES FOUND C1513, R&R BRAKE LAMP SWITCH CLEAR CODES 93810R00 0.3 N94/C15	CUSTOMER STATES THE ESC & CHECK ENGINE LIGHT COME ON EVERY NOW & THEN-CURRENTLY OFF-ADVISE FOR ANY STORED CODES	E	SENSOR ASSY-OXYGEN LH (UP) RE SENSOR ASSY-OXYGEN LH (UP) RE 21072 2/1 O2 SENSOR N69/C15 PULL CODES FOUND(P0150,P0154,P0456), R&R 2/1 O2 SENSOR (CLEARCODES), RUN FORCED EVAP TEST PASSED 39213R000.5, 39213RQO 0.3
KM8JN12D46U	1/13/06	21739	34.86	CUSTOMER STATES ABS LIGHT COMING ON; SCAN SYSTEM, CODE C1513 BRAKE LAMP CIRCUIT; FOUND BRAKE LAMP SWITCH AT TIMES SHORTING-INTERNAL FAULT; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT THIS TIME	CUSTOMER STATES ABS LIGHT COMING ON.	BRAKE LIGHT SWITCH INTERMITTENTLY SHORTING. C1513 CODE PRESENT.	REPLACED SWITCH AND CLEARED CODE C1513.
KM8JN12D66U	12/27/05	15608	34.54	CUSTOMER STATES ECS LIGHT COMES ON AT LEAST TWICE A WEEK WHILE DRIVING; SCAN SYSTEM, CODE C1513-BRAKE LIGHT CIRCUIT; FOUND INTERNAL FAULT IN BRAKE LAMP SWITCH; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT THIS TIME	CUSTOMER STATES THAT ECS OFF LIGHT COMES ON AT LEAST TWICE A WEEK WHILE DRIVING CHECK AND ADVISE	FOUND CODE C1513 BREAK LIGHT CIRCUIT.	REPLACE BREAK LIGHT SWITCH, CLEAR CODE RETEST CAR FOR FAULTSFOUND NONE AT YTHIS TIME SYSTEM CHECK OK.
KM8JN12D46U	7/23/05	21072	35.56	21072 BRAKE LAMP SWITCH OPEN PULL CODES FOUND C1513, R&R BRAKE LAMP SWITCH CLEAR CODES 93810R00 0.3 N94/C15	CUSTOMER STATES THE ESC & CHECK ENGINE LIGHT COME ON EVERY NOW & THEN-CURRENTLY OFF-ADVISE FOR ANY STORED CODES	E	SENSOR ASSY-OXYGEN LH ADDGDS OPERATION SENSOR ASSY-OXYGEN LH ADDGDS OPERATION 21072 2/1 O2 SENSOR N69/C15 PULL CODES FOUND(P0150,P0154,P0456), R&R 2/1 O2 SENSOR (CLEARCODES), RUN FORCED EVAP TEST PASSED 39213R000.5, 39213RQO 0.3
KM8JN12D46U	7/23/05	21072	35.56	21072 BRAKE LAMP SWITCH OPEN PULL CODES FOUND C1513, R&R BRAKE LAMP SWITCH CLEAR CODES 93810R00 0.3 N94/C15	PERFORM RECALL T79 DRIVERS SIDE AIRBAG MOD REPL		R&R AIR BAG MODULE COVER R&R AIR BAG MODULE COVER 21072 RECALL R&R DRIVER AIRBAG COVER 61B046R00.2
KM8JN12D66U	12/27/05	15608	34.54	CUSTOMER STATES ECS LIGHT COMES ON AT LEAST TWICE A WEEK WHILE DRIVING; SCAN SYSTEM, CODE C1513-BRAKE LIGHT CIRCUIT; FOUND INTERNAL FAULT IN BRAKE LAMP SWITCH; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT THIS TIME	CUSTOMER REQ RECALL FOR AIRBAG 079	AS STATED IN RECALL	COMPLETE
KM8JM12B26U	7/28/05	26290	63.66	CUSTOMER STATES THAT ESC OFF LIGHT IS ON; SCAN SYSTEM, CODE C1513-BRAKE SWITCH CIRCUIT; FOUND INTERNAL FAULT IN BRAKE LAMP SWITCH; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT THIS TIME...ATT FOR SCAN TIME	CUSTOMER STATES THAT THE ESC OFF LIGHT IS ON. CHECK AND ADVISE.	SCAN CHECK FOUND CODE C1513 BRAKE SWICH CIRCUIT LAMP.	REPLACED NEW BRAKE SWITCH LAMP TEST VEH AND VEH OPERATING TO HYUNDAI SPECS.
KM8JN12D46U	7/23/05	21072	35.56	21072 BRAKE LAMP SWITCH OPEN PULL CODES FOUND C1513, R&R BRAKE LAMP SWITCH CLEAR CODES 93810R00 0.3 N94/C15	CUSTOMER STATES THE ESC LIGHT COMES ON EVERY NOW AND THEN-ADVISE FOR ANY STORED CODES		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21072 BRAKE LAMP SWITCH OPEN PULL CODES FOUND C1513, R&R BRAKE LAMP SWITCH CLEAR CODES93810R00 0.3 N94/C15
KM8JN12D76U	7/19/05	33790	62.1	33790 OPEN STOP LAMP SWITCH(N94)(C15) 93810R00 0.3 95670RQ0 0.3 TOTAL 0.6 VERIFY CONCERN PERFORM GDS SCAN RECIEVED CODES C1237 C1513 REPLACE STOP LAMP SWITCH CLEAR CODES VERIFY REPAIR ATT TIME IS PERFORMING GDS SCAN ON ABS SENSOR			
KM8JN12D65U	10/20/04	35472	31.56	35476 CRUISE INOP WARR CK OUT REPLACE BRAKE LIGHT SWITCH	CUSTOMER STATES THE CRUISE CONTROL IS INOP CHECK AND ADVISE		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 35476 CRUISE INOP WARR CK OUT REPLACE BRAKELIGHT
KM8JN12D06U	7/13/05	31265	34.86	CUSTOMER STATES THAT THE ESC OFF LIGHT HAS COME ON AFTER STARTING THE CAR AND STAYS ON; SCAN SYATEM, CODEC1513 BRAKE LAMP SWITCH INOPERATIVE-INTERNAL FAULT; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT THIS TIME	CUSTOMER STATES THAT THE ESC OFF LIGHT HAS COME ON AFTER STARTING THE CAR AND STAYS ON. CHECK AND ADVISE.	C1513 CODE PRESENT. BRAKE SWITCH IS INTERMITTENTLY INOP.	REPLACED SWITCH AND CLEARED CODE.
KM8JN12D86U	7/28/05	22530	60.06	REPLACED BRAKE LIGHT SWITCH..CUSTOMER STATES THAT THE ESC LIGHT IS ON; SCAN SYSTEM, CODE C1513-BRAKE LAMP SWITCH CIRCUIT; FOUND INTERNAL FAULT WITH BRAKE LAMP SWITCH; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT THIS TIME	CUSTOMER STATES THAT THE ESC LIGHT IS ON. CHECK AND ADVISE.	C1513 BRAKE SWITHC	REPLACED BRAKE LIGHT SWITCH

KM8JN12D56U	11/18/05	12270	36.5		CUST STATES ONCE STEERING WHEEL LOCKED WHILE DRIVING - TURNED IGNITION SWITCH OFF AND BACK ON AND STEERING OK		ROAD TEST VEHICLE AND WAS UNABLE TO DUPLICATE CONCERN FOUND VEHICLE OPERATING AS DESIGNED
KM8JN72D96U	8/19/05	16440	32.91	C1513	CUSTOMER STATES ESC OFF LIGHT COMING ON WHILE DRIVING	FOUND BRAKE LAMP SWITCH INTERNAL FAILURE,REPLACED AND RECHECKED OK	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D96U	9/09/05	13353	55.84	C1513	CUSTOMER STATES CHECK FOR OPEN RECALL/CAMPAIGN	COMPLETED RECALL 079	REPLACED AIR BAG COVER PER 079 REPLACED AIR BAG COVER PER 079
KM8JN12D96U	9/09/05	13353	55.84	C1513	CUSTOMER NSTATES TH EESC LIGHT IS ON	CODE C1513 REPLACE BRAKE SWITCH INTERNAL FAILURE	SCAN COMPUTER 93810ATT
KM8JN12D56U	11/18/05	12270	36.5		CUST STATES ESC LIGHT ON INTERMITANTLY	SCAN VEHICLE AND FOUND DTC P0703 STOP LAMP SWITCH CIRCUIT MALFUNCTION	FOUND BRAKE SWITCH MALFUNCTIONING. REPLACED SWITCH AND CHECK ESC OPERATION
KM8JN12D56U	11/18/05	12270	36.5		CUST STATES CAR INTERMITANTLY STALLS OUT - RESTARTS OK		SCAN VEHICLE ECM AND FOUND NO DTC AT THIS TIME. ROAD TEST VEHICLE AND WAS UNABLE TO DUPLICATE CONCERN
KM8JN12D96U	9/09/05	13353	55.84	C1513	CUSTOMER NSTATES TH EESC LIGHT IS ON	CODE C1513 REPLACE BRAKE SWITCH INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D35U	9/09/04	313	32.07				
KM8JM12B26U	7/19/05	38128	32.59	C1513	CUSTOMER STATES CHECK FOR OPEN RECALL/CAMPAIGN	PERFORM RECALL 079	REPLACED AIR BAG COVER PER 079 REPLACED AIR BAG COVER PER 079
KM8JM12B26U	7/19/05	38128	32.59	C1513	CUST STATES CK ESC LITE COMES ON ATTIMES	C1513 BRAKE LITE SWITCH OPEN CIRCUITREPLACE BRAKE LITE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D56U	11/18/05	25799	336.94		CUST STATES THAT THE CRUISE CONTR & BRAKE LIGHTS ARE INOP. FOUND CAN BUS LINE DOWN. CODE C1611 CAN BUS FAILURE.CASE 259216. TRACED BRAKE LIGHT CIRCUIT PIN 1 HAD NO CONTINUITY TO GROUND. CHECKED ALL GROUNDS TRACED WHITE WIRE THROUGH CAR AND FOUND NOT M		
KM8JN12D95U	6/15/05	20173	36.5		CUST STATES NOISE IN REAR WHEN HITTING BUMPS	TEST DROVE THE CAR FOR 20 MILES OVER SPEED BUMPS AND COULD NOT DUPLICATE ANY NOISE CUST STATED.	ALSO TEST DROVE WITH QI AND COULD NOT DUPLICATE NO NOISE
KM8JN12D95U	6/15/05	20173	36.5		CUST STATE E.S.P LIGHT KEEP COMING AT TIMES	CODE FOUND P1707 BRAKE SWITCH. NEED TO REPLACE THE BRAKE SWITCH	REPLACED THE BRAKE SWITCH AND ERASED THE CODE. THEN DROVE THE CAR FOR 20 MILES AND FOUND NO CODES
KM8JN72D15U	6/24/05	29401	32.59		CUSTOMER STATES THE ESP LIGHT COMES ON AND GOES OFF	REPLACE BRAKE SWITCHC1513	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP
KM8JM12B36U	7/20/05	23685	32.91	P1501	CUSTOMER STATES STRONG VIBRATION INSTEERING AT EXPRESSWAY SPEEDS	TECH CHECKED AND ROADTESTED VEHICLE,FOUNDROTORS WARPED,MACHINED AND ROADTESTED OK	BRAKE DISC MACHINING (BOTH SIDES)-ADJUSTMENT BRAKE DISC MACHINING (BOTH SIDES)-ADJUSTMENT
KM8JM12B36U	7/20/05	23685	32.91	P1501	CUSTOMER STATES ESC LIGH COMING ON	TECH CHECKED AND FOUND BRAKE SWITCH WITHINTERNAL FAILURE,REPLACED AND RECHECKEDOK.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D95U	6/15/05	52799	60.06		CUSTOMER STATES THAT THE ESP LIGHT IS ON; SCAN SYSTEM, CODE C1513 BRAKE LAMP SWITCH; FOUND INTERNAL FAULT WITH BRAKE LAMP SWITCH; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT THIS TIME. ATT IS FOR SCAN	PERFORMED BATTERY TEST, BATTERY FAILED	REPLACED BATTERY WARRANTY CODE 4WV4C-MQFJG
KM8JN12D95U	6/15/05	52799	60.06		CUSTOMER STATES THAT THE ESP LIGHT IS ON; SCAN SYSTEM, CODE C1513 BRAKE LAMP SWITCH; FOUND INTERNAL FAULT WITH BRAKE LAMP SWITCH; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT THIS TIME. ATT IS FOR SCAN	FOUND CODE C1513 BRAKE LAMP SWITCH	FOUND BRAKE LAMP SWITCH WITH INTERNAL FAILURE. REPLACED SWITCH CLEARED CODE. CODE DID NOT RETURN
KM8JM12B56U	8/25/05	21754	32.59	C1513	CUSTOMER STATES THE ESC LIGHT CAME ON WENT OFF AFTER 3 DAYS	REPLACE STOP LIGHT SWITCH INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B95U	12/13/04	1134	32.62		CUSTOMER STATES THE TCS LIGHT CAME ON. FOUND OPEN CIRCUIT IN STOP LAMP SWITCH. REPLACED		
KM8JM12B76U	1/05/06	20123	60.94		20123 BRAKE LAMP SWITCH PAYS OUT .6 RAN DIAGNOSTICS, CODE C1513 SHOWED BRAKE LAMP SWITCH FAULT. INSTALLED NEW BRAKE LAMP SWITCH AND CLEARED CODES. CONCERN RESOLVED. NO LONGER ANY TROUBLE CODES REOCCURRING.		
KM8JN12D46U	7/30/05	31212	34.86		CUSTOMER STATES ECS LIGHT HAS BEEN COMING ON AT TIMES; SCAN SYSTEM, CODE C1611 C1612 C1613 FOUND BRAKE LAMP SWITCH MALFUNCTION; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT THIS TIME	FOUND CODES C1611 LOST COMMUNICATION WITH ECM, C1612 LOST COMMUNICATION WITH TCM AND C1513 BRAKE SWITCH CIRCUIT. BRAKE PEDAL SWITCH MALF. NEEDS REPLACE BRAKE PEDAL SWITCH	REPLACE BRAKE PEDAL SWITCH. CODES C1611 AND 1612 ARE SET BECAUSE BRAKE PEDAL SWITCH MALF. CLEAR CODES. RETESTED. NO CODES AT THIS TIME
KM8JN12D85U	6/23/05	10509	36.5		CUSTOMER STATES THAT E.S.P LIGHT AT TIMES FLASHS	FOUND CODE C1513 BRAKE SWITCH.	REPALCED BRAKE LIGHT SWITCH AND CLEARED CODE. E
KM8JN12D85U	6/23/05	10509	36.5		CAMPAIGN 921 QWNER MANUAL	AS STATED IN RECALL.	

KM8JN12D55U	4/21/05	18314	60.94	18314 DIAG AND INSTALLATION OF BRAKE SWITCH PAYS .6 RAN DIAGNOSTICS, CODE C1513 SHOWED BRAKE LAMP SWITCH FAUL. WENT TO CURRENT DATA AND FOUND BRAKE SWITCH NOT SWITCHING TO ON WHEN STEPPING ON BRAKE PEDAL. INSTALLED NEW BRAKE SWITCH. CONCERN RESOLVED. SWIT			
KM8JN12D05U	6/14/05	26354	35.14	26354 SET CODESC1237-C1260-C1513THE PRESSURE SENSOR 93810ROO N94 C15 59150ROO N66 C31. 8 WASNT READING PROPERLY AND BRAKE LAMP SWITCH HAS INTERMITTEN FAILURE THE STEERING WHEEL SENSOR WAS OUT OF CALABRATION C- REPLACED BRAKE PRESSURE SENSOR WITH NEW REPLA			
KM8JN12D86U	11/21/05	19400	34.54	CUSTOMER STATES THAT THE ESC LIGHT IS ON; SCAN SYSTEM- CODE C1513 BRAKE LIGHT SWITCH-INTERNAL FAULT; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT	CUSTOMER STATES THAT THAT THE ESC LIGHT IS ON. CHECK AND ADVISE.	SCEN CHECK FOUND CODE C1513 BRAKE LAMP SWITCH.	REPLACED NEW BRAKE CAMP SWITCH.
KM8JN12D86U	11/21/05	19400	34.54	CUSTOMER STATES THAT THE ESC LIGHT IS ON; SCAN SYSTEM- CODE C1513 BRAKE LIGHT SWITCH-INTERNAL FAULT; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT THIS TIME	CUSTOMER STATES THAT CAR HAS A HESITATION THEN STALLS OUT NOTICE MAINLY WHEN TRYING TO PARK CAR ALSO DRIVER STATES THAT WHEN LETTING OFF ACCELL. PEDAL OR BRAKE PEDAL CAR HAS VIBRATION AND JERKS BACK CHECK AND ADVISE	CODE P0123 THROTTLE POSITION SENSOR IN VEH CIRCUIT HIGH	CHECKED CONNECTOR AND FOUND LOOSE PINS. TIGHTENED PIN AND ALSO INSTALLED INHIBITOR 22 CONNECTING ENHANCER. CLEARED CODES AND TEST DROVE VEH AND VEH OPERATING TO HYUNDAI SPECS AT THIS TIME
KM8JM12B36U	7/16/05	42578	35.5		CUSTOMER STATES: ESC LIGHT HAS CAME ON AND STAYED ON A COUPLE TIMES LATELY - RESETS WHEN CYCLE IGNITION	HI SCAN DIAGNOSTICS, C1513 STORED FOR BRAKE SWITCH CIRCUIT. CHECKED SWITCH ADJUSTMENT OK.	REPLACED DEFECTIVE BRAKE SWITCH, CLEARED CODE, AND RECHECKED OPERATION OK
KM8JM12B66U	7/12/05	12545	43.27		C/S ECS LIGHT COMES ON INTERMITTENT	15	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY
KM8JN12D96U	8/18/05	28080	41.13		CUSTOMER STATES ESC LIGHT CAME ON	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D96U	8/18/05	28080	41.13		CUSTOMER STATES VEHICLE SAT FOR 2-3DAYS AND THEN VEHICLE WOULDNT START.	15	ETR RADIO ASSY RE ETR RADIO ASSY RE
KM8JN12D86U	11/21/05	19400	34.54	CUSTOMER STATES THAT THE ESC LIGHT IS ON; SCAN SYSTEM- CODE C1513 BRAKE LIGHT SWITCH-INTERNAL FAULT; REPLACED BRAKE LAMP SWITCH ASSEMBLY; OPERATING TO FACTORY SPECIFICATION AT	CUSTOMER REQ RECALL FOR AIR BAG (079)	AS STATED IN RECALL	REPLACED NEW AIR BAG.
KM8JM12BX6U	7/13/05	17119	36.2		CUSTOMER STATES THE ESC LIGHT HAS BEEN COMING ON.		PERFORMED ESC DIAG-C3115--PINPOINT TEST & REPLACED BRAKE LITE SWITCH & TEST DRIVE-RETEST PASS
KM8JN12DX5U	6/13/05	19854	36.04	CUST STATES NO BRAKE LIGHTS AND ESP LIGHT HAS BEEN COMING ON, TEST AND REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES NO BRAKE LIGHTS AND ESP LIGHT HAS BEEN COMING ON.	SWITCH	CHECK BRAKE LAMPS, REPLACE SWITCH
KM8JM12B76U	7/09/05	12856	43.27		CUST STATES STABLITEY LIGHT COMES ON INTERMITT-ADVISE	40	EMC PROGRAMMING. BULLETIN 06-36-005 EMC PROGRAMMING. BULLETIN 06-36-005
KM8JN72D56U	7/21/05	9118	28.5		C/S WHEN DRIVING ESC LIGHT COMES ON AND STAYS ON UNTIL CAR IS TURNED OFF	15	FOUND POOR CONNECTION AT BRAKE LIGHT SWITCH. TWEETPINS AND RECONNECT ALSO POOR ADJUSTMENT ON SWITCHHEAD ADJUSTED SWITCH. CLEARED CODE OK NOW STOP LAMP SWITCH ASSY RE
KM8JN72D56U	7/21/05	9118	28.5		C/S BATTERY GOES DEAD WHEN CAR SITS	F	HAD TO ORDER RADIO PER TSB FOR VEHICLE UNDER WARRANTY MISC
KM8JN12DX5U	6/13/05	19854	36.04	CUST STATES NO BRAKE LIGHTS AND ESP LIGHT HAS BEEN COMING ON, TEST AND REPLACE BRAKE LAMP SWITCH	FREE MULTI POINT INSPECTION AND BATTERY TEST	FREE BATTERY TEST AND MULTI-POINT INSPECTION RECOMMENDED ITEMS ARE AS FOLLOWS:	BALANCE AND ROTATE
KM8JN12DX5U	6/13/05	19854	36.04	CUST STATES NO BRAKE LIGHTS AND ESP LIGHT HAS BEEN COMING ON, TEST AND REPLACE BRAKE LAMP SWITCH	TIRES AT 7/32 OR GREATER (TIRES OK AT THIS TIME)	CHEROKEE FORD OFFERS PURIGEN98 NITROGEN TIRE FILL THAT WILL IMPROVE YOUR HANDLING, TIRE LIFE, FUEL ECONOMY AND SAFETY.	TIRES AT 7/32 OR GREATER (TIRES OK AT THIS TIME)
KM8JN12D55U	5/19/05	13594	61.1	ATT USED FOR DIAG OF PROBLEM	CUSTOMER STATES: ESP OFF LIGHT WILL NOT TURN OFF. AFTER SHUTTING VEHICLE OFF AND THEN RESTARTING IT WILL USUALLY GO OFF BUT WILL COME BACK ON. CK AND ADVISE		PERFORMED DIAG & SELF TEST C1513, PINPOINT TEST & REPLACED BRAKE LIGHT SWITCH & RETEST PASS
KM8JM12B15U	5/13/05	38979	37.4	BRAKE LIGHT INOPERATIVE. CHECK BRAKE LIGHTS AND FOUND BRAKE LIGHT SWITCH BAD--OPEN CIRCUIT. REPLACE BRAKE LIGHT SWITCH.	CUST STATES PASS FRONT DOOR PANEL FABRIC WILL NOT STAY IN TRACK AND IS FALLING OFF	C63	PANEL ASSY-FRONT DOOR TRIM (RH) RE PANEL ASSY-FRONT DOOR TRIM (RH) RE 38979 REPLACED RIGHT FRONT DOOR PANEL.
KM8JM12B15U	5/13/05	38979	37.4	BRAKE LIGHT INOPERATIVE. CHECK BRAKE LIGHTS AND FOUND BRAKE LIGHT SWITCH BAD--OPEN CIRCUIT. REPLACE BRAKE LIGHT SWITCH.	BRAKE LIGHTS ARE INOP	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 38979 CHECK BRAKE LIGHTS AND FOUND BRAKE LIGHT SWITCH BAD. REPLACED BRAKE LIGHTSWITCH. OPEN CIRCUIT IN
KM8JN12D75U	9/21/04	29330	36.52		RECALL 06-01-001		REPROGRAM PCM FOR ESP AS PER RECALL 06-01-00

KM8JN12D75U	9/21/04	29330	36.52		CUSTOMER STATES: WINDSHIELD WASHER WILL NOT SPRAY WITH ANY FORCE. FLUID ONLY DRIBBLES OUT		TEST WASHER SYSTEM. FOUND SYSTEM SUCKING AIR. INSPECT LINES. LINES OK. FOUND WASHER PUMP WITH DEFECTIVE DIAPHRAM. REPLACE WASHER PUMP. NECESSARY TO REMOVE AND REINSTALL WASHER JAR TO REPLACE PUMP
KM8JM12B05U	5/13/05	31970	37.4	ESC LIGHT IS ON AND BRAKE LIGHTS DO NOT WORK. C1513. REPLACE BRAKE LIGHT SWITCH AND CLEAR CODE.	OPEN 922 CAMP ECM REPROGRAM	RECALL 922	ESC/ECM REPROGRAM TUCSON ESC/ECM REPROGRAM TUCSON 31970 PERFORMED RECALL #922-REPROGRAMMED SUCCESSFULLY
KM8JM12B05U	5/13/05	31970	37.4	ESC LIGHT IS ON AND BRAKE LIGHTS DO NOT WORK. C1513. REPLACE BRAKE LIGHT SWITCH AND CLEAR CODE.	61B046R0 DRIVER AIR BAG MODULE REPLACEMENT	RECALL 079	DRIVER AIRBAG MODULE REPLACEMENT DRIVER AIRBAG MODULE REPLACEMENT 31970 REPLACED DRIVERS SIDE AIRBAG COVER.
KM8JM12B05U	5/13/05	31970	37.4	ESC LIGHT IS ON AND BRAKE LIGHTS DO NOT WORK. C1513. REPLACE BRAKE LIGHT SWITCH AND CLEAR CODE.	CUST STATES ESC LIGHT IS ON AND BRAKE LIGHTS DO NOT WORK	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 31970 BRAKE LIGHT SWITCH PLUNGER STUCK-CONNECT SCANNER. CODE C1513 STORED. FOUND BRAKE LIGHT SWITCH BAD. PLUNGER STUCK. REPLACED BRAKE LIGHT SWITCH & CLEARED CODE.
KM8JN12D75U	9/21/04	29330	36.52		CUSTOMER STATES: CRUISE CONTROL IN OP		RD TEST AND VERIFY CONDITION. FOUND CRUISE LIGHT ON WHEN SWIRTCN TURNED ON. WHEN SET BUTTON PUSHED SET WOULD FLASH ON DASH. PERFORM PINPOINT TEST ON BRAKE SWITCH. FOUND OPEN IN SWITCH ALL THE TIME. REPLACE BRAKE LIGHT SWITCH.
KM8JN12D75U	9/21/04	29330	36.52		CUST STATES THE RIGHT FRONT WEATHERSTRIP IS COMING APART		FOUND RUBBER WEATHERSTRIP DETERIORATED IN 1 SECTION. NECESSARY TO S.O.P
KM8JN12D75U	9/21/04	29330	36.52		FREE BATTERY TEST AND MULTI POINT INSPECTION.		RECOMMENDED ITEMS ARE AS FOLLOWS: 30K MILE SERVICE SEE JOSH OR CALL 678-841-6964 FOR DETAILS
KM8JN12D75U	9/21/04	29330	36.52		BRAKES ARE 6MM OR GREATER. NO WORK REQUIRED.		NO WORK REQUIRED.
KM8JM12B05U	5/13/05	31970	37.4	ESC LIGHT IS ON AND BRAKE LIGHTS DO NOT WORK. C1513. REPLACE BRAKE LIGHT SWITCH AND CLEAR CODE.	OPEN 071 CAMP PARKING BRAKE LEVER	OPEN RECALL 071	SEE TECHNICIAN COMMENTS SEE TECHNICIAN COMMENTS
KM8JM72B25U	7/02/05	34393	37.08	ESP LIGHT IS COMING ON. C1513. INTERMITTANT OPEN CIRCUIT IN BRAKE LIGHT SWITCH. NEC TO REPLACE BAD BRAKE LIGHT SWITCH. CLEAR CODE.	CUST STATES ESP LIGHT IS COMING ON	C15	93810R00 SEE TECHNICIAN COMMENTS 34393 BRAKE LIGHT SWITCH BAD-CONNECT SCANNER, CODE C1513 STORED. INTERMITTANT OPEN CIRCUIT IN BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH & CLEARED CODE.
KM8JN72D16U	8/10/05	17949	37.4	ESC LIGHT COMES ON. C1513. FOUND BRAKE LIGHT SWITCH STICKING INTERMITTENTLY. REPLACE SWITCH AND CLEAR CODE.	61B046R0 DRIVER AIR BAG MODULE REPLACEMENT	079 CAMP	DRIVER AIRBAG MODULE REPLACEMENT DRIVER AIRBAG MODULE REPLACEMENT 17949 PERFORMED RECALL-REPLACED DRIVERS AIRBAG COVER ASSEMBLY.
KM8JN12D75U	9/21/04	29330	36.52		TIRES AT 7/32 OR GREATER (TIRES OK AT THIS TIME)		
KM8JN12DX5U	5/20/05	29835	36.04	CUST STATES ESP OFF LIGHT COMING ON, SCAN C1513, PINPOINT, REPLACE BRAKE LIGHT SWITCH, RETEST			
KM8JN12D46U	9/24/05	20973	36.04	CUST STATES ECS LIGHT IS COMING ON AND GOING OFF INTERMITTANTLY. SCAN TOOL, CODE C1513. REPLACE STOP LAMP SWITCH, CLEAR CODES, RETEST, PASSED	TIRES AT 7/32 OR GREATER (TIRES OK AT THIS TIME)	CHEROKEE FORD OFFERS PURIGEN98 NITROGEN TIRE FILL THAT WILL	TIRES AT 7/32 OR GREATER (TIRES OK AT THIS TIME)
KM8JN72D16U	8/10/05	17949	37.4	ESC LIGHT COMES ON. C1513. FOUND BRAKE LIGHT SWITCH STICKING INTERMITTENTLY. REPLACE SWITCH AND CLEAR CODE.	CUST STATES WHILE DRIVING THE ESC LIGHT COMES ON	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 17949 BRAKE LIGHT SWITCH STICKING INTERMITTENTLY-CONNECTED SCANNER, CODE C1513 STORED. FOUND BRAKE LIGHT SWITCH STICKING, REPLACED SWITCH & CLEARED CODE.
KM8JN12D85U	6/01/05	31151	37.08	ESP LIGHT COMES ON AND FLICERS AND GOES OFF. C1611 C1513. FOUND BRAKE SWITCH NOT WORKING. REMOVE AND REPLACE SWITCH. OPERATION GOOD.	OPEN RECALL 079	079 CAMP	DRIVER AIRBAG MODULE REPLACEMENT DRIVER AIRBAG MODULE REPLACEMENT 31151 PERFORMED 079
KM8JM12B95U	5/24/05	24208	61.84	ESP LIGHT COMES ON WHILE DRIVING. INTERNAL FAILURE. CODE C1513 IN ECM. TEST CIRCUIT AND REPL STOP LAMP SWITCH	ESP LIGHT COMES ON/OFF FLUCTUATES WHILE DRIVING CK AND ADVISE	INTERNAL FAILURE...OF THE BRAKE LAMP SWITCH ASSEMBLY..	REPLACED THE BRAKE LAMP SWITCH ASSEMBLY... C1513 IN ECM
KM8JN12D96U	2/02/06	10960	35.43	EST CONTROL LIGHT STAYS ON. OPEN CIRCUIT. REPL BRAKE LAMP SWITCH	CUSTOMER STATES EST CONTROL LIGHT COMES ON WHILE DRIVING AND STAYS ON UNTIL TURN OFF VEHICLE..	CODE C1513 BRAKE LAMP SWITCH	REPLACED SWITCH/RESET CODE
KM8JN12D96U	2/02/06	14560	35.75	ESC LIGHT IS ON. INTERNAL FAILURE. REPLACED BRAKE LIGHT SWITCH	C/S THERE IS VIBRATION WHEN BRAKING AT HWY SPEEDS	ROTORS WARPED	RESURFACED FRONT BRAKE ROTORS

KM8JN12D85U	6/01/05	31151	37.08	ESP LIGHT COMES ON AND FLICKERS AND GOES OFF. C1611 C1513. FOUND BRAKE SWITCH NOT WORKING. REMOVE AND REPLACE SWITCH. OPERATION GOOD.	CUST STATES ESP LIGHT COMES ON AND THEN FLICKER AND GOES OFF	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 31151 GOT C1611 AND C1513 FOUND BRAKE SWITCH NOT WORKING REMOVED AND REPLACED BRAKE SWITCH TESTED OPERATION NOW
KM8JM12B86U	7/14/05	16049	39.94		PER LAST RO ESC LIGHT IS ON AND BRAKE LIGHTS INOP-SOP IS HERE #4 INSTALL UNDER WARRANTY AS NECC..	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B85U	5/18/05	11521	41.9		C/S ESP LIGHT STAYING ON, ADVISE.		HYDRAULIC MODULE ASSY - ABS RE HYDRAULIC MODULE ASSY - ABS RE
KM8JN12D96U	2/02/06	14560	35.75	ESC LIGHT IS ON. INTERNAL FAILURE. REPLACED BRAKE LIGHT SWITCH	C/S ESC LIGHT CAME ON. PLEASE CHECK AND ADVISE	INTERNAL FAILURE OF BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12D96U	2/02/06	14560	35.75	ESC LIGHT IS ON. INTERNAL FAILURE. REPLACED BRAKE LIGHT SWITCH	C/S ABS LIGHT IS ON	INTERNAL FAILURE OF THE PEDAL PRESSURE SENSOR	REPLACED BRAKE PEDAL PRESSURE SENSOR AND BLEED BRAKE SYSTEM.
KM8JM12B85U	5/18/05	11521	41.9		RENTAL OK'D BY F.D.	15	RENTAL RENTAL
KM8JM12B85U	5/18/05	11521	41.9		C/S BRAKE LIGHTS INOP.. ADVISE.		PARKING BRAKE SWITCH ASSY RE PARKING BRAKE SWITCH
KM8JM12B85U	5/18/05	11521	41.9			15	
KM8JN72D07U	9/19/06	3	39.94		RENTAL OK'D BY F.D.		
KM8JM12B76U	7/12/05	18951	104.74	CUST STATES THAT THE ESC LIGHT COMES ON AT TIMES B1513 BRAKE LITE SWITCH CIRCUIT TESTED AND FOUND THE BRAKE LITE SWITCH OHM TEST FAILED REPLACED THE BRAKE LITE SWITCH TESTED WORKING TO STANDARDS SCAN TOOL TIME	CUSTOMER STATES THAT THE ESC LIGHT COMES ON AT TIMES	B1513-BRAKE LITE SWITCH CIRCUIT. TESTED AND FOUND THE BRAKE LITE SWITCH OHM TEST FAILED.	REPLACED THE BRAKE LITE SWITCH. TESTED. WORKING TO STANDARDS SCAN TOOL TIME..
KM8JN12D36U	7/16/05	19005	33.19	CUST STATES STABILIZATION LIGHT IS ON DIAG AND FOUND BRAKE LIGHT SWITCH FAULTY REPLACED THE BRAKE LIGHT SWITCH CLEARED CODES TESTED OPERATING TO	CUSTOMER STATES STABILIZATION LIGHT COMES ONE SOP HERE	DIAGNOSED ON PREVIOUS RO	REPLACED THE BRAKE LITE SWITCH. CLEARED CODES. TESTED. WORKING TO STANDARDS.
KM8JM12B16U	7/14/05	9810	81.21	CUST STATES THAT THE ESC LIGHT COMES ON AT TIMES CHECK AND ADVISE C1513 BRAKE LIGHT CIRCUIT TEST CIRCUIT IMPROPER ADJ SWITCH OK SWITCH FILED OHM TEST REPLACED THE BRAKE LIGHT SWITCH WORKING PROPERLY SCAN TOOL TIME	CUSTOMER STATES THAT THE ESC LIGHT COMES ON AT TIMES CHECK AND ADVISE	C1513-BRAKE LITE CICUIT. TESTED CIRCUIT--OK. CHECKED FOR IMPROPER ADJUSTED SWITCH--OK. SWITCH FAILED OHM TEST.	REPLACED THE BRAKE LIGHT SWITCH. TESTED. WORKING PROPERLY. SCAN TOOL TIME.
KM8JN72D75U	10/15/04	19720	38.83		CUSTOMER STATE CRUISE CONTROL INOP INTERMITTED - ADVISE	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B05U	5/23/05	25050	51.34	ESP LIGHT COMES ON WHILE DRIVING, SCAN FOR CODES. B1513 BRAKE LAMP SWITCH FAILED. REPLACED	C/S ESP LIGHT COMES ON AT TIMES WHILE DRIV	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B05U	5/23/05	25050	51.34	ESP LIGHT COMES ON WHILE DRIVING, SCAN FOR CODES. B1513 BRAKE LAMP SWITCH FAILED. REPLACED	C/S ESP LIGHT COMES ON AT TIMES WHILE DRIV	F	SCAN TOOL CODE SCAN TOOL CODE
KM8JM12B46U	7/13/05	45362	33.21	CUSTOMER STATES ESC LIGHT WILL NOT GO OFF. FOUND CODE C1513-BRAKE LAMP SWITCH MALFUNCTION OPEN CIRCUIT. REPLACED BRAKE LIGHT SWITCH.			
KM8JN12D46U	12/26/05	16510	33.21	CUSTOMER STATES BRAKE LIGHTS STAY ON. FOUND SHORT INSIDE OF BRAKE SWITCH. REPLACED BRAKE SWITCH.			
KM8JN12D76U	1/23/06	14465	33.21	CUSTOMER STATES ESC LIGHT COMES ON AND VEHICLE HAS A LOSS OF POWER. FOUND CODE C1513-INTERNAL SHORT IN BRAKE LIGHT SWITCH. REPLACED STOP LAMP SWITCH.			
KM8JN12D46U	9/27/05	24816	32.76	ESC LIGHT ON AND OFF INTERMITTEN. SWITCH STICKING. REPLACED STOP LAMP SWITCH ASSEMBLY	C-S ESC LIGHT ON/OFF INTERM	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D56U	10/13/05	26304	32.76	ESC LIGHT COMES ON. OPEN CIRCUIT. REPLACED STOP LAMP SWITCH	C-S ESC LIGHT COMES ON WHEN GOING OVER BUMP (SOP)	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D86U	12/29/05	20482	32.76	BRAKE LIGHT INOP INTERMITTENLY. SWITCH FAILED. REPLACED STOP LAMP SWITCH ASSEMBLY	UPON INSPECTION TECH FOUND BRAKE LIGHT WORKING INTERMITTAINLY	F	LUBE AND ADJUST CABLE AND CLEAN SHIFT LEVER ASSY REMOVE TA LUBE AND ADJUST CABLE AND CLEAN SHIFT LEVER ASSY REMOVE TA
KM8JM12B66U	7/11/05	17424	30.13		CUST STATES ESC LIGHT KEEPS COMING ON	C06	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B66U	7/11/05	17424	30.13		RENTAL AVAILABLE	X	5NPEU46C18H332854, 1 DAY RENTAL AVAILABLE
KM8JN12D86U	7/12/05	15767	29.85		CUST STATES THE ECS LIGHT IS STAYING ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D86U	12/29/05	20482	32.76	BRAKE LIGHT INOP INTERMITTENLY. SWITCH FAILED. REPLACED STOP LAMP SWITCH ASSEMBLY	UPON INSPECTION TECH FOUND BRAKE LIGHT WORKING INTERMITTAINLY	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D86U	12/29/05	20482	32.76	BRAKE LIGHT INOP INTERMITTENLY. SWITCH FAILED. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S CK CHARGING SYSTEM BATTERY KEEPS GOING DEAD S O P	F	REPALCE RADIO REPALCE RADIO
KM8JM12B56U	7/11/05	14960	30.34	BOTH BRAKES LIGHTS OUT. INTERNAL FAULT. REPLACED STOP LAMP SWITCH	TUCSON DRIVER AIR BAG MODULE REPLACEMENT	F	TUCSON DRIVER AIR BAG MODULE REPLACEMENT TUCSON DRIVER AIR BAG MODULE
KM8JN12D96U	8/08/05	11664	29.85		CUST STATES ESC LIGHT STAYS ON WHEN DRIVING	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE

KM8JN12D75U	6/21/05	19473	30.96		RECALL 06-01-001 ECM REPROGRAM	KC	ESC ECM REPROGRAMMING ESC ECM REPROGRAMMING
KM8JN12D75U	6/21/05	19473	30.96		RECALL 07-01-001 AIRBAG COVER	KC	DRIVER AIRBAG MODULE REPLACEMENT DRIVER AIRBAG MODULE REPLACEMENT
KM8JN12D75U	6/21/05	19473	30.96		CUST STATES THE BRAKE LIGHT STAY ON ALL THE TIME	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B56U	7/11/05	14960	30.34	BOTH BRAKES LIGHTS OUT. INTERNAL FAULT. REPLACED STOP LAMP SWITCH	C-S BOTH BRK LIGHTS OUT (ADVISE)	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B56U	7/11/05	14960	30.34	BOTH BRAKES LIGHTS OUT. INTERNAL FAULT. REPLACED STOP LAMP SWITCH	C-S BOTH BRK LIGHTS OUT (ADVISE)	F	SCAN TOOL CODE SCAN TOOL CODE
KM8JM12B56U	7/11/05	14960	30.34	BOTH BRAKES LIGHTS OUT. INTERNAL FAULT. REPLACED STOP LAMP SWITCH	C-S BOTH BRK LIGHTS OUT (ADVISE)	F	SUBLET REPAIRS
KM8JN12D75U	6/21/05	19473	30.96			F	2 DAYS 5NMSH13E37H052912.
KM8JN12D75U	6/21/05	19473	30.96		CUST ATATES THE ESP AND THE RED BRAKE LIGHT ON THE DASH WAS STAYING ON	F	RELATED TO LINE D NO REPAIRS MADE
KM8JN12D65U	8/26/04	26720	32.48		PERFORM NEEDED RECALLS	KC	ESC ECM REPROGRAMMING ESC ECM REPROGRAMMING
KM8JN12D76U	9/29/05	16320	32.76	ESC LIGHT COMING ON AND OFF. C1513 SWITCH STICKING. REPLACED STOP LAMP SWITCH ASSEMBLY	C-S ESC LIGHT COMING ON/OFF INTERM	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D65U	4/27/05	19360	32.76	ESC/ABS LIGHT FLICK ON AND OFF. C1513 STOP LAMP SWITCH ERROR. REPLACED STOP LAMP SWITCH ASSEMBLY	PARKING BRAKE LEVER (TSB# 05-01-006)	F	PARKING BRAKE LEVER (TSB#05-01-006) PARKING BRAKE LEVER (TSB#05-01-006)
KM8JN12D65U	4/27/05	19360	32.76	ESC/ABS LIGHT FLICK ON AND OFF. C1513 STOP LAMP SWITCH ERROR. REPLACED STOP LAMP SWITCH ASSEMBLY	TUCSON DRIVER AIR BAG MODULE REPLACEMENT	F	TUCSON DRIVER AIR BAG MODULE REPLACEMENT TUCSON DRIVER AIR BAG MODULE REPLACEMENT
KM8JN12D65U	8/26/04	26720	32.48		CUST STATES WHEN VEHICLE IS WARMED UP WHEN SHIFTING GEARS, SEEMS TO BESLIPPING AND CLUNKS HARD	C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12DX6U	7/29/05	30603	30.13		CUST STATES ESC LIGHT COME ON AND TRANS SHIFT HARD AND CAR WILL STALL OUT	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12DX6U	7/29/05	30603	30.13		NO REPAIRS MADE	F	ADVISED CUSTOMER CAR IS PAST DUE FOR THE 30K SERVICE, ADVISED OF THE IMPORTANCE OF THE SERVICE, DECLINED REPAIRS NO REPAIRS MADE
KM8JN12D65U	4/27/05	19360	32.76	ESC/ABS LIGHT FLICK ON AND OFF. C1513 STOP LAMP SWITCH ERROR. REPLACED STOP LAMP SWITCH ASSEMBLY	UPON INSPECTION FOUND BOTH CRADLE BUSHINGS LOOSE	F	BUSHING-CROSSMEMBER MOUNTING (ALL) RE BUSHING-CROSSMEMBER MOUNTING (ALL) RE
KM8JN12D65U	4/27/05	19360	32.76	ESC/ABS LIGHT FLICK ON AND OFF. C1513 STOP LAMP SWITCH ERROR. REPLACED STOP LAMP SWITCH ASSEMBLY	C-S ESC/ABS LIGHTS FLICK ON AND OFF INTERM.	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12DX6U	9/09/05	10853	55.54	ESC LIGHT COMES ON WHILE DRIVING. SCAN FOR CODES. P1513 REPLACED STOP LIGHT SWITCH ASSEMBLY	C/S ESC LIGHT COMES ON WHILE DRIV SOP RO 212198 06/20/07 10732 TEC 46	F	SCAN TOOL CODE. P1513 REPAIR WIRING
KM8JN12D65U	9/20/04	35392	248.85	USED ANOTHER TUCSON COMPARED VOLTAGE & RESISTANCE AT CRUISE CONTROL MODULE. BOTH ARE THE SAME. CK VOLTAGES WHILE DRIVING, PIN 1 VOLTAGE DROPS TO 2 VOLTS WHEN CRUISE IS SET.	CUST STTAE THE CC IS INOP AGAIN	15	X TIME TO DIAG AND MAKE ALL ADJUSTMENTS X TIME TO DIAG AND MAKE ALL ADJUSTMENTS
KM8JN12D65U	9/20/04	35392	248.85	USED ANOTHER TUCSON COMPARED VOLTAGE & RESISTANCE AT CRUISE CONTROL MODULE. BOTH ARE THE SAME. CK VOLTAGES WHILE DRIVING, PIN 1 VOLTAGE DROPS TO 2 VOLTS WHEN CRUISE IS SET.	CUST STTAE THE CC IS INOP AGAIN	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D65U	9/20/04	35392	248.85	USED ANOTHER TUCSON COMPARED VOLTAGE & RESISTANCE AT CRUISE CONTROL MODULE. BOTH ARE THE SAME. CK VOLTAGES WHILE DRIVING, PIN 1 VOLTAGE DROPS TO 2 VOLTS WHEN CRUISE IS SET.	CRUISE ACTUATOR ASSY	15	ACTUATOR ASSY-CRUISE. CONTROL RE ACTUATOR ASSY-CRUISE CONTROL RE
KM8JN12DX6U	9/09/05	10853	55.54	ESC LIGHT COMES ON WHILE DRIVING. SCAN FOR CODES. P1513 REPLACED STOP LIGHT SWITCH ASSEMBLY	C/S ESC LIGHT COMES ON WHILE DRIV SOP RO 212198 06/20/07 10732 TEC 46	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B95U	6/03/05	25598	32.76	ESC OFF LIGHT ON. STICKING. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S CK ENG LIGHT ON SOP RO 220955 101907 AT 25498 TEC 86	F	THERMOSTAT HOUSING ASSY AND/OR GASKET RE THERMOSTAT HOUSING ASSY AND/OR GASKET RE
KM8JM12B95U	6/03/05	25598	32.76	ESC OFF LIGHT ON. STICKING. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S AT TIMES ESC OFF LIGHT ON AT TIMES	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D65U	9/20/04	35392	248.85	USED ANOTHER TUCSON COMPARED VOLTAGE & RESISTANCE AT CRUISE CONTROL MODULE. BOTH ARE THE SAME. CK VOLTAGES WHILE DRIVING, PIN 1 VOLTAGE DROPS TO 2 VOLTS WHEN CRUISE IS SET.	CUST STATES THE WATER IS STILL GETTING ON THE PASS FT FLOOR	X	REPAIRED BY WATER DOCTOR SUBLET NO CHARGE
KM8JM12B76U	7/20/05	26257	31.56		ECS LIGHT ON SOP TECH 461	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D55U	9/11/04	7430	30.9				
KM8JN12D66U	7/12/05	13412	50.3		ESC OFF LIGHT ON	C1513	R&R BRAKE LIGHT SWITCH AND CLEAR CODES
KM8JN12D46U	8/31/05	16402	32.76	ESC LIGHT ON. OPEN CIRCUIT. REPLACED STOP LAMP SWITCH ASSEMBLY	TUCSON DRIVER AIR BAG MODULE REPLACEMENT	F	TUCSON DRIVER AIR BAG MODULE REPLACEMENT TUCSON DRIVER AIR BAG MODULE

KM8JN12D46U	8/31/05	16402	32.76	ESC LIGHT ON. OPEN CIRCUIT. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S LT REAR DOOR WEATHER STRIP COMING APART SOP HERE	E	REAR DOOR BODY SIDE WEATHER STRIP (LH) RE REAR DOOR BODY SIDE WEATHER
KM8JN12D46U	8/31/05	16402	32.76	ESC LIGHT ON. OPEN CIRCUIT. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S ESC LIGHT ON AT TIMES	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12DX6U	8/08/05	11500	30.8		C/S ESC LIGHT STAYS ON EVEN AFTER SHE MASHES THE BUTTON	C1513 BRAKE SWITCH CIRCUIT	REPLACE BRAKE SWITCH HDS SCAN OPERATION
KM8JN12D66U	7/12/05	31722	29.16	REPLACED SWITCH AND VERIFIED REPAIR	CUSTOMER STATES ESC OFF LAMP ON IN DASH IF YOU TURN KEY OFF AND RESTART LAMP GOS OFF	C1513 OPEN BRAKE LAMP SWITCH	REPLACED SWITCH AND VERIFIED REPAIR
KM8JM12B36U	8/29/05	9185	30.8		ECS LIGHT IS ON S/ORDER PART HERE	BAD CONNE IN BRAKE LIGHT SWITCH	R R STOPLAMP SWITCH
KM8JN12D46U	8/31/05	16402	32.76	ESC LIGHT ON. OPEN CIRCUIT. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S CLEAR COAT ON HOOD FLACKING OFF	E	SUBLET REPAIRS
KM8JN12D46U	8/31/05	16402	32.76	ESC LIGHT ON. OPEN CIRCUIT. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S CLEAR COAT ON HOOD FLACKING OFF	E	REFINISHED HOOD REFINISHED HOOD
KM8JN12D46U	8/31/05	16402	32.76	ESC LIGHT ON. OPEN CIRCUIT. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S CLEAR COAT ON HOOD FLACKING OFF	E	SUBLET TO REFINISH LEFT FENDER SUBLET TO REFINISH LEFT FENDER
KM8JN12D25U	6/03/05	18330	28.84		CUSTOMER STATES AFTER DEER HIT CAR CAR REPAIRED BUT CHECK ENGINE LAMP ON	OPEN BRAKE LAMP SWITCH C1513	REPLACED SWITCH AND VERIFIED REPAIR
KM8JM12B26U	9/07/05	27435	48.34	DTC C1513 OPEN BRK SWITCH. REPLACED SWITCH AND VERIFIED REPAIR			
KM8JN72D26U	7/27/05	23010	25.65		CUSTOMER STATES ESC OFF LIGHT COMES ON	FOUND DTC C1513 STOP LAMP SWITCH.	ADJUSTED STOP LAMP SWITCH PER MANUAL. CHECKED OPERATION. BRAKE LIGHTS WORKING.
KM8JN12D46U	8/31/05	16402	32.76	ESC LIGHT ON. OPEN CIRCUIT. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S CLEAR COAT ON HOOD FLACKING OFF	E	SUBLET TO REFINISH RITH SUBLET TO REFINISH RITH
KM8JM12B86U	7/13/05	32112	32.3		C/S ESC LIGHT FLASHES ON/OFF	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B86U	7/13/05	32112	32.3		C/S ESC LIGHT FLASHES ON/OFF	F	SUBLET REPAIRS
KM8JM12BX5U	2/25/05	42966	54.43	ESC OFF LIGHT STAYS ON. SCAN CODE C1513 STOP LAMP SWITCH FAILED. REPLACED	TUCSON DRIVER AIR BAG MODULE REPLACEMENT	F	TUCSON DRIVER AIR BAG MODULE REPLACEMENT TUCSON DRIVER AIR BAG MODULE
KM8JN72D26U	7/27/05	23010	25.65		CUST STATES WASHER PUMP INOP	FOUND WASHER PUMP NOT SPRAYING WHEN SWITCH PUSHED.	REPLACED WASHER PUMP ASSEMBLY.
KM8JN72D26U	7/27/05	23010	25.65		CUSTOMER STATES GLASS ON INSTRUMENT CLUSTER IS CRACKED	FOUND GLASS FOR INSTRUMENT CLUSTER FOGGING AND CRACKED.	REPLACED INSTRUMENT CLUSTER GLASS.
KM8JN72D56U	7/26/05	28201	34.99	C/S CHECK ENGINE LIGHT ON SOP FOUND C1513 BRAKE LAMP SWITCH ERROR. FOUND BRAKE LAMP SWITCH INTERNALLY SHORTED. REPLACED BRAKE LAMP SWITCH.	C/S CHECK ENGINE LIGHT ON SOP	FOUND C1513 BRAKE LAMP SWITCH ERROR. FOUND BRAKE LAMP SWITCH INTERNALLY SHORTED.	REPLACED BRAKE LAMP SWITCH.
KM8JM12BX5U	2/25/05	42966	54.43	ESC OFF LIGHT STAYS ON. SCAN CODE C1513 STOP LAMP SWITCH FAILED. REPLACED	C/S ESC OFF LIGHT STAYS ON AT TIMES	F	ATT TIME FOR DAG OF BAD SWITCH REPAIR WIRING
KM8JM12BX5U	2/25/05	42966	54.43	ESC OFF LIGHT STAYS ON. SCAN CODE C1513 STOP LAMP SWITCH FAILED. REPLACED	C/S ESC OFF LIGHT STAYS ON AT TIMES	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D46U	12/23/05	21373	55.54	ESC LIGHT ON. TRACED WIRING. CODE B1315. REPLACED STOP LAMP SWITCH. STICKING.	TUCSON DRIVER AIR BAG MODULE REPLACEMENT	F	TUCSON DRIVER AIR BAG MODULE REPLACEMENT TUCSON DRIVER AIR BAG MODULE
KM8JN12D46U	9/29/05	34859	35.31	CUST STATES CHECK ENGINE LIGHT IS ON SCAN TESTED AND FOUND DTC C1513 BRAKE LAMP SWITCH INOP REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES THERE IS AN ISSUE WITH THE TRANSMISSION. TRANSMISSION STALLS, SPEEDS UP AND CHUGS.	FOUND TPS SIGNAL ERRATIC WHEN GRAPHED ON TEST DRIVE. GRAPH ON TPS NOT CONSISTANT.	REPLACED TPS SENSOR AND RESET ADAPTIVE VALUES.
KM8JN12D46U	9/29/05	34859	35.31	CUST STATES CHECK ENGINE LIGHT IS ON SCAN TESTED AND FOUND DTC C1513 BRAKE LAMP SWITCH INOP REPLACED BRAKE LAMP SWITCH	TECH NOTED ECS LIGHT ON	FOUND BRAKE LAMP SWITCH CODE. C1513.	REPLACED BRAKE LAMP SWITCH.
KM8JN12D46U	12/23/05	21373	55.54	ESC LIGHT ON. TRACED WIRING. CODE B1315. REPLACED STOP LAMP SWITCH. STICKING.	C/S ESC LIGHT ON AT TIMES SOP RO 210945 06/06/07 18607 TEC 46	F	ADDITIONAL TIME TO USE SCAN TOOL TO DIAG BAD SWITCH REPAIR WIRING
KM8JN12D46U	12/23/05	21373	55.54	ESC LIGHT ON. TRACED WIRING. CODE B1315. REPLACED STOP LAMP SWITCH. STICKING.	C/S ESC LIGHT ON AT TIMES SOP RO 210945 06/06/07 18607 TEC 46	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D76U	1/20/06	25900	25.65	CUSTOMER STATES ESC LIGHT ON. SCAN TESTED FOUND DTC C1513 BRAKE LIGHT SWITCH. READJUSTED AND CHECKED BRAKE LIGHT OPERATION. SWITCH AND LIGHTS WORKING. CLEARED CODES AND TEST DROVE VEHICLE.	CUST STATES ESC LIGHT ON	SCAN TESTED FOUND DTC C1513 BRAKE LIGHT SWITCH.	RE-ADJUSTED AND CHECKED BRAKE LIGHT OPERATION. SWITCH AND LIGHTS WORKING. CLEARED CODES AND TEST DROVE VEHICLE.
KM8JN12D76U	1/20/06	25900	25.65	CUSTOMER STATES ESC LIGHT ON. SCAN TESTED FOUND DTC C1513 BRAKE LIGHT SWITCH. READJUSTED AND CHECKED BRAKE LIGHT OPERATION. SWITCH AND LIGHTS WORKING. CLEARED CODES AND TEST DROVE VEHICLE.	CUST STATES PASSENGER SIDE WINDOW WILL NOT ROLL DOWN	FOUND WEATHER STRIP TANGLED IN WINDOW TRACK.	REMOVED DOOR PANEL AND UNTANGLED WEATHER STRIP. WINDOW WORKING WITHOUT INTERFERENCE.
KM8JN12D76U	12/14/05	9951	34.25		CUSTOMER REPORTS ESC LIGHT ON	R&R FAILED BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D56U	8/16/05	15552	32.76	ESC/LIGHT ON INTERMITTEN. SCAN CODES. C1513 SHORTED. REPLACED STOP LAMP SWITCH ASSEMBLY	TUCSON DRIVER AIR BAG MODULE REPLACEMENT	F	TUCSON DRIVER AIR BAG MODULE REPLACEMENT TUCSON DRIVER AIR BAG MODULE REPLACEMENT
KM8JN12D56U	8/16/05	15552	32.76	ESC/LIGHT ON INTERMITTEN. SCAN CODES. C1513 SHORTED. REPLACED STOP LAMP SWITCH ASSEMBLY	C-S ESC LIGHT ON/OFF INTERM	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE

KM8JN12DX6U	1/19/06	30080	32.76	ESC LIGHT COMING ON. SWITCH FAILED. REPLACED STOP LAMP SWITCH	C/S AT TIMES ESC LIGHT ON	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D66U	8/16/05	22024	30.34	AT TIMES ESC LIGHT OFF COMES ON. BRAKE SWITCH BROKEN. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S CREAKING NOISE ON TURNING FRONTEND	F	BUSHING-CROSSMEMBER MOUNTING (ALL) RE BUSHING-CROSSMEMBER MOUNTING (ALL) RE
KM8JN12DX5U	5/24/05	9570	40.7		CUST STATES THE TCS FLICKER ON AND OFF SOMETIMES	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D15U	6/30/05	26125	39.06		CUST STATES THAT ENGINE CUTTS OFF AT IDLE ... CHECK	F	SENSOR ASSY-THROTTLE POSITION RE SENSOR ASSY-THROTTLE POSITION RE
KM8JN72D15U	6/30/05	26125	39.06		CUST STATES THAT ENGINE CUTTS OFF AT IDLE ... CHECK	F	SENSOR ASSY-THROTTLE POS ADD SCAN TOOL OPERATION SENSOR ASSY-THROTTLE POS ADD SCAN TOOL OPERATION
KM8JN72D15U	6/30/05	26125	39.06		CUST STATES 'ESP' LIGHT GOES ON AND OFF ...	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D66U	8/16/05	22024	30.34	AT TIMES ESC LIGHT OFF COMES ON. BRAKE SWITCH BROKEN. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S AT TIMES ESC LIGHT OFF LIGHT COMES ON WONT GO OFF HITTING BUTTON	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B75U	6/22/05	35150	30.34	ESP LIGHT ON AND OFF INTERMITTENTLY. INTERNAL FAULT. REPLACED STOP LAMP SWITCH ASSEMBLY	TUCSON DRIVER AIR BAG MODULE REPLACEMENT	F	TUCSON DRIVER AIR BAG MODULE REPLACEMENT TUCSON DRIVER AIR BAG MODULE REPLACEMENT
KM8JN72DX5U	5/26/05	24011	39.06		CUST STATES THE 'ESP' LIGHT KEEPS COMING ON AND OFF ... (SOMETIMES / SPORADIC) ... CUST PUSH THE BUTTON BUT STILL COMES ON ...	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D26U	7/19/05	9739	40.7		CUST STATES THE TRANS SLIPS IN ALL GEARS AT ALL SPEEDS...	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D96U	10/13/05	8286	40.7		CUST STATES THE 'TCS' LIGHT STAYS ON ... IT DOESN'T GO WITH THE SWITCH ... //	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B75U	6/22/05	35150	30.34	ESP LIGHT ON AND OFF INTERMITTENTLY. INTERNAL FAULT. REPLACED STOP LAMP SWITCH ASSEMBLY	C-S ESP LIGHT ON AND OFF INTERM	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12DX7U	11/07/06	123	32.76	BRAKE LIGHTS INOP. SWITCH STICKING. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S BRAKE LIGHTS INOP AT TIMES	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B05U	6/21/05	18274	32.3		C/S ESP LIGHT IS ON S O P	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B05U	6/21/05	18274	32.3		C/S ESP LIGHT IS ON S O P	F	SUBLET REPAIRS
KM8JN72D25U	6/09/05	17479	39.06		CUST STATES THE 'ESP' OFF LIGHT KEEPS COMING ON AND OFF ...	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B86U	7/09/05	15409	39.06		CUST STATES THE ESC LIGHT COMES ON SOMETIMES	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D95U	6/11/05	13555	39.06		CUST STATES THE 'ESP' LIGHT KEEPS COMING ON AND OFF ... ///	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B16U	8/26/05	29324	32.76	ESC OFF LIGHT ON. SWITCH STICKING. REPLACED STOP LAMP SWITCH ASSEMBLY	TUCSON DRIVER AIR BAG MODULE REPLACEMENT	F	TUCSON DRIVER AIR BAG MODULE REPLACEMENT TUCSON DRIVER AIR BAG MODULE
KM8JM12B16U	8/26/05	29324	32.76	ESC OFF LIGHT ON. SWITCH STICKING. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S ESC OFF LIGHT ON AT TIMES	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B45U	6/17/05	9182	32.3		ESC (OR ESP) ELEC CONTR MOD REPRG CAMP 922	F	ESC (OR ESP) ELEC CONTR MOD REPRG CAMP 922 ESC (OR ESP) ELEC CONTR MOD REPRG CAMP 922
KM8JN72D85U	6/10/05	26821	38.74		CUST STATES THE 'ESP' LIGHT KEEPS COMING ON AND OFF ... (SPORADICALLY) ...	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM72B25U	6/17/05	30970	39.06		CUST STATES CHECK ENGINE LIGHT IS ON	F	IDLE SPEED ACTUATOR ASSY RE IDLE SPEED ACTUATOR ASSY RE
KM8JM72B25U	6/17/05	30970	39.06		RSVD LOANER	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D35U	6/20/05	18416	40.7		CUST STATES THE 'ESP' LIGHT STAYS ON THE CAR ... * S O P *	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B45U	6/17/05	9182	32.3		C/S ESP LIGHT IS ON	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B96U	2/15/06	30004	32.76	ESC LIGHT ON/OFF INTERMITTENT. SWITCH STICKING. REPLACED STOP LAMP SWITCH ASSEMBLY	C-S ESC LIGHT ON/OFF INTERM	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B76U	9/14/05	27956	32.44	ESC LIGHT COMES ON. INTERNAL FAULT. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S ESC LIGHT COMES ON AT TIMES SOP RO 212783 06/27/07 25679 TEC 68	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B65U	6/03/05	9809	38.3		CUST STATES CHECK ENGINE LIGHT IS ON	F	CANISTER CLOSE VALVE RE CANISTER CLOSE VALVE RE
KM8JM12B65U	6/03/05	9809	38.3		CUST STATES CHECK ENGINE LIGHT IS ON	F	CANISTER CLOSE VALVE ADD SCAN TOOL OPERATION CANISTER CLOSE VALVE ADD SCAN TOOL OPERATION
KM8JM12B65U	6/03/05	9809	38.3		CUST STATES THE 'TCS' LIGHT CAME ON....	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D76U	8/16/05	39525	30.34	ESC LIGHT ON. BRAKE LIGHT SWITCH BAD RESISTANCE. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S CAR IS STALLING OUT AND HAS A LOW IDLE AND OCCURS AFTER THE CAR IS WARM	F	THROTTLE POSITION SENSOR ASSY RE THROTTLE POSITION SENSOR ASSY RE
KM8JN12D76U	8/16/05	39525	30.34	ESC LIGHT ON. BRAKE LIGHT SWITCH BAD RESISTANCE. REPLACED STOP LAMP SWITCH ASSEMBLY	C/S CAR IS STALLING OUT AND HAS A LOW IDLE AND OCCURS AFTER THE CAR IS WARM	F	THROTTLE POSITION SENSOR ADD SCAN TOOL OPERATION THROTTLE POSITION SENSOR ADD SCAN TOOL OPERATION
KM8JN12D76U	8/16/05	39525	30.34	ESC LIGHT ON. BRAKE LIGHT SWITCH BAD RESISTANCE. REPLACED STOP LAMP SWITCH ASSEMBLY	TUCSON DRIVER AIR BAG MODULE REPLACEMENT	F	TUCSON DRIVER AIR BAG MODULE REPLACEMENT TUCSON DRIVER AIR BAG MODULE REPLACEMENT
KM8JM12B76U	8/09/05	19057	39.06		CUST STATES ESC LIGHT IS ON	C	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D95U	6/13/05	12767	36.06				

KM8JN72D95U	6/16/05	33582	39.06		CUST STATES THAT THE 'ESP' LIGHT COMES ON AND OFF ..SOMETIMES .//	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B56U	8/09/05	9385	38.3		CUST STATES THE ESC LIGHT COMES ON AND OFF	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D76U	8/16/05	39525	30.34	ESC LIGHT ON. BRAKE LIGHT SWITCH BAD RESISTANCE. REPLACED STOP LAMP SWITCH ASSEMBLY	CUST STATES CHECK ENGINE LIGHT IS ON CHECK AND ADVISE	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B36U	7/13/05	33992	30.34	BRAKE LIGHTS STAY ON. SWITCH STICKING. REPLACED STOP LAMP SWITCH	C/S BRAKE LIGHTS STAY ON	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B26U	11/28/05	27521	32.3	ESC OFF LIGHT KEEPS COMING ON BY ITSELF. BRAKE LIGHT SWITCH FAILED. REPLACED	C-S ESC OFF LIGHT KEEPS COMING ON BY ITSELF (HAPPENING MORE AND MORE OFTEN)	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D85U	6/10/05	26718	39.06		079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	F	DRIVER SIDE AIRBAG MODULE DRIVER SIDE AIRBAG MODULE
KM8JN12D85U	6/10/05	26718	39.06		CUST STATES ESC LIGHT COMES ON (SEEKIM BUSH) KEEPS COMING ON AND OFF.	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D66U	1/03/06	9638	38.74		CUST STATES THE ESC LIGHT IS SHOWING ON THE DASH.	F	SWITCH ASSY-ESP SWITCH ASSY-ESP
KM8JN12D46U	12/15/05	13612	32.76	ESC LIGHT ON. SCAN TOOL C1513 ERROR. REPLACED STOP LAMP SWITCH	C-S ESC LIGHT ON INTERM	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B35U	5/14/05	18399	30.34	ESP LIGHT ON INTERMITTENTLY WHILE DRIVING. SWITCH FAILED. REPLACED STOP LAMP SWITCH	TUCSON DRIVER AIR BAG MODULE REPLACEMENT	F	TUCSON DRIVER AIR BAG MODULE REPLACEMENT TUCSON DRIVER AIR BAG MODULE
KM8JM12B35U	5/14/05	18399	30.34	ESP LIGHT ON INTERMITTENTLY WHILE DRIVING. SWITCH FAILED. REPLACED STOP LAMP SWITCH	UPON INSPECTION PASS SIDE CRADLE BUSHING LOOSE	F	REPLACED RIGHT SIDE BUSHING ONLY REPLACED RIGHT SIDE BUSHING ONLY
KM8JN12D66U	1/03/06	9638	38.74		I NEED MY CAR BY THIS TIME PLEASE HAVE CUST SIGN TICKET FOR SPECIFIC	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72DX6U	7/22/05	34068	31.35	CUST STATES THE ESC LIGHT HAS BEEN COMING ON. TECH FOUND NO SIGNAL FROM SWITCH TO ECM. TECH R AND R STOP LAMP SWITCH FOR INTERNAL	CUST STATES THAT THE ESC LIGHT HAS BEEN COMING ON AND OFF IS NOT ON AT THIS TIME	OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D56U	10/28/05	32065	31.67	CUST STATES THE ESC LIGHT IS ON. TECH PERFORMED SYSTEM TEST. CODES C1513, C1237, TECH R AND R BRAKE SWITCH. DUE TO INTERNAL FAILURE	CUST STATES THE ESC LIGHT IS COMING ON IF UNDER WARRANTY PLEASE ADVISE	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B35U	5/14/05	18399	30.34	ESP LIGHT ON INTERMITTENTLY WHILE DRIVING. SWITCH FAILED. REPLACED STOP LAMP SWITCH	C-S ESP LIGHT ON INTERM WHILE DRIVING	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B86U	7/12/05	20018	32.74		CUSTOMER STATES ESC LIGHT GOES ON AND OFF	TECH DIAG STATE THAT CODE C1513 BRAKE LAMP SWITCH OPEN CIRCUIT	REPLACE BRAKE LAMP SWITCH AND RESET CODES
KM8JN72D36U	8/18/05	31762	33.06		CUSTOMER STATES ESC LIGHT ON AND OFF	FOUND SHORTED BRAKE LIGHT SWITCH	REMOVED AND REPLACED BRAKE LIGHT SWITCH TESTED TO VERIFY REPAIR
KM8JN12D55U	6/30/05	32371	28.86	COMPLETED HAD CODE 1513 REPLACED BRAKE LIGHT SWITCH			
KM8JN72D65U	5/13/05	40080	30.5		CUSTOMER STATES THE ESP LAMP IS COMING ON (PART IN)	15	STOP LAMP SWITCH ASSY RE SWITCH ASSY-STOP LAMP RE
KM8JN72D96U	9/28/05	16007	28.86	INSTALLED SWITCH			
KM8JN72D16U	12/22/05	312	30.5		CUSTOMER STATES THAT ESC LIGHT COMES ON AND WONT TRN OFF WITH BUTTON UNTILL TRN CAR OFF AND RESET	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D46U	11/19/05	25699	33.06		CUSTOMER STATES ESC LIGHT KEEPS GOING ON AND OFF	FOUND CODE C1513 BRAKE SWITCH SHORTED AND CODE C11237 PRIMARY PRESSURE SENSOR SHORTED	REMOVED AND REPLACED STOP LAMP SWITCH AND ORDERED PRESSURE SWITCH. TESTED TO VERIFY REPAIR ON STOP LAMP SWITCH
KM8JN12D65U	5/21/05	31377	32.74		CUSTOMER STATES THE ESP LIGHT COMES ON WHEN DRIVING AT TIMES PART IS ORDERED FOR THIS CONCERN.	CODE STORED, C1513 INTERNAL MALFUNCTION IN STOP LAMP SWITCH	REPLACED SWITCH AND CHECKED OPERATION.
KM8JN12D65U	5/21/05	31377	32.74		CUSTOMER STATES THE VEHICLE HAS A SLOW CRANK WHEN STARTING.	BATTERY FAILED TEST.	REPLACED THE BATTERY AND CHECKED OPERATION.
KM8JM12B76U	7/12/05	30124	28.86				
KM8JN12D55U	6/13/05	18880	28.86	COMPLETED HAD CODE C1513 OPEN CIRCUIT REPLACED BRAKE LIGHT SWITCH			
KM8JN72D76U	1/23/06	17496	28.54	SCAN TESTED, C1513 BRAKE SENSOR. BRAKE SWITCH INTERMITTENT. REMOVED AND REPLACED BRAKE SWITCH. H. CLEARED CODE.			
KM8JN12D65U	5/21/05	31377	32.74		CUSTOMER STATES THERE IS A NOISE FROM THE ENGINE AREA WHEN TURNING LEFT AND RIGHT, CHECK AND ADVISE.	NOISEY STEERING GEARBOX.	PART IS ORDERED FOR THIS CONCERN.
KM8JN12D06U	1/03/06	8926	33.06		REAR BRAKE LIGHTS OUT	STOP LIGHT SWITCH	CONFIRM CONCERN AND REPLACED STOP LIGHT SWITCH
KM8JM12B76U	7/13/05	4197	34.7		CUSTOMER STATES HAVING TO FORCE SHIFTER INTO REVERSE-INSTALL SOP	SHORTED STOP LAMP SWITCH	REPLACE STOP LAMP SWITCH
KM8JM72B16U	11/08/05	8514	30.5		CUSTOMER STATES THAT ESP LIGHT COMING ON AND OFF PART HERE	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE COMPLETED HAD CODE 1511 REPLACED BRAKE SWITCH
KM8JN72D26U	9/28/05	29658	28.54	SCAN TESTED, P1506. REMOVED AND REPLACED BRAKE SWITCH.			
KM8JM72B16U	11/08/05	17897	28.86	INSPECTED AND FOUND BRAKE SWITCH INPUT IS OPEN DIAG TO HAVE SHORTED BRAKE SWITCH. REMOVED AND REPLACED BRAKE PEDAL SWITCH			
KM8JN72D66U	10/12/05	39907	28.86				

KM8JN12D76U	2/03/06	13298	33.06	DIAG. REPLACED SWITCH AND CHECKED OPERATION.	CUSTOMER STATES THE ESC LIGHT COMES ON WHILE DRIVING AT TIMES, CHECK AND ADVISE.	INTERNAL SHORT IN BRAKE SWITCH	DIAG. REPLACED SWITCH AND CHECKED OPERATION.
KM8JN12D85U	7/08/05	13651	34.7		CUSTOMER STATES "ESP" LIGHT IS ILLUMINATING FREQUENTLY-SCAN/CHECK-ADVISE	DIAGNOSED STOP LAMP SWITCH WITH INTERMITTANT OPEN CIRCUIT CODE C1513/SCANNED SYSTEMS-CLEARED CODES	INSTALLED STOP LAMP SWITCH/CHECKED SWITCH ADJUSTMENT RESCANED GOOD-TESTED GOOD
KM8JM12B96U	7/09/05	26477	32.74				
KM8JN72D75U	5/23/05	40868	28.86	COMPLETED REPLACED BRAKE LIGHT SWITCH HAD CODE 1513			
KM8JN12D85U	9/13/04	17479	28.26		CUSTOMER STATES THAT CRUISE INOP PART HERE	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D56U	9/23/05	24500	28.54	COMPLETED HAD CODE C1513 B H SWITCH HAD OPEN SHORT REPLACED BRAKE SWITCH	CUSTOMER STATES THAT ESC LIGHT CAME ON WOULD NOT GO OFF UNTIL CAR WASH SHUT OFF	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE COMPLETED HAD CODE C1513 B H SWITCH HAD OPEN SHORT REPLACED BRAKE SWITCH
KM8JN12D55U	1/25/05	33793	31.35		CUSTOMER STATES RUBBER OVER FRONT PASS WHEEL FALLING OFF	FOUND FRONT RIGHT WHEEL RUBBER MOLDING SEPARATING	REMOVED AND REPLACED MOLDING TESTED TO VERIFY REPAIR
KM8JN12D55U	1/25/05	33793	31.35		CUSTOMER STATES CRUISE INOP	FOUND CODE C1513 ABS/TCS/EPS SHORTED, STOP LAMP SWITCH	REMOVED AND REPLACED STOP LAMP SWITCH TESTED TO VERIFY REPAIR
KM8JN12D55U	1/25/05	33793	31.35		CUSTOMER STATES WASHERS INOP	FOUND PUMP CLOGGED	REMOVED PUMP AND UNCLOGGED TESTED TO VERIFY REPAIR
KM8JN72D36U	11/11/05	26787	28.86	COMPLETED REPLACED BRAKE LIGHT SWITCH HAD OPEN SHORT			
KM8JN72D45U	6/09/05	46442	28.86	SCAN TESTED AND FOUND P1513 BRAKE LAMP SWITCH ERROR CODE. FOUND SWITCH HAS AN INTERMITTED SHORT. DIAG AND REPLACED BRAKE LAMP SWITCH.			
KM8JN72D96U	7/27/05	25517	35.74				
KM8JN12D26U	1/13/06	12539	35.74				
KM8JN12D75U	5/25/05	7855	34.7		CUSTOMER STATES ENGINE DIED @ IDLE ALL LIGHT ON THE DASH BOARD CAME ON RESTARTED VEH DROVE A COUPLE OF MILES TOW-IN CK & ADVISE SEE HISTORY	TEST DROVE, RAN FLIGHT RECORD, VEHICLE STALLED AT STOP WITHOUT RECYCLING THE KEY, STARTED RIGHT BACK UP. ESP OFF LIGHT STAYS ON, HOLDS CODE C1513, CALLED TECH LINE, CASE #226674. CHECKED GROUND #G08, OK, CHECKED BRAKE LAMP SWITCH, FAULTY SWITCH, OPEN CIRC	REPLACED BRAKE LAMP STOP SWITCH, SYSTEM WORKS NORMAL ROAD TESTED VEHICLE DID NOT STALL OUT
KM8JN12D75U	5/25/05	7855	34.7		LINE ADDED TO FIT NEW DCS SYSTEM		
KM8JM12B96U	7/22/05	13128	34.7		CUSTOMER STATES ESC LIGHT WILL NOT EXTINGUISH-CHECK AND ADVISE	DIAGNOSED STOP LAMP SWITCH INTERNAL CIRCUIT MALFUNCTION SCANNED SYSTEMS-NO HISTORY OR PRESENT CODES TESTED BRAKE LAMP OPERATION ///INTERMITTANT OPEN CIRCUIT	INSTALLED NEW BRAKE LAMP STOP SWITCH//RETESTED GOOD NO FURTHER PROBLEMS FOUND
KM8JM12B96U	12/02/05	17137	35.74				
KM8JN12D77U	1/19/07	1447	36.06				
KM8JN12D16U	9/26/05	29087	36.06				
KM8JN72D76U	7/25/05	31884	36.06				
KM8JN12D66U	9/28/05	39544	33.06		CUSTOMER STATES THERE IS A CLUNK NOISE HEARD FROM THE TRANS AREA WHEN SHIFTING INTO REVERSE, PART IS ORDERED FOR THIS CONCERN.	CRADLE BUSHINGS NOISEY	CONFIRM CONCERN AND REPLACED SUBFRAME BUSHINGS
KM8JM12B96U	7/12/05	22963	33.06		CUSTOMER STATES ESC LIGHT STAYS ON- INSTALL SOP PARTS- BRAKE LIGHT SWITCH	FOUND CODE C1513 OPEN IN STOP LAMP CIRCUIT	REMOVED AND REPLACED STOP LAMP SWITCH TESTED TO VERIFY REPAIR
KM8JM12B26U	7/13/05	42729	32.74		CUSTOMER STATES BRAKE LIGHT STAYED ON SOP	INTERNAL SHORT IN BRAKE SWITCH	REPLACED SWITCH AND CHECKED OPERATION.
KM8JN12D36U	11/18/05	8008	34.7		CUSTOMER STATES ECS LIGHT IS ON AT TIMES (SOP IS IN)	BRAKE LIGHT SWITCH	DIAGNOSIS AND REPLACED BRAKE LIGHT SWITCH
KM8JM12B86U	7/22/05	16540	34.7		CUSTOMER STATES ESC LIGHT STAYS ON AT TIMES AND CANNOT BE CONTROLLED BY SWITCH	BRKE LIGHT SWITCH FAILURE	VERIFIED CUSTOMER CONCERN AND R AND R BRAKE LIGHT SWITCH VERIFIED REPAIR
KM8JN12D85U	11/03/04	2456	54.27	ESC LIGHT WAS ON. FOUND CODE C1513.NO SCAN TOOL OP FOR THIS PART. USED .3 TT TIME FOR SCAN TOOL.			
KM8JN12D36U	11/08/05	20492	32.74		CUSTOMER STATES THE ABS LIGHT IS ON AND THE ESC OFF LIGHT IS DISPLAYED WHILE DRIVING, PART IS ORDERED FOR THIS CONCERN.	CODE STORED, C1513 BRAKE LIGHT SWITCH	DIAG. REPLACED THE BRAKE LIGHT SWITCH, CLEARED CODES, AND TEST DROVE 5 MILES. CHECKED OKAY
KM8JN12D36U	11/08/05	20492	32.74		CUSTOMER STATES THE PASSENGER SUNVISOR IS MISSING THE HOLD CLIP, PART IS ORDERED FOR THIS CONCERN.	CLIP BROKE	REPLACED AND CHECKED
KM8JN12D15U	5/24/05	26646	34.7		CUSTOMER STATES "ESP" LIGHT IS ON -CHECK/SCAN -ADVISE	SCANNED SYSTEMS FOR CODES- FOUNF C1513 (DIAGNOSED AS OPEN CIRCUIT IN BRAKE LIGHT SWITCH)	REPLACED BRAKE LIGHT SWITCH- RETESTED GOOD
KM8JM72B86U	12/09/05	30193	57.66	CUSTOMER STATES ESC LIGHT COMES ON AT TIMES. FOUND CODE C1513. REPLACED BRAKE LIGHT SWITCH. USED .3 TT TIME FOR PERFORMING SCAN TOOL, NO SCAN TOOL OR GDS OP CODES AVAILABLE FOR THIS	CUSTOMER STATES ESC LIGHT COMES ON AT TIMES	BRAKE LIGHT SWITCH FAILURE	VERIFIED CONCERN C1513 DIAG AND REPLACED BRAKE LIGHT SWITCH RETEST OK

KM8JN12D16U	9/24/05	45916	56.14	CUSTOMER STATES ESC LIGHT COMES ON AT TIMES WHILE DRIVING. FOUND CODE C1513. FOUND BRAKE LAIGHT SWITCH INOP. TESTED PIN TENSION AND INSPECTED CONNECTORS. ALL OK. INSTALLED NEW BRAKE LIGHT SWITCH AND TESTED. NO LABOR OP AVAILABLE FOR SCAN TOOL. USED .3 TT	CUSTOMER REQUEST CHECK ESC LIGHT COMES ON AT TIMES WHILE DRIVING	DIAG SYSTEM C1513 TESTED FOUND BRAKE LIGHT SWITCH INOP AT TIMES	PERFORMED PIN TENSION TEST AND INSPECTED CONNECTORS OK NISTALLED NEW BRAKE LIGHT SWITCH AND TESTED OPERATION OK NOW
KM8JM12B35U	3/22/05	20453	31.35				
KM8JM12B66U	12/06/05	17132	32.74		CUSTOMER STATES THAT THE CHECK ENGINE LIGHT IS ON	PO111 CODE STORED UPDATE ECM	CONFIRM AND REPROGRAM PCM TO CORRECT CONCERN
KM8JN12D45U	4/08/05	28324	32.74		CUSTOMER STATES ESC LIGHT ON INSPECT AND ADVISE	CODE STORED, C1513 BRAKE LAMP SWITCH	DIAG. REPLACED SWITCH, CLEARED CODE, AND CHECKED OPERATION.
KM8JN12D15U	4/18/05	27933	33.06		CUSTOMER STATES ESP LIGHT HAS COME ON WHILE DRIVING HAS SINCE GONE OFF	OPEN CIRCUIT IN BRAKE SWITCH ASSEMBLY	REPLACED SWITCH AND CHECKED OPERATION.
KM8JN72D85U	6/13/05	21783	57.66	USED .3 TT TIME FOR GDS OPERATION. NO GDS LABOR OP AVAILABLE FOR THIS PART. CUSTOMER STATES ESC LIGHT IS COMING ON. FOUND CODE C1513 USING GDS.	CUSTOMER REQUEST CHECK ESC LIGHT COMING ON	TROUBLE CODE C1513 BRAKE SWITCH CIRCUIT	REPLACED BRAKE SWITCH AND CLEARED TROUBLE CODE
KM8JN12D86U	9/26/05	21305	56.14	CUSTOMER STATES ESC LIGHT ON DASH IS COMING ON AND OFF. PERFORMED GDS OPECTION. FOUND CODE C1513. BRAK LIGHT SWITCH CIR. FAULTY. REPLACED BRAKE LAMP SWITCH. USED .3 TT TIME FOR PERFORMING GDS OPERATION, THERE IS NO LABOR OP FOR GDS OR SCAN TOOL FOR THIS P	CUSTOMER STATES THAT ESC LIGHT ON DASH COMING ON AND OFF	TROUBLE CODE C1513.BRAKE SWITCH CIRCUIT.	REPLACED BRAKE LAMP SWITCH
KM8JN12D06U	10/19/05	19578	56.14	CUSTOMER STATES ESC LIGHT IS ON. FOUND CODE C1513. USED .3 TT TIME, NO LABOR OP AVAILABLE FOR SCAN TOOL.	CUSTOMER STATES ESC LIGHT COMING ON	TROUBLE CODE C1513.BRAKE SWITCH CIRCUIT	REPLACED BRAKE LAMP SSWITCH.
KM8JN12D15U	4/18/05	27933	33.06		CUSTOMER STATES A/C WILL BLOW HOT AIR AT TIMES-PLEASE ADVISE	NO PROBLEM FOUND	DIAG. CHECKED OPERATION OF A/C ADND COOLANT, ALL CHECKED OKAY.
KM8JN12D56U	4/06/06	18816	33.06		CUSTOMER STATES ESC LIGHT IS ON AND WILL NOT TURN OFF PLEASE ADVISE	FOUND C1513 SHORT IN BRAKE LIGHT SWITCH	REMOVED AND REPLACED BRAKE LIGHT SWITCH, CLEARED CODES TESTED TO VERIFY REPAIR
KM8JN12D76U	4/14/06	4276	54.94	C/S STEERING ASST WARNING CAME ON ONCE WHEN DRIVING;RAN DIAGNOSTIC AND REPLACED BRAKE LIGHT SWITCH;CLEARED CODES AND ROAD TESTED	CUSTOMER STATES STEERING ASST WARNING CAME ON ONCE WHEN DRIVING / PART IN STOCK	C1573 93810NTT .5 N69 C15 - BRAKE SWITCH 93810ATT .3 N69 C15 - SCAN TOOL OPERATION	RAN SYSTEM DIAGNOSTICS. REPLACED BRAKE LIGHT SWITCH. CLEARED CODES AND ROAD TESTED.
KM8JN12D76U	4/14/06	4276	54.94	C/S STEERING ASST WARNING CAME ON ONCE WHEN DRIVING;RAN DIAGNOSTIC AND REPLACED BRAKE LIGHT SWITCH;CLEARED CODES AND ROAD TESTED	CUSTOMNER STATES A/C SYSTEM IS NOT COLD / PART IN STOCK	97762R00 .3 N89 C38 - DISCHARGE HOSE 09760A00 .5 N89 C38 - EVACUATE AND RECHARGE	REPLACED SUCTION HOSE, EVACUATE AND RECHE FOR PROPER OPERATION
KM8JM12B87U	11/10/06	1337	33.06		CUSTOMER STATES IF THE CRUISE CONTROL IS SET AND THE BRAKE IS APPLIED THE CRUISE CONTROL WILL NOT SHUT OFF AND THE VEHICLE WILL ACCELERATE. CUSTOMER NOTICED THE ESC WILL COME ON WHILE DRIVING AT TIMES, CHECK AND ADVISE.	TECH DIAG STATE THAT STOP LAMP SWITHC STUCK OPEN CIRCUIT	REPLACE STOP LAMP SWITCH AND CLEAR CODE TEST CRUISE CONTROL NO CONCERN AT THIS TIME
KM8JN12D46U	12/26/05	24403	32.74		CUSTOMER STATES THAT THE CHECK ENGINE LIGHT IS ON AND CAR IS BUCKING AND JERKING CHECK AND ADVISE	TEST AND FOUND TPMS SENSOR HAS FAILED	CAUSING CAR TO BUCK AND JERK REMOVED AND REPLACED TPMS SENSOR AND TEST TO VERIFY REPAIR
KM8JN12D46U	12/26/05	24403	32.74		CUSTOMER STATES CHECK ENGINE LIGHT IS ON	TEST AND FOUND INTERNAL FAULT IN STOP LAMP SWITCH	REMOVED AND REPLACED STOP LAMP SWITCH ASSY AND TEST TO VERIFY REPAIR
KM8JN12D76U	4/14/06	4276	54.94	C/S STEERING ASST WARNING CAME ON ONCE WHEN DRIVING;RAN DIAGNOSTIC AND REPLACED BRAKE LIGHT SWITCH;CLEARED CODES AND ROAD TESTED	CUSTOMER STATES RIGHT UPPER CORNER OF GRILLE COMING OUT / PART IN STOCK	86350NTT .8 N35 C09 - GRILLE SEAL	REPLACED FRONT GRILLE SEAL.
KM8JN12D76U	4/14/06	4276	54.94	C/S STEERING ASST WARNING CAME ON ONCE WHEN DRIVING;RAN DIAGNOSTIC AND REPLACED BRAKE LIGHT SWITCH;CLEARED CODES AND ROAD TESTED	CAMPAIGN 079 - AIR BAG COVER MODULE REPLACEMENT / PART IN STOCK	61B046R0 .2 - DRIVER AIR BAG MODULE REPLACEMENT	COMPLETED
KM8JM12BX6U	7/14/05	33735	35.59		CUSTOMER STATES CHECK ENGINE LIGHT CAME ON, RELATED TO LINE ONE	SCANNED FOR CODES, C1513- BRAKE SWITCH MALFUNCTIONING	REPLACED BRAKE SWITCH
KM8JN12D76U	9/29/05	12679	33.06		CUSTOMER STATES THE ESC LIGHT COMES ON WHILE DRIVING. CHECK AND ADVISE.	TECH FOUND CODE C1513 BRAKE LAMP SWITCH OPEN CIRCUIT	TECH REPLACED BRAKE LAMP SWITCH-TESTED- OPERATING AS DESIGNED.
KM8JN12D26U	9/27/05	27061	32.74		CUSTOMER STATES TIRE PRESSURE LIGHT IS ON CHECK AND ADVISE LOOK AT ALL TIRES	FOUND SENSOR NOT FIGURED	RESET PRESURES AND SET PRESSURES TESTED TO VERIFY REPAIR
KM8JN12D26U	9/27/05	27061	32.74		CUSTOMER STATES ESC LIGHT CAME ON CHECK AND ADVISE	FOUND CODE C1513 BRAKE LAMP SWITCH SHORTED	REMOVED AND REPLACE BRAKE LAMP SWITCH TESTED TO VERIFY REPAIR
KM8JM12BX6U	7/14/05	33735	35.59		CUSTOMER STATES ESC LIGHT COMES ON AND GOES OFF, SPECIAL ORDER PART IS IN, PLEASE CHECK	SCANNED FOR CODES, P0111- INTAKE AIR TEMP SENSOR MALFUNCTIONING	REPLACED INTAKE AIR TEMP SENSOR

KM8JN12D86U	7/29/05	22907	35.91		CUSTOMER STATES HEARS CREAKING NOISE FROM FRONT END WHEN DRIVING OVER BUMPS OR CORNERING, PLEASE CHECK	SCANNED FOR CODES, C1237- PRESSURE SENSOR AND C1513- BRAKE SWITCH. TESTED BRAKE SWITCH ACCORDING TO TSB 06-50-006. BRAKE SWITCH FAULTY. C1237 WAS BEING CAUSED BY FAULTY BRAKE SWITC H BECAUSE THE PRESSURE SENSOR WAS SEEING PRESSURE BUT THE COMPUTER DIDNT KNO	REPLACED BRAKE SWITCH
KM8JN12D86U	7/29/05	22907	35.91		CUSTOMER STATES ESC LIGHT WILL COME ON RANDOMLY WHILE DRIVING, PUSHING BOTTON DOES NOTHING WHEN LIGHT IS ON, PLEASE CHEC	TEST DROVE AND VERIFIED NOISE. LEFT FRONT STRUT MOUNT IS NOISY	PART NOT IN STOCK, ORDERED LEFT FRONT STRUT MOUNT AND INSULATOR
KM8JM12B46U	12/17/05	19338	32.74		CUSTOMER STATES ESC LIGHT IS ON ALREADY CHEC PARTS HERE	FOUND PRESSURE SENSOR MALFUNCTION, AND STOP LAMP SWITCH MALFUNCTION	REMOVED AND INSTALLED PRESSURE SENSOR TO MASTER CYLINDER AND BLED SYSTEM. INSTALLED STOP LAMP SWITCH. TESTED TO VERIFY REPAIR
KM8JN12D46U	9/15/05	24862	33.06		CUSTOMER STATES THAT CHECK ENGINE LIGHT COMES ON AND OFF	PO130 O2 SENSOR CIRCUIT (BANK 1 SENSOR 1) IS SHORT	REPLACED O2 SENSOR AS NEEDED BANK 1 SENSOR 1
KM8JN12D46U	9/15/05	24862	33.06		CUSTOMER STATES THAT ESC LIGHT COMES ON AND OFF. PLEASE CHECK AND ADVISE	C1513 BRAKE SWITCH CIRCUIT IS SHORT	REPLACED BRAKE LAMP SWITCH
KM8JN72D26U	11/15/05	28866	28.87		CUSTOMER REQUEST ESC LIGHT BE CHECKED NOT ON AT THIS TIME AND BRAKES SEEM TO GRAB SEEM TO HAPPEN ON STEP HILL	TESTED AND CEHC KED FOUND CODE C1513 BRAKE LAMP SWITCH MALFUCTION.	REPLACED BRAKE LAMP SWITCH AND CLEARED CODE.
KM8JM72B66U	10/03/05	12897	29.9	HAS CODE C1513 BRAKE LAMP SEITCH OPEN	CUSTOMER REQUEST ESP LIGHT BE CHECKED COME ON AND OFF.	TESTED AND CEHCKED FOUND CODE C1513 BRAKE LAMP SWITCH OPEN	REPLACED STOP LAMP SWITCH AND CLEANED CODE.
KM8JN72D76U	8/22/05	17733	36.34		PERFORM RECALL 079 AIR BAG	PERFORM RECALL 079 AIR BAG REPLACMENMT TECH # 3493	PERFORM RECALL 079 PERFORM RECALL 079
KM8JN12D46U	9/15/05	24862	33.06		RECALL 079 AIR BAG COVER	OPEN CAMPAIGN	REPLACED AIR BAG COVER AS NEEDED
KM8JN12D27U	11/03/06	5779	33.06		CUSTOMER STATES THE ESC OFF LIGHT COMES ON WHILE DRIVING ANDTHE BUTTON HAS NO EFFECT. CHECK AND ADVISE.	INTERNAL SHORT IN BRAKE SWITCH.	REPLACED THE BRAKE SWITCH AND CHECKED OPERATION.
KM8JM12B36U	10/15/05	14078	32.74				
KM8JN12D06U	9/30/05	30109	33.06	REMOVED AND REPLACED SWITCH TESTED TO VERIFY REPAIR	CUSTOMER STATES ESC LIGHT ON SPECIAL ORDER PART	FOUND STOP LAMP SWITCH SHORTED	REMOVED AND REPLACED SWITCH TESTED TO VERIFY REPAIR
KM8JN72D76U	8/22/05	17733	36.34		CUSTOMER CLAIMS ESC LIGHT COMES ON AT TIMES AND WILL STAY ON UNTIL ENGINE IS TURNED OFF	CHECKED AND REPLACEDBRAKE LIGHT SWITCH, TECH 3493 CHECKED FOR CODES 1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D56U	10/19/05	12844	36.34	SCAN CODE C1513 REPLACE BRAKE LIGHT SWITCH 14-8665	CUSTOMER REQUEST TO PERFORM CAMPAIG079	E	PERFORM RECALL 079 PERFORM RECALL 079 14-8665
KM8JN72D56U	10/19/05	12844	36.34	SCAN CODE C1513 REPLACE BRAKE LIGHT SWITCH 14-8665	CUSTOMER STATES THE ESC LIGHT COMES ON AT TIMES WHEN DRIVING	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE SCAN CODE C1513 REPLACE BRAKE LIGHT SWITCH14-8665
KM8JM12B56U	8/25/05	46477	33.06	REMOVED AND REPLACED SWITCH TESTED TO VERIFY REPAIR	CUSTOMER STATES THAT BRAKE LIGHTS ARE INOPERATIVE	FOUND CODE C1513 SHORT IN STOP LAMP SWITCH	REMOVED AND REPLACED SWITCH TESTED TO VERIFY REPAIR
KM8JM12B56U	8/25/05	46477	33.06	REMOVED AND REPLACED SWITCH TESTED TO VERIFY REPAIR	CUSTOMER STATES THAT BRAKES FEEL LIKE THEY ARE STICKING	FOUND CODE C1235 PRIMARY PRESSURE SWITCH SHORTED	ORDERED PART
KM8JN12D75U	6/03/05	49182	33.35		CLIENT STATES THAT THE ENGINE QUITTS AT STOPLIGHTS.	UPON INSPECTION OF THE CLIENT'S VEHICLE THE TECH FOUND THAT THERE WAS A STORED CODE FOR THE TPS SIGNAL TO HIGH (P0123)	THE TECH ALSO FOUND THAT THE CRUISE CABLE WAS TO TIGHT HOLDING THE THROTTLE OPEN. ADJUSTED THE CRUISE CABLE.
KM8JM12B47U	8/25/06	9650	58.84	TT FOR SCAN TOOL CODE C1513	CUST STATES THAT ESC LIGHT IS ON	INTERNAL	SCAN TOOL USE ADJUST BRAKE SWITCH TO RELIEVE PRESSURE FROM CALIPERS
KM8JM12B47U	8/25/06	9650	58.84	TT FOR SCAN TOOL CODE C1513	CUST STATES THAT ESC LIGHT IS ON	INTERNAL	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D26U	7/28/05	48153	33.51		STABILITY CONTROL LIGHT STAYS ON ATTIMES	1	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D75U	6/03/05	49182	33.35		OWNER REPORTS ROUGH RUNNING CONDITION CLIENT STATES THAT SOMETIMES THE IDLE SPEED VARIES ABOVE 1K DOWN TO 500.		SEE JOB ONE.
KM8JN12D75U	6/03/05	49182	33.35		CLIENT STATES THAT THE TRANSMISSION WONT SHIFT FROM FIRST UNTIL THE RPM'S ARE HIGH. CK AND ADVISE.		SEE JOB ONE.
KM8JN12D75U	6/03/05	49182	33.35		CLIENT STATES THAT THE ESP TURNS ITSELF OFF AND WHEN YOU TRYTO TURN THE ESP BACK, YOU CANT TURN IT BACK ON.	UPON INSPECTION OF THE CLIENT'S VEHICLE THE TECH FOUND THAT THERE WAS 2 CODES STORED (C1237, C1513) FOR A BRAKE SWITCH MALFUNCTION.	REMOVED AND REPLACED THE BRAKE SWITCH AND CLEARED ALL STORED CODES.
KM8JN72D26U	7/28/05	48153	33.51		AIR BAG WARNING LIGHT ON	WARNING LIGHT IS ON	SENSOR ASSY-FRONT DUAL AIR BAG (LH) RE SENSOR ASSY-FRONT DUAL AIR BAG (LH) RE
KM8JN72D36U	3/30/06	2314	33.93		CUST STATES THAT CAR HAS NO BRAKE LIGHT, BACKUP LIGHTS, OR INTERIOR LIGHTS	POOR CONTACT	TIME TO DIAGNOSE AND REPAIR WIRE HARNESS TIME TO DIAGNOSE AND REPAIR WIRE HARNESS
KM8JN72D36U	3/30/06	2314	33.93		CUST STATES THAT CAR HAS NO BRAKE LIGHT, BACKUP LIGHTS, OR INTERIOR LIGHTS	POOR CONTACT	SENSOR-ANGULAR VELOCITY SENSOR-ANGULAR VELOCITY
KM8JN12D06U	8/17/05	23936	31.71	ESC LIGHT ACTIVATED. C1513, BRAKE LAMP SWITCH. REMOVED AND REPLACED SWITCH ASSY.	CUSTOMER STATES TPMS LIGHT HAS BEEN ON A LONG TIME	C1315 SENSOR 4 RF CHANNEL FAIL C1312 SENSOR 1 RF CHANNEL FAIL	REAN RECONFIGURATION OF WHEEL SENSORS
KM8JN12D06U	8/17/05	23936	31.71	ESC LIGHT ACTIVATED. C1513, BRAKE LAMP SWITCH. REMOVED AND REPLACED SWITCH ASSY.	ESC LIGHT ON	C1513 BRAKE LAMP SWITCH	REPLACED SWITCH ASSEMBLY - STOP LAMP

KM8JN72D36U	3/30/06	2314	33.93		SECOND REPAIR FOR ABOVE COMPLAINT	POOR CONTACT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72DX6U	8/17/05	26864	58.84	TT FOR SCAN TOOL CODE C1513	ESC LIGHT ON	INOP	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D56U	8/10/05	16887	33.65		CUSTOMER STATES ESC LIGHT WILL COMEON	SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D06U	8/17/05	23936	31.71	ESC LIGHT ACTIVATED. C1513, BRAKE LAMP SWITCH. REMOVED AND REPLACED SWITCH ASSY.	CAMPAIGN 079, (TUCSON) DRIVER AIR BAG COVER MODULE REPLACEMENT.	CAMPAIGN 079	CAMPAIGN 079 HAS BEEN COMPLETED AS PER THE CAMPAIGN NOTICE.
KM8JM12B16U	7/12/05	43149	31.71	BRAKE LIGHTS INOP. FAULTY BRAKE LIGHT SWITCH. REMOVED AND REPLACED SWITCH.	CUST STATE BRAKE LIGHTS INOP	CODE C1513 BRAKLAMP SWITCH INOP	R&R SWITCH
KM8JM12B07U	11/09/06	143	31.39		C/S ESE LIGHT GOES ON AND OFF	FOUND CODE C1513	REPLACED BRAKE LIGHT SWITCH
KM8JN12D96U	8/10/05	22695	31.71	STABILIZER LIGHT ACTIVATED AND TURN OFF. BRAKE LAMP SWITCH FAULTY. REMOVED AND REPLACED BRAKE LAMP SWITCH.	CUSTOMER STATES STABILIZER LIGHT IS ACTIVATED WILL NOT TURN OFF CHECK AND DIAGNOIS	BRAKE LAMP SWITCH	BRAKE LAMP SWITCH FAULTY, REMOVED AND REPLACED BRAKE LAMP SWITCH
KM8JM12B46U	9/24/05	20950	58.84	TT FOR SCAN TOOL CODE C1513	ESC LIGHT IS ON	SCAN TEST C 1513 REPLACE BRAKE LIGHT SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D36U	8/25/05	32220	58.84	TT FOR SCAN TOOL CODE C1513	CUST STATES THAT ESC LIGHT IS ON	POOR CONTACT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D36U	8/25/05	32220	58.84	TT FOR SCAN TOOL CODE C1513	CUST STATES THAT ESC LIGHT IS ON	POOR CONTACT	SCAN TIME SCAN TIME
KM8JN72D56U	11/03/05	9353	58.52	TT FOR SCAN TOOL USE CODE C1513			
KM8JM12B25U	6/03/05	34487	33.35		CUSTOMER STATES ESP LIGHT GOES ON AND OFF WHEN	PERFORM SCAN C1513	REPLACE BRAKE LIGHT SWITCH
KM8JM12B25U	6/03/05	34487	33.35		CUSTOMER STATES ALARM HORN WILL NOT SOUND AFTER PUSHING LOCKBUTTON TWICE		ORDER SIREN
KM8JM12B86U	7/13/05	15657	31.39		CUSTOMER STATES ESC LIGHT IN DASH SOMETIMES EVEN WHEN BUTTON NOT PUSHED	BRAKE LIGHT SWITCH BAD FOUND CODE C1513	REPLACED BRAKE LIGHT SWITCH JOB COMPLETE
KM8JN12D36U	10/14/05	20085	34.25		CUSTOMER STATES ESC LIGHT COMES ON.INSTALL S/O	ESC LIGHT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D75U	1/12/05	2996	33.97	15	CUST STATES THAT ESP LIGHT COMES ON/OFF INTERMITNTLY WHILE DRIVING	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN72D86U	7/28/05	31267	34.25		ESC LIGHT - SO PARTS HERE	INTERNAL	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B15U	12/17/04	150	32.67				
KM8JN12D06U	8/08/05	16735	53.44	ESC LIGHT ON...PERFORMED SCAN B1513...REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT IS ON	PERFORM SCAN B1513	REPLACE BRAKE LIGHT SWITCH
KM8JN12D46U	12/09/05	16318	53.44	ESC WARNING LIGHT WILL INTERMITTENTLY REMAIN ACTIVED. FOUND CODE C153 BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH AND CLEARED CODES.	CUSTOMER STATES THE ESC WARNING LIGHT WILL INTERMITTENTLY REMAIN ACTIVATED. DIAGNOSE AND REPORT. NOW IT IS OFF CHECK FOR CODES	C1513 BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH AND CLEARED CODES
KM8JN12D26U	7/29/05	19232	34.25		ESC WARNING LIGHT COMES ON	SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B76U	7/15/05	17679	56	TT FOR SCAN TOOL CODE P1513	CUSTOMER STATES CEL LIGHT IS ON S/O PART	IMPROPER ADJUSTMENT	JM ECM REPROGRAMMING (TSB# 06-36-005) JM ECM REPROGRAMMING (TSB# 06-36-005)
KM8JM12B76U	7/15/05	17679	56	TT FOR SCAN TOOL CODE P1513	CUSTOMER STATES ESC LIGHT IS ON S/O PART	POOR CONTACYT	SCAN TIME ADJUST BRAKE SWITCH TO RELIEVE PRESSURE FROM CALIPERS
KM8JN12D95U	6/23/05	27521	31.71	ESC LIGHT IS ACTIVATED. B1315, REPLACED BRAKE LIGHT SWITCH	CUST STATES BATTERY HAS TO BE JUMPED LATELY	BATTERY	REPLACED BATTERY
KM8JN12D95U	6/23/05	27521	31.71	ESC LIGHT IS ACTIVATED. B1315, REPLACED BRAKE LIGHT SWITCH	CUST STATES ESC LIGHT COMES ON	B1315	REPLACED BRAKE LIGHT SWITCH
KM8JM12B86U	9/21/05	44166	31.71	ALL BRAKE LIGHTS WENT OUT AT SAME TIME. BRAKE LIGHT SWITCH FAULTY, REMOVED AND REPLACED OPERATING TO MANUFACTURES SPECIFICATIONS	CUSTOMER STATES ALL BRAKE LIGHTS WENT OUT AT THE SAME TIME CHECK AND DIAGNOIS	BRAKE LIGHT SWITCH	BRAKE LIGHT SWITCH FAULTY, REMOVED AND REPLACED OPERATING TO MANUFACTURES SPECIFICATIONS
KM8JM12B76U	7/15/05	17679	56	TT FOR SCAN TOOL CODE P1513	CUSTOMER STATES ESC LIGHT IS ON S/O PART	POOR CONTACYT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D96U	7/22/05	24001	58.84	TT FOR SCAN TOOL USE	CUSTOMER STATES ECS LIGHT IS ON S/O PART	POOR CONTACT	SCANNED FOR CODES ADJUST BRAKE SWITCH TO RELIEVE PRESSURE FROM CALIPERS
KM8JN72D96U	7/22/05	24001	58.84	TT FOR SCAN TOOL USE	CUSTOMER STATES ECS LIGHT IS ON S/O PART	POOR CONTACT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D96U	7/29/05	29828	32.82		CUSTOMER STATES ESC OFF LIGHT IS ON	ESC LIGHT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12DX5U	9/13/04	22948	34.13		CUSTOMER STATES CRUISE CONTROL INOP CRUISE SET LIGHT BLINKS OFF AND ON CRUISE WILL WORK FOR ABOUT 15 MINUTES THEN SHUTS	FOUND BRAKE SWITCH INOP	REPLACED BRAKE LAMP SWITCH
KM8JN12D56U	9/29/05	15179	31.71	VEH JERKING WHEN SLOWING DOWN. TO 30 MPH, BRAKE SWITCH REMOVED AND REPLACED BRAKE LGIHT SWITCH.	CUSTOMER STATES VEHICLE IS JERKING WHEN SLOWING DOWN TO 30MPH	BRAKE SWITCH	REMOVED AND REPLACED BRAKE LIGHT SWITCH, OPERATING TO MANUFACTURES SPECIFICATIONS
KM8JM12B96U	8/31/05	19690	31.71	ESC LIGHT ACTIVATED. FOUND BRAKE LAMP SWITCH FAULTY. CODE C1513 REMOVED AND REPLACED BRAKE LAMP SWITCH.	CUSTOMER STATES ESC LIGHT IS STAYING ON	FOUND BRAKE LAMP SWITCH FAULTY CODE C1513	REMOVED AND REPLACED BRAKE LAMP SWITCH, CLEARED CODE
KM8JN12D06U	8/10/05	13018	58.84	TT FOR SCAN TOOL CODE C1513	CUSTOMER STATES THAT ECS LIGHT WILLCOME ON AND NOT SHUT OFF	SWITCH INOP	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D06U	8/10/05	13018	58.84	TT FOR SCAN TOOL CODE C1513	CUSTOMER STATES THAT ECS LIGHT WILLCOME ON AND NOT SHUT OFF	SWITCH INOP	SCAN TIME SCAN TIME
KM8JN72D36U	1/07/06	24254	28.86	REPALCED BRAKE LIGHT SWITCH,CLEARED CODE,RETESTED	ESC LIGHT IS ON	PERFORMED DIAG. TEST,FOUND CODE C1513 BRAKE LIGHT SWITCH FOUND BRAKE LIGHT SWITCH TO BE BAD	REPALCED BRAKE LIGHT SWITCH,CLEARED CODE,RETESTED
KM8JN12D76U	12/22/05	18953	31.39		CUST STATES ESC LIGHT KEEPS COMING OFF AND ON	BRAKE LIGHT SWITCH FAULTY	REPLACED BRAKE LIGHT SWITCH
KM8JN12D76U	8/08/05	22653	31.71		CUST. STATED THE ESC LIGHT COMES ON AND OFF	SWITCH	REPLACED BRAKE LIGHT SWITCH

KM8JN12D76U	8/08/05	22653	31.71		CAMPAIGN 079, (TUCSON) DRIVER AIR BAG COVER MODULE REPLACEMENT.	CAMPAIGN 079	CAMPAIGN 079 HAS BEEN COMPLETED AS PER THE CAMPAIGN NOTICE.
KM8JN12D95U	12/16/04	30344	26.1	30344 C1513 BRAKE LIGHT SWITCH .30 ADJUSTED BRAKE LIGHT SWITCH	RECALL 079: D/S AIR BAG.	E	079 DRIVERS AIR BAG 079 DRIVERS AIR BAG 30344 DRIVERS A/B COVER UPDATE 61B046RO .20PERFORMED CAMPAIGN
KM8JN12D95U	12/16/04	30344	26.1	30344 C1513 BRAKE LIGHT SWITCH .30 ADJUSTED BRAKE LIGHT SWITCH	C/S THE AC WOULD NOT COME ON WITH RECENT STARTS OF THE VEHICLE. ALSO STATES THE VEHICLE DID NOT BLOW ANYAIR AT ALL.	E	MOTOR AND FAN ASSY-AIR CONDITIONING BLOWER RE MOTOR AND FAN ASSY-AIR CONDITIONING BLOWER RE 30344 NO BLOWER MOTOR OPERATION HAS VOLTAGEON SYSTEM .30 REPLACED BLOWER MOTOR HAS DEADSPOT ON ARMATURE
KM8JN12D86U	8/08/05	7259	31.39		ESC LIGHT COME ON	FOUND THE BRAKE LIGHT SWITCH SHORTED OUT.	REMOVED AND REPALCED THE BRAKE LIGHT SWITCH.
KM8JN12D06U	8/12/05	15041	33.35	ESC LIGHT ON...PERFORMED SCAN C1513...REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT WHILE DRIVING	PERFORM SCAN C1513	REPLACE BRAKE LIGHT SWITCH T
KM8JN12D86U	8/08/05	22652	31.39		CUST STATES STABILITY LIGHT COME ON WHILE DRIVING	C 1513 BRAKE LAMP SWITCH FAILURE	REPALCE SWITCH ASSEMBALLY
KM8JN12D95U	12/16/04	30344	26.1	30344 C1513 BRAKE LIGHT SWITCH .30 ADJUSTED BRAKE LIGHT SWITCH	C/S THE ESP LIGHT CAME ON RECENTLY.CHK/ADVISE	E	MISCELLANEOUS REPAIRS MISCELLANEOUS REPAIRS 30344 C1513 BRAKE LIGHT SWITCH .30 ADJUSTEDBRAKE LIGHT SWITCH
KM8JN12D56U	7/22/05	29514	61.54	29514 C1513 BRAKE LAMP SWITCH 93810ROO 93810RPO 0.6 PERFORMED PUT SCAN TOOL FOUND C1513 BRAKE LAMP SWITCH IS BAD REPLACE	CUSTOMER STATES VEHICLE WILL LOSE POWER--ON RIGHT TURNS	NO CODES .DID FIND AIR INTAKE LOOSE	MINOR MAINTENANCE MINOR MAINTENANCE 29514 READJUSTED AIR INTAKE HOSE
KM8JN12D56U	7/22/05	29514	61.54	29514 C1513 BRAKE LAMP SWITCH 93810ROO 93810RPO 0.6 PERFORMED PUT SCAN TOOL FOUND C1513 BRAKE LAMP SWITCH IS BAD REPLACE	CUSTOMER STTES E.S.C LIGHT ON		MINOR MAINTENANCE MINOR MAINTENANCE 29514 C1513 BRAKE LAMP SWITCH 93810ROO93810RPO 0.6 PERFORMED PUT SCAN TOOL FOUND C1513 BRAKE LAMP SWITCH IS BAD REPLACE
KM8JM12B86U	12/06/05	29168	31.71	ESC LIGHT ALWAYS STAYS ON. FAULTY BRAKE LIGHT SWITCH. REMOVED AND REPLACED SWITCH			
KM8JM12B66U	7/15/05	14480	33.35		CUSTOMER STATES BRAKE LIGHTS FLICKER	FOUND BAD BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JM12B66U	7/15/05	14480	33.35		CUSTOMER STATES ESC LIGHT IS BLINKING OFF AND ON SEVERAL TIMES A DAY	FOUND CODE C1513 CLEARED CODE	
KM8JM12B66U	7/15/05	14480	33.35		CUSTOMER REQUEST LOANER VEHICLE		LOANER PROVIDED
KM8JN12D85U	1/12/05	16083	34.05	16083 CODE 1260 ESC.STOP LAMP SW SLOW REACTION PEDAL C-56 PIN 1 93480ROO .6 93810ROO .3 REPLACED ANGULAR VELOCITY SENSOR CLEARED CODE REPLACED AND ADJUSTED STOPLAMP SWITCH VEHICLE RETURNED TO NORMAL OPERATION ESC AND CR CRUISE	ESC LIGHT WILL NOT TURN OFF		SENSOR-ANGULAR VELOCITY SENSOR-ANGULAR VELOCITY SEE LINE A FOR STORY
KM8JN12D85U	1/12/05	16083	34.05	16083 CODE 1260 ESC.STOP LAMP SW SLOW REACTION PEDAL C-56 PIN 1 93480ROO .6 93810ROO .3 REPLACED ANGULAR VELOCITY SENSOR CLEARED CODE REPLACED AND ADJUSTED STOPLAMP SWITCH VEHICLE RETURNED TO NORMAL OPERATION ESC AND CR CRUISE	C/S CRUISE CONTROL SYSTEM TURNS OFFWHEN HITTING BRAKES		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16083 CODE 1260 ESC.STOP LAMP SW SLOWREACTION PEDAL C-56 PIN 1 93480ROO .693810ROO .3 REPLACED ANGULAR VELOCITY SENSORCLEARED CODE REPLACED AND ADJUSTED STOPLAMP SWITCH VEHICLE RETURNED TO NORMAL OPERATIONE
KM8JN12D76U	8/08/05	23080	31.71	AFTER 20 MINUTES HIGHWAT DRIVING, VEHICLE FEELS LIKE IT HAS A LOOSE WHEEL AND VIBRATION/ INTERNAL MALFUNCTION/ FOUND CODE C1513/ REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES AFTER 20 MIN HWY DRIVING VEHICLE FEELS LIKE IT HAS A LOOSE WHEEL AND VIB. SEVERELY ESC LIGHT NOW ON	INTERNAL MALFUNCTION	DIAG CODE C1513 BRAKE LIGHT SWITCH REPLACED BRAKE LIIGHT SWITCH
KM8JM12B66U	7/15/05	32824	31.71		CUSTOMER STATES ESC LIGHT COMING ON AND OFF	FOUND CODES C1513	REMOVED AND REPLCED BRAKE LIGHT SWITCH, OPERATING TO MANUFACTURES SPECIFICATIONS
KM8JN12D96U	10/14/05	15935	31.71	ECS LIGHT IS NOT WORKING. CODE C1513. REMOVED AND REPLACED BRAKE SWITCH. CLEARED ALL CODES AND RETEST. NO CODES.	CUSTOMER STATES ENGINE LIGHT IS ON	CODES P0130 02 SENSOR FAULTY	REMOVED AND REPLACED 02 SENSOR, OPERATING TO MANUFACTURES SPECIFICATIONS
KM8JM12B16U	7/13/05	13959	63.5	ESC LIGHT ON FOUND CODE C1513 BRAKE LAMP SWITCH OPEN REPLACED SWITCH CLEARED DTC, TT TIME IS FOR THE USAGE OF THE SCAN TOOL DOES NOT APPLY TO VEH, TESTED GOOD	BRAKE SWITCH IS HERE PLEASE REPLACE	ECS LIGHT WAS ON	REPLACED BRAKE SWITCH AND CLEARD CODES. NO CODES COME UP
KM8JN12D56U	7/22/05	29533	90				
KM8JN12D36U	11/28/05	26746	61.86	26746 C1513 93810ROO.95698RPO .6 SWITCH DID NOT PASS THE CONT.TEST.REPLACED. DTC CLEARED.TT TIME FOR THE USAGE OF THE SCAN TOOL	C/S ESC LIGHT COMES ON INTERMITTATNLY		MISCELLANEOUS REPAIRS MISCELLANEOUS REPAIRS 26746 C1513 93810ROO.95698RPO .6 SWITCH DIDNOT PASS THE CONT.TEST.REPLACED. DTC CLEARED.
KM8JN12D96U	10/14/05	15935	31.71	ECS LIGHT IS NOT WORKING. CODE C1513. REMOVED AND REPLACED BRAKE SWITCH. CLEARED ALL CODES AND RETEST. NO CODES.	CUSTOMER STATE ECS LIGHT IS NOT WORKING PROPERLY	ESC LIGHT CODE C1513	REMOVED AND REPLACED BRAKE SWITCH, CLEARED ALL CODES, OPERATING TO MANUFACUTRS SPECIFICATIONS

KM8JN12D96U	10/14/05	15935	31.71	ECS LIGHT IS NOT WORKING. CODE C1513. REMOVED AND REPLACED BRAKE SWITCH. CLEARED ALL CODES AND RETEST. NO CODES.	CAMPAIGN 079, (TUCSON) DRIVER AIR BAG COVER MODULE REPLACEMENT.	CAMPAIGN 079	CAMPAIGN 079 HAS BEEN COMPLETED AS PER THE CAMPAIGN NOTICE.
KM8JN12D36U	11/28/05	26746	61.86	26746 C1513 93810ROO,95698RPO .6 SWITCH DID NOT PASS THE CONT.TEST.REPLACED. DTC CLEARED.TT TIME FOR THE USAGE OF THE SCAN TOOL	C/S HOOD RELEASE INOP		MISCELLANEOUS REPAIRS MISCELLANEOUS REPAIRS 26746 CABLE OUT OF RETAINERS TT .6 GRILL HAD TO BE CUT OFF TO GET TO THE LATCH. CABLE REPOSITIONED NEW GRILL INSTALLED
KM8JN12D46U	8/08/05	23736	35.76	23736 C1513 STOP LAMP SWITCH/LONG PAUSE ON OPERATE 93810ROO .3 REPLACED STOP LAMP SWITCH	BRAKE LIGHTS INOP WHEN KEY IS IN ACCESSORY POSITION, WHEN VEH IS ON RIGHT BRAKE LIGHT IS INOP		EXTERIOR TRIM CONCERN EXTERIOR TRIM CONCERN 23736 C1513 STOP LAMP SWITCH/LONG PAUSE ON OPERATE 93810ROO .3 REPLACED STOP LAMP SWITCH
KM8JN12D46U	8/08/05	23736	35.76	23736 C1513 STOP LAMP SWITCH/LONG PAUSE ON OPERATE 93810ROO .3 REPLACED STOP LAMP SWITCH	ESC LIGHT IS ON AND WONT TURN OFF		MISCELLANEOUS REPAIRS MISCELLANEOUS REPAIRS 23736 RELATIVE TO STOP SWITCH LINE B
KM8JN12D56U	12/13/05	10718	24.36	ESC LIGHT WILL NOT COME ON. FOUND FAULTY SWITCH. REPLACD BRAKE LIGHT SWITCH. CUST STATES ESC LIGHT ON.	CUSTOMER STATES ESC LIGHT WONT COME ON	FOUND LIGHT NOT COMING ON	REPLACED BRAKE LIGHT SWITCH
KM8JN12D06U	12/16/05	20867	29.22	CODES C1503 AND C1513 STORED SWITCH DEFECTIVE. REPLACED BRAKE SWITCH-CLEAR CODES AND ROAD TEST OK.	CUST STATES ESC LIGHT ON	CODES C1503 AND C1513 STORED SWITCH DEFECTIVE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACED BRAKE SWITCH - CLEAR CODES AND ROADTEST OK
KM8JN12D06U	1/13/06	12460	34.56	CUSTOMER STATES REAR BRAKE LIGHTS INTERMITTENTLY INOP 12460 INTERMITTENT OPERATION (OPEN) PERFORM GDS DIAGNOSTIC/ELECTRICAL SYSTEM DIAGNOSTIC- FAULT PRESENT. VERIFY CUSTOMER CONCERN. REPLACE BRAKE LIGHT SWITCH. CLEAR FAULT. TEST DRIVE VEHICLE- VERIFY REP			
KM8JN12D45U	9/16/04	26932	29.02		INSTALL SOP L/F DOOR SIDE MLD		BODY SHOP
KM8JN12D45U	9/16/04	26932	29.02		CRUISE CONTROL IS INOP	FOUND BRAKE SWITCH FAULTY	REPLACED BRAKE SWITCH,RETESTED O.K
KM8JN12D45U	9/16/04	26932	29.02		SERVICE LOANER VEHICLE PROVIDED BY PITRE HYUNDAI		
KM8JN12D36U	10/12/05	32168	29.54	CUSTOMER STATES ESC LIGHT INTERMITTENTLY ON WHILE DRIVING. NO PERFORMANCE/TRANSMISSIN CONCERNS NOTED. PERFORMED DIAGNOSTICS AND FOUND DEFECTIVE ESC SWITCH NECESSARY TO REMOVE AND REPLACE ESC SWITCH AND VERIFY PROPER OPERATION UPON COMPLETION			
KM8JM12B96U	7/12/05	31125	36.5		CUSTOMER STATES WHEN DRIVING ESC LIGHT COMES ON	INTERNAL FAILURE	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 31125 SCNTL-C1513 BRAKE LAMP SWITCH OPEN/SHORT FOUND BRAKE LAMP SWITCH INTERNAL FAILURE REPLACED SWITCH-LIGHTS WORKING PROPERLY AT THIS
KM8JN12D75U	6/02/05	35131	36.5	INTERNAL FAILURE	CUSTOMER STATES AT TIMES ESP LIGHT COMES ON	INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE INTERNAL FAILURE
KM8JM12B56U	12/15/05	7929	43.5	7929 BRAKE SWITCH MISADJ. SET CODE 32002A00, 3200RP00 .5 RESET SWITCH, CLEARED CODES	C/S THE ESC LIGHT WAS ON RECENTLY.	E	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP 7929 BRAKE SWITCH MISADJ. SET CODE 32002A00,3200RP00 .5 RESET SWITCH, CLEARED CODES
KM8JM12B56U	12/15/05	7929	43.5	7929 BRAKE SWITCH MISADJ. SET CODE 32002A00, 3200RP00 .5 RESET SWITCH, CLEARED CODES	RECALL 079-AIRBAG	RECALL	079 DRIVERS AIR BAG 079 DRIVERS AIR BAG 7929 FAULTY AIRBAG COVER 61B046R0 .2 REPLACED COVER
KM8JM12B26U	7/21/05	16536	35.44	16536 C1513 STOP LAMP SWITCH STICKING OVER MONITOR LIMIT REPLACED SWITCH AND ADJUSTED			
KM8JM12B06U	7/12/05	15532	35.74	15532 REPLACED STOP LAMP SWITCH			
KM8JN12D96U	8/09/05	16726	36.5	16726 FOUND CODE C1513-BRAKE SWITCH MALF. SWITCH HAS INTERNAL OPEN CIRCUIT CONDITION. REPLACED SWITCH AND PERFORMED MINOR WIRE REPAIR ON CONNECTOR C54. NORMAL OPERATION AT THIS TIME.	TO SPLIT LINE FOR THE CONCERN ON LINE B	F	WIRE REPAIR TIME (MINOR) WIRE REPAIR TIME (MINOR) FOUND OPENB CIRCUTI AT THE STOP LAMP SWITCH CAUSING INTERNAL FIALURE IN THE STOP SWITCH ASSY RE PAIRED CONNECTOR AND WORKING TOMANUFACTURE SJE CS
KM8JM12B76U	9/16/05	8262	54.8	ESC LIGHT ON FLUND CODE C1513 BRK LAMP SWITCH MALF INTERMITTENT OPEN SWITCH OPEN REPL SWITCH CLEARED CODES TT TIME FOR SCAN TOOL DOES NOT APPLIE TO LABOR OP	ESC LIGHT ON -----SOP IN	TESTED AND FOUND BRAKE LIGHT SWITCH MALFUNCTION	REPLACED SWITCH
KM8JN12D76U	1/06/06	6568	61.86	6568 C1513 BRAKE LAMP SWITCH 93810RPO 93810ROO 0.6 PERFORMED INSPECTION FOUND BRAKE LAMP SWITCH FAILURE	C/S ESC LIGHT TURNS ON INTERMITANTLY		MISCELLANEOUS REPAIRS MISCELLANEOUS REPAIRS 6568 C1513 BRAKE LAMP SWITCH 93810RPO93810ROO 0.6 PERFORMED INSPECTION FOUND BRAKE LAMP SWITCH FAILURE
KM8JN12D76U	1/06/06	6568	61.86	6568 C1513 BRAKE LAMP SWITCH 93810RPO 93810ROO 0.6 PERFORMED INSPECTION FOUND BRAKE LAMP SWITCH FAILURE	PREFORM RECALL 079 DRIVER AIRBAG COVER MODIFICATION		MISCELLANEOUS REPAIRS MISCELLANEOUS REPAIRS 6568 RECALL 079 61B046R0 0.2 PERFORMED RECALL 079

KM8JN12D96U	8/09/05	16726	36.5	16726 FOUND CODE C1513-BRAKE SWITCH MALF. SWITCH HAS INTERNAL OPEN CIRCUIT CONDITION. REPLACED SWITCH AND PERFORMED MINOR WIRE REPAIR ON CONNECTOR C54. NORMAL OPERATION AT THIS TIME.	CUSTOMER STATES ESC LIGHTS COMES ON		STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 16726 FOUND CODE C1513-BRAKE SWITCH MALF. SWITCH HAS INTERNAL OPEN CIRCUIT CONDITION. REPLACED SWITCH AND PERFORMED MINOR WIRE REPAIR ON CONNECTOR C54. NORMAL OPERATION AT THIS TIME.
KM8JN12D76U	11/25/05	17342	36.06	17342 CODE C1513 BRAKES LAMP SWITCH REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING	CODE C1513 BRAKES LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 17342 CODE C1513 BRAKES LAMP SWITCH REPLACED BRAKE LAMP SWITCH
KM8JN12DX6U	7/14/05	30011	36.06	30013 BRAKE LAMP SWITCH SHORTED OUT REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES CHECK ENGINE LIGHT ON	CODE P0130 SET INTERNAL FAILURE IN 02 SENSOR NOT READING	SENSOR ASSY-OXYGEN LH (UP) RE SENSOR ASSY-OXYGEN LH (UP) RE 30013 CODE P0130 SET INTERNAL FAILURE IN 02 SENSOR NOT READING REPLACE 02 SENSOR TO CORRECT
KM8JM12B76U	9/16/05	21418	61.54	21418 INTERMITTENT MALF. OF THE BRK.L.SW. 95650RPO 0.3.93810ROO 0.3 0.6 SWITCH REPLACED, DTC CLEARED.	CUSTOMER STATE S.C LIGHT COMES ON AND OFF		MINOR MAINTENANCE MINOR MAINTENANCE 21418 INTERMITTENT MALF. OF THE BRK.L.SW 95650RPO 0.3.93810ROO 0.3 0.6 SWITCH REPLACED, DTC
KM8JN12D56U	12/13/05	27900	35.76	27900 BRAKE LAMP SW MALFUNCTION / DELAYS 93810ROO .3 REPLACED STOP SWITCH	ESC LIGHT ON		MISCELLANEOUS REPAIRS MISCELLANEOUS REPAIRS 27900 BRAKE LAMP SW MALFUNCTION / DELAYS 93810ROO .3 REPLACED STOP SWITCH
KM8JN12D56U	12/13/05	27900	35.76	27900 BRAKE LAMP SW MALFUNCTION / DELAYS 93810ROO .3 REPLACED STOP SWITCH	PERFORM RECALL 079 AIRBAG COVER MODIFICATION		MISCELLANEOUS REPAIRS MISCELLANEOUS REPAIRS 27900 RECALL 079 61B046RO .2 COMPLETED DABCOVER
KM8JN12DX6U	7/14/05	30011	36.06	30013 BRAKE LAMP SWITCH SHORTED OUT REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES CHECK ENGINE LIGHT ON	CODE P0130 SET INTERNAL FAILURE IN 02 SENSOR NOT READING	SENSOR ASSY-OXYGEN LH ADDSCAN TOOL OPERATION SENSOR ASSY-OXYGEN LH ADDSCAN TOOL OPERATION 30013 CODE P0130 SET INTERNAL FAILURE IN 02 SENSOR NOT READING REPLACE 02 SENSOR TO CORRECT
KM8JN12DX6U	7/14/05	30011	36.06	30013 BRAKE LAMP SWITCH SHORTED OUT REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES TRACTION CONTROL LIGHT COMES ON WHEN DRIVING	BRAKE LAMP SWITCH SHORTED OUT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 30013 BRAKE LAMP SWITCH SHORTED OUT REPLACE BRAKE LAMP SWITCH
KM8JN12D65U	7/08/05	11745	36.06	11746 USE SCAN TOOL TO CHECK CODE C1513-C1237 REMOVE AND REPLACE BRAKE LIGHT SWITCH.	CAR NEEDS A JUMP TO START	FINISH	BATTERY ASSY RE BATTERY ASSY RE 11746 FINISH FINISH
KM8JM72B47U	10/31/06	6101	36.36	6101 C1513 BRAKE LAMP SWITCH CIRCUIT BRAKE LAMP SWITCH INTERNAL FAILURE, REPLACED BRAKE LAMP SWITCH TO REPAIR CLEARED CODE, RETESTED NO PROBLEMS FOUND AT THIS TIME			
KM8JN72D06U	2/27/06	10241	36.36	10241 DIG BRAKE SWITCH OPEN PERFORM BATTERY TEST, BATTERY LOOK GOOD PERFORM QUICK START TEST TO SEE, IF START APPENDACH GETTING STUCK OR NOT, CHECK ALL FUSE AND CABLE TO BATTERY, EVERYTHING NORMAL AT THIS TIME. REPLACED BRAKE LIGHT SWITCH, TEST DROVE OK.			
KM8JN72DX6U	3/06/06	24893	36.36	24893 BRAKE LIGHT SWITCH OPEN CIRCUIT REPLACED BRAKE LIGHT SWITCH.			
KM8JN12D65U	7/08/05	11745	36.06	11746 USE SCAN TOOL TO CHECK CODE C1513-C1237 REMOVE AND REPLACE BRAKE LIGHT SWITCH.	CAR NEEDS A JUMP TO START	FINISH	BATTERY ASSY ADD SCAN TOOL OPERATION BATTERY ASSY ADD SCAN TOOL OPERATION 11746 FINISH FINISH
KM8JN12D65U	7/08/05	11745	36.06	11746 USE SCAN TOOL TO CHECK CODE C1513-C1237 REMOVE AND REPLACE BRAKE LIGHT SWITCH.	CUSTOMER STATES ESP LIGHT IS ON	USE SCAN TOOL TO CHECK CODE C1513-C1237	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 11746 USE SCAN TOOL TO CHECK CODE C1513-C1237 REMOVE AND REPLACE BRAKE LIGHT SWITCH.
KM8JN72D26U	11/17/05	7500	36.04	7500 C1513 BRAKE LAMP SWITCH OPEN CONTACT INSTALL AND RESET CODE			
KM8JN72D85U	2/28/05	25293	34.93	25293 C1513 STORED DIAG BRAKE SWITCH SWITCH OPEN CIRCUIT VEHICLE START UP, WHEN START PERFORM BATTERY TEST, EVERYTHING LOOK GOOD CHECK ALL FUSE PERFORM START TEST AND START UP EVERYTIME. REPLACED BRAKE SWITCH TO REPAIR.			
KM8JN72D76U	3/24/06	25382	36.36	25382 BRAKE SWITCH OPEN SEE LINE B FOR STORY, TECH FOUND FAULTY BRAKE SWITCH. REPLACED TO REPAIR.			
KM8JN12D76U	11/09/05	22161	36.06	22161 C1513 - BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH	CUSTOMER REQUESTS TO PERFORM RECALL 079 DRIVER AIRBAG COVER MOD REPL (07-01-001)		079 DRIVERS AIRBAG COVER 07-01-001 079 DRIVERS AIRBAG COVER 07-01-001 22161 PERFORMED AIR BAG RECALL
KM8JN12D76U	11/09/05	22161	36.06	22161 C1513 - BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES ESC LIGHT IS ON	C1513 - BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 22161 C1513 - BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH

KM8JN12D76U	11/09/05	22161	36.06	22161 C1513 - BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES CIGARETTE LIGHTER INOP	CIGARETTE LIGHTER SOCKET PINS BENT INWARD- WONT LOCK CIGARETTE LIGHTER IN PLACE	SOCKET AND/OR PLUG ASSY- CIGAR LIGHTER RE SOCKET AND/OR PLUG ASSY-CIGAR LIGHTER RE 22161 CIGARETTE LIGHTER SOCKET PINS BENTINWARD- WONT LOCK CIGARETTE LIGHTER IN PLACE REMOVED CIGARETTE LIGHTER POWER SOCKET ANDBENT PINS INWARD TO HOLD FIRMLY AROUND CIGARETT
KM8JN72D47U	6/30/06	2224	36.04	2224 SHORT IN BRAKE LIGHT SWITCH INSTALLED TEST (HAS STICKY PLUNGER) BRAKE LIGHT SWITCH OPERATES BRAKE LIGHTS AND ESC NORMALLY UNTIL PLUNGER STICKS ORDERED NEW SWITCH			
KM8JN72D47U	6/30/06	2444	36.04	2444 C1513 BRAKE LAMP SWITCH MALFUNCTION BRAKE LAMP SWITCH INTERNAL MALFUNDION, REPALCED BRAKE LIGHT SWITCH TO REPAIR			
KM8JN72D87U	12/14/06	350	36.04	350 BRAKE LIGHT SENSOR DEFECTIVE. REPLACED WITH NEW BRAKE LIGHT SENSOR			
KM8JN12D36U	9/13/05	15696	35.74	15698 INTERNAL FAILURE OF THE BRAKE LIGHT SWITCH. REPLACED THE BRAKE LIGHT SWITCH.	CUSTOMER STATES ESC LIGHT COMES ON WHILE DRIVING. CUSTOMER STATES THE LIGHT WILL GO OFF WITH THE SWITCH.	INTERNAL FAILURE OF THE BRAKE LIGHT SWITCH.	SWITCH ASSY-STOP LAMP RE 15698 INTERNAL FAILURE OF THE BRAKE LIGHTSWITCH. REPLACED THE BRAKE LIGHT
KM8JN12D66U	7/16/05	27026	35.74		079 DRIVER AIRBAG COVER MOD REPL(07-01-001)	PERFORMED RECALL	079 DRIVERS AIRBAG COVER 07-01-001 079 DRIVERS AIRBAG COVER 07-01-001 27026 PERFORMED RECALL RECALL
KM8JM12B96U	1/09/06	8638	36.36	8638 BRAKE LAMP SWITCH TEST DRIVE VEHICLE CONFIRM CRUISE CONTROL NOT WORKIGN, PERFORM INSPECTION, FOUND CODE C1513 BRAKE LAMP SWITCH . REPLACE BRAKE LAMP SWITCH TEST DRIVE VEHICLE CRUISE CONTROL WORKING			
KM8JN72D76U	10/26/05	20277	36.36	20277 C1513 BRAKE LAMP SWITCH CIRCUIT BRAKE LAMP SWITCH INTERNAL FAULT, REPLACED BRAKE LAMP SWITCH TO REPAIR CLEARED CODES NO FAULT FOUND			
KM8JN12D06U	12/31/05	7500	33.64	C/S THAT INTERMIT ON START ESC LIGHT WILL STAY ON HE THEN SHUTS CAR OFF AND RESTARTS AND LIGHT WILL GO AWAY. DUP CONCERN FOUND DTC C1513 STOP LAMP SWITCH MAL REPLACED STOP LAMP SWITCH VEH WORKING TO SPECS	CUSTOMER STATES THAT AFTER VEHICLE SITTING FOR TWO DAYS HE HAS TO JUMP START CHECK AND ADVISE REFER RO 398595 TECH 6301	RECHECKED BATTERY,READ LOW AND NEEDED CHARGE.CHARGED AND CHECKED AGAIN,FAILED LOAD TEST	REPLACED BATTERY,CHECKS GOOD AT THIS TIME
KM8JN12D66U	7/16/05	27026	35.74		CUSTOMER STATES WHEN DRIVING ESC LIGHT COMES ON	CODE C1503/C1513 BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE 27026 CODE C1503/C1513 BRAKE SWITCHREPLACED BRAKE
KM8JM12B46U	9/09/05	21772	36.06	21772 CODE C1513 BRAKE LAMP SWITCH INTERNAL FAILURE REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES THE ESC LIGHT STAYSON, WHEN THE VEHICLE IS PUT INTO REVERSE THE LIGHT COMES ON, IF NOT ON ALREADY	CODE C1513 BRAKE LAMP SWITCH INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE 21772 CODE C1513 BRAKE LAMP SWITCH INTERNALFAILURE REPLACED BRAKE LAMP SWITCH
KM8JN12D06U	8/10/05	10082	37.7	10082 C1513 BRAKE LAMP SWITCH MALFUNCTION INTERNAL REPLACE BKAKE LAMP SWITCH	CUSTOMER STATES ESC LIGHT COME ON WHEN DRIVING	INTERNAL FAILURE NECTO REPLACE BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE 10082 C1513 BRAKE LAMP SWITCH MALFUNCTIONINTERNAL REPLACE BKAKE LAMP SWITCH
KM8JN12D06U	12/31/05	7500	33.64	C/S THAT INTERMIT ON START ESC LIGHT WILL STAY ON HE THEN SHUTS CAR OFF AND RESTARTS AND LIGHT WILL GO AWAY. DUP CONCERN FOUND DTC C1513 STOP LAMP SWITCH MAL REPLACED STOP LAMP SWITCH VEH WORKING TO SPECS	CUSTOMER STATES THAT INTERMITTENTLY ON START ESC LIGHT WILL STAY ON HE THEN SHUTS CAR OFF AND RESTARTS AND LIGHT WILL GOAWAY	DUPLICATE CUSTOMER CONCERN, FOUND DTC C1513 STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH VEHICLE WORKING TO SPECS
KM8JN12D46U	1/04/06	25417	37.86	C/S ESC LIGHT IS OFF AND ON. C1513 CODE BRAKE LAMP SWITCH FAILURE REPLACED BRAKE LAMP SWITCH R/T VERIFIED RPR ALL AT FACTORY	FACTORY WARR/CUSTOMER STATES - ESC LIGHT IS OFF AND ON	C1513 CODE BRAKE LAMP SWITCH FAILURE	REPLACED BRAKE LAMP SWITCH TEST DROVE VERIFIED REPAIR ALL AT FACTORY SPEC
KM8JM12B45U	4/13/05	27199	36.5	27200 FOUND CODSE C1513 BRAKC LAMP SWITCH REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES THAT THAT ESP LIGHTGOES ON AND OFF. CUSTOMER TRIED TO DETERMINE WHEN THIS OCCURS AND IT DOES IT AT NO PARTICULAR TIME AND NO PARTICULAR WEATHER CONDITION		SWITCH ASSY-STOP LAMP RE 27200 FOUND CODSE C1513 BRAKC LAMP SWITCHREPLACE BRAKE LAMP SWITCH
KM8JN12D86U	9/26/05	30190	36.06	30192 BRAKES SWITCH OPEN CIRCUIT SCANED CODES 1513. FOUND BRAKE SWITCH OPEN INFINITE RESISTANCE WITH SWITCH CLOSED. REPLACED BRAKE SWITCH TEST DRIVE VEHILCE 3 MILES	CUSTOMER STATES ESC LIGHT STAYS ON	BRAKES SWITCH OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE 30192 BRAKES SWITCH OPEN CIRCUIT SCANEDCODES 1513. FOUND BRAKE SWITCH OPEN INFINITERESISTANCE WITH SWITCH CLOSED. REPLACED BRAKESWITCH TEST DRIVE VEHILCE 3 MILES
KM8JN12D46U	1/04/06	25417	37.86	C/S ESC LIGHT IS OFF AND ON. C1513 CODE BRAKE LAMP SWITCH FAILURE REPLACED BRAKE LAMP SWITCH R/T VERIFIED RPR ALL AT FACTORY	CUTOMER STATES CRUISE CONTROL WILL NOT ACTIVATE	TEST DROVE VEHICLE VERIFIED CRUISE CONTROL WORKS. VERIFIED WITH SERVICE MANAGER	NO PROBLEM FOUND WITH VEHICLE TEST DROVE SEVERAL TIMES CRUISE SET EACH TIME AT SPEEDS ABOVE 45MPH. SEE ADVISOR

KM8JM12B96U		9/13/05	30290	33.96	C/S ESC LIGHT IS ON. INTERNAL FAILURE REPLACED SWITCH RETESTED ALL OPERATIONS NORMAL			
KM8JN12D75U		6/02/05	44852	37.86	TESTED CIRCUIT FOUND STOP LAMP SWITCH WITH INTERMIT OPEN CIRCUIT REPLACED STOP LAMP SWITCH GOOD AT THIS TIME	CUSTOMER STATES THAT THE ESP LIGHT COMES ON WHILE DRIVING. INTERMITTENT PROBLEM. WHEN THE LIGHT COMES ON IT STAYS ON UNTIL THE CAR IS SHUT OFF. WHEN CAR IS TURNED ON SOMETIMES THE LIGHT WILL BE ON AND SOMETIMES THAT LIGHT WILL BE OFF. CHECK AND	TESTED CIRCUIT, FOUND STOP LAMP SWITCH WITH INTERMITTENT OPEN CIRCUIT	REPLACED STOP LAMP SWITCH. GOOD AT THIS TIME E
KM8JM12B56U		7/15/05	12309	36.5	12340 FOUND CODE C1503TCS SWITCH ERROR & C1513 BRAKE SWITCH CIRCUIT MAL. TESTED ALL WIRING FRO M TCS SWITCH TO THE HECU. ALL ELECTRICAL WAS OK. TEST SWITCH. SWITCH OK. FOUND HECU AT FALUT DUE TO INTERNAL SHORT TO GROUND. INSTALLED NEW HECU AND CLEARED CODE	CUSTOMER STATES CHECK ENGINE LIGHT ON	F	HYDRAULIC MODULE ASSY - ABS RE HYDRAULIC MODULE ASSY - ABS RE 12309 VERIFIED CONCERN. CODE P0455:EVAP SYS. LARGE LEAK (TANK CAP LOOSE OR OFF). FOUND THE GAS CAP LANYARD BETWEEN THE SEAL. REINSTALLED GAS CAP AND PERFORMED A EVAP LEAK DOWN TEST. TEST PASSED.
KM8JM12B56U		7/15/05	12309	36.5	12340 FOUND CODE C1503TCS SWITCH ERROR & C1513 BRAKE SWITCH CIRCUIT MAL. TESTED ALL WIRING FRO M TCS SWITCH TO THE HECU. ALL ELECTRICAL WAS OK. TEST SWITCH. SWITCH OK. FOUND HECU AT FALUT DUE TO INTERNAL SHORT TO GROUND. INSTALLED NEW HECU AND CLEARED CODE	CUSTOMER STATES CHECK ENGINE LIGHT ON	F	HYDRAULIC MODULE ASSY ADD SCAN TOOL OPERATION HYDRAULIC MODULE ASSY ADD SCAN TOOL OPERATION 12309 VERIFIED CONCERN. CODE P0455:EVAP SYS. LARGE LEAK (TANK CAP LOOSE OR OFF). FOUND THE GAS CAP LANYARD BETWEEN THE SEAL. REINSTALLED GAS CAP AND PERFORMED A EVAP
KM8JM12B66U		7/14/05	17209	32.25	C/S BRAKE LIGHTS DONT COME ON WHEN BRAKES DEPRESSED. INSPECTED AND FOUND STOP LAMP SWITCH SHORTED OUT INTERNAL FAULTY RE REMOVED CRASH PANEL TO GAIN ACCESS TO SWITCH REPLACED STOP SWITCH REINSTALLED PANEL VERIFIED WORK ALL AT AT	CUSTOMER STATES BRAKE LIGHTS DONT COME ON WHEN BRAKES DEPRESSED	INSPECTED AND FOUND STOP LAMP SWITCH SHORTED OUT INTERNAL FAILURE	REMOVED CRASH PANEL TO GAIN ACCSES TO SWITCH REPLACED STOP STOP SWITCH REINSTALLED PANEL VERIFIDE WORK ALL AT FACTORY SPECS
KM8JM12BX5U		6/23/05	22307	33.64	C/S INTERMIT WHILE DRIVING ESP OFF LIGHT COMES ON STAYS ON TIL SHUTOFF RESTART LIGHT GONE. DTC P2524 SHORT IN BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES INTERMITTENT WHILE DRIVING. ESP OFF LIGHT COMES ON STAYS ON TIL SHUTOFF RESTART LIGHT GONE	DTC2524 SHORT IN BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JM12B56U		7/15/05	12309	36.5	12340 FOUND CODE C1503TCS SWITCH ERROR & C1513 BRAKE SWITCH CIRCUIT MAL. TESTED ALL WIRING FRO M TCS SWITCH TO THE HECU. ALL ELECTRICAL WAS OK. TEST SWITCH. SWITCH OK. FOUND HECU AT FALUT DUE TO INTERNAL SHORT TO GROUND. INSTALLED NEW HECU AND CLEARED CODE	CUSTOMER STATES ESC LIGHT FOR THE PAST 5 DAYS COMES ON AND WILL STAY ON. THEN SOMETIMES IT WILL FLASH ON AND OFF	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 12340 FOUND CODE C1503:TCS SWITCH ERROR & C1513: BRAKE SWITCH CIRCUIT MAL. TESTED ALL WIRING FRO M TCS SWITCH TO THE HECU. ALLELECTRICAL WAS OK. TEST SWITCH. SWITCH OK. FOUND HECU AT FALUT DUE TO INTERNAL SH
KM8JN72D66U		7/22/05	28242	35.74	28243 INTERNAL FAILURE INOPERTAIVE NEC TO REPLACE BRAKE LAMP SWITCH	079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	RECALL	079 DRIVERS AIRBAG COVER 07-01-001 079 DRIVERS AIRBAG COVER 07-01-001 28243 RECALL RECALL COMPLETED
KM8JN12DX6U		9/23/05	12368	33.64	C/S INTERMIT ON STARTUP ESC OFF LIGHT STAYS ON ONLY GOES OFF AFTER 1ST TRIP AFTER RESTART LIGHT IS OFF HAS HAPPENED MULTIPLE TIMES. PULLED CODE C1513 BRAKE SWITCH CIRCUIT CHKD CONNECTION SECURE REPLACED BRAKE LIGHT SWITCH ERASED CODE DID NOT RETURN COULD			
KM8JN12D86U		1/07/06	11386	33.96	C/S CRUISE CONTROL DOES NOT WORK. FOUND FAULTY BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH WORKING TO FACTORY SECS AT THIS TIME			
KM8JM12B66U		7/12/05	18799	35.6	C/S ESC LIGHT STAYS ON - SPO. SWITCH IS SHORTED OUT INSTALLED NEW SWITCH CHECKED OP ALL NORMAL	CUST STATES ESC LIGHT STAYS ON INSTALL SPO RO 239680 06/05/06 - CHARGED OUT ON RO#239680		INSTALLED SPO PART
KM8JN72D66U		7/22/05	28242	35.74	28243 INTERNAL FAILURE INOPERTAIVE NEC TO REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES ESC LIGHT KEEPS COMING ON THEN IT GOES OFF		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 28243 INTERNAL FAILURE INOPERTAIVE NEC TO REPLACE BRAKE LAMP SWITCH
KM8JM12B96U		12/02/05	16824	35.74	16824 BRAKE LAMP SWITCH INOP REPLACED STOP LAMP SWITCH ASSY	CUSTOMER STATES ESC LIGHT IS ON	BRAKE LAMP SWITCH INOP	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16824 BRAKE LAMP SWITCH INOP REPLACED STOP LAMP SWITCH ASSY
KM8JN12D26U		7/22/05	18009	36.34		CUSTOMER STATES THE ESC LIGHT WAS COMING ON AND STAYING ON, INSTALL SPECIAL ORDERED SWITCH AS PER PRIOR INSPECTION/ORDER	9415	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE VERIFIED ESC LIGHT IN ON AT TIMES, CODE C1513 IS IN MEMORY FOR STOP LIGHT SWITCH MALFUNCTION (GOES OPEN ELECTRICALLY AT TIMES), REPLACED THE STOP LIGHT SWITCH (WAS SPECIAL ORDERED LAST VISIT), CLEARED ESCM

KM8JN12D26U		7/15/05	29236	68.46	C/S 'ESC OFF' LIGHT COMES ON WHILE DRIVING. CANNOT GET SHIFTER OUT OF PARK. VERIFIED CONCERN. PULLED CODE C1513 BRAKE LIGHT SWITCH CIRCUIT FAILURE. FOUND BRAKE LAMP SWITCH OPEN AT TIMES. REPLACED SWITCH AND CLEARED CODE. ATT TIME OKAY PER SERVICE MANAGER			
KM8JN12D15U		5/31/05	25886	35.74	25888 INTERNAL FAILURE INTERNAL FAILURE SHORTED OUT NEC TO REPLACE RAKE LAMP SWITCH	079 DRIVER AIRBAG COVER MOD REPL (07-01-001) INSTALL SPECIAL ORDER PART	RECALL	079 DRIVERS AIRBAG COVER 07-01-001 079 DRIVERS AIRBAG COVER 07-01-001 25888 RECALL RECALL COMPLETED
KM8JN12D15U		5/31/05	25886	35.74	25888 INTERNAL FAILURE INTERNAL FAILURE SHORTED OUT NEC TO REPLACE RAKE LAMP SWITCH	CUSTOMER STATES ESP LIGHT IS ON	INTERNAL FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 25888 INTERNAL FAILURE INTERNAL FAILURE SHORTED OUT NEC TO REPLACE RAKE LAMP SWITCH
KM8JM12B85U		7/05/05	19837	35.74	19843 BRAKE LAMP SWITCH DEFECTIVE INOPERATIVE REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES TRIM ON ALL 4 DOORS IS LOOSE	ALL FOUR DOOR PANEL MATERIAL PULLING LOOSE POOR ADHESIVE	PANEL ASSY-FRONT DOOR TRIM (BOTH SIDES) PANEL ASSY-FRONT DOOR TRIM (BOTH SIDES) 19843 ALL FOUR DOOR PANEL MATERIAL PULLING LOOSE POOR ADHESIVE NEC TO REPAIR ALL FOUR DOOR PANELS- MATERIAL COMING LOOSE- POOR ADHESIVE- REFIT AND GLUE MATERIAL TO
KM8JM12B66U		11/21/05	7050	38.3		CUSTOMER STATES ESC LIGHT WILL COME ON WHEN APPLYING BRAKES, AND CAN NOT TURN OFF WITH ESC BUTTON INSPECT AND ADVISE	9415	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE DUPLICATED CUSTOMER CONCERN, INSPECTED AND FOUND BRAKE LIGHT SWITCH INTERNALLY OPEN. REPLACED BRAKE LIGHT SWITCH, CLEARED CODES RECHECK BRAKE LIGHT SWITCH, ROAD TEST BRAKES OPERATING NORMAL, RECHECK FOR CODE
KM8JN72D15U		11/12/04	25503	38.62		CUSTOMER STATES 'ESP OFF' LIGHT STAYS ON ALL THE TIME WHILE DRIVING. CHECK AND ADVISE.	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE ROAD TEST, ESP LIGHT NOT ON. SCAN FOR CODES. C1 513- STOP LIGHT SWITCH MALFUNCTION. REPLACED SWITCH.
KM8JN12D45U		5/31/05	34073	68.46	C/S ESC LIGHT IS ON. PULLED CODE C1573 BRAKE LIGHT SWITCH MAL. SWITCH HAS INTERNAL FAILURE. REPLACED SWITCH. ATT TIME OKAY PER SVC MNGR FOR GDS.			
KM8JM12B85U		7/05/05	19837	35.74	19843 BRAKE LAMP SWITCH DEFECTIVE INOPERATIVE REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES REAR WINDOW DEFOGGER IS INOP	FOUND WIRE TO REAR WINDOW DEFOGGER LOOSE	WIRE REPAIR TIME (MAJOR)- ADJUSTMENT WIRE REPAIR TIME (MAJOR)-ADJUSTMENT 19843 FOUND WIRE TO REAR WINDOW DEFOGGER LOOSE REPAIR WIRE TO CORRECT
KM8JM12B85U		7/05/05	19837	35.74	19843 BRAKE LAMP SWITCH DEFECTIVE INOPERATIVE REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING	BRAKE LAMP SWITCH DEFECTIVE INOPERATIVE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 19843 BRAKE LAMP SWITCH DEFECTIVE INOPERATIVE REPLACE BRAKE LAMP SWITCH
KM8JM12BX5U		6/24/05	10644	36.34		PERFORM DRIVER AIRBAG COVER MODULE REPLACEMENT (07-01-001) 61B046R0	CPN	DRIVERS AIRBAG MODULE REPLACEMENT CAMPAIGN DRIVERS AIRBAG MODULE REPLACEMENT CAMPAIGN COMPLETED DRIVERS AIRBAG COVER MODULE REPLACEMENT NOT OK.
KM8JM12BX5U		6/24/05	10644	36.34		CUSTOMER STATES THE DRIVERS DOOR PANEL MATERIAL IS COMING APART NEAR INSIDE HANDLE	8663	PANEL ASSY-FRONT DOOR TRIM (LH) RE PANEL ASSY-FRONT DOOR TRIM (LH) RE DRIVER DOOR PANEL MATERIAL COMING LOOSE. INSTALL LED NEW DOOR PANEL.
KM8JM12BX5U		6/24/05	10644	36.34		CUSTOMER STATES THE DRIVERS FLOOR MAT MATERIAL IS COMING LOOSE FROM RUBBER PORTION, INSTALL SPECIAL ORDERED MAT AS PER PRIOR INSPECTION/ORDER	5263	FRONT CAR MAT (ONE SIDE) FRONT CAR MAT (ONE SIDE) CARPET COMING LOOSE FROM FLOOR MATS. THE FLOOR MATS NO LONGER AVAILABLE, INSTALLED UPDATED FLOOR MATS.
KM8JM12B85U		7/05/05	19837	35.74	19843 BRAKE LAMP SWITCH DEFECTIVE INOPERATIVE REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES TRIM ON ALL 4 DOORS IS LOOSE	ALL FOUR DOOR PANEL MATERIAL PULLING LOOSE POOR ADHESIVE	82330 ATT MISC 19843 ALL FOUR DOOR PANEL MATERIAL PULLING LOOSE POOR ADHESIVE NEC TO REPAIR ALL FOUR DOOR PANELS- MATERIAL COMING LOOSE- POOR ADHESIVE- REFIT AND GLUE MATERIAL TO
KM8JM12B85U		7/05/05	12298	36.5	12298 BRAKE LAMP SWITCH OPEN/ SHORT TO GROUND. C1513 BRAKE SWITCH CIRCUIT FAILURE. VERIFIED BRAKE LAMP SWITCH IS INOP. NOTE TO CUSTOMER THIS WILL CAUSE YOUR BRAKE LIGHTS NOT TO WORK.	CUSTOMER STATES THE ESP LIGHT IS ON	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 12298 BRAKE LAMP SWITCH OPEN/ SHORT TO GROUND. C1513: BRAKE SWITCH CIRCUIT FAILURE. VERIFIED BRAKE LAMP SWITCH IS INOP. NOTE TO CUSTOMER: THIS WILL CAUSE YOUR BRAKE LIGHTS NOT TO WORK.

KM8JN12D05U	6/13/05	21232	35.74	21232 CODE B1513 BRAKE SWITCH WORKING INTERMITTENTLY VERIFIED CONCERN AND REPLACED DEFECTIVE BRAKE SWITCH	CUSTOMER STATES TO PERFORM AIR BAG RECALL	PERFORMED RECALL	079 DRIVERS AIRBAG COVER 07-01-001 079 DRIVERS AIRBAG COVER 07-01-001 21232 PERFORMED RECALL. REPLACED DRIVER AIRBAG PER RECALL
KM8JM12BX5U	6/24/05	10644	36.34		CUSTOMER STATES THE ESP LIGHT ON DASH COMES ON WHILE DRIVING AT TIMES, INSTALL SPECIAL ORDERED SWITCH AS PER PRIOR INSPECTION	9415	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE ESP LIGHT ON IN DASH. FOUND A C1513 CODE,BRAKE SWITCH MALFUNCTION. TESTED SWITCH WITHOHM MET ER, WIGGLED STOPPER AND FOUND ATTIMES SWITCH W ILL GO OPEN. REPLACED SWITCH,CLEANED CODE. ROA D TESTED
KM8JN12D16U	12/28/05	9715	33.19		CUST STATES CRUISE CONTROL WILL NOT WORK PARTS IN STOCK	VERIFIED THE BRAKE SWITCH HAD AN OPEN SHORT	REPLACED THE BRAKE SWITCH CHKS OKAY
KM8JN12D05U	6/13/05	21232	35.74	21232 CODE B1513 BRAKE SWITCH WORKING INTERMITTENTLY VERIFIED CONCERN AND REPLACED DEFECTIVE BRAKE SWITCH	CUSTOMER STATES ESC LIGHT COMES ON.	CODE B1513 BRAKE SWITCH WORKING INTERMITTENTLY	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21232 CODE B1513 BRAKE SWITCH WORKINGINTERMITTENTLY VERIFIED CONCERN AND REPLACEDDEFECTIVE BRAKE
KM8JN12D46U	11/01/05	23592	35.74	23592 REPLACED DEFECTIVE BRAKE LIGHT SWITCH			
KM8JN72D76U	12/27/05	11267	33.19	TEST DROVE CRUISE WILL NOT SET FOUND BRAKE SWITCH PINS 3&4 ARE OPEN INTERNALLY.WILL NOT COMPLETE CIRCUIT FOR CRUISE.REPL SWITCH DUE TO INTERNAL FAULT.RETEST OK AT	CUST STATES CRUISE CONTROL WILL NOT SET CHK/ADV	VERIFIED OPEN CIRCUIT TO BRAKE SWITCH	REPLACED SWITCH CRUISE WORKS AS DESIGNED
KM8JN12D16U	12/28/05	18428	33.51	VARY SHORT IN STOP SWITCH AND REPLACE	CUST STATES ESC LIGHT WILL COME ON THEN GO OFF ON ITS OWN CHK/ADV	FOUND INTERNAL FAULT OF SWITCH	REPLACED THE BRAKE SWITCH
KM8JN12D16U	12/28/05	18428	33.51	VARY SHORT IN STOP SWITCH AND REPLACE	CUST STATES SPRING IS SPRUNG OR CRACKED IN FRNT CUP HOLDER CHK/ADV	VERIFIED SPRING ASSY HAS FAILED AND SIEZED	REPLACED CUP HOLDER ASSY WORKS AS DESIGNED
KM8JM12B26U	7/19/05	25453	36.06	25453 CODE C1513 BRAKELAMP SWITCH SHORT REPLACED BRAKE LAMP SWITCH ASSY	CUSTOMER STATES THE ESC LIGHT COMESON INTERMITTENTLY	CODE C1513 BRAKELAMP SWITCH SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 25453 CODE C1513 BRAKELAMP SWITCH SHORTREPLACED BRAKE LAMP SWITCH ASSY
KM8JN12D46U	2/28/06	27538	36.06	27538 CODE C1513 BRAKE LIGHT SWITCH INOP REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES ESC LIGHT COMES ON AT TIMES WHEN DRIVING	CODE C1513 BRAKE LIGHT SWITCH INOP	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 27538 CODE C1513 BRAKE LIGHT SWITCH INOPREPLACED BRAKE LIGHT SWITCH
KM8JN12D46U	9/25/05	21619	36.06	21621 BRAKE SWITCH HIGH RESISTANCE SCANNED CODES C1513. MEASURE BRAKE LAMP SWITCH RESISTANCE WITH THE SWITCH DEPRESSED 5.5 OHMS SPEC 0.1- 1 OHM. REPLACED BRAKE LAMP SWITCH TEST DRIVE CAR. OK AT THIS TIME.	CUSTOMER STATES WHEN DRIVING ESC LIGHT COMES ON	BRAKE SWITCH HIGH RESISTANCE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21621 BRAKE SWITCH HIGH RESISTANCE SCANNEDCODES C1513. MEASURE BRAKE LAMP SWITCHRESISTANCE WITH THE SWITCH DEPRESSED 5.5 OHMSPEC. 0.1- 1 OHM. REPLACED BRAKE LAMP SWITCHTEST DRIVE CAR. OK AT THIS TIME.
KM8JN12D66U	12/05/05	9437	38.3		CUST STS THT THE CRUISE CONTROL IS STILL INOP	TECH FOUND AN OPEN CIRCUIT IN THE BRAKE PEDAL SWITCH WHICH WOULD NOT LET THE CRUISE CONTROL ENGAGE WHEN TRYING TO SET	REPLACED BRAKE PEDAL SWITCH AND TEST DROVE VEHICLE AND CRUISE CONTROL IS WORKING NORMAL.
KM8JM12B26U	2/13/06	9118	36.34	SCAN TOOL CODE C1513	CUSTOMER STATES ESC LIGHT COMES ON AND GOES OFF WHEN DRIVING- NOT ON UPON WALAROUND.	SCAN FOR CODES C1513 BRAKE LIGHT SWITCH OPEN FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12D66U	12/16/05	18491	63.34	ST TIME FOR SCAN TOOL CODE C1513	CUSTOMER STATES TO PERFORM SERVICE CAMPAIGN 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT	UPDATED DAB COVER MODULE AS OUTLINED IN SERVICE CAMPAIGN 079	PERFORMED AND REPLACED DAB SERVICE CAMPAIGN 079
KM8JN12D85U	7/04/05	19645	35.74	19646 INTERNAL FAILURE OF THE BRAKE LIGHT SWITCH. INSTALLED BRAKE LIGHT SWITCH & THE VEHICLE IS OPERATING NORMALLY.	CUSTOMER STATES THE ESP LIGHT COMESON @ TIMES.	INTERNAL FAILURE OF THE BRAKE LIGHT SWITCH.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 19646 INTERNAL FAILURE OF THE BRAKE LIGHTSWITCH.
KM8JN12D66U	8/09/05	8457	36.5	8457 FOUND CODE C1513 BRAKE LAMP SWITCH PERFORMED TSB FOR SONATA SWITCH. HAS INTERNAL OPEN CIRCUIT. INSTALLED NEW SWITCH. NORMAL AT THIS TIME.	CUSTOMER STATES THAT THE ESC LIGHT KEEPS COMING ON	REPOSITIONED	BRAKE PEDAL RE BRAKE PEDAL RE 8457 FOUND CODE C1513 BRAKE LAMP SWITCHPERFORMED TSB FOR SONATA SWITCH. HAS INTERNALOPEN CIRCUIT. INSTALLED NEW SWITCH.
KM8JN12D66U	12/16/05	18491	63.34	ST TIME FOR SCAN TOOL CODE C1513	CUSTOMER STATES THAT THE ESC LIGHT HAS BEEN COMING ON	FOUND ESC CODE #C1513 INTERNAL OPEN SHORT INSIDE BRAKE LIGHT SWITCH	REP. BRAKE LIGHT SWITCH AND CLEARAD CODE. FOUND NO MORE PROBLEMS AFTER REPAIRS AT RETEST AT THIS TIME
KM8JN12D66U	12/16/05	18491	63.34	ST TIME FOR SCAN TOOL CODE C1513	CUSTOMER STATES THAT THE CRUISE CONTROL WILL COME ON BUT NOT SET - S.O.P. MODULE	FOUND OPEN SHORT INTERNAL OF CRUIS MODULE	REP. CRUIS MODULE AND FOUND NO MORE PROBLEMS DURING TEST DRIVE AFTER REPAIRS
KM8JN12D66U	12/16/05	18491	63.34	ST TIME FOR SCAN TOOL CODE C1513	CUSTOMER STATES THAT THE RUBBER SEALS BETWEEN FENDER FLAIRS ON DRIVER'S SIDE HAVE FADED	FOUND RIGHT SIDE FENDER RUPPER FADED	PARTS ARE SOP. AT THIS TIME
KM8JN12D66U	8/09/05	8457	36.5	8457 FOUND CODE C1513 BRAKE LAMP SWITCH PERFORMED TSB FOR SONATA SWITCH. HAS INTERNAL OPEN CIRCUIT. INSTALLED NEW SWITCH. NORMAL AT THIS TIME.	CUSTOMER STATES THAT THE ESC LIGHT KEEPS COMING ON	REPOSITIONED	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 8457 FOUND CODE C1513 BRAKE LAMP SWITCHPERFORMED TSB FOR SONATA SWITCH. HAS INTERNALOPEN CIRCUIT. INSTALLED NEW SWITCH. NORMAL ATTHIS TIME.

KM8JN12D75U	6/24/05	17893	35.74	17897 INTERNAL FAILURE SHORTED OUT NEC TO REPLACE BRAKE LAMP SWITCH TO CORRECT	CUSTOMER STATES ESP LIGHTS GOES ON AND OFF ON THE DASH, INSTALL SPECIAL ORDER PART	INTERNAL FAILURE SHORTED OUT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 17897 INTERNAL FAILURE SHORTED OUT NEC TO REPLACE BRAKE LAMP SWITCH TO CORRECT
KM8JN12D76U	8/17/05	19217	36.34		CUSTOMER STATES THAT THE ESC LIGHT HAS BEEN COMING ON	C1513 STOP LAMP SWITCH OPEN CIRCUIT	REPLACED STOP LAMP SWITCH
KM8JM12B35U	6/29/05	13792	65.3	SCAN TOOL CODE C1513	CUST STS THT THE ESP LIGHT WILL NOT TURN OFF THE ONLY WAY TO TURN IT OFF IS TO KILL THE IGN	C1513 BRAKE SWITCH OPEN/SHORT	REPLACE SWITCH
KM8JN12D05U	5/20/05	23153	38.3	SCAN TOOL CODES C1503 AND C1513	CUSTOMER STATES THE CAR IS SLOW TO START. ACTS LIKE THE BATTERY MAY BE GOING DEAD. PLEASE CHECK AND ADVISE.	SCANNED BATTERY USING MIDTRONIC BATTERY SCANNER AND BATTERY TESTED BAD WITH ONLY 303CCA OUT OF 700CCA.	TECH REPLACED BATTERY AND NO OTHER PROBLEMS WERE FOUND.
KM8JN12D46U	10/11/05	31937	36.06	31938 CODE 1513 BRAKE LAMP SWITCH OPEN REPLACED THE BRAKE LAMP SWITCH.	UPON INSPECTION FOUND CODE FOR THE BRAKE LIGHT SWITCH.	CODE 1513 BRAKE LAMP SWITCH OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 31938 CODE 1513 BRAKE LAMP SWITCH OPEN REPLACED THE BRAKE LAMP SWITCH.
KM8JM12B16U	7/12/05	34441	36.06	34443 CODE C1513 SET INTERNAL FIALURE IN BRAKE LAMP SWITCH REPLACE BRAKE LAMP SWITCH TO CORRECT	079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	RECALL COMPLETED	079 DRIVERS AIRBAG COVER 07-01-001 079 DRIVERS AIRBAG COVER 07-01-001 34443 RECALL COMPLETE. RECALL COMPLETED
KM8JM12B16U	7/12/05	34441	36.06	34443 CODE C1513 SET INTERNAL FIALURE IN BRAKE LAMP SWITCH REPLACE BRAKE LAMP SWITCH TO CORRECT	CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING	CODE C1513 SET INTERNAL FIALURE IN BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 34443 CODE C1513 SET INTERNAL FIALURE INBRAKE LAMP SWITCH REPLACE BRAKE LAMP SWITCH TO CORRECT
KM8JN12D05U	5/20/05	23153	38.3	SCAN TOOL CODES C1503 AND C1513	CUSTOMER STATES THT THE ESP LIGHT WILL NOT SHUT OFF	SCANNED FOR CODES FOUND C1503 TCS/ESP SWITCH AND C1513 BRAKE LAMP SWITCH. VEHICLE HAD NO BRAKE LIGHTS.	TECH REPLACED BRAKE LAMP SWITCH AND ERASED CODES AND CODES DID NOT COME BACK AND VEHICLE HAS BRAKE LIGHTS NOW.
KM8JN12D05U	5/20/05	23153	38.3	SCAN TOOL CODES C1503 AND C1513	CUST STS THT THE RIGHT FOGLIGHT IS INOP	TECH INSPECTED FOG LIGHT BULB AND FOUND THAT THE BULB HAD AN OPEN CIRCUIT IN IT.	REPLACED RIGHT FRONT FOG LIGHT BULB.
KM8JN12D76U	4/05/06	17039	33.66				
KM8JM12B76U	1/07/06	30004	33.66				
KM8JM12B25U	4/27/05	30169	33.34				
KM8JN12D95U	9/03/04	25246	32.23				
KM8JN12D05U	5/20/05	23153	38.3	SCAN TOOL CODES C1503 AND C1513	CUSTOMER STATES FABRIC ON PASSENGER REAR ARM REST IS COMING APART. PLEASE CK AND ADVISE	TECH VERIFIED CONCERN FOUND MATERIAL WEAK CAUSING FABRIC TO COME APART. INSPECTED BY SERVICE	SUBLET TO REPAIR AND DYE REAR PASSENGER DOOR PANEL SUBLET TO CREATIVE COLORS
KM8JN12D96U	8/16/05	12300	38.3		CUSTOMER STATES THE REAR BRAKE LIGHTS WERE STAYING ON-OFF NOW	OPEN CIRCUIT IN BRAKE LAMP SWITCH ASSY.	REPLACED BRAKE LAMP SWITCH ASSY AND LIGHTS ARE WORKING WHEN BRAKE PEDAL IS DEPRESSED.
KM8JN12D56U	8/09/05	18387	65.3	ST TIME FOR SCAN TOOL TIME P1513	C/S ESC LIGHT ON INTERMIT CHECK HISTORY	P1513 BRAKE LIGHT SWITCH OPEN CIRCUIT CAUSING THE ESC LIGHT TO COME ON	TECH REPLACED BRAKE LIGHT SWITCH AND ERASED CODE
KM8JN12D35U	4/22/05	13469	33.34				
KM8JN12D06U	7/18/05	18085	25.34		CUSTOMER STATES THAT ESC LIGHT WILL NOT GO OFF	INOP	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY
KM8JN12D06U	7/18/05	18085	25.34		RECALL:079	RECALL	079 RECALL 079 RECALL
KM8JM12B06U	7/22/05	15278	35.15		CUSTOMER STATES ESC LIGHT STAYS ON	INTERNAL FAILURE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE EEC TEST/FOUND CODE C1513 REPLACED BRAKE LIGHT SWITCH
KM8JN12D56U	8/09/05	18387	65.3	ST TIME FOR SCAN TOOL TIME P1513	CUSTOMER STATES DOME LIGHT INOP INTERMIT AFTER SUNROOF REPAIR	FOUND THE DOME LIGHT SWITCH TO HAVE AN OPEN CIRCUIT CAUSING IT TO NOT WORK AT	REPLACED DOME LIGHT SWITCH ASSY
KM8JN12D56U	8/09/05	18387	65.3	ST TIME FOR SCAN TOOL TIME P1513	CUSTOMER STATES WEATHER STRIP BEHIND CLADDING IS FADED	FOUND THE ALL 6 TRIM STRIPS BEHIND FRT FENDER CLADINGS, REAR DOOR CLADINGS AND REAR QUARTER CLADINGS TO BE	TECH REMOVED ALL CLADINGS, CLEANED AND INSTALLED NEW TRIM STRIPS.
KM8JN12D05U	5/20/05	12490	36.8		CUSTOMER STATES THE ESP LIGHT STAYS ON SOP HERE	C1513 STORED IN ESP CONTROL MODULE-BRAKE LAMP MALFUNCTION	R&R BRAKE LAMP SWITCH. CLEAR TROUBLE CODES AND TEST DRIVE-OK
KM8JN12D15U	5/21/05	14048	35.15		CUST STATES BRAKE LIGHTS ARE INOP	INOPERATIVE BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED BRAKE LIGHT SWITCH
KM8JN72D55U	11/25/04	43475	23.85		CUST STATES RESUME ON CRUISE CONTROL IS INOP	TECH STATES BRAKE LIGHT SWITCH IS INOPERATIVE	STOP LAMP SWITCH ASSEMBLY STOP LAMP SWITCH ASSEMBLY REPLACED BRAKE LIGHT SWITCH
KM8JN12D25U	10/02/04	23020	31.8		CUSTOMER STATES REAR LEFT PASSENGER LOWER DOOR PANEL COMMING LOOSE...	PART IS DEFECTED....	TECH STATES PART ON ORDER... MAINTENANCE, MISC
KM8JN12D05U	5/20/05	12490	36.8		RENTAL		RENTAL
KM8JN12D66U	11/28/05	22329	63.34	ST TIME IS FOR SCAN TOOL CODE C1513			
KM8JN12D95U	5/20/05	25567	54.66	REPLACED BRAKE LIGHT SWITCH AND CLEARED CODES OK-ST TIME IS FOR SCAN TOOL CODE C1513 SWITCH HAD AN OPEN	CUSTOMER STATES ESP OFF LIGHT KEEPS COMING ON AND OFF WHEN DRIVING	SCAN FOR CODES C1513 BRAKE LIGHT SWITCH CIRCUIT FOUND INTERMITTENT OPEN CIRCUIT IN BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH AND CLEARED CODES OK
KM8JM12B46U	1/06/06	25182	33.51		CUST STATES ABS/ESC LIGHT IS ON (SOP)	TECH STATES OPEN CIRCUIT IN BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED BRAKE LIGHT SWITCH
KM8JN72D76U	9/14/05	18868	35.44				
KM8JN12D06U	2/21/06	28997	35.76				
KM8JN72DX6U	9/27/05	42386	35.44				

KM8JM12B15U	6/29/05	9449	36.8		CUSTOMER STATES THE A/C BLOWS WARM UNTIL SELECTING MAX A/C THEN ALL OTHER SELECTIONS WILL WORK	NO PROBLEM FOUND	TESTED A/C DISCHARGE TEMP WITH MODE ON REGULAR A/C MODE WITH RECIRCULATION BUTTON ENGAGED- DISCHARGE TEMP IS 44 DEGREES AT IDLE. HIGH SIDE PRESSURE: 250 PSI LOW SIDE PRESSURE: 25PSI- PRESSURES WITHIN SPEC AND DISCHARGE TEMP-OK TEST DROVE VEHICLE 3 MILES(944
KM8JM12B15U	6/29/05	9449	36.8		CUSTOMER STATES THE ESP OFF LIGHT STAYS ON	C1513 STORED IN ESP CONTROL MODULE- BRAKE LAMP SWITCH MALFUNCTION(OPEN CIRCUIT)	R&R BRAKE LIGHT SWITCH AND TEST DRIVE VEHICLE-OK
KM8JN12D75U	5/18/05	29522	36.66	CODE C1513	CUSTOMER STATES AT TIMES WHEN VEH IS AT IDLE IT WILL START RUNNING ROUGH AND STALL VEH WILL RE-START AND RUN FINE	COULD NOT DUPLICATE CUSTOMERS CONCERN AT THIS TIME VEHICLE OPERATING AS DESIGNED	NO PROBLEM FOUND
KM8JN72D55U	6/16/05	37632	35.76				
KM8JN12D85U	4/04/05	13172	38.18				
KM8JM12B06U	8/13/05	27986	35.44				
KM8JN72D95U	5/24/05	32428	36.06	REPLACED BRAKE LIGHT SWITCH			
KM8JN12D75U	5/18/05	29522	36.66	CODE C1513	CUSTOMER STATES TO PERFORM SERVICE CAMPAIGN 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT	UPDATED DAB COVER MODULE AS OUTLINED IN SERVICE CAMPAIGN 079	PERFORMED AND REPLACED DAB SERVICE CAMPAIGN 079
KM8JN12D75U	5/18/05	29522	36.66	CODE C1513	CUSTOMER STATES THAT ESP LIGHT OFF IS ILLUMINATING	SCAN FOR CODES C1513 BRAKE LIGHT SWITCH CIRCUIT FAILURE FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN12DX5U	6/23/05	7905	61.88	ST TIME FOR SCAN TOOL CODE C1513	CUSTOMER STATES ESP LIGHT WILL NOT GO OFF SOP HERE	SCAN TOOLE CODE C1513 BRAKE LIGHT SWITCH MAL.	REP. BRAKE LIGHT SWITCH AND CLEARD ESP CODE.FOUND NO MORE PROBLEMS AFTER RETEST AT THIS TIME
KM8JN12D26U	7/27/05	7011	36.06	REPLACE BRAKE PEDAL SWITCH.			
KM8JN72D56U	7/19/05	8637	37.7				
KM8JN72D25U	6/11/05	14735	35.74				
KM8JN72D56U	7/19/05	38552	36.06				
KM8JN12D55U	6/07/05	41964	36.66		CUSTOMER STATES THAT THE FAN MOTOR FOR A/C CUTS OFF AND ON BUT THE AIR IS COLD	TECH 1322 DIAG. A/C CONTROLL HEAD WITH AN INTERMITTEN OPEN SHORT FOR BLOWER SWITCH	REP. A/C CONTROLL HEAD AS PER TECH 1322 1
KM8JN12D55U	6/07/05	41964	36.66		CUSTOMER STATES TO PERFORM SERVICE CAMPAIGN 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT	UPDATED DAB COVER MODULE AS OUTLINED IN SERVICE CAMPAIGN 079	PERFORMED AND REPLACED DAB SERVICE CAMPAIGN 079
KM8JN12D55U	6/07/05	41964	36.66		CUSTOMER STATES THAT THE ESC LIGHT GOES OFF AND ON	SCANED FOR DTCS PULLED CODE C1513 BRAKE SWITCH THIS WAS ESP LIGHT TO COME ON.	REPLACED BRAKE LIGHT SWITCH AND SYSTEM IS WORKING FINE AT THIS TIME.
KM8JN72D56U	7/19/05	24759	64.1	OWNER STATES THAT THE ESC LIGHT COMES ON AFTER DRIVING THE CAR 5-10 MILES. PERFORM DIAGNOSTIC SCAN -FAULT CODES C1513. TEST AND REPLACE BRAKE SWITCH			
KM8JN72D26U	8/10/05	13448	36.06				
KM8JM12B26U	8/23/05	17192	35.74				
KM8JM12B66U	7/09/05	10	20.7		BRAKE LIGHT IS DELAYED WHEN PRESSING BRAKES.	DELAY	STOP LAMP SWITCH ASS'Y RE
KM8JN12D15U	10/05/04	17532	62.62	TIME FOR SCAN TOOL CODE C1513	CUSTOMER STATES THAT THE ESP LIGHT IS ON AND OFF	SCAN FOR CODES FOUND C1513 BRAKE LAMP SWITCH, FOUND SWITCH COMING APART	REPLACE BRAKE LAMP SWITCH
KM8JN12D36U	10/08/05	30139	63.66	REPLACED BRAKE LIGHT SWITCH CLEARED CODES OK-ST TIME IS FOR CODE C1513 SWITCH HAD AN OPEN	CUSTOMER STATES ESC LIGHT IS ON	SCAN FOR CODES C1513 BRAKE LIGHT SWITCH OPEN . FOUND OPEN CIRCUIT IN BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH CLEARED CODES OK
KM8JN72D55U	5/30/05	25364	35.16		CUST STATES THAT THE CHECK ENGINE LIGHT COMES ON AND OFF	FAILED	SENSOR ASSY-OXYGEN RH (UP) RE
KM8JN72D55U	5/30/05	25364	35.16		CUST STATES THAT THE CHECK ENGINE LIGHT COMES ON AND OFF	FAILED	SENSOR ASSY-OXYGEN RH ADD4 WHEEL DRIVE
KM8JN72D55U	5/30/05	25364	35.16		CUST STATES THAT THE CHECK ENGINE LIGHT COMES ON AND OFF	FAILED	SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION
KM8JN12D86U	8/24/05	7986	56.3	ST TIME FOR SCAN TOOL CODE C1513	ECS LIGHT WILL COME ON AT TIMES NOTICED ON A PANIC STOP AND WOULD NOT TURN OFF UNTILL VEHICLE IS TURNED OFF AND ON	FOUND C1513 STORED IN ESC CONTROL MODULE- BRAKE LIGHT SWITCHMALFUNCTION(OPEN)	R&R BRAKE LIGHT SWITCH, CLEAR TROUBLE CODES AND TEST DRIVE VEHICLE-OK (7986/7990)
KM8JN12D25U	9/15/04	27874	53.23	TECH REMOVED AND REPLACED BRAKE LAMP SWITCH. TECH CLEARED DTC.ST TIME IS FOR SCAN TOOL CODE C1513	CUSTOMER STATES ECS LIGHT KEEPS COMING ON WHEN SHOULD BE OFF	TECH SCANNED FOR CODES FOUND C1513. TECH FOUND BRAKE LAMP SWITCH TO HAVE OPEN.	TECH REMOVED AND REPLACED BRAKE LAMP SWITCH. TECH CLEARED DTC.
KM8JN72D56U	10/13/05	25282	54.34	ST TIME IS FOR SCAN TOOL CODE C1513	CUSTOMER STATES THAT THE ESC OFF INDICATOR LIGHT IS ON	C1513 BRAKE LAMP SWITCH OPEN CIRCUIT CAUSING THE ESP LIGHT TO COME ON	REPLACED BRAKE LAMP SWITCH ERASED CODE
KM8JN72D55U	5/30/05	25364	35.16		CUSTOMER STATES THE ESP LIGHT IS ON	FAILED	SWITCH ASSY-STOP LAMP RE
KM8JN72D55U	5/30/05	25364	35.16		CUST STATES THAT THE HORN DOES NOT WORK	FAILED	HORN ASSY (BOTH SIDES) RE
KM8JN12D55U	8/28/04	12488	32.32		CUST STATES PASS FLOOR IS	FAILED	RUBBER STRIP
KM8JN12D55U	8/28/04	12488	32.32		CUST STATES WHEN START OF CAR MAKESA LOUD NOSIE AND ESP LIGHT COMES ON	FAILED	STOP LAMP SWITCH ASS'Y RE
KM8JM12B86U	7/14/05	19251	65.3	SCAN TOOL CODE C1513	CUST STS THT WHEN IT IS OVER 100 DEGREES OUTSIDE THE A/C WILL SHUT OFF AND WILL BLOW WARM AND KEEP CUTTING OFF	TEST DROVE CAR AT 1PM IN AFTERNOON TOOK FOR 25MILE DRIVE WITH AC ON MAX A/C	VEHICLE NEVER GAVE TECHNICIAN ANY PROBLEMS BLEW COLD WHOLE TEST DRIVE
KM8JM12B86U	7/14/05	19251	65.3	SCAN TOOL CODE C1513	CUST STS THT THE ESC LIGHT WILL COME ON BY ITSELF AND THE ENGINE WILL START TO RUN ROUGH	C1513 BRAKE LIGHT SWITCH OPEN CIRCUIT CASUING THE ESC LIGHT TO COME ON AT TIMES	REPLACED BRAKE LIGHT SWITCH AND ERASED CODES
KM8JM12B86U	7/14/05	19251	65.3	SCAN TOOL CODE C1513		SUBLET	

KM8JM12B36U	7/15/05	19485	34.84		CUSTOMER STATES THE BRAKE LIGHT STAYS ON	FAILED	SWITCH ASSY-STOP LAMP RE
KM8JM12B06U	7/09/05	24768	35.16		CUSTOMER STATES THE BRAKE LIGHTS ARE INOP	FAILED	SWITCH ASSY-STOP LAMP RE
KM8JN72D76U	10/14/05	23269	35.74				
KM8JN72D25U	5/14/05	18239	37.7				
KM8JN12D55U	4/14/05	29726	63.66	REPLACED SWITCH SYSTEM WORKING FINE AT THIS TIME-ST TIME IS FOR THE CODE C1513	CUSTOMER STATES THAT THE ESP ESC LIGHT IS ON	CHECKED FOR DTCS PULLED CODE C1513 BRAKE LAMP SWITCH OPEN CAUSING ESP LIGHT TO COME ON AND OFF.	REPLACED SWITCH SYSTEM WORKING FINE AT THIS TIME
KM8JM12B66U	12/19/05	14252	45.66	TECH REMOVD AND REPLACED BRAKE LAMP SWITCH. TECH CLEARED DTC. ST TIME IS FOR SCAN TOOL CODE C1513-FOUND OPEN IN SWITCH	CUSTOMER STATES THAT THE ESC LIGHT IS ON	TECH SCANNED FOR CODES FOUND C1513. TECH FOUND OPEN IN BRAKELAMP SWITCH.	TECH REMOVD AND REPLACED BRAKE LAMP SWITCH. TECH CLEARED DTC
KM8JM12B66U	12/19/05	14252	45.66	TECH REMOVD AND REPLACED BRAKE LAMP SWITCH. TECH CLEARED DTC. ST TIME IS FOR SCAN TOOL CODE C1513-FOUND OPEN IN SWITCH	CUSTOMER STATES THAT THE PASSENGER FRONT GRA HANDLE HAS COME OUT OF IT'S HOLDER	TEHC FOUND LH GRAB ASSIST HANDLE SCREW BACKED OUT DUE TO IMPROPER TORQUE ON SCREW.	TECH REINSTALLED AND TORQUED SCREW TO PROPER SPEC.
KM8JN72D25U	5/14/05	18239	37.7				
KM8JM12B25U	4/08/05	9274	37.7				
KM8JN72DX5U	5/19/05	18590	35.74				
KM8JN72D16U	9/28/05	17908	35.74				
KM8JN12D46U	11/19/05	16283	36.66	C/S ESC LITE IS ON-SCANNED FOR CODE C1513	CUSTOMER STATES VEHICLE ACCELERATES FORWARD ON ITS OWN WHILE PARKING AND FOOT IS OFF GAS PEDAL AS IF JERKING FORWARD	SCANNED FOR CODES NO CODES AT THIS TIME	COULD NOT DUPLICATE
KM8JN12D46U	11/19/05	16283	36.66	C/S ESC LITE IS ON-SCANNED FOR CODE C1513	CUSTOMER STATES ESC LIGHT COMES ON AND OFF SOMETIMES STAYS ON FOR DAYS AND WILL TURN OFF	SCANNED FOR CODES C1513 BRAKE LIGHT SWITCH OPEN CIRCUIT	REPLACED BRAKE LIGHT SWITCH
KM8JN72D15U	3/18/05	31638	34.63				
KM8JN72D95U	4/28/05	46288	44	ESP LIGHT IS ON SCANNED THE ONBOARD COMPUTER FOR OPEN FAULT CODE C1260 STEERING WHEEL SENSOR ABNORMAL C1513 BRAKE LAMP SWITCH CLEARED CODES AND RERAN DIAGNOSTICS CODE DID NOT RETURN			
KM8JN72D06U	9/28/05	30359	36.06				
KM8JN72D06U	10/19/05	14668	36.06				
KM8JN12D85U	4/28/05	37424	36.66	REMOVED AND REPALCED BRAKE LAMP SWITCH AND ERASED CODE NO OTHER PROBLEMS FOUND. CODE C1513	CUSTOMER STATES THAT THE ESC LIGHT KEEPS COMING ON	SCANNED FOR CODES AND FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION.	REMOVED AND REPALCED BRAKE LAMP SWITCH AND ERASED CODE NO OTHER PROBLEMS FOUND.
KM8JN12D76U	7/21/05	21977	54.34	ST TIME IS FOR SCAN TOOL CODE B2524	CUSTOMER STATES ESC LIGHT FLICKERS ON AND OFF WHEN DRIVING AND SOMETIMES STAYS ILLUMINATED ALL OF THE TIME CHECK/ADVISE	TECH VERIFIED COMPLAINT SCANNED FOR CODES FOUND B2524. TECH FOUND OPEN IN BRAKE LAMP SWITCH	TECH REPLACED BRAKE LAMP SWITCH AND CLEARED DTC
KM8JN12D76U	7/21/05	21977	54.34	ST TIME IS FOR SCAN TOOL CODE B2524	CUSTOMER STATES TO PERFORM SERVICE CAMPAIGN 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT	UPDATED DAB COVER MODULE AS OUTLINED IN SERVICE CAMPAIGN 079	PERFORMED AND REPLACED DAB SERVICE CAMPAIGN 079
KM8JN72D35U	4/27/05	43316	36.06	ADJUSTED BRAKE SWITCH PER TECH. SERVICE BULLITEN. ADJUSTMENT DID NOT CORRECT PROBLEM. REPLACED BRAKE SWITCH AND RECHECKED.			
KM8JN72D66U	9/27/05	24551	36.06				
KM8JN72D35U	4/27/05	41332	36.06				
KM8JN12D66U	9/15/05	13089	38.3		CUSTOMER STATES ESC LIGHT ON INTERMITTEN	CODE C1513 STOP LAMP SWITCH OPEN CIRCUIT CASUING THE ES[LIGHT TO COME ON AT TIMES	TECH REPLACED STOP LAMP SWITCH TEST DROVE. LIGHT DID NOT COME ON
KM8JN12D66U	9/15/05	34236	36.34	CODE C1513	CUSTOMER STATES ESC LIGHT COMES ON AND WILL NOT TURN OFF WHEN ESC BUTTON IS PRESSED	SCANNED FOR CODES AND FOUND C1513 BRAKE LAMP SWITCH OPEN/ SHORT.	REMOVED AND REPLACED BRAKE LAMP SWITCH.
KM8JN12D66U	9/15/05	34236	36.34	CODE C1513	CUSTOMER STATES PASS FRONT GRAB HANDLE IS LOOSE OR COMING APART	SCREW WAS LOOSE.	RETIGHTENED SCREWS FOR PASSENGER GRAB HANDLE.
KM8JN72DX5U	11/24/04	46125	90.5	FUEL CHARGES OK'ED BY DM DUE TO 930 MILE ROADTESTS TO ISOLATE CAUSE OF FAILURE.			
KM8JN72DX5U	11/24/04	46125	90.5	FUEL CHARGES OK'ED BY DM DUE TO 930 MILE ROADTESTS TO ISOLATE CAUSE OF FAILURE.			
KM8JN72DX5U	11/24/04	46125	90.5	FUEL CHARGES OK'ED BY DM DUE TO 930 MILE ROADTESTS TO ISOLATE CAUSE OF FAILURE.			
KM8JN72DX5U	11/24/04	46125	250				
KM8JN12D66U	12/22/05	14053	36.34		CUSTOMER STATES THAT THE ESC LIGHT HAS BEEN COMING ON AND THAT THE BRAKES LIGHTS HAVE BEEN INOP	STOP LAMP HAS OPEN CIRCUIT	REPLACED STOP LAMP SWITCH
KM8JN12D35U	9/02/04	24020	34.95		CUSTOMER STATES TO PERFORM SERVICE CAMPAIGN 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT	UPDATED DAB COVER MODULE AS OUTLINED IN SERVICE CAMPAIGN 079	PERFORMED AND REPLACED DAB SERVICE CAMPAIGN 079 OP CODE 61B046RO OP NAME DRIVERS AIR BAG MODULE REPLACEMENT
KM8JN12D35U	9/02/04	24020	34.95		CUSTOMER STATES CRUISE CONTROL INOP	FOUND THE BRAKE LIGHT SWITCH TO HAVE A OPEN	REPLACED BRAKE LIGHT SWITCH
KM8JN72DX5U	11/24/04	46125	250				
KM8JN72DX5U	11/24/04	46125	250				
KM8JN72DX5U	11/24/04	46125	390.48				
KM8JN72DX5U	11/24/04	46125	390.48				
KM8JN12D35U	9/02/04	24020	34.95		CUSTOMER STATES ESP LIGHT IS ON	C1260 STEERING SENSOR OPEN CIRCUIT CASUING THE ESP LIGHT TO COME ON	REPLACED STEERING WHEEL ANGLE SENSOR TEST DROVE NO MORE PROBERASED CODE
KM8JN12D85U	10/15/04	18990	34.95		CUSTOMER STATES TO PERFORM SERVICE CAMPAIGN 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT	UPDATED DAB COVER MODULE AS OUTLINED IN SERVICE CAMPAIGN 079	COMPLETE

KM8JN12D85U	10/15/04	18990	34.95		CUSTOMER STATES: CRUISE CONTROL INOP	FOUND THE BRAKE LIGHT SWITCH TO HAVE A OPEN	REPLACED BRAKE LIGHT SWITCH
KM8JN72DX5U	11/24/04	46125	390.48				
KM8JN72D16U	1/07/06	22715	31.99				
KM8JN72D96U	8/22/05	18283	32.14	ESC LIGHT ON BRAKE SWITCH FAULTY REPLACED BRAKE SWITCH RETESTED FINE	ESC LIGHT HAS BEEN COMING ON	BRAKE SWITCH	INSPECT TEST AND REPLACE 93810R00 .3 // N94 // C15
KM8JM12B06U	7/13/05	12090	45.34	ST TIME IS SCAN TOOL CODE C1513	CUSTOMER STATES THAT THE ESC LIGHT KEEPS COMING ON	FOUND DIAGNOSTIC CODE C1513 BAKE LAMP SWITCH OUT OF RANGE	REMOVE AND REPLACE BRAKE SWITCH
KM8JN12D65U	9/03/04	12145	37.12	SCAN TOOL CODE C1513	CUSTOMER STATES VEHICLE JERKS ON ACCEL	TECH VERIFIED DTC C1513 BRAKE LAMP SW.	R@R BRAKE LAMP SW. DUE TO ELEC MALF. ROADTEST VEH. OP. TO MFR SPEC
KM8JN12D65U	9/03/04	12145	37.12	SCAN TOOL CODE C1513	CUSTOMER STATES ESP LIGHT ON	TECH VERIFIED DTC C1260 STEERING WHEEL ANGLE SENSOR MALF- ABNORMAL	R@R STEERING ANGLE SENSOR. PERFORMED CALIBRATION OF SENSOR CLEARED DTCS. ROADTESTED VEH. VEHICLE NOW OP. TO MFR SPEC
KM8JN72D16U	4/12/06	2516	34.1	ESC LIGHT ON C1513 PRESENT TESTED AND REPLACED BRAKE LIGHT SWITCH RETESTED FINE CLEARED CODE	CUSTOMER COMPLAINS THAT ESC LIGHT IS ON	BRAKE LIGHT SWITCH	INSPECT TEST AND REPLACE BRAKE LIGHT SWITCH //RETEST
KM8JN72D16U	4/12/06	16193	32.46	ESC LIGHT COMES ON WHILE DRIVING REPLACED FAULTY BRAKE SWITCH RETESTED FINE	CUSTOMER COMPLAINS THAT ESC.LITE COMES ON DRIVING (SOMETIMES)	CODE C1513	REPLACED FAULTY BRAKE SWITCH
KM8JN72D06U	7/25/05	15930	32.46	ESC LIGHT ON C1513 REPLACED BRAKE LAMP SWITCH	CUST STATSE TIRE LIGHT ON	ADJUSTED TIRE PRESSURE	CLEARED LIGHT - NO ADDITIONAL PROBLEMS AT THIS TIME
KM8JN72D06U	7/25/05	15930	32.46	ESC LIGHT ON C1513 REPLACED BRAKE LAMP SWITCH	CUST STATES MIL AND ESC LTS COME ON	CODE C1513	REPLACED BRAKE LAMP SWITCH
KM8JN12D25U	6/02/05	35854	54.66	ST TIME IS FOR THE SCAN TOOL CODE C1513	CUSTOMER STATES ESP LIGHT COMES ON WHEN DRIVING	SCAN (ESP) SYSTEM FOUND CODE: C1513 BRAKE LAMP SWITCH	REPLACE BRAKE LAMP SWITCH
KM8JN12D25U	6/02/05	35854	54.66	ST TIME IS FOR THE SCAN TOOL CODE C1513	CUSTOMER STATES TO PERFORM SERVICE CAMPAIGN 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT	UPDATED DAB COVER MODULE AS OUTLINED IN SERVICE CAMPAIGN 079	PERFORMED AND REPLACED DAB SERVICE CAMPAIGN 079 OP CODE 61B046R0 OP NAME DRIVERS AIR BAG MODULE REPLACEMENT
KM8JN12D25U	6/02/05	35854	54.66	ST TIME IS FOR THE SCAN TOOL CODE C1513	CUSTOMER STATES THE CAR IS SLOW TO START. ACTS LIKE THE BATTERY MAY BE GOING DEAD. PLEASE CHECK AND ADVISE.	SCAN BATTERY AND BATTERY FAILED SELF TEST	REPLACE BATTERY
KM8JN72D36U	12/23/05	4332	32.46	ESCLIGHT ON C1513 PRESENT REPLACED FAULTY BRAKE SWITCH TO FIX CONCERN CLEARED CODE RETESTED FINE	CUST STATES ESC LIGHT ON ALL THE TIME	CODE FOR FOR BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN72D85U	5/21/05	21784	32.46	ESC LIGHT ON C1513 PRESENT REPLACED FAULTY BRAKE SWTCH RETESTED FINE	CUSTOMER STATES ESC LIGHT ON	PERFORM SCAN DIAGNOSTIC CODE C1513 BRAKE LIGHT SWITCH OPEN	REMOVE AND REPLACE BRAKE LAMP SWITCH/CLEAR CODE ALL OK AT THIS TIME
KM8JN12D06U	9/09/05	12895	38.3		CUSTOMER STATES THE ESC LIGHT OFF WILL COME ON WHEN STARTINGHITTING ESC BUTTON, THE ESC OFF STAYS ON	VERIFIED CUSTOMER CONCERN FOUND C 1513 BRAKE LAMP SWITCH OPEN/SHORT	REPLACED BRAKE LAMP SWITCH,ROAD TEST VEHICLE
KM8JM12B36U	7/19/05	28849	36.66	FOUND OPEN IN BRAKE LITE SWITCH	DURING INSPECTION IT WAS OBSERVED THAT THE BRAKE LIGHTS ARE INOP	TECH FOUND AN OPEN CIRCUIT IN THE BRAKE LIGHT SWITCH	REPLACE THE BRAKE LIGHT SWITCH
KM8JM12B35U	6/15/05	15496	36.66		CUSTOMER STATES BRAKE LIGHTS WILL NOT TURN OFF	FOUND AN OPEN CIRCUIT IN THE BRAKE LIGHT SWITCH	REPLACE BRAKE LIGHT SWITCH,RECHECK OPERATION,OK AT THIS TIME
KM8JN72D85U	5/21/05	21784	32.46	ESC LIGHT ON C1513 PRESENT REPLACED FAULTY BRAKE SWTCH RETESTED FINE	CUSTOMER STATES CHECK ENGINE LIGHT IS ON	PERFORM SCAN TOOL DIAGNOSTIC CODE P0130 B1/S1 02 SENSOR	REMOVE AND REPLACE OXYGEN SENSOR B1/S1 CLEAR CODES REINSPECT OK AT THIS TIME
KM8JM12B97U	1/20/07	2456	32.14	ESC LIGHT COMES ON WHILE DRIVING REPLACED STOP LAMP SWITCH TO FIX CONCERN	CUSTOMER COMPLAINS THAT ESC.LIGHT COMES ON WHILE DRIVING	BRAKE STOP LIGHT SWITCH	INSPECT TEST AND REPLACE 93810R00 .3 // N94 // C15
KM8JN72D46U	7/18/05	17929	34.1		ECS LIGHT HAS BEEN GOING OFF	SCAN TOOL DIAG //CODE C1513	INSPECT TEST AND REPLACE BRAKE SWITCH 93810R00 .3 //N94//C15
KM8JM12B96U	7/09/05	22513	34.1		ESC LIGHT IS ON	BRAKE SWITCH	INSPECT AND REPLACE STICKING BRAKE SWITCH 93810R00.3//N94//C15
KM8JN72D76U	12/20/05	8073	36.66		CUSTOMER STATES TO PERFORM SERVICE CAMPAIGN 079 DRIVERS AIR BAG COVER MODULE REPLACEMENT	UPDATED DAB COVER MODULE AS OUTLINED IN SERVICE CAMPAIGN 079	PERFORMED AND REPLACED DAB SERVICE CAMPAIGN 079
KM8JN72D76U	12/20/05	8073	36.66		CUSTOMER STATES ESC LIGHT WILL COME ON AND WILL NOT TURN OFFEVEN WHEN BUTTON IS PRESSED	FOUND THE CODE C1513 TO BE STORED BRAKE LIGHT SWITCH OPEN CIRCUIT CASUING THE LIGHT TO COME ON	REPLACED BRAKE LIGHT SWITCH ERASED CODE
KM8JN12D06U	7/21/05	14724	32.46	ESC LIGHT COMES ON WHILE DRIVING REPLACED FAULTY BRAKE SWITCH RETESTED FINE	ESC LIGHT ON // OFF	BRAKE SWITCH	INSPECT TEST AND REPLACE 93810R00 .3 // N94 // C15
KM8JN12D06U	7/21/05	14724	32.46	ESC LIGHT COMES ON WHILE DRIVING REPLACED FAULTY BRAKE SWITCH RETESTED FINE	RECALL 079	DRIVER AIR BAG MODULE REPLACEMENT	COMPLETE 61B046R0 .2
KM8JN72D26U	8/17/05	21330	29.16		CUSTOMER STATES ESC LIGHT COMES ON	BRAKE LIGHT SWITCH FOUND INTERITT OPEN CIRCUIT	REPLACE BRAKE LIGHT SWITCH 93810R00 .3, N94C15
KM8JN72D95U	4/27/05	12724	205.09	CUSTOMER STATES GOING DOWN HILL ON A DIRT ROAD BRAKES WOULD NOT SLOW VEHICLE, KEPT ACC. TILL BOTTOM. SCAN ABS/EXP/TCS C1237 PRESS SEN ABNL, C1513 BRAKE LAMP SWITCH. CALLED TECH SUPPORT BEFORE RD TEST, CKD GRND NEAR HECU #8SD58-6 CHK PRESS SNSR VOLT			
KM8JN72D55U	2/22/05	42156	29.7	CUSTOMER STATES CRUISE CONTROL DISCONNECTS AT TIME. SCAN CODE C1513 FAILURE BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH. OPS CHECK OK.			
KM8JM12B16U	1/11/06	25164	38.01	ESC LIGHT COMES ON - FOUND CODE C1513 - NEC TO REPLACE STOP LAMP SWITCH			

KM8JN72D16U	7/28/05	22393	56.76	CODE C1513, BRAKE LIGHT SWITCH INTERNAL FAILURE. REPLACED SWITCH CLEARED CODE RETEST OK.			
KM8JM12B46U	7/15/05	29967	29.16		ESC LIGHT IS COMING ON	PULLED CODES C1513 BRAKE LAMP SWITCH INTERNAL OPEN. CK COMPUTER FOR CODES	REPL SWITCH - CLEAR CODES 93810R00, .3, N94C15
KM8JN72D46U	8/18/05	32407	29.16	REPL BRAKE SWITCH	CUST STATES THE CHECK ENGINE LIGHT IS COMING ON AT TIMES / LAST TIME LIGHT WAS ON WAS LAST WEEK	P0130 O2 SENSOR BANK 1 SENSOR 1 P0134 O2 SENSOR BANK 1 SENSOR 1 NO ACTIVITY P0030 O2 SENSOR HEATER BANK 1 SENSOR 1	REPL O2 SENSOR 39214R00, .9, 39214RF1, .5, 391214RP0, .3 N69C15
KM8JN72D46U	8/18/05	32407	29.16	REPL BRAKE SWITCH	CUSTOMER STATES ESC OFF LIGHT CAME ON BY ITSELF / LIGHT NOW OFF	FOUND BRAKE LIGHT SWITCH INTERNAL FAILURE	REPL BRAKE SWITCH 93810R00, .3, N94C15
KM8JN12D46U	10/31/05	23204	33.41		079(61B046R0)DRIVER AIR BAG COVER MODULE REPLACEMENT	079	079(61B046R0)DRIVER AIR BAG COVER MODULE REPLACEMENT 23204 AIRBAG COVER RECALL WARRANTY REPLACED AIRBAG COVER AS PER RECALL
KM8JN12D46U	10/31/05	23204	33.41		CUSTOMER STATES WHILE DRIVING ESC LIGHT COMES ON INTERMITTANTLY CHECK AND ADVISE	INTERNAL OPEN	MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION MODULE ASSY-ENGINE CONTROL ADD SCAN TOOL OPERATION 23205 ESC LITE IS ON WARRANTY SCAN FOR CODES C1513 BRAKE LAMP SWITCH CIRCUIT TESTED SYS AND FOUND BRAKE LAMP SWITCH OPEN CIR REPLACED BRAKE LAMP SWITCH AND
KM8JN72D36U	10/19/05	12132	28.84		CUSTOMER STATES THAT THE ESC OFF LIGHT IS STAYING ON WHILE DRIVING	SCAN CODE C1513 STOP LAMP SWITCH OPEN CIRCUIT	REPLACE SWITCH 93810R00 .3, N94, C15
KM8JN12D6U	12/30/05	11819	39.06		CUST STATES ECS LIGHT KEEPS COMING ON EVERY 3 MILES OR SO	C1513 BRAKE LAMP SWITCH FAULT	REPLACED BRAKE LAMP SWITCH AND TEST DROVE VEHICLE. ESC LIGHT IS NOW OFF.
KM8JN12D36U	10/10/05	13413	37.24				
KM8JN12D46U	10/31/05	23204	33.41		CUSTOMER STATES WHILE DRIVING ESC LIGHT COMES ON INTERMITTANTLY CHECK AND ADVISE	INTERNAL OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 23205 ESC LITE IS ON WARRANTY SCAN FOR CODES C1513 BRAKE LAMP SWITCH CIRCUIT TESTED SYS AND FOUND BRAKE LAMP SWITCH OPEN CIR REPLACED BRAKE LAMP SWITCH AND RETESTED SYSTEM/ OK
KM8JN12D46U	10/31/05	23204	33.41		CUSTOMER STATES BATTERY IS NOT HOLDING CHARGE, HAS CHANGED BATTERY, WILL DIE OUT AFTER SITTING FOR A COUPLE DAYS. PLS CK ADV	PER TSB 07-90-007	RADIO ASSY-ETR RE RADIO ASSY-ETR RE 23204 BATTERY NOT HOLDING CHARGE WARRANTY FOUND RADIO TO HAVE A PARASITIC DRAW INTERNALLY REPLACED RADIO AS PER TSB#07-90-
KM8JM12BX5U	1/12/05	60821	128.31	CUST STATES ESP LT COMES ON AND OFF INTERMITT. TECH SCANNED FOR CODES AND FOUND C1513 AND C1260 PRESENT. NEC TO REPL STOP LAMP SW AND REPAIRED PINS 16 AND 47 AT THE ESP CNTL UNIT FOR DTC C1260 STEERING ANGLE SENSOR. ROBERT AUTH AS ONE TIME GOODWILL REPA			
KM8JN72D25U	6/10/05	29937	39.06		CUSTOMER STATES THAT THE ESC LIGHT COMES ON AND OFF AT TIMES.	C1513 BRAKE LAMP SWITCH FAULTY	REPLACED BRAKE LAMP SWITCH ASSEMBLY
KM8JN12D46U	12/16/05	13116	37.24		ESC LIGHT STAYS ON - DOESNT COME ON AT FIRST BUT COMES ON AFTER YOU DRIVE FOR A WHILE	BRAKE LAMP SWITCH INOP	REPLACED BRAKE LAMP SWITCH
KM8JN72D06U	9/23/05	18822	38.74		CUST STATES THAT ESC LIGHT IS KEEP COMING ON AND OFF	FOUND C/5/3 BRAKE LAMP SWITCH CIR FAULT	REPLACED BRAKE SWITCH
KM8JN72D36U	7/27/05	25942	31.56	25942 ABS/ESC DIAG DTC-C1513 BRAKE SWITCH FAULT. VERIFIED SWITCH STICKING WITH SCAN TOOL. REPLACED BRAKE SWITCH. RETEST-PASS. CODE CLEARED.			
KM8JM72B16U	1/10/06	22504	31.56	22504 ALL BRAKE LITES INOP ORDERED BRAKE SWITCH REPLACED BRAKE LIGHT SWITCH WARRANTY			
KM8JN72D66U	2/24/06	9854	31.56	9856 CHECKED FOR CODES FOUND CODE C1237 PRESSURE SWITCH OTHER C1513 BRAKE LAMP SWITCH CHECKED PRESSURE SWITCH ALL WAS FINE FOUND BRAKE LIGHT SWITCH BAD REPLACED BRAKE LAMP SWITCH ALL OK NOW WARRANTY			
KM8JN72D45U	9/14/04	29277	37.63		CUSTOMER STATES CRUISE IS INOP	C1260 STEERING ANGLE SENSOR SHORT	REPLACED STEERING ANGLE SENSOR/CLEARED CODE
KM8JN72D76U	10/25/05	28930	38.74		CUST STATES ETC LIGHT COMES ON BY ITSELF	C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH ASSEMBLY
KM8JN12D36U	12/19/05	13108	39.06		CUSTOMER STATES TRACTION CONTROL COMES ON AND STAYS ON WHILE DRIVING SOMETIMES	BRAKE LIGHT SWITCH OPEN CIRCUIT	REPLACED BRAKE LIGHT SWITCH
KM8JN12D26U	10/27/05	16126	39.2		C/S ESC LIGHT KEEPS COMING ON - SOP	CODE FOR BRAKE LIGHT SWITCH	REPLACED SWITCH

KM8JM12B07U	11/08/06	6602	43.8	6602 CHECKED FOR CODES FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION FOUND BRAKE LIGHT SWITCH TOO TIGHT AGAINST PLUNGER PLUNGER GETTING STUCK ADJUSTED SWITCH AND TEST DROVE NORMAL OPERATION AT THIS TIME WARRANTY			
KM8JN72D85U	9/14/04	35752	29.85	35752 I SCAN CHECKED FOR CODES AND FOUND C1260 AND C1513. C1260 IS A BRAKE SWITCH ERROR CODE. I DID VERIFY THE BRAKE LIGHTS WOULD NOT FUNCTION EVERY TIME THE BRAKES WERE APPLIED, I REPLACED THE SWITCH TO CORRECT THE PROBLEM. THE CODE C1260 IS FOR THE STEE			
KM8JM72B56U	9/27/05	46523	31.56	46523 VERIFIED ESC OFF LIGHT COMING ON CHECKED FOR CODES FOUND C1513 BRAKE LAMP SWITCH FAULT CHECKED AND FOUND BRAKE LAMP SWITCH BAD REPLACED BRAKE LAMP SWITCH CLEARED DTC			
KM8JM12B06U	10/17/05	48143	30.66	C/ST ECS LIGHT IS ON FOUND INTERNAL SHORT IN BRAKE SWITCH REPLACED BRAKE SWITCH CHECKED OK	CUSTOMER STATES ECS LIGHT IS ON	INTERNAL OPEN IN BRAKE SWITCH	SWITCH ASSY, STOP LAMP
KM8JM12B06U	10/17/05	48143	30.66	C/ST ECS LIGHT IS ON FOUND INTERNAL SHORT IN BRAKE SWITCH REPLACED BRAKE SWITCH CHECKED OK	CUSTOMER STATES A/C BLOWS WARM AND DOES NOT BLOW THRU VENTS AT TIMES	MODE ACTUATOR HAS INTERNAL SHORT	ACTUATOR MODE DOOR
KM8JM12B35U	5/12/05	14815	31.84		CUSTOMER SAID THE ESP LIGHT IS ON	BRAKE LIGHTS INOPERATIVE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D95U	9/20/04	10685	33.52	CUSTOMER STATES THE CRUISE IS INOPERATIVE. CHECKED AND FOUND ALL FUSES OK. CHECKED BRAKE SWITCH-ONLY TWO PINS HOT (SHOULD BE 3). BRAKE SWITCH IS BAD. REPLACED SWITCH-OK NOW.			STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM72B96U	1/10/06	22268	31.56	22268 LITE ON SCAN CK C1513 BRAKE LAMP SWITCH, REPLACED BRAKE SWITCH AND CLEARED CODE			
KM8JN72D76U	3/10/06	21973	31.56	21973 VERIFIED CONCERN-DTC C1513-BRAKE SWITCH FAULT. FOUND SWITCH PLUNGER IS STICKING IN WHEN BRAKE PEDAL IS APPLIED. REPLACED STOP LAMP SWITCH. RETEST-PASS. CODE CLEARED.			
KM8JM12B35U	5/12/05	23092	32.16		CUSTOMER STATES THE ESP LIGHT IS ON- SOP IN	OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D05U	11/11/04	20723	33.22		CHECK ENGINE LIGHT IS ON AND CUSTOMER CAN'T ACCELERATE	E	AIR FLOW SENSOR ASSY RE AIR FLOW SENSOR ASSY RE
KM8JN12D05U	11/11/04	20723	33.22		CHECK ENGINE LIGHT IS ON AND CUSTOMER CAN'T ACCELERATE	E	AIR FLOW SENSOR ADD SCAN TOOL OPERATION AIR FLOW SENSOR ADD SCAN TOOL OPERATION
KM8JN72D55U	4/18/05	32772	54.5	CHECKED AND FOUND A FAILURE CODE FOR BRAKE LAMP SWITCH, REPLACED SWITCH, ALSO PERFORMED ESP ENGINE CONTROL MODULE UPDATE ROAD TESTED, ALL NORMAL AT THIS TIME	*CUSTOMER STATES TRANSMISSION IS SLIPPING, WHEN GOING UPHILL WILL NOT SHIFT INTO NEXT GEAR, ESP LIGHT COMES ON AND THE ENGINE FEELS LIKE IT WILL STALL	C15	STRAIGHT TIME
KM8JN72D55U	4/18/05	32772	54.5	CHECKED AND FOUND A FAILURE CODE FOR BRAKE LAMP SWITCH, REPLACED SWITCH, ALSO PERFORMED ESP ENGINE CONTROL MODULE UPDATE ROAD TESTED, ALL NORMAL AT THIS TIME	*CUSTOMER STATES TRANSMISSION IS SLIPPING, WHEN GOING UPHILL WILL NOT SHIFT INTO NEXT GEAR, ESP LIGHT COMES ON AND THE ENGINE FEELS LIKE IT WILL STALL	C15	SWITCH ASSY-STOP LAMP RE
KM8JN72D85U	4/29/05	21349	35.16	PFP 93810-3K000 TECH REPLACED INOP STOP LAMP SWITCH			
KM8JN12D05U	11/11/04	20723	33.22		DIAGNOSTIC AND WIRING REPAIR RIGHT SIDE ENGINE WIRING	15	WIRING DIAG. AND REPAIR
KM8JN12D05U	11/11/04	20723	33.22		CODE P0305 - FUEL INJECTION	32	FUEL INJECTOR ASSY (ALL) RE FUEL INJECTOR ASSY (ALL) RE
KM8JN12D05U	11/11/04	20723	33.22		DIAGNOSTIC AND WIRING REPAIR RIGHT SIDE ENGINE WIRING	15	DIAG AND WIRING REPAIR DIAG AND WIRING REPAIR
KM8JN12D05U	11/11/04	20723	33.22		CODE C1513 BRAKE LIGHT SWITCH MALFUNCTION CODE	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D05U	5/14/05	31324	34.84	BRAKE SWITCH SHORTED OUT- REPLACED BRAKE SWITCH			
KM8JN12D65U	5/16/05	23036	34.84	PERFORMED COMPUTER DIAGNOSTICS CODES C1513 AND C1260- BRAKE SWITCH SHORTED OUT- REPLACED BRAKE SWITCH			
KM8JM12B46U	7/09/05	31550	35.16	PFP 93810-3K000 TECH REPLACED SWITCH			
KM8JN12D86U	12/23/05	42051	32.16		CHECK ENGINE LIGHT IS ON. SPECIAL ORDER O2 SENSOR IS HERE	P0130	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE
KM8JN12D86U	12/23/05	42051	32.16		CHECK ENGINE LIGHT IS ON. SPECIAL ORDER O2 SENSOR IS HERE	P0130	SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION
KM8JN12D86U	12/23/05	42051	32.16		CHECK ENGINE LIGHT IS ON. SPECIAL ORDER BRAKE SWITCH IS HERE	OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE

KM8JM12B46U	7/09/05	7629	32.9	ESC LIGHT OFF IS ON, RPL STOP LAMP SWITCH ASS'Y	CUSTOMER STATES ESC LIGHT OFF IS ON-S/O PART HERE	C15	STOP LAMP SWITCH ASS'Y RE
KM8JN72D5U	4/13/05	21125	34.84	PERFORMED ELECTRICAL CHECK. BRAKE SWITCH SHORTED OUT. REPLACED BRAKE SWITCH			
KM8JN72D25U	4/28/05	22304	30.94	TECH FOUND CODES C1513 BRAKE LAMP SWITCH AND C1260 STEERING ANGLE SENSOR AND P1716 RELATED TO STEERING SENSOR THIS PART FAILURE DOESN'T INDICATE A TOTAL VEH BREAKDOWN TECH FOUND MULTIPLE CODES IN VEH FOR FAILURE IN BRAKE LAMP SWITCH AND STEERING ANGLE SEN	*CUSTOMER STATES PERFORM OPEN RECALL (079)	RECALL	RECALL 079-DRIVER AIR BAG/MODULE REPLACEMENT
KM8JM12B35U	5/12/05	7949	32.9		CUSTOMER SAYS THE ESP LIGHT STAYS ON WHEN SHE IS DRIVING	BRAKE LAMPS INOP	PRESSURE SENSOR PRESSURE SENSOR
KM8JM12B35U	5/12/05	7949	32.9		CUSTOMER SAYS THE ESP LIGHT STAYS ON WHEN SHE IS DRIVING	BRAKE LAMPS INOP	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN12D16U	9/23/05	25466	32.16		EXPRESS OIL AND FILTER CHANGE--CHECK FLUID LEVELS--SET TIRE PRESSURES.	OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D25U	4/28/05	22304	30.94	TECH FOUND CODES C1513 BRAKE LAMP SWITCH AND C1260 STEERING ANGLE SENSOR AND P1716 RELATED TO STEERING SENSOR THIS PART FAILURE DOESN'T INDICATE A TOTAL VEH BREAKDOWN TECH FOUND MULTIPLE CODES IN VEH FOR FAILURE IN BRAKE LAMP SWITCH AND STEERING ANGLE SEN	*CUSTOMER STATES WHEN MAKING A U TURN, OR HARD LEFT THE VEHICLE FELT LIKE IT HAD A FLAT TIRE, OR THE TIRES WERE LOCKING UP	C15	SENSOR-ANGULAR VELOCITY
KM8JN72D25U	4/28/05	22304	30.94	TECH FOUND CODES C1513 BRAKE LAMP SWITCH AND C1260 STEERING ANGLE SENSOR AND P1716 RELATED TO STEERING SENSOR THIS PART FAILURE DOESN'T INDICATE A TOTAL VEH BREAKDOWN TECH FOUND MULTIPLE CODES IN VEH FOR FAILURE IN BRAKE LAMP SWITCH AND STEERING ANGLE SEN	*CUSTOMER STATES WHEN MAKING A U TURN, OR HARD LEFT THE VEHICLE FELT LIKE IT HAD A FLAT TIRE, OR THE TIRES WERE LOCKING UP	C15	SWITCH ASSY-STOP LAMP RE
KM8JM12B26U	9/09/05	10178	33.8		CUSTOMER SAYS THE ESC LIGHT COMES ON/OFF BY ITSELF		STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JN72D75U	2/22/05	17788	31.56		CUSTOMER SAYS THE MALFUNCTION LIGHT CAME ON AND STAYED ON - SOP BRAKE LIGHT SWITCH	BRAKE LIGHT SWITCH DEFECTIVE\	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JM12B56U	7/14/05	18946	33.8		STATE INSPECTION	BRAKE LIGHTS NOT WORKING	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B15U	6/10/05	25194	31.84		BRAKE LIGHTS ARE WORKING INTERMITTENTLY	ADJUSTMENT WOULD NOT WORK - SET LIGHT AGAIN AFTER ADJUSTMENT.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D36U	8/12/05	30000	35.16	REPLACED FAULTY BRAKE LAMP SWITCH			
KM8JN72D26U	7/16/05	15893	79.3		CUSTOMER STATES "ESC OFF" LIGHT CAME ON WHILE DRIVING LAST NIGHT. LIGHT IS NOW OFF. CHECK AND ADVISE	FOUND CODE C1513 STORED. FOUND BRAKE LIGHT SWITCH HAS OPEN/SHORT AND BRAKE LIGHTS INOP. REPLACED SWITCH	VERIFY CORRECTION, OK AT THIS TIME.
KM8JN72D66U	9/27/05	24266	39.66				
KM8JN72D45U	6/11/05	37661	36.34		CUSTOMER STATES THAT THE ESC LIGHT WAS ON 20 MIN INTO DRIVE LIGHT TURNED OFF	FAULT CODE FOR C1513 BRAKE LAMP SWITCH MALFUNCTION	REPALCED THE BRAKE LAMP SWITCH FOR THE REPAIR TEST DROVE TO VERIFY REPAIRS 93810R00 N94 C15
KM8JN12D66U	12/27/05	14858	36.34		CUST STATES THE ESC LIGHT COMES ON	FOUND BAD STOP LAMP SWITCH 93810R00 N94 C15	REPLACED STOP LAMP SWITCH
KM8JM12B35U	5/20/05	8021	35.3		CUSTOMER STATES THAT THE ESP LIGHT IS COMING ON AND OFF THE CAR HESITATES WHEN THIS IS HAPPENING	DUE TO THE BRAKE LIGHT SWITCH IS FAULTY	REPLACED THE SWITCH FOR THE REPAIR VERIFIED OPERATION N94 C15 9381R00
KM8JN12DX5U	4/06/05	30263	39.34		CUST STATES: UPON STOPPING AT LIGHT ETC CAR STARTS JERKING AND ALMOST CUTS OFF. SOMETIMES AT 60 MPH STARTS JERKING.	CODE C1513 BRAKE LAMP SWITCH OPEN SHORT CIRCUIT	REPLACED BRAKE LAMP SWITCH
KM8JN12DX5U	4/06/05	30263	39.34		CUST STATES: CUP HOLDER TANG SPRING BROKEN	VERIFIED CUSTOMERS CONCERN	REPLACED CUP HOLDER ASSY
KM8JN72D75U	5/19/05	27876	39.66				
KM8JN72D85U	6/10/05	34091	39.66		CUST STATES: ESP LIGHT COMES ON AND OFF	TECH FOUND CODE C1513 BRAKE LAMP SWITCH, BRAKE LAMP SWITCH HAD A SHORT TO GROUND	REPLACED BRAKE LAMP SWITCH
KM8JN72D86U	7/29/05	21033	34.86	21033 FAULTY BRAKE LAMP SWITCH GOT CODE C1513 BRAKE SWITCH CIRCUIT, CHECKED BRAKE LAMP SWITCH. SWITCH FAILED CONTINUITY TEST. REPLACED BRAKE LAMP SWITCH. ERASED CODE. TEST DROVE. ESC LIGHT OF NOW.	CLIENT STATES ESC LIGHT ON. CK AND ADVISE	FAULTY BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21033 FAULTY BRAKE LAMP SWITCH GOT CODE C1513 BRAKE SWITCH CIRCUIT, CHECKED BRAKE LAMP SWITCH. SWITCH FAILED CONTINUITY TEST. REPLACED BRAKE LAMP SWITCH. ERASED CODE. TEST DROVE. ESC LIGHT OF NOW.
KM8JN12D05U	9/20/04	23203	33.15	23203 CC INOP DIAG FIND CC INOP, FIND BRAKE WAS NOT WORKING FOR CC/900	CUSTOMER STATES CRUISE CONTROL INOP, IS ABLE TO SET, BUT SPEED IS NOT MAINTAINED.	CC INOP	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 23203 CC INOP DIAG FIND CC INOP, FIND BRAKE WAS NOT WORKING FOR CC/900
KM8JN72D25U	5/30/05	19699	39.34		CUSTOMER STATES ESP LIGHT COMES ON RANDOMLY	CODE C1513 STORED FOR BRAKE LAMP SWITCH SHORT CIRCUIT	REPLACED BAD BRAKE LIGHT SWITCH
KM8JN12D35U	8/28/04	58185	37.95		CUSTOMER STATES ESC LIGHT IS ON	TECHNICIAN FOUND CODE C1513 BRAKE SWITCH OPEN SHORT	REPLACED BRAKE SWITCH

KM8JN12D76U	10/17/05	16514	67.86	16514 F USED SCAN TOOL TO P1513. INSTALLED WITH NEW BRAKE LIGHT SWITCH. CLEAR CODES AT THIS TIME. ESC LIGHT IS NOW OFF AND BRAKE LIGHTS ARE WORKING NO OTHER PROBLEMS ARE FOUND AT THIS TIME.	BRAKE LIGHTS SEEM TO BE WORKING NOW	F	DIAG ON SWITCH FOR BRAKE LIGHT DIAG. CAR NOT COMING OUT OF PARK 16514 F USED SCAN TOOL TO P01513. INSTALLED WITH NEW BRAKE LIGHT SWITCH. CLEAR CODES AT THIS TIME. ESC LIGHT IS NOW OFF AND BRAKE LIGHTS ARE WORKING NO OTHER PROBLEMS ARE FOUND AT THIS TIME.
KM8JN12DX6U	12/17/05	25918	33.66	REPLACED BRAKE SWITCH. TEST DROVE. WORKING NORMALLY AT THIS TIME	ESC LIGHT COMES ON THEN GOES OFF FREQUENTLY	FOUND BRAKE SWITCH REASON FOR ESC LIGHT GOING ON AND OFF	REPLACED BRAKE SWITCH. TEST DROVE. WORKING NORMALLY AT THIS TIME
KM8JN72D36U	10/17/05	35945	33.66	REPLACED BRAKE SWITCH AND TEST DROVE. VEHICLE WORKING NORMALLY AT THIS TIME	ECS LIGHT ON. PLEASE CHECK AND ADVISE	FOUND BRAKE SWITCH NOT WORKING PROPERLY.	REPLACED BRAKE SWITCH AND TEST DROVE. VEHICLE WORKING NORMALLY AT THIS TIME
KM8JN12D76U	10/17/05	16514	67.86	16514 F USED SCAN TOOL TO P1513. INSTALLED WITH NEW BRAKE LIGHT SWITCH. CLEAR CODES AT THIS TIME. ESC LIGHT IS NOW OFF AND BRAKE LIGHTS ARE WORKING NO OTHER PROBLEMS ARE FOUND AT THIS TIME.	BRAKE LIGHTS SEEM TO BE WORKING NOW	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16514 F USED SCAN TOOL TO P01513. INSTALLED WITH NEW BRAKE LIGHT SWITCH. CLEAR CODES AT THIS TIME. ESC LIGHT IS NOW OFF AND BRAKE LIGHTS ARE WORKING NO OTHER PROBLEMS ARE FOUND AT THIS TIME.
KM8JM12B85U	4/08/05	17353	38.76		CUSTOMER STATES THAT THE BATTERY IS NOT HOLDING CHARGE HAD TO JUMP FOR 5 MIN WITH DASH LIGHTS ON	F	BATTERY ASSY RE BATTERY ASSY RE
KM8JN72D36U	10/17/05	35945	33.66	REPLACED BRAKE SWITCH AND TEST DROVE. VEHICLE WORKING NORMALLY AT THIS TIME	CUSTOMER STATES CHECK ENGINE LIGHT ON CUSTOMER STATES KEEPS LOSING POWER WHILE DRIVING	FOUND FAILURE IS IN THROTTLE POSITION SWITCH SENSOR	REPLACED SENSOR. TEST DROVE VEHICLE. OPERATING NORMALLY AT THIS TIME
KM8JN12D27U	10/31/06	2280	33.66				
KM8JN12D26U	9/28/05	34191	29.46	VERIFIED - SCANNED SYSTEM - CODE P1513 - BRAKE LIGHT S SWITCH MALFUNCTION - REMOVE AND REPLACE BRAKE LIGHT SWITCH	CUSTOMER STATES - ESC LIGHT STAYS ON	BRAKE LIGHT SWITCH FAULTY	VERIFIED - SCANNED SYSTEM - CODE P1513 - BRAKE LIGHT S SWITCH MALFUNCTION - REMOVE AND REPLACE BRAKE LIGHT SWITCH
KM8JM12B85U	4/08/05	17353	38.76		CUSTOMER STATES THAT THE BATTERY IS NOT HOLDING CHARGE HAD TO JUMP FOR 5 MIN WITH DASH LIGHTS ON	F	BATTERY ASSY ADD SCAN TOOL OPERATION BATTERY ASSY ADD SCAN TOOL OPERATION
KM8JM12B85U	4/08/05	17353	38.76		CUSTOMER STATES THAT THE ESP LIGHT IS COMING ON WITHOUT PRESSING THE BOTTON	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D25U	5/26/05	11382	31.7				
KM8JM12B76U	8/19/05	11310	30.34	TECH PERFORMED TSB AND IT DID NOT FIX CUSTOMERS PROBLEM - REPLACED BRAKE SWITCH TO CORRECT	C STATES ESC LIGHT HAS COME ON A COUPLE OF TIMES AND STAYED ON FOR ACOUPLE OF HOURS BEFORE GOING OFF(POO)	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE TECH PERFORMED TSB AND IT DID NOT FIX CUSTOMERS PROBLEM - REPLACED BRAKE SWITCH TO CORRECT
KM8JM12B66U	7/28/05	21748	30.66		CAMPAIGN 079	00	CAMPAIGN 079 CAMPAIGN 079
KM8JM12B66U	7/28/05	21748	30.66		C STATES THE ESC LIGHT COMES ON AND WILL STAY ON UNTILL THE CAR IS TURNED OFF	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D76U	7/12/05	12482	32.3		C STATES ESC LIGHT IS ON - ADJUSTED BRAKE SWITCH LAST TIME	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP
KM8JM12B25U	4/08/05	28262	31.11	28262 INSTALLED SCAN TOOL AND FOUND CODE C1513 STORED FOR BRAKE LAMP SWITCH FAILURE. FOUND NO TSB'S APPLYING TO DTC, FOUND NEC TO REPLACE BRAKE LAMP SWITCH	PERFORM CAMPAIGN 79 AIR BAG COVER	CAMPAIGN	REPLACE DRIVER AIRBAG MODULE COVER REPLACE DRIVER AIRBAG MODULE COVER 28262 INSTALLED AIR BAG COVER TO CORRECT
KM8JM12B25U	4/08/05	28262	31.11	28262 INSTALLED SCAN TOOL AND FOUND CODE C1513 STORED FOR BRAKE LAMP SWITCH FAILURE. FOUND NO TSB'S APPLYING TO DTC, FOUND NEC TO REPLACE BRAKE LAMP SWITCH TO CORRECT	CUSTOMER STATES ESP OFF LIGHT IS ON WILL NOT GO OFF	POOR CONTACT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 28262 INSTALLED SCAN TOOL AND FOUND CODE C1513 STORED FOR BRAKE LAMP SWITCH FAILURE. FOUND NO TSB'S APPLYING TO DTC, FOUND NEC TO REPLACE BRAKE LAMP SWITCH TO CORRECT
KM8JN72D96U	9/29/05	23246	31.11	23246 CHECKED CODES FOUND 1513 ADJUSTED SWITCH AND CODE RESET. NEC TO REPLACE SWITCH	CUSTOMER STATES ESC LIGHT WAQS ON WENT OFF	POOR CONTACT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 23246 CHECKED CODES FOUND 1513 ADJUSTED SWITCH AND CODE RESET. NEC TO REPLACE SWITCH
KM8JM12B56U	7/12/05	51044	30.66		C STATES THE BRAKE LIGHTS DO NOT WORK AT TIMES	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B76U	7/22/05	15182	30.34		C STATES AFTER DRIVING THE CAR QUITE AWHILE(MYRTLE BEACH) THE ESC LIGHT COMES	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D86U	9/14/05	46575	30.66	MILAGE WAS INPUTTED WRONG VEHICLE HAS 46575 MILES	C STATES THE ESC LIGHT IS ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D36U	7/27/05	19464	31.11	19469 FOUND CODE C1513 BRAKE LIGHT SWITCH TRIED TO ADJUSTE SWITCH BUT CODE RETURNED WAS NECC. TO REPLACE SWITCH TO CORRECT AT THIS TIME	CUSTOMER STATES VEHICLE IS HAVING PROBLEMS THE HEADLIGHT TURNING OFF	POOR CONTACT	SWITCH ASSY-LIGHTING AND/OR TURN SIGNAL RE SWITCH ASSY-LIGHTING AND/OR TURN SIGNAL RE 19469 FOUND INTERNAL SHORT IN HEADLIGHT SWITCH AT THIS TIME COULD TURN SWITCH OFF BUT PARKING LIGHTS WILL STAY ON WAS NECC. TO REPLACE SWITCH TO CORRECT AT THIS TIME
KM8JN72D36U	7/27/05	19464	31.11	19469 FOUND CODE C1513 BRAKE LIGHT SWITCH TRIED TO ADJUSTE SWITCH BUT CODE RETURNED WAS NECC. TO REPLACE SWITCH TO CORRECT AT THIS TIME	CUSTOMER STATES VEHICLE ESC LIGHT IS COMING AND GOING	POOR CONTACT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 19469 FOUND CODE C1513 BRAKE LIGHT SWITCH TRIED TO ADJUSTE SWITCH BUT CODE RETURNED WAS NECC. TO REPLACE SWITCH TO CORRECT AT THIS TIME

KM8JN12D45U	5/03/05	44501	30.66		CAMPAIGN 922	00	ESC ECM REPROGRAMMING ESC ECM REPROGRAMMING
KM8JN12D45U	5/03/05	44501	30.66		CAMPAIGN 079	00	CAMPAIGN 079 CAMPAIGN 079
KM8JN12D45U	5/03/05	44501	30.66		C STATES WHEN THE CRUISE CONTROL ISSET IT WILL ACCL. BY ITSELF	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B57U	12/12/06	45	30.66		C STATES THE ESC LIGHT IS ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D56U	7/22/05	21892	31.11	21895 FOUND CODE C1513 BRAKE LAMP SWITCH FOUND BRAKE LIGHTS INTERMITTINLY NOT WORKING ADJUSTED BRAKE LIGHT SWITCH DIDN'T HELP FOUND INTERNAL FAILURE IN BRAKE LIGHT SWITCH WAS NECC. TO REPLACE TO CORRECT AT THIS TIME	CUSTOMER STATES CHECK ENGINE LIGHT IS ON SOP	POOR CONTACT	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE 21895 FOUND CODE PO130 O2 SENSOR CIRCUITMALF. FOUND INTERNAL FAILURE IN O2 SENSOR WASNECC. TO REPLACE B1S1 O2 SENSOR TO CORRECT ATTHIS TIME ROADTESTED NO LIGHTS OR CODES RESETAT T THIS TIME
KM8JN72D56U	7/22/05	21892	31.11	21895 FOUND CODE C1513 BRAKE LAMP SWITCH FOUND BRAKE LIGHTS INTERMITTINLY NOT WORKING ADJUSTED BRAKE LIGHT SWITCH DIDN'T HELP FOUND INTERNAL FAILURE IN BRAKE LIGHT SWITCH WAS NECC. TO REPLACE TO CORRECT AT THIS TIME	CUSTOMER STATES CHECK ENGINE LIGHT IS ON SOP	POOR CONTACT	SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION 21895 FOUND CODE PO130 O2 SENSOR CIRCUITMALF. FOUND INTERNAL FAILURE IN O2 SENSOR WASNECC. TO REPLACE B1S1 O2 SENSOR TO CORRECT ATTHIS TIME ROADTESTED NO LIGHTS OR
KM8JM12B15U	5/20/05	14946	30.34		C STATES THE ESP LIGHT IS ON	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12BX6U	8/31/05	23232	30.66		PARTS HAVE BEEN SPECIAL ORDERED FORYOUR VEHICLE YOU WILL BE CONTACTED VIA PHONE OR MAIL WHEN THEY ARRIVE.	15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B15U	5/13/05	42965	32.3	TECH CHECKED AND FOUND C1513 BRAKE SWITCH CIRCU IT - PERFORMED TEST AND TSB FOR ADJUSTING BRAKE SWITCH AND FOUND SWITCH BAD - REPLACED TO CORRECT	C STATES THE ESP LIGHT IS ON	15	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP TECH CHECKED AND FOUND C1513 BRAKE SWITCHCIRCU IT - PERFORMED TEST AND TSB FORADJUSTING BRAKE SWITCH AND FOUND SWITCH BAD - REPLACED TO CORRECT
KM8JN72D56U	7/22/05	21892	31.11	21895 FOUND CODE C1513 BRAKE LAMP SWITCH FOUND BRAKE LIGHTS INTERMITTINLY NOT WORKING ADJUSTED BRAKE LIGHT SWITCH DIDN'T HELP FOUND INTERNAL FAILURE IN BRAKE LIGHT SWITCH WAS NECC. TO REPLACE TO CORRECT AT THIS TIME	CUSTOMER STATES VEHICLE ESC LIGHT IS ON	POOR CONTACT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21895 FOUND CODE C1513 BRAKE LAMP SWITCHFOUND BRAKE LIGHTS INTERMITTINLY NOT WORKINGADJUSTED BRAKE LIGHT SWITCH DIDN'T HELP FOUNDINTERNAL FAILURE IN BRAKE LIGHT SWITCH WASNECC. TO REPLACE TO CORRECT AT THI
KM8JM12B86U	7/09/05	22340	31.11	22340 FOUND LIGHT IS COMING ON DUE TO BRAKE LIGHT SWITCH MALFUNCTION, NEC TO REPLACE BRAKE LIGHT SWITCH TO CORRECT	CUSTOMER STATES ESP LIGHT IS COMMING AND GOING	POOR CONTACT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 22340 FOUND LIGHT IS COMING ON DUE TO BRAKELIGHT SWITCH MALFUNCTION, NEC TO REPLACEBRAKE LIGHT SWITCH TO CORRECT
KM8JM12B26U	7/28/05	7381	32.44		MAINTENANCE AND SAFETY CHECK	GENERAL SAFETY AND MAINTENANCE INSPECTION	PERFORMED FREE SAFETY AND MAINTENANCE INSPECTION
KM8JM12B26U	7/28/05	7381	32.44		CUSTOMER STATES ESC LIGHT KEEPS COMING ON, LIGHT IS OFF AT THIS TIME. CHECK AND	TECH RAN SCAN TEST CODE C1513 BRAKE LAMP SWITCH MALFUNCTION.	TECH REMOVED AND INSTALLED NEW BRAKE LAMP SWITCH AND RETESTED.
KM8JM12B95U	5/13/05	35248	32.76		CUSTOMER STATES ESC OFF LIGHT COMES ON INTERMITTENTLY	TECH FOUND CODE SET C1513 BRAKE LAMP CIRCUIT MALFUNCTION	TECH REPLACED BRAKE SWITCH AND TESTED
KM8JN72D65U	5/21/05	26944	34.84		CUST STATES ESP LIGHT ON	15	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP FOUND CODE C1513 FOUND BAD BRAKE SWITCH ANDREP LACED W/NEW
KM8JN12D46U	8/08/05	30566	35.16		CUST STATES ESP LIGHT COMES ON SOP	15	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP FOUND CODE C1513 FOUND FAULTY BRAKE LAMP SWITCH REPLACED W/NEW AND CLEARED CODE
KM8JM12BX5U	6/15/05	10546	34.4		CUST STATES CAR WONT STOP AT TIMES SOP	FOUND FAULTY BRAKE SWITCH AND REPLACED W/NEW	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D96U	12/14/05	10403	56.74	SCANNED CAR.	CUSTOMER STATES ECS (TIRES PRESSURE) LIGHT ON) NOTICES IT WHEN BACKING UP	DEFECTIVE SWITCH ASSY STOP LAMP	REPLACED UNIT AND VEHICLE BACK TO FACTORY SPECIFICATIONS
KM8JN12D96U	10/13/05	16186	56.74	SCAN TOOL OP.	C/S ENGINE STALLS WHEN SLOWING DOWN OR STOP	COULD NOT DUPLICATE PROBLEM AT THIS TIME. CUSTOMER WELCOME ANYTIME DURING REGULAR BUSINESS HOURS WITHOUT	AN APT OK, IF PROBLEM DEVELOPS AGAIN.
KM8JN12D96U	10/13/05	16186	56.74	SCAN TOOL OP.	C/S ESP LIGHT GOES ON AND OFF	INSPECTED VEHICLE AND VERIFIED COMPLAINT. BRAKE LAMP SWITCH INOP. REPLACED UNIT AND VEHICLE BACK TO NORMAL	OPERATION.
KM8JN72D05U	9/21/04	32327	34.72	CUSTOMER STATES ESP LIGHT WON'T COME ON. FOUND BAD BRAKE LAMP SWITCH AND REPLACED WITH NEW. VERIFIED NORMAL OPERATION AND RELEASED VEHICLE TO CUSTOMER.	CUST STATES ESP LIGHT WONT COME ON	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE FOUND BAD BRAKE LAMP SWITCH AND REPLACEDW/NEW
KM8JN12DX6U	7/27/05	11242	35.16		CUST STATES ESC LIGHT COMES ON	15	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP FOUND CODE C1513 FOUND BAD BRAKE LAMP SWITCHAN D REPLACED

KM8JN12D95U	4/11/05	29541	34.84		CUST STATES CEL WAS ON AND ESP LIGHT CAME ON BUT NOW OFF	15	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP ESP LIGHT WAS ON CODE C1513 FOUND BAD STOPLAMP SWITCH REPLACED AND CLEARED CODE
KM8JN12D75U	3/24/05	12121	31.93				
KM8JN12D16U	12/14/05	15252	57.06	MINOR ELEC. DIAG. COMPLETE 93810RPO/93810R00/N69-C15	CUSTOMER STATE NO BRAKES LIGHTS	BRAKE LIGHT SWITCH FAILED REPLACE SWITCH	MINOR ELEC. DIAG. COMPLETE 93810RPO/93810R00/N69-C15
KM8JN12D95U	12/30/04	4	32.78	BRAKE LIGHTS INOPERABLE			
KM8JN12D95U	4/11/05	29541	34.84		CUST STATES A/C NOT COOLING SOP	06	R&R A/C COMPRESSOR R&R A/C COMPRESSOR FOUND A/C NOT COOLING AND VERY NOISEYCOMPRESSOR R AND WOULDNT HOLD A CHARGERPLACED W/NEW AND NOW OK
KM8JN72D36U	12/26/05	19743	39.35	CS ESC OFF LIGHT IS STAYING ON, C1513 BRAKE LIGHT SWITCH HAS INTERNAL FAILURE, REPLACED BRAKE LIGHT SWITCH	CUST STATES ESC OFF LIGHT IS STAYING ON	FAULT C1513 BRAKE LIGHT SWITCH HANS INTERNAL FAILURE	REPLACED BRAKE LIGHT SWITCH
KM8JN72D26U	11/30/05	5160	41.01	CS ESC LIGHT COMES WHILE DRIVING, C1513 BRAKE LIGHT SWITCH HAS INTERNAL SHORT, REPLACED BRAKE LIGHT SWITCH	CUST STATES ESC LIGHT COMES ON WHILE DRIVING	FAULT C1513 BRAKE LIGHT SWITCH HAS INTERNAL SHORT	REPLACED BRAKE LIGHT SWITCH
KM8JN12D86U	1/10/06	11700	71.51		C/S CRUIS CONTROL NOT WORKING INTERNAL FAILURE IN SWITCH	CRUISE CONTROL & STOP SWITCH REPLACE SWITCH	MINOR ELEC. DIAG. COMPLETE
KM8JN12D45U	11/03/04	22811	33.36		C/S CRUISE CONTROL NOT WORKING WONT RESET/ LIGHT BLINKS	BRAKE SWITCH FAILED REPLACE SWITCH	MINOR ELEC. DIAG. COMPLETE
KM8JM12B76U	8/29/05	20480	94.8	OPERATION.			
KM8JN12D35U	6/03/05	31340	25.46		C/S VEHICLE IS STALLING INTERM. AND WHEN TAKING RT TURNS AND SLOWING DOWN ENG. STALLS MORE FREQUENTLY	SCANNED FOR CODES AND FOUND 2 IN ECU (P0123,P0103) MISSFIRE (TPS) AIR FLOW SENSOR. CHECKED GROUND G10. THIS IS THE	COMMON GROUND FOR TPS AND AFS. VERIFIED REPAIR, GROUND IS TESTING GOOD. REPLACED TPS AND MAF SENSOR.
KM8JN12DX6U	7/19/05	22641	39.35	CS ESC LIGHT IS ON, OPEN CIRCUIT IN BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH	CUST STATES ESC LIGHT KEEPS COMING ON SOP	OPEN CIRCUIT IN WHEEL SPEED SENSOR	REPLACED WHEEL SPEED SENSOR.
KM8JN12DX6U	7/19/05	22641	39.35	CS ESC LIGHT IS ON, OPEN CIRCUIT IN BRAKE LIGHT SWITCH, REPLACED BRAKE LIGHT SWITCH	CUST STATES ESC LIGHT IS ON	OPEN CIRCUIT IN BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN72D86U	7/16/05	20520	35.99		CUSTOMER STATES WHEN DRIVING DOWN THE HWY ESC OFF LIGHT WILL APPEAR THEN GO AWAY	SCAN TEST FOUND CODE C1513 BRAKE LAMP SWITCH	INSTALLED NEW BRAKE LAMP SWITCH ERASES CODES RESCANED TO VERIFY REPAIR AND FOUND TO BE OPERATING TO MANUFACTURERS SPECS
KM8JM12B06U	8/30/05	16987	35		CUST STATES ESC LIGHT WILL NOT GO OFF, PART ORDERED AND IN	BRAKE SWITCH INTERNAL FAILURE	REPLACED BRAKE SWITCH
KM8JM12B46U	9/01/05	27160	35		CUSTOMER STATES THAT THE ECS LIGHT IS ON IT KEEPS GOING ON AND OFF	FAULTY BRAKE SWITCH	REPLACED BRAKE SWITCH
KM8JN12D66U	9/28/05	32552	31.6	ESC LIGHT GOES ON AND OFF.FOUND CODE STORED BRAKE LIGHT SWITCH MALFUNCTION.PLUGGED SWITCH BACK IN AND CAR WAS BACK TO NORMAL.	ESC LIGHT GOES ON AND OFF	INSPECTED VEHICLE AN DVERIFIED COMPLAINT. SCANNED VEHICLE AND FOUND CODE STORED. BRAKE LIGHT SWITCH MALFUNCTION.	PLUGGED SWITCH BACK IN AND VEHICLE BACK TO NORMAL OPERATION.
KM8JN72D65U	1/12/05	8738	62.36	ATT TIME IS FOR SCAN TIME FOR SCANNING FOR CODES, ESP LAMP WAS ON ALSO, C1513	CUSTOMER STATES WHEN YOU ACCELERATE ENGINE HESITATES	AIR MASS METER HOSE COMING OFF	REPLACED AIR MASS METER HOSE CLAMP AND TEST DROVE
KM8JN72D65U	1/12/05	8738	62.36	ATT TIME IS FOR SCAN TIME FOR SCANNING FOR CODES, ESP LAMP WAS ON ALSO, C1513 PRESENT	CUSTOMER STATES WHEN YOU PUT INTO GEAR VEHICLE STARTED SHAKING AND WHEN SHE WENT TO DRIVE TRANSMISSION STARTED SLIPPING HAVING TOWED IN	BRAKE LAMP SWITCH FAILURE	TEST AND REPLACED BRAKE LAMP SWITCH
KM8JN72D65U	1/12/05	8738	62.36	ATT TIME IS FOR SCAN TIME FOR SCANNING FOR CODES, ESP LAMP WAS ON ALSO, C1513	CUSTOMER REQUEST LOANER CAR D78423 Y		
KM8JN12D65U	5/13/05	2471	34.58		CUST. REQUESTS MINOR ELEC. DIAG. ESP LIGHT COMES ON	STOP SWITCH FAILED	REPLACE SWITCH
KM8JN12D65U	5/13/05	2471	34.58		CUST STATES SQUEAK OR RATTLE ON GLOVE	ADJUST STRIKER ON GLOVE BOX	COMPLETED
KM8JM12B06U	7/13/05	6764	35.9	REPLACE BRAKE SWITCH ASSY ELECTRICAL MALFUNTION	CUSTOMER STATES ESC LIGHT ON WONT TURN OFF	SCANNER SHOWS C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACE BRAKE SWITCH ASSY ELECTRICALMALFUNTION
KM8JN72D06U	11/22/05	10281	26.65				
KM8JN72DX6U	10/23/05	20865	32.74	CUSTOMER STATES THAT WARNING LIGHT COMES ON ESCPULLED CODE FOR BRAKE SWITCHREPLACED BRAKE SWITCH	WARNING LIGHT COMES ON ESC - SOP PART ORDERED LAST TIME IN - BRAKE SWITCH	OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D96U	11/17/05	23272	33.06	CUSTOMER STATES THAT ESC LAMP IS ONPULLED CODE P1513--INTERMITTANT OPENREPLACED BRAKE SWITCH	CUSTOMER STATES REAR CARGO TRAY HANDLE BROEN	BROKEN	TRIM ASSY-LUGGAGE PARTITION RE TRIM ASSY-LUGGAGE PARTITION RE
KM8JN12D06U	7/18/05	10102	35.9	R&R BRAKE PEDAL SWITH , ELECTRICAL MALFUNTION	CUSTOEMR CLAIMS ESC LIGHT ON	ELECTRICAL MALFUNTION	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE R&R BRAKE PEDAL SWITH , ELECTRICALMALFUNTION
KM8JN12D16U	9/22/05	20922	33.94	REPLACE BRAKE LIGHT SWITCH ASSY ELECTRICAL MALFUNTION	CUSTOMER CLAIMS RECALL AS PER HMA #079 AIRBAG MODULE	RECALL	CAMPAIGN 079 CAMPAIGN 079 RECALL DONE
KM8JN12D16U	9/22/05	20922	33.94	REPLACE BRAKE LIGHT SWITCH ASSY ELECTRICAL MALFUNTION	CUSTOMER CLAIMS ESC LIGHT ON	SCANNER SHOWS C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE REPLACE BRAKE LIGHT SWITCH ASSY
KM8JN72D96U	11/17/05	23272	33.06	CUSTOMER STATES THAT ESC LAMP IS ONPULLED CODE P1513--INTERMITTANT OPENREPLACED BRAKE SWITCH	CUSTOMER STATES ESC ON (SOP HERE).	OPEN CIRCUIT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE

KM8JN12D77U	11/14/06	1583	55.54	1583 SCAN VEH FOUND CODE C1513 BRAKE SWITCH CIRCUIT MAL TESTED SWITCH INTERNAL SHORT REPLACE OK AT T THIS TIME	C/S THAT THE ECS LIGHT STAYS ON	ESC LIGHT STAYS ON	ADDITIONAL TIME FOR SCAN TOOL BRAKE LITE SWITCH 1583 SCAN VEH FOUND CODE C1513 BRAKE SWITCHCIRCUIT MAL TESTED SWITCH INTERNAL SHORTREPLACE OK AT T THIS
KM8JN72D25U	6/10/05	14846	35.9	R&R BRAKE SWITCH , ELECTRICAL MALFUNTION	CUST STATES ESP LIGHT ON	ELECTRICAL MALFUNTION	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE R&R BRAKE SWITCH , ELECTRICAL MALFUNTION
KM8JN72D96U	11/05/05	17348	32.16	REPLACE AND ADJUST BRAKE LIGHT SWITCH	NO BRAKES LIGHTS	FAULTY BRAKE LIGHT SWITCH	REPLACE AND ADJUST BRAKE LIGHT SWITCH
KM8JN72D96U	11/05/05	17348	32.16	REPLACE AND ADJUST BRAKE LIGHT SWITCH	FOR AIR BAG LIGHT, PART WAS ORDERED	RECALL CAMPAIGN 079	REPLACE DRIVERS AIR BAG COVER PER RECALL CAMPAIGN 079
KM8JN12D77U	11/14/06	1583	55.54	1583 SCAN VEH FOUND CODE C1513 BRAKE SWITCH CIRCUIT MAL TESTED SWITCH INTERNAL SHORT REPLACE OK AT T THIS TIME	C/S THAT THE ECS LIGHT STAYS ON	ESC LIGHT STAYS ON	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 1583 SCAN VEH FOUND CODE C1513 BRAKE SWITCHCIRCUIT MAL TESTED SWITCH INTERNAL SHORTREPLACE OK AT T THIS TIME
KM8JN12D15U	5/16/05	41279	63.96	SCANNED FOR CODES AND FOUND CODE C1513 BRAKE SWITCH CIRCUIT. REPLACED BRAKE SWITCH.			
KM8JN12D26U	12/06/05	17276	63.96	17276 93810R00 TECH FOUND THAT THE BRAKE LIGHTS WOULD NOT WORK AND THE ESC OFF LIGHT WAS ON. TECH FOUND COD B1315 BRAKE SWITCH. TECH FOUND THAT THE SWITCH WAS OPEN. TECH REPLACED THE SWITCH AND IS NOW OPERATING NORMALY.	CUSTOMER STATES NO BRAKE LIGHT		SCAN TOOL GENERAL ENGINE SERVICES
KM8JN12D86U	10/14/05	34453	35.16		CUST STATES ESC LIGHT ON SOP BRAKE SWITCH	INTERNAL FAILURE IN SWITCH	REPLACED SWITCH
KM8JN12D86U	10/14/05	34453	35.16		CUST STATES FAN ONLY WORKS ON HIGH	INTERNAL FAILURE IN SWITCH	REPLACED
KM8JN12D86U	10/14/05	34453	35.16		CUST STATES AIR BAG RECALL SOP	RECALL	PERFORMED RECALL 61B046R0 .2
KM8JN12D26U	12/06/05	17276	63.96	17276 93810R00 TECH FOUND THAT THE BRAKE LIGHTS WOULD NOT WORK AND THE ESC OFF LIGHT WAS ON. TECH FOUND COD B1315 BRAKE SWITCH. TECH FOUND THAT THE SWITCH WAS OPEN. TECH REPLACED THE SWITCH AND IS NOW OPERATING NORMALY.	CUSTOMER STATES NO BRAKE LIGHT		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D05U	4/29/05	41632	63.96	41632 CODE C1513 BRAKE LIGHT SWITCH 93810R00 0.3 REPLACED BRAKE LIGHT SWITCH & RESET ECU			
KM8JN12D15U	4/21/05	9598	34.4	9598 TECH. DIAG. THAT BRAKE SW. HAD AN OPEN/SHORT WHICHD CAUSE BRAK LIGHTS NOT WORK.	C/S THAT THE BRAKE LIGHTS ARE INOP	E	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 9598 TECH. DIAG. THAT BRAKE SW. HAD ANOPEN/SHORT WHICHD CAUSE BRAK LIGHTS NOTWORK.
KM8JN72D76U	10/15/05	17783	34.84	SCANNED CODE C1513GETTING NO SIGNAL FROM LIGHT SWITCH HAS INTERNAL SHORT	CUSTOMER STATES THAT THE ESC LIGHT GOES ON AND OFF PLKEASE CHECK AND ADVISE	SCANNED FOR CODES FOUND CODE C1513 CHECKED BRAKE LIGHTS. LIGHT INOP CHECKED FOR POWER AND GROUND AT BRAKE LIGHT SWITCH GOOD GETTING NO SIGNAL FROM LIGHT SWITCH. SWITCH HAS INTERNAL SHORT	INSTALLED NEW BRAKE LIGHT SWITCH. LIGHTS NOW WORK CLEARED CODE TOOK FOR READ TEST OK COMPLETEJR
KM8JN72D76U	10/15/05	17783	34.84	SCANNED CODE C1513GETTING NO SIGNAL FROM LIGHT SWITCH HAS INTERNAL SHORT	CUST REQUESTS TO PERFORM RECALL 079 0	RECALL COMPLETE JR	ORDERED PART
KM8JM12B77U	11/09/06	3262	35.16		CUST STATES ECS LIGHT STAYS ON... CK AND ADVISE	VERIFIED CONCERN S/C C1513 SHORTED BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH OPERATION NORMAL
KM8JN12D35U	5/24/05	19821	63.96	19821 SCAN VEH FOUND CODE C1513 BRK LAMP SWITCH MAL REPLACE SWITCH AND CLEARED CODE			
KM8JN12D36U	1/13/06	44311	63.96	44311 CODE P1513 BRAKE LIGHT SWITCH 93810R00 0.3 REPLACED BRAKE LIGHT SWITCH			
KM8JN72D06U	7/22/05	21617	27.15	21617 SCANED VEHICLE AND FOUND CODE C1513 BRAKE LAMP SWITCH. ADJUSTED SWITCH CLEARED CODE AND TEST DROVE. CAN NOT DUPLICATE ANY PROBLEM AT THIS TIME. MILEAGE 21621	C/S ESC LIGHT STAYS ON INTERMITTANTLY AND WILL NOT RESPOND TO SWITCH//ADVISE		GENERAL ENGINE SERVICES GENERAL ENGINE SERVICES 21617 SCANED VEHICLE AND FOUND CODE C1513BRAKE LAMP SWITCH. ADJUSTED SWITCH CLEAREDCODE AND TEST DROVE. CAN NOT DUPLICATE ANYPROBLEM AT THIS TIME. MILEAGE 21621
KM8JN12D26U	10/05/05	49856	35.16	REPLACED BRAKE SWITCH			
KM8JM12B36U	9/13/05	24505	34.84	FOUND STOP LAMP SWITCH SHORTED	CUST REQUESTS TO PERFORM RECALL 079	RECALL	PERFORMED RECALL 61B046R0 .2
KM8JN12D66U	7/15/05	28241	35.87	28241 LAMP SWITCH NOT WITH IN SPECS 93810R00 0.3 PULLED LAMP SWITCH AND TEST WITH OHM METER LAMP SWITCH NOT IN SPECS REPLACED LAMP SWITCH BRAKE LIGHTS WORKING CODE C1513 BRAKE LAMPS SWITCH CLEARED CODE TK2307			

KM8JN12D96U	11/05/05	30375	35.87	30375 BRAKE LAMPS SWITCH SHORTING OUT 93810R00 0.3 CHECK LAMPS SWITCH READING ARE NOT INSPECTS REPLACED LAMPS SWITCH CLEARED CODES LIGHT DOES NOT COME BACK ON TK2307			
KM8JN12D26U	10/24/05	4384	32.44	4384 FOUND CODE C1513 (BRAKE SWITCH CKT MAL) REMOVED AND REPLACED BRAKE SWITCH AND CODE CLEARED	DRIVER AIRBAG COVER MOD REPL (07-01-001)	E	DRIVER AIRBAG MODULE REPLACEMENT DRIVER AIRBAG MODULE REPLACEMENT 4384 TSB FOR AIR BAG MOD REPLACEMENT IS COMPLETE
KM8JN12D26U	10/24/05	4384	32.44	4384 FOUND CODE C1513 (BRAKE SWITCH CKT MAL) REMOVED AND REPLACED BRAKE SWITCH AND CODE CLEARED	C/S TCS OFF LIGHT IS ON ///ADVISE	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 4384 FOUND CODE C1513 (BRAKE SWITCH CKT MAL) REMOVED AND REPLACED BRAKE SWITCH AND CODE CLEARED
KM8JN12D55U	10/15/04	17383	34.16	17383 CRUISE INOP BRAKE SWITCH READS OL IN BOTH POSITIONS ON LOWER CONTRACT WHEN IS DOES READ RESISTANCE IS AT 4.56OHMS. 93810R00 .3 REPLACE BRAKE SWITCH RETEST CLEAR ANY CODES ROADTEST VERIFY			
KM8JM12B45U	7/05/05	36483	35.87	36483 C1513 BRAKE LAMP SWITCH 93810R00 0.3 CHECKED FOR GOOD ADJUSTMENT, WITHIN SPECS, REMOVED AND REPLACED, CLEARED DTC TK1828			
KM8JN12D07U	9/21/06	103	35.55	103 CODE01513 BRAKE SWITCH TEST BRAKE SWITCH LOWER CONTACTS READ 8.4OHMS CLOSED-OL OPEN, UPPER CONTACTS READ 0.02OHMS OPEN AND OL CLOSED 93810R00 .3 REPLACE BRAKE SWITCH CLEAR CODE RETEST ROADTEST TK1800			
KM8JN12D97U	7/24/06	1942	36.49	1942 SCANED VEHICLE AND FOUND CODE C1513 BRAKE SWITCH CIRCUIT. ADJUSTED BRAKE FRIST, CODE CAME BACK AND ABS LITE CAME ON. REPLACED BRAKE SWITCH FOR INTERNAL SHORT. CODE GONE AT THIS TIME.	C/S THAT THE ESC LIGHT STAYS ON	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 1942 SCANED VEHICLE AND FOUND CODE C1513 BRAKE SWITCH CIRCUIT. ADJUSTED BRAKE FRIST, CODE CAME BACK AND ABS LITE CAME ON. REPLACED BRAKE SWITCH FOR INTERNAL SHORT. CODE GONE AT THIS TIME.
KM8JN72D76U	7/22/05	36700	63.96	36700 93810R00 .3 SCANED VEHICLE AND FOUND CODE C1513 BRAKE SWITCH CIRCUIT. ADJUSTED SWITCH FIRST, CODE WOULD NOT CLEAR. REPLACED SWITCH, CODE CLEARED.			
KM8JN12D85U	12/10/04	21179	54.3	THE TECH HAD RIDDEN WITH THE CUSTOMER ON A DIFFERENT OCCASION AND AT THAT TIME FELT IT WAS A BRAKE SWITCH PROBLEM. THE TECH ADJUSTED THE BRAKE PEDAL SWITCH TO CORRECT. TEST DROVE AND THE CRUISE WAS WORKING AS DESIGNED.			
KM8JN12D96U	4/07/06	3584	37.51	3584 FOUND OPEN IN BRAKE SWITCH 93810R .3 R&R BRAKE SWITCH AND RETEST TO VERIFY THE REPAI	C/S BRAKE LIGHTS DO NOT WORK ---SOPS HERE	E	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 3584 FOUND OPEN IN BRAKE SWITCH 93810R .3 R&R BRAKE SWITCH AND RETEST TO VERIFY THE REPAI
KM8JN72DX6U	8/09/05	32847	29.82		CUSTOMER STATES CHECK ENGINE LIGHT ON	TESTED AND CHECKED SYSTEM FOUND ECS LIGHT ON HAD CODE P1315 BRAKE LIGHT SWITCH GAS OPE/SHORT	R/R BRAKE LIGHT SWITCH CLEARED CODES AND RETESTED
KM8JN72D46U	10/14/05	31426	63.96	31426 93810R00 .3 INSTALLED S/O BRAKE SWITCH DUE TO INTERNAL SHORT CHECK HISTORY FOR DTC DESCRIPTION.	CS/ ESC OFF LIGHT STAYS ON INSTALL SOP BRAKE SWITCH	ESC LIGHT ON	SCAN TOOL GENERAL ENGINE SERVICES 31426 93810R00 .3 INSTALLED S/O BRAKE SWITCH DUE TO INTERNAL SHORT CHECK HISTORY FOR DTC DESCRIPTION.
KM8JN72D46U	10/14/05	31426	63.96	31426 93810R00 .3 INSTALLED S/O BRAKE SWITCH DUE TO INTERNAL SHORT CHECK HISTORY FOR DTC DESCRIPTION.	CS/ ESC OFF LIGHT STAYS ON INSTALL SOP BRAKE SWITCH	ESC LIGHT ON	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 31426 93810R00 .3 INSTALLED S/O BRAKE SWITCH DUE TO INTERNAL SHORT CHECK HISTORY FOR DTC DESCRIPTION.
KM8JN72DX6U	8/09/05	32847	29.82		CUSTOMER STATES NOISE IN FRONT END WHILE DRIVING	TESTED AND CEHCKED SYSTEM FOUND R/FRT STRUT MOUNT WEAK AND MAKING NOISE.	ORDERED PART
KM8JM72B66U	2/09/06	14825	30.14	R/R SWITCH, CLEARED CODES AND RETESTED	CUSTOMER STATES ESC LIGHT AND ENG LIGHT IS ON	TESTED AND CHECKED SYSTEM HAD CODE C1611 CANTIME OUT	R/R ABS MODULE, CLEARED CODES AND RETESTED
KM8JM72B66U	2/09/06	14825	30.14	R/R SWITCH, CLEARED CODES AND RETESTED	CUSTOMER STATES CHECK ENGINE LIGHT ON	TESTED AND CHECKED SYSTEM HAD CODE C1615 BRAKE LIGHT SWITCH HAS OPEN/SHORT	R/R SWITCH, CLEARED CODES AND RETESTED
KM8JN12D66U	10/05/05	21146	63.96	21146 93810R00 .3 DTC C1513 BRAKE SWITCH CIRCUIT. ADJUST THE SWITCH, ESC LIGHT WOULD NOT SHUT OFF. REPLACED THE BRAKE LAMP SWITCH DUE TO INTERNAL SHORT/ POOR CONTACTS IN SWITCH. ESC LIGHT IS OFF AT THIS TIME. DTC P0130 O2 SENSOR CIRCUIT MAL.B1-S1 FOUND NO T	ESC LIGHT WILL NOT SHUT OFF AND SES LIGHT WASH ON ALSO	ESC AND SES LIGHT ON	SCAN TOOL GENERAL ENGINE SERVICES 21146

KM8JN12D66U	10/05/05	21146	63.96	21146 93810R00 .3 DTC C1513 BRAKE SWITCH CIRCUIT. ADJUST THE SWITCH,ESC LIGHT WOULD NOT SHUT OFF. REPLACED THE BRAKE LAMP SWITCH DUE TO INTERNAL SHORT/ POOR CONTACTS IN SWITCH. ESC LIGHT IS OFF AT THIS TIME. DTC P0130 O2SENSOR CIRCUIT MAL.B1-S1 FOUND NO T	ON SHARP RIGHT OR LEFT TURN SQUEAKNOISE	F	LINK ASSY-STABILIZER (LH)RE LINK ASSY-STABILIZER (LH)RE 21146 54840R00 .2 FOUND THAT THE SWAY BARLINK ON THE LF. HAD EXCESSIVE PLAY. REPLACEDTHE L.F SWAY BAR LINK TEST DROVE AND SOUNDRETURN. RECOMMEND LEAVE THE VEHICLE FORLONGER DIAG TIME.
KM8JN72D65U	1/24/05	30020	30.14		CUSTOMER STATES ENG LIGHT COMING ON	TESTED AND CHECKED SYSTEM FOUND CODE C1513 BRAKE LIGHT SWITCH HAS OPEN/SHORT	R/R SWITCH CLEARED CODES AND RETESTED
KM8JN72D65U	1/24/05	30020	30.14		CUSTOMER STATES CHECK ENGINE LIGHT ON	TESTED AND CHECKED SYSTEM HAD CODE P0130 EVAP SYSTEM LARGE LEAK	RAN TEST 3 TIMES PASSED TEST,CLEARED CODES
KM8JN72D65U	1/24/05	30020	30.14		CUSTOMER STATES A/C NOT COLD	TESTED AND CHECKED SYSTEM COOLING TO 38 DEGREES	NO PROBLEM FOUND
KM8JM72B15U	6/16/05	34302	20.48	CLEARED CODES WORKING AS DESIGNED	CUSTOMER STATES ABS LIGHT AND 4WD LIGHTS FLASH AT TIMES	TESTED ANDCHK FOUND CODE C1208 WHEEL SPEED SENSOR,AND1513 BRAKE LIGHT SWITCH	CLEANED BACK OF SENSOR AND BRAKE LIGHT SWITCH WORK GOOD NOW
KM8JN12D66U	10/05/05	21146	63.96	21146 93810R00 .3 DTC C1513 BRAKE SWITCH CIRCUIT. ADJUST THE SWITCH,ESC LIGHT WOULD NOT SHUT OFF. REPLACED THE BRAKE LAMP SWITCH DUE TO INTERNAL SHORT/ POOR CONTACTS IN SWITCH. ESC LIGHT IS OFF AT THIS TIME. DTC P0130 O2SENSOR CIRCUIT MAL.B1-S1 FOUND NO T	ESC LIGHT WILL NOT SHUT OFF AND SES LIGHT WASH ON ALSO	ESC AND SES LIGHT ON	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21146
KM8JN12D26U	10/09/05	28692	63.96	28692 93810R00 + SCAN TOOL TIME CAR HAD CODE C1513 BRAKE SWITCH CIRCUIT, FOUND THE BRAKE SWITCH HAD AN INTERMITTANT OPEN WHILE DRIVING, REMOVED AND REPLACED, CODE DID NOT COME BACK			
KM8JN72D56U	7/18/05	19712	32.44	19712 WHEN READING CODES FOUND C1237 *PRIMARY PRESSURE SENSOR SIGNAL * AND C1513 BRAKE SWITCH CIRCUIT. CODE C1237 IS SET WHEN THERE IS NO BRAKE SWITCH CIRCUIT * CODE C1513 * AND THERE IS MORE THAN 20 BAR OF PRESSURE APPLIED * ONE BAR IS 14.5 LBS ROUGHLY *	DRIVER AIRBAG COVER MOD REPL (07-01-001)	E	DRIVER AIRBAG MODULE REPLACEMENT DRIVER AIRBAG MODULE REPLACEMENT 19712 COMPLETE
KM8JN72D25U	10/12/04	29842	28.71	R/R BRAKE LIGHT SWITCH AND RETESTED	CUSTOMER STATES CRUISE NOT WORKING	TESTED AND CHECKED SYSTEM FOUND BRAKE SWITCH HAS INTERNAL PROBLEM	R/R BRAKE SWITCH AND RETESTED
KM8JN12D06U	12/08/05	29293	34.84		CRUISE CONTROL ACTS LIKE IT WILL GOON AND THEN WHEN YOU PRESS BUTTON TO ACCEL IT DISENGAGES	F	WIRE REPAIR TIME (MAJOR)- ADJUSTMENT WIRE REPAIR TIME (MAJOR)-ADJUSTMENT
KM8JN12D06U	12/08/05	29293	34.84		CRUISE CONTROL ACTS LIKE IT WILL GOON AND THEN WHEN YOU PRESS BUTTON TO ACCEL IT DISENGAGES	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D56U	7/18/05	19712	32.44	19712 WHEN READING CODES FOUND C1237 *PRIMARY PRESSURE SENSOR SIGNAL * AND C1513 BRAKE SWITCH CIRCUIT. CODE C1237 IS SET WHEN THERE IS NO BRAKE SWITCH CIRCUIT * CODE C1513 * AND THERE IS MORE THAN 20 BAR OF PRESSURE APPLIED * ONE BAR IS 14.5 LBS ROUGHLY *	C/S THAT THE ESC LIGHT INTERMITTENTLY STAYS ON AFTER THE CAR IS STARTED	E	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 19712 WHEN READING CODES FOUND C1237*PRIMARY PRESSURE SENSOR SIGNAL * AND C1513BRAKE SWITCH CIRCUIT. CODE C1237 IS SET WHEN THERE IS NO BRAKE SWITCH CIRCUIT * CODE C1513* AND THERE IS MORE THAN 20
KM8JM12B06U	11/23/05	23334	63.96	23334 CODE P1513 BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH & RESET ECM			
KM8JN12D46U	8/17/05	33105	35.16		CUSTOMER STATES ESC LIGHT ON	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B95U	5/10/05	30505	35.16		CUSTOMER STATES ESP OFF LIGHT STAYSON	REPLACED BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D26U	1/13/06	18366	31.64				
KM8JN72D06U	7/26/05	18728	20				
KM8JN72D06U	7/26/05	18728	30.34	FOUND BRAKE SWITCH ON DATA SCREEN INTERMITTENTLY WAS SAYING OFF WITH PEDAL PUSHED IN AND ALSO TEST LIGHT SOMETIMES NOT LIGHTNG UP WHEN HOD IN CIRRCUT. ALSO SWITCH HAS SLOW REACTION TIME. SCAN CODE C1513 NEEDS BRAKE SWITCH			
KM8JN72D36U	7/27/05	20670	29.76	ENG LIGHT ON. FOUND BRAKE LIGHT SWITCH MALFUNCTION C1513. REPLACED BRAKE LIGHT SWITCH.			
KM8JN72D66U	7/15/05	13449	31.4				
KM8JN12D05U	6/21/05	17330	33.28		C/S THE ESP LIGHT COMES ON	FOUND CODE C1513 BRAKE LAMP SWITCH; INTERNAL PROBLEM WITH SWITCH	REPLACED SWITCH 98310R00 N=94 C=15
KM8JM12B15U	7/05/05	17639	33.28	BRAKE SWITCH INTERNALLY SHORTED CODE C1513 C1237, REPLACED SWITCH AND CLEARED CODES, RETESTED OK	CUST STATES ESP OFF LIGHT KEEPS COMING ON. ORDERED STOP LAMP SWITCH, HERE. INSTALL	BRAKE SWITCH BAD CODE C1513 C1237	REPLACED SWITCH AND CLEARED CODES
KM8JM12B96U	9/23/05	27791	31.32				
KM8JN12D76U	12/20/05	13482	31.32		C/S ESC LIGHT ON	FOUND CODE C1513 BRAKE SWITCH INTERMITTENT	REPLACED BRAKE LAMP SWITCH
KM8JN72D66U	7/15/05	14201	31.4				

KM8JN12D96U	9/28/05	31394	28.99	NA			
KM8JN12D56U	8/16/05	13255	58.26	13255 BRAKE LIGHT SWITCH INOP INT C1513 .3 93810R00 .3 93810ATT N/69 C/15 REPLACED BRAKE LIGHT SWITCH AND RETESTED ESC SYSTEM NO OTHER PROBLEMS DETECTED AT THIS TIME			
KM8JN12D46U	7/16/05	23936	31.64				
KM8JN12D76U	1/04/06	19410	64.86	19415 VEH HAD CODE C1513 SCAN TESTED VEH, HAD CODE C1513 FOR BRAKE LAMP SWITCH, REPLACED BRAKE LAMP SWITCH AND TEST DROVE VEH. CRUISE OPERATION OK AFTER REPAIRS			
KM8JN12D46U	7/27/05	20250	33.64	20250 ESC LIGHT ON CODE C1513 BRAKE LIGHT SWITCH PROBLEM .3 93810R00 N/94 C/15 REPLACED BRAKES LIGHT SWITCH AND RETESTED ESC SYSTEM NO OTHER PROBLEMS DETECTED AT THIS TIME			
KM8JN72D96U	7/14/05	26979	58.26	26979 BRAKE LIGHT SWITCH INT INOP C1513 .3 93810R00 .3 93810ATT N/69 C/15 TESTED AND REPLACED BRAKE LIGHT SWITCH RETESTED ESC SYSTEM NO OTHER PROBLEMS DETECTED AT THIS TIME			
KM8JN12D26U	7/26/05	27031	50.16	27031 CODE FOR BRAKE LIGHT SWITCH OPEN C1513 .3 93810R00 .3 93810ATT N/69 C/15 REPLACED BRAKE LIGHT SWITCH AND RETESTED SYSTEM NO OTHER PROBLEMS DETECTED AT THIS TIME			
KM8JN12D36U	1/20/06	10091	36.94	10092 REPLACED BRAKE LAMP SWITCH AND YAW SENSOR PER CODE. SCAN TESTED, CODE C1260 STEERING SENSOR ABNORMAL AND CODE C1513 BRAKE LAMP SWITCH CODE, FAILED SWITCH, REPLACED YAW SENSOR AND BRAKE LAMP SWITCH, CLEARED CODE AND TESTED, OK NOW.	CUSTOMER STATES: "ESC OFF" LIGHT IS ON, CHECK AND ADVISE	REPLACED BRAKE LAMP SWITCH AND YAW SENSOR PER CODE.	SENSOR-ANGULAR VELOCITY SENSOR-ANGULAR VELOCITY 10092 REPLACED BRAKE LAMP SWITCH AND YAWSENSOR PER CODE. SCAN TESTED, CODE C1260 STEERING SENSOR ABNORMAL AND CODE C1513 BRAKELAMP SWITCH CODE, FAILED SWITCH, REPLACED YAWSENSOR AND BRAKE LAMP SWITCH, CLEARE
KM8JN12D36U	1/20/06	10091	36.94	10092 REPLACED BRAKE LAMP SWITCH AND YAW SENSOR PER CODE. SCAN TESTED, CODE C1260 STEERING SENSOR ABNORMAL AND CODE C1513 BRAKE LAMP SWITCH CODE, FAILED SWITCH, REPLACED YAW SENSOR AND BRAKE LAMP SWITCH, CLEARED CODE AND TESTED, OK NOW.	CUSTOMER STATES: "ESC OFF" LIGHT IS ON, CHECK AND ADVISE	REPLACED BRAKE LAMP SWITCH AND YAW SENSOR PER CODE.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 10092 REPLACED BRAKE LAMP SWITCH AND YAWSENSOR PER CODE. SCAN TESTED, CODE C1260 STEERING SENSOR ABNORMAL AND CODE C1513 BRAKELAMP SWITCH CODE, FAILED SWITCH, REPLACED YAWSENSOR AND BRAKE LAMP SWITCH, CLEA
KM8JN72D06U	8/09/05	6232	34.84	6232 INTERMITTANT BRAKE SWITCH OPEN 93810R00 .3 N/94 C/15 R5 5NMSH13E47H058220 \$10.00 CHECKED CODES, C1513. REPLACED BRAKE LIGHT	CK FOR BRAKE LAMP BULB INOP	BULB BURNT OUT	BULBS (RH) BULBS (RH) 6232 BULB BURNT OUT 18642ROR .2 N/94 C/15REPLACE RIGHT BRAKE LIGHT BULB.
KM8JN72D06U	8/09/05	6232	34.84	6232 INTERMITTANT BRAKE SWITCH OPEN 93810R00 .3 N/94 C/15 R5 5NMSH13E47H058220 \$10.00 CHECKED CODES, C1513. REPLACED BRAKE LIGHT	079 DRIVER AIRBAG COVER MOD REPL (07-01-001)	RECALL	DRIVER AIRBAG MODULE REPLACEMENT DRIVER AIRBAG MODULE REPLACEMENT 6232 RECALL 61B046R0 2 REPLACE DRIVERS AIRBAG COVER
KM8JN12D75U	5/18/05	16282	34.1	16282 ESP LIGHT ON WH USED SCAN TOOL AND FOUND CODE C1513. FOUND INTEWRMITANT OPEN CUIRCUIT AT BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH AND CLEARED CODE. CHECKED FOR PROPER OPERATION	C/S ESP OFF LIGHT COMES ON AND OFF (LIGHT WILL COME ON AND CUSTOMER MUST TURN VEH OFF, RESTART VEH, THEN LIGHT WILL STAY OFF FOR A LITTLE WHILE, AND THEN COME BACK ON) CK AND ADVISE	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16282 ESP LIGHT ON WH USED SCAN TOOL AND FOUND CODE C1513. FOUND INTEWRMITANT OPEN CUIRCUIT AT BRAKE LAMP SWITCH REPLACED BRAKELAMP SWITCH AND CLEARED CODE. CHECKED FOR PROPER OPERATION
KM8JN12D36U	1/10/06	4587	36.94	4587 USED SCAN TOOL AND FOUND CODE C1513. INTERMITTANT OPEN INSIDE BRAKE SWITCH. WAS ADJUSTED CORRECTLY ACCORDING TO SHOP MANUAL. REPLACED BRAKE SW 0			
KM8JN12D26U	8/22/05	21705	34.1	21705 ECS LIGHT ON WH USED SCAN TOOL CODE P1513. DEFECTIVE BRAKE SW. REPLACED BRAKE SWITCH. CHECKED FOR PROPER OPERATION. S/O PART FOR OTHER CODE. LIGHT MAY COME	MAINTANCE LOF	MC -RE	MAINTANCE LOF MAINTANCE LOF 21705 LOF .3 PERFORMED OIL CHANGE
KM8JN72D06U	8/09/05	6232	34.84	6232 INTERMITTANT BRAKE SWITCH OPEN 93810R00 .3 N/94 C/15 R5 5NMSH13E47H058220 \$10.00 CHECKED CODES, C1513. REPLACED BRAKE LIGHT SWITCH..	CK FOIR ESC LAMP COMES ON A COUPLETIMES A WEEK	INTERMITTANT BRAKE SWITCH OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 6232 INTERMITTANT BRAKE SWITCH OPEN 93810R00.3 N/94 C/15 R5 5NMSH13E47H058220 \$10.00CHECKED CODES, C1513. REPLACED BRAKE LIGHTSWITCH..
KM8JN72D06U	8/09/05	6232	34.84	6232 INTERMITTANT BRAKE SWITCH OPEN 93810R00 .3 N/94 C/15 R5 5NMSH13E47H058220 \$10.00 CHECKED CODES, C1513. REPLACED BRAKE LIGHT SWITCH..	CK FOIR ESC LAMP COMES ON A COUPLETIMES A WEEK	INTERMITTANT BRAKE SWITCH OPEN	HYUNDAI LOANER HYUNDAI LOANER 6232 INTERMITTANT BRAKE SWITCH OPEN 93810R00.3 N/94 C/15 R5 5NMSH13E47H058220 \$10.00CHECKED CODES, C1513. REPLACED BRAKE LIGHTSWITCH..

KM8JN72D55U	2/18/05	6512	67.5	PERFORMED HI SCAN TEST. CODE C1513 BRAKE LAMP SWITCH, CHECKED FUSE 31-015, CHECKED BRAKE LAMP SWITCH-OK, TRACED TO OPEN CIRCUIT TO RIGHT SIDE KICK PANEL CONNECTOR NOT SECURED, LOCK CONNECT OR AND CLEARED CODE	ESP LITE ON	F	WIRE REPAIR TIME (MAJOR) WIRE REPAIR TIME (MAJOR) PERFORMED HI SCAN TEST, CODE C1513 BRAKE LAMPS SWITCH, CHECKED FUSE 31-015, CHECKED BRAKE LAMP SWITCH-OK, TRACED TO OPEN CIRCUIT TORIGHT SIDE KICK PANEL CONNECTOR NOT SECURED,LOCK CONNECT OR
KM8JN12D26U	8/22/05	21705	34.1	21705 ECS LIGHT ON WH USED SCAN TOOL CODE P1513. DEFECTIVE BRAKE SW. REPLACED BRAKE SWITCH. CHECKED FOR PROPER OPERATION. S/O PART FOR OTHER CODE. LIGHT MAY COME BACK ON	C/S ESC LIGHT GOES ON OFF INTERM, CK AND ADVISE	POOR CONTACT -RE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 21705 ECS LIGHT ON WH USED SCAN TOOL CODEP1513. DEFECTIVE BRAKE SW. REPLACED BRAKESWITCH. CHECKED FOR PROPER OPERATION. S/OPART FOR OTHER CODE. LIGHT MAY COME
KM8JN12D96U	8/17/05	23679	34.1	23683 REPLACED BRAKE LAMP SWITCH PER CODE. WH SCAN TESTED, CODE C1513 BRAKE LAMP SWITCH, REPLACED BRAKE LAMPS SWITCH, CLEARED CODE AND ROAD TESTED, LIGHT DID NOT RESET.	C/S ESC LIGHT COMES ON, INTERM. CK AND ADVISE	.	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 23683 REPLACED BRAKE LAMP SWITCH PER CODE. WHSCAN TESTED, CODE C1513 BRAKE LAMP SWITCH,REPLACED BRAKE LAMPS SWITCH, CLEARED CODE ANDROAD TESTED, LIGHT DID NOT RESET.
KM8JN72D55U	2/18/05	20615	32.23	20615 F RAN HI SCAN, FOUND CODE C1513, BRAKE SWITCHFH ERROR, REPLACED BRAKE SWITCH ECS SYSTEM IS OPERATIONAL	CUST STATES AT TIMES THE ESC LITES HAS BEEN COMING ON - ADN HITTING HTE ESC BUTTON THE LITEW ILL NOT TURN OFF - SEEMS TO BE RELATED TO NOIS	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20615 F RAN HI SCAN, FOUND CODE C1513,BRAKE SWITCHFH ERROR, REPLACED BRAKE SWITCHCHCS SYSTEM IS OPERATIONAL
KM8JN72D76U	7/26/05	29536	33.66	29536 F PERFORM HI-SCAN AND AND FOUND CODE C1513-BRAKE SWITCH MALFUNCTION FOUND SWITCH SHORTED REPLACED	AFTER REPAIRING VISCOUS COUPLER - STIL HAD SOME NOISE FROM UNDER THE HOOD - SCREACHING	F	TENSIONER ASSY-DRIVE BELTRE TENSIONER ASSY-DRIVE BELTRE 29536 F SEE JOB A
KM8JN12D66U	7/29/05	25485	64.54	25485 USED SCAN TOOL AND FOUND CODE C1213. FOUND INTERMITANT OPEN CONECTION INSIDE BRAKE SWITCH. REPLACED BRAKE SWITCHCH ASSY. 0 FOUND TSB AVAILABLE FOR THIS CODE BUT DOES NOPT APPLY. BRAKE SWITCH ADJUSTED			
KM8JN12D96U	8/16/05	27497	37.26	27500 USED SCAN TOOL AND FOUND CODE C1513. FOUND POOR CONTACTS INSIDE BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH AND CHECKED FOR PROPER OPERAT 0			
KM8JN12D66U	7/29/05	25485	25				
KM8JN72D76U	7/26/05	29536	33.66	29536 F PERFORM HI-SCAN AND AND FOUND CODE C1513-BRAKE SWITCH MALFUNCTION FOUND SWITCH SHORTED REPLACED	CUST STATES THERE IS A NOISE IN THEFRONT OF THE VEHICLE - SCREACHING NOISE - HEARD AFTER DRIVING IT ABOUT 15 MILES - HEARD WHEN TURNINGTH	F	COUPLING ASSY-4WD COUPLING ASSY-4WD 29536 F FOUND REAR VISCOUS COUPLER GROWLINGFROM THE REAR, REPLACED COUPLER-BEARINGSNOISEY, AFTER REPLACING COUPLER WE ALSO DIDHEAR THE SCREAYCHING FROM UNDER THE HOOD,REPLACED SERPENTINE BELT TENSIONER
KM8JN72D76U	7/26/05	29536	33.66	29536 F PERFORM HI-SCAN AND AND FOUND CODE C1513-BRAKE SWITCH MALFUNCTION FOUND SWITCH SHORTED REPLACED	PERFORM MANUFACTURER CAMPAIGN-079-	F	RECALL 079 - DAB COVER MODULE RECALL 079 - DAB COVER MODULE 29536 F COMPLETED RECALL
KM8JM12B65U	5/20/05	49285	64.86	49288 USED SCAN TOOL AND FOUND CODE C1513. FOUND STUCK BRAKE SWITCH CONTACTS. REPLACED BRAKE SWITCH AND CHECKED FOR PROPER OPERATION 0 RECOMEND BELTS AND 30K			
KM8JN72D05U	1/19/05	41197	35.55	41197 C1513 CODE STORED. WH SCAN TEST ESP,1513 CODE STORED,FAULTY BRAKE LIGHT SWITCH. REPLACE BRAKE LIGHT SWITCH & CHEC K OPPERATION.	C/S CHECK ENGINE LIGHT IS ON, HEITATION WHEN TRYING TO ACCELEARATE FROM A STOP PLEASE CHECK AND ADVISE	.	CLAMP CLAMP 41197 CLAMPS SLIPPED OFF. WH SCAN TEST,LEANCODES,AIR FLOW CODES STORED P117 0 & P1171CODES. AIRFLOW METER LOOSE. REPLACE CLAMPS ONAIR FLOW METER WITH UPDATED CLAMPS. CLEARCODES & CHECK OPPERATION AFTER REPAIRS.
KM8JN72D05U	1/19/05	41197	35.55	41197 C1513 CODE STORED. WH SCAN TEST ESP,1513 CODE STORED,FAULTY BRAKE LIGHT SWITCH. REPLACE BRAKE LIGHT SWITCH & CHEC K OPPERATION.	RECALL 922 ECM REPROGRAMMING (06-01-001)	.	RECALL 922 RECALL 922 41202 PERFORM ECM RECALL REPROGRAM &COMPLETE. WH
KM8JN72D76U	7/26/05	29536	33.66	29536 F PERFORM HI-SCAN AND AND FOUND CODE C1513-BRAKE SWITCH MALFUNCTION FOUND SWITCH SHORTED REPLACED	THE ESC OFF LITE COMES ON AT TIMES FOR NO REASON	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 29536 F PERFORM HI-SCAN AND AND FOUND CODEC1513-BRAKE SWITCH MALFUNCTION FOUND SWITCHSHORTED REPLACED
KM8JN72D16U	11/18/05	28903	34.84	CUSTOMER STATES THE ESC LIGHT IS ONCODE C1513 BRAKE LAMP SWITCH, THE SWITCH HAS HIGH RESISTANCE CORRECTION DIAGNOSED VEHICLE REPLACING BRAKE LAMP SWITCH	CUSTOMER STATES THE ESC LIGHT IS ON.	CODE C1513 BRAKE LAMP SWITCH, THE SWITCH HAS HIGH RESISTANCE	DIAGNOSED VEHICLE REPLACING BRAKE LAMP SWITCH.
KM8JN12D16U	4/03/06	2856	31.1		CUSTOMER STATES THAT THE ESC LIGHT IS ON(PARTS IN STK)	SWITCH FILURE	REPLACE SWITCH

KM8JN72D05U	1/19/05	41197	35.55	41197 C1513 CODE STORED. WH SCAN TEST ESP,1513 CODE STORED,FAULTY BRAKE LIGHT SWITCH. REPLACE BRAKE LIGHT SWITCH & CHECK OPERATION.	2005-2007-DRIVER AIRBAG COVER MODULE REPLACEMENT		RECALL 079 RECALL 079 41202 PERFORM AIRBAG REPLACEMENT RECALL WH
KM8JN72D05U	1/19/05	41197	35.55	41197 C1513 CODE STORED. WH SCAN TEST ESP,1513 CODE STORED,FAULTY BRAKE LIGHT SWITCH. REPLACE BRAKE LIGHT SWITCH & CHECK OPERATION.	C/S THE BUTTONS ABOVE DASH WILL TURN OFF SOMETIMES, SOMETIMES WONT COME ON, SOMETIMES WONT TURN OFF, PLUS ESP LIGHT COMES ON INTERMITTANTLY PLEASE CHECK AND ADVISE		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 41197 C1513 CODE STORED. WH SCAN TEST ESP,1513 CODE STORED,FAULTY BRAKE LIGHTSWITCH. REPLACE BRAKE LIGHT SWITCH & CHECK OPERATION.
KM8JN12D96U	1/13/06	16220	33.36	ESC LIGHT ON PERF DIAG AND FOUND INTERNAL OPEN IN BRAKE SWITCH REPLACE AND RETST ALL OK	C/S ECS LIGHT ON	INTERNAL OPEN IN BRAKE SWITCH	PERFORM DIAGNOSES AND REPLACE BRAKE LIGHT SWITCH
KM8JN12D96U	1/13/06	16220	33.36	ESC LIGHT ON PERF DIAG AND FOUND INTERNAL OPEN IN BRAKE SWITCH REPLACE AND RETST ALL OK	PERFORM 079 RECALL	UPDATE 3	REPLACE AIR BAG COVER
KM8JM72B45U	7/02/05	22270	33.04	ESP LIGHT KEEPS COMING ON,VERIFY FOUND INTERNAL OPEN IN ESP SWITCH,REPLACE ESP SPEED SENSOR ASSY REPROGRAM AND RETST	C S THAT HE ESP LIGHT KEEPS COMING ON SOP HERE	INTERNAL OPEN IN ESP SWITCH	PERFORM DIAGNOSES AND INSPECT. FOUND ESP FAILURE DISASSEMBLE AND REPLACE ESP SPEED SENSOR ASSY. REPROGRAM AND ROADTEST
KM8JN72D05U	1/19/05	41197	35.55	41197 C1513 CODE STORED. WH SCAN TEST ESP,1513 CODE STORED,FAULTY BRAKE LIGHT SWITCH. REPLACE BRAKE LIGHT SWITCH & CHECK OPERATION.	C/S THE BUTTONS ABOVE DASH WILL TURN OFF SOMETIMES, SOMETIMES WONT COME ON, SOMETIMES WONT TURN OFF, PLUS ESP LIGHT COMES ON INTERMITTANTLY PLEASE CHECK AND ADVISE		00 TIME 00 TIME 41197 C1513 CODE STORED. WH SCAN TEST ESP,1513 CODE STORED,FAULTY BRAKE LIGHTSWITCH. REPLACE BRAKE LIGHT SWITCH & CHECK OPERATION.
KM8JN12D86U	12/19/05	10151	56.9	10151 ECS LIGHT COMES ON WH & 3 "00" TIME USED SCAN TOOL AND FOUND CODE C1513. CHECKED BRAKE SWITCH AND FOUND IT WORKING INTERMITTANTLY. REPLACED BRAKE SWITCH AND CHECKED FOR PROPER OPERATION	MAINTANCE LOF		MAINTANCE LOF MAINTANCE LOF 10151 LOF COMPLETED .3
KM8JN12D95U	4/19/05	25923	32.74		079 CAMPAIGN	079 CAMPAIGN	079 CAMPAIGN 079 CAMPAIGN
KM8JN12D95U	4/19/05	25923	32.74		CUSTOMER STATES ESP LIGHT CAME ON THEN WENT OUT-CHECK AND ADVISE	ESP LIGHT ON CODE C1513 REPL. BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D16U	10/14/05	31817	33.06		CHECK ENGINE LIGHT ON	CHECK ENGINE LIGHT CODE P0118 REPL. ENGINE COOLANT TEMP SENSOR	SENSOR ASSY-ENGINE COOLANT TEMPERATURE RE SENSOR ASSY-ENGINE COOLANT TEMPERATURE RE
KM8JN12D86U	12/19/05	10151	56.9	10151 ECS LIGHT COMES ON WH & 3 "00" TIME USED SCAN TOOL AND FOUND CODE C1513. CHECKED BRAKE SWITCH AND FOUND IT WORKING INTERMITTANTLY. REPLACED BRAKE SWITCH AND CHECKED FOR PROPER OPERATION	C.S ESC LIGHT COMES ON INTERM. CK AND ADVISE		CLUTCH SWITCH ATT TIME CLUTCH SWITCH ATT TIME 10151 ECS LIGHT COMES ON WH USED SCAN TOOL AND FOUND CODE C1513. CHECKED BRAKE SWITCH AND FOUND IT WORKING INTERMITTANTLY. REPLACED BRAKE SWITCH AND CHECKED FOR PROPER OPERATION
KM8JN12D86U	12/19/05	10151	56.9	10151 ECS LIGHT COMES ON WH & 3 "00" TIME USED SCAN TOOL AND FOUND CODE C1513. CHECKED BRAKE SWITCH AND FOUND IT WORKING INTERMITTANTLY. REPLACED BRAKE SWITCH AND CHECKED FOR PROPER OPERATION	C.S ESC LIGHT COMES ON INTERM. CK AND ADVISE		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 10151 ECS LIGHT COMES ON WH USED SCAN TOOL AND FOUND CODE C1513. CHECKED BRAKE SWITCH AND FOUND IT WORKING INTERMITTANTLY. REPLACED BRAKE SWITCH AND CHECKED FOR PROPER OPERATION
KM8JN12D66U	7/28/05	17149	64.54	17149 INTERMITTANT OPEN IN BRAKE LIGHT SWITCH SCAN TEST P01513 - BRAKE LIGHT SWITCH OPEN AT TIMES. REPLACE BRAKE LIGHT SWITCH. CHECK OPERATION AFTER REPAIRS. 3 HRS RAN "00 TIME" FOR SCAN			
KM8JN72D16U	10/14/05	31817	33.06		CHECK ENGINE LIGHT ON	CHECK ENGINE LIGHT CODE P0118 REPL. ENGINE COOLANT TEMP SENSOR	SENSOR ASSY-ENG COOLANT TEMP ADD SCAN TOOL OPERATION SENSOR ASSY-ENG COOLANT TEMP ADD SCAN TOOL OPERATION
KM8JN72D16U	10/14/05	31817	33.06		CUSTOMER STATES THE ESC LIGHT WILL COME OFF AND ON	ESC LIGHT ON CODE C1513 REPL. BRAKE SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D16U	10/26/05	20207	33.06		CUSTOMER STATES ESC LIGHT IS ON	ESC LIGHT IS ON BRAKE SWITCH SHORTED REPLACED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B86U	7/20/05	17109	56.14	CODE 1513	CUSTOMER STATES ESC LIGHT CAME ON BRIEFLY. PLEASE CHECK AND ADVISE.	ESC LIGHT BRAKE SWITCH SHORTING REPLACED SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D46U	10/28/05	13862	37.26	13868 BRAKE LIGHT SWITCH SCAN TEST, TIME RAN FOR SCAN. C1513, BRAKE LIGHT SWITCH. CHECK BRAKE LIGHTS, REPLACE BRAKE LIGHT SWITCH & ROAD TEST. NORMAL OPERATION AFTER REPAIRS.			
KM8JN12D35U	5/18/05	36312	64.54	36312 REPLACED BRAKE LAMP SWITCH PER CODE. WH SCAN TESTED, CODE C1513 BRAKE LAMP SWITCH CODE. FAILED SWITCH, REPLACED SWITCH AND CHECKED OPERATION OK NOW.	MAINTANCE LOF	F	MAINTANCE LOF MAINTANCE LOF 36312 LOF COMPLETED .3
KM8JM12B75U	4/21/05	27167	33.2		CUSTOMER STATES THE TCS LIGHT WILL COME ON AT RANDOM WHEN DRIVING	TCS LIGHT COMES ON PC1513 CODE REPLACED	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B86U	7/16/05	22503	56.14	REPL BRAKE SWITCH			
KM8JN72D96U	3/14/06	19351	56.46	SCAN TIME	CUSTOMER STATES THE ESC LIGHT IS ON-SOP	ESC LIGHT C1237C1513 OPEN SHORT REPLACED	SENSOR-PRESSURE SENSOR-PRESSURE

KM8JN12D35U2	5/18/05	36312	64.54	36312 REPLACED BRAKE LAMP SWITCH PER CODE. WH SCAN TESTED, CODE C1513 BRAKE LAMP SWITCH CODE. FAILED SWITCH, REPLACED SWITCH AND CHECKED OPERATION OK NOW.	2005-2007-DRIVER AIRBAG COVER MODULE REPLACEMENT		RECALL 079 RECALL 079 36312 RECALL 079 COMPLETED. WH INSTALLEDUPDATED AIR BAG PER RECALL.
KM8JN12D35U2	5/18/05	36312	64.54	36312 REPLACED BRAKE LAMP SWITCH PER CODE. WH SCAN TESTED, CODE C1513 BRAKE LAMP SWITCH CODE. FAILED SWITCH, REPLACED SWITCH AND CHECKED OPERATION OK NOW.	DIPLAYS "ESP OFF" WHEN TURNING VEH ON. CK AND ADVISE		CLUTCH SWITCH ATT TIME CLUTCH SWITCH ATT TIME 36312 REPLACED BRAKE LAMP SWITCH PER CODE. WHSCAN TESTED, CODE C1513 BRAKE LAMP SWITCHCODE. FAILED SWITCH, REPLACED SWITCH ANDCHECKED OPERATION OK NOW.
KM8JN12D35U2	5/18/05	36312	64.54	36312 REPLACED BRAKE LAMP SWITCH PER CODE. WH SCAN TESTED, CODE C1513 BRAKE LAMP SWITCH CODE. FAILED SWITCH, REPLACED SWITCH AND CHECKED OPERATION OK NOW.	DIPLAYS "ESP OFF" WHEN TURNING VEH ON. CK AND ADVISE		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 36312 REPLACED BRAKE LAMP SWITCH PER CODE. WHSCAN TESTED, CODE C1513 BRAKE LAMP SWITCHCODE. FAILED SWITCH, REPLACED SWITCH ANDCHECKED OPERATION OK NOW.
KM8JN72D96U4	3/14/06	19351	56.46	SCAN TIME	CUSTOMER STATES THE ESC LIGHT IS ON--SOP	ESC LIGHT C1237C1513 OPEN SHORT REPLACED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D96U4	3/14/06	19351	56.46	SCAN TIME	CUSTOMER STATES THE ESC LIGHT IS ON--SOP	ESC LIGHT C1237C1513 OPEN SHORT REPLACED	STOP LAMP SWITCH SCAN TIME STOP LAMP SWITCH SCAN TIME
KM8JM12B26U2	8/25/05	19145	34.7		CUSTOMER STATES THE TCS LIGHT STAYED ON	FOUND CODES C1237,C1513 BRAKESWITCH OPEN--CONNECTOR AT C165 LOOSE REPAIRED-REPLACED	WIRE REPAIR TIME (MAJOR)-ADJUSTMENT WIRE REPAIR TIME (MAJOR)-ADJUSTMENT
KM8JM12BX6U2	7/13/05	26318	36.94	26321 REPLACED BRAKE LAMP SWITCH PER CODE. SCAN TESTED, CODE C1513 BRAKE LAMP SWITCH FAILURE, FAILED SWITCH, REPLACED BRAKE LAMP SWITCH. OK NOW.			
KM8JN12D65U2	5/17/05	26016	30.34		CUSTOMER STATES THE ESP LIGHTS IS ON AND WILL NOT GO OFF	N69,C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D26U3	12/08/05	11352	32.3		CUSTOMER STATES THE CRUISE CONTROL IS INOP AT TIMES AND THE SET LIGHT WILL BLINK. PARTS IS	N94,C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B26U2	8/25/05	19145	34.7		CUSTOMER STATES THE TCS LIGHT STAYED ON	FOUND CODES C1237,C1513 BRAKESWITCH OPEN--CONNECTOR AT C165 LOOSE REPAIRED-REPLACED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D56U2	8/18/05	12778	33.06		CUSTOMER STATES THE ESC LIGHT WAS ON FOR A WHILE	ESC LIGHT ON CODE B1513 REPL. BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D15U2	6/02/05	22998	56.46	SCAN TIME	CUSTOMER STATES ESC OFF LIGHT COMESON RANDOMLY	ESC LIGHT C1513BRAKE SWITCH OPEN REPLACED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B55U1	4/16/05	14029	32.3		CUSTOMER STATES THE TCS OFF LIGHT STAYS ON	N94,C15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D36U3	12/07/05	15856	28.95		CUSTOMER STATES THE BRAKE LIGHTS ARE INOP AT TIMES	N94,C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B36U3	11/23/05	25067	30.66		CUSTOMER STATES THE ESC LIGHT WILL COME ON AND OFF AT TIMES	N69 C15 BRAKE LIGHT SWITCH WAS BAD	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D15U2	6/02/05	22998	56.46	SCAN TIME	CUSTOMER STATES ESC OFF LIGHT COMESON RANDOMLY	ESC LIGHT C1513BRAKE SWITCH OPEN REPLACED	STOP LAMP SWITCH SCAN TIME STOP LAMP SWITCH SCAN TIME
KM8JM12B16U2	7/13/05	20855	32.74		922 CAMPAIGN	922 CAMPAIGN	ESC ECM REPROGRAMMING ESC ECM REPROGRAMMING
KM8JM12B16U2	7/13/05	20855	32.74		079 CAMPAIGN	079 CAMPAIGN	079 CAMPAIGN 079 CAMPAIGN
KM8JM12B16U2	7/13/05	20855	32.74		CUSTOMER STATES ESC LIGHT IS ON	ESC LIGHT ON CODE C1513 REPL. STOPLAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D76U3	1/11/06	16475	33.64	ELECTRICAL OPEN IN THE SWITCH C1513. REPLACED AND ADJUSTED THE BRAKE SWITCH.	FACTORY WARR/CUSTOMER STATES - THE ESC LIGHT COMES ON INTER.(ABOUT EVERY THREE TIMES) -SOP HERE	WAS PREVIOUSLY DIAGNOSED AS A FAULTY BRAKE SWITCH. THERE IS AN ELECTRICAL OPEN IN THE SWITCH.	REPLACED AND ADJUSTED THE BRAKE SWITCH.
KM8JN12D46U3	1/23/06	17479	58.26	USED THE GDS AND HAS CODE C1513-BRAKE SWITCH ERROR. THERE IS AN INTERNAL ELECTRICAL OPEN IN THE BRAKE SWITCH. REPLACED THE SWITCH AND RESET THE CODE. ATT FOR GDS NO OP FOR THIS REPAIR	FACTORY WARR/CUSTOMER STATES - ESC LIGHT WILL STAY ON INTERMITTANLY	USED THE GDS AND HAS CODE C1513-BRAKE SWITCH ERROR. THERE ISAN INTERNAL ELECTRICAL OPEN IN THE BRAKE SWITCH.	REPLACED THE SWITCH AND RESET THE CODE.
KM8JM12B16U2	7/13/05	20855	32.74		CUSTOMER STATES ESC LIGHT IS ON	ESC LIGHT ON CODE C1513 REPL. STOPLAMP SWITCH	STOP LAMP SWITCH SCAN TIME STOP LAMP SWITCH SCAN TIME
KM8JM12B16U2	7/13/05	20855	32.74		ENTERPRISE RENTAL CAR	ENTERPRISE RENTAL	SUBLET REPAIRS
KM8JM12B16U2	7/13/05	20855	32.74		ENTERPRISE RENTAL CAR	ENTERPRISE RENTAL	ENTERPRISE RENTAL CAR ENTERPRISE RENTAL CAR
KM8JM12B75U1	4/29/05	39821	57.94	USED THE GDS AND HAS CODE C1513-BRAKE SWITCH CURCUIT. THERE IS AN ELECTRICAL OPEN IN THE BRAKE SWITCH. REPLACED THE BRAKE SWITCH AND RESET THE CODE. ATT FOR GDS USE, NO OP FOR THIS PART.	FACTORY WARR/CUSTOMER STATES - ESP OFF LIGHT ON	USED THE GDS AND HAS CODE C1513-BRAKE SWITCH CURCUIT. THERE IS AN ELECTRICAL OPEN IN THE BRAKE SWITCH.	REPLACED THE BRAKE SWITCH AND RESET THE CODE.
KM8JN12D96U3	12/21/05	26557	64.48	OPEN CIRCUIT - EXAMINE BRAKE SWITCH GAP WITHIN SPECS.REPLACE STOP LAMP SWITCH,TT=SCAN TEST C1513	CUSTOMER STATES ESC LIGHT ON	INTERMITTENT OPEN/POOR CONTACT	SCANNED SYSTEM AND FOUND C1513. EXAMINED BRAKE SWITCH GAP. GAP WITHIN SPECS. REMOVED AND REPLACED THE BRAKE SWITCH. CLEARED TROUBLE CODE. TT=3 SCAN TOOL OPERATION.
KM8JM72B16U3	11/17/05	30264	36.75		CUSTOMER STATES ESC LIGHT TURNON AND OFF	ECS LIGHT ON CODE C1513 BRAKE SWITCH CK ADJ OK NEEDS SWITCH	INTERMITTENT OPEN REPLACE STOP LAMP SWITCH
KM8JN72D36U3	11/01/05	18670	41.74				
KM8JN72D55U1	1/19/05	42132	40.35		CUST STATES THE ESP LIGHT HAS BEEN ON STEADY FOR TWO WEEKS VEHICLE DOESNT SEEM TO BE AS SMOOTH	CODE P1513 BRAKE SWITCH CIRCUIT PER TSB	REPLACED BRAKE SWITCH AND CLEARED CODE

KM8JN72D06U	11/21/05	11463	41.74		CUST STATES THE "ECS OFF" LIGHT ON THE DASH WILL COME ON UNDER NORMAL DRIVING CONDITIONS AND NOT SHUT OFF UNTILL THE KEY IS TURNED OFF	FAILING BRAKE SWITCH	REPLACED SWITCH
KM8JM72B16U	11/17/05	30264	36.75		CAMPAIGN 079- DRIVER AIR BAG 61B046R0 -- 2	MATERIAL FLAW	REPLACE DRIVER AIR BAG MODULE COVER
KM8JN12D86U	4/19/06	10	38.71		FOUND BRAKE LIGHTS INOP ON PDI TEST DRIVE.	OPEN CIRCUIT	REPLACE STOP LAMP SWITCH
KM8JN72D16U	1/07/06	23637	37.07	POOR CONTACT - SCAN TEST C1513,ADJUST STOP LAMP SWITCH TEST DROVE AND CODE CAME BACK NEC TO REPLACE STOP LAMP SWITCH,TEST DROVE AND RESCAN-OK	CUSTOMER STATES THE ESC LIGHT IS ON	ECS LIGHT ON C1513 BRAKE SWITCH TRIED TO ADJ IT TEST DROVE CODE CAME BACK INTERMITANT OPEN IN SWITCH REMOVED SWITCH AND TESTED IT HAD NO OPEN OUT OF CAR INTERNAL FAILURE WORN PARTS	REPLACED BRAKE SWITCH CLEARED CODES TEST DROVE DIDNT RETURN AFTER DROVE 1 MILE
KM8JM12B65U	7/05/05	22958	41.74		CUST STATES THE ABS AND ESC LIGHTS ARE ON	WIRE NOT PLUGGED IN ON MAIN HARNESS	TRACKED DOWN AND PLUGGED IN WIRE (NOT PLUGGED IN FROM FACTORY)
KM8JM12B65U	7/05/05	22958	41.74		CUST STATES THE BRAKE LIGHTS DONT WORK.	BAD BRAKE LIGHT SWITCH	REPLACED SWITCH
KM8JN12D45U	5/20/05	23556	42.06				
KM8JN12D26U	8/08/05	15803	41.74		CUST STATES THE CD PLAYER WILL NOT READ DISC,GETS VARIOUS MESSAGES,BUT DOES NOT PLAY AT ALL	FAULTY RADIO	REPLACED RADIO
KM8JN72D06U	12/28/05	15050	36.75		CUSTOMER STATES THE ESC LIGHT COMES ON	OPEN CIRCUIT	REPLACED BRAKE LAMP SWITCH
KM8JN72D06U	12/28/05	15050	36.75		RECALL 079	MATERIAL FLAW	REPLACE DRIVER AIR BAG MODULE COVER
KM8JN12D85U	5/19/05	36125	37.07		CUSTOMER STATES HE HAS NO BRAKE LIGHTS	OPEN IN BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN12D85U	5/19/05	36125	37.07		CUSTOMER STATES THE ESP LIGHT IS ON.	OPEN IN STEERING ANGLE SENSOR	SCANTESTED SYSTEM AND FOUND C1260,TRACED DOWN TO OPEN IN STEERING ANGLE SENSOR,REPLACED SENSOR
KM8JN72D16U	1/24/06	26307	24.9	CRUISE CONTROL INOP - REINSTALL BRAKE SWITCH	C/S: CUSTOMER STATED THE CRUISE CONTROL IS NOT WORKING.	TEST DROVE AND FOUND CRUISE CONTROL NOT WORKING TESTED AND FOUND BRAKE SWITCH OUT OF HOLDER	REINSTALL BRAKE SWITCH AND TEST DRIVE ALL OK
KM8JN72D96U	12/05/05	14682	34.24	ESC LIGHT ON - FIND SWITCH INOP - RPLC			
KM8JN72D95U	1/26/05	41	69.72	TEST DESCRIPTION INCORRECT ON HMA SERVICE. TEST CALLS FOR CONTINUITY BETWEEN TERMINALS 1-4 AND 2-3 RATHER THAN 1-2 AND 3-4. TECH TIME REQUESTED TO COVER TIME SPENT FIGURING OUT CORRECT TEST PROCEDURE.			
KM8JN12D95U	4/25/05	16790	66.12	ESP LIGHT ON AT TIMES - OPEN CIRCUIT, CODE C1513 - RPLC STOP LAMP SWITCH,TT=CONNECT SCAN	CUSTOMER STATES INTERMITTANT ESP LIGHT. SOP BRAKE SWITCH IS IN. ORDERED ON RO. 17695	CODE C1513	SCAN TEST FOUND SHORTED OUT BRAKE LIGHT SWITCH. REMOVE AND REPLACE SWITCH AND CLEAR CODE.
KM8JN12D66U	8/24/05	15089	64.48	STICKING - REPLACE STOP LAMP SWITCH,TT=SCAN TEST C1513	CUSTOMER STATES ESC LIGHT COMES ON AND OFF WHEN DRIVING	BRAKE SWITCH STICKING.	SCANNED C1513 BRAKE LAMP SWITCH. FOUND SWITCH STICKING REPLACED SWITCH ASSY, CLEARED CODE OK. .3TT = SCANTOOL AND .3
KM8JM12B16U	7/13/05	14569	83	ESC LIGHT ON - FIND BRAKE SWITCH LAMP WIRE BROKEN - REPAIR WIRE	CUSTOMER STATES SQUEALING NOISE FROM ENGINE AREA AFTER AC ISTURNED ON.	VERIFIED CONCERN AND FOUND A/C BELT NEEDING TIGHTENING.	TIGHTENED A/C BELT AND VERIFIED CONCERN CORRECTED.
KM8JM12B16U	7/13/05	14569	83	ESC LIGHT ON - FIND BRAKE SWITCH LAMP WIRE BROKEN - REPAIR WIRE	CUSTOMER STATES ESC WARNING INDICATOR COMES ON INTERMITTENTLY.	FOUND CODE SET FOR BRAKE LAMP SWITCH AND FOUND WIRE BROKEN.	REPAIRED WIRE AND VERIFIED CONCERN CORRECTED.
KM8JN12D96U	7/22/05	20404	24.9	ESC LIGHT ON - C1513 R AND I BRAKE SWITCH AND CLEAR			
KM8JN12D36U	8/16/05	26606	64.16	OPEN CIRCUIT - REPLACE STOP LAMP SWITCH,TT=SCAN TEST C1513			
KM8JM12B25U	2/25/05	10050	35.85		CUSTOMER STATES CLUTCH PEDAL SQUEAKING, SPECIAL ORDER SWITCH CAME IN.	BROKEN-TORN	REPLACE STOP LAMO SWITHC ASSY
KM8JM12B25U	2/25/05	10050	35.85		CUSTOMER STATES TRANS KICKING OUT OF GEAR 4TH CHECK AND ADVISE AND TOP OF SHIFTER KNOB WON'T STAY ON, KEEPS FALLING OFF	ABNORMAL EXCESSIVE WEAR - BROKEN	INSP. TO VERIFY. REMOVE TRANS. FROM CAR. REPLACE TRANS. SYNCRONIZORS FOR 3RD AND 4TH GEAR AND RELATED PARTS TEST DROVE-OK ALSO, REMOVE AND REPLACE SHIFTER KNOB BECAUSE TOP KEEPS COMING OFF.
KM8JM12B25U	2/25/05	10050	35.85		RECALL 922	OUT OF CALIBRATION	REPROGRAM ESC ECM
KM8JN12D26U	7/30/05	33038	34.56	ESC LIGHT ON - B1513 - RPLC			
KM8JN72D26U	8/10/05	7490	34.24	ESC LIGHT COMES ON AND OFF - RPLC SWITCH	PERFORM RECALL 079 DRIVER AIRBAG COVER MOD REPL 07-01-001	RECALL	PERFORMED RECALL AND CONCERN CORRECTED.
KM8JN72D26U	8/10/05	7490	34.24	ESC LIGHT COMES ON AND OFF - RPLC SWITCH	CUSTOMER STATES THE ESC OFF LIGHT COMES ON AND OFF INTERMITTENTLY AND DOESN'T PRESS THE BUTTON. DIAG AND ADV.	VERIFIED CONCERN AND FOUND BRAKE SWITCH NEEDING REPLACEMENT.	REPLACED BRAKE SWITCH AND CONCERN CORRECTED.
KM8JN12D85U	5/19/05	9867	38.71		CUSTOMER STATES ESP LIGHT ON	RAN SCAN FOUND P1513 BRAKE LIGHT SWITCH INTERNAL FAILURE	REPLACED BRAKE LIGHT SWITCH
KM8JN12D85U	5/19/05	9867	38.71		CUSTOMER STATES POWER OUTLETS IN BACK NOT WORKING.	FUES BLOWN REPLACED FUSE SYSTEM OPERATING AS DESIGNED	
KM8JN12D86U	12/28/05	23111	64.48	STICKING/POOR CONTACT - REPLACE STOP LAMP SWITCH,TT=SCAN TEST C1513	CUSTOMER STATE THE ESC LIGHT COMES ON WHEN DRIVING	STICKING BRAKE SWITCH.	SCANNED C1513 BRAKE LAMP SWITCH, FOUND SWITCH STICKING, REPLACED SWITCH, CLEARED CODE TEST DROVE OK. TT.3=SCANTOOL

KM8JM12BX6U	8/29/05	16888	36.2	CUSTOMER STATES BRAKE LITES STICK ON.VERIFIED CONCERN AND FOUND BRAKE LITE SWITCH STICKING.REPLACED SWITCH ALL WORKING FINE.	INSTALL BRAKE LIGHT SWITCH	FOUND BRAKE LIGHT SWITCH STICKING AND MAKING BRAKE LIGHTS STAY ON	REPLACED BRAKE LIGHT SWITCH AND RECHECKED AND O.K. NOW
KM8JM12BX6U	8/29/05	37852	34.24	ECS LIGHT FLASHES ON AND OFF RPLC SWITCH	CUSTOMER STATES THE ESC LITE FLASHES OF AND ON AT TIMES WAS IN BEFORE WITH THE SAME CONCERN SEE RON	CHECKED OUT AND FOUND A CODE P1513 POSSIBLE POOR BRAKE SWITCH	TESTED BRAKE SWITCH AND FOUND BAD BRAKE SWITCH
KM8JN72D46U	12/03/05	16750	33.36	REMOVED AND REPLACED THE BRAKE LAMP SWITCH. VEHICLE IS CHECKING O.K. AT THIS TIME.	CUSTOMER STATES THE ESC LIGHT COMES ON AND WHEN PUSHING THE BUTTON IT WILL NOT GO OFF.	DUPLICATED CUSTOMERS CONCERN.	REMOVED AND REPLACED THE BRAKE LAMP SWITCH. VEHICLE IS CHECKING O.K. AT THIS TIME.
KM8JM12B47U	9/08/06	17692	64.48	POOR CONTACT/ADJUSTMENT - REPLACE STOP LAMP SWITCH,TT=SCAN TEST RAN DIAGNOSTICS C1513-CLEAR CODE AND TEST DRIVE,OK	CUSTOMER STATES PUT CAR IN DRIVE, SHOWS REVERSE DASH CAR WOULD NOT MOVE, ACTED LIKE CAR WAS IN NEUT.	SHIFT CABLE STRETCHED/BINDING.	SHIFT CABLE WAS STRETCHED BEYOND ADJUSTMENT, REPLACED SHIFT CABLE ASSY. OPERATES AS DESIGNED.
KM8JM12B47U	9/08/06	17692	64.48	POOR CONTACT/ADJUSTMENT - REPLACE STOP LAMP SWITCH,TT=SCAN TEST RAN DIAGNOSTICS C1513-CLEAR CODE AND TEST DRIVE,OK	CUSTOMER STATES ESC LIGHT CAME ON WHEN DRIVING, WHEN GOING TO ACCEL. CAR SEEMED LIKE IT WAS DECELING, WHEN THIS WAS HAPPENING, WHOLE FRONT END STARTED SHAKING AND COULD FEEL THROUGH FLOOR BOARD/GAS PEDAL.	STICKING BRAKE LAMP SWITCH	SCANNED C1513 BRAKE LAMP SWITCH. FOUND THAT THE BRAKE SWITCH WAS STICKING CAUSEING ESC TO ENGAGE. REPLACED SWITCH AND CLEARED CODE. TEST DROVE OK. 3TT FOR SCAN
KM8JM12B86U	7/11/05	28427	33.36		CUSTOMER STATES THE ESC LIGHT IS ON. PERFORM DIAGNOSTIC TEST	FOUND ERROR CODE C1513 REPLACE BRAKE LAMP SWITCH	CLEAR CODE AND RETEST CHECKS OK
KM8JM12BX6U	10/25/05	20427	33.04		CUSTOMER STATES ESC LIGHT COMING ON	PULLED CODE C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH.
KM8JN72D76U	12/28/05	15268	33.04		CUSTOMER STATES ESC LIGHT KEEPS COMING ON	SCANNED FOR CODES FOUND CODEC1513 BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH.
KM8JM12B47U	9/08/06	17692	64.48	POOR CONTACT/ADJUSTMENT - REPLACE STOP LAMP SWITCH,TT=SCAN TEST RAN DIAGNOSTICS C1513-CLEAR CODE AND TEST DRIVE,OK	RECALL 079 DRIVER'S AIR BAG 61B046R0 -- 2	MATERIAL FLAW	REPLACE DRIVER AIR BAG MODULE COVER
KM8JN12DX5U	6/22/05	21607	36.75	SHORTED, C1513 - SCN TEST/REPLACE STOP LAMP SWITCH, PREV REPAIR ORDER 030104,5/24/07,21258 MILES FOLLOWED TSB 06-50-006 GUIDELINES MEASURING GAP AND ADJUSTING SWITCH TO SPECS,TEST DROVE AND CODE DID NOT RETURN- CK LIGHT COME ON 350 MILES LATER	CUSTOMER STATES ESP LIGHT ON	CODE C1513 BRAKE LAMP SWITCH SHORTED	REPLACE STOP LAMP SWITCH CLEAR CODE -RO 30104,5/24/07,21258 MI
KM8JN12D76U	12/09/05	17039	33.36		CUSTOMER STATES ESC LIGHT IS ON	SCANNED FOR CODES FOUND CODE BC1513 BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JN72D46U	4/13/06	12007	33.36		CUSTOMER STATES ESC LIGHT COMES ON AND WONT TURN OFF	PERFORM DIAGNOSTIC TEST FOUND ERROR CODE C1513	REPLACE BRAKE LAMP SWITCH CLEAR CODE AND RETEST - CHECKS OK
KM8JM12B66U	7/13/05	23652	29.16	BRAKE LAMP SWITCH HAS OPEN. R AND R BRAKE LAMP SWITCH AND TEST DROVE.			
KM8JN72DX6U	7/19/05	14289	29.16		CUSTOMER STATES THAT THE ESC OFF LIGHT COMES ON AND OFF AT TIMES.	C1513 BRAKE SWITCH CIRCUIT	REPLACED THE BRAKE LIGHT SWITCH
KM8JN12D56U	10/16/05	29022	64.16	OPEN CIRCUIT - REPLACE STOP LAMP SWITCH,TT=SCAN TEST C1513	CUSTOMER STATES HEAR A SQUEAKING NOISE WHEN GOING OVER BUMPS AND WHEN TURNING STEERING WHEEL LEFT AND RIGHT.	COMING APART-ABNORMAL WEAR	REPLACE REAR CRADLE BUSHINGS,BOLTS AND STOPPERS,TT=REPLACE LH LOWER CONTROL ARM AND LH FRONT STRUT,ROAD TEST SEVERAL TIMES WITH MECHANIC EARS, CASE 260467
KM8JN12D56U	10/16/05	29022	64.16	OPEN CIRCUIT - REPLACE STOP LAMP SWITCH,TT=SCAN TEST C1513	CUSTOMER STATES ECS LIGHT COMES ON AND GOES OFF WHEN DRIVING.	OPEN CIRCUIT - C1313	REPLACE STOP LAMP SWITCH,TT=SCAN TEST
KM8JN12D56U	10/16/05	29022	64.16	OPEN CIRCUIT - REPLACE STOP LAMP SWITCH,TT=SCAN TEST C1513	CUSTOMER STATES REAR TAIL GATE WINDOW LEAKS	WARPED-IMPTOPER SEALING	REMOVE AND REPLACE TAIL GATE WEATHER STRIP SEAL.
KM8JM12B76U	10/06/05	6982	28.84	CODE C1513/BRAKE SWITCH OPEN. REPLACED SWITCH.	CUSTOMER STATES THAT THE STABILTY LIGHT COMES ON AT TIMES WHEN DRIVING DOWN THE ROAD,LIGHT COMES ON WHEN RAINING OUTSIDE.	C1513 BRAKE SWITCH OPEN P0111 IAT SENSOR OUT OF CALIBRATION	REPLACED THE BRAKE SWITCH AND MAF SENSOR,CLEARED CODES
KM8JN12D56U	9/06/05	27367	30.94		CUSTOMER SAYS THAT THE ESP LIGHT COMES ON INSTALL SOP BRAKE LIGHT SWITCH	VERIFIED BRAKE LIGHT SWITCH NEEDS REPLACED	REPLACED THE BRAKE LIGHT SWITCH
KM8JN12D56U	10/16/05	29022	64.16	OPEN CIRCUIT - REPLACE STOP LAMP SWITCH,TT=SCAN TEST C1513	CAMPAIGN 079 - DRIVER AIR BAG COVER MODULE 61B046R0 -- 2	MATERIAL FLAW	REPLACE DRIVER AIR BAG MODULE COVER
KM8JN12D05U	6/02/05	27309	66.12	ESP LIGHT COMES ON/OFF BY ITSELD - OPEN CIRCUIT - REPLACE STOP LAMP SWITCH,TT=CONNECT SCAN TOOL RAN DIAGNOSTICS,C1513	CUSTOMER STATES ESP LIGHT COMES ON AND GOES OFF, HAVE NO CONTROL USING SWITCH, WORKS ON ITS OWN	OPEN CIRCUIT - C1513	PERFORM SCAN TEST FOUND BRAKE LIGHT SWITCH INTERMIT. SHORT REMOVE AND REPLACE BRAKE LIGHT SWITCH AND CLEAR CODE.
KM8JN12D25U	4/19/05	48454	35.64	SHORTED - REPLACE STOP LAMP SWITCH	CUSTOMER STATES NO BRAKE LIGHTS WORKING AT ALL	OPEN/SHORTED	REPLACED BRAKE LAMP SWITCH.
KM8JN12D55U	10/02/04	20756	31.35	CUST STATES THE CRUISE CONTROL IS INOP THE LIGHT WILL COME ON BUT WON'T SETTECH FOUND THAT THE BRAKE LIGHT SWITCH WAS FAULTYTECH REPLACED BRAKE LIGHT SWITCH AND CRUISE NOW	CUSTOMER STATES THE CRUISE CONTROL IS INOP THE LIGHT WILL COME ON BUT IT WONT SET	TECH FOUND THAT THE BRAKE LIGHT SWITCH WAS FAULTY	TECH REPLACED BRAKE LIGHT SWITCH AND CRUISE NOW WORKS

KM8JN72D96U	11/01/05	21511	56.14	CUST STATES ESC LIGHT COMES ON TECH SCAN TESTED HAD CODE C1513 -BRAKE LAMP SWITCH CODETECH REPLACED BRAKE LAMP SWITCH ,CLEARED CODE, ROAD TESTED FOR PROPER OPERATION. TT TIME FOR SCAN TOOL OPERATIONLIGHT AND CODES DID NOT RETURN WORKS PER	CUSTOMER STATES ESC LIGHT COMES ON AND STAYS ON	TECH SCANTESTED FOR CODES AND FOUND C1513 BRAKE LAMP SWITCH CODE.	TECH REPLACED BRAKE LAMP SWITCH,CLEARED CODE AND ROADTESTED FOR PROPER OPERATION.
KM8JN72D86U	10/19/05	25855	36.66	CUST STATES ESC LIGHT IS ONTECH SCAN TESTED HAD CODE P1513 TECH FOUND BRAKE SWITCH GETTING STUCKTECH REPLACED THE SWITCHWORKS PER DESIGN NOW	CUSTOMER STATES ESC LIGHT IS ON	SCAN TEST CODE 1513 FOUND BRAKE SWITCH GETING STUCK	REPLACED SWITCH
KM8JN12D25U	4/19/05	48454	35.64	SHORTED - REPLACE STOP LAMP SWITCH	CUSTOMER STATES CUP HOLDER WON'T HOLD CUP SPECIAL ORDER PART HAS COME IN. REFER TO 33212	CUP HOLDER FINGERS BROKEN.	REPLACED DRINK HOLDER ASSEMBLY.
KM8JN12DX5U	6/22/05	21258	54.82	IMPROPER ADJUSTMENT - ADJUST STOP LAMP SWITCH GAP TO .020 FROM .050,TT=SCAN TEST C1513	CUSTOMER STATES "ESP OFF" LIGHT WILL NOT TURN ON WITH BUTTON	SCAN TESTED AND FOUND DTC C1513. REFERRED TO TSB 06-50-006 MEASURED STOP LAMP SWITCH GAP MEASUREMENT EQUEALED APPROXIMATELY .050 INCHES IMPROPER ADJUSTMENT	ADJUSTED STOP LAMP SWITCH GAP TO .020 INCHES , CLEARED DTS, ESP BUTTON CURRENTLY OPATES AS PER DESIGN TT=SCAN TEST
KM8JN12DX5U	6/22/05	21258	54.82	IMPROPER ADJUSTMENT - ADJUST STOP LAMP SWITCH GAP TO .020 FROM .050,TT=SCAN TEST C1513	CAMPAIGN 079 - DRIVER AIR BAG COVER MODULE 61B046R0 -- .2	MATERIAL FLAW	SPECIAL ORDER PART
KM8JN72D36U	8/12/05	19858	36.66	CUST STATES THE ESC OFF LIGHT COMES ON AFTER SITTING W FOOT ON THE BRAKE AND VEHICLE RUNNING TECH CHECKED FOR CODES HAD C1315 BRAKE LIGHT SWITCH ERRATIC SIGNAL TECH REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE	CUSTOMER STATES THE ESC OFF LIGHT COMES ON AFTER SITTING WITH FOOT ON THE BRAKE AND VEHICLE RUNNING FOR MORE THAN 5-10 MINS.	CK. FOR CODES,C1315,CK. BRAKE LIGHT SWITCH,ERRATIC SIGNAL	REPLACE BRAKE LIGHT SWITCH AND CLEAR CODE
KM8JN72D86U	9/29/05	47373	36.34	CUST STATES CAR HAD NO BRAKE LIGHTS TECH PERFORMED CIRCUIT CHECK IN BRAKE LIGHTS AND FOUND BRAKE SWITCH FAULTYTECH REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES CAR HAS NO BRAKE LIGHTS	TECH PERFORMED CIRCUIT CHECK ON BRAKE LIGHTS AND FOUND BRAKE SWITCH IS FAULTY.	TECH REPLACED BRAKE LIGHT SWITCH AND ADJUSTED.
KM8JN12D15U	4/26/05	25727	35.64	SHORTED-C1513 - REPLACE STOP LAMP SWITCH	CUSTOMER STATES ESP LIGHT IS ON	C1513 BRAKE LIGHT SWITCH SHORTED	REPLACED BRAKE LIGHT SWITCH
KM8JN12D15U	4/26/05	25727	35.64	SHORTED-C1513 - REPLACE STOP LAMP SWITCH	RECALL 079 DRIVER'S AIR BAG 61B046R0 -- .2	MATERIAL FLAW	REPLACE DRIVER AIR BAG MODULE COVER
KM8JN12D15U	4/26/05	25727	35.64	SHORTED-C1513 - REPLACE STOP LAMP SWITCH	RECALL 922 50B035R1- 0.3	OUT OF CALIBRATION	REPROGRAM ESC ECM
KM8JN72D86U	9/29/05	59681	36.66	CUST STATES THE ESC LIGHT IS ON TECH SCANNED ESC /ABS FOR CODES HAD CODE C1513 FOR BRAKE SWITCH TECH REPLACED BRAKE LIGHT SWITCH CLEARED CODES AND ROADTESTED NO LIGHTS RETURNED	CUSTOMER STATES THE ESC LIGHT IS ON.	TECH SCAN TESTED ESC/ABS SYSTEM FOR CODES.TECH FOUND C1513 CODE FOR BRAKE SWITCH.	TECH REPLACED BRAKE LIGHT SWITCH,CLEARED CODES AND ROAD- TESTED.
KM8JN72D86U	9/29/05	59681	36.66	CUST STATES THE ESC LIGHT IS ON TECH SCANNED ESC /ABS FOR CODES HAD CODE C1513 FOR BRAKE SWITCH TECH REPLACED BRAKE LIGHT SWITCH CLEARED CODES AND ROADTESTED NO LIGHTS RETURNED	CUSTOMER STATES THERE IS A CREAKING NOISE HEARD IN FRONT SUSPENSION WHEN MAKING TURNS.	TECH FOUND BOTH REAR SUBFRAME BUSHINGS MAKING NOISE.	TECH REPLACED BOTH REAR SUBFRAME BUSHINGS.
KM8JN72D06U	8/09/05	45200	44.64	ESC LIGHT ON, SWITCH FAILED CAUSING LIGHT TO COME ON, REPLACED SWITCH, TT TIME USED FOR DIAG	CUST STATES ESC LIGHT ON	SWITCH FAILED CAUSING ESC LIGHT TO ILLUMINATE	TT TIME TT TIME
KM8JN12D75U	4/14/05	35838	64.48	SHORTED - REPLACE STOP LAMP SWITCH,TT=SCAN TEST RAN DIAGNOSTICS C1513	CUST STATES CHECK ENGINE LIGHT IS ON,	OPEN IN BANK2 SENSOR1 O2 SENSOR	SOP SENSOR
KM8JN12D75U	4/14/05	35838	64.48	SHORTED - REPLACE STOP LAMP SWITCH,TT=SCAN TEST RAN DIAGNOSTICS C1513	CUSTOMER STATES ESP LIGHT ON	SHORTED BRAKE LAMP SWITCH	REPLACE STOP LAMP SWITCH.TT=SCAN TEST RAN DIAGNOSTICS C1513
KM8JN12D46U	11/02/05	23409	64.48	HIGH RESISTANCE/POOR CONTACT/MEASURED GAP APPROX .020-GOOD - REPLACE STOP LAMP SWITCH,TT=SCAN TEST C1513	CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING, WILL GO OUT AFTER SHUTTING CAR OFF AND RESTARTING	HIGH RESISTANCE/POOR CONTACT	SCAN TESTED VEHICLE AND RETRIEVED C1513. MEASURED THE GAP BETWEEN STOP LAMP SWITCH PLUNGER AND BRAKE PEDAL RESTING POINT. THE GAP MEASUREMENT WAS OK AT APPROXIMATELY .020 INCHES. REMOVED AND REPLACED THE STOP LAMP SWITCH ASSY. CLEARED TROUBLE CODE. TT=.3
KM8JN72D06U	8/09/05	45200	44.64	ESC LIGHT ON, SWITCH FAILED CAUSING LIGHT TO COME ON, REPLACED SWITCH, TT TIME USED FOR DIAG	CUST STATES ESC LIGHT ON	SWITCH FAILED CAUSING ESC LIGHT TO ILLUMINATE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D46U	4/06/06	1611	34.1	1200 BRAKE LIGHT SWITCH FOUND CODE C1513 FOR BRAKE LIGHT SWITCH TESTED SWITCH FOUND TO HAVE INTERMITTENT SHORT RR BRAKE LIGHT SWITCH TESTED WITH SCAN TOOL WORKS PROPERLY	THE ESC LIGHT COMES ON AT TIMES ANDSTAYS ON UNTIL RESTARTING THE ENGINE		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 1200 BRAKE LIGHT SWITCH FOUND CODE C1513 FORBRAKE LIGHT SWITCH TESTED SWITCH FOUND TOHAVE INTERMITTENT SHORT RR BRAKE LIGHT SWITCHTESTED WITH SCAN TOOL WORKS PROPERLY
KM8JN12D25U	4/19/05	20991	38.71		CUSTOMER STATES ALL BRAKE LIGHTS NOT WORKING ON REAR OF CAR.		INSP. TO VERIFY, FOUND BRAKE LIGHT SWITCH SHORTED OUT REMOVE AND REPLACE SWITCH AND TEST. OK

KM8JN12D25U		4/19/05	20991	38.71		CUSTOMER STATES POWER OUTLET COVER IN BACK SEAT CUP HOLDER CAME OFF CAN'T PUT BACK ON		INSP. TO VERIFY, SPECIAL ORDER A NEW COVER FOR OUTLET PLUG
KM8JN12D25U		4/19/05	20991	38.71		CUSTOMER STATES CUP HOLDER IN CENTER CONSOLE RETAINER NOT WORKING.		INSP. TO VERIFY, SPECIAL ORDER A NEW CONSOLE. WILL CALL CUSTOMER WHEN PART COMES. IN
KM8JM12B55U		5/03/05	25226	32.14	25000 CHECKED FOR CODES GOT C1513 BRAKE LAMP SWITCH REPLACED SWITCH AND CLEARED CODE			
KM8JN72D05U		5/23/05	20040	54.06	R/R BRAKE SWITCH TT TIME TO SCAN TOOL TEST DUE TO LIGHT BEING ON	C/S ESP LIGHT COMES ON INTERMITT. ORDER BRAKE LIGHT SWITCH	CODE C1513 TEST FOUND NEEDS BRAKE SWITCH	R/R BRAKE SWITCH
KM8JN12D35U		9/02/04	16424	37		INTERM. UNABLE TO SHUT OFF VEHICLE UNLESS PUSHING SHIFTER HARDER INTO PARK	TECHNICIAN & SHOP FOREMAN UNABLE TO REPRODUCE CONCERN @ THIS TIME	CHECKED FOR TECHNICAL SERVICE BULLETINS. NONE FOUND CALLED HYUNDAI, PER HOTLINE, ADJUSTED SHIFTER INTERLOCK CABLE
KM8JN12D25U		4/19/05	20991	38.71		CUSTOMER STATES CAN'T OPEN ASH TRAY		INSP. TO VERIFY, SPECIAL ORDER A NEW ASH TRY WILL CALL CUSTOMER WHEN PARTS COME IN
KM8JM12B36U		7/11/05	47724	27.41		CUSTOMER STATES BATTERY GOES DEAD, REQUESTS CHECKING OF CHARGING	0 COLD CRANKING AMPS PER HYUNDAI BATTERY TESTER.	REPLACED THE BATTERY ASSY.
KM8JM12B36U		7/11/05	47724	27.41		CUSTOMER STATES ESC LIGHT STAYS ON	IMPROPER ADJUSTMENT	ADJUSTED STOP LAMP SWITCH TO SPECIFIED GAP. .020 TO .040 INCHES AS DIRECTED PER RELEVANT TSB FOR C1513.
KM8JM12B35U		12/20/04	5770	14.8		C/S HAD TO BE JUMPED SAT AM. AND FOUND OUT THAT BRAKE LIGHTS ARE STUCK IN THE ON POSIT. C/S THE PEDAL SEEMS SOFTER THAT USUAL		FOUND BRAKE SWITCH HAD COME LOOSE, TIGHTENED AND ADJUSTED
KM8JN72D45U		5/26/05	19076	31.54		CUSTOMER STATES: ESP LIGHT WILL COME ON WHILE DRIVING IN NORMAL CONDITIONS	FOUND DTC 1513-BRAKE LIGHT SWITCH. SWITCH HAS INTERMITTANT BAD CONTACT	REPLACED BRAKE LIGHT SWITCH. CLEARED DTC. SYSTEM OPERATING AS DESIGNED 93810R00 N69/C15
KM8JN72D45U		5/26/05	19076	31.54		CUSTOMER STATES:CHECK FOR RECALL FOR D/S AIR BAG	VERIFY WARRANTY APPLICABILITY	REPLACED D/S AIR BAG MODULE. TEST DROVE. VEHICLE OPERATING AS DESIGNED
KM8JM12B36U		7/11/05	47850	64.16	POOR CONTACT - MEASURES 200 OHMS WHERE THE CLOSED CIRCUIT SHLD HAVE READ 0 OHMS, REPLACE STOP LAMP SWITCH, TT=SCAN TEST RAN DIAGNOSTICS C1513			
KM8JM12B85U		6/14/05	21882	66.12	ESP OFF LIGHT WILL COME ON BY ITSELF - OPEN CIRCUIT, RPLC STOP LAMP SWITCH, TT=CONNECT SCAN TOOL RAN DIAGNOSTICS, CODE	CUSTOMER STATES HEARS STRANGE NOISE FROM ENGINE COMPARTMENT WHEN FIRST STARTING COLD.		COULD NOT DUPLICATE CUSTOMER CONCERN.
KM8JM12B85U		6/14/05	21882	66.12	ESP OFF LIGHT WILL COME ON BY ITSELF - OPEN CIRCUIT, RPLC STOP LAMP SWITCH, TT=CONNECT SCAN TOOL RAN DIAGNOSTICS, CODE	CUSTOMER STATES "ESP OFF" LIGHT WILL COME ON BY ITSELF	CODE C1513	BRAKE SWITCH OPEN/SHORTED - REPLACED SWITCH ASSEMBLY, CLEARED TROUBLE CODE AND TEST DROVE. TT=CONNECT SCAN TOOL RAN DIAGNOSTICS
KM8JN72D96U		8/08/05	21143	32.97	REPLACED STOP LAMP SWITCH. OPERATING AS DESIGNED 93810R00 N94/C15	ESC LIGHTS ON WHILE DRIVING	FOUND OPEN IN STOP LAMP SWITCH	REPLACED STOP LAMP SWITCH. OPERATING AS DESIGNED 93810R00 N94/C15
KM8JN72D96U		8/08/05	21143	32.97	REPLACED STOP LAMP SWITCH. OPERATING AS DESIGNED 93810R00 N94/C15	W/WASHERS ARE INOP	CHECK WIND. WASHER OPERATION. FOUND OPEN IN WASHER PUMP	REPLACED WASHER PUMP. OPERATING AS DESIGNED 98510R00 N94/C15
KM8JN72D95U		4/26/05	29730	32.97		CUSTOMER STATES ESP LIGHT COMES ON WHILE DRIVING AT TIMES AND CAN NOT BE SHUT OFF WITH BUTTON ON DASH.	DUE TO MISADJUSTED BRAKE LAMP SWITCH REPLACED STOP LAMP SWITCH	93810RTT N94 C15
KM8JM12B85U		6/14/05	21882	66.12	ESP OFF LIGHT WILL COME ON BY ITSELF - OPEN CIRCUIT, RPLC STOP LAMP SWITCH, TT=CONNECT SCAN TOOL RAN DIAGNOSTICS, CODE	RECALL 922	OUT OF CALIBRATION	REPROGRAM ESC ECM
KM8JM12B85U		6/14/05	21882	66.12	ESP OFF LIGHT WILL COME ON BY ITSELF - OPEN CIRCUIT, RPLC STOP LAMP SWITCH, TT=CONNECT SCAN TOOL RAN DIAGNOSTICS, CODE	CUSTOMER STATES DRIVER FRONT DOOR PANEL CLOTH IS COMING OFF.	WARPED-SEPARATING	REPLACE DRIVER DOOR TRIM PANEL COMPLETE
KM8JM12B85U		6/14/05	32228	64.16	OPEN CIRCUIT-C1513 - REPLACE STOP LAMP SWITCH, TT=SCAN TEST	CUSTOMER STATES "ESP" WILL TURN ITSELF OFF WHILE DRIVING CUSTOMER HAS TO SHUT OFF VEHICLE THEN RESTART TO GET TO TURN ON PUSHING ON/OFF BUTTON DOES NOT HELP	OPEN CIRCUIT C1513	REPLACED SWITCH ASSY. CLEARED CODE AND TEST DROVE OK TT=SCAN TEST
KM8JN72D15U		5/31/05	7195	33.5		CUSTOMER STATES ESP LIGHT ON --SOP PART--	TECH SCANNED FOR CODES FOUND C1513 BRAKE LAMP SWITCH OPEN SHORT	REPLACE BRAKE LAMP SWITCH
KM8JN72D6U		7/22/05	25342	30.43		CUSTOMER STATES: ESC LIGHT COMES ON WHILE DRIVING- INTERMIT.	TECH SCANNED FOR CODES FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION	REPLACE BRAKE LAMP SWITCH VERIFIED REPAIR
KM8JN72D96U		7/27/05	15165	31.54		CUSTOMER STATES ESC LIGHT COMES ON AND STAYS ON TILL YOU TURN CAR OFF AND RESTART - CHECK AND ADVISE	FOUND CODE C1513 BRAKE LAMP SWITCH	REPLACED BRAKE LIGHT SWITCH
KM8JM12B76U		7/16/05	59747	64.16	OPEN CIRCUIT-POOR CONTACT - REPLACE STOP LAMP SWITCH, TT=CONNECT SCAN TOOL RAN DIAGNOSTICS C1513	CUSTOMER STATES ESC LIGHT COMES ON AND GOES OFF WHEN DRIVING	POOR CONTACT - HIGH RESISTANCE	SCANNED AND RETRIEVED C1513. BRAKE SWITCH WAS ADJUSTED CORRECTLY, BUT FOUND ABNORMAL RESISTANCE BETWEEN BRAKE SWITCH CONTACTS. REPLACED BRAKE SWITCH AND CLEARED TROUBLE CODE. TT=3

KM8JM12B76U	7/16/05	59747	64.16	OPEN CIRCUIT-POOR CONTACT - REPLACE STOP LAMP SWITCH,TT=CONNECT SCAN TOOL RAN DIAGNOSTICS C1513	CAMPAIGN 079- DRIVER AIR BAG 61B046R0 -- 2	MATERIAL FLAW	REPLACE DRIVER AIR BAG MODULE COVER
KM8JN72D96U	7/27/05	15165	31.54		AIR BAG RECALL	REPLACED DRIVERS AIR BAG	RECALL COMPLETE
KM8JN72D86U	7/28/05	23037	31.86		CUSTOMER STATES CHECK ENGINE LIGHT ON AND ESC LIGHT AT TIMES ----SOP PART----	TECH SCANNED FOR CODES FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION	REPLACE BRAKE LAMP SWITCH VERIFIED REPAIR
KM8JN72D86U	7/28/05	23037	31.86		PERFORM RECALL 079 (AIRBAG COVER)	TECH VERIFIED VIN FALLS UNDER 079 RCALL	REPLACE D/S FRONT AIRBAG COVER AS PER RECALL
KM8JN72D06U	9/28/05	8694	33.5		ESC LIGHT COMES ON WHILE DRIVING	INTERNAL SHORT CIRCUIT IN SWITCH	REPLACED STOP LAMP SWITCH 93810R00 N94 C15
KM8JN12D86U	1/10/06	1280	34.28	1280 SCAN TEST.DTC 1513 .3 93810R00/N69/C15/ .3 REPLACED DEFECTIVE STOP LAMP SWITCH,CLEARED CODE & VERIFIED OPERATION.			STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JM12B26U	9/15/05	11486	33.5	ESC LIGHT ON OPEN CIRCUIT AT BRAKE SWITCH REPLACE SWITCH			STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE
KM8JM12B06U	4/04/06	9689	33.5	BRAKE SWITCH FAILURE CHECK CODES FOUND CODE C1513 BRAKE SWITCH CHECK FOR TSBS NO RELATED TBS. CHECK SWITCH ADJ. OK, REPLACE BRAKE SWITCH CHECK FOR OPERATION			SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D06U	9/28/05	8694	33.5		CUSTOMER STATES WATER LEAKING FROM DASH AREA UNDER GLOVE BOX	DUE TO POOR SEAL OF SEAM	RESEAL BODY SEAM ON COWL PANEL SUBLET GREENSBURG COLLISION
KM8JN72D25U	6/10/05	25796	31.54		CUSTOMER STATES INTERMITTANTLY WHEN TRANSMISSION SHIFTS FROMFIRST TO SECOND, ITS SEEMS TO GRIND ESP LIGHT FLASHES AT TIMES WHILE DRIVING	FOUND ESP ALREADY HAD UPDATED REPROGRAM SCANNED VEHICLE FOUND CODE C1513 BRAKE LAMP SWITCH FOUND BRAKE LAMP SWITHC	NOT WORKING ALL THE TIME DUE TO INTERNAL FAILURE E
KM8JN12D15U	10/12/04	55191	35.83	55191 SWITCH .3 93810R00=.3,N94,C15 SCAN SHOWS CODE 1513,REPLACED THE BRAKE LIGHT SWITCH			
KM8JN12D76U	7/28/05	11315	37.26	11315 NO BRAKE LIGHTS. .3 93810R00(N94)(C15) FOUND BRAKE SWITCH HAD INTERNAL OPEN. REPLACED STOP LIGHT SWITCH.			
KM8JN12D76U	7/20/05	7136	64.86	7137 BRAKE SWITCH FAILURE .6 95660RP0 N69 C15. .3 93810R00 .3 CHECK FOR CODES FOUND CODE C1513 BRAKE SWITCH INSP. AND REPLACE BRAKE SWITCH CHECK FOR OPERATION OK NOW			
KM8JN12D96U	1/06/06	13631	36.94	13631 ECS LIGHT COMES ON .3 93810ROO .3 N94 C15 SCAN TESTED FOR CODE B1513 BRAKE LIGHT SWITCH			
KM8JN72D86U	9/24/05	21356	31.54		CUSTOMER STATES ESC OFF LIGHT ON CHECK AND ADVISE	TECH SCANNED FOR CODES FOUND C1513 BRAKE LAMP SWITCH OPEN	REPLACE BRAKE LAMP SWITCH VERIFIED REPAIR
KM8JN72D55U	6/23/05	32518	31.54				
KM8JN72D85U	6/10/05	19966	56.28	TT FOR DIAGNOSIS			
KM8JN72D46U	3/24/06	9580	30.04		CUSTOMER STATES ESC LIGHT ON/OFF ATDASH; STATES WHEN LIGHT CAME ON INITIALLY SHE SMELLED A STRONG GLUESMELL BRIEFLY	06	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE INTERMITTENT FAILURE OF BRAKE SWITCH. REPLACESWITCH. CLEAR CODES AND ROAD TEST CODE:
KM8JN12D06U	8/16/05	8698	55.7	ESC LIGHT COMING HOOKED SCANNER CODE C1513,CHECKED OPRATION AND ADJUSTMENT OF BRAKE SWITCH.REPLACED BRAKE SWITCH BECAUSE INTERMITENTLY INOP. CLEARED CODE AND TEST DROVE TO			
KM8JN12D96U	12/27/05	7853	36.94	7854 OPEN CIRCUIT .30 93810R00 .30 N69 C15 CHECK SYSTEM CODES C1513 BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH, ADJUST.. CLEAR DIAG CODE			
KM8JN12D76U	1/04/06	15516	36.94	15516 ESC LIGHT ON .3 93810R00 .3 N 94 C15 SCAN TESTED FOR CODE B1513 BRAKE LIGHT SWITCH OPEN REPLACED BRAKE LIGHT SWITCH			
KM8JN72D75U	7/12/05	11148	30.04		CUSTOMER REC'D 079 RECALL NOTICE	F	079 CAMP 079 CAMP R & R DRIVERS SIDE AIRBAG COVER AS PERBULLETIN
KM8JN72D75U	7/12/05	11148	30.04		CUSTOMER STATES ESC LIGHT ON/OFF ATDASH	06	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE CODE C1315. BRAKE LAMP SWITCH DEFECTIVE. R & R BRAKE LAMP SWITCH.
KM8JM12B06U	8/30/05	39992	30.36		CUSTOMER STATSE ESC LIGHT ON/OFF ATDASH	06	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE STOP LAMP SWITCH FAULTY; REPLACE SWITCH

KM8JM12B16U	7/12/05	24659	64.86	24660 ESC LIGHT ON 0.6 93810R00/N94/C15/0.3.95910RPO/ 0.3 HOOKED SCANNER HAD CODE C1513(BRAKE LAMP SWITCH).CHECKED BRAKE SWITCH WAS OPERATIONAL AND ADJUSTED CORRECTLY.REPLACED BRAKE SWITCH BECAUSE INTERMITTENTLY INOP.CLEARED CODE.			
KM8JN72D46U	1/25/06	23472	37.26	23472 SWITCH .3 93810R00= .3,N94,C15 SCAN SHOWS CODE #C1513 REPLACED BRAKE LIGHT SWI			
KM8JM12B26U	11/29/05	38553	64.86	38558 OPEN IN CIRCUIT .6 93810R00 .3, 58910RPO .3, N69, C15 CHECK AND CLEAR CODE C1513. REPLACE BRAKE SWITCH. TEST DRIVE 5 MILES. RECHECK FOR CODES NONE			
KM8JN72D26U	12/12/05	25149	30.36		CUSTOMER STATES ESC LIGHT ON AT DASH	06	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE CK CODESW. C1513 FAULTY BRAKE LAMP SWITCH. R & R SWITCH AND ROAD TEST
KM8JM12B56U	12/09/05	10337	32		CUSTOMER STATES LIGHT ON @ DASH	06	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE REPLACED FAULTY BRAKE LIGHT SWITCH
KM8JM12B96U	11/24/05	18633	30.36		CUSTOMER STATES ESC LIGHT ON AT DASH	06	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE C1513 BRAKE LAMP SWITCH. REPLACE BRAKE LAMP SWITCH
KM8JN72D25U	12/17/04	18091	35.83	SEE LINE A - CRUISE CONTROL HAD INTERNAL OPEN - WOULD STILL CANCEL. FOUND BRAKE SWITCH HAD AN INTERNAL OPEN. REPLACED SWITCH. NOW OPERATING AS DESIGNED.			
KM8JM12B36U	1/05/06	21651	36.94	21651 ESC LIGHT COMMING ON .4 93830R00 N94 C15 .4 INSPECTED AND SCAN TESTED ESC/ABS SYSTEM. FOUND BRAKE LAMP SWITCH CODE. INSPECTED BRAKE LAMP SWITCH AND FOUND SWITCH HAD POOR CONTACT. REPLACED BRAKE LAMP SWITCH AND TESTED ALL CONTACTS. NO PROBLEMS FOUND			
KM8JN72D95U	9/21/04	11796	35.55	11811 STOP LIGHT SWITCH NOT SENDING TO CRUISE MODULE .3 93810R00 N94 C15 #499 REPLACED STOP LIGHT SWITCH VERIFIED REPAIR			
KM8JM12B25U	6/17/05	31477	29.62		CUSTOMER STATES ESP LIGHT ON AT DASH	06	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE CK CODES; B1513 FAULTY BRAKE LAMP SWITHC R & R SWITCH AND ROAD TEST
KM8JN72D56U	9/15/05	13242	32		CUSTOMER STATES ECS LIGHT ON AT DASH; STATES VEHICLE SLOWS DOWN WHEN LIGHT FLASHES	06	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE FAULTY BRAKE LAMP SWITCH. R & R SWITCH, CLEARCODE AND ROAD TEST
KM8JN72D55U	6/10/05	24039	30.36		CUSTOMER STATES ESC LIGHT ON/OFF ATDASH	06	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE CODE C1237 C1513 PRESSURE SENSOR; BRAKE LAMP SWITCH FAULTY. R & R BRAKE LAMP SWITCH ROADTEST
KM8JN12D65U	4/15/05	32304	64.86	32305 OPEN CIRCUIT INT. .60 58910RPO .30 93810R00 .30 N94 C15 CHECK SYSTEM CODES C1513 BRAKE LAMP SWITCH. INSPECTED OPERATION NOTED BRAKE LAMPS AND SCANNER DO NOT REGISTER WHEN BRAKE PEDAL DEPRESSED. REPLACED BRAKE LAMP SWITCH, CLEAR			
KM8JM12B26U	1/05/06	11768	64.54	11769 INT OPEN CIRCUIT .60 95910RPO .30 93810R00 .30 N69 C15 CHECK SYSTEM CODES C1513 BRAKE SWITCH OPEN OR SHORT. CHECK BRAKE LAMP CIRCUIT FOUND INT OPEN CIRCUIT IN CONNECTOR C15 PIN 3 WHEN PEDAL PUSHED. REPLACED BRAKE LAMP SWITCH, CLEAR DIAG CODE. REINSP			
KM8JN12D45U	4/20/05	15079	37	ADJ. BRAKE SWITCH .5 CHECK FOR CODES FOUND CODE P1503 BRAKE SWITCH INSP. AND ADJ. BRAKE SWITCH LCHECK FOR OPERATION			
KM8JN72D56U	7/19/05	16849	28.24	PERFORM GDS SCAN TEST-C1513 STORED-PERFORM DIAG AND FOUND BRAKE SWITCH CONTACT INTERMITTENTLY OPEN.REPLACE SWITCH,CLEAR CODES AND VERIFY REPA IR	CAMPAIGN 079	.	61B046R0 0

KM8JN72D56U	7/19/05	16849	28.24	PERFORM GDS SCAN TEST-C1513 STORED-PERFORM DIAG AND FOUND BRAKE SWITCH CONTACT INTERMITTENTLY OPEN.REPLACE SWITCH,CLEAR CODES AND VERIFY REPAIR	CUSTOMER STATES ESC LIGHT ON INT		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE PERFORM GDS SCAN TEST-C1513 STORED-PERFORMDIAG AND FOUND BRAKE SWITCH CONTACTINTERMITTENTLY OPEN.REPLACE SWITCH,CLEARCODES AND VERIFY REPAIR
KM8JN72D76U	11/26/05	4592	27.34	PERFORM DIAG-C1513 STORED.PERFORM DIAG AND FOUN D SHORTED BRAKE LAMP SWITCH.REPLACE SWITCH, CLEAR CODE AND VERIFY REPAIR	CUSTOMER STATES ESC LIGHT STAYS ON AFTER BRAKE PEDAL DEPRESSED		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE PERFORM DIAG-C1513 STORED.PERFORM DIAG ANDFOUN D SHORTED BRAKE LAMP SWITCH.REPLACESWITCH, CLEAR CODE AND VERIFY REPAIR
KM8JN72D55U	6/10/05	27717	36.94	27717 ECS LIGHT STAYING ON. 3 93810R00 .3 N94 C15 SCAN TESTED FOR CODE B1216 BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH			
KM8JN12D45U	4/20/05	24350	64.86	24350 OPEN CIRCUIT .60 58910RP0 .30 93810R00 .30 N69 C15 CHECK SYSTEM CODES C1513 BRAKE LAMP SWITCH OPEN/SHORT. REPLACED BRAKE LAMPS SWITCH CLEAR DIAG CODE. RECHECK FOR PROPER OPERATION OPERATING NORMALLY AT THIS TIME.			
KM8JN12D07U	1/30/07	672	64.86	672 SWITCH SCAN SHOWS CODE 1315,REPLACED BRAKE LIGHT SWITC H AND RETESTED.			
KM8JN72D76U	7/16/05	29752	28.56		CAMPAIGN 079	CPN	61B046R0 0
KM8JN72D76U	7/16/05	29752	28.56		CUSTOMER STATES RIGHT FOG LAMP INOP	WAR	BULB-HEAD LAMP (RH) BULB- HEAD LAMP (RH)
KM8JN72D76U	7/16/05	29752	28.56		CUSTOMER STATES ESC LIGHT ON	WAR	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D26U	12/16/05	27154	64.86	27157 OPEN IN CIRCUIT .6 93810R00 .3. N69, C15, 58910RP0, .3 CHECK AND CLEAR CODE B1513 REPLACE STOP LIGHT			
KM8JN12D66U	8/09/05	18970	37.26	18970 INSPECT AND ADVISE ESC LIGHT. 4 93830R00 N94 C15 .4 SCAN TESTED ESC SYSTEM AND FOUND BRAKE SWITCH MALFUNCTION. REPLACED BRAKE SWITCH. TESTED FOR FURTHER CODES AND OPERATION. NO DTC OR ESC LIGHT ON AT THIS TIME.			
KM8JN12D95U	10/05/04	6168	55.8	6168INTERNALLY FALED BRAKE LIGHT SWITCH.6039110RP0 .30 93810R00 .30 N69 C15CHECK SYSTEM CODES C1513 BRAKE LAMP SWITCHFAILURE. CHECK BRAKE LAMP SWITCH OPERATIONFOUND CRUISE CONTROL SIDE OF SWITCH FAILINGREPLACED BRAKE LAMP SWITCH, CLEAR CODES,RECHECK OPERA			
KM8JN72D45U	5/24/05	42595	28.56	PERFORM GDS SCAN TEST C1513 STORED-PERFORM DIAG AND FOUND INT OPEN IN BRAKE LAMP SWITCH- REPLACE SWITCH AND ROADTEST AND FELT HARSH 2-3 AND CODE U0001 STORED IN TCM.PERFORM DIAG AND FOUND NO FAULTS.CONTACT TECH ASSIST CENTER AND REPLACE THROTTLE POSITION	ADD ON OP FOUND TPS SWITCH INOP	WAR	SENSOR ASSY-THROTTLE POSITION RE SENSOR ASSY- THROTTLE POSITION RE VERIFIED CONCERN FOUND CODE STORED CALL TECHLI N CASE 107190 SAID TPS IS TO BE REPLACEDREPLAC ED TPS AND VERIFIED CONCERN
KM8JN72D45U	5/24/05	42595	28.56	PERFORM GDS SCAN TEST C1513 STORED-PERFORM DIAG AND FOUND INT OPEN IN BRAKE LAMP SWITCH- REPLACE SWITCH AND ROADTEST AND FELT HARSH 2-3 AND CODE U0001 STORED IN TCM.PERFORM DIAG AND FOUND NO FAULTS.CONTACT TECH ASSIST CENTER AND REPLACE THROTTLE POSITION	ADD ON OP FOUND TPS SWITCH INOP	WAR	SENSOR ASSY-THROTTLE POS ADD SCAN TOOL OPERATION SENSOR ASSY-THROTTLE POS ADD SCAN TOOL OPERATION VERIFIED CONCERN FOUND CODE STORED CALL TECHLI N CASE 107190 SAID TPS IS TO BE REPLACEDREPLAC ED TPS AND VERIFIED CONCERN
KM8JM12BX5U	4/27/05	15485	33.5	15485 ESP LIGHT COMES ON .9 93841R00-.3(N94)(C15) AND 93480R00-.6(N69)(C15) FOUND ESP LIGHT ON RECEIVED TWO CODES 1260 AND 1513 STEERING ANGLE CODE AND BRAKE SWITCH INOP. FOUND BRAKE SWITCH INTERNALLY HAS OPEN. REPLACED BRAKE SWITCH. ALSO FOUND STEERING AN			ANGULAR VELOCITY SENSOR ANGULAR VELOCITY SENSOR
KM8JM12BX5U	4/27/05	15485	33.5	15485 ESP LIGHT COMES ON .9 93841R00-.3(N94)(C15) AND 93480R00-.6(N69)(C15) FOUND ESP LIGHT ON RECEIVED TWO CODES 1260 AND 1513 STEERING ANGLE CODE AND BRAKE SWITCH INOP. FOUND BRAKE SWITCH INTERNALLY HAS OPEN. REPLACED BRAKE SWITCH. ALSO FOUND STEERING AN			IGNITION LOCK SWITCH ASS'Y RE IGNITION LOCK SWITCH ASS'Y RE

KM8JN72D45U	5/24/05	42595	28.56	PERFORM GDS SCAN TEST C1513 STORED-PERFORM DIAG AND FOUND INT OPEN IN BRAKE LAMP SWITCH- REPLACE SWITCH AND ROADTEST AND FELT HARSH 2-3 AND CODE U0001 STORED IN TCM.PERFORM DIAG AND FOUND NO FAULTS.CONTACT TECH ASSIST CENTER AND REPLACE THROTTLE POSITION	CUST STATES VEHICLE IS SURGING FORWARD.		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE PERFORM GDS SCAN TEST C1513 STORED-PERFORM DIAG AND FOUND INT OPEN IN BRAKE LAMP SWITCH-REPLACE SWITCH AND ROADTEST AND FELT HARSH2-3 AND CODE U0001 STORED IN TCM.PERFORM DIAGAND FOUND NO FAULTS.CONTACT TEC
KM8JN72D06U	11/29/05	20993	28.56	PERFORM GDS SCAN TEST=C1513 STORED-PERFORM DIAG AND FOUND OPEN IN BRAKE LAMP W=SWITCH-REPLACE SWITCH CLEARED CODE AND VERIFY REPAIR	CUSTOMER STATES ESC LIGHT ON INT		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE PERFORM GDS SCAN TEST=C1513 STORED-PERFORMDIAG AND FOUND OPEN IN BRAKE LAMPW=SWITCH-REPLACE SWITCH CLEARED CODE ANDVERIFY REPAIR
KM8JN12D56U	12/28/05	10782	31.86	BRAKE LIGHTS STAY ON SOLID, REPLACE BRAKE LIGHT SWITCH	C/S THAT BRAKE LIGHTS STAY ON SOLID/BATTERY WENT DIED OVER NIGHT	VERIFIED CUSTOMER CONCERN FOUND BRAKE LIGHT SWITCH FUALTY AND BATTERY NEEDED RECHARGED	INSTALLED NEW HYUNDAI BRAKE LIGHT SWITCH AND RECHARGED BATTERY/ALL WORKING PROPERLY AFTER WORK PERFORMED
KM8JM12B15U	5/27/05	21515	37	EXTENSIVE DIAGNOSIS AND TEST DRIVE	C/S THAT VEHICLE CRUISE CONTROL IS INTERMINETT/ADVISE	VERIFIED COMPLAINT FOUND FROM DIAG BRAKE SWITCH BAD	REPLACED BRAKE LIGHT SWITCH RETEST AND DROVE 20 MILES WITH TECH AND SHOP FOREMAN
KM8JM12B15U	5/27/05	21515	33.5	FOUND FROM DIAGNOSIS BRAKE SWITCH INOP. NREPLACE BRAKE LIGHT SWITCH, RETEST, TEST DROVE 20 MILES WITH TECH AND SHOP FOREMAN	C/S THAT VEHICLE CRUISE CONTROL IS INTERMINETT/ADVISE	VERIFIED COMPLAINT FOUND FROM DIAG BRAKE SWITCH BAD	REPLACED BRAKE LIGHT SWITCH RETEST AND DROVE 20 MILES WITH TECH AND SHOP FOREMAN
KM8JM12B15U	6/15/05	13689	27.34	PERFORM GDS DIAGNOSTICS-P1513 STORED.PERFORM DIAG AND FOUND INT HIGH RESISTANCE IN STOP LAMP SWITC.REPLACE SWITCH,CLEAR CODE AND VERIFY REPA IR	CUSTOMER STATES WHEN VEHICLE SLIDESBECAUSE OF ROAD CONDITIONS-ESP OFF LIGHT COMES ON AND STAYS ON UNTIL KEY CYCLED-LIGHT WONT GO OFF IF SWITCH DEPRESSED		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE PERFORM GDS DIAGNOSTICS-P1513 STORED.PERFORMDIAG AND FOUND INT HIGH RESISTANCE IN STOPLAMP SWITC.REPLACE SWITCH,CLEAR CODE ANDVERIFY REPA IR
KM8JN72DX6U	10/18/05	15331	28.56		CUST STATES ESC LIGHT IS ON.	WAR	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72DX6U	10/18/05	15331	28.56		CUSTOMER STATES LT FENDER HAS BLEMISH	E	FENDER PANEL - LH FENDER PANEL - LH VERIFIED R AND I FENDER RT AND LFT FLARE MUDGU ARD WHEEL LINER BUMPER LINER FENDER FENDERFLAI R RAND I RT HEADLAMP AND RT FENDER LINERPAINTE D ALL PARTS AND VERIFIED
KM8JM12B46U	9/15/05	35618	34.84	35618 C1513 INTERMITENT STOP LIGHT SWITCH READING REPLACED STOP LIGHT SWITCH CLEAR CODE TEST DRIVE VEHICLE NOW PERFORMING AS DESIGNED	CUST STATES ECS LIGHT IS ON	F	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 35618 C1513 INTERMITENT STOP LIGHT SWITCHREADING REPLACED STOP LIGHT SWITCH CLEARCODE TEST DRIVE VEHICLE NOW PERFORMING ASDESIGNED
KM8JN72D36U	7/28/05	13369	34.84	13369 C1513 STOP LIGHT SWITCH INTERNAL FAILURE TEST SWITCH FAILED. INSTALL NEW SWITCH ADJUST. CHECK ADJUST FOR PROPER FUNCTION CLEAR CODE NOW PERFORMING AS DESIGNED	RECALL 079	F	AIRBAG MODULE CAMP AIRBAG MODULE CAMP 13369 RECALL DUE 0.4 PERFORM RECALL 079 DABOPP #61B046RO
KM8JN72DX6U	10/18/05	15331	28.56		CUSTOMER STATES LT FENDER HAS BLEMISH	E	FENDER PANEL - RH FENDER PANEL - RH VERIFIED R AND I FENDER RT AND LFT FLARE MUDGU ARD WHEEL LINER BUMPER LINER FENDER FENDERFLAI R RAND I RT HEADLAMP AND RT FENDER LINERPAINTE D ALL PARTS AND VERIFIED
KM8JN72D16U	8/12/05	17176	28.56		CAMPAIGN 079		61B047R0 0
KM8JN72D16U	8/12/05	17176	28.56		CUSTOMER STATES ESC LIGHT ON INT		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D36U	7/28/05	13369	34.84	13369 C1513 STOP LIGHT SWITCH INTERNAL FAILURE TEST SWITCH FAILED. INSTALL NEW SWITCH ADJUST. CHECK ADJUST FOR PROPER FUNCTION CLEAR CODE NOW PERFORMING AS DESIGNED	CUSTOMER STATES ESC OFF INDICATOR COMES ON AT TIMES	F	SWITCH ASSY-ESP SWITCH ASSY-ESP 13369 C1513 STOP LIGHT SWITCH INTERNALFAILURE TEST SWITCH FAILED. INSTALL NEWSWITCH ADJUST. CHECK ADJUST FOR PROPERFUNCTION CLEAR CODE NOW PERFORMING ASDESIGNED
KM8JM12BX6U	7/20/05	8739	59.3	SCANNED FOR CODES FOUND #C1513 BRAKE SWITCH FAILURE REPLACED BRAKE LIGHT SWITCH. TT FOR SCANNING FOR CODES	CUST STATES ESP LIGHT FLASHES ON AND OFF(PART SOP)	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 8742 BRAKE LIGHT SWITCH INTERMITENT FAILUREVERIFIED COMPLAINT. SCANNED FOR CODES FOUND#C1513 BRAKE SWITCH FAILURE REPLACED BRAKELIGHT SWITCH
KM8JN72D86U	10/28/05	28921	28.56	ROADTEST AND VERIFY COMPLAINT-PERFORM GDS SCAN TEST=C1513 STORED.PERFORM DIAG AND FOUND INT SHORT IN BRAKE LAMP SWITCH-REPLACE SWITCH,CLEAR CODE AND RE-ROADTEST TO VERIFY REPAIR	CUSTOMER STATES SURGES AND STALLS		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE ROADTEST AND VERIFY COMPLAINT-PERFORM GDSSCAN TEST=C1513 STORED.PERFORM DIAG AND FOUNDINT SHORT IN BRAKE LAMP SWITCH- REPLACESWITCH,CLEAR CODE AND RE-ROADTEST TO VERIFYREPAIR

KM8JN72D95U	5/20/05	9014	27.34	PERFORM DIAG-C1513 STORED-PERFORM DIAG AND FOUND SHORTED BRAKE SWITCH.REPLACE BRAKE SWITCH AND CLEAR CODE AND VERIFY REPAIR	CUSTOMER STATES ESP OFF LIGHT STAYING ON		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE PERFORM DIAG-C1513 STORED-PERFORM DIAG AND FOUND SHORTED BRAKE SWITCH.REPLACE BRAKE SWITCH AND CLEAR CODE AND VERIFY REPAIR
KM8JN72D15U	11/15/04	36369	307.88	36369 BRAKE INPUT SWITCH SCANNED VEHICLE FOR CODES, NONE FOUND, RAN DATA FOR TCM AND FOUND CRUISE "ON" NOT BEING RECOGNIZED IN DATA STREAM OF SCANNER, HOWEVER INDICATOR FOR CRUISE "ON" OPERATIVE, REPLACED ONLY COMPONENT BETWEEN, THE CRUISE CONTROL MODULE,	CUST STATES PERFORM 079 AIRBAG RECALL	F	AIRBAG MODULE CAMP AIRBAG MODULE CAMP 36369 RECALLED 0.2 PERFORMED DAB COVERRECALL
KM8JN72D15U	11/15/04	36369	307.88	36369 BRAKE INPUT SWITCH SCANNED VEHICLE FOR CODES, NONE FOUND, RAN DATA FOR TCM AND FOUND CRUISE "ON" NOT BEING RECOGNIZED IN DATA STREAM OF SCANNER, HOWEVER INDICATOR FOR CRUISE "ON" OPERATIVE, REPLACED ONLY COMPONENT BETWEEN, THE CRUISE CONTROL MODULE,	CUST STATES CRUISE CONTROL INOP(PART SOP)	F	SWITCH ASSY-PARKING BRAKERE SWITCH ASSY-PARKING BRAKERE 36369 BRAKE INPUT SWITCH SCANNED VEHICLE FORCODES, NONE FOUND, RAN DATA FOR TCM AND FOUND CRUISE "ON" NOT BEING RECOGNIZED IN DATASTREAM OF SCANNER, HOWEVER INDICATOR FORCRUISE "ON" OPERATIVE,
KM8JN72D06U	1/09/06	29122	28.56	VERIFY COMPLAINT-PERFORM GDS SCAN TEST=C1513 STORED-PERFORM DIAG AND ATTEMPT TO ADJUST SWITC H AS PER TSB 06-50-006-CONDITION STILL PRESENT- REPLACE SWITCH,CLEAR CODE AND VERIFY OPERATION	CUSTOMER STATES CRUISE CONTROL INT INOP		SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE VERIFY COMPLAINT-PERFORM GDS SCAN TEST=C1513STORED-PERFORM DIAG AND ATTEMPT TO ADJUSTSWITC H AS PER TSB 06-50-006-CONDITION STILLPRESENT- REPLACE SWITCH,CLEAR CODE AND VERIFYOPERATION
KM8JN72D66U	7/25/05	27542	33.95				
KM8JN72D45U	4/26/05	17292	33.63				
KM8JN72D86U	11/10/05	22790	33.63				
KM8JN72D15U	11/15/04	36369	307.88	36369 BRAKE INPUT SWITCH SCANNED VEHICLE FOR CODES, NONE FOUND, RAN DATA FOR TCM AND FOUND CRUISE "ON" NOT BEING RECOGNIZED IN DATA STREAM OF SCANNER, HOWEVER INDICATOR FOR CRUISE "ON" OPERATIVE, REPLACED ONLY COMPONENT BETWEEN, THE CRUISE CONTROL MODULE,	CUST STATES CRUISE CONTROL INOP(PART SOP)	F	ACUATOR ACUATOR 36369 BRAKE INPUT SWITCH SCANNED VEHICLE FORCODES, NONE FOUND, RAN DATA FOR TCM AND FOUND CRUISE "ON" NOT BEING RECOGNIZED IN DATASTREAM OF SCANNER, HOWEVER INDICATOR FORCRUISE "ON" OPERATIVE, REPLACED ONLYCOMPONENT BETWEEN, THE CRUISE CON
KM8JN72D15U	11/15/04	36369	307.88	36369 BRAKE INPUT SWITCH SCANNED VEHICLE FOR CODES, NONE FOUND, RAN DATA FOR TCM AND FOUND CRUISE "ON" NOT BEING RECOGNIZED IN DATA STREAM OF SCANNER, HOWEVER INDICATOR FOR CRUISE "ON" OPERATIVE, REPLACED ONLY COMPONENT BETWEEN, THE CRUISE CONTROL MODULE,	CUSTOMER REQUESTS COURTESY TRANSPORTATION	F	CUSTOMER REQUESTS COURTESY TRANSPORTATION CUSTOMER REQUESTS COURTESY TRANSPORTATION 36369
KM8JN12DX7U	1/26/07	1690	33.95	USB FOR BRAKE LIGHT SWITCH. REPLACED AND ADJUSTED BRAKE LIGHT SWITCH.			
KM8JN72D95U	5/16/05	23672	60.66	C/S ESP LIGHT IS COMING ON AND OFF SCANT TEST FOUND CODE C1513 BRAKE LIGHT SWITCH INTERNAL FAILURE IN SWITCH REPLACED	CUSTOMER STATES ESP LIGHT IS COMING ON AND OFF	SCAN TEST FOR ESP LIGHT ON CODE C1513 BRAKE LIGHT SWITCH MALFUNCTION FOUN INTERNAL FAILURE IN SWITCH.	REPLACED BRAKE SWITCH ROADTEST AND REPAIR ORDERED STEERING ANGLE SENSOR FOR CODE P1260
KM8JN12DX6U	12/08/05	13077	34.84	13079 CRUISE CONTROL INOP. CHECK FUSES,CHECK CONTROL CIRCUITS,FOUND OPEN CIRCUIT IN BRAKE SWITCH FOR ACTUATOR CLUTCH CONTROL.REPLACE BRAKE SWITCH,ROAD TEST,CRUISE CONTROL NOW PERFORMS AS PER DESIGN.	CUSTOMER STATES CHECK OPERATION OF CRUISE CONTROL		SWITCH ASSY-PARKING BRAKERE SWITCH ASSY-PARKING BRAKERE 13079 CRUISE CONTROL INOP. CHECKFUSES,CHECK CONTROL CIRCUITS,FOUND OPEN CIRCUIT IN BRAKE SWITCH FOR ACTUATOR CLUTCHCONTROL.REPLACE BRAKE SWITCH,ROAD TEST,CRUISECONTROL NOW
KM8JN72DX6U	12/03/05	16648	60.66	ESC LIGHT COMES ON SCAN TEST FOUND CODE C1513 BRAKE LIGHT SWITCH REPLACE STOP LAMP SWITCH, OK NOW.	BATTERY SEEMS TO BE GOING DEAD ALL THE TIME.	TESTED BATTERY, 321 CCA. FAILED TEST.	REPLACED BATTERY TEST CODE 401R6-RU-BA
KM8JN72DX6U	12/03/05	16648	60.66	ESC LIGHT COMES ON SCAN TEST FOUND CODE C1513 BRAKE LIGHT SWITCH REPLACE STOP LAMP SWITCH, OK NOW.	ESC LIGHT COMES ON	SCAN TEST FOUND C1513 BRAKE SWITCH MALFUNCTION	REPLACE STOP LAMP SWITCH, OK NOW.
KM8JN72D76U	1/06/06	11910	60.66	C/S ESC LIGHT IS COMING ON INTERMITTENTLY SCAN TEST FOUND CODE C1513 BRAKE LIGHT SWITCH FAULTY REPLACED SWITCH AND CLEARED CODE			
KM8JN12DX6U	12/08/05	20489	63.66	20490 BRAKE LAMP SWITCH SCANNED AND FOUND C1513, CHECKED CONTINUITY IN BRAKE LAMP SWITCH AND FOUND TCM INPUT TO BE OPEN IN ANY SWITCH POSITION. WASW NOT ABLE TO DUPLICATE STALLING HOWEVER THIS CRITERIA COULD CAUSE SUCH AN ISSUE, REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES AT TIMES WHEN SLOWING DOWN TO A STOP, THE ENGINE DIES HAPPENED ABOUT 7 TIMES ON THURSDAY. HAS TO PUT IN PARK AND RESTART. HAS NOT DRIVEN THE CAR SINCE THURSDAY AND DID NOT HAPPEN THIS MORNING	PF	SWITCH SWITCH 20490 BRAKE LAMP SWITCH SCANNED AND FOUND C1513, CHECKED CONTINUITY IN BRAKE LAMP SWITCH AND FOUND TCM INPUT TO BE OPEN IN ANY SWITCH POSITION, WASW NOT ABLE TO DUPLICATE STALLING HOWEVER THIS CRITERIA COULD CAUSE SUCH AN ISSUE, REPLACED BRAKE L

KM8JN12DX6U	12/08/05	20489	63.66	20490 BRAKE LAMP SWITCH SCANNED AND FOUND C1513, CHECKED CONTINUITY IN BRAKE LAMP SWITCH AND FOUND TCM INPUT TO BE OPEN IN ANY SWITCH POSITION, WASW NOT ABLE TO DUPLICATE STALLING HOWEVER THIS CRITERIA COULD CAUSE SUCH AN ISSUE, REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES AT TIMES WHEN SLOWING DOWN TO A STOP, THE ENGINE DIES HAPPENED ABOUT 7 TIMES ON THURSDAY. HAS TO PUT IN PARK AND RESTART. HAS NOT DRIVEN THE CAR SINCE THURSDAY AND DID NOT HAPPEN THIS MORNING	PF	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20490 BRAKE LAMP SWITCH SCANNED AND FOUND C1513, CHECKED CONTINUITY IN BRAKE LAMP SWITCH AND FOUND TCM INPUT TO BE OPEN IN ANY SWITCH POSITION, WASW NOT ABLE TO DUPLICATE STALLING HOWEVER THIS CRITERIA COULD
KM8JM12B06U	9/14/05	15087	35	SOP C/S ECS LIGHT GOES ON AND OFF TECH PERFORMED PIN POINT TEST FOUND BRAKE LIGHT SWITCH TO HAVE AN INTERNAL FAILURE IN SWITCH REPLACED SWITCH	CUSTOMER STATES CHECK ENGINE LIGHT ON TECH CONFIRMED LIGHT WAS ON SCAN TEST AND FOUND CODE P0455	AND P0456 PERFORMED EVAP TEST AND FOUND CLOSE STUCK REPLACE AND RETEST	
KM8JM12B06U	9/14/05	15087	35	SOP C/S ECS LIGHT GOES ON AND OFF TECH PERFORMED PIN POINT TEST FOUND BRAKE LIGHT SWITCH TO HAVE AN INTERNAL FAILURE IN SWITCH REPLACED SWITCH	INSTALL SOP SWITCH 93810-3K000 CUST STATES ECS LIGHT GOES ON AND OFF TECH PERFORMED	PINPOINT TEST AND FOUND BRAKE LIGHT SWITCH TO HAVE AN INTERNAL FAILURE IN SWITCH REPLACE AND RETEST	
KM8JM12B96U	9/14/05	20984	56.74	C/S ESC LIGHT COMES ON AND STAYS ON UNTIL VEH IS TURNED OFF. CK SCAN FOUND CODE C1513 BRAKE SWITCH CIRCUIT TEST ALL INPUTS AND OUTPUTS TO BRAKE SWITCH OK FOUND INTERNAL FAILURE IN BRAKE SWITCH REPLACED			
KM8JM12B76U	9/09/05	21030	36.06	21030 CUST STATES THAT THE ESC OFF LIGHT IS ON 99999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LAMP SWITCH FOUND SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION AFTER REPAIR	CUSTOMER STATES THE ESC OFF LIGHT IS ON	CUST STATES THAT THE ESC OFF LIGHT IS ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 21030 CUST STATES THAT THE ESC OFF LIGHT IS ON 99999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LAMP SWITCH FOUND SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION AFTER REPAIR
KM8JM12B76U	9/09/05	21030	36.06	21030 CUST STATES THAT THE ESC OFF LIGHT IS ON 99999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LAMP SWITCH FOUND SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION AFTER REPAIR	CUSTOMER STATES THE ESC OFF LIGHT IS ON	CUST STATES THAT THE ESC OFF LIGHT IS ON	SCAN TOOL OPERATION SCAN TOOL OPERATION 21030 CUST STATES THAT THE ESC OFF LIGHT IS ON 99999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LAMP SWITCH FOUND SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION AFTER REPAIR
KM8JN72D96U	10/08/05	24133	60.66	C/S ESC LIGHT COMES ON AND OFF SCAN TEST FOUND CODE C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED	CUSTOMER STATES THE ESC LIGHT COMES ON AND OFF.	SCAN CODE FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION	REPLACED BRAKE LAMP SWITCH, OK NOW.
KM8JM12B25U	4/15/05	24843	35.16	C/S ESC LIGHT IS ON FOUND CODE FOR STOP LAMP SWITCH REPLACED	CUSTOMER STATES THE ESC LIGHT IS ON (SOP BRAKE SWITCH)	ESC LIGHT WAS ON PREVIOUS VISIT, SCAN CODE SHOWED MALFUNCTION IN STOP LAMP SWITCH.	REPLACED SWITCH ESC LIGHT IS OFF NOW.
KM8JN72D75U	7/02/05	16072	56.74	C/S ESP LIGHT IS ON SCAN FOUND CODE C1513 BRAKE SWITCH CK FOUND INTERNAL FAILURE REPLACED BRAKE LIGHT	CUST STATES THE ESP LIGHT IS ON?	SCAN FOUND C1513 BRAKE SWITCH, CHECKED SWITCH, FOUND INTERNAL FAILURE.	REPLACED BRAKE LIGHT SWITCH
KM8JM12B16U	12/30/05	24777	36.06	24777 CUST STATES THAT THE TCS LIGHT ON 9999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LIGHT SWITCH FOUND THAT INTERM. SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION AFTER REPAIR	DRIVER AIR BAG MODULE REPLACEMENT	DRIVER AIR BAG COVER REPLACEMENT	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 24777 DRIVER AIR BAG COVER REPLACEMENT 9999 REPLACED DRIVE AIR BAG COVER THANK YOU
KM8JM12B16U	12/30/05	24777	36.06	24777 CUST STATES THAT THE TCS LIGHT ON 9999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LIGHT SWITCH FOUND THAT INTERM. SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION AFTER REPAIR THANK YOU	CUSTOMER STATES THE TCS LIGHT STAY ON AND THEN GOES OFF INSTALL SOP PART	CUST STATES THAT THE TCS LIGHT ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 24777 CUST STATES THAT THE TCS LIGHT ON 9999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LIGHT SWITCH FOUND THAT INTERM. SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL
KM8JN72D75U	7/02/05	16072	56.74	C/S ESP LIGHT IS ON SCAN FOUND CODE C1513 BRAKE SWITCH CK FOUND INTERNAL FAILURE REPLACED BRAKE LIGHT	CUST STATES THE CENTER ARMREST IS BROKEN (SOP)	HINGE ON ARMREST SPLIT	REPLACE CENTER ARMREST
KM8JN12DX5U	9/03/04	4117	105	ROAD TEST TO CONFIRM COMPLAINT C/S BRAKES LOCKED UP AT STOPPING THEN WOULD RELEASE AFTER 1HR. REMOVED ALL WHEELS CK BRAKES NO SIGNS EXCESSIVE HEAT CALL TECH LINE CASE #176995 TOLD TECH TO CHECK SWITCH FOR BEING TIGHT CHECK SWITCH WAS TO TIGHT			
KM8JN12D96U	1/04/06	13752	35.74	13752 SCAN TEST CODE C1513 BRAKE LIGHT SWITCH POOR CONTACT SCAN TEST CODE C1513 POOR CONTACTS IN THE BRAKE LIGHT SWITCH / REPLACE THE BRAKE LIGHT SWITCH AND CLEAR CODE	CUSTOMER STATES THE ESC LIGHT IS ON AGAIN	SCAN TEST CODE C1513 BRAKE LIGHT SWITCH POOR CONTACT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 13752

KM8JN12D96U	1/04/06	13752	35.74	13752 SCAN TEST CODE C1513 BRAKE LIGHT SWITCH POOR CONATCT SCAN TEST CODE C1513 POOR CONTACTS IN THE BRAKE LIGHT SWITCH / REPLACE THE BRAKE LIGHT SWITCH AND CLEAR CODE	CUSTOMER STATES THE ESC LIGHT IS ON AGAIN	SCAN TEST CODE C1513 BRAKE LIGHT SWITCH POOR CONATCT	SCAN TOOL OPERATION SCAN TOOL OPERATION 13752
KM8JN72DX5U	7/02/05	17918	60.66	C/S ECS LIGHT GOES ON AND OFF SCAN TEST SHOWED C1513 FAILURE IN BRAKE SWITCH REPLACED	CUST STATES ECS LIGHT GOES ON AND OFF	SCAN TEST SHOWED C1513 BRAKE SWITCH FAILURE.	REPLACED SWITCH, OK NOW.
KM8JN72D05U	5/17/05	24377	60.66	ESC LIGHT KEEPS GOING ON AND OFF SCAN TEST FOUND CODE C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED SWITCH CLEARED CODE	ESP LIGHT KEEPS GOING ON AND OFF.	SCAN CODE FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION	REPLACED BRAKE LAMP SWITCH, CLEARED CODES. OK NOW.
KM8JN72D76U	8/10/05	30992	60.66	C/S ESC LIGHT CAME ON AND STAYED ON SCAN TEST FOUND CODE C1237 AND C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED SWITCH CLEARED CODES			
KM8JN12D96U	10/12/05	21817	36.06	21817 CUST STATES THAT THE ESC LIGHT COMES ON 999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LAMP SWITCH. INSPECTED FOUND THAT THE SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION AFTER REPAIR THANK YOU	CUSTOMER STATES THE ESC LIGHT KEEPS COMING ON	CUST STATES THAT THE ESC LIGHT COMES ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 21817 CUST STATES THAT THE ESC LIGHT COMES ON 999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LAMP SWITCH. INSPECTED FOUND THAT THE SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERA
KM8JN12D96U	10/12/05	21817	36.06	21817 CUST STATES THAT THE ESC LIGHT COMES ON 999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LAMP SWITCH. INSPECTED FOUND THAT THE SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION AFTER REPAIR THANK YOU	CUSTOMER STATES THE ESC LIGHT KEEPS COMING ON	CUST STATES THAT THE ESC LIGHT COMES ON	SCAN TOOL OPERATION SCAN TOOL OPERATION 21817 CUST STATES THAT THE ESC LIGHT COMES ON 999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LAMP SWITCH. INSPECTED FOUND THAT THE SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION AFTER R
KM8JN12D66U	10/12/05	19788	36.06	19788 INSPECT & SCAN TEST - CODE - C1513 - BRAKE LIGHT SWITCH FAULT - INSTALL SWITCH ASSY - STOP LAMP (4P) CLEAR CODE / ROAD TEST - CHECK FOR PENDING - OK -			
KM8JM12B36U	4/26/06	13627	60.66	C/S ESC LIGHT CAME ON LAST WEEK WHILE VEH WAS LOADED WITH PEOPLE AND CARGO SHOULD THIS HAPPEN? SCAN TEST FOUND CODE C1513 BRAKE SWITCH HIGH RESISTANCE REPLACED SWITCH OK NOW	ESC LIGHT CAME ON LAST WEEK WHILE VEHICLE WAS LOADED WITH PEOPLE AND CARGO. SHOULD THIS HAPPEN?	SCAN TEST FOUND C1513 BRAKE SWITCH HIGH RESISTANCE.	REPLACED BRAKE SWITCH, OK NOW.
KM8JN72D07U	9/26/06	4800	60.66	C/S ESC LIGHT COMES ON AND OFF SCAN CODE FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION REPLACED	ESC LIGHT COMES ON AND OFF.	SCAN CODE FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION.	REPLACED BRAKE LAMP SWITCH.
KM8JN12DX6U	9/30/05	21153	60.66	C/S ESC LIGHT HAS COME AND GONE OFF SEVERAL TIMES SCAN TEST FOUND CODE C1513 BRAKE LAMP SWITCH FAILURE REPLACED STOP LAMP SWITCH.	ESC LIGHT HAS COME ON AND GONE OFF SEVERAL TIMES.	SCAN TEST FOUND C1513 BRAKE LAMP SWITCH FAILURE.	REPLACED STOP LAMP SWITCH.
KM8JM12B96U	1/04/06	27182	36.06	27182 CUST STATES THAT THE ESC LIGHT KEEPS COMING ON 99999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LAMP SWITCH FOUND THAT SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION AFTER REPAIR THANK YOU	CUSTOMER STATES THE ESC LIGHT WILL GO OFF AND THEN WHEN THE VEHICLE IS RESTARTED THE LIGHT IS NOT ON	CUST STATES THAT THE ESC LIGHT KEEPS COMING ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 27182 CUST STATES THAT THE ESC LIGHT KEEPS COMING ON 99999 INSPECTED AND PULLED CODES FOUND CODE C1513 BRAKE LAMP SWITCH FOUND THAT SWITCH NOT MAKING GOOD INTERNAL CONTACT REPLACED SWITCH NORMAL OPERATION A
KM8JM12B75U	6/02/05	15545	56.74	C/S EST OFF COME ON AND OFF HAPPENED 4X'S SCAN TEST FOUND CODE C1513 INTERMITTENT FAILURE WITH SWITCH REPLACED AND CLEARED CODE	CUSTOMER STATES EST OFF COME ON AND OFF. HAPPENED 4 TIMES IN LAST MONTH	SCAN TEST FOUND CODE C1513 BREAK LAMP SWITCH CIRCUIT.	CONNED SCANNER TO CHECK ESC FOUND BRAKE LAMP SWITCH CODE WHICH IS INTERMITTENT FAILURE WHICH WILL CAUSE ESC LIGHT TO COME ON AND OFF. REPLACED SWITCH CLEARED CODE.
KM8JN72D66U	7/28/05	23125	56.74	C/S ESC LIGHT FLASHES INTERMITTENTLY SCAN TESTED FOUND CODES C1503 AND 1513 BRAKE LIGHT SWITCH INTERM. SHORT REPLACED			
KM8JM12B36U	1/04/06	31358	60.66	C/S ESC LIGHT COMES ON INTERMITTENTLY SCANNED TESTED FOUND CODE C1513 BRAKE LIGHT SWITCH CONFIRM BRAKE LIGHTS IN OP REPLACED BRAKE LIGHT SWITCH			
KM8JN12D35U	10/16/04	32914	167.46	32914 BAD BRAKE LIGHT SWITCH CHECK ALL FUSES ARE OK. DISCONNECT PLUG AT CRUISE CONTROL MODULE. MEASURE INPUT VOLTAGES AT PIN # 7, IT IS 12.3 VOLTS AND IS NORMAL. MEASURE VOLTAGE AT PIN # 3, IT IS 12.3 VOLTS AND IS NORMAL. MEASURE VOLTAGE AT PIN # 5 WITH BRAKE	CUSTOMER STATES THE PANEL UNDER THE STEERING COLUMN IS LOOSE AND KEEPS FALLING DOWN	F	LOWER CRASH PAD PANEL ASSY RE LOWER CRASH PAD PANEL ASSY RE 32914 HOLD PINS & CLIPS ARE WEAK REPLACED/S UNDER DASH PANEL

KM8JN12D35U	10/16/04	32914	167.46	32914 BAD BRAKE LIGHT SWITCH CHECK ALL FUSES,ARE OK.DISCONNECT PLUG AT CRUISE CONTROL MODULE. MEASURE INPUT VOLTAGES AT PIN # 7,IT IS 12.3 VOLTS AND IS NORMAL. MEASURE VOLTAGE AT PIN # 3,IT IS 12.3 VOLTS AND IS NORMAL.MEASURE VOLTAGE AT PIN #5 WITH BRAKE	CUSTOMER STATES THE CRUISE CONTROL WILL NOT ENGUAGE	F	STOP LAMP SWITCH ADDITIONAL TIME CLUTCH SWITCH ATT TIME 32914 BAD BRAKE LIGHT SWITCH CHECK ALL FUSES,ARE OK.DISCONNECT PLUG AT CRUISECONTROL MODULE. MEASURE INPUT VOLTAGES AT PIN# 7,IT IS 12.3 VOLTS AND IS NORMAL. MEASUREVOLTAGE AT PIN # 3,IT IS 12.3 VOL
KM8JN72D06U	8/16/05	37212	60.66	C/S ESC LIGHT IS ON FOUND CODE C1513 BRAKE SWITCH FOUND FAULTY BRAKE LIGHT SWITCH REPLACED SWITCH CLEAR CODE RE-TEST			
KM8JN12D87U	10/31/06	3329	60.66	C/S ESC LIGHT COMES ON INTERMITTENT SCAN TEST FOUND CODE C1513 DIAG SYSTEM ALL INPUTS AND OUTPUTS TO SWITCH INTERNAL FAILURE IN SWITCH REPLACED SWITCH CLEARED CODE	CUSTOMER STAETS ESC LIGHT COMES ON INTERMITTENT	CUSTOMER STATES ESC LIGHT IS ON SCAN TESTED FOUND CODE C1513BRAEK SWITCH CIRCUIT DIAG SYSTEM TEST ALL INPUTS AND OUTPUTS	TO SWITCH ON FOUND INTERNAL FAILURE IN SWITCH REPLACED AND RETEST CLEARED CODES
KM8JN72D96U	10/01/05	16307	60.66	C/S ESC LIGHT STAYS ON VERIFIED SCAN TEST FOUND CODE C1513 BRAKE LAMP SWITCH FAULTY REPLACED			
KM8JN12D35U	10/16/04	32914	167.46	32914 BAD BRAKE LIGHT SWITCH CHECK ALL FUSES,ARE OK.DISCONNECT PLUG AT CRUISE CONTROL MODULE. MEASURE INPUT VOLTAGES AT PIN # 7,IT IS 12.3 VOLTS AND IS NORMAL. MEASURE VOLTAGE AT PIN # 3,IT IS 12.3 VOLTS AND IS NORMAL.MEASURE VOLTAGE AT PIN #5 WITH BRAKE	CUSTOMER STATES THE CRUISE CONTROL WILL NOT ENGUAGE	F	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 32914 BAD BRAKE LIGHT SWITCH CHECK ALL FUSES,ARE OK.DISCONNECT PLUG AT CRUISECONTROL MODULE. MEASURE INPUT VOLTAGES AT PIN# 7,IT IS 12.3 VOLTS AND IS NORMAL. MEASUREVOLTAGE AT PIN # 3,IT IS 12.3 VOLTS A
KM8JN12D05U	1/06/05	40585	35.46	ESP LIGHT ON.SCAN C1513 BRAKE LAMP SWITCH FAILURE. REPLACED SWITCH	922 ECM REPROGRAM	F	EMC REPROG. 922 EMC REPROG. 922 40585 922 ECM REPROGRAM WH PERFORMED 922 ECMREPROGRAM NORMAL OPPERATION AFTER REPAIRTHANK YOU HAVE A NICE DAY..... KYLE
KM8JM12B06U	8/24/05	31657	60.66	C/S ESC LIGHT IS ON ALSO BRAKE LIGHTS ARE INOP SCAN TEST FOUND CODE C1513 FOUND BATTERY POSITIVE TO SWITCH OK BUT WHEN BRAKE DEPRESSED NO POWER OUT REPLACED SWITCH			
KM8JN72D95U	5/14/05	33172	60.66	C/S ESC LIGHT CAME ON SCAN TEST FOUND CODE C1513 BRAKE SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES THE ESP LIGHT IS ON (SOP SENSORS)	FOUND CODE FOR G SENSOR MALFUNCTION C1274	REPLACED G SENSOR, ROAD TEST, OK NOW.
KM8JN12D05U	1/06/05	40585	35.46	ESP LIGHT ON.SCAN C1513 BRAKE LAMP SWITCH FAILURE. REPLACED SWITCH	CUSTOMER STATES THE CHECK ENGINE LGIHT IS ON	OPEN	ANGULAR VELOCITY SENSOR ANGULAR VELOCITY SENSOR 40585 CUST STATES TAHT ESP LIGHT ON WHINSPECTED AND PULLED CODES FOUND CODE C1260STEERING WHEEL ANGLE SENSOR ABNORMAL ANDC1513 BRAKE LAMP SWITCH. TESTED STEERINGWHEEL SENSOR IS NOT READING POSITIVE ANGLEONL
KM8JN12D05U	1/06/05	40585	35.46	ESP LIGHT ON.SCAN C1513 BRAKE LAMP SWITCH FAILURE. REPLACED SWITCH	CUSTOMER STATES THE CHECK ENGINE LGIHT IS ON	OPEN	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 40585 CUST STATES TAHT ESP LIGHT ON WHINSPECTED AND PULLED CODES FOUND CODE C1260STEERING WHEEL ANGLE SENSOR ABNORMAL ANDC1513 BRAKE LAMP SWITCH. TESTED STEERINGWHEEL SENSOR IS NOT READING POSITIVE ANGL
KM8JN12D05U	1/06/05	40585	35.46	ESP LIGHT ON.SCAN C1513 BRAKE LAMP SWITCH FAILURE. REPLACED SWITCH	922 ECM REPROGRAM	F	EMC REPROG. 922 40585 922 ECM REPROGRAM WH PERFORMED 922 ECMREPROGRAM NORMAL OPPERATION AFTER REPAIRTHANK YOU HAVE A NICE DAY..... KYLE
KM8JN72D95U	5/14/05	33172	60.66	C/S ESC LIGHT CAME ON SCAN TEST FOUND CODE C1513 BRAKE SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH.	CUSTOMER STATES THE ESC LIGHT CAME ON	SSCAN CODE FOR C1513 BRAKE SWITCH MALFUNCTION.	REPLACED BRAKE LIGHT SWITCH.
KM8JN12D76U	9/26/05	13867	60.66	C/S ESC LIGHT COMES ON AND STAYS ON UNTIL VEH SHUTS OFF SCAN TEST FOUND CODE C1513 BRAKE SWITCH DEFECTIVE REPLACED SWITCH CLEARED CODE RE-TEST			
KM8JN72D45U	6/16/05	27058	60.66	C/S ESP LIGHT COMES ON AND STAYS ON UNTIL VEH IS SHUT OFF VERIFIED CONCERN SCAN TEST FOUND CODE C1513 BRAKE SWITCH REPLACED SWITCH CLEARED CODE AND RETESTED			

KM8JN72D66U		11/16/05	23436	35.74	23436 CUST STATES THAT THE ESC LIGHT CAME ON 9999999 INSPECTED AND PULLED CODES FOUND CODE 1513 BRAKE LIGHT SWITCH FOUND TO BE LOOSEING CONTACT INTERMITTANTLY. REPLACED BRAKE LIGHT SWITCH AND CLEARED CODES TEST DROVE NORMAL OPERAITON AFTER REPAIR THANK YO	CUSTOMER STATES THE RIGHT FRONT DOOR HANDLE IS CRACKED INSTALL SOP PART	CUST STATES THAT THERIGHT FRONT DOOR HANDLE IS CRACKED	FRONT DOOR OUTSIDE HANDLEASSY (RH) RE FRONT DOOR OUTSIDE HANDLEASSY (RH) RE 23436 CUST STATES THAT THE RIGHT FRONT DOORHANDLE IS CRACKED 9999999 INSPECTED FOUNDTHAT THE LOCK CYL. COVER WAS CRACKED REPLACEDDOOR HANDLE NORMAL OPERATION AFTER REPAIRTHANK Y
KM8JN72D65U		6/01/05	37949	60.66	C/S ESC LIGHT COMES ON AND OFF SCAN TEST FOUND CODE C1513 BRAKE LAMP SWITCH BAD REPLACED	CUSTOMER STATES ESP LIGHT COMES ON AND OFF.	EPC LIGHT COMING ON VERIFIED CONCERN SCAN TEST C1513 DIAG	FOUND BAD BRAKE LAMP SWITCH. REPLACED SWITCH
KM8JN72D66U		11/16/05	23436	35.74	23436 CUST STATES THAT THE ESC LIGHT CAME ON 9999999 INSPECTED AND PULLED CODES FOUND CODE 1513 BRAKE LIGHT SWITCH FOUND TO BE LOOSEING CONTACT INTERMITTANTLY. REPLACED BRAKE LIGHT SWITCH AND CLEARED CODES TEST DROVE NORMAL OPERAITON AFTER REPAIR THANK YO	CUSTOMER STATES WHEN BRAKING THE ENGINE REVED THE ESC LIGHT CAME ON THE BRAKES WENT TO THE FLLOR AND THE VEHICLE WOULD NOT STOP	CUST STATES THAT THEESC LIGHT CAME ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 23436 CUST STATES THAT THE ESC LIGHT CAME ON9999999 INSPECTED AND PULLED CODES FOUND CODE1513 BRAKE LIGHT SWITCH FOUND TO BE LOOSEINGCONTACT INTERMITTANTLY. REPLACED BRAKE LIGHTSWITCH AND CLEARED CODES T
KM8JN72D66U		11/16/05	23436	35.74	23436 CUST STATES THAT THE ESC LIGHT CAME ON 9999999 INSPECTED AND PULLED CODES FOUND CODE 1513 BRAKE LIGHT SWITCH FOUND TO BE LOOSEING CONTACT INTERMITTANTLY. REPLACED BRAKE LIGHT SWITCH AND CLEARED CODES TEST DROVE NORMAL OPERAITON AFTER REPAIR THANK YO	CUSTOMER STATES THE RIGHT FRONT DOOR HANDLE IS CRACKED INSTALL SOP PART	CUST STATES THAT THERIGHT FRONT DOOR HANDLE IS CRACKED	SUBLET REPAIRS 23436 CUST STATES THAT THE RIGHT FRONT DOORHANDLE IS CRACKED 9999999 INSPECTED FOUNDTHAT THE LOCK CYL. COVER WAS CRACKED REPLACEDDOOR HANDLE NORMAL OPERATION AFTER REPAIRTHANK YOU HAVE A NICE DAY.....KYLE
KM8JN72D76U		11/23/05	15678	37.7	15678 SCANNED FOR DTC'S AND FOUND T1513 BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH DUE TO INTERNAL FAILURE. NORMAL OPERATION AFTER REPAIR	CUSTOMER STATES THE ESC LIGHT KEEPSCOMING ON AND CUST WILL HAVE TO PULL OVER AND TURN CAR OFF AND BACKON FOR THE LIGHT TO GO OUT	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 15678 SCANNED FOR DTC'S AND FOUND T1513BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCHDUE TO INTERNAL FAILURE. NORMAL OPERATIONAFTER REPAIR
KM8JN72D76U		11/23/05	43495	35.74	43495 SCAN TEST CODE C1513 / BRAKE LIGHT SWITCH POOR CONTACTS REPLACE THE BRAKE LIGHT SWITCH AND CLEAR CODE	CUSTOMER STATES THE ESC LIGHT IS ONALL THE TIME	SCAN TEST CODE C1513/ BRAKE LIGHT SWITCH POOR CONTACTS	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 43495 SCAN TEST CODE C1513 / BRAKE LIGHTSWITCH POOR CONTACTS REPLACE THE BRAKELIGHT SWITCH AND CLEAR CODE
KM8JN72D76U		11/23/05	43495	35.74	43495 SCAN TEST CODE C1513 / BRAKE LIGHT SWITCH POOR CONTACTS REPLACE THE BRAKE LIGHT SWITCH AND CLEAR CODE	CUSTOMER STATES THE ESC LIGHT IS ONALL THE TIME	SCAN TEST CODE C1513/ BRAKE LIGHT SWITCH POOR CONTACTS	SCAN TOOL OPERATION SCAN TOOL OPERATION 43495 SCAN TEST CODE C1513 / BRAKE LIGHTSWITCH POOR CONTACTS REPLACE THE BRAKELIGHT SWITCH AND CLEAR CODE
KM8JN72D66U		7/21/05	18016	36.06	18016 SCAN TESTED FOUND C1513 BRAKE LAMP SWITCH SCAN TESTED AND FOUND C1513 BRAKE LAMP SWITCH MALFUNCTION TESTED FOUND POWER AND GROUND AT SWITCH. REPLACED SWITCH AND CLEARED CODE OK AFTER REPAIR	CUSTOMER STATES THE ESC LIGHT STAYSON	SCAN TESTED FOUND C1513 BRAKE LAMP SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 18016 SCAN TESTED FOUND C1513 BRAKE LAMP SWITCH SCAN TESTED AND FOUND C1513 BRAKELAMP SWITCH MALFUNCTION TESTED FOUND POWERAND GROUND AT SWITCH. REPLACED SWITCH ANDCLEARED CODE OK AFTER REPAIR
KM8JN72D66U		7/21/05	17851	26.4	17851 SCAN TESTED AND NO CODES LIGHT IS NOT ON AT THIS TIME SCAN TESTED AND NO CODES.LIGHT IS NOT ON AT THIS TIME	CUSTOMER STATES THE ESC LIGHT INDICATESIT OFF INTERMITTANT	SCAN TESTED AND NO CODES LIGHT IS NOT ONAT THIS TIME	SCAN TOOL OPERATION SCAN TOOL 17851 SCAN TESTED AND NO CODES LIGHT IS NOT ON AT THIS TIME
KM8JN12DX6U		8/16/05	17910	36.06	ESC LIGHT IS ON CODE C1513 BRAKE LAMP SWITCH INOP REPLACED	CUSTOMER STATES THAT ESC LIGHT IS ON CHECK AND ADVISE	C1513 BRAKE SWITCH	REPALCE BRAKE SWITCH
KM8JN12D75U		4/20/05	22712	33.34	STOP LIGHT DONT WORK BRAKE SWITCH REPLACE BRAKE LIGHT SWITCH			
KM8JN12D16U		8/08/05	14765	36.06	ESC LIGHT CAME ON CODES C1513 BRAKE C1237 PRIMARY PRESSURE SENSOR DIGNAL REPAIRED BRAKE SW CODE S FAR AS CODE 1237 PERFORMED TEST REPLACED HECU	ESC LIGHT COMES ON WHILE DRIVING	SCAN TEST CODES C1513 AND C1237	REPLACE BRAKE SWITCH AND CLEAR CODE
KM8JN12D36U		10/17/05	35321	33.34	CODE C1513 BRAKE SWITHC SIGNAL INOP REPLACED SWITCH PEDAL	CUST STATES THAT AT PARKING LOT SPEED AND YOU HIT THE BRAKE PEDAL THE VEH WILL DIE OUT. INTERMITTANT, NOTE: CRUISE WAS IN THE ON POSITION, AND WHEN TURNED OFF IT MAY HAVE GONE AWAY ??	CODE C1513 BRAKE SWITCH SIGNAL	REPLACED BRAKE SWITCH PEDAL.
KM8JN12D36U		10/17/05	35321	33.34	CODE C1513 BRAKE SWITHC SIGNAL INOP REPLACED SWITCH PEDAL	AIR GAB RECALL	CAMPAIGN 079	REPLACED AIR BAG COVER AS PER CAMPAIGN.
KM8JN12D36U		10/17/05	35321	33.34	CODE C1513 BRAKE SWITHC SIGNAL INOP REPLACED SWITCH PEDAL	CUST STATES THAT THERE IS A CRUNCH NOISE IN THE FRONT SUSP GOING OVER BUMPS.	UNKNOWN AT THIS TIME.	LUBED ALL BUSHING AND STEERING SHAFT.
KM8JM12B86U		7/12/05	25000	36.94	25000 SCANNED COMPUTER AND FOUND C1513 BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH. COMPLETED	CUST STATES THE TPS LIGHT IS ON SOPIN	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 25000 SCANNED COMPUTER AND FOUND C1513BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH. COMPLETED

KM8JN12D56U	9/16/05	25363	37.26	25364 C1513 TTOAL 1988 .2 RPL THE BRK LAMP SWICTH	CUST STATES ESC LIGHT COMES ON	ESC LIGHT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 25364 C1513 TTOAL 1988 .2 RPL THE BRK LAMP SWICTH
KM8JN12D65U	4/13/05	14603	36.94	BAD BRAKE LIGHT SWITCH REPLACED	DRIVER AIR BAG MODULE REPLACEMENT	CPN	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT
KM8JN12D65U	4/13/05	14603	36.94	BAD BRAKE LIGHT SWITCH REPLACED	CUST STATES THE ESC LIGHT KEEPS COMING ON	BAD BRAKE SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D86U	9/28/05	16915	36.94	16915 SCANNED COMPUTER AND FOUND C1513 BRAKE LAMP SWITCH. REPLACED THE SWITCH DUE TO IT BEING BAD	DRIVER AIR BAG MODULE REPLACEMENT	CAMPAIGN	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 16915 COMPLETED
KM8JN12D86U	9/28/05	16915	36.94	16915 SCANNED COMPUTER AND FOUND C1513 BRAKE LAMP SWITCH. REPLACED THE SWITCH DUE TO IT BEING BAD COMPLETED	CUST STATES ESC LIGHT COMES ON AND OFF	ESC LIGHT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 16915 SCANNED COMPUTER AND FOUND C1513BRAKE LAMP SWITCH. REPLACED THE SWITCH DUE TOIT BEING BAD COMPLETED
KM8JN12D36U	7/15/05	27059	37.26	27060 BAD BRAKE LIGHT SWITCH SCANNED FOR CODES AND FOUND C1513 BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE. C15 & N69	CUST STATES THE ESC LIGHT KEEPS COMING ON AND OFF	ESC LIGHT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 27060 BAD BRAKE LIGHT SWITCH SCANNED FORCODES AND FOUND C1513 BRAKE LIGHT SWITCH.REPLACED BRAKE LIGHT SWITCH AND CLEARED CODE.C15 & N69
KM8JN12DX6U	1/12/06	11707	27.6	11707 BRAKE SWITCH WAS NOT ADJUSTED. COMPLETED CAR DRIVES FINE AFTER TEST DRIVING CAR.	CUST STATES HAD VEHICLE TOWED IN,BRAKES TIGHT,AND ESC LIGHT COMING ON	ADJUSTED BRAKE SWITCH	ADJUSTED BRAKE SWITCH GENERIC MAJOR MAINTENANCE 11707 BRAKE SWITCH WAS NOT ADJUSTED.COMPLETED CAR DRIVES FINE AFTER TEST DRIVINGCAR.
KM8JN12DX5U	6/11/05	18171	36.94	18171 CODE C1513 BRAKE LAMP SWITCH REPLACE BRAKE LAMP SWITCH	DRIVER AIR BAG MODULE REPLACEMENT	CAMPAIGN	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 18171 DID REPLACEMENT
KM8JN12DX5U	6/11/05	18171	36.94	18171 CODE C1513 BRAKE LAMP SWITCH REPLACE BRAKE LAMP SWITCH	CUST STATES ESP LIGHT COMES ON AND OFF	ESP LIGHT ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 18171 CODE C1513 BRAKE LAMP SWITCH REPLACEBRAKE LAMP SWITCH
KM8JN12D65U	4/13/05	20855	37.26	20855 SCAN COMPUTER FOR CODES I GOT C 1513 BRAKE LAMP SWITCH. SO I REPLACE THE BRAKE LAMP SWITCH AND IT IS WORKING FIND.N-66 C-40. COMPLETED	CUST STATES ESC LIGHT KEEPS COMING ON	ESC LIGHT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 20855 SCAN COMPUTER FOR CODES I GOT C 1513BRAKE LAMP SWITCH. SO I REPLACE THE BRAKELAMP SWITCH AND IT IS WORKING FIND.N-66 C-40.COMPLETED
KM8JN12D46U	1/13/06	13207	37.26	13210 HOOKED UP SCAN TOOL AND FOUND ONE CODE C1513 BRAKE LAMP SWITCH ERASED CODE AND PUT IN NEW BRAKE LAMP SWITCH UNDER WARRANTY NOW BRAKE LIGHTS ARE WORKING PROPERLY N66,C15 COMPLETED	CUST STTAE THE ESC LIGHT IS ON	F	GENERIC MINOR MAINTENANCE GENERIC MINOR MAINTENANCE 13210 HOOKED UP SCAN TOOL AND FOUND ONE CODEC1513 BRAKE LAMP SWITCH ERASED CODE AND PUTIN NEW BRAKE LAMP SWITCH UNDER WARRANTY NOWBRAKE LIGHTS ARE WORKING PROPERLY
KM8JN12DX6U	1/12/06	11697	38.9	11697 SCANED COMPUTER AND FOUND A CODE C1513 BRAKE LAMP SWITCH REPLACED BRAKE LIGHT SWITCH. COMPLE TED	CUST STATES ESC LIGHT ON CK AND ADV	SCANNED FOUND CODE C1513 REPLACED BRAKE LIGHT SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 11697 SCANED COMPUTER AND FOUND A CODEC1513 BRAKE LAMP SWITCH REPLACED BRAKE LIGHTSWITCH. COMPLE TED
KM8JN12D06U	7/19/05	14714	36.94	14714 CODE C1513 BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH	DRIVER AIR BAG MODULE REPLACEMENT	CAMPAIGN	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 14714 DID REPLACEMENT
KM8JN12D06U	7/19/05	14714	36.94	14714 CODE C1513 BRAKE LAMP SWITCH REPLACED BRAKE LAMP SWITCH	CUST STATES ESC LIGHT FLASHES ON AND OFF	ESC LIGHT FLASHING	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 14714 CODE C1513 BRAKE LAMP SWITCH REPLACEDBRAKE LAMP SWITCH
KM8JN72DX6U	7/21/05	33802	36.94	33802 SCAN COMPUTER FOR CODES C1513 BRAKE LAMP SWITCH. SO I REPLACE THE BRAKE SWTICH.COMPLETED	DRIVER AIR BAG MODULE REPLACEMENT	RECALL	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 33802 COMPLETED
KM8JN72DX6U	7/21/05	33802	36.94	33802 SCAN COMPUTER FOR CODES C1513 BRAKE LAMP SWTICH. SO I REPLACE THE BRAKE SWITCH.COMPLETED	CUST STATES ESC LIGHTS COMES ON ANDOFF	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 33802 SCAN COMPUTER FOR CODES C1513 BRAKELAMP SWTICH. SO I REPLACE THE BRAKESWTICH.COMPLETED
KM8JM12B36U	7/12/05	24024	37.26	24024 C1513 93810ROO(.3)93810RPO(.3)TOTAL 1988 .6 RPL THE BRK LAMP SWICTH	CUST STATES THE ESC LIGHT COMES ON	ESC LIGHT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 24024 C1513 93810ROO(.3)93810RPO(.3)TOTAL1 988 .6 RPL THE BRK LAMP SWICTH
KM8JN12D25U	5/03/05	38794	36.94	38794 CHECK ENG LITE ON CODEC1513 BRAKE LITE SWITCH LAMP SWITCH REPLACE BRAKE LITE SWITCH	CUST STATES ESP LIGHT COMES AND STAYS ON	ESP LIGHT	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 38794 CHECK ENG LITE ON CODEC1513 BRAKE LITESWITCH LAMP SWITCH REPLACE BRAKE LITE SWITCH
KM8JM12B66U	7/22/05	7661	38.9	7661 FAULTY BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH	CUST STATES THERE IS A PEE SMELL WHEN YOU TURN THE FAN ON AND THE THE A/C	DEODERIZED AC**ENVIRONMENTAL ONE TIME GOODWILL**	AIR CONDITIONER EVACUATE & CHARGE AIR CONDITIONER EVACUATE & CHARGE 7661 DEODERIZE
KM8JM12B66U	7/22/05	7661	38.9	7661 FAULTY BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH	CUST STATES THE ESC LIGHT IS ON	BRAKE LIGHT SWITCH FAULTY	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 7661 FAULTY BRAKE LIGHT SWITCH REPLACE BRAKELIGHT SWITCH

KM8JM12B06U		7/12/05	23536	37.26	23537 BRAKE LIGHT SWITCH IS BAD SCANNED FOR CODES AND FOUND C1513 BRAKE LAMP SWITCH. REPLACED BRAKE LIGHT SWITCH	DRIVER AIR BAG MODULE REPLACEMENT	RECALL	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 23537 CAMPAIGN 079 618046R0 REPLACED DRIVERAIRBAG MODULE COVER
KM8JM12B06U		7/12/05	23536	37.26	23537 BRAKE LIGHT SWITCH IS BAD SCANNED FOR CODES AND FOUND C1513 BRAKE LAMP SWITCH. REPLACED BRAKE LIGHT SWITCH	CUST STATES THE ESC LIGHT COMES ON	ESC LIGHT	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 23537 BRAKE LIGHT SWITCH IS BAD SCANNED FORCODES AND FOUND C1513 BRAKE LAMP SWITCH.REPLACED BRAKE LIGHT SWITCH
KM8JN12D16U		9/27/05	23284	36.94	23284 SCAN THE COMPUTER FOR CODES C 1513 BRAKE LAMP SWITCH. SO I REPLACE THE BRAKE LAMP SWITCH AND IT IS WORKING FIND. COMPLETED	CUST STATES ESC LIGHT OFF IS ON	C1513	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 23284 SCAN THE COMPUTER FOR CODES C 1513BRAKE LAMP SWITCH. SO I REPLACE THE BRAKELAMP SWITCH AND IT IS WORKING FIND. COMPLETED
KM8JN12D66U		10/06/05	36421	37.26	36421 SCANNED COMPUTER FOUND CODE C1513 BRAKE LAMP SWITCH. REPLACED SWITCH. COMPLETED	CUST STATES ENGINE LIGHT IS ON,S.O.P.	P0139	OXYGEN SENSOR ASSY LH (UP) RE OXYGEN SENSOR ASSY LH (UP) RE 36421 SCANNED COMPUTER FOUND CODE P0139 O2SENSOR SLOW RESPONSE. REPLACED O2 AND CAR ISRUN FINE COMPLETED
KM8JN12D66U		10/06/05	36421	37.26	36421 SCANNED COMPUTER FOUND CODE C1513 BRAKE LAMP SWITCH. REPLACED SWITCH. COMPLETED	CUST STATES ENGINE LIGHT IS ON,S.O.P.	P0139	OXYGEN SENSOR ASSY (LH) ADD SCAN TOOL OPERATION OXYGEN SENSOR ASSY (LH) ADD SCAN TOOL OPERATION 36421 SCANNED COMPUTER FOUND CODE P0139 O2SENSOR SLOW RESPONSE. REPLACED O2 AND CAR ISRUN FINE COMPLETED
KM8JN12D66U		10/06/05	36421	37.26	36421 SCANNED COMPUTER FOUND CODE C1513 BRAKE LAMP SWITCH. REPLACED SWITCH. COMPLETED	CUST STATES ESC LIGHT IS ON	C1513	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 36421 SCANNED COMPUTER FOUND CODE C1513BRAKE LAMP SWITCH. REPLACED SWITCH. COMPLETED
KM8JM12B75U		6/16/05	16123	38.9	SCAN COMPUTER FOR CODES C1513 STORED BAD BRAKE LIGHT SWITCH REPLACED SWITCH	CUST STATES ESP IS MALFUNCTIONING		STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 16123 SCAN COMPUTER FOR CODES C1513 STOREDBAD BRAKE LIGHT SWITCH.REPLACE
KM8JM12B75U		6/16/05	16123	38.9	SCAN COMPUTER FOR CODES C1513 STORED BAD BRAKE LIGHT SWITCH REPLACED SWITCH	CUST STATES WARRANTY LOANER	LOANER	SUBLET REPAIRS 16123
KM8JM12B75U		6/16/05	16123	38.9	SCAN COMPUTER FOR CODES C1513 STORED BAD BRAKE LIGHT SWITCH REPLACED SWITCH	CUST STATES WARRANTY LOANER	LOANER	WARRANTY/MAINTENANCE LOANER CAR WARRANTY/MAINTENANCE LOANER CAR 16123
KM8JM12B97U		9/08/06	11253	18.4	11253 BRAKE LITES STAYS ON ADD. BRAKE LITE SWITCH.			
KM8JM12B75U		6/16/05	33052	36.94	33052 C1513 TOTAL 1988 .4 RPL THE BRK PEDAL SWICHT	CUST STATES THE VEH WILL NOT START	NO START	BATTERY ASS'Y RE BATTERY ASS'Y RE 33052 LOW VOLT BATTERY37110ROO(.3)37110RPO(.1)TOTAL 1988 .4 RPL
KM8JM12B75U		6/16/05	33052	36.94	33052 C1513 TOTAL 1988 .4 RPL THE BRK PEDAL SWICHT	CUST STATES THE VEH WILL NOT START	NO START	BATTERY ASSEMBLY ADD SCANTOOL OPERATION BATTERY ASSEMBLY ADD SCANTOOL OPERATION 33052 LOW VOLT BATTERY37110ROO(.3)37110RPO(.1)TOTAL 1988 .4 RPL
KM8JM12B75U		6/16/05	33052	36.94	33052 C1513 TOTAL 1988 .4 RPL THE BRK PEDAL SWICHT	CUST STATES THE ESP LIGHT IS ON	ESP LIGHT ON	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 33052 C1513 TOTAL 1988 .4 RPL THE BRK PEDALSWICHT
KM8JM12B26U		11/19/05	5527	38.9	5533 C1513 32002A00(.2)TOTAL 1988 .2 RPL THE BRK LAMP SWICHT BECUASE WHILE ON THE TEST DRIVE THE ESC LIGHT CAME ON THEN AT THE NEXT TRAFFIC LIGHT I TURN ENGINE OFF TWO SECOND TIRN BACK ON LIGHT WHEN OFF RETURN TO SHOP CHEC FOR CODES FOUND C1513 RPL THE SW	CUST STATES THE CHECK ENGINE LIGHT IS ON	SCANNED AND FOUND CODE P0139	SCANNED AND FOUND CODE P0139 39210RPO(.3)TOTAL 1988 .3 CHECKFOR TSB DID NOT FIND ANY PERTENING TO THISCODE.THEN I CALL TECH LINE SPOKE TO JAMESCS#251708.HE ASK ME TO CHECK FOR EXHAUSTLEAKS DID
KM8JM12B26U		11/19/05	5527	38.9	5533 C1513 32002A00(.2)TOTAL 1988 .2 RPL THE BRK LAMP SWICHT BECUASE WHILE ON THE TEST DRIVE THE ESC LIGHT CAME ON THEN AT THE NEXT TRAFFIC LIGHT I TURN ENGINE OFF TWO SECOND TIRN BACK ON LIGHT WHEN OFF RETURN TO SHOP CHEC FOR CODES FOUND C1513 RPL THE SW	CUST STATES THE ESC LIGHT IS ON	REPLACED BRAKE LIGHTSWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 5533 C1513 32002A00(.2)TOTAL 1988 .2 RPL THEBRK LAMP SWICHT BECUASE WHILE ON THE TESTDRIVE THE ESC LIGHT CAME ON THEN AT THE NEXTTRAFFIC LIGHT I TURN ENGINE OFF TWO SECONDTIRN BACK ON LIGHT WHEN OFF RETU
KM8JM12B35U		6/14/05	17348	37.26	17350 HOOKED UP SCAN TOOL AND FOUND ONE CODE C1513 BRAKE LAMP SWITCH ERASED CODE AND PUT IN NEW BRAKE LAMP SWITCH UNDER WARRANTY TEST DROVE VEHICLE AND LIGHT DIDN'T COME BACK ON COMPLETED	CUST STATES ESP LIGHT STAYS ON	ESC LIGHT ON	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 17350 HOOKED UP SCAN TOOL AND FOUND ONE CODEC1513 BRAKE LAMP SWITCH ERASED CODE AND PUTIN NEW BRAKE LAMP SWITCH UNDER WARRANTY TESTDROVE VEHICLE AND LIGHT DIDN'T COME BACK ONCOMPLETED
KM8JM12B26U		7/19/05	14315	38.9	14315 CODE C1513 BRAKE LIGHT SWITCH REPLACE BRAKE LIGHT SWITCH	CUST STATES ESC LIGHT COMES ON AND DOES NOT GO OFF	BAD BRAKE LIGT SWITCH	STOP LAMP SWITCH ASS'Y RE STOP LAMP SWITCH ASS'Y RE 14315 CODE C1513 BRAKE LIGHT SWITCH REPLACEBRAKE LIGHT SWITCH

KM8JM12B56U		7/21/05	21916	37.26	21916 SCANNED COMPUTER FOUND CODE C1513 BRAKE LAMP SWITCH. REPLACED SWITCH. COMPLETED	CUST STATES ESC LIGHT KEEPS COMING ON	ESC LIGHT ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 21916 SCANNED COMPUTER FOUND CODE C1513BRAKE LAMP SWITCH. REPLACED SWITCH. COMPLETED
KM8JN12D96U		1/13/06	10646	36.94	10648 HOOKED UP SCAN TOOL AND FOUND ONE CODE B1513 BRAKE LAMP SWITCH ERSED CODE PUT IN NEW BRAKE LAMP SWITCH UNDER WARRANTY TEST DROVE VEHICLE AND CODES DIDN'T COME BACK UP COMPLETED	CUST STATES AT TIMES ESC OFF LIGHT COMES ON	ESC LIGHT ON	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 10648 HOOKED UP SCAN TOOL AND FOUND ONE CODEB1513 BRAKE LAMP SWITCH ERSED CODE PUT IN NEWBRAKE LAMP SWITCH UNDER WARRANTY TEST DROVEVEHICLE AND CODES DIDN'T COME BACK UPCOMPLETED
KM8JN12D96U		10/13/05	41661	37.26	41661 ESC CHECK ENG LITE ON CODE C1513 N69 REPLACE BRAKE LITE SWITCH R3SET CODE C15.	CUST STATES THE ESC LIGHT IS ON	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 41661 ESC CHECK ENG LITE ON CODE C1513 N69REPLACE BRAKE LITE SWITCH R3SET CODE C15.
KM8JN12D25U		6/13/05	21954	36.94	21954 C1513 C 1237 P0455 93810ROO(,3)93810RPO(,3)TOTAL 1988 .6 RPL THE BRK PEDAL SWITH RAN SELF EVAP LEAK TEST IT PASS AT 6SECONDS	CUST STATES THE CHECK ANGINE LIGHT IS ON AND THE ESP LIGHT GOES ON ANDOFF	INOP	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 21954 C1513 C 1237 P045593810ROO(,3)93810RPO(,3)T OTAL 1988 .6 RPL THEBRK PEDAL SWITH RAN SELF EVAP LEAK TEST ITPASS AT 6SECONDS
KM8JM12B06U		10/04/05	22251	36.94	22252 CODE C1513 BAD BRAKE LIGHT SWITCH SCANNED FOR CODES AND FOUND C1611 CAN TIMEOUT- EMS AND C1513 BRAKE LAMP SWITCH. CLEARED CODES AND REPLACED THE BRAKE LAMP SWITCH	CUST STATES THE ESC LIGHT IS ON	WAR	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 22252 CODE C1513 BAD BRAKE LIGHT SWITCHSCANNED FOR CODES AND FOUND C1611 CANTIMEOUT- EMS AND C1513 BRAKE LAMP SWITCH.CLEARED CODES AND REPLACED THE BRAKE LAMPSWITCH
KM8JN12D96U		2/20/06	22816	36.94	22818 FOUND ESC LIGHT ON HOOKED UP SCAN TOOL AND FOUND ONE CODE C1513 BRAKE LAMP SWITCH UNDER WARRANTY ERASED CODE TEST DROVE VEHICLE AND THE LIGHT DIDN'T COME BACK ON COMPLETED	DRIVER AIR BAG MODULE REPLACEMENT	RECALL	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT 22818 DRIVER AIR BAG MODULE REPLACEMENT PUTIN NEW DRIVER AIR BAG MODULE UNDER WARRANTYCOMPLETED
KM8JN12D96U		2/20/06	22816	36.94	22818 FOUND ESC LIGHT ON HOOKED UP SCAN TOOL AND FOUND ONE CODE C1513 BRAKE LAMP SWITCH UNDER WARRANTY ERASED CODE TEST DROVE VEHICLE AND THE LIGHT DIDN'T COME BACK ON COMPLETED	CUST STATES THE ESC LIGHT IS ON	WAR	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 22818 FOUND ESC LIGHT ON HOOKED UP SCAN TOOLAND FOUND ONE CODE C1513 BRAKE LAMP SWITCHPUT IN NEW BRAKE LAMP SWITCH UNDER WARRANTYERASED CODE TEST DROVE VEHICLE AND THE LIGHTDIDN'T COME BACK ON COMPLETED
KM8JN12D26U		10/07/05	8887	38.9	8889 BRAKE SWITCH IS NOT WORKING NEED TO BE REPACE WITH NEW, REPLACE PART S AND TEST DROVE AND CHECK REAR LIGHTS, WORKS FINE NOW, ECS LIGTH IS NOW OFF COMPLETED	CUST STATES THE ESC LIGHT IS ON ANDTHE BRAKE LIGHTS DO NOT WORK	BAD SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 8889 BRAKE SWITCH IS NOT WORKING NEED TO BEREPACE WITH NEW, REPLACE PART S AND TESTDROVE AND CHECK REAR LIGHTS, WORKS FINE NOW,ECS LIGTH IS NOW OFF COMPLETED
KM8JM12B86U		8/25/05	16700	38.9	16700 CUST STATES ESC LIGHT IS ON SCAN COMPUTER FOR CODES ONE FIND IS C1513 BRAKE LAMP SWITCH. SO I REPLACE IT WITH A NEW ONE.	CUST STATES ESC LIGHT IS ON	BAD SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 16700 CUST STATES ESC LIGHT IS ON. SCANCOMPUTER FOR CODES ONE FIND IS C1513 BRAKELAMP SWITCH. SO I REPLACE IT WITH A NEW ONE.
KM8JM12B26U		7/11/05	28125	36.94	28135 BAD BRAKE LIGHT SWITCH SCANNED FOR CODES AND FOUND C1513 BRAKE LAMP SWITCH. REPLACED BRAKE LAMP SWITCH	CUST STATES THE ESC LIGHT IS ON	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 28135 BAD BRAKE LIGHT SWITCH SCANNED FORCODES AND FOUND C1513 BRAKE LAMP SWITCH.REPLACED BRAKE LAMP SWITCH
KM8JN12D26U		8/08/05	31267	37.26	31267 SCAN THE COMPUTER FOR CODES I GOT C1513 BRAKE LAMP SWITCH. SO I REPLACE THE BRAKE LAMP SWITCH ANSD IT IS WORKING FIND.N-51,C-15 COMPLETED			
KM8JN12D46U		8/19/05	28051	38.9	SWITH ON PEDAL ERASE CODE TEST DROVE VEHICLE NO ESP OFF LIGHT ANY MORE OR CODE DID NOT RETUR N.	CUST STATES((ESC OFF) LIGHT IS ON	SWITCH INOP	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 28053 C1513 BRK LAMP SWICHTH93810ROO(,3)93810RPO(,3)TOTAL 1988 .6 CHECKFOR CODES FOUND C1513 RPL THE BRK LAMP SWICHTON PEDAL ERASE CODE TEST DROVE VEHICLE NO ESPOFF LIGHT ANY MORE OR CODE DID NOT RETUR N.
KM8JN12D46U		8/19/05	28051	38.9	SWITH ON PEDAL ERASE CODE TEST DROVE VEHICLE NO ESP OFF LIGHT ANY MORE OR CODE DID NOT RETUR N.	WARRANTY/MAINTENANCE LOANER CAR	LOANER	SUBLET REPAIRS
KM8JN12D46U		8/19/05	28051	38.9	SWITH ON PEDAL ERASE CODE TEST DROVE VEHICLE NO ESP OFF LIGHT ANY MORE OR CODE DID NOT RETUR N.	WARRANTY/MAINTENANCE LOANER CAR	LOANER	WARRANTY/MAINTENANCE LOANER CAR WARRANTY/MAINTENANCE LOANER CAR

KM8JM12B86U	9/02/05	23963	37.26	23966 HOOKED UP SCAN TOOL AND FOUND ONE CODE C1513 BRAKE LAMP SWITCH ERASED CODE AND PUT IN NEW BRAKE LAMP SWITCH UNDER WARRANTY COMPLETED	CUST STATES ESC LIGHT IS ON	C1513	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 23966 HOOKED UP SCAN TOOL AND FOUND ONE CODE C1513 BRAKE LAMP SWITCH ERASED CODE AND PUT IN NEW BRAKE LAMP SWITCH UNDER WARRANTY COMPLETED
KM8JN12D86U	4/07/06	7624	38.9	7624 CUST STATES THE ESC LIGHT STAYS ON SCAN COMPUTER FOR CODES I GOT BRAKE LAMP SWITCH . IT WAS SHORTED OUT THAT WHY I REPLACE IT.	CUST STATES THE ESC LIGHT STAYS ON	BRAKE LAMP SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 7624 CUST STATES THE ESC LIGHT STAYS ON SCANCOMPUTER FOR CODES I GOT BRAKE LAMP SWITCH .IT WAS SHORTED OUT THAT WHY I
KM8JN12D26U	8/08/05	11675	66.5	11675 SCAN COMPUTER FOR CODES C1513 STORED BAD BRAKE LIGHT SWITCH,REPLACE SWITCH	CUST STATES ECS LIGHT COMES ON AND OFF AT TIMES	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 11675 SCAN COMPUTER FOR CODES C1513 STOREDBAD BRAKE LIGHT SWITCH,REPLACE
KM8JN12D26U	8/08/05	11675	66.5	11675 SCAN COMPUTER FOR CODES C1513 STORED BAD BRAKE LIGHT SWITCH,REPLACE SWITCH	CUST STATES ECS LIGHT COMES ON AND OFF AT TIMES	F	RESET TCS LIGHT GENERIC MINOR MAINTENANCE 11675 SCAN COMPUTER FOR CODES C1513 STOREDBAD BRAKE LIGHT SWITCH REPLACE SWITCH
KM8JM12BX5U	6/13/05	9552	38.9	9552 BRAKE LAMP SWITCH BAD SCANNED FOR CODES. GIVEN CODE C1611 CAN TIMEOUT EMS AND CODE C1513 BRAKE LAMP SWITCH. CLEARED CODES. REPLACED BRAKE LAMP SWITCH	CUST STATES ESP LIGHT IS ON, ON THE DASH BOARD	BRAKE LAMP SWITCH INOP	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 9552 BRAKE LAMP SWITCH BAD SCANNED FOR CODES. GIVEN CODE C1611 CAN TIMEOUT EMS AND CODE C1513 BRAKE LAMP SWITCH. CLEARED CODES.REPLACED BRAKE LAMP SWITCH
KM8JM12B35U	6/16/05	43640	37.26	43645 BRAKE LAMP SWITCH BAD SCANNED FOR CODES AND FOUND C1237 PRESSURE SENSOR-OTHER AND C1513 BRAKE LAMP SWITCH. REPLACED THE BRAKE LAMP SWITCH AND CLEARED CODE TEST DROVE CAR AND ESP LIGHT DID NOT COME BACK ON N69 AND C15			
KM8JM12B95U	5/17/05	47289	36.94	47289 SCAN COMPUTER FOR CODES C1513 STORED BRAKE SWITCH BAD REPLACE SWITCH	CUST STATES THE ESP LIGHT COMES ON AND THEN TURNS OFF	WAR	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 47289 SCAN COMPUTER FOR CODES C1513 STOREDBRAKE SWITCH BAD REPLACE SWITCH
KM8JN12D26U	11/16/05	17979	34.24	CUSTOMER STATES THAT SHE CAME IN BACK IN MAY DUE TO ESC LIGHT ON CUSTOMER STATES LIGHT STILL IS ON WHEN DRIVING CHECK AND ADVISE OPEN CIRCUIT REPLACED BRAKE PEDAL SWITCH FOUND BRAKE SWITCH TO BE FAILED REPLACED AND TEST DROVE RECHECKED FOR DTC VEH IS NOW			
KM8JN12D46U	9/15/05	30417	34.24	30417 ESC LIGHT COMES ON AND OFF 93810R00,N69,C15 .3 DIAGNOSED THE TROUBLE CODE,C1513 BRAK LAMP SWITH.PERFORMED TESTING AND REPLACED THE BRAKE LAMP SWITH ASSY.			
KM8JN12D95U	7/01/05	42137	36.2	42137 C1513 BRAKE LAMP SWITCH. 93810R00 -- N94 C15 .3 BRAKE LAMP SWITCH INTERMITTENTLY INOP. REPLACED SWITCH AND VERIFIED REPAIR.	CUST STATES "ESC OFF" COMES ON AT DASH INTERMITTENTLY- ONCE IN PARKING GARAGE AND ONCE IN RAIN- PUSHING BUTTON DOES NOTHING- RESTART CAR ONCE OR TWICE TO GET LIGHT TO GO OFF	BRAKE LIGHT SWITCH INTERMITTENT OPERATION	REPLACE BRAKE PEDAL SWITCH REPLACE BRAKE PEDAL SWITCH 42137 C1513 BRAKE LAMP SWITCH. 93810R00 --N94 C15 .3 BRAKE LAMP SWITCH INTERMITTENTLY INOP. REPLACED SWITCH AND VERIFIED REPAIR.
KM8JN12D95U	7/01/05	42137	36.2	42137 C1513 BRAKE LAMP SWITCH. 93810R00 -- N94 C15 .3 BRAKE LAMP SWITCH INTERMITTENTLY INOP. REPLACED SWITCH AND VERIFIED REPAIR.	CUST STATES GOING UP AN INCLINE- HAS TO LET OFF GAS TO GET IT TO SHIFT- CHECK AND ADVISE	TEST AS REQUIRED NO FAULT OR CODES RECOGNIZED, OPERATION TO SPECIFICATIONS	TEST DROVE . FOUND NORMAL OPERATION, NO TROUBLE CODES FOUND TEST DROVE . FOUND NORMAL OPERATION, NO TROUBLE CODES FOUND 42137 TEST DROVE, NORMAL OPERATION. 95440R00-- N74 C98 .3 NO PROBLEM FOUND, NO TROUBLE CODES STORED. DELAYED SHIFT CAUSED BY GREATER LOAD ON POWER
KM8JN12D56U	2/24/06	10778	59.14	10778 BRAKE LIGHT SWITCH 93810R00 .3 93810R00 .3 .60 PERFORM ESC/ABS DIAG USING SCAN TOOL. C1513 CODE CHECKED OPERATION OF BRAKE LIGHT SWITCH. SWITCH INOP- REPLACE SWITCH			
KM8JM12B36U	9/23/05	7412	36.2	7412 C1513 BRAKE LITE SWITCH 93810R00 93810RPO N94 C15 .3. .3 SCANNED FOR CODES AND FOUND C1513 REPLACED BRAKE LIGHT SWITCH DUE TO SHORT AND VERIFIED REPAIR	CUSTOMER STATES ESC LIGHT COMES AND STAYS ON...CHECK/ADVISE	C1513 BRAKE SWITCH SHORTED	SCAN TOOL USAGE REPLACED CRUISE CONTROL BRAKE SWITCH 7412 C1513 BRAKE LITE SWITCH 93810R00 93810RPO N94 C15 .3. .3 SCANNED FOR CODES AND FOUND C1513 REPLACED BRAKE LIGHT SWITCH DUE TO SHORT AND VERIFIED REPAIR

KM8JM12B36U	9/23/05	7412	36.2	7412 C1513 BRAKE LITE SWITCH 93810R00 93810RPO N94 C15 .3.3 SCANNED FOR CODES AND FOUND C1513 REPLACED BRAKE LIGHT SWITCH DUE TO SHORT AND VERIFIED REPAIR	CUSTOMER STATES ESC LIGHT COMES AND STAYS ON...CHECK/ADVISE	C1513 BRAKE SWITCH SHORTED	REPLACE BRAKE LIGHT PEDAL SWITCH 7412 C1513 BRAKE LITE SWITCH 93810R00 93810RPO N94 C15 .3.3 SCANNED FOR CODES AND FOUND C1513 REPLACED BRAKE LIGHT SWITCH DUE TO SHORT AND VERIFIED REPAIR
KM8JN12DX6U	10/04/05	20235	34.24	20235 C1513 BRAKE SWITCH 93810R00 N94 C15 .30 REPLACED BRAKE SWITCH, PER MATT'S DIAG	CUST. STATES WHEN DRIVING DOWN ROAD VEHICLE CUT OFF AND STALLS OUT...CHECK AND ADV. SEE HISTORY	BRAKE SWITCH FAILURE	REPLACE BRAKE PEDAL SWITCH 20235 C1513 BRAKE SWITCH 93810R00 N94 C15 .30 REPLACED BRAKE SWITCH, PER MATT'S DIAG
KM8JM12BX6U	10/06/05	41453	34.56	41453 SWITCH 93810R00 .3 PERFORM ABS DIAG- C1513 REPLACED BRAKE LIGHT SWITCH			
KM8JN12D77U	12/27/06	2372	34.56	CUSTOMER STATES THAT ESC LIGHT COMES ON AND OFF CHECK AND ADVISE 2372 BRAKE LAMP SWITCH INOP 93810R00-N94-C15 .30 PULLED CODE FROM GDS AND FOUND BRAKE LAMP SWITCH INOP REPLACED SWITCH AND CLEARED CODE BRAKE LIGHT SWITCH WORKS PROPERLY NOW			
KM8JN12D46U	11/10/05	18718	31.54		CUSTOMER STATES THEY HAVE BRAKE PROBLEM ESC LIGHT IS ON C1513 SOP ARE IN	C1513 BRAKE LIGHT SWITCH MALFUNCTION	REPLACED BRAKE LIGHT SWITCH
KM8JM12B15U	6/03/05	14407	31.54		CUSTOMER STATES ESP LIGHT IS ON	C1513 BRAKE LIGHT SWITCH FAILURES ESP WONT ENGAGE	REPLACED BRAKE LIGHT SWITCH
KM8JN12D25U	9/18/04	23047	33.82		ESP LIGHT SAYS OFF HAD IT REPROGRAMMED THE OTHER DAY	C1513 BRAKE LAMP SWITCH BAD SWITCH REPLACE BRAKE LAMP SWITCH	COMPLETE
KM8JN12D25U	9/18/04	23047	33.82		SOP IN CD PLAYER	REPLACED CD PLAYER	COMPLETE
KM8JN12D76U	11/17/05	8852	33.5		CUSTOMER STATES THEY HAVE BRAKE PROBLEM ESC LIGHT KEEPS COMING ON, SOP IS HERE	CODE C1513, BRAKE LAMP SWITCH FAILURE, FOUND BRAKE LIGHT SWITCH SHORTED	REPLACED BRAKE LIGHT SWITCH, CLEARED CODES AND RETESTED
KM8JM12B15U	4/27/05	23454	31.86		CUSTOMER STATES THEY HAVE A STEERING CONCERN. ESC LIGHT COMES ON AT TIMES SEE ADVISOR	C1513 BRAKE LIGHT SWITCH BAD	REPLACED BRAKE LIGHT SWITCH
KM8JN12DX5U	3/04/05	19758	31.26		CUSTOMER STATES CHECK ENGINE LIGHT ON STALLING SOMETIMES	CODCE C1315 FOUND BRAKE LIGHT SWITCH SHORTED INTERNALLY	REPLACED BRAKE LIGHT SWITCH AND CLEARED CODES, RETESTED
KM8JN12D86U	11/06/05	24233	33.5		CUSTOMER STATES THEY HAVE A WHEEL/TIRE CONCERN ESC LIGHT COMING ON, SOP HERE	FOUND BRAKE LIGHT SWITCH SHORTED INTERNALLY	REPLACED BRAKE LIGHT SWITCH AND RETESTED
KM8JN12D86U	11/06/05	24233	33.5		CUSTOMER STATES CENTER CONSOLE CUP HOLDER LOOSE SOP HERE	FOUND CUP HOLDER COMING APART AND NOT HOLDING CUPS IN PLACE DEFORMED	REPLACED CUP HOLDER
KM8JN12DX6U	11/04/05	32299	31.86		CUSTOMER STATES BRAKE LIGHTS STAY ON AT TIMES	VERIFIED CONCERN FOUND BRAKE LIGHT SWITCH INTERNAL FAILURE	REPLACED BRAKE LIGHT SWITCH
KM8JN12DX6U	11/04/05	22108	30.15		CUSTOMER STATES CHECK ENGINE LIGHT ON CODE C1315, BRAKE LIGHT SWITCH	C1315 BRAKE LIGHT FAILING INTERNAL FAILURE	REPLACED BRAKE LIGHT SWITCH
KM8JM12B86U	7/11/05	32552	31.54		CUSTOMER STATES ESC LIGHT COMES ON WHEN DRIVING	C1513 BRAKE LIGHT SWITCH	REPLACED SENSOR, RETESTED PASSED TEST
KM8JN12D66U	11/10/05	26078	31.86		CUSTOMER STATES THEY HAVE A SUSPENSION CONCERN. ESC LIGHT COMES ON	C1513 BRAKE LIGHT FAILURES	REPLACED BRAKE LIGHT SWITCH
KM8JN12D15U	6/23/05	17012	31.1		CUSTOMER STATES ESC LIGHT KEEPS COMING ON, SOP BRAKE LAMP SWITCH	FOUND BRAKE LAMP SWITCH SHORTED	REPLACED AND RECHECKED
KM8JN72D46U	12/30/05	21856	33.06		THE ESC LIGHT COMES ON RANDOMLY AND STAYS ON THEN IT GOES OFF. CHECK & ADVISE	CODE C1513 BRAKE SWITCH CIRCUIT ERROR	REPLACED BRAKE SWITCH OK AT THIS TIME
KM8JN72D35U	4/01/05	16	31.42		REPAIR FOR THE BRAKE LIGHTS ARE INOP	CHECKED AND FOUND BRAKE LIGHT SWITCH INOP	REPLACED SWITCH
KM8JN72D55U	4/04/05	13	51.22		CHECK FOR CUSTOMER STATES THAT THE ESP LIGHT IS STAYING ON.	CHECKED AND FOUND CODE OF C1513, BRAKE SWITCH MALFUNCTION. FOUND BRAKE LIGHTS INOP AND CHECKED SWITCH. SWITCH HAS FAULT.	REPLACED SWITCH AND CLEARED TROUBLE CODE FROM TCS. ALL OK AT THIS TIME.
KM8JN72D35U	3/25/05	34185	27.75				
KM8JN12D06U	7/21/05	19477	29.46		CUSTOMER STATES THAT THE ESC LIGHT IS COMING ON AT TIMES FOR NO APPARENT REASON	FOUND CODE C1513 BRAKE LAMP SWITCH FAULTY	REPLACED BRAKE LAMP SWITCH OK AT THIS TIME
KM8JN72D55U	4/04/05	16659	33.06		CUSTOMER STATES ESP OFF LIGHT HAS BEEN ON	C1315 - BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH - RETEST OK AT THIS TIME
KM8JN72D45U	4/01/05	19	19.8		CHECK AND ADVISE, BRAKE LIGHTS ARE INOP AND ESP LIGHT IS ON	CHECKED AND FOUND BRAKE LIGHT SWITCH TO BE OUT OF ADJUSTMENT	ADJUSTED BRAKE LIGHT SWITCH. RECHECKED SYSTEM. ALL OK AT THIS TIME.
KM8JN12D65U	4/08/05	21288	33.04	21288 SCAN TEST C1513 BRAKE LAMP SWITCH OPEN/SHORT FOUND BRAKE LAMP SWITCH INTERNALLY SHORTED. REPLACED BRAKE LAMP SWITCH. CHECKED OP. OK.	DRIVER AIRBAG MODULE REPLACEMENT	REPLACE AIR BAG MODULE PER RECALL	DRIVER AIRBAG MODULE REPLACEMENT DRIVER AIRBAG MODULE REPLACEMENT
KM8JN12D65U	4/08/05	21288	33.04	21288 SCAN TEST C1513 BRAKE LAMP SWITCH OPEN/SHORT FOUND BRAKE LAMP SWITCH INTERNALLY SHORTED. REPLACED BRAKE LAMP SWITCH. CHECKED OP. OK.	CUSTOMER STATES REAR BRAKE LIGHTS INOP	SCAN TEST C1513 BRAKE LAMP SWITCH OPEN/SHORT REPLACED SHORTED BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21288 SCAN TEST C1513 BRAKE LAMP SWITCH OPEN/SHORT FOUND BRAKE LAMP SWITCH INTERNALLY SHORTED. REPLACED BRAKE LAMP SWITCH. CHECKED OP. OK.

KM8JM12B06U	8/19/05	7684	35	7684 SCAN TEST C1516 BRAKE LAMP SWITCH FOUND BRAKE LAMP SWITCH INTERNALLY OPEN REPLACED BRAKE LAMP SWITCH CHECKED OP OK	CUSTOMER STATES ELECTRONIC STABILIZER CONTROL CUTS ON AND OFF ADVISE	REPLACED SW	CRUISE CONTROL ACTUATOR ASSY RE CRUISE CONTROL ACTUATOR ASSY RE 7684 SCAN TEST C1516 BRAKE LAMP SWITCH FOUND BRAKE LAMP SWITCH INTERNALLY OPEN REPLACED BRAKE LAMP SWITCH CHECKED OP OK
KM8JM12B36U	7/11/05	13988	35	13988 FOUND CODE C1513, STOP LAMP SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH ASSY SCNA AND CLEAR CODE C1513	CUST STATES ECS LIGHT CAME ON ADVISE	REPLACED SW	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 13988 FOUND CODE C1513, STOP LAMP SWITCH MALFUNCTION REPLACED BRAKE LIGHT SWITCH ASSY SCNA AND CLEAR CODE C1513
KM8JM12B06U	8/19/05	23612	35.91	23612 FOUND CODE C1513, SHORT IN BRAKE SWITCH REPLACED BRAKE SWITCH ASSY AND SET ADJUSTMENT SCAN AND CLEAR CODE C1513			
KM8JM12B25U	4/22/05	7105	34.58		CUST STATES ESP LIGHT KEEP COMING ON AND OFF SOP HERE	15	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 7105 INSTALLED SOP 6671 ORDERED REMOVE AND REPLACED BRAKE SWITCH
KM8JN12D95U	10/06/04	175	20.7	SCAN CODE C1513/BRAKE SWITCH SHORTED			
KM8JN12D55U	5/23/05	9996	35	9996 FOUND CODE C1513, BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LAMP SWITCH ASSY SCAN AND CLEAR CODE C1513	CUST STATES ESP LIGHT COMES ON AND OFF ADVISE	REPLACED SW	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 9996 FOUND CODE C1513, BRAKE LAMP SWITCH MALFUNCTION REPLACED BRAKE LAMP SWITCH ASSY SCAN AND CLEAR CODE C1513
KM8JM12B66U	7/15/05	17915	35	17911 BRAKE LAMP SWITCH HAD NO OUTPUT SIGNAL SCANNED C1513 BRAKE LAMP SWITCH R&R BRAKE LAMP SWITCH	CUSTOMER STATES ESC LIGHT COMES ON WHILE DRIVING GOES OFF WHEN SHUT OFF VEH AND RE-START-ADVISE	FOUND BRAKE LAMP SWITCH HAD NO OUTPUT SIGNAL, REPLACED SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 17911 BRAKE LAMP SWITCH HAD NO OUTPUT SIGNAL SCANNED C1513 BRAKE LAMP SWITCH R&R BRAKE LAMP SWITCH
KM8JM12B76U	12/09/05	14870	33.04	14870 SCANNED C1508 - BRAKE SWITCH REPLACED BRAKE LAMP SWITCH	CUST STATES ECS LIGHT COMES ON SOP HERE	REPLACED SW ASSY	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 14870 SCANNED C1508 - BRAKE SWITCH REPLACED BRAKE LAMP SWITCH
KM8JM12B85U	7/01/05	56214	35.91	56211 FOUND CODE C1513, BRAKE SWITCH INTERNAL SHORT REPLACED BRAKE SWITCH ASSY SCAN AND CLEAR CODE C1513 TEST DROVE VEH	CUSTOMER STATES CHECK ENGINE LIGHT ON-SOP IN	FOUND CODE P0133, O2 SENSOR READINGS INCORRECT	REPLACED FRONT O2 SENSOR B151SCANNED AND CLEAR CODE P0133 RESET ADAPTIVE VALUES
KM8JM12B85U	7/01/05	56214	35.91	56211 FOUND CODE C1513, BRAKE SWITCH INTERNAL SHORT REPLACED BRAKE SWITCH ASSY SCAN AND CLEAR CODE C1513 TEST DROVE VEH	CUSTOMER STATES CHECK ENGINE LIGHT ON-SOP IN	FOUND CODE P0133, O2 SENSOR READINGS INCORRECT	SENSOR ASSY-OXYGEN ADD SCAN TOOL OPERATION SENSOR ASSY-OXYGEN ADD SCAN TOOL OPERATION 56214 FOUND CODE P0133, O2 SENSOR READINGS INCORRECT REPLACED FRONT O2 SENSOR B151SCANNED AND CLEAR CODE P0133 RESET ADAPTIVE VALUES AND TEST DROVE VEH
KM8JM12B85U	7/01/05	56214	35.91	56211 FOUND CODE C1513, BRAKE SWITCH INTERNAL SHORT REPLACED BRAKE SWITCH ASSY SCAN AND CLEAR CODE C1513 TEST DROVE VEH	DRIVER AIRBAG MODULE REPLACEMENT	INSPECTED VEH FOR RECALL	DRIVER AIRBAG MODULE REPLACEMENT DRIVER AIRBAG MODULE REPLACEMENT 56209 INSPECTED VEH FOR RECALL REPLACED DABCOVER ASSY
KM8JM12B85U	7/01/05	56214	35.91	56211 FOUND CODE C1513, BRAKE SWITCH INTERNAL SHORT REPLACED BRAKE SWITCH ASSY SCAN AND CLEAR CODE C1513 TEST DROVE VEH	CUSTOMER STATES ESC LIGHT ON-SOP IN	FOUND CODE C1513, BRAKE SWITCH INTERNAL SHORT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 56211 FOUND CODE C1513, BRAKE SWITCH INTERNAL SHORT REPLACED BRAKE SWITCH ASSY SCAN AND CLEAR CODE C1513 TEST DROVE VEH
KM8JM12B85U	7/01/05	56214	35.91	56211 FOUND CODE C1513, BRAKE SWITCH INTERNAL SHORT REPLACED BRAKE SWITCH ASSY SCAN AND CLEAR CODE C1513 TEST DROVE VEH	CUSTOMER STATES CRUISE CONTROL INOP-ADVISE	FOUND OPEN IN SWITCH	BRACKET ASSY-CRUISE CONTROL RE BRACKET ASSY-CRUISE CONTROL RE 56211 FOUND OPEN IN SWITCH REPLACE CRUISE CONTROL SWITCH ASSY TEST DROVE VEH
KM8JN72D46U	11/15/05	12125	35.91	12125 SCAN TEST, FOUND CODE C1513 BRAKE LAMP SWITCH REPLACED SWITCH, CLEARED CODE, TEST DROVE, NO MORE LIGHT	CUST STATES ECS LIGHT IS ON ADVISE	SCAN TEST, FOUND CODE C1513 BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 12125 SCAN TEST, FOUND CODE C1513 BRAKE LAMP SWITCH REPLACED SWITCH, CLEARED CODE, TEST DROVE, NO MORE LIGHT
KM8JN72D75U	4/20/05	3805	35	3805 SOP CODE IN SYSTEM REPLACED BRAKE SWITCH	CUST STATES BRAKE LIGHT SW IS INOP SOP HERE	REPLACED SHORTED BRAKE SWITCH PER TECH LINE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 3805 SOP CODE IN SYSTEM REPLACED BRAKE SWITCH
KM8JN72D16U	10/11/05	33839	52.86	ESC LIGHT ON SCAN TOOL CODE C1513 BRAKE LIGHT SWITCH FAULT TESTED FOUND OPEN BRAKE LAMP SWITCH REPLACED SWITCHED CLEARED CODE—OK NOW			
KM8JN12D56U	11/24/05	16203	52.86	3 OLH-DIAGNOSIS-CUSTOMER STATES ESC LIGHT OFF WILL COME BACK FOR DAYS, THEN BACK OFF-SCAN TEST CODE B1513-FOUND FAULTY BRAKE LIGHT SWITCH-THANKS	CUSTOMER STATES THAT THE ESC LIGHT OFF WILL COME ON IN THE DASH-STAYS ON FOR A FEW DAYS-THEN GOES OFF-COMES BACK ON LATER	PERFORMED SCAN TOOL TEST- FOUND CODE C1513 FOUND FAULTY BRAKE LIGHT SWITCH	REPLACED 32602A00=2 N69 C15 58910RPO=.3

KM8JN12D56U	11/24/05	16203	52.86	.3 OLH-DIAGNOSIS-CUSTOMER STATES ESC LIGHT OFFWILL COME BACK FOR DAYS, THEN BACK OFF-SCAN TESTCODE B1513-FOUND FAULTY BRAKE LIGHT SWITCH-THANKS	CUSTOMER STATES THAT THERE IS A LEFT FRONT HEADLIGHT OUT	FAULTY BULB	REPLACED 18647R00= 2
KM8JN72D56U	9/28/05	7305	52.86	0.3 TT-SCAN TEST-CUSTOMER STATES ESC LIGHT ON-WILL NOT GO OFF-SCAN TEST -CODE C1513- STOP LAMP SWITCH FAULTY- REPLACE STOP LAMP SWITCH- THANKS			
KM8JM12B75U	4/09/05	12106	29.3		ESP LIGHT COMES AND GOES - SOP BRAKE SWITCH OFF93810-3K000	OPEN CIRCUIT 93810R00	REPLACED BRAKE SWITCH N94 C15
KM8JM12B95U	12/02/04	27342	26.23		CRUISE WONT SET WHEN TURNED ON OFF 96440-2E000	OPEN CIRCUIT CASE# 102923 OP 96441R00 N94 C15	PERFORMED DIAGNOSTIC AND REPLACED CRUISE CONTROL ACTUATOR
KM8JM12B95U	12/02/04	27342	26.23		BRAKE LIGHTS INOP INTERMITTENTLY OFF 93810-38110	OPEN CIRCUIT OP 93810R00	R&R STOP LAMP SWITCH N94 C15
KM8JM12B45U	12/06/04	27281	35.25				
KM8JM12B45U	12/06/04	25226	71.85				
KM8JM12B45U	12/06/04	31079	35.53	DPSM REVIEWED CLAIM WHEN HE WAS AT THE DEALERSHIP. SWITCH WAS REPLACED ON 7-5-07 AT 27,281 MILES ON 028831 CLAIM AND RO 02833 THE SWITCH HAD FAILED			
KM8JN12D75U	6/10/05	31953	63.94	ATT TIME TO REPAIR WIRES TO BRAKE LAMP SWITCH SHORTED OUT			
KM8JN12D56U	12/17/05	14160	36.64				
KM8JN12D56U	12/17/05	14160	120				
KM8JM12B85U	10/15/04	39403	35.53				
KM8JN12D75U	5/13/05	34187	36.96				
KM8JN72D46U	11/10/05	18594	35.16	REPLACE BRAKE LIGHT SWITCH BAD			
KM8JN12D36U	10/26/05	22225	32.44	REPLACE BRAKE LIGHT SWITCH			
KM8JM12BX5U	10/15/04	33983	33.73	REPLACE BRAKE LIGHT SWITCH BAD INTERMITTLY			
KM8JN72D86U	7/18/05	17634	32.46				
KM8JN12D86U	12/03/05	4710	32.46		CUSTOMER STATES THE ESC OFF LIGHT IS COMING ON AT TIMES WHILE DRIVING	C15	REPLACED SWITCH ASSY.
KM8JN12D86U	7/27/05	19433	32.46		CUSTOMER STATES ESC LIGHT IS ON (SOP)	C15	REPLACED SWITCH ASSY.
KM8JN12D76U	7/26/05	18104	32.46		CUST STATES ESC LIGHT IS ON	C15	REPLACED SWITCH ASSY.
KM8JN12D65U	5/27/05	21570	34.1		CK ESP LIGHT IS ON INTERMIT. WHEN SWITCH IS PRESSED LIGHT DOES NOT GOOUT. MUST SHUT VEHICLE OFF AND RESTART THEN LIGHT WILL GO OUT - SOP MODULE	C15	REPLACED SWITCH ASSY. SCAN TOOL DIAG C1513 BRAKE PEDAL SWITCH ERROR- CHECKED FOR POWER AND GROUNDS AT SWITCH ANDFO UND SWITCH OPEN. REPLACED FAILED BRAKELAMP SWI TCH, CLEARED CODE AND ROADTEST LIGHTTURN ON AN D OFF
KM8JN12D65U	6/09/05	30735	32.46		CUST STATES THAT THE ESP LIGHT WILL COME ON ALL BY ITSELF AND WHEN SHE PRESSES THE BUTTON IT WONT GO OFF	C15	REPLACED SWITCH ASSY.
KM8JM12B06U	11/29/05	11801	22.8	SCAN TOOL CODE C1513 ADJUSTED BRAKE LAMP SWITCH	CK ESC OFF LIGHT WILL BE ILLUMINATED INTERMIT. MUST SHUT OFFVEHICLE AND RESTART TO TURN OFF LIGHT.	C15	SCAN TOOL RAN SCAN TOOL FOUND CODE C1513 IN ABS ADJUSTED BRAKE LAMP SWITCH ACCORDING TO CODEAND CLEARE D CODE.
KM8JM12B06U	11/29/05	14117	32.46		CUSTOMER STATES THE ESC LIGHT COMES ON AT TIMES	C15	REPLACED SWITCH ASSY.
KM8JN12D26U	7/26/05	14285	30.36				
KM8JN12DX6U	10/19/05	11287	30.36				
KM8JN72D75U	5/23/05	23159	30.04				
KM8JN12D96U	7/11/05	19329	30.04				
KM8JN12D05U	10/28/04	27642	29.76	REPLACED BRAKE LIGHT SWITCH			MISC MISC
KM8JN12D05U	10/28/04	27642	29.76	REPLACED BRAKE LIGHT SWITCH			DIAGNOSTIC ALLOWANCE WIRE REPAIR TIME (MAJOR)
KM8JN12D05U	10/28/04	27642	29.76	REPLACED BRAKE LIGHT SWITCH			STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM12B26U	7/09/05	18504	31.84	ESC OFF LIGHT COMES ON RANDOMLY AND CANNOT BE TURNED OFF UNLESS VEHICLE IS RESTARTED. C1513 REPL BRAKE LAMP SWITCH			
KM8JM12B96U	7/19/05	25880	32.16	ESC OFF LIGHT COMES ON INTERMIT. INTERNAL FAILURE IN BRAKE SWITCH. REPLACED BRAKE SWITCH	CUSTOMER STATES THE VEHICLE RAN HOT LAST WEEK, THE COOLANT HAD TO BE REFILLED	RADIATOR LEAKING.	REPLACED RADIATOR. LABOR OP: 25300R00-1.6HRS, 25300RA1-1, 25300RA4- 2, N88 C07
KM8JM12B96U	7/19/05	25880	32.16	ESC OFF LIGHT COMES ON INTERMIT. INTERNAL FAILURE IN BRAKE SWITCH. REPLACED BRAKE SWITCH	CUSTOMER STATES THE ESC OFF LIGHT COMES ON INTERMITENTLY	FAILURE IN BRAKE SWITCH. REPLACED BRAKE SWITCH.	LABOR OP: 93810R00-.3HRS CAUSE CODES: N94 C15
KM8JM12B96U	7/19/05	25880	32.16	ESC OFF LIGHT COMES ON INTERMIT. INTERNAL FAILURE IN BRAKE SWITCH. REPLACED BRAKE SWITCH	AS OF 11/2/06, ALL TUSCON VEHICLES HAVE BEEN EQUIPED WITH ANEW DESIGN AIR BAG COVER MODULE.	HYUNDAI IS REPLACING ALL PREVIOUS DRIVER AIR BAG COVER	LABOR OP. 61B046R0 0.2
KM8JM12B56U	8/25/05	24977	32.16	C1513 ELECTRICAL FAILURE IN STOP LAMP SWITCH. REPLACED BRAKE LAMP SWITCH	CUSTOMER STATES ESP LIGHT COMES ON SOMETIMES.	CODE C1513 IN SYSTEM. INTERNAL FAILURE IN BRAKE LAMP SWITCH.	REPLACED BRAKE LAMP SWITCH. LABOR OP: 93810R00-.3HRS, CAUSE CODES: N94 C15
KM8JN72DX6U	7/18/05	23086	32.16	ECS LIGHT STAYS ON. C1513 IN SYSTEM. FAILURE IN BRAKE LIGHT SWITCH. REPL BRAKE LIGHT SWITCH	CUSTOMER STATES THE ESC LIGHT STAYS ON.	CODE C1513 IN SYSTEM. FOUND FAILURE IN BRAKE LIGHT SWITCH REPLACED BRAKE LIGHT SWITCH	LABOR OP: 93810R00-.3 N94 C15
KM8JN72D06U	8/12/05	16350	32.16	ECS LIGHT COMING ON C1513 IN SYSTEM REPLACE BRAKE LIGHT SWITCH	CUSTOMERS ATTES THE ESC LIGHT COMES ON THE DASH.	CODE C1513 IN SYSTEM. INTERNAL FAILURE IN BRAKE LIGHT SWITCH.	REPLACED BRAKE LIGHT SWITCH. LABOR OP: 93810R00-.3HRS, CAUSE CODES: N94 C15

KM8JN72D06U	8/12/05	16350	32.16	ECS LIGHT COMING ON C1513 IN SYSTEM REPLACE BRAKE LIGHT SWITCH	AS OF 11/2/06, ALL TUSCON VEHICLES HAVE BEEN EQUIPED WITH ANEW DESIGN AIR BAG COVER MODULE.	HYUNDAI IS REPLACING ALL PREVIOUS DRIVER AIR BAG COVER	LABOR OP. 61B046R0 0.2
KM8JN72DX6U	7/18/05	24409	66.36	CUSTOMER SREPORTS ESC LIGHT IS ON WHEN DRIVING. C1513 BRAKE SWITCH CIRCUIT. SCAN TEST CLEARED CODE. REPLACE BRAKE LIGHT SWITCH. A TIME FOR DIAGNOSIS TIME NOT SHOWN IN WARRANTY WIZARD.	CUST.REPORTS ESC LIGHT ON WHEN DRIVING,ADVISE	C1513 BRAKE SWITCH CIRCUIT	SCAN TEST, CLEARED CODE. REPLAE BRAKE LIGHT SWITCH
KM8JM12B66U	11/24/05	32426	38.01	CUSTOMER STATES THAT THE ESC OFF LIGHT COMES ON WHILE DRIVING. BRAKE LIGHT SWITCH DEFECTIVE. C1513. SCAN TEST, CLEARED CODE. REPLACED BRAKE LIGHT SWITCH. RQO TIME OR A TIME REQUIRED TO DIAGNOSE PROBLEM. SHOULD BE ALLOWED ON CLAIM.	CUST STATES THAT THE ESC OFF LIGHT COMES ON WHILE DRIVING	BRAKE LIGHT SWITCH DEFECTIVE C1513	SCAN TEST, CLEARED CODE. REPLACED BRAKE LIGHT SWITCH
KM8JN72D35U	12/27/04	23480	35.91	CUSTOMER STATES 4X4 LIGHT FLASHES WHEN DRIVING. HAVE TO SHUT OFF VEHICLE TO GET OUT OF FOUR WHEEL DRIVE. LIGHT WILL THEN SHUT OFF. C1513 BRAKE LIGHT SWITCH. REPLACED SWITCH.	CUSTOMER STATES 4X4 LIGHT FLASHES WHEN DRIVING. HAVE TO SHUT OFF VEHICLE TO GET OUT OF FOUR WHEEL DRIVE LIGHT WILL THEN SHUT OFF	C1513 BRAKE LAMP SWITCH	REPLACED SWITCH
KM8JN72D35U	12/27/04	23480	35.91	CUSTOMER STATES 4X4 LIGHT FLASHES WHEN DRIVING. HAVE TO SHUT OFF VEHICLE TO GET OUT OF FOUR WHEEL DRIVE. LIGHT WILL THEN SHUT OFF. C1513 BRAKE LIGHT SWITCH. REPLACED SWITCH.	CUSTOMER STATES SOP PART IN FOR SEAT HEATER	OPEN CIRCUIT IN SEAT HEATER	REPLACED BOTH SEAT HEATERS
KM8JN72D35U	12/27/04	23480	35.91	CUSTOMER STATES 4X4 LIGHT FLASHES WHEN DRIVING. HAVE TO SHUT OFF VEHICLE TO GET OUT OF FOUR WHEEL DRIVE. LIGHT WILL THEN SHUT OFF. C1513 BRAKE LIGHT SWITCH. REPLACED SWITCH.	SEAT BACK HEATER INOP	OPEN CIRCUIT IN SEAT HEATER BACK	REPLACED HEATER
KM8JM72B36U	4/11/06	929	34.91				
KM8JN12D96U	9/28/05	21769	33.27				
KM8JN72D56U	8/08/05	14744	30.64		CUSTOMER STATES ESC LIGHT CAME ON THEN WENT OFF	REPLACED BRAKE STOP LAMP SWITHC AFTER PULLING CODE C1516	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D55U	4/29/05	23998	30.96				
KM8JN12D66U	11/30/05	19820	30.96				
KM8JN12D46U	10/14/05	18400	30.64	REPLACED BRAKE LAMP SWITCH			
KM8JM12B45U	4/27/05	40832	39.47		CUST STATES ESP OFF DASH SWITCH INOP AT TIMES.	SCANNED SYSTEM FOUND BRAKE SWITCH SHORTED INTERNALLY	TEST AND REPLACE BRAKE SWITCH AND BULB.
KM8JN12D45U	5/14/05	18108	31.86	REPLACED FAULTY BRAKE LAMP SWITCHES	CUSTOMER STATES ESP LIGHT HAS BEEN COMING AND OFF	DISCOVERED FAULTY BRAKE LAMP SWITCHES	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP
KM8JM12B67U	8/21/06	19	32.14		CUSTOMER STATES BRAKE LIGHTS STAY ON	BRAKE LAMP SWITCH	REPLACED BRAKE LIGHT SWITCH 93810R00 0.3 HRS. N=94 C=40
KM8JN12D66U	8/18/05	24428	59.46	C/S ESC LITE COMES ON -HAVE TO SHUT OFF AND START VEH TO GET LITE TO TURN OFF / CODE C1513 SET - CAUSED BY FAILED BRAKE LAMP ON / REPLACED BRAKE LITE SWITCH AND CLEARED CODE - WORKING AS	PERFORM OPEN RECALL 079	OPEN RECALL	REPLACED DRIVER AIR BAG
KM8JN12D66U	8/18/05	24428	59.46	C/S ESC LITE COMES ON -HAVE TO SHUT OFF AND START VEH TO GET LITE TO TURN OFF / CODE C1513 SET - CAUSED BY FAILED BRAKE LAMP ON / REPLACED BRAKE LITE SWITCH AND CLEARED CODE - WORKING AS	C/S THAT ESC LIGHT COMES ON INTERMITTENTLY,HAVE TO SHUT OFF VEH AND THEN BACK ON,TO GET LIGHT TO GO OUT	CODE C1513 SET CAUSED BY FAILED BRAKE LAMP SW.	REPLACED BRAKE LAMP SW AND CLEARED CODE
KM8JM12B96U	7/12/05	17220	30.06		CUST STATSE THAT THE ESC LIGHT WAS ON. IT WENT OUT AND HAS STAYED OUT AFTER THE APPOINTMENT WAS MADE	PULLED OUT CODE C1513 BRAKE LAMP SWITCH,CHECKED BRAKE SWITCHADJUSTMENT-OK.SWITCH INTERMITTANTLY GOES OPEN	REMOVED AND REPLACED SWITCH,CLEARED CODE
KM8JN72D16U	7/20/05	22910	29.74		CUSTOMER STATES THE ESC LIGHT COMES ON.	FOUND CODE INS ESC SYSTEM C1513 FOR THE BRAKE LIGHT SWITCH FAILING. REPLACED THE BRAKE LIGHT SWITCH. CLEARED THE CODES	REPLACED THE BRAKE LIGHT SWITCH AND RESET THE LIGHT.
KM8JM12B37U	8/10/06	1541	32.45	DTC C1513. BRAKE LAMP SWITCH IS INOP. REPLACED BRAKE LAMP SWITCH	CHECK ENGINE CUSTOMER SAID WHILE DRIVING. VEHICLE WILL DIE OUT. WILL RESTART	FOUND BRAKE LAMP SWITCH NOT WORKING	REPALCED BRAKE LAMP SWTICH
KM8JM12B37U	8/10/06	1541	32.45	DTC C1513. BRAKE LAMP SWITCH IS INOP. REPLACED BRAKE LAMP SWITCH	CHECK ECS BUTTON, CUSTOMER SAID IT IS ALWAYS ON OFF. WILL NOT TURN ON	FOUND FAULTY ESC SWTICH	REPLACED ESC SWITCH
KM8JN72D36U	9/27/05	16326	30.81	SCANNED CODES, CHECK BRAKE LAMPS, REPLACED FAULTY BRAKE LAMP SWITCH, CLEARED CODES	CHECKL STABILITY CONTROL, LIGHT WILL COME ON IN DASH WHILE DRIVING AND WILL NOT GO OFF.	VEHICLE HAD CODE C1237 AND C1513	SCANNED CODES, CHECK BRAKE LAMPS, REPLACED FAULTY BRAKE LAMP SWITCH, CLEARED CODES
KM8JN12DX5U	8/26/04	41923	100	SUBLET COMPLETE. HYUNDAI TO PAY FOR LOANER AS PER CHUCK			
KM8JM72B66U	1/09/06	23223	30.36		CUSTOMER STATES BRAKE LIGHTS INOP CHECK & ADVISE	VERIFIED CONCERN AND INSPECTED. FOUND PLUNGER FOR BRAKE LIGHT SWITCH WAS PUSHED ALL THE WAY IN AND WOULD NOT COME OUT. DETERMINED SWITCH HAD FAILED INTERNALLY AND NEEDED REPLACEMENT	INSTALLED NEW BRAKE LIGHT SWITCH AND VERIFIED NORMAL OPERATION. REPAIR COMPLETE
KM8JM72B66U	1/09/06	23223	30.36		LOANER VEHICLE, HPP COVERED. 2 DAYS. PO# 23365 AS OF 8/23/07 PM	AS OF ADDITIONAL CONVERSATION WITH CUSTOMER ON 8/23/07 DECLINED USE OF LOANER VEHICLE AT THIS TIME. IF VEHICLE WILL NOT BE READY BE END OF DAY ON 8-24-07, CUSTOMER MAY NEED VEHICLE	SUBLET COMPLETE

KM8JN12D36U	10/13/05	9014	33.66		CUSTOMER STATES THAT THE ESC LIGHT KEEPS COMING ON, WILL NOT TURN OFF WITH SWITCH, SOP IN	ALREADY ADDED STABILANT AND LIGHT CAME BACK ON	REPLACED BRAKE SWITCH 32002A00 N69 C15
KM8JN12D36U	10/13/05	8732	24		CUST SAYS ESC LIGHT KEEPS COMING ON CHECK AND ADVISE WAITING	TEST DROVE LIGHT DID NOT ILLUMINATE SCANNED FOR CODES FOUND C1513 SET FOR BRAKE LAMP SWITCH MALFUNCTION	INSPECTED BRAKE SWITCH, CHECKED PIN TENSION. ALL FINE AT THIS TIME CLEARED CODE REDROVE LIGHT DID NOT COME BACK ON AT THIS TIME NO STORED ANY OTHER CODES
KM8JN72D16U	12/20/05	9810	38.14	REPLC BRAKE PEDAL SWITCH AND TEST DROVE			
KM8JN72D66U	7/28/05	30646	38.46	30646 CUST STATES THE ESC LIGHT HAS BEEN COMING ON WHEN DRIVING. TEST DROVE VEHICLE BUT THE LIGHT DID NOT COME ON. PERFORMED HI-SCAN DIAGNOSTICS AND FOUND ESC FAULT CODE C1513 BRAKE PEDAL SWITCH MALFUNCTION. CHKD THE ADJUSTMENT OF THE SWITCH, CHKD OK. REM			
KM8JN12D76U	9/23/05	23382	34.86	STABILITY CONTROL LIGHT IS ON. INSTALLED NEW BRAKE LAMP SWITCH FOR CODE B1513	CUSTOMER STATES, THE STABILITY CONTROL LIGHT ON--- SOP	15	STOP LAMP SWITCH ASSM. STOP LAMP SWITCH ASSM. 23382 INSTALLED NEW BRAKE LAMP SWITCH FOR CODE B1513
KM8JM12B36U	8/29/05	15277	88.06	SCAN FOR ESC RELATED INFORMATION. DTC C1513 BRAKE SWITCH ERROR. FOLLOW DIAGNOSTIC FLOW IN SERVICE MANUAL. DISCONNECTED HECU CONNECTOR E37 (2.0L) MEASURE VOLTAGE AT PIN 21 NOT PUSHING BRAKE PEDAL, 12.26V, MEASURE VOLTAGE PIN 21 PUSHING THE BRAKE PEDAL, 15.			
KM8JM72B35U	4/26/05	25812	39.34		922	RECALL	PERFORM 922 RECALL PERFORM 922 RECALL
KM8JM72B35U	4/26/05	25812	39.34		071	RECALL	PERFORM 071 RECALL PERFORM 071 RECALL
KM8JM72B35U	4/26/05	25812	39.34		CUSTOMER STATES THAT THE ESP LIGHT GOES ON AND OFF SPORADICALLY. CHECK AND ADVISE.	ELECTRICAL MALFUNCTION	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JM72B35U	4/26/05	25812	39.34		CUSTOMER STATES THAT THE ALARM WILL GO OFF EVERY ONCE IN AWHILE IN THE MIDDLE OF THE NIGHT. CHECK AND ADVISE.	STRAIT TIME DIAG	CHECK ALARM CHECK ALARM
KM8JN72D76U	7/26/05	28916	39.66		CUSTOMER STATES THAT THE ESC OFF LIGHT IS STAYING ON CONSTANTLY. CHECK AND	ELECTRICAL MALFUNCTION	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D26U	7/20/05	15413	39.66	SCAN TEST CODE P1513 STOP LAMP SWITCH OPEN SHOR TED REPLACE SWITCH CLEAR CODES ROADTEST	CUSTOMER STATES THAT ESC OFF LIGHT KEEPS GOING ON AND OFF FOR NO REASON WHEN DRIVING. CHECK AND ADVISE.	SCAN TEST CODE P1513 STOP LAMP SWITCH OPEN REPLACE STOP LAMP SWITCH	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE SCAN TEST CODE P1513 STOP LAMP SWITCH OPEN SHOR TED REPLACE SWITCH CLEAR CODES ROADTEST
KM8JN12D66U	10/05/05	14120	39.34		OWNER REPORTS ESC LIGHT IS COMING ON, CHECK AND REPORT	INTERNAL FAILURE	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE
KM8JN12D66U	10/05/05	14120	39.34		OWNER REPORTS AT TIMES THE BLOWER QUIT RUNNING, CHECK AND REPORT	INTERNAL	HEATER FAN & MOTOR ASSY RE HEATER FAN & MOTOR ASSY RE
KM8JN12D35U	9/09/04	7343	32.67	OPEN CIRCUIT			
KM8JN12D25U	2/18/05	23666	31.86	23666 RAN SCAN TEST FOUND C1237 C1513 PRESSURE SNSR OTHER BRAKE LAMP SWITCH CHECKED BRAKE LAMP SWITCH SWITCH CHECKED BAD INTERNAL FALIURE 93810R00 R&R BRAKE LAMP SWITCH AND THEN TEST DROVE PUT 10 MILES ON VEHICLE AND ENGINE LIGHT DID NOT COME BACK ON .3	CUSTOMER STATES TRANSMISSION SEEMS TO SLIP WHEN ENGAGING INTO GEAR WHEN CRUISE CONTROL IS ON VEHICLE DOWN SHIFTS TO WHAT SEEMS TO BE FIRST GEAR AND REVS VERY HIGH INTERMITTANTLY SEEMS TO BE IN THE WRONG GEAR UNDER ACCELERATION AND SEEMS		TRANSMISSION TRANSMISSION 23666 TEST DROVE AND RAN SCAN TEST NO CODES AND I WAS UNABLE TO DUPLICATE CUSTOMER CONCERN AT THIS TIME NO ACTION TAKEN
KM8JN12D25U	2/18/05	23666	31.86	23666 RAN SCAN TEST FOUND C1237 C1513 PRESSURE SNSR OTHER BRAKE LAMP SWITCH CHECKED BRAKE LAMP SWITCH SWITCH CHECKED BAD INTERNAL FALIURE 93810R00 R&R BRAKE LAMP SWITCH AND THEN TEST DROVE PUT 10 MILES ON VEHICLE AND ENGINE LIGHT DID NOT COME BACK ON .3	CUSTOMER STATES THE CD PLAYER WILL NOT ACCEPT CD'S ALSO WILL NOT EJECT DISC IN SLOT #2		MAZZIBATT MAZZIBATT 23666 INTERNAL FALIURE ORDERED ON STOCK ORDER
KM8JN12D25U	2/18/05	23666	31.86	23666 RAN SCAN TEST FOUND C1237 C1513 PRESSURE SNSR OTHER BRAKE LAMP SWITCH CHECKED BRAKE LAMP SWITCH SWITCH CHECKED BAD INTERNAL FALIURE 93810R00 R&R BRAKE LAMP SWITCH AND THEN TEST DROVE PUT 10 MILES ON VEHICLE AND ENGINE LIGHT DID NOT COME BACK ON .3	CUSTOMER STATES THE ESP LIGHT COMES ON WHILE DRIVING WILL NOT GO OUT TILL YOU SHUT THE VEHICLE OFF THE LIGHT DOES NOT COME BACK ON WHEN RESTARTED WILL COME ON AFTER VEHICLE HAS BEEN DRIVEN	F	STOP LAMP SWITCH ASSY RE STOP LAMP SWITCH ASSY RE 23666 RAN SCAN TEST FOUND C1237 C1513 PRESSURE SNSR OTHER BRAKE LAMP SWITCH CHECKED BRAKE LAMP SWITCH SWITCH CHECKED BAD INTERNAL FALIURE 93810R00 R&R BRAKE LAMP SWITCH AND THEN TEST DROVE PUT 10 MILES ON VE
KM8JN12D35U	4/18/05	23664	32.14	23664 ESP LIGHT ON BRAKE LIGHT SWITCH CODE 93810R00 0.3 PULLED DTC FROM ESP MODULE C1513 BRAKE LAMP SWITCH CK CIRCUIT AND CONNECTOR AND REPLACE SWITCH CLEAR DTC AND CK OPERATION			

KM8JN72DX5U	6/13/05	20304	32.14	WHEN APPLYING BRAKES THE ESP OFF LIGHT COMES ON. FOUND CODE C1315 BRAKE SWITCH CODE FOUND SHORT IN SWITCH REPLACED BRAKE SWITCH NO PROBLEMS AT THIS			
KM8JN72D76U	11/15/05	10810	32.14	4WD LIGHT FLASHING., ENG SURGING. C1213, BRAKE LAMP SWITCH CIRCUIT. REPLACED BRAKE LAMP SWITCH AFTER VERIFYING HARNESS AND RELATED WIRING IN WORKING ORDER			
KM8JN12D16U	9/01/05	18759	32.14	ESC LIGHT CAME ON THE SHORTLY WENT OUT. BRAKE LAMP SWITCH OPEN CIRCUIT AT TIMES 93810R00 0.3 PULLED DTC C1513 BRAKE LAMP SWITCH CK CIRCUIT WAS OK REPLACED SWITCH CLEARED DTC CK ROAD TEST TO VERIFY OPERATION AFTER REPAIR			
KM8JN12D86U	9/28/05	18544	34.26	ESC LIGHT ON. FOUND VEHICLE HAVING BRAKE SWITCH CODE C1513 WI CH BRAKE SWITCH WAS SENDING WRONG SIGNAL TO ABS MODULE REPLACED BRAKE SWITCH			
KM8JN12D45U	6/17/05	27247	32.14	27247 YAW SENSOR BRAKE LIGHT SWITCH INOP. REPLACED BAD BRAKE LIGHT SWITCH			
KM8JN72D85U	9/15/04	4405	32.67				
KM8JN12D75U	9/11/04	12459	33.22	ENG LOOSE S POWER	PER HYUNDAI ORDER PARTS AS NOTED ON EMAIL	F	MAZZIBATT MAZZIBATT 11459 INSTALLED ORDERED PARTS ON VEHICLE96441R00 42621R00 42620R00 93810R00 93400R00INSTALLED ORDERED PARTS AS TOLD TO 1.9
KM8JN12D75U	9/11/04	12459	33.22	ENG LOOSE S POWER	CUSTOMER SAYS VEHICLE PULLS TO RIGHT DRIVING	F	ADJUST WHEEL ALIGNMENT (4WHEELS) ADJUST WHEEL ALIGNMENT (4WHEELS) 11459 NORMAL WEAR 52903A00 PERFORMED WARRANTYFOUR WHEEL ALIGNMENT 1.1
KM8JN12D75U	9/11/04	12459	33.22	ENG LOOSE S POWER	LOANER PROVIDED	F	SUBLET SUBLET 12/12-12-16 6H039492
KM8JN12D56U	8/22/05	15567	33.66	15567 C1513 BRAKE LAMP SWITCH . I FOUND THE BRAKE LAMP SWITCH WAS SHORTED OUT . REPLACE THE BRALE LAMP SWITCH THE ESC LIGHT WENT OUT	CUSTOMER STATES THE ESC OFF LIGHT IS ON	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 15567 C1513 BRAKE LAMP SWITCH . I FOUNDTHE BRAKE LAMP SWITCH WAS SHORTED OUT .REPLACE THE BRALE LAMP SWITCH THE ESC LIGHTWENT
KM8JN12D56U	8/22/05	15567	33.66	15567 C1513 BRAKE LAMP SWITCH . I FOUND THE BRAKE LAMP SWITCH WAS SHORTED OUT . REPLACE THE BRALE LAMP SWITCH THE ESC LIGHT WENT OUT	SUBSTITUTE TRANSPORTATION	5NPET46C26H322661	SUBLET REPAIRS
KM8JN12D56U	8/22/05	15567	33.66	15567 C1513 BRAKE LAMP SWITCH . I FOUND THE BRAKE LAMP SWITCH WAS SHORTED OUT . REPLACE THE BRALE LAMP SWITCH THE ESC LIGHT WENT OUT	SUBSTITUTE TRANSPORTATION	5NPET46C26H322661	SUBSTITUTE TRANSPORTATION SUBSTITUTE TRANSPORTATION
KM8JN12D56U	8/22/05	8756	35.3		STATES ESC INDICATOR WILL COME ON DASH AT RANDOM // SOP HERE	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D86U	11/21/05	20430	35.3		STATES ESP INDICATOR COMES ON DASH // SOP HERE	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 88811NTT - REPLACED COVERFOR SEAT BELT SHOULDER PASS FRT ENTER OPERATION CODE DECRPTION NECESSARY TO REPLACE PASS SEAT BELT SHOULDERCOVER - FELL OFF - NOW MISSING
KM8JN72D86U	11/21/05	20430	35.3		STATES FRONT RT SHOULD BELT GARNISHCOVER MISSING // SOP HERE	LOOSE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 16463 CODE C1513 BRAKE SWITCH OPEN CIRCUITINSTALLED NEW SWITCH AND CK OPERATION
KM8JN72D86U	12/05/05	16461	33.66	16463 CODE C1513 BRAKE SWITCH OPEN CIRCUIT INSTALLED NEW SWITCH AND CK OPERATION	CUSTOMER STATES THE ESC OFF LIGHT IS COMING ON INTERMITTENTLY, USUALLY STAYS ON 2-3 DAYS	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 31338 FOUND DTC C1513 BRAKE LAMP SWITCH.FOUND THE BRAKE SWITCH SHORTED. REPLACED THEBRAK SWITCH. OPERATION IS OK AT THIS TIME.
KM8JN12D16U	7/22/05	31338	33.34	31338 FOUND DTC C1513 BRAKE LAMP SWITCH. FOUND THE BRAKE SWITCH SHORTED. REPLACED THE BRAK SWITCH. OPERATION IS OK AT THIS TIME.	CUSTOMER STATES ESC LIGHT COMES ON INTERMITTENTLY	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 31338 FOUND DTC C1513 BRAKE LAMP SWITCH.FOUND THE BRAKE SWITCH SHORTED. REPLACED THEBRAK SWITCH. OPERATION IS OK AT THIS TIME.
KM8JM12B85U	5/14/05	22897	33.34	22898 DUPLICATED CUST COMPLAINT. TESTED ALL FUSES ALL OK. FOUND THE STOP LAMP SWITCH SHORTED. REPLACED THE STOP LAMP SWITCH, BRAKELIGHT OPERATION IS OK AT THIS TIME.	CAMPAIGN 079, TUCSON DRIVER AIR BAGCOVER MODULE REPLACEMENT, TSB#07-01-001.	CAMPAIGN	DRIVERS AIRBAG COVER MODULE REPLACEMENT (07-01-001) 079 DRIVERS AIRBAG COVER MODULE REPLACEMENT (07-01-001) 079 22898 CAMPAIGN REPLACED THE AIR BAG MODULECOVER PER CAMPAIGN.
KM8JM12B85U	5/14/05	22897	33.34	22898 DUPLICATED CUST COMPLAINT. TESTED ALL FUSES ALL OK. FOUND THE STOP LAMP SWITCH SHORTED. REPLACED THE STOP LAMP SWITCH, BRAKELIGHT OPERATION IS OK AT THIS TIME.	STATES BRAKE LIGHTS ARE NOT WORKING/ CHECK ADVISE	OPEN	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 22898 DUPLICATED CUST COMPLAINT. TESTEDALL FUSES ALL OK. FOUND THE STOP LAMP SWITCHSHORTED. REPLACED THE STOP LAMP SWITCH.BRAKELIGHT
KM8JN72D65U	8/30/04	7058	32.97				

KM8JM12B65U	4/08/05	39363	33.66	39363 SHORTED VERIFIED ESP INDICATOR LIGHT NOT RESPONDING INTERMITTENTLY / FOUND INTERMITTENTLY OPEN SHORT WITH STOP LAMP SWITCH / INTERNAL FAILURE / NECESSARY TO REMOVE AND REPLACED STOP LAMP SWITCH ASSEMBLY /	CUSTOMER STATES ESP INDICATOR WARNING INDICATOR COMES ON INTERMITTENTLY AND CAN'T SHUT OFF UNLESS IGN IS TURNED OFF AND BACK ON /// SOP H	SHORTED	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 39363 SHORTED VERIFIED ESP INDICATOR LIGHTNOT RESPONDING INTERMITTENTLY / FOUNDINTERMITTENTLY OPEN SHORT WITH STOP LAMP SWITCH / INTERNAL FAILURE / NECESSARY TOREMOVE AND REPLACED STOP LAMP SWITCH ASSEMBLY/
KM8JN72D95U	4/25/05	33455	34.24	C1513 BRAKE LAMP STOP SWITCH INOP NO SIGNAL	CUSTOMER REQUESTS WIPER REPLACEMENT	-	REPLACED WIPER BLADES
KM8JN72D95U	4/25/05	33455	34.24	C1513 BRAKE LAMP STOP SWITCH INOP NO SIGNAL	CUSTOMER STATES ESP LIGHT COMES ON INTERMITTENT - WHEN VEHICLE IS RESTARTED THE ESP LIGHT WILL BE OFF - HAS HAPPENED 3 TIMES - ADVISE	C1513 BRAKE LAMP STOP SWITCH INOP NO SIGNAL	REPLACED BRAKE LAMP SWITCH
KM8JN12DX5U	4/27/05	20015	34.24	C1260 STEERING W/ SENSOR ABNORMAL, C1513 BRAKE LAMP SWITCH , STOP LAMP SWITCH MALFUNCTION	CUSTOMER STATES ESC LIGHT IS ON	C1260-STEERING W/SENSOR-ABNORMAL C1513-BRAKE LAMP SWITCH	REPLACE BRAKE SWITCH AND TEST DROVE.
KM8JN12DX5U	4/27/05	20015	34.24	C1260 STEERING W/ SENSOR ABNORMAL, C1513 BRAKE LAMP SWITCH , STOP LAMP SWITCH MALFUNCTION	CUSTOMER REQUESTS DRIVER AIRBAG COVER MOD REPL (07-01-001)	TUCSON DRIVER AIR BAG COVER MODULE PRODUCTION CHANGE.	PERFORMED DRIVER AIR BAG COVER MODULE REPLACEMENT PER FACTORY BULLETIN. 61B046R0_2
KM8JN12D96U	7/27/05	17253	34.56	C1513 BRAKE LAMP SWITCH INTERMITTENT LOSS OF CONTINUITY THROUGH BRAKE LAMP SWITCH	CUSTOMER STATES CHECK ENGINE LIGHT ON NO RUNNING PROBLEMS	P0130 O2 SENSOR CIRCUIT - MAL. B1S1 INTERMITTENT LOSS OF SIGNAL FROM REAR UPPER O2 SENSOR	REPLACED B1S1 O2 SENSOR
KM8JN12D96U	7/27/05	17253	34.56	C1513 BRAKE LAMP SWITCH INTERMITTENT LOSS OF CONTINUITY THROUGH BRAKE LAMP SWITCH	C/S: ESC LIGHT IS ON	C1513 BRAKE LAMP SWITCH INTERMITTENT LOSS OF CONTINUITY THROUGH BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN12D86U	8/18/05	26181	34.56	C1503 TCS/ESP SWITCH C1237 PRESSURE SENSOR - OTHER C1513 BRAKE LAMP SWITCH INTERMITTENT LOSS OF SIGNAL FROM BRAKE LAMP SWITCH	C/S: THE ESC LIGHT IS ON	C1503 TCS/ESP SWITCH C1237 PRESSURE SENSOR - OTHER C1513 BRAKE LAMP SWITCH INTERMITTENT LOSS OF SIGNAL FROM BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JM12B15U	4/21/05	23830	34.56	C1513 BRAKE LAMP SWITCH, INTERMITTENT LOSS OF SIGNAL FROM BRAKE LAMP SWITCH	C/S: ESC LIGHT IS ON THE PAST TWO NIGHTS, BUT IS NOT ON DURING THE DAY	C1513 BRAKE LAMP SWITCH INTERMITTENT LOSS OF SIGNAL FROM BRAKE LAMP SWITCH	REPLACED BRAKE LAMP SWITCH
KM8JN12D96U	7/28/05	9349	34.24	C1513 BRAKE LAMP SWITCH INOP, SIGNAL DROPPED INTERMITTENTLY	CUSTOMER STATES ESC LIGHT IS ON	C1513 BRAKE LAMP SWITCH INOP, SINGNAL DROPPED INTERMITANTLY	REPLACED BRAKE LAMP SWITCH
KM8JN72D06U	7/15/05	11856	34.56	C1513 BRAKE LANMP SWITCH, INTERMITTENT LOSS OF SIGNAL FROM BRAKE LAMP SWITCH			
KM8JN72D46U	9/23/05	19420	30.96	REPLACED BRAKE LAMP SWITCH	CUSTOMER CONCERN THE ECS LIGHT COMES ON AT TIMES ADVISE	C1513 BRAKE LAMP SWITCH INTERMITANT FAILURE IN BRAKE LAMP SWITCH WATCHED WITH SCAN TOOL	REPLACED BRAKE LAMP SWITCH
KM8JN72DX6U	8/29/05	14997	30.96	CIRCUIT GOOD, TESTED SWITCH, INTERMITTANTLY HAD OPEN CIRCUIT REPLACED BRAKE SWITCH ASSY.	CUSTOMER STATES; ESC LIGHT COMES OFF AND ON AT TIMES--CK/ADV	LAMP NOT ON CURRENTLY, PAST CODE C1513 BRAKE SWITCH STORED IN MEMORY	CIRCUIT GOOD, TESTED SWITCH, INTERMITTANTLY HAD OPEN CIRCUITREPLACED BRAKE SWITCH ASSY.
KM8JN72D56U	9/29/05	11333	30.96				
KM8JN12D16U	10/10/05	17221	30.64		CUSTOMER CONCERN THE REAR DEFROSTER SWITCH DOESN'T LIGHT UP- PLEASE INSTALL SPECIAL ORDERED SWITCH	SHORT IN SWITCH, INTERNAL FAILURE	REPLACED DEFORSTER HEATER SWITCH
KM8JN12D16U	10/10/05	17221	30.64		OWNER REPORTS INTERNAL FAILURE IN RADIO PLEASE INSTALL SP RADIO (TECH 145)	EXAMINED UNIT FOUND INTERNAL FAILURE	INSTALL SP/ORDER RADIO
KM8JN12D16U	10/10/05	17221	30.64		OWNER REPORTS ESC LIGHT COMES ON WHILE DRIVING	FOUND INTERNAL FAILURE IN SWITCH	REPLACED STOP LAMP SWITCH
KM8JN12D16U	10/10/05	17221	30.64		OWNER REQUESTED A RENTAL CAR WHILE VECH WAS IN FOR SERVICE ENTERPRISE RENTAL 9AM---672104	SERVICING VEHICLE	OWNER WAS PROVIDED RENTAL CAR WHILE VECH WAS WORKED ON
KM8JN12D16U	10/10/05	17221	30.64		CUSTOMER STATES; RECEIVED NOTICE FOR DRIVER AIR BAG COVER MODULE REPLACE MENT	DRIVER AIR BAG COVER REDESIGNED	REPLACED DRIVER AIR BAG COVER MODULE
KM8JN12D16U	10/10/05	17221	10		CUSTOMER CONCERN THE REAR DEFROSTER SWITCH DOESN'T LIGHT UP- PLEASE INSTALL SPECIAL ORDERED SWITCH	SHORT IN SWITCH, INTERNAL FAILURE	REPLACED DEFORSTER HEATER SWITCH
KM8JN12D16U	10/10/05	17221	10		OWNER REPORTS INTERNAL FAILURE IN RADIO PLEASE INSTALL SP RADIO (TECH 145)	EXAMINED UNIT FOUND INTERNAL FAILURE	INSTALL SP/ORDER RADIO
KM8JN12D16U	10/10/05	17221	10		OWNER REPORTS ESC LIGHT COMES ON WHILE DRIVING	FOUND INTERNAL FAILURE IN SWITCH	REPLACED STOP LAMP SWITCH
KM8JN12D16U	10/10/05	17221	10		OWNER REQUESTED A RENTAL CAR WHILE VECH WAS IN FOR SERVICE ENTERPRISE RENTAL 9AM---672104	SERVICING VEHICLE	OWNER WAS PROVIDED RENTAL CAR WHILE VECH WAS WORKED ON
KM8JN12D16U	10/10/05	17221	10		CUSTOMER STATES; RECEIVED NOTICE FOR DRIVER AIR BAG COVER MODULE REPLACE MENT	DRIVER AIR BAG COVER REDESIGNED	REPLACED DRIVER AIR BAG COVER MODULE
KM8JM12B76U	10/08/05	28911	30.96		CUSTOMER STATES: THE ESC LIGHT IS COMING ON--CODE C1513 PART IS IN --ORDERED BRAKE SWITICH.	BRAKE LIGHT SWITCH IS OPEN	REPLACE BRAKE LIGHT SWITCH
KM8JM12B16U	9/14/05	11866	34.99		REPLACE LAMP SWITCH / SOP	C15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D86U	7/27/05	14280	35.31		C/S THE CK ENG LT IS ON --SOP FROMLAST RO	N-69-C-15	SENSOR ASSY-OXYGEN RH (UP) RE SENSOR ASSY-OXYGEN RH (UP) RE
KM8JN12D86U	7/27/05	14280	35.31		C/S THE CK ENG LT IS ON --SOP FROMLAST RO	N-69-C-15	SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION SENSOR ASSY-OXYGEN RH ADDSCAN TOOL OPERATION
KM8JN12D86U	7/27/05	14280	35.31		CUSTOMER STATES BRAKE LIGHT OUT	N-94 C-15	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN12D86U	7/27/05	14280	35.31		CUSTOMER STATES BRAKE LIGHT OUT	N-94 C-15	93810RP0--SCANN TEST E

KM8JN72D36U	8/12/05	12097	34.99		C/S THE ESP LIGHT COMES ON,WHEN WAITING AT A LIGHT OR LONGER	N94	SENSOR-PRESSURE SENSOR-PRESSURE
KM8JN72D36U	8/12/05	12097	34.99		PERFORM OPEN CAMPAIGNS	99	DRIVER AIR BAG MODULE REPLACEMENT DRIVER AIR BAG MODULE REPLACEMENT
KM8JN72D36U	8/12/05	12097	34.99		C/S THE ESP LIGHT COMES ON,WHEN WAITING AT A LIGHT OR LONGER	N94	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D75U	6/13/05	8928	21.9				
KM8JN72D86U	7/16/05	9268	32.3		OWNER STATES THE ESC LIGHT IS ON DASH	INOP	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D26U	11/26/05	19823	31.56				
KM8JM12BX6U	8/23/05	11020	21	ADJUST BRAKE LIGHT SWITCH 0650006	CUSTOMER STATES WHEEL WEIGHT APPEARTO HAVE FALLEN OFF	WHEEL WEIGHT SEPERATE	WHEEL BALANCE (2 WHEELS)-ADJUSTMENT WHEEL BALANCE (2 WHEELS)-ADJUSTMENT REBALANCE LEFT FRONT WHEEL
KM8JM12BX6U	8/23/05	11020	21	ADJUST BRAKE LIGHT SWITCH 0650006	CUSTOMER STATES ECS LIGHT COMES ON AND OFF INTERMITTENTLY	DTC C1513 BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE ADJUST BRAKE LIGHT SWITCH 0650006
KM8JN72D26U	7/23/05	15286	31.56				
KM8JN72D65U	4/21/05	11648	31.24				
KM8JN72DX6U	9/27/05	26429	31.56				
KM8JN72D85U	6/15/05	12731	31.24				
KM8JN72D16U	10/31/05	21801	31.24				
KM8JN72D06U	12/17/05	13390	31.56				
KM8JN72D35U	6/11/05	16049	32.3	DTC C1513 BRKE LAMP SWITCH REPLACE BRAKE LAMP SWITCH	CUSTOMER STATES ESP LIGHT COMES ON	DTC C1513 BRAKE LAMP SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE DTC C1513 BRKE LAMP SWITCH REPLACE BRAKE LAMP SWITCH
KM8JN72D75U	6/13/05	27129	31.56	27129 DTC C1513 BRAQKE LAMP SWITCH REPALCE BRAKE LIGHT SWITCH			
KM8JN72D26U	8/08/05	18595	30.34		CUST STATES ESC LIGHT IS ON/ WAS ON YESTERDAY	ESC LIGHT ON TEST C1513 BRAKE SWITCH REPALCED SWITCH REPAIR COMPLETE	SWITCH ASSY-STOP LAMP SWITCH ASSY-STOP LAMP
KM8JN72D26U	8/08/05	18595	30.34		CUST REQUEST RECALL 079	RECALL INSTALL COVER REPAIR COMPLETE	FLASH AIR BAG MODULE FLASH AIR BAG MODULE
KM8JN72D96U	8/17/05	10319	34.1				
KM8JM12B45U	6/11/05	26872	32.14				
KM8JN72D36U	7/21/05	15509	33.28				
KM8JN72DX6U	7/20/05	11475	34.1				
KM8JN72D55U	5/14/05	21999	33.6	21999 CODE C1513			
KM8JN72D46U	9/28/05	9947	32.14				
KM8JN72D76U	7/29/05	10327	32.14		CUSTOMER STATES THE ESC OFF LIGHT IS COMING ON INTERMITENTLY---SOP	SWITCH FAILURE	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JN72D96U	9/29/05	35627	33.6				
KM8JN72D86U	10/28/05	31954	33.6				
KM8JN72D16U	8/16/05	14198	33.6				
KM8JN72D66U	8/10/05	42980	33.6				
KM8JN72D86U	10/05/05	24298	52.86	CUSTOMER STATES BRAKE LIGHT SWITCH IS INOP OPEN IN SWITCH REPLACE SWITCH ASSY SCAN TOOL CODES C1513			
KM8JN72DX6U	9/23/05	11079	31.1				
KM8JN72D06U	10/10/05	10454	55.02	10454 ADD TIME USED HAND HELD SCAN TOOL CODE B1315.			
KM8JN72D46U	11/11/05	16604	31.26	16604 359822 HPP-10/100/4B-02/18/2016 JIMENEZ			
KM8JM12B86U	7/11/05	12589	54.5				
KM8JN72D45U	6/13/05	11528	30.94				
KM8JN72D65U	7/04/05	24062	32.34				
KM8JN72D76U	8/18/05	36568	30.64	36570 CODE C1513 BRAKE LIGHT SWITCH VERIFIED ESC LIGHT COMMING ON CODE C1513/REMOVED AND REPLACED BRAKE LIGHT SWITCH	CUSTOMER STATES;ESC LIGHT GOES OFF AND ON	CODE C1513 BRAKE LIGHT SWITCH	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 36570 CODE C1513 BRAKE LIGHT SWITCH/VERIFIED ESC LIGHT COMMING ON CODEC1513/REMOVED AND REPLACED BRAKE LIGHT SWITCH
KM8JN72D56U	7/16/05	20582	30.96	20583 CODE C1513 VERIFY CUSTOMER CONCERN/CODES STORES C1237,C1513 BRAKE LAMP SWITCH, REMOVED AND REPLACED BRAKE LAMP SWITCH/VERIFIED REPAIR	CUSTOMER STATES;ESC LIGHT KEEPS COMING ON	CODE C1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 20583 CODE C1513 VERIFY CUSTOMER CONCERN/CODES STORES C1237,C1513 BRAKE LAMP SWITCH, REMOVED AND REPLACED BRAKE LAMP SWITCH/VERIFIED REPAIR
KM8JN72D96U	8/08/05	21281	30.96	21281 CODE 1513 VERIFIED ABS ESC LIGHT ON/BRAKE SWITCH INTERNAL FAILURE/REMOVED AND REPLACED BRAKE SWITCH/CHECKS OK	CHECK ENGINE LIGHT	CODE P0400 LARGE EVAP LEAK	CAP ASSY-FUEL TANK CAP ASSY-FUEL TANK 21281 CODE P0400 LARGE EVAP LEAK VERIFIEDCHECK ENGINE LIGHT ON/CODE FOR EVAP LEAK/FUELCAP NOT RATCHETING AND SEALING/R&R GASCAP/CLEARED CODE CHECKS OK
KM8JN72D96U	8/08/05	21281	30.96	21281 CODE 1513 VERIFIED ABS ESC LIGHT ON/BRAKE SWITCH INTERNAL FAILURE/REMOVED AND REPLACED BRAKE SWITCH/CHECKS OK	CHECK ENGINE LIGHT	CODE P0400 LARGE EVAP LEAK	CAP ASSY-FUEL TANK ADD SCAN TOOL OPERATION CAP ASSY-FUEL TANK ADD SCAN TOOL OPERATION 21281 CODE P0400 LARGE EVAP LEAK VERIFIEDCHECK ENGINE LIGHT ON/CODE FOR EVAP LEAK/FUELCAP NOT RATCHETING AND SEALING/R&R GASCAP/CLEARED CODE CHECKS OK
KM8JN72D96U	8/08/05	21281	30.96	21281 CODE 1513 VERIFIED ABS ESC LIGHT ON/BRAKE SWITCH INTERNAL FAILURE/REMOVED AND REPLACED BRAKE SWITCH/CHECKS OK	CUSTOMER STATES/ESC LIGHT AND ABS LIGHT STAYING ON	CODE 1513	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 21281 CODE 1513 VERIFIED ABS ESC LIGHTON/BRAKE SWITCH INTERNAL FAILURE/REMOVED ANDREPLACED BRAKE SWITCH/CHECKS OK

KM8JN72D76U		9/23/05	15860	30.04	15860 INSTALLED SOP BRAKE LIGHT SWITCH WAS STICKING AT TIMES REMOVED AND REPLACED VERIFIED REPAIR	STABILITY CONTROL SWITCH	BRAKE LIGHT SWITCH NOT WORKING CORRECTLYINTERMITTENT AND STICKING	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 15860 INSTALLED SOP BRAKE LIGHT SWITCH WASSTICKING AT TIMES REMOVED AND REPLACEDVERIFIED REPAIR
KM8JN72D95U		5/23/05	18670	30.96		CUSTOMER STATES;ESC LIGHT OFF AND ON	ESC LIGHT ON	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE
KM8JM12B46U		9/16/05	33730	30.96	33731 CODE 1513 BRAKE LIGHT TESTED ABS ESC CODE 1513/BRAKE LIGHT SWITCH/MONITOR CURRENT DATA BRAKE SWITCH IS OFF ALL THE TIME/REPLACED SWITCH VERIFIED REPAIR	CUSTOMER STATES;ESC LIGHT IS COMINGOFF AND ON	CODE 1513 BRAKE LIGHT	SWITCH ASSY-STOP LAMP RE SWITCH ASSY-STOP LAMP RE 33731 CODE 1513 BRAKE LIGHT TESTED ABS ESCCODE 1513/BRAKE LIGHT SWITCH/MONITOR CURRENTDATA BRAKE SWITCH IS OFF ALL THE TIME/REPLACED SWITCH VERIFIED REPAIR
KM8JM72B85U		7/06/05	31582	29.46				
KM8JN72DX5U		7/04/05	33744	29.46		CUSTOMER STATES: ESC LIGHT ON IN DASH	CAUSE: VERIFIED CONCERN, FOUND THAT BRAKE LIGHT SWITCH FAILED	CORRECTION: REPLACED SWITCH, RETEST ALL OK
KM8JN72D45U		6/24/05	33821	31.1		CUSTOMER STATES: ESC LIGHT IS ON	CAUSE: BRAKE SWITCH HAS INTERNAL FAILURE	CORRECTION: REPLACED BRAKE SWITCH, RETEST ALL OK
KM8JN72D45U		6/24/05	33821	31.1		CUSTOMER STATES: FLOOR MATS ARE FALLING APART	CAUSE: DRIVERS SIDE FRONT AND PASSENGER SIDE REAR FLAPS ARE COMING APART AT	CORRECTION: REPLACED FLOOR MATS
KM8JN72D45U		6/24/05	33821	31.1		CUSTOMER STATES: ANTENNA WILL NOT STAY IN PLACE	CAUSE: ANTENNA HINGE IS BROKEN	CORRECTION: REPLACED ANTENNA RETEST ALL OK
KM8JN72D76U		8/17/05	24300	30.66	CUSTOMER STATES INSTALL SOP BRAKE LAMP SWITH. PERFORMED SCAN TEST AND FOUND SCAN CODE C1513, FROM PREVIOUS RO # 456132. FOUND BRAKE LAMP SWITCH FAULTY. REMOVED AND REPLACED BRAKE LIGHT SWITCH.	C/S CAR STALLS WHEN TURNING AROUND CORNER ATLOW SPEEDS	SCANNED FINDING CODE PO123 FOUND INTERNAL FALIURE IN TPS	REPLACED TPS CAR RUNNING GREAT AT THIS TIME
				\$222,952				

QAJM-C-071104

HYUNDAI

QUALITY INFORMATION
REPORT

CONFIDENTIAL

Model Code JM	Subject Code* CHASSIS	Severity Code 7	HMA Report Number QAJM-C-071104	
Creation date/time/user: 11/29/2007 09:51:27 AM by Casey Shah		Analyst:* Casey Shah	Co-analyst(s): Rolf Brandt	Modified date/time/user: 11/29/2007 09:52:06 AM by
Distributor* HMA	Country* USA	Vendor Info INFAC	Causal part No 93810-3K000	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model* TUCSON	Engine or Transmission #* G6BA5417865	Lot # PA66-GF30	Production Date* (MM/DD/YY) 12/05/2005	
VIN* KM8JN72D86U	Mileage* 10,452	Repair Date (MM/DD/YY) 10/17/2007	Delivery Date* (MM/DD/YY) 4/19/2006	
Subject* [B] STOP LAMP SWITCH ASSEMBLY – INTERMITTENT MALFUNCTION – DTC C1513				

Types of QIR					
<input type="checkbox"/> General	<input checked="" type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date:

Report Number : QAJM-C-071104

- **Customer statement:**
 - Customer complaint “ESC” indicator light ON the dash.

VIN Number	Prod Date	Mileage	Total Cost	Technician Comment	Customer Complaint	Notes Comment	Technician Conclusion
KWLNJ2D47U	3/15/17	8516	33.36	CUSTOMER STATES LIGHT'S FLICKER/SCANNED FOR CODES B1513 SHORT IN BRAKE LIGHT SWITCH/REPLACED SWITCH	ESC LIGHT COMES ON INTERMITTENTLY, INSTRUMENT FLICKERS	SCANNED FOR CODES.	B1513 REPLACED BRAKE LIGHT SWITCH.
KWLNJ2D33U	2/21/17	51	36.66		CUSTOMER STATES - DASH E.S.C LIGHT IS ON, INSPECT & ADVISE.	TECH VERIFIED DASH E.S.C LIGHT IS ON. SET VEHICLE ON DIAGNOSTIC SCANNER, FOUND CODE C1513 BRAKE SWITCH ERROR. PERFORMED INSPECTION, FOUND BRAKE SWITCH HAS AN INTERNAL OPEN CIRCUIT.	REMOVED AND REPLACED BRAKE SWITCH. CLEARED CODES. SWITCH TESTED OKAY. CODE DID NOT RETURN.
KWLNJ2D56U	1/20/17	2496	32.14	ESC LIGHT COMES ON WHILE DRIVING, REPLACED STOP LAMP SWITCH TO FIX CONCERN	CUSTOMER COMPLAINS THAT ESC LIGHT COMES ON WHILE DRIVING.	BRAKE STOP LIGHT SWITCH	INSPECT TEST AND REPLACE 93810900.3 / 1644 / C15
KWLNJ2D56U	1/19/17	1597	33.04		CUSTOMER STATES ESC OFF LIGHT STAYS ON	CODE C1513 PRESENT	REPLACED STOP LAMP SWITCH
KWLNJ2D73U	1/12/16	644	38.16		CUST STATES ESC LIGHT IS ON	PERFORMED SCAN TOOL TEST AND FOUND CODE C1513 BRAKE SWITCH OPEN	REPLACED BRAKE SWITCH AND CLEARED CODE. TESTED OK AT THIS TIME
KWLNJ2D23U	1/13/16	4268	33.09		CUSTOMER STATES THE ESC LIGHT INTERMITTENTLY KEEPS COMING ON	INOPERATIVE.	SWITCH ASSY-STOP LAMP RE. SWITCH ASSY-STOP LAMP RE.
KWLNJ2D73U	1/14/16	1583	35.54	1583 SCAN VEH FOUND CODE C1513 BRAKE SWITCH CIRCUIT MAL. TESTED SWITCH INTERNAL. SHORT. REPLACE OK AT THIS TIME	C/S THAT THE ESC LIGHT STAYS ON	ESC LIGHT STAYS ON	SWITCH ASSY-STOP LAMP RE. SWITCH ASSY-STOP LAMP RE. 1583 SCAN VEH FOUND CODE C1513 BRAKE SWITCH CIRCUIT MAL. TESTED SWITCH INTERNAL. SHORT. REPLACE OK AT THIS TIME
KWLNJ2D67U	1/13/16	819	54.66	ADD LTIME FOR SCAN TOOL.	CUST STATES INTERMITTENTLY ESC OFF LIGHT WILL COME ON AND NOT GO OFF UNTIL IGNITION SHUT OFF	C1513	STOP LAMP SWITCH ASSY RE. STOP LAMP SWITCH ASSY RE.
KWLNJ2D53U	1/10/16	7938	55.86	VEH CAME IN ESC LIGHT DISPLAYED. SCANNED VEH. FOUND CODE C1513. FAULTY BRAKE LIGHT SWITCH. REPLACED BRAKE LIGHT SWITCH. CLEARED CODE. RETESTED OKAY.	CUSTOMER STATES ESC LIGHT CAME ON TODAY BUT GOES AWAY ONCE SHE RESTARTS THE VEHICLE	SCAN TOOL CODE C1513 FAULTY BRAKE LIGHT SWITCH	REPLACED BRAKE LIGHT SWITCH AND TEST DROVE VEHICLE FOR NORMAL OPERATION
KWLNJ2D33U	1/10/16	3	29.4	SCAN ELECTRONIC STABILITY CONTROL SYSTEM WITH G.D.S.-C1237 PRIMARY PRESSURE SIGNAL / C1513 BRAKE SWITCH CIRCUIT. CLOSED BY FAULTY STOP LAMP SWITCH - CLEARED CODES. VERIFIED PROPER OPERATION	UPON INSPECTION FOUND ESC OFF LAMP ALWAYS ON PLEASE CK AND ADVISE	CAUSED BY FAULTY STOP LAMP SWITCH	ADD SCAN TOOL INSPECTION E.S.C E.C.T. SWITCH ADD SCAN TOOL OPERATION SCAN ELECTRONIC STABILITY CONTROL SYSTEM WITH G.D.S.-C1237 PRIMARY PRESSURE SIGNAL / C1513 BRAKE SWITCH CIRCUIT. CLOSED BY FAULTY STOP LAMP SWITCH - CLEARED CODES. VERIFIED PROPER OPERATION

- **Technician statement:**
 - Technician verified the condition and retrieved the DTC C1513 (Brake Switch Error) code.
- **Customer driving habit / operation condition:**
 - Stop and go with extended period of stopping with brakes applied.
- **Road condition:**
 - City roads
- **Weather condition:**
 - Humid
- **Vehicle speed:**
 - Low speeds under 20 mph
- **Number of passengers:**
 - One
- **Region:**
 - Western
- **Other comments:**
 - None

Analysis:

Date:

Report Number : QAJM-C-071104

- The incident vehicle had three previous repairs as shown below.

WPC008 M00021791		Hyundai Motor America	
CSHAH		Claim Inquiry Bu Vin, R/O, Claim	
VIN :	KM8JN72D86U	Tucson (JM) V-6	2006 Total C
Dealer:		Claim No:	R/O No:

A Delr	Claim#	R/O No	VR C/T R/O Date Mileage OP Code


OR024	29677A	029677 00	G 10/17/2007 10,452 93810AZZ
OR024	29430A	029430 01	W 10/02/2007 10,452 93810R00
OR024	28495A	028495 00	R 8/09/2007 8,843 618046R0
OR024	24718B	024718 01	W 1/05/2007 4,999 93810R00
OR024	23378A	023378 00	W 10/13/2006 3,473 59150R00
OR024	22972A	022972 00	W 9/18/2006 3,197 93810R00
OR024	22827A	022827 00	W 9/08/2006 2,976 89831R0B
OR024	22827B	022827 00	W 9/08/2006 2,976 95440RP0
OR024	19050A	019050 00	I 1/20/2006 5 PREDELIV
OR024	19050B	019050 00	W 1/20/2006 5 81641R00

- At the 4th repair, FSE (Field Service Engineer) got involved to determine the cause of the multiple repairs.
- The incident switch was cut open to monitor the dynamics of the DTC C1513 setting as shown.



- The diagram below provides the following information:
- The picture to the right is a page from the electrical troubleshooting manual (ETM) that shows brake light switch inputs to the electronic stability control (ESC) control unit.


- The switch between terminals 2 and 4 is the brake light switch that closes when the brakes are applied. Output 12V.
- The switch between terminals 3 and 4 is the brake switch that opens when the brakes are applied. Output 0 V.
- If the ESC control module sees both brake switch and brake light switch in the same state for >500ms and the brake pressure is >20 bar DTC C1513 is set.

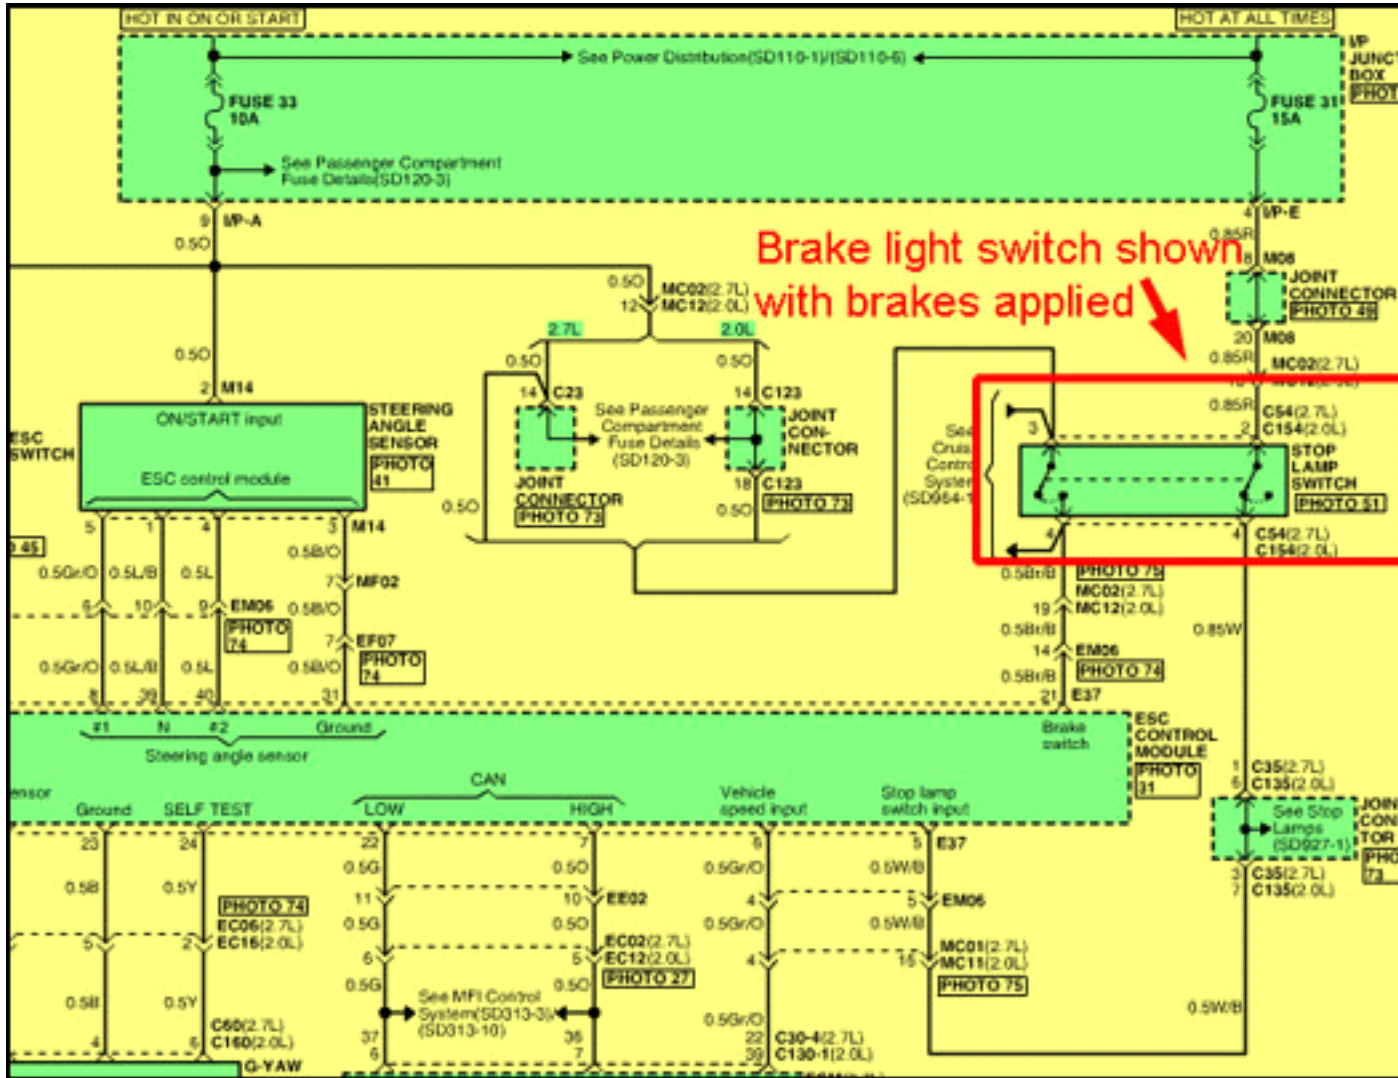


- The brake pressure and brake switch voltage was monitored that set the DTC C1513 as shown.
- The picture below shows the event that set the DTC C1513. The brake light switch is on, the brake switch is on and the brake pressure is >20 bar.
- The brake lights were ON during the event.





- The picture below shows the internal components of the brake light switch.
- After extended operation, the “Brake Switch” contacts closed with brake pressure present and the brake lights on, causing the DTC C1513 to set.

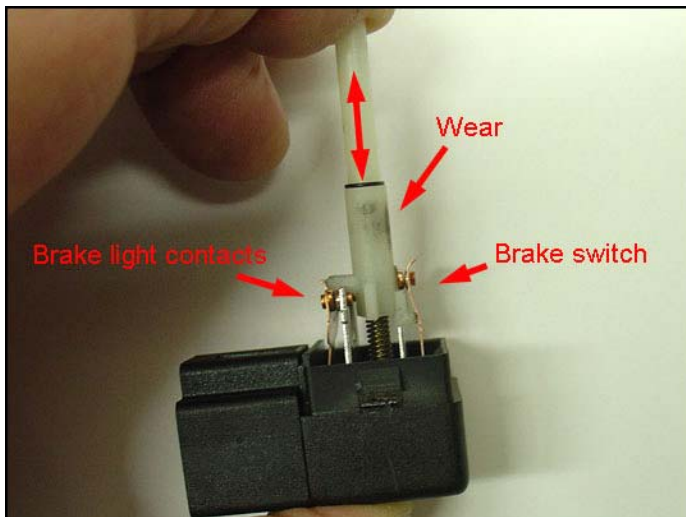


- From this exercise, the following was realized:
 - That the DTC C1513 can occur if one of the following conditions can occur:
 - Brake switch contacts get hot and loose the continuity
 - Brake contacts burn out
 - Plunger hang-up in the cylinder
 - Switch not adjusted correctly
 - Grease in the switch may contaminate the contacts
 - One of the connectors in the harness looses contact
 - Brake pressure switch acts erratically
- The part warranty data provides the following information:

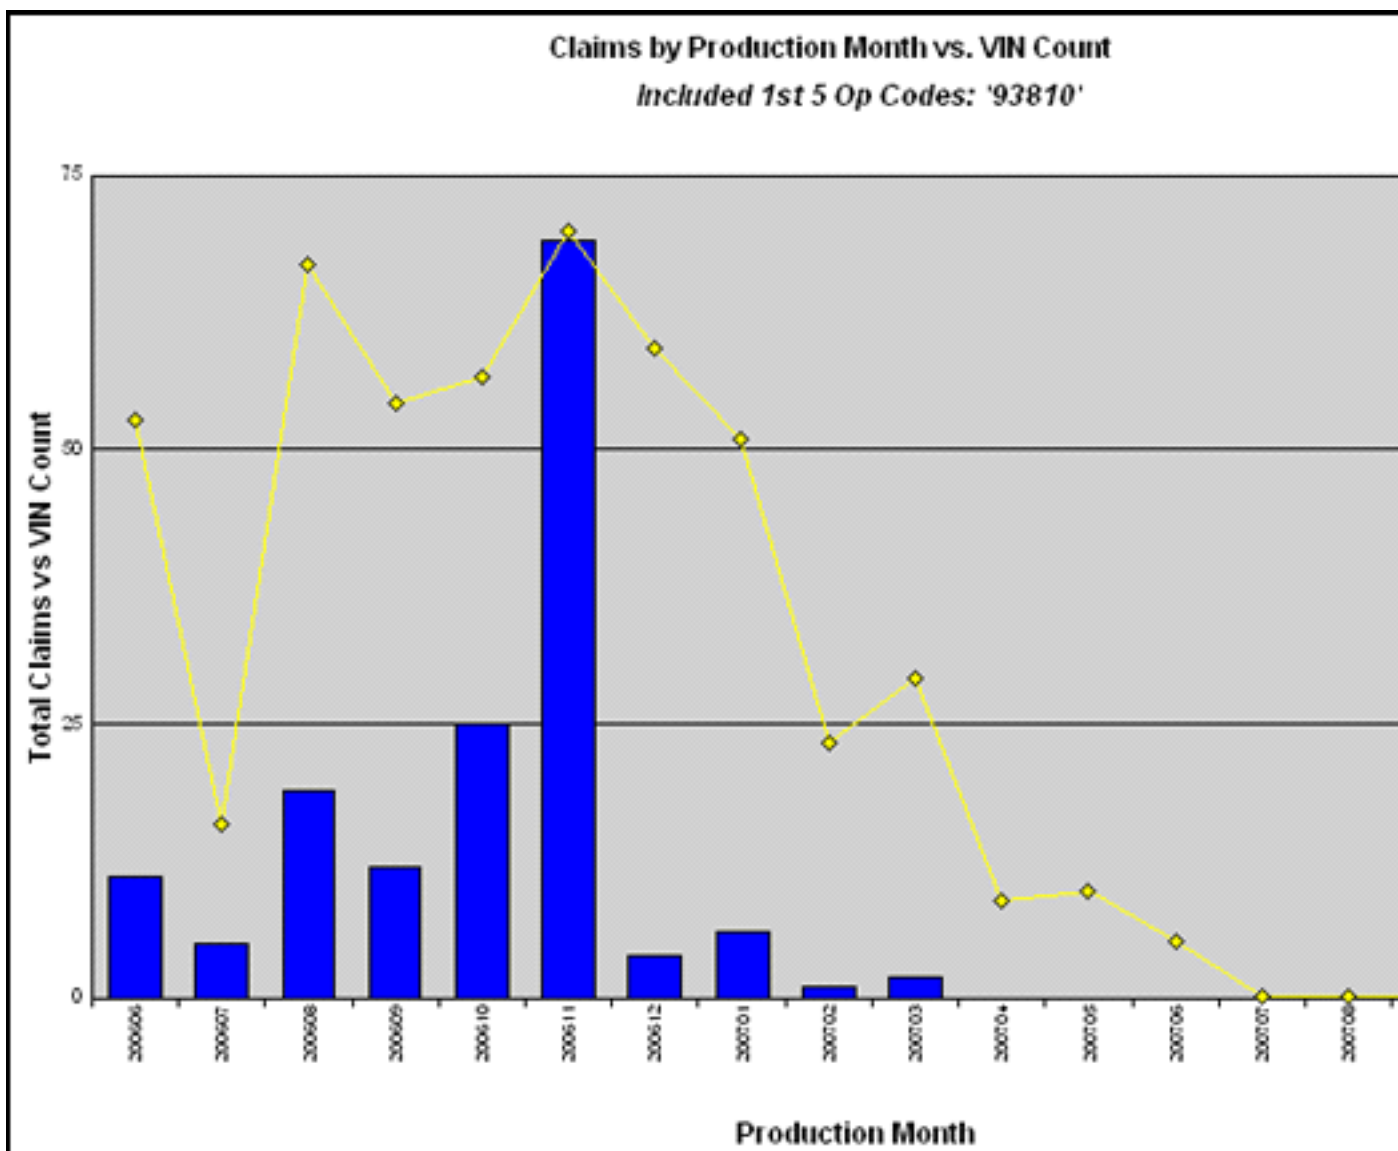


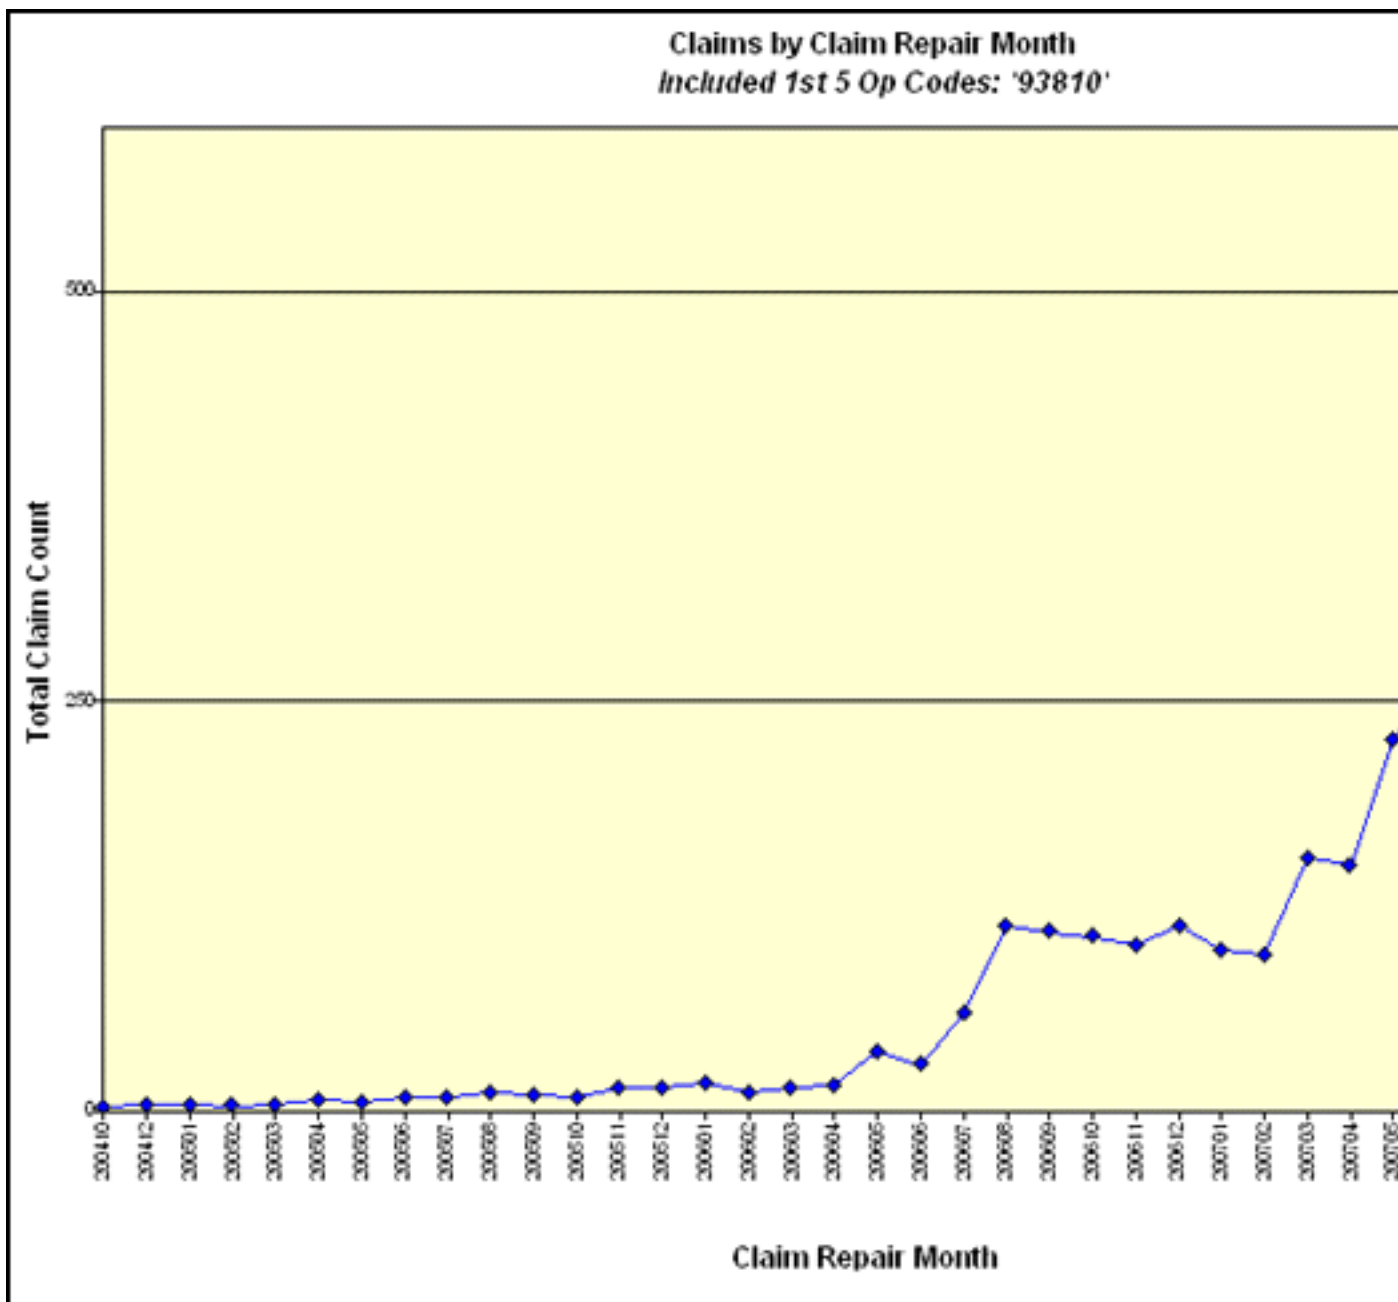


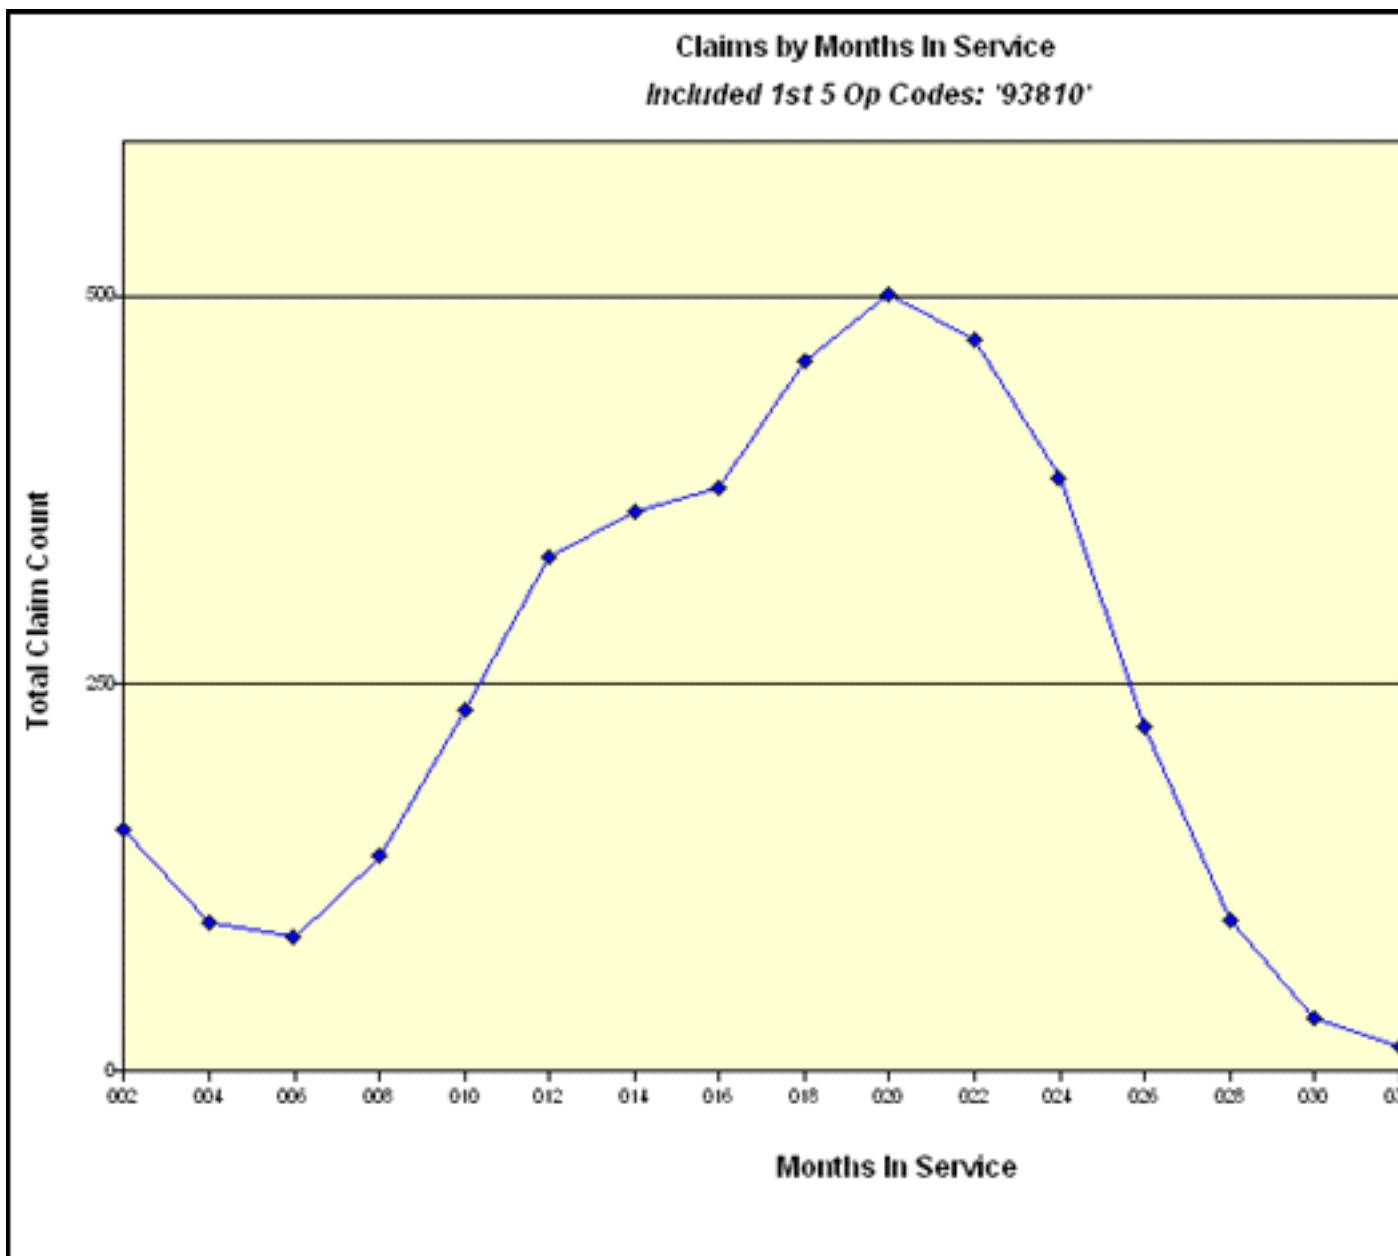

Defects by Mileage Range
Included 1st 5 Op Codes: '93810'

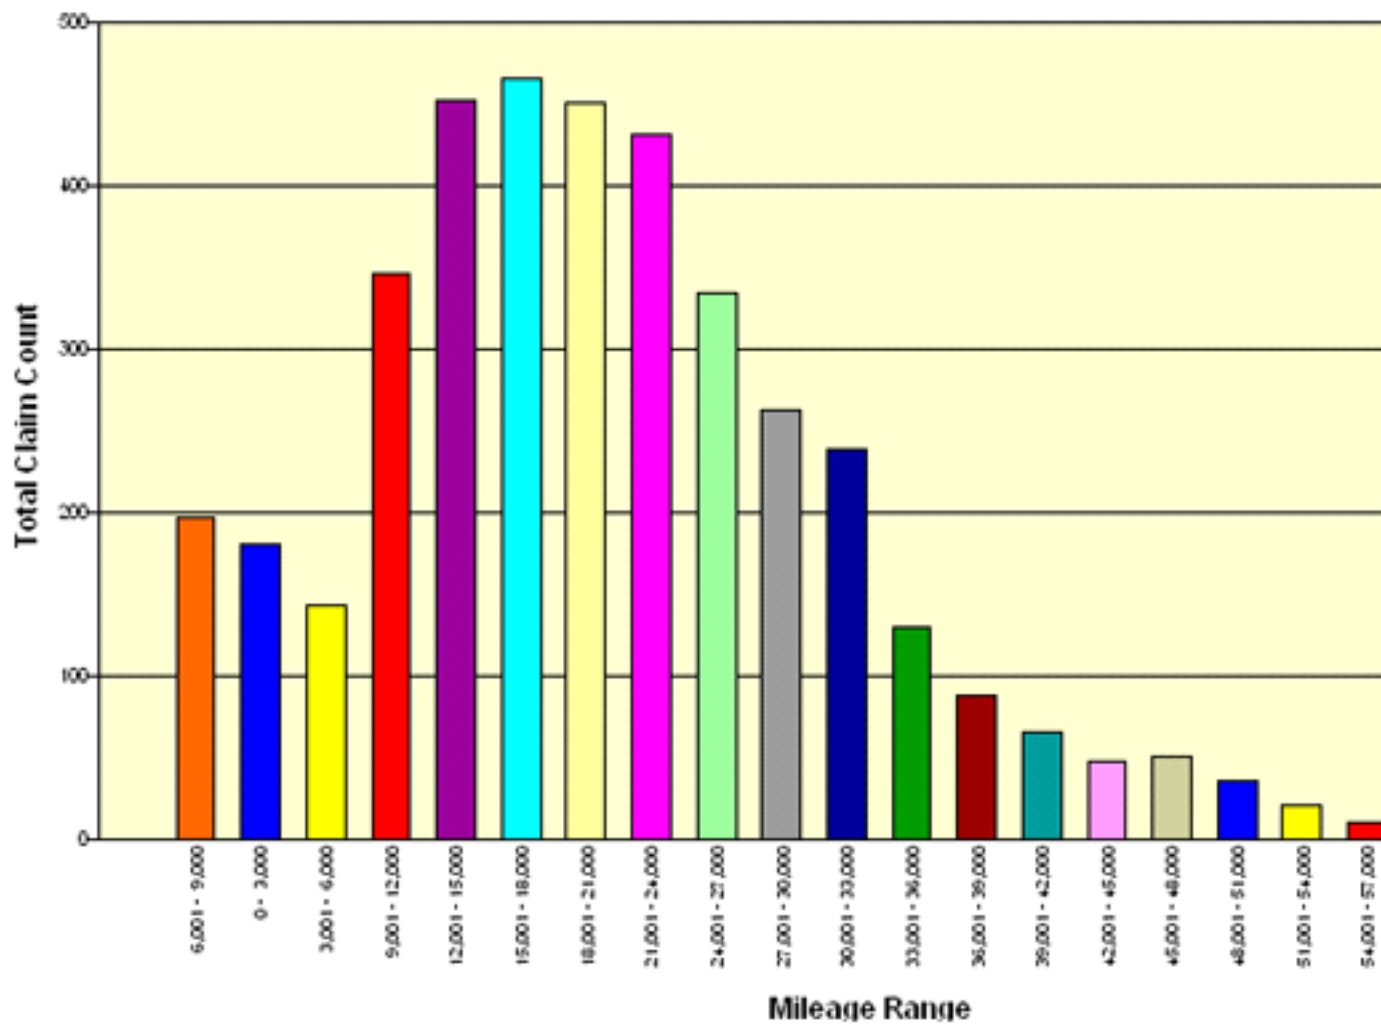

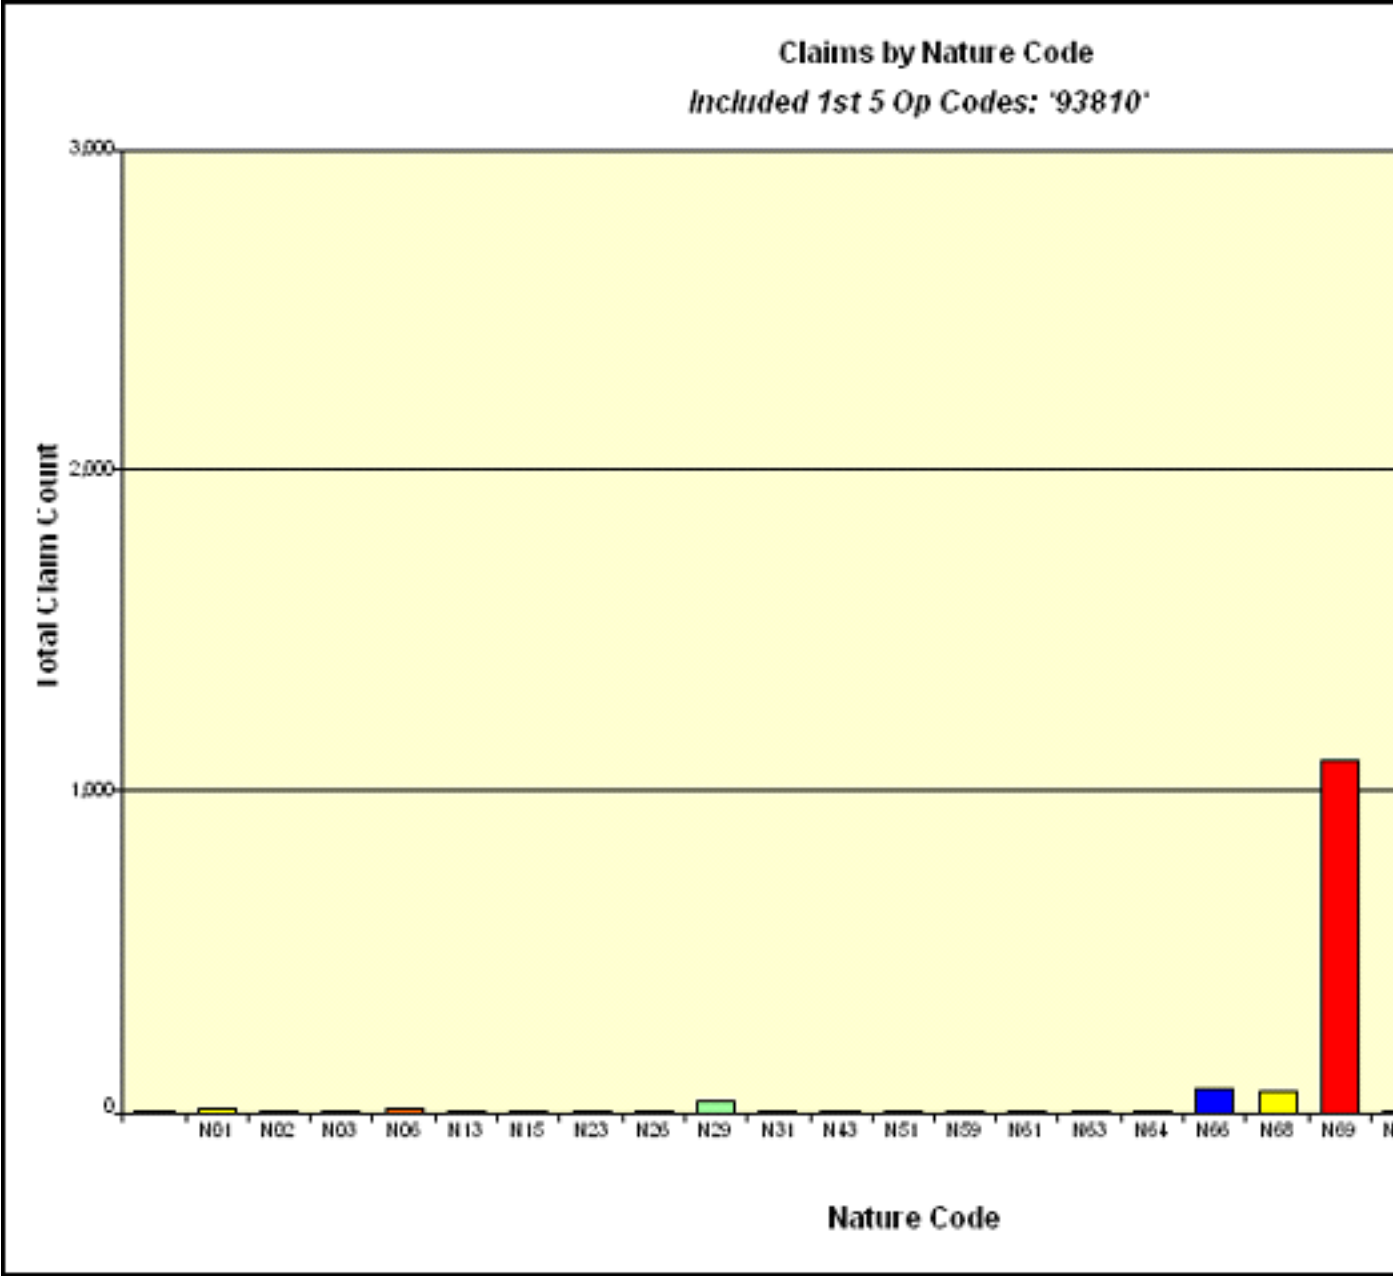

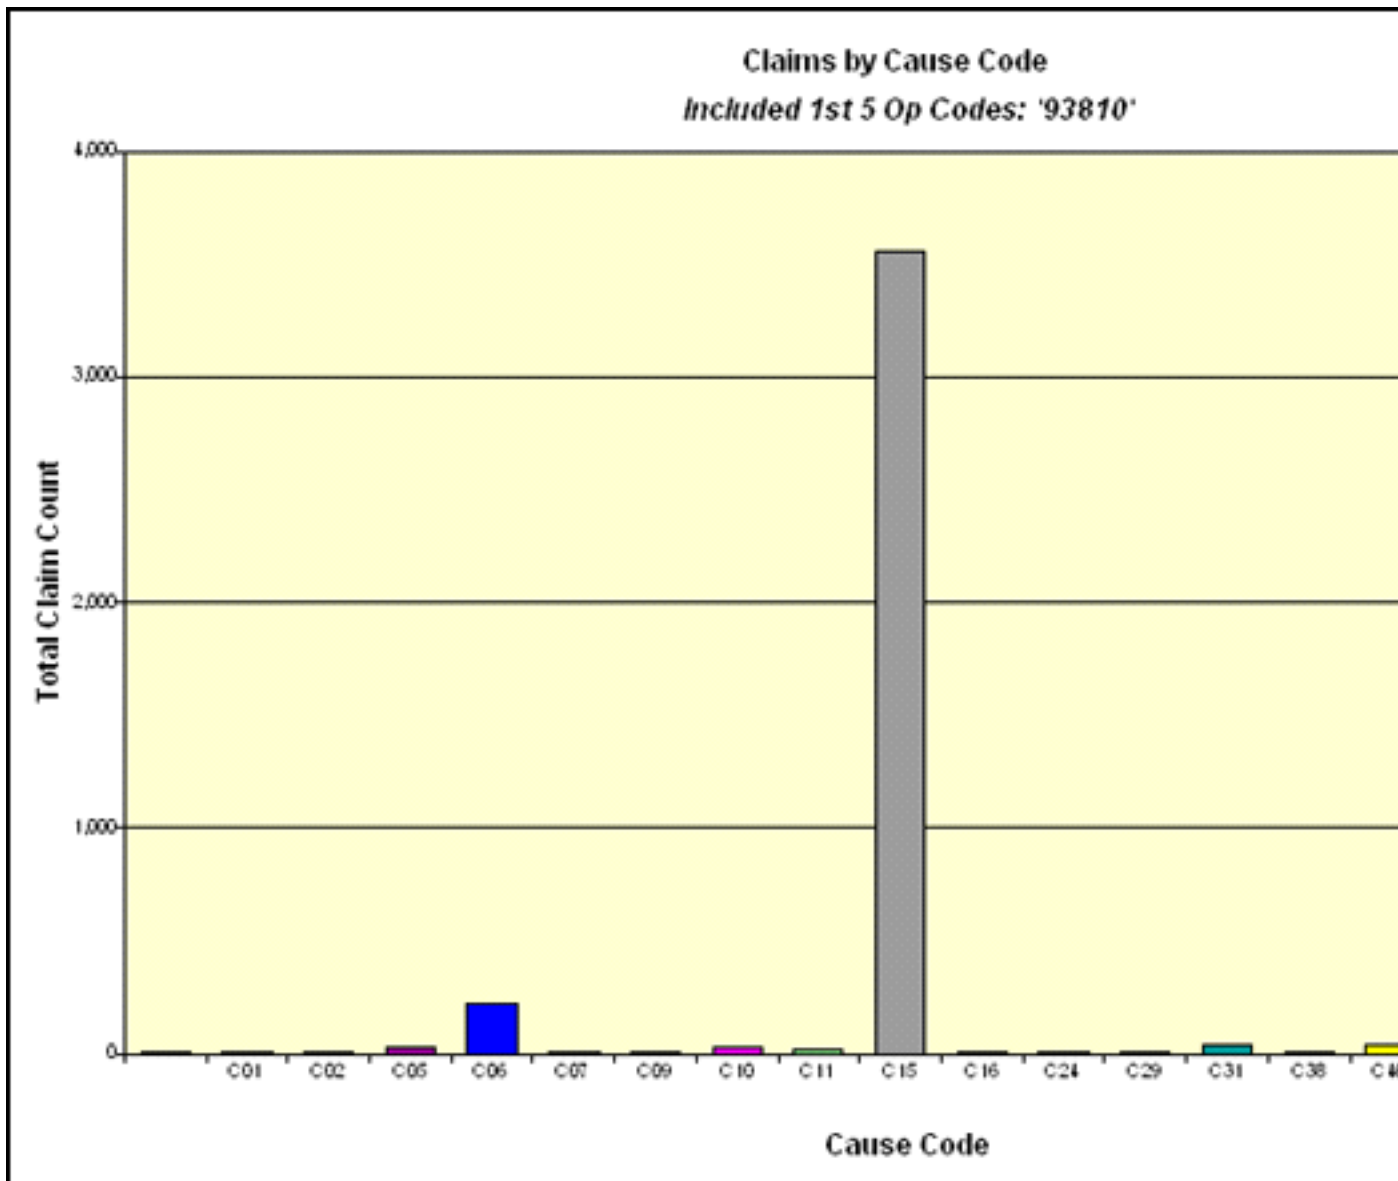

Summary		
Production Date : All	Region : All	Months in Service : All
Claims Paid Date : All		Mileage Range : All
Claims Repair Date : All		
Model Year : All	DMRS Group Code : All	Body Style : All
Model Code : JM	Tread Act Group Code : All	Trim Level : All
Warranty Claim Type : All	Cause Code : All	Exterior Color : All
Transmission Type : All	Nature Code : All	Interior Color : All
Engine Code : All	Plant Code : All	
Belts/Clon Flag : All	Port Claim : X	
Included Op Code : All Int5 Op Code : '93810' Causal Part No : All Int5 Causal Part No : All Installed Part No : All Int5 Installed Part No : All		Excluded Op Code : All Int5 Op Code : All Causal Part No : All Int5 Causal Part No : All Installed Part No : All Int5 Installed Part No : All
Business Processing Date : 11-28-2007 Run Date : 11/29/07 07:56 AM		

Corrective Action:

Date:

Report Number : QAJM-C-071104

- **Dealer fix:**
 - Replace brake switch, P/N: 93810-3K000.
Note: Many times replacing the switch corrects the condition for a while but the vehicle returns as was the situation in this incident. The driver was advised not to hold the brake for an extended period.
- **Repair procedure:**
 - Replace stop lamp switch using the procedure provided in the shop manual
Note: The TABLE below provides the part history. The warranty shows that there is a high warranty for all parts meaning the improved parts do not correct the incident conditions. This part is common to many models and similar warranty shows on other models also.

<input type="checkbox"/>	93810A	93810-38100	SWITCH ASSY-STOP LAMP(4P)	1	08/09/2004	04/04/2
▼ History Available...						
<input type="checkbox"/>	93810-38110	SWITCH ASSY-STOP LAMP(4P)				
<input type="checkbox"/>	93810-38100	SWITCH ASSY-STOP LAMP(4P)				
▶ TSB Available...						
<input type="checkbox"/>	93810A	93810-3K000	SWITCH ASSY-STOP LAMP(4P)	1	04/04/2005	00/00/1
▶ TSB Available...						
<input type="checkbox"/>	93810A	93810-3K000	SWITCH ASSY-STOP LAMP(4P)	1	04/04/2005	00/00/1
▶ TSB Available...						
<input type="checkbox"/>	93810A	93810-3K000	SWITCH ASSY-STOP LAMP(4P)	1	04/04/2005	00/00/1
▶ TSB Available...						
<input type="checkbox"/>	93810A	93810-3K000	SWITCH ASSY-STOP LAMP(4P)	1	04/04/2005	00/00/1
▶ TSB Available...						
<input type="checkbox"/>	93810A	93810-3K000	SWITCH ASSY-STOP LAMP(4P)	1	04/04/2005	00/00/1
▶ TSB Available...						
<input type="checkbox"/>	93810A	93810-3K000	SWITCH ASSY-STOP LAMP(4P)	1	04/04/2005	00/00/1
▶ TSB Available...						

Comments and Recommendations:

Date:

Report Number : QAJM-C-071104

- **Production C/M:**
 - HMC should investigate this condition and apply corrections as soon as possible.
- **Port action:**
 - Not required at this time as replacement part may or may not correct the condition permanently.
- **Field fix:**
 - Required from HMC as soon as improved parts are available.
- **TSB:**
 - HMC should provide a TSB with the improved parts.
- **Other comment:**
 - As the stop lamp switch also provides input to auto shift release, sometimes customers complain that the shifter cannot be released from the PARK position.

Attachments:

Date:

Report Number : QAJM-C-071104



QIR 50 JM Stop Lamp SW.doc



Claim Detail with Comments.xls

QAMC-C-060621

Attachment

QUALITY INFORMATION REPORT

CONFIDENTIAL

Model Code	Subject Code*		HMA Report Number	
MC CHASSIS				
Creation date/time/user:	Analyst:*	Co-analyst(s):	Modified date/time/user:	
Jo	shua Vedder			
Distributor*	Country*	Date	HMC Report Number	Attachments
HMA USA				<input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input type="checkbox"/> Other
Model*	Engine or Transmission Number*		Production Date*	
MC G4ED5	302230		11/20/2005	
Vehicle Identification Number*	Mileage*		Delivery Date*	
KMHCN46C46U0			4/27/06	
Subject* e.g. [A] SUBJECT – EARLY WARNING/PORT ISSUE – HMMA/HMC				
[B] BRAKE SWITCH NO CONTINUITY – EARLY WARNING - HMC				

1. Condition:

Customer complains of brake lights stuck on.

Repair Date: 5/15/06


Op Code: 93810R00

Part #: 93810-38110

2. Analysis:

HMA has received 3 brake switches. 4 have been replaced under warranty. All three exhibited the same conditions.

This switch is common with NF and TG. The switch consists of 2 circuits; the MC only utilizes one circuit because MC does not have cruise control. The circuit consists of two contacts, either will complete the circuit. As the plunger is depressed by the brake pedal it displaced the brake light circuit. When the brake pedal is released the circuit is completed.

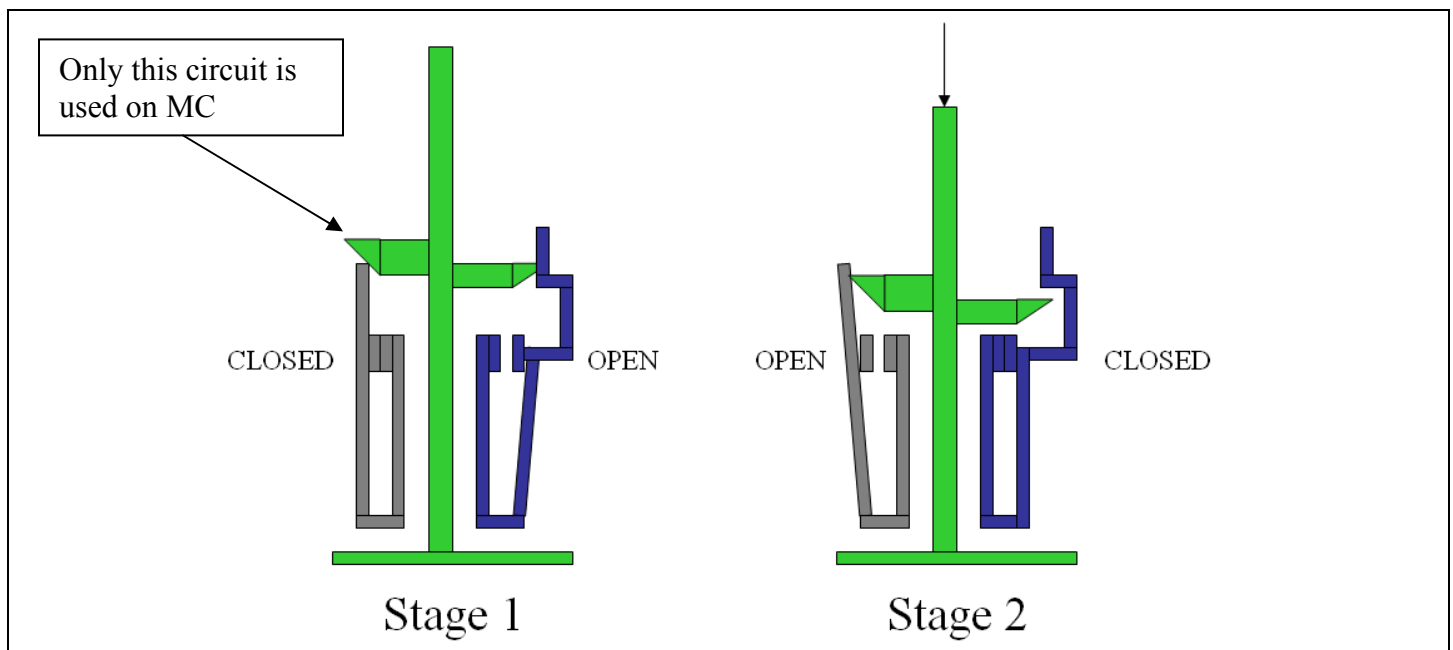



The stamping process appears to be bending the switch so that only one contact is touching when the brake pedal is not applied. The current level could be too high for the single contact. All 3 switches exhibited excessive heat on the same contact.



Lot codes, part number and manufacturer.



PHOTO.32

Diagram illustrating the E39 Stop Lamp Switch circuit. The circuit starts with a power source (HOT AT ALL TIMES) connected to the MP JUNCTION BOX (PHOTO 26). The power flows through a STOP LP 15A fuse to the E39 Stop Lamp Switch (PHOTO 32). The switch is connected to the MP-F (10) and MP-E (2) terminals. The circuit then branches into four paths:

- Left Path:** Connects to the PCM (PHOTO 22) via C01-1 (PHOTO 62).
- Second Path:** Connects to the REAR COMBINATION LAMP LH (PHOTO 68) via F17 (PHOTO 62).
- Third Path:** Connects to the REAR COMBINATION LAMP RH (PHOTO 69) via F16 (PHOTO 63).
- Right Path:** Connects to the HIGH-MOUNTED STOP LAMP (PHOTO 67) via F20 (PHOTO 62) and the HIGH-MOUNTED STOP LAMP (PHOTO 73) via R03 (PHOTO 74).

The diagram also shows the E28 Ignition Lock Switch (PHOTO 32) and the ABS Control Module (PHOTO 15) connected to the circuit.

PHOTO.32

PHOTO 26: MP JUNCTION BOX

PHOTO 32: E39 STOP LAMP SWITCH

PHOTO 32: E28 IGNITION LOCK SWITCH

VIN Number	Prod Date	MOS	Mileage	Allowed Cost	Technician Comments
KMHCHN46C86U	2005 -10-29	4.8	6,413.	\$36.08	
KMHCHN46C26U	2005 -11-22	0.9	1,102.	\$33.68	
KMHCHN46C46U	2005 -11-20	0.6	724.	\$32.78	
KMHCHN46C96U	2005 -11-09	2.9	3,335.	\$33.84	FOUND STOP LAMP SWITCH INT ERMITTENTLY SHORTING, CAUSING BRAKE LIGHTS TO S TAY ON.

Dealer – Replace switch, adjust using TSB: 06-50-006.

HMA requests that HMC investigate this failure to determine if excessive current is being transmitted through the brake switch. Also HMC should determine if the design is robust enough for a single contact to carry all the current in the circuit without overheating.

QAMC-C-060621

HYUNDAI

QUALITY INFORMATION
REPORT

CONFIDENTIAL

Model Code MC	Subject Code* CHASSIS	Severity Code	HMA Report Number QAMC-C-060621	
Creation date/time/user: 06/05/2006 11:22:15 by Joshua Vedder		Analyst:* Joshua Vedder	Co-analyst(s):	Modified date/time/user: by
Distributor* HMA	Country* USA	Vendor Info	Causal part No	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input type="checkbox"/> Other
Model* MC ACCENT	Engine or Transmission #* G4ED5302230	Lot #	Production Date* (MM/DD/YY) 11-20-2005	
VIN* KMHCN46C46U [REDACTED]	Mileage* 724	Repair Date (MM/DD/YY)	Delivery Date* (MM/DD/YY) 04-27-2006	
Subject* [B] BRAKE SWITCH NO CONTINUITY - EARLY WARNING - HMC				

Types of QIR					
<input type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date: 06/05/2006

Report Number :

Customer complains of brake lights stuck on.
Repair Date: 5/15/06
Op Code: 93810R00
Part #: 93810-38110

Analysis:

Date: 06/05/2006

Report Number :

HMA has received 3 brake switches. 4 have been replaced under warranty. All three exhibited the same conditions.

This switch is common with NF and TG. The switch consists of 2 circuits; the MC only utilizes one circuit because MC does not have cruise control. The circuit consists of two contacts, either will complete the circuit. As the plunger is depressed by the brake pedal it displaced the brake light circuit. When the brake pedal is released the circuit is completed.

The stamping process appears to be bending the switch so that only one contact is touching when the brake pedal is not applied. The current level could be too high for the single contact. All 3 switches exhibited excessive heat on the same contact.

Warranty Data:

VIN Number	Prod Date	MOS	Mileage	Allowed Cost	Technician Comments
KMHCHN46C86U	2005-10-29	4.8	6,413.	\$36.08	
KMHCHN46C26U	2005-11-22	0.9	1,102.	\$33.68	
KMHCHN46C46U	2005-11-20	0.6	724.	\$32.78	
KMHCHN46C96U	2005-11-09	2.9	3,335.	\$33.84	FOUND STOP LAMP SWITCH INTERMITTENTLY SHORTING, CAUSING BRAKE LIGHTS TO STAY ON.

Corrective Action:

Date: 06/05/2006

Report Number :

Dealer – Replace switch, adjust using TSB: 06-50-006.

Comments and Recommendations:

Date: 06/05/2006

Report Number :

HMA requests that HMC investigate this failure to determine if excessive current is being transmitted through the brake switch. Also HMC should determine if the design is robust enough for a single contact to carry all the current in the circuit without overheating.

Attachments:

Date: 06/05/2006

Report Number :



Brake Switch.doc

QANF-B-090202



Attachment



Subject: [A] ESC Light ON C1513. Brake SW
Ground – Early Warning - (HMMA)

General	Early Warning	Serviceability	Port	Monitoring	VDS
---------	---------------	----------------	------	------------	-----

QIR Type		X				
----------	--	---	--	--	--	--

Model Code	Subject Code	Severity	Report Number
(NF) Sonata	Trim	5	QANF-B-090103
VIN 	Prod Date	Repair Date	Nature Code
5NPET46F88H 	07/09/2007	01/15/2008	N94
Causal Part #	Delivery Date	Mileage	Cause Code
93810-3K000	02/28/2008	15500	C29


1. Issue Description

- Customer complains ESC light ON.
- Technician confirmed poor G32 ground.



2. Part Analysis

- Test vehicle was obtained to review assembly of related components
- Brake Switch from incident vehicle exhibited damaged contact points.

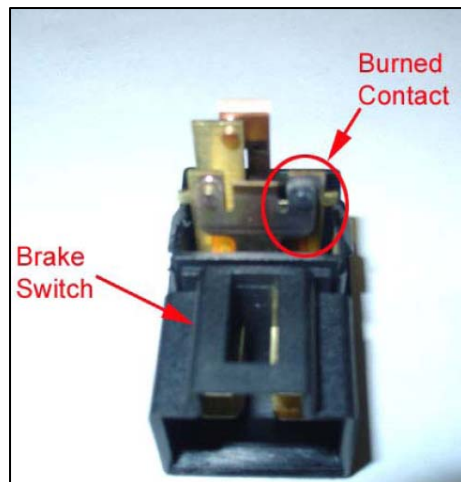

3. Data Analysis

- Data analysis reveal 77 claims during 09NF production.
- Latest claims include ESC light on comments.

[illegible]


VIN Number	Prod Date	Mileage	Technician Comment
5NPET46C59H	10/10/08	753	CUST STATES ESC LITE WON'T TURN OFF. SCAMMED FOUND CODES C1513 BRAKE LAMP SWITCH INSPECTED SWITCH FOR PROPER ADJUSTMENT INTERNAL FAILURE
5NPET46C49H	9/16/08	12	IN SWITCH. REPALED/CLEARED CODES/OK. SHIFTER STUCK IN PARK
5NPET46C99H	9/9/08	463	464 CONFIRMED COMPLAINT. GDS DIAGNOSTICS C1513 BRAKE LAMP SWITCH CIRCUIT OPEN . FOUND THAT THE STOP LAMP SWITCH HAS AN OPEN CIRCUIT. REPLACED SWITCH. CHECK OPERATION OK.

4. HMA Request

- Review assembly process to identify potential loose connection and take corrective action as required.
- Review seam sealer / body assembly process and conduct corrective action as required.
- Confirm vendor QC/Assembly process if applicable

HMA Request	YES	NO
C/M Part		X
Field Fix TSB		X
Port Campaign		X
Dealer Campaign		X

Item	Date
QIR Issued	01/22/08
Part Sent	N/A
QIS Received	TBD

Item	Date
C/M	N/A
Details	

C/100 (Claims)	Techline	FSE
0.07 (77)	18	4

IQS	Mimic
0.3	0.3

Duplicate Report	YES	NO	Prev QIR
		X	

Incident Parts Available	
Part # (s)	Qty
93810-3K000	1

*Current MY data ONLY

QANF-B-090202

HYUNDAI

QUALITY INFORMATION
REPORT

CONFIDENTIAL

Model Code NF	Subject Code* BODY	Severity Code 10	HMA Report Number QANF-B-090202	
Creation date/time/user: 01/23/2009 10:12:39 AM by Mark Maehara		Analyst:* Mark Maehara	Co-analyst(s):	Modified date/time/user: 01/23/2009 10:12:42 AM by
Distributor* HMA	Country* USA	Vendor Info	Causal part No 93810-3K000	Attachments No <input type="checkbox"/> Movie <input type="checkbox"/> Photo <input type="checkbox"/> Part <input type="checkbox"/> Other
Model* NF SONATA	Engine or Transmission #* G6DB7K279278	Lot #	Production Date* (MM/DD/YY) 07/09/2007	
VIN* 5NPET46F88H	Mileage* 15500	Repair Date (MM/DD/YY) 01/15/2008	Delivery Date* (MM/DD/YY) 02/28/2008	
Subject* [A] ESC Light ON C1513. Brake Switch Poor G32 Ground – Early Warning - (HMMA)				

Types of QIR					
<input type="checkbox"/> General	<input checked="" type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date:

Report Number : QANF-B-090202

See attachment

- Customer statement:
- Technician statement:
- Customer driving habit / operation condition:
- Road condition:
- Weather condition:
- Vehicle speed:
- Number of passengers:
- Region:
- Other comments:

Analysis:

Date:

Report Number : QANF-B-090202

Corrective Action:

Date:

Report Number : QANF-B-090202

- Dealer fix:
- Repair procedure:

Comments and Recommendations:

Date:

Report Number : QANF-B-090202

- Production C/M:
- Port action:
- Field fix:
- TSB:
- Other comment:

Attachments:

Date:

Report Number : QANF-B-090202



09NFG32Ground.ppt

QANF-C-060631

Attachment

QUALITY INFORMATION REPORT

CONFIDENTIAL

Model Code		Subject Code*		HMA Report Number	
NF CHASSIS					
Creation date/time/user:		Analyst:*		Co-analyst(s):	
Jo		shua Vedder			
Distributor*		Country*		Date	HMC Report Number
HMA USA					
Model*		Engine or Transmission Number*		Production Date*	
Sonata G6DB6K		115835		3/30/06	
Vehicle Identification Number*		Mileage*		Delivery Date*	
5NPEU46F96H [REDACTED]				6/4/06	
Subject* e.g. [A] SUBJECT – EARLY WARNING/PORT ISSUE – HMMA/HMC					
[B] BRAKE SWITCH FAILURE – HMMA					
<input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input type="checkbox"/> Other					

1. Condition:

Customer complains of brake lights stuck on. 12 incident switches collected.

Repair Date: 5/18/06


Op Code: 93810R00


Part #: 93810-3K000

TSB 06-50-006 was written to help dealers properly diagnose stop lamp switch issues.

2. Analysis:


This switch is common with MC and TG. The switch consists of 2 circuits, one each for stop lamps and cruise control. The stop lamp circuit consists of two contacts. A connection at either contact will complete the circuit. When the brake is depressed a plunger allows the cruise control circuit to disconnect and connects the stop lamp circuit. When the brake pedal is released the plunger allows the cruise control circuit to connect and disconnects the stop lamp circuit.

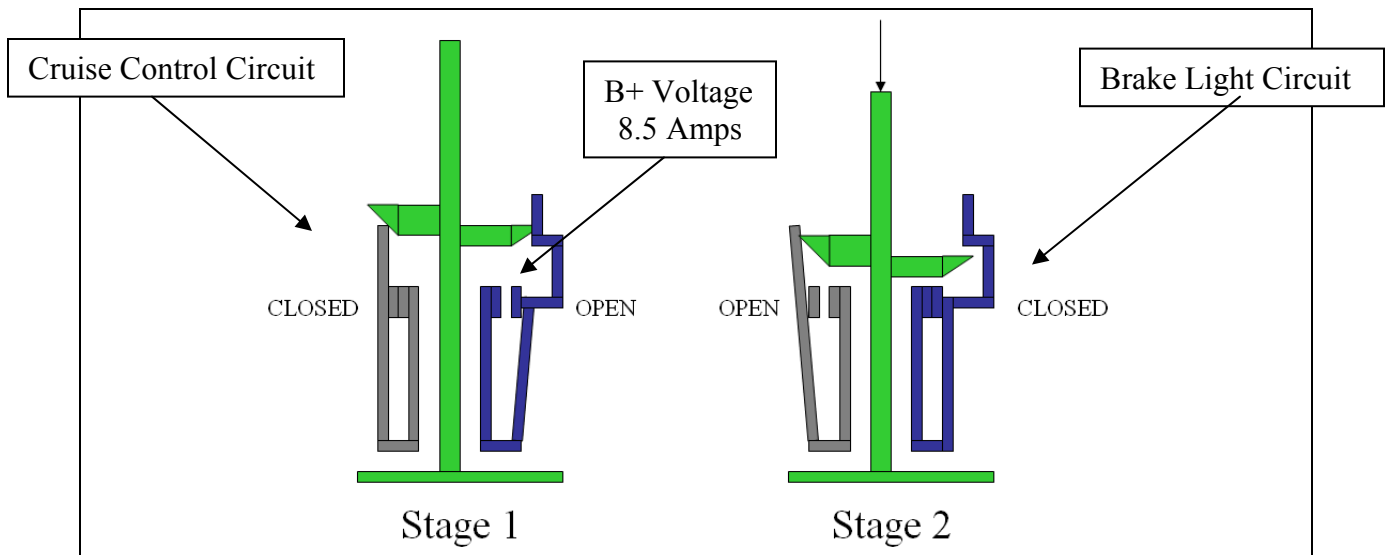


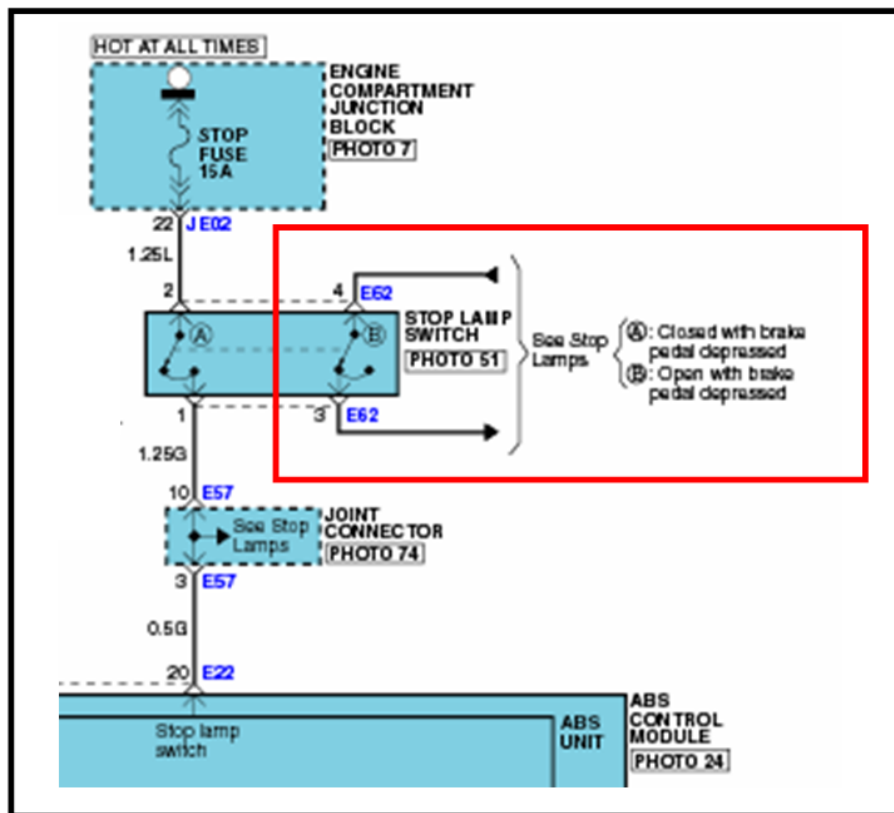



STOP LAMPS (1)

SD927-1

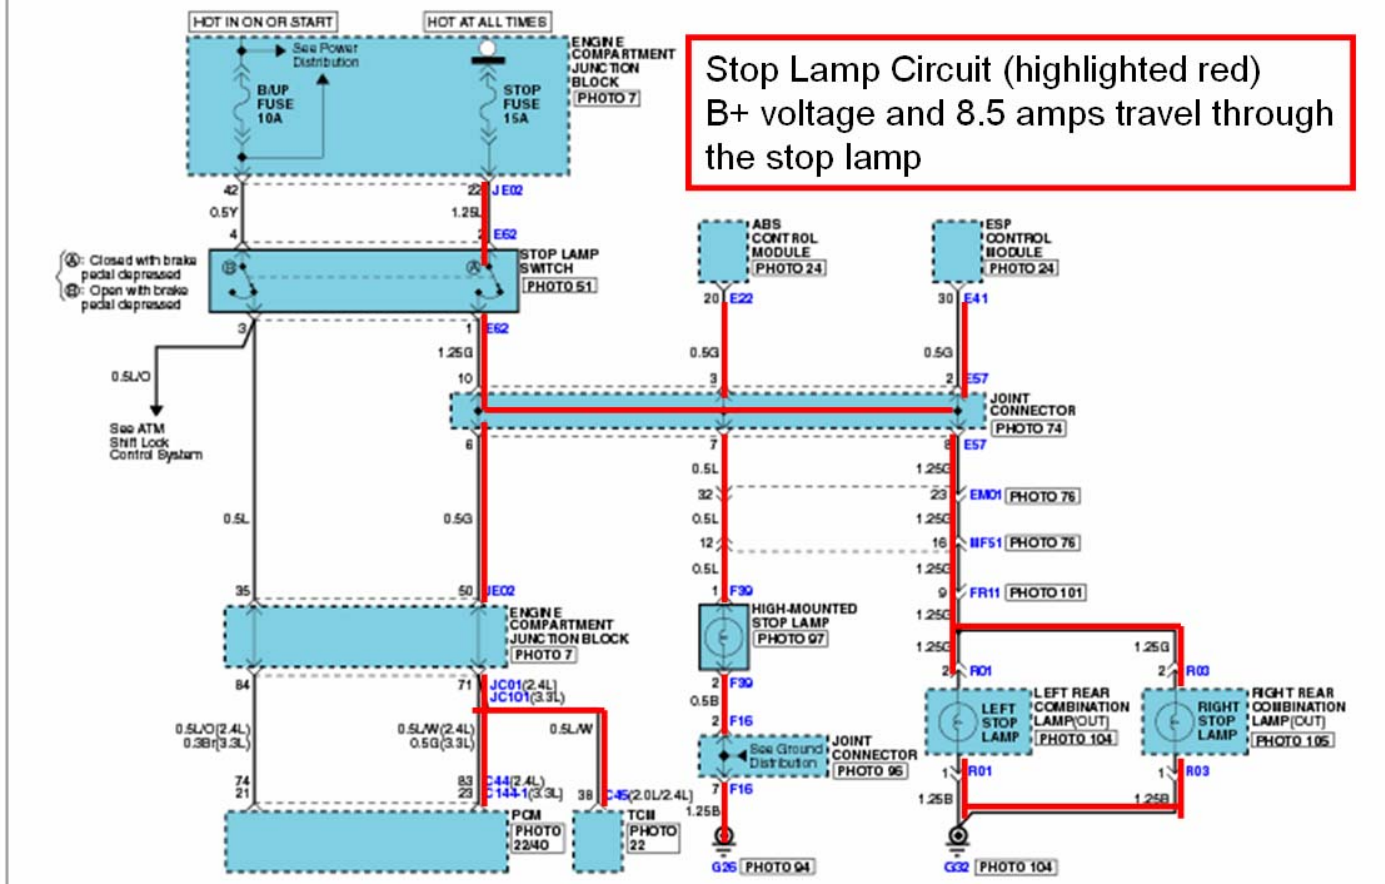

- The contacts consist of a base conductive material and a silver coating at the contact point. The incident switches indicate that the silver contact material is overheating and transferring onto the mating contact.

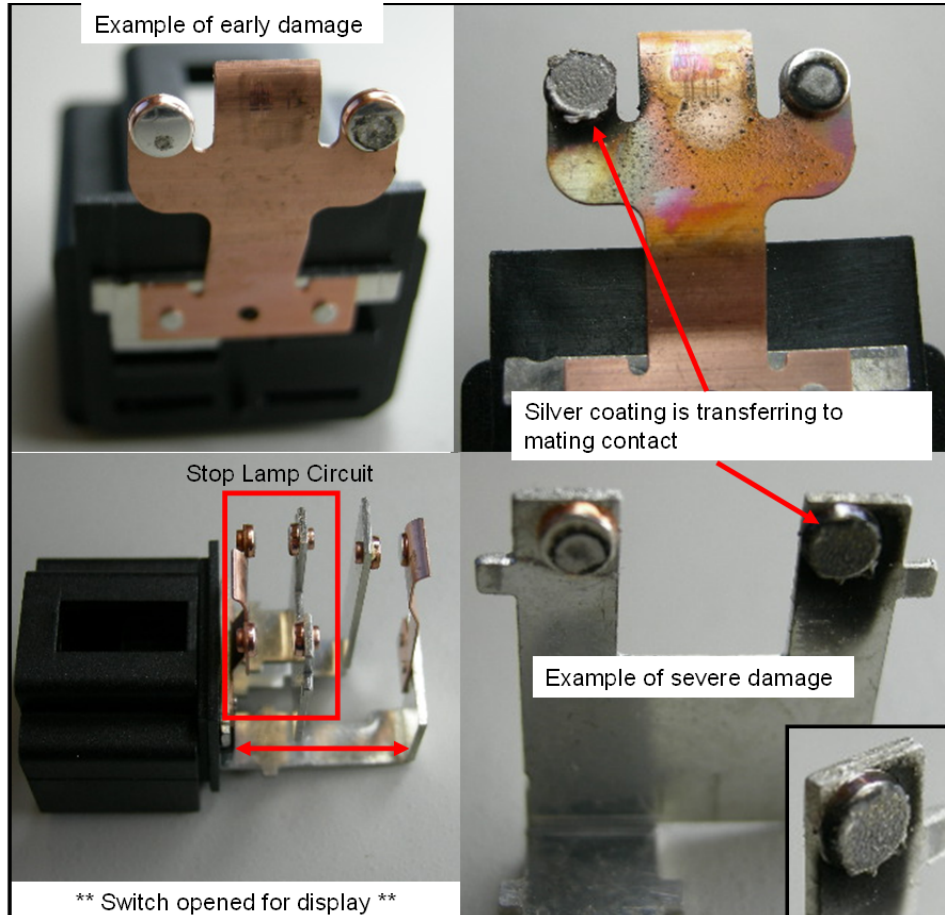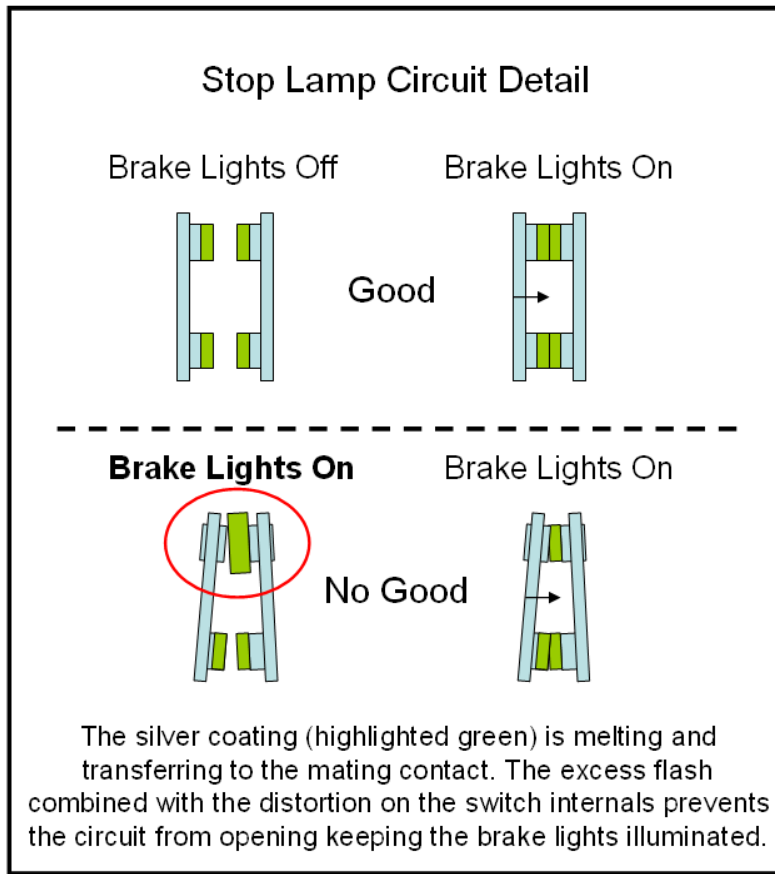

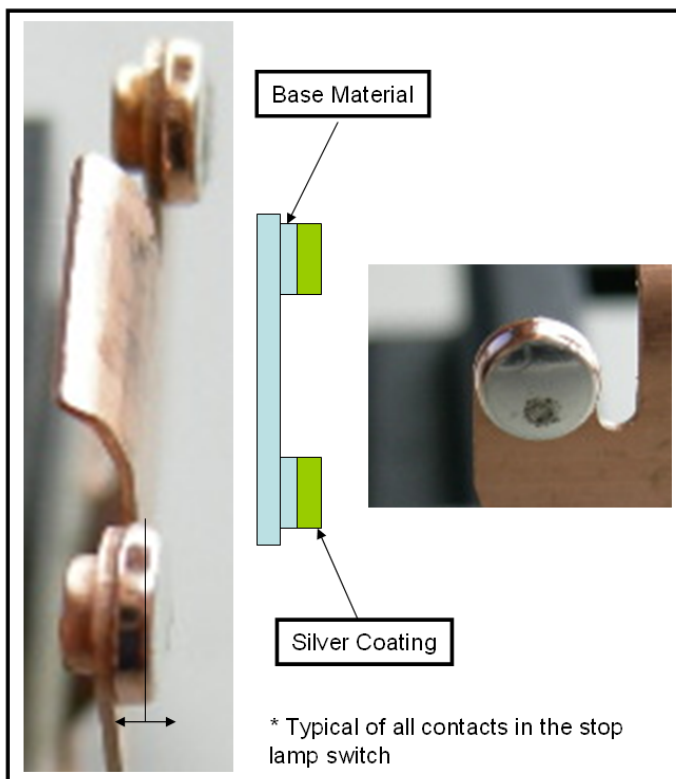

Silver coating is transferring to the mating contact. Flash from the transfer and distortion in the switch internals allows only one contact to complete the circuit which creates additional heat.




Warranty Analysis:


- HMC C/M changed stop lamp switch suppliers on 9/19/2005.
 - New supplier as of 9/19/05, confirmed on 9/21 P/D
 - Changed the Brake pedal switch's Vendor & contact point type.
 - H.K FCI (up & down type) INPAC (Sliding type).
 - Effective date : Apr.28.05 (Asan plant), Aug.19.05 (HMMA)
- 54 warranty claims after 10/1/2006 production date as of June 20th, 2006. (46 parts replaced)
- Average Months in Service: 1.8
- Average miles: 3,057
- No regional effects:

Region	Claims
EA 13	
SO 12	
SC 12	
CE 8	
WE 7	

- Top 10 State/Dealers (NY086 has 3 times the :

State	Claims	Dealer	Claims
NY 9		NY086	6
FL 8		NJ499	2
TX 5		CA232	2
OH 4		NC041	2
CA 3		FL094	2
OK 2		FL108	2
NV 2		WV010	2
NC 2		CA172	1
WA 2		NY077	1
AL 2		CO031	1

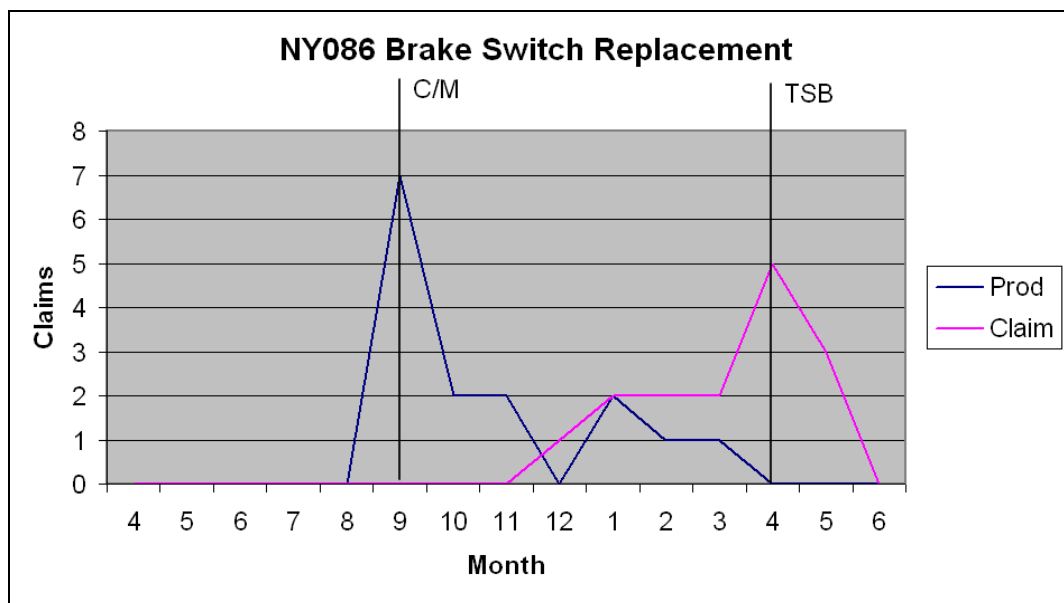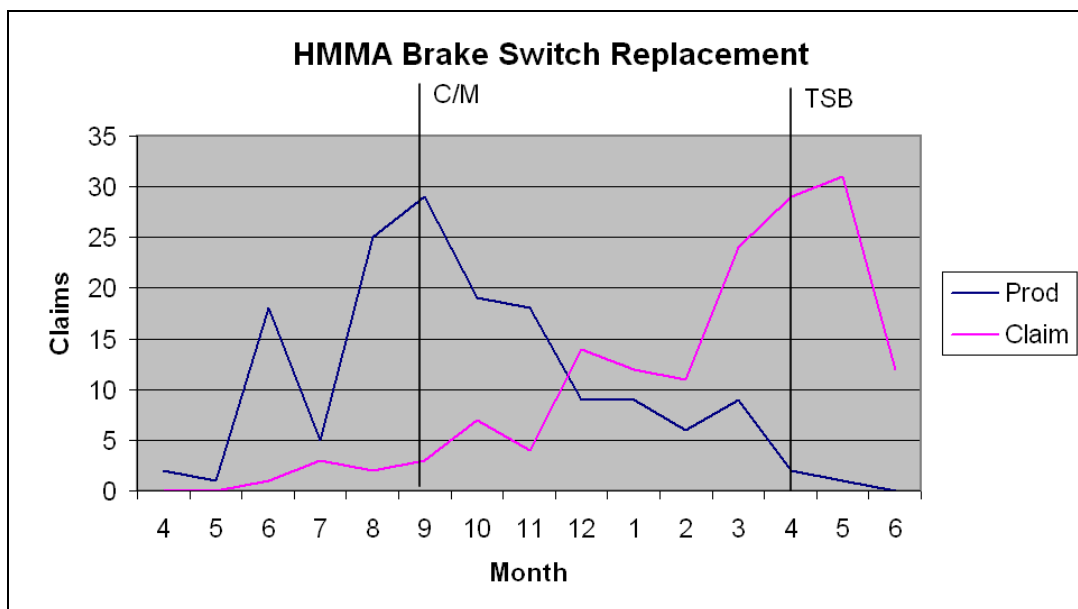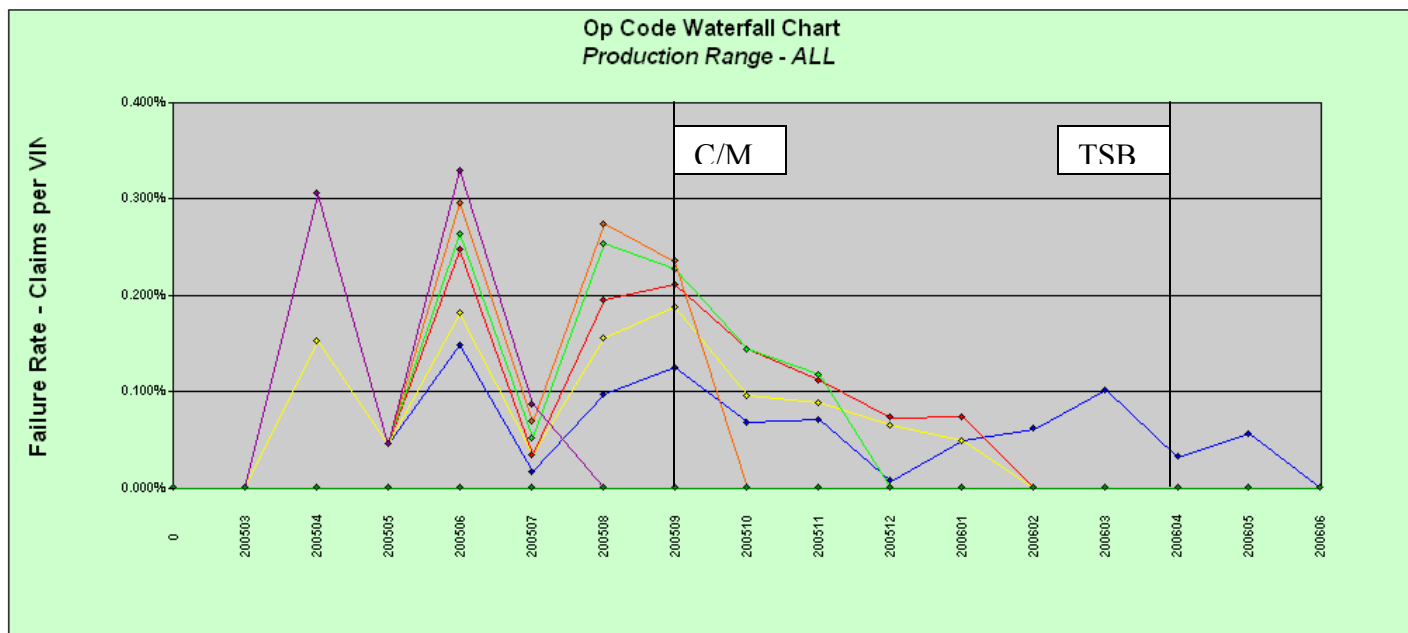

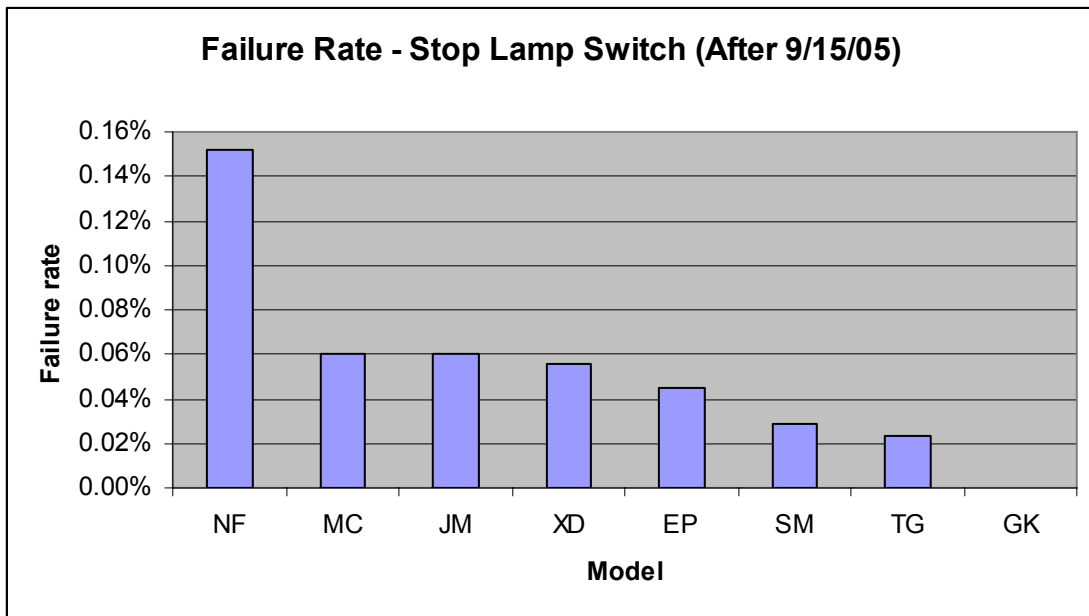


* NF, MC, JM and TG all use a common stop lamp switch (93810-3K000, 93810-38110 on MC)


Competitive Vehicle Analysis:

HMA looked at two high mileage vehicles for comparison, the Honda CRV and Toyota Corolla.

Toyota Corolla
90,000 miles

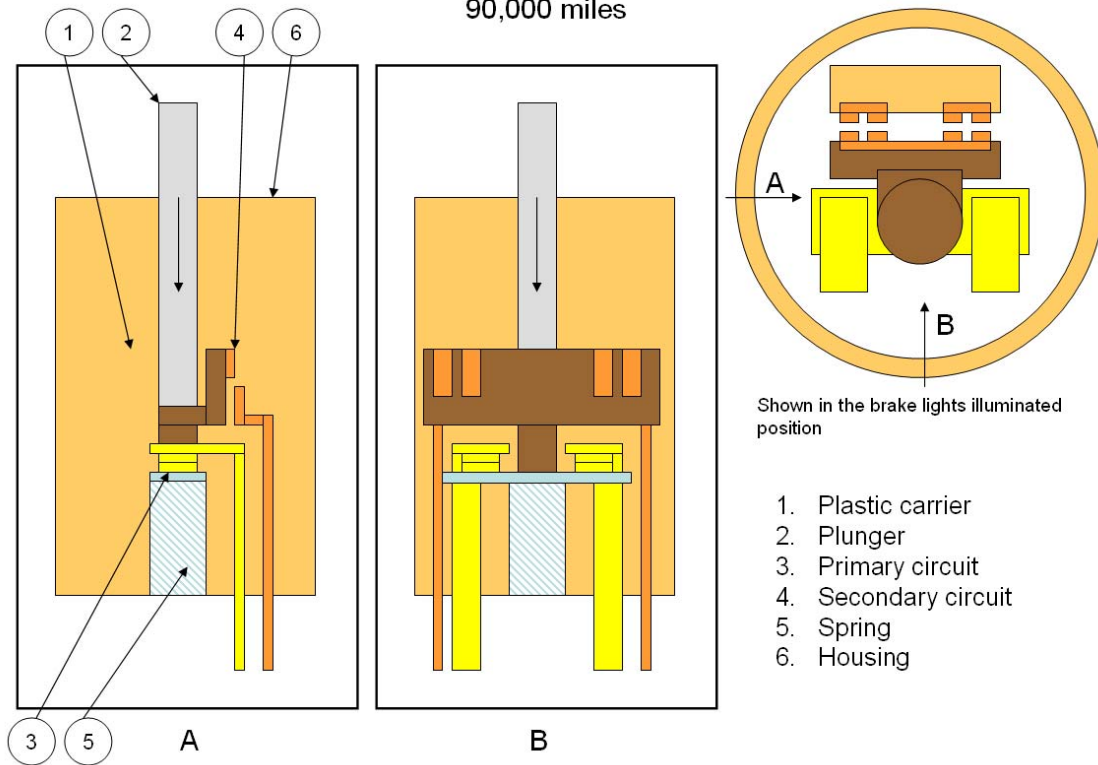


Toyota Corolla
90,000 miles

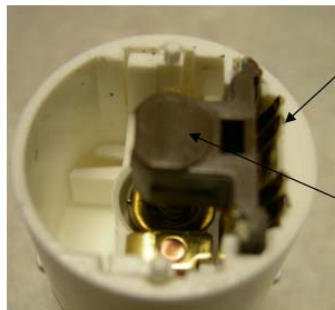

Secondary circuit

Plunger strikes the carrier which then compresses the spring and opens the primary circuit.

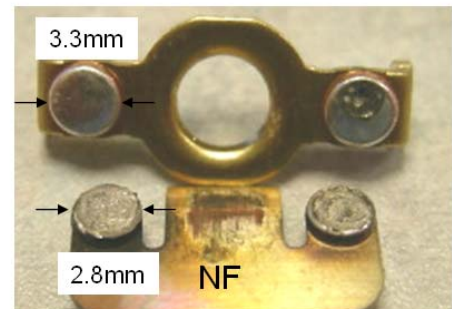

Primary circuit is a self contained unit within the switch housing




Primary circuit contacts are smooth and coated similar to NF. Signs of heat and metal transfer similar to NF.






Secondary circuit



Honda CRV
100,000 miles

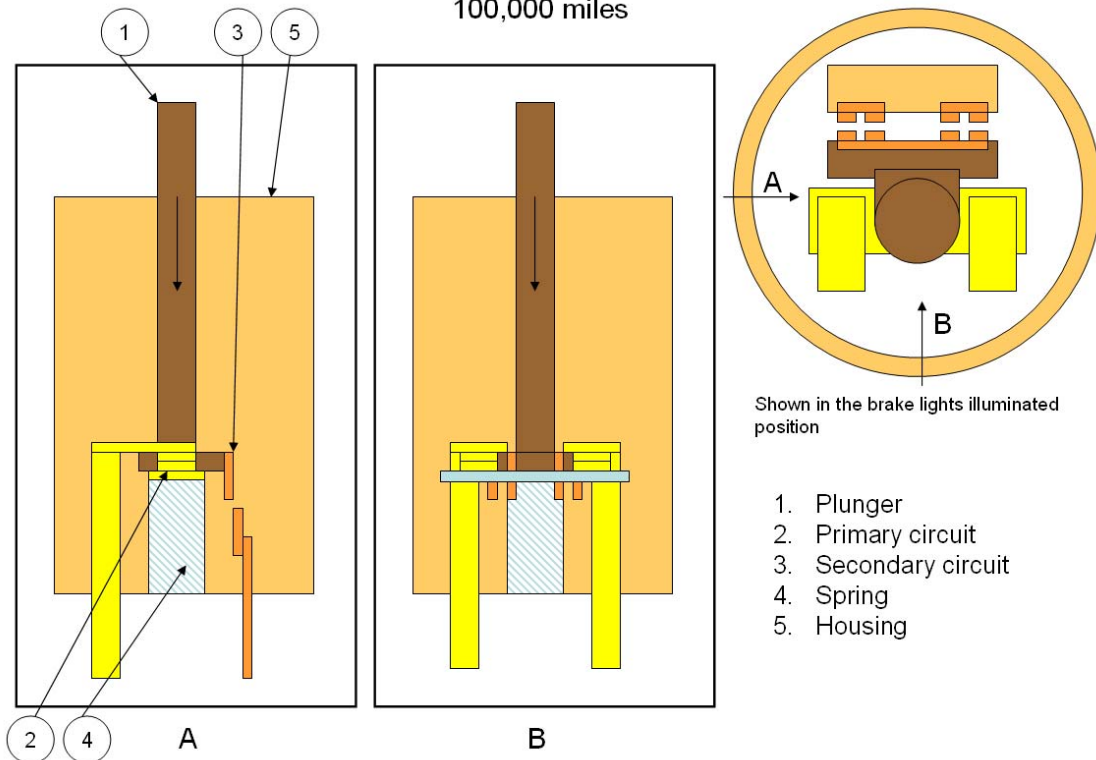


Honda CRV
100,000 miles

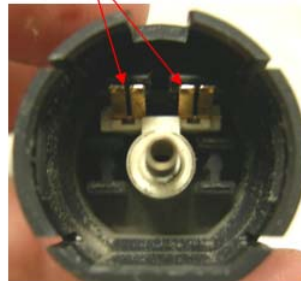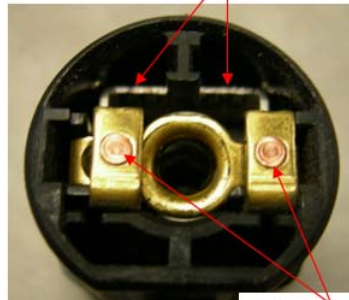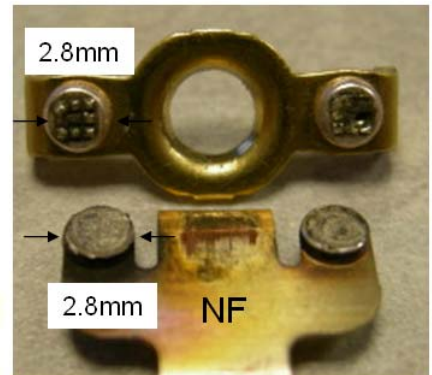

Switch has very limited damage after 100k miles.

Primary circuit spring side contacts have 6 small stamped protrusions.

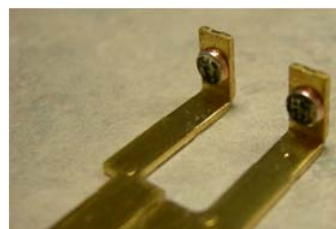

Primary circuit fixed contacts are smooth with coatings similar to NF.

Secondary circuit slides with the plunger.



3. Action:


Dealer – Replace switch, adjust using TSB: 06-50-006.

4. Comment/Recommendation:

HMA requests that HMC/HMMA investigate this failure to determine if excessive current is being transmitted through the brake switch. Also HMC should determine if the design is robust enough for a single contact to carry all the current in the circuit without overheating.

HMC/HMMA should determine if the silver coating material is adequate to handle the heat load when a single contact occurs.

Also the ramp that allows the contacts to “make” does not allow for instantaneous contact which can promote extended arcing and excess heat. This system also allows a single contact to carry the load if a customer is riding the brakes.

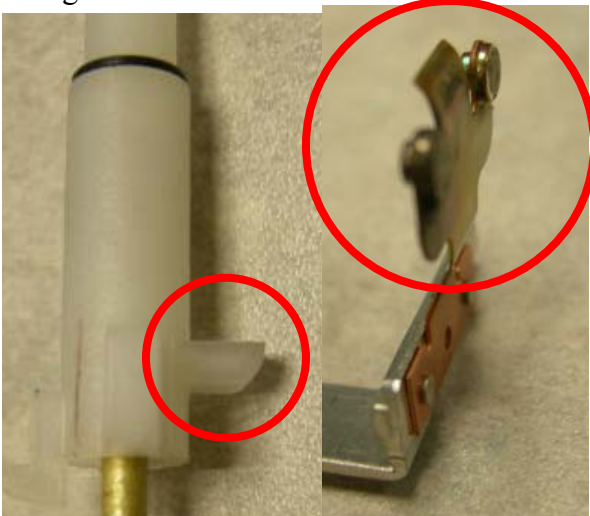**Attachments:**

QANF-C-060631

HYUNDAI

QUALITY INFORMATION
REPORT

CONFIDENTIAL

Model Code NF	Subject Code* CHASSIS	Severity Code	HMA Report Number QANF-C-060631	
Creation date/time/user: 06/26/2006 01:59:40 by Joshua Vedder		Analyst:* Joshua Vedder	Co-analyst(s):	Modified date/time/user: 06/28/2006 11:09:45 AM by Joshua Vedder
Distributor* HMA	Country* USA	Vendor Info	Causal part No	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input type="checkbox"/> Other
Model* NF SONATA	Engine or Transmission #* G6DB6K115835	Lot #	Production Date* (MM/DD/YY) 03-30-2006	
VIN* 5NPEU46F96H	Mileage* 11	Repair Date (MM/DD/YY)	Delivery Date* (MM/DD/YY) 06-04-2006	
Subject* [B] BRAKE SWITCH FAILURE - HMMA				

Types of QIR					
<input type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date: 06/26/2006

Report Number :

Customer complains of brake lights stuck on. 12 incident switches collected.

Repair Date: 5/18/06

Op Code: 93810R00

Part #: 93810-3K000

TSB 06-50-006 was written to help dealers properly diagnose stop lamp switch issues.

Analysis:

Date: 06/26/2006

Report Number :

This switch is common with MC and TG. The switch consists of 2 circuits, one each for stop lamps and cruise control. The stop lamp circuit consists of two contacts. A connection at either contact will complete the circuit. When the brake is depressed a plunger allows the cruise control circuit to disconnect and connects the stop lamp circuit. When the brake pedal is released the plunger allows the cruise control circuit to connect and disconnects the stop lamp circuit

- The contacts consist of a base conductive material and a silver coating at the contact point. The incident switches indicate that the silver contact material is overheating and transferring onto the mating contact.

Silver coating is transferring to the mating contact. Flash from the transfer and distortion in the switch internals allows only one contact to complete the circuit which creates additional heat.

Warranty Analysis:

- HMC C/M changed stop lamp switch suppliers on 9/19/2005.
 - o New supplier as of 9/19/05, confirmed on 9/21 P/D
 - o Changed the Brake pedal switch's Vendor & contact point type.
 - o H.K FCI (up & down type) INPAC (Sliding type).
 - o Effective date : Apr.28.05 (Asan plant), Aug.19.05 (HMMA)
- 54 warranty claims after 10/1/2006 production date as of June 20th, 2006. (46 parts replaced)
- Average Months in Service: 1.8
- Average miles: 3,057
- No regional effects:

Region	Claims
EA	13
SO	12
SC	12
CE	8
WE	7

- Top 10 State/Dealers (NY086 has 3 times the :

State	Claims
NY	9
FL	8

TX	5
OH	4
CA	3
OK	2
NV	2
NC	2
WA	2
AL	2
Dealer	Claims
NY086	6
NJ499	2
CA232	2
NC041	2
FL094	2
FL108	2
WV010	2
CA172	1
NY077	1
CO031	1

Competitive Vehicle Analysis:

HMA looked at two high mileage vehicles for comparison, the Honda CRV and Toyota Corolla.

Corrective Action:

Date: 06/26/2006

Report Number :

Dealer – Replace switch, adjust using TSB: 06-50-006.

Comments and Recommendations:

Date: 06/26/2006

Report Number :

HMA requests that HMC/HMMA investigate this failure to determine if excessive current is being transmitted through the brake switch. Also HMC should determine if the design is robust enough for a single contact to carry all the current in the circuit without overheating.

HMC/HMMA should determine if the silver coating material is adequate to handle the heat load when a single contact occurs.

Also the ramp that allows the contacts to “make” does not allow for instantaneous contact which can promote extended arcing and excess heat. This system also allows a single contact to carry the load if a customer is riding the brakes.

Attachments:

Date: 06/26/2006

Report Number :



Brake Switch.doc

QANF-C-070511

Attachment

QUALITY INFORMATION REPORT

CONFIDENTIAL

Model Code	Subject Code*		HMA Report Number	
NF CHASSIS				
Creation date/time/user:	Analyst:*	Co-analyst(s):	Modified date/time/user:	
CASEY	SHAH			
Distributor*	Country*	Date	HMC Report Number	Attachments <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
HMA USA		5/17/2007		
Model*	Engine or Transmission Number*		Production Date*	
SONATA G6DB6K	207754		11/27/2006	
Vehicle Identification Number*		Mileage*	Delivery Date*	
5NPEU46F37H [REDACTED] 865			3/28/2007	
Subject*				
[B] INTERMITTENT NO "PARK" RELEASE AND "ESC" LIGHT ON – HMMA (EARLY WARNING)				

1. Condition:

- The customer states that the transmission intermittently doesn't release from "PARK" and the "ESC OFF" light stays ON the dash (see vehicle drop off request attached below).

VEHICLE DROP OFF
Please leave key in envelope and fill out the information below:

VEHICLE:
 Model SONATA-V6 Color SILVER
 License # 6-AR-1234 Space # 6
 Date 5/14 Time _____

DRIVER:
 Name GEORGE GONZALEZ
 Extension 4802

I NEED ...
☐ 7,500 service ☐ 15,000 service
☐ 22,500 service ☐ 30,000 service
☐ other, describe: _____

1. ESC WILL NOT STAY ON
2. CHECK ENGINE LIGHT ON
3. HAD TO GET OUT OF PARK

↓

2. Analysis:


- The customer complaint was duplicated by driving the vehicle.
- While driving the vehicle, the following conditions were experienced intermittently:
 - The automatic transmission shifter could not be moved from “D” to any other gears at a stop light.
 - When this condition was experienced, the “ESC OFF” indicator light was turned ON the dash.
 - When the ignition key was cycled, the “ESC OFF” indicator light on the dash was turned OFF and the transmission started operating normally.
 - Additional driving of the vehicle showed that intermittently only the “ESC OFF” indicator light would turn ON the dash but the transmission would operate normally.
 - When the transmission shifter was stuck in “PARK”, the tail light lamps would not operate with the brake pedal depressed.
- The photo below shows the vehicle mileage and the “ESC OFF” indicator light ON when this condition was recreated.



- The HI-Scan captured the code C1513 (Brake lamp switch open/short).



- Replacing the stop lamp switch assembly, P/N: 93810-0W000, corrected this condition.
- The photo below shows the incident stop lamp switch, P/N: 93810-0W000.

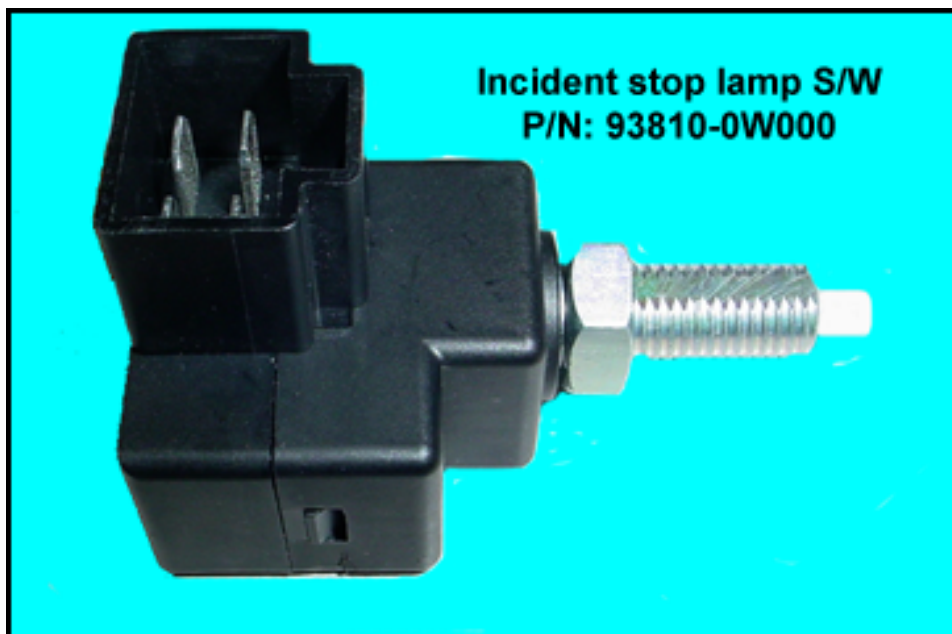

- The incident stop lamp switch continuity checked out OK statically on a bench.
- HMA suspects that there may be internal electrical contact burned out condition that may have had cause this incident.
- The above comment is made based on a similar incident analyzed in detail in the QIR: QAEN-C-
- Please refer to this QIR for additional information attached herewith.
- The warranty shows that this is the only incident; however, HMA suspects that there will be more incidents based on the warranty on similar parts on other models.

3. Action:

Replace stop lamp switch, P/N: 93810-0W000.

4. Comment/Recommendation:

- HMMA should test the incident stop lamp switch in the vehicle to determine the cause(s) of this condition and apply corrections as necessary to improve this condition.
- HMA feels that the switch design, particularly switch contact size and shape may be an issue here.
- HMA has done many QIRs on this subject and subsequently HMC has applied many countermeasures; however, looking at the warranty data, it appears that the applied countermeasures have not been very effective. Therefore, HMMA and HMC should review the switch design and apply improvements such that they become less incident prone.

5. Attachments:

QANF-C-070511

HYUNDAI

QUALITY INFORMATION
REPORT

CONFIDENTIAL

Model Code NF	Subject Code* CHASSIS	Severity Code 5	HMA Report Number QANF-C-070511	
Creation date/time/user: 05/18/2007 02:37:11 PM by Casey Shah		Analyst:* Casey Shah	Co-analyst(s): Simon Kim	Modified date/time/user: 05/18/2007 02:37:51 PM by
Distributor* HMA	Country* USA	Vendor Info	Causal part No	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input checked="" type="checkbox"/> Other
Model* NF SONATA	Engine or Transmission #* 5NPEU46F37H	Lot #	Production Date* (MM/DD/YY) 11/27/2006	
VIN* 5NPEU46F37H	Mileage* 1,865	Repair Date (MM/DD/YY)	Delivery Date* (MM/DD/YY) 3/28/2007	
Subject* [B] INTERMITTENT NO "PARK" RELEASE AND "ESC" LIGHT ON - HMMA (EARLY WARNING)				

Types of QIR					
<input type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date: 05/18/2007

Report Number : QANF-C-070511

The customer states that the transmission intermittently doesn't release from "PARK" and the "ESC OFF" light stays ON the dash (see vehicle drop off request attached below).

Analysis:

Date: 05/18/2007


Report Number : QANF-C-070511

- The customer complaint was duplicated by driving the vehicle.
- While driving the vehicle, the following conditions were experienced intermittently:
 - The automatic transmission shifter could not be moved from "D" to any other gears at a stop light.
 - When this condition was experienced, the "ESC OFF" indicator light was turned ON the dash.


- When the ignition key was cycled, the “ESC OFF” indicator light on the dash was turned OFF and the transmission started operating normally.
- Additional driving of the vehicle showed that intermittently only the “ESC OFF” indicator light would turned ON the dash but the transmission would operate normally.
- When the transmission shifter was stuck in “PARK”, the tail light lamps would not operate with the brake pedal depressed.



- The photo below shows the vehicle mileage and the “ESC OFF” indicator light ON when this condition was recreated.

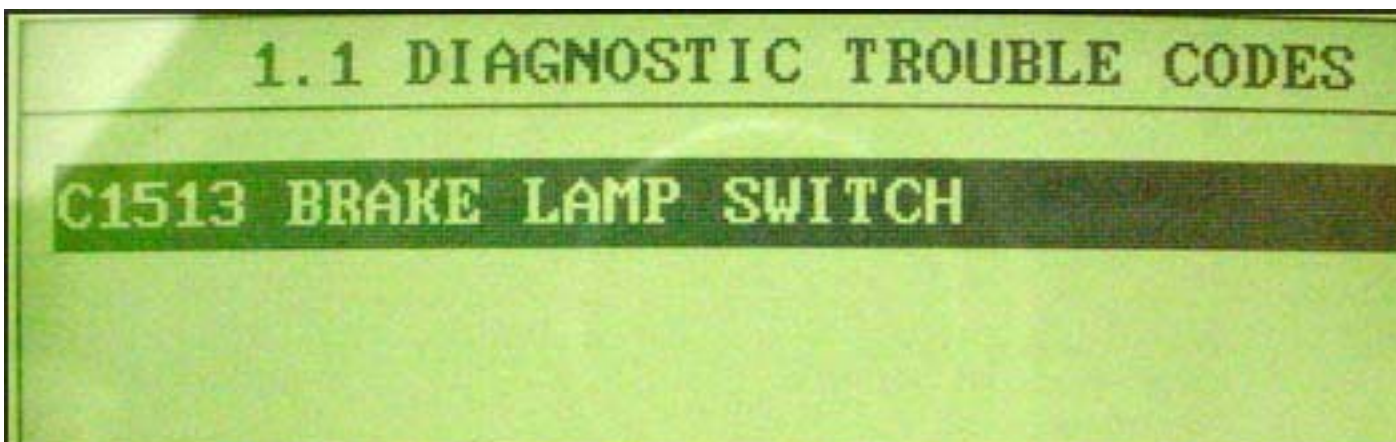

- The HI-Scan captured the code C1513 (Brake lamp switch open/short).
- Replacing the stop lamp switch assembly, P/N: 93810-0W000, corrected this condition.
- The photo below shows the incident stop lamp switch, P/N: 93810-0W000.

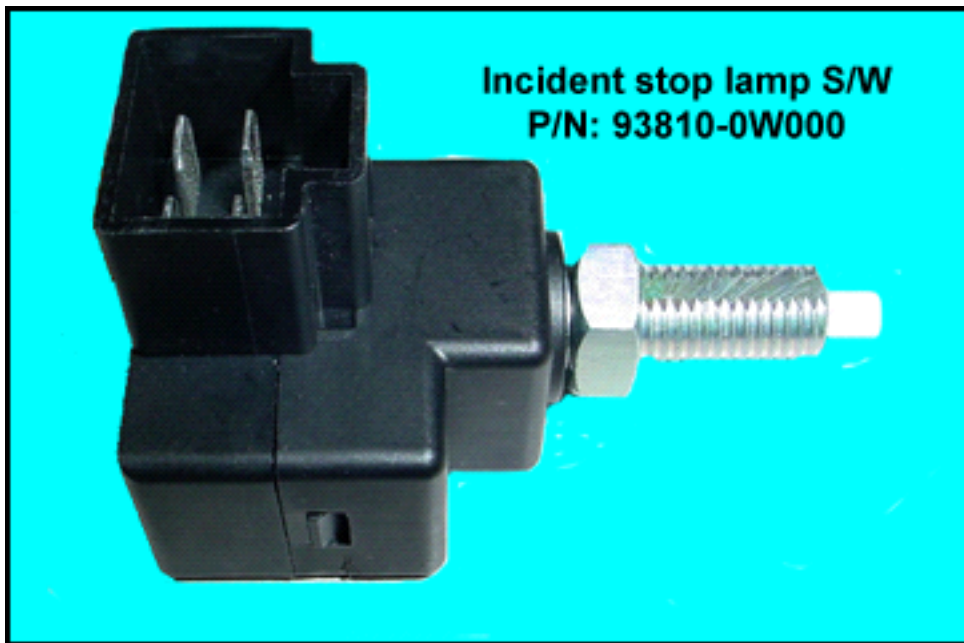

- The incident stop lamp switch continuity checked out OK statically on a bench.
- HMA suspects that there may be internal electrical contact burned out condition that may have had cause this incident.
- The above comment is made based on a similar incident analyzed in detail in the QIR: QAEN-C-
- Please refer to this QIR for additional information attached herewith.
- The warranty shows that this is the only incident; however, HMA suspects that there will be more incidents based on the warranty on similar parts on other models.

Corrective Action:

Date: 05/18/2007

Report Number : QANF-C-070511

Replace stop lamp switch, P/N: 93810-0W000.

Comments and Recommendations:

Date: 05/18/2007

Report Number : QANF-C-070511

- HMMA should test the incident stop lamp switch in the vehicle to determine the cause(s) of this condition and apply corrections as necessary to improve this condition.
- HMA feels that the switch design, particularly switch contact size and shape may be an issue here.
- HMA has done many QIRs on this subject and subsequently HMC has applied many countermeasures; however, looking at the warranty data, it appears that the applied countermeasures have not been very effective. Therefore, HMMA and HMC should review the switch design and apply improvements such that they become less incident prone.

Attachments:

Date: 05/18/2007

Report Number : QANF-C-070511



QIR 22 NF Brake Switch.doc QIR 19 EN Stop Lamp Switch.doc

QANF-L-070108

Attachment

QUALITY INFORMATION REPORT

CONFIDENTIAL

Model Code		Subject Code*		HMA Report Number	
NF Electri		cal			
Creation date/time/user:		Analyst		Co-analyst(s):	
Jim		Whitney			
Distributor*		Country*		Date	
HMA USA					
Model*		Engine or Transmission Number*		Production Date*	
Sonata N/A				11/08/06	
Vehicle Identification Number*		Mileage*		Delivery Date*	
5NPEU46F17H [REDACTED]				Port Inventory	
Subject*					
(A) INOPERATIVE BRAKE STOP LAMP SWITCH CAUSES NO ATM SHIFTER RELEASE-HMMA					
Attachments <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input type="checkbox"/> Other					


Condition:

The Transaxle cannot be shifted out of Park.

Analysis:

Investigation revealed the brake stop light switch plunger is sticking in the brake switch. When the brake pedal is depressed the plunger will not move out of the brake switch. The shifter release solenoid is not activated thus preventing the shifter from being released from Park.

One switch was disassembled. The switch plunger at it's widest diameter (A in photo) binds in the hole (B in photo).

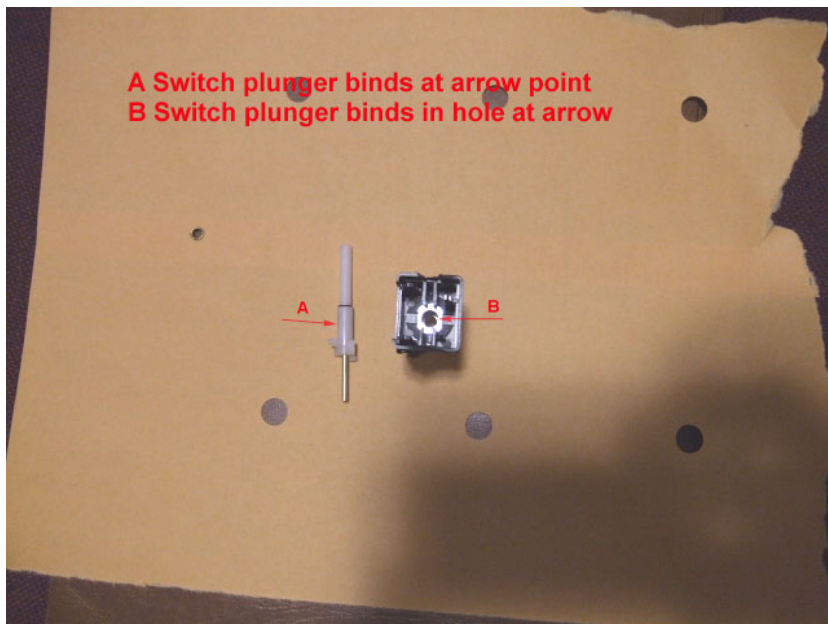

Additional vehicles with the same condition.

<u>VIN:</u>	<u>Production Date</u>
5NPEU46F67H	11/11/06
5NPEU46F07H	11/20/06
5NPEU46FX7H	11/20/06
5NPEU46F37H	11/15/06

Corrective Action:

Replace the brake light switch p/n 93810-3K000


Recommendation:

HMMA should investigate the cause of the brake switch malfunction and implement changes needed to eliminate the condition. The inability of the driver to remove the Transaxle from Park will probably cause the vehicle to be towed to a repair facility.

Attachment:



Brake Switch

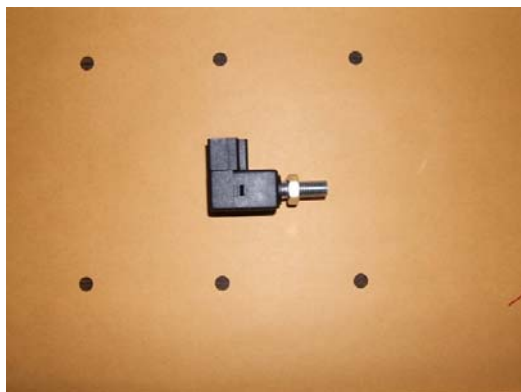

Brake Switch Plunger stuck in switch

QANF-L-070108

HYUNDAI

QUALITY INFORMATION
REPORT

CONFIDENTIAL

Model Code NF	Subject Code* ELECTRICAL	Severity Code	HMA Report Number QANF-L-070108	
Creation date/time/user: 01/15/2007 04:17:14 by Jim Whitney	Analyst:* Jim Whitney	Co-analyst(s):	Modified date/time/user: by	
Distributor* HMA	Country* USA	Vendor Info	Causal part No	Attachments Yes <input type="checkbox"/> Movie <input checked="" type="checkbox"/> Photo <input checked="" type="checkbox"/> Part <input type="checkbox"/> Other
Model* NF SONATA	Engine or Transmission #* N/A	Lot #	Production Date* (MM/DD/YY) 11-08-2006	
VIN* 5NPEU46F17H	Mileage* 6	Repair Date (MM/DD/YY)	Delivery Date* (MM/DD/YY) 01-11-2007	
Subject* (A) INOPERATIVE BRAKE STOP LAMP SWITCH CAUSES NO ATM SHIFTER RELEASE-hmma				

Types of QIR					
<input type="checkbox"/> General	<input type="checkbox"/> Early Warning	<input type="checkbox"/> Serviceability	<input type="checkbox"/> Port	<input type="checkbox"/> Monitoring	<input type="checkbox"/> VDS

Condition:

Date: 01/15/2007

Report Number :

Analysis:

Date: 01/15/2007

Report Number :

Corrective Action:

Date: 01/15/2007

Report Number :

Comments and Recommendations:

Date: 01/15/2007

Report Number :

Attachments:

Date: 01/15/2007

Report Number :



QIR NF Brake Switch Sticks 1-07.doc