

U.S. Department of Transportation

National Highway Traffic Safety Administration

# **ODI RESUME**

**Investigation:** PE 13-021

Date Opened:06/14/2013Date Closed:09/30/2013Investigator:Michael LeeReviewer:Scott Yon

**Approver:** Frank Borris

**Subject:** Occupant Classification System Failure

# MANUFACTURER & PRODUCT INFORMATION

Manufacturer: Suzuki Motor of America, Inc.

Products: 2006-2011 Suzuki Grand Vitara and 2007-2011 Suzuki SX4

Population: 205,552

Problem Description: The sensor mat for the OCS, intended to identify the type/size of the occupant, fails and

causes the air bag warning light to illuminate, indicating that the frontal passenger air

bag is not suppressed for a seated child or small-stature adult.

# **FAILURE REPORT SUMMARY**

	ODI	Manufacturer	Total
Complaints:	140	2,011	2103**
Crashes/Fires:	0	0	0
Injury Incidents:	0	0	0
Fatality Incidents:	0	0	0
Other*:	0	14,502	14,502

<sup>\*</sup>Description of Other: Warranty claims related to, or likely related to, OCS problems.

# ACTION / SUMMARY INFORMATION

Action: Close this Preliminary Evaluation; NHTSA recall 13V-405.

#### **Summary:**

Suzuki Motor of America is conducting a safety recall to remedy the occupant classification system's (OCS) sensor mats in approximately 193,936 model year 2006-2011 Suzuki Grand Vitara and 2007-2011 Suzuki SX4 vehicles (see NHTSA recall 13V-405 for more details). The sensor mat installed in the front passenger seat can develop an electrical circuit disconnection as a result of repeated flexing of the seat from use of the seat. According to Suzuki, when the failure occurs, the OCS system, by design, will not suppress the frontal passenger air bag for a seated child or small-stature adult. A deploying passenger air bag can cause serious injury to such an occupant.

The recall population excludes those vehicles that previously had proper remedies under the special coverage campaign for this issue (~11,600) that began in July 2012. The recall remedy will be to install a new front passenger seat cushion assembly that includes an improved OCS sensor mat and an OCS control module with updated algorithms designed to properly identify the type/size of the seated occupant. Consequently, this recall action will address various OCS related problems, including a programming error (associated with diagnostic trouble code B1318) related to detecting a change or shifting in load on the front passenger seat in the model year 2009 Grand Vitara and SX4 vehicles. This Preliminary Evaluation is closed.

The ODI reports cited above can be reviewed online at http://www-odi.nhtsa.dot.gov/owners/SearchNHTSAID under the following identification numbers: 10178750, 10185778, 10200217, 10200123, 10206368, 10217021, 10250561, 10254251, 10263756, 10283309, 10285166, 10294320, 10316125, 10323718, 10324530, 10326910, 10332645, 10347204, 10348957, 10349038, 10350237, 10353604, 10354901, 10355400, 10364190, 10367631, 10369777,

Investigation: PE 13-021 Close Resume Page 1 of 2

<sup>\*\*</sup> Total eliminates duplicates received by ODI and manufacturer.

10371056, 10373558, 10375165, 10375789, 10376071, 10376621, 10378154, 10380794, 10382860, 10392447, 10392434, 10392599, 10393975, 10395430, 10395602, 10395821, 10395983, 10398172, 10400092, 10400035, 10401106, 10401424, 10404772, 10405359, 10406459, 10407500, 10409412, 10409993, 10413235, 10418162, 10419237, 10419578, 10425035, 10425212, 10426703, 10434905, 10435090, 10435091, 10437600, 10437892, 10437994, 10438100, 10438501, 10438613, 10439357, 10439979, 10440088, 10442968, 10442759, 10442883, 10443173, 10443592, 10443594, 10444434, 10445034, 10445447, 10446215, 10446580, 10447689, 10448161, 10448446, 10448499, 10448554, 10449238, 10450746, 10451260, 10452961, 10453168, 10453403, 10453376, 10454445, 10454978, 10455231, 10455529, 10456043, 10456367, 10456407, 10459063, 10460417, 10460510, 10462016, 10463337, 10464941, 10464693, 10467988, 10468641, 10479583, 10479929, 10481120, 10484053, 10484863, 10486369, 10486729, 10487379, 10491755, 10499622, 10506034, 10508282, 10511057, 10511439, 10512962, 10521656, 10521779, 10523512, 10523931, 10524266, 10526435, 10533196, 10535513, 10537314, 10537619, 10543672, 10544287.

Investigation: PE 13-021 Close Resume Page 2 of 2