













HIS VEHICLE CONFORMS TO ALL APPLICABLE U.S.A. STANDARDS IN EFFECT ON THE DATE OF MANUFA VIN: 1J4RR5GT1BC VEHICLE MADE IN U.S.A. PAINT: PDM

SLER GROUP LLC

11

52 KG 3200 LB HIIN 20X8.0 RIMS AT

HIIW 379 KG 3700 LB

RIMS AT 20X8.0

GUHR: 3085 KG 6800 LB

265/50R20 TIRES 250 KPA (36 PSI) COLD


265/50R20 TIRES

250 KPA (36 PSI) COLD



THIS VEHICLE CONFORMS TO ALL STANDARDS IN EFFECT ON

VIN: 1J4RR5GT1BC UEHICLE MADE IN U.S.A.

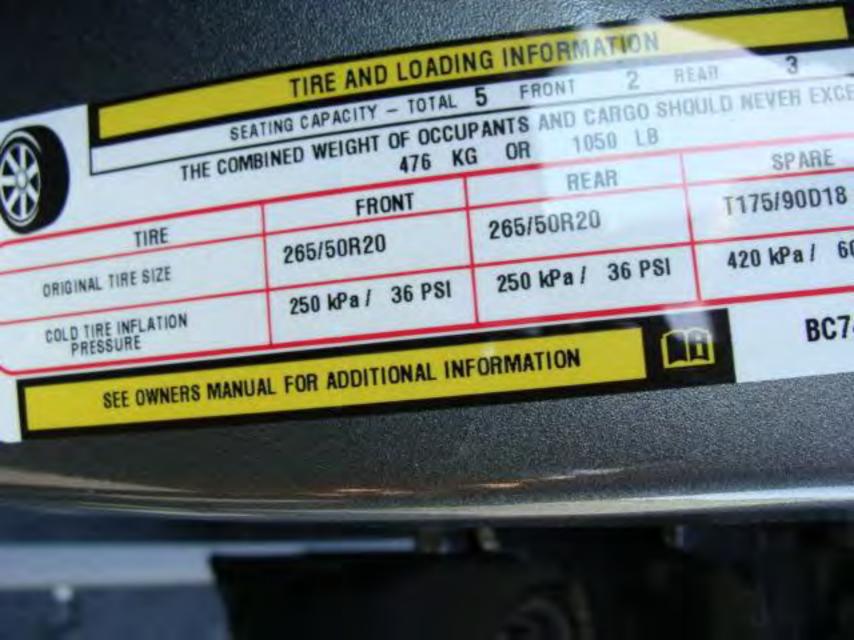

and Push Button to Start

7363 mi **(**)OFF











































Chrysler Group LLC | VEHICLE EMISSION CONTROL INFO

U.S. EPA: T2 B5 LDT OBD: FII FUEL: GASOLINE

CALIFORNIA: N/A NOT FOR SALE IN STATES V

NO ADJUSTMENTS NEEDED

68080 101AA

ENGINE: 5.7L GROUP: BCRXT05.7RN0 EVAP: BCRXR0180RK0

TWC / HO2S / SFI



































OPTIONS: STK:1131062 DLR:65688 ENG:5.7 Liter

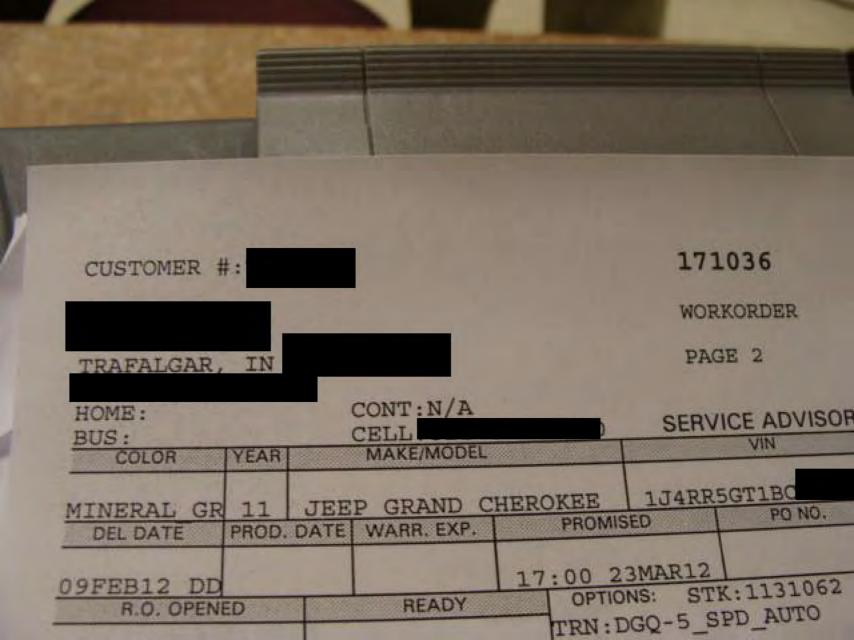

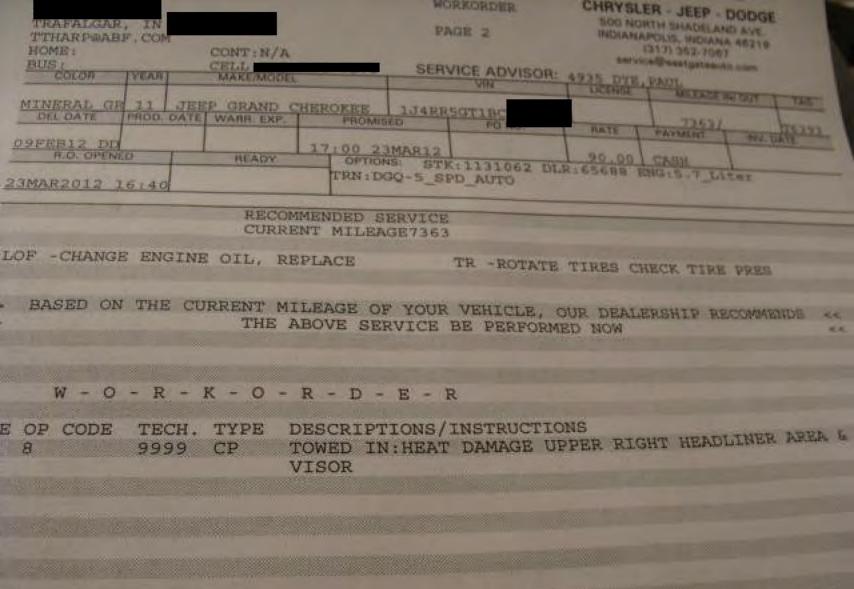




























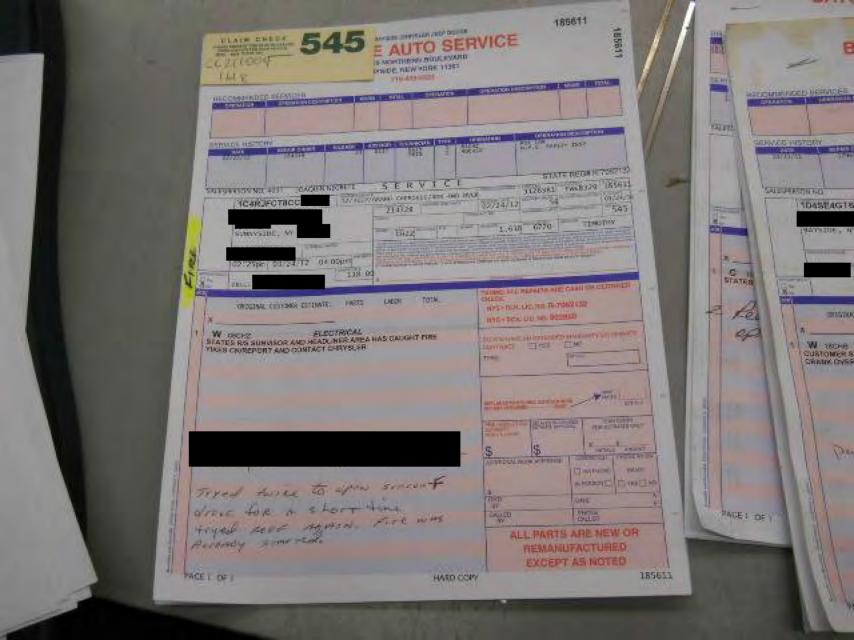

VIP Summary Report THE REST LET WHEN THE PARTY OF Been reported above, from records Dean County Spin S.C. Seriel System Ottomore: 1 513 com-A CONTRACTOR OF STREET ASSESSMENT OF THE PROPERTY OF THE PROPE A REAL PROPERTY OF CHANGE CONTRACT AND COME SERVED AND ADDRESS ASSESSMENT OF THE PERSON OF THE PERSO WHEN THE PARTY SEALIST Warning Mescages Warning Mussages, or wavey Sustages Switter Versole Restrictions - to Value Medicals Vehicle-Service information Land Spinsons of Street or Spinsons of Addis-SANSTONE OF PERSONAL OF SHIP OWN INCOME SHOW Indiana Pate Company N. 1983 Bost description. TARREST AND ADDRESS OF THE PARTY NAMED IN SHAPE RESERVE THE SECURITY SHAPE. District Total Inch. Direction of the last owner, didn't you work. THE PERSON SOME TO THE WARRY TO SEE THE PARK THE PARK THE Parents of Concession, in Paris See 2 Sidemanus makes Inc. Bollet 10. cores these Lapane 12 BOOK III. Vehicle Owner Information. Personal Services NAME AND ADDRESS OF REAL PROPERTY. The process. WOMEN STATISTICAL APPRIS Franchiscon, Property of Sportment of Laboritys Preference. DECAME AND Desprise Water State. Deprese warm (Climitality DOWNSTRAM CONTRACTOR MANY Recall Information - 4s these informer Assistan Warranty Information SCHOOL OF STREET LOPE FOR ADDITIONAL COVERAGE AND LIVING Please to their Chick County States Club for Investig Associated \$00-521-2772 Partners'riq. Capitalion Beductrate. Delpitel Tree of Wilcomy Officers & Militaries. Printer 20, 2010 18 No do is in stout in **PARKE** Spikhera or (M. 182) were HERENY M. SSIT NAMES AND ADDRESS OF THE NOWEKTRANIA DESCRIPTION OF Name of Street, Street, NATIONALIST PRANSPORTERS BORNAL HE KOCKE Hotelahy 24, 8517 and other and the Section 10 Montage of 100,000 kills. PERFORATION SAMOOR - COMPANY Filmury 24, 2000) IN NOTATION IN DRIGOSHIA. SOME WILLIAM PRINCIPLE ST. 1015 18 Phillips in 25 (10) - The ACAUSTMENT. MANAGEMENT STREET Semily 24, 2016 55 Marrier 19 50 大 AR CURS TORRE MANAGEMENT OF PROPERTY. February 24, 2000 DOTENDED PROPERTY SHIPPINGS M. Marrier or St. 800 Table Pant PAGET IN

FRIEN

SAIDER

MATCH CHRYSLER SEEP COOLS Dealer Emared Gonneter Dealer Entered Name ALEX ethoday into OF ECONTINENTIAL! This information is provided to CEALER, in accompanie with Section 4 of DEALER's Software Law Earlings and Electronic Commercia Agreement with Citydel Group LLC. At information provided with read on ASSESSMENT DEALER or Marine or \$5,965 when February 24, 22ml Trends des Presention Warriers DE DESPRESE TRUBE PRINCIPAL MAPONIA LONG TERM ENGINEERS BER Martin Street Towing Assertation Scorning pretteres MODE Service Contract - No Service Contracts Available CT. Service History (24 Month) Transaction Type List Date SALE Repair Ctalm DealestPayer Odometer Repair Date PREPARATION Number 2012234 IS DIROT January 19, 1012 WHERE CAST HELE CHENNERS SHET CODDE THEPIN ESTROCATO - Rocal House State : Pyto Vehicle Sale Information Sales Type: L. BROKEN named Damps: Stocks - Day of the State of the Stock of State Property .. by Temphores | 1715/229-9700 GRY BEYSIDE CHIMINY USA CAIR - No Goen CAIR Information Available

Your requires for Technical Appletonce has been submitted to the STAR Help Down. Your reference minition for this impact is 304539. AS STAR Help Does responses will be posted to the TemCONNECT Search Lib

Request Information Vehicle Information DB - Electron LNI Contact reformation Pitmick VIN 104RUFCTROCS OTHER System ID _ F26478A 2012 JEEP GRAND STAR Previously Net Provious Contacted CHEROKEE Marrie. Demast DIVERLAND 4X4 Welnickel Desirer Code: 040525 Restricted SPORT UTILITY 4 DR Parts Proons Number S.TL VS MOS VVT High (2 your Priority: Enginet pesponen! Engine Paul Nameber: Odometen 1618 Saturetted Status: Email Alerta: Yes Awaring for STAR to Vehicle in 1 day (or less) Mabile Alerts: You Steet Steeps **HERPOTER** Shop Email vehicle Off 1 Yes AGGTREE Resad Mobile Email Receptat I NO Address Repair NOT TREASURE IN PRESENTATION FOR MADE IN CASE OF test resultings tranger.

VEHICLE HEADLINER AND RIS VISOR HAVE COUGHT FIRE. YMES

Customer Concerns ANYTHING OUT THERE ABOUT THIS

YES - FIRE EXTING/SHED BY FDNY Concern Qualicated:

Repars, Parts and Tests: NA Service Bulletins Performed:

DTCs

Information Sent:

Scan Tool Software Version:

Last TechCONNECT Search FIRE

Print

Clase Window













1C4RJFC18CC

State Street or or





1C4RJFCT6CC























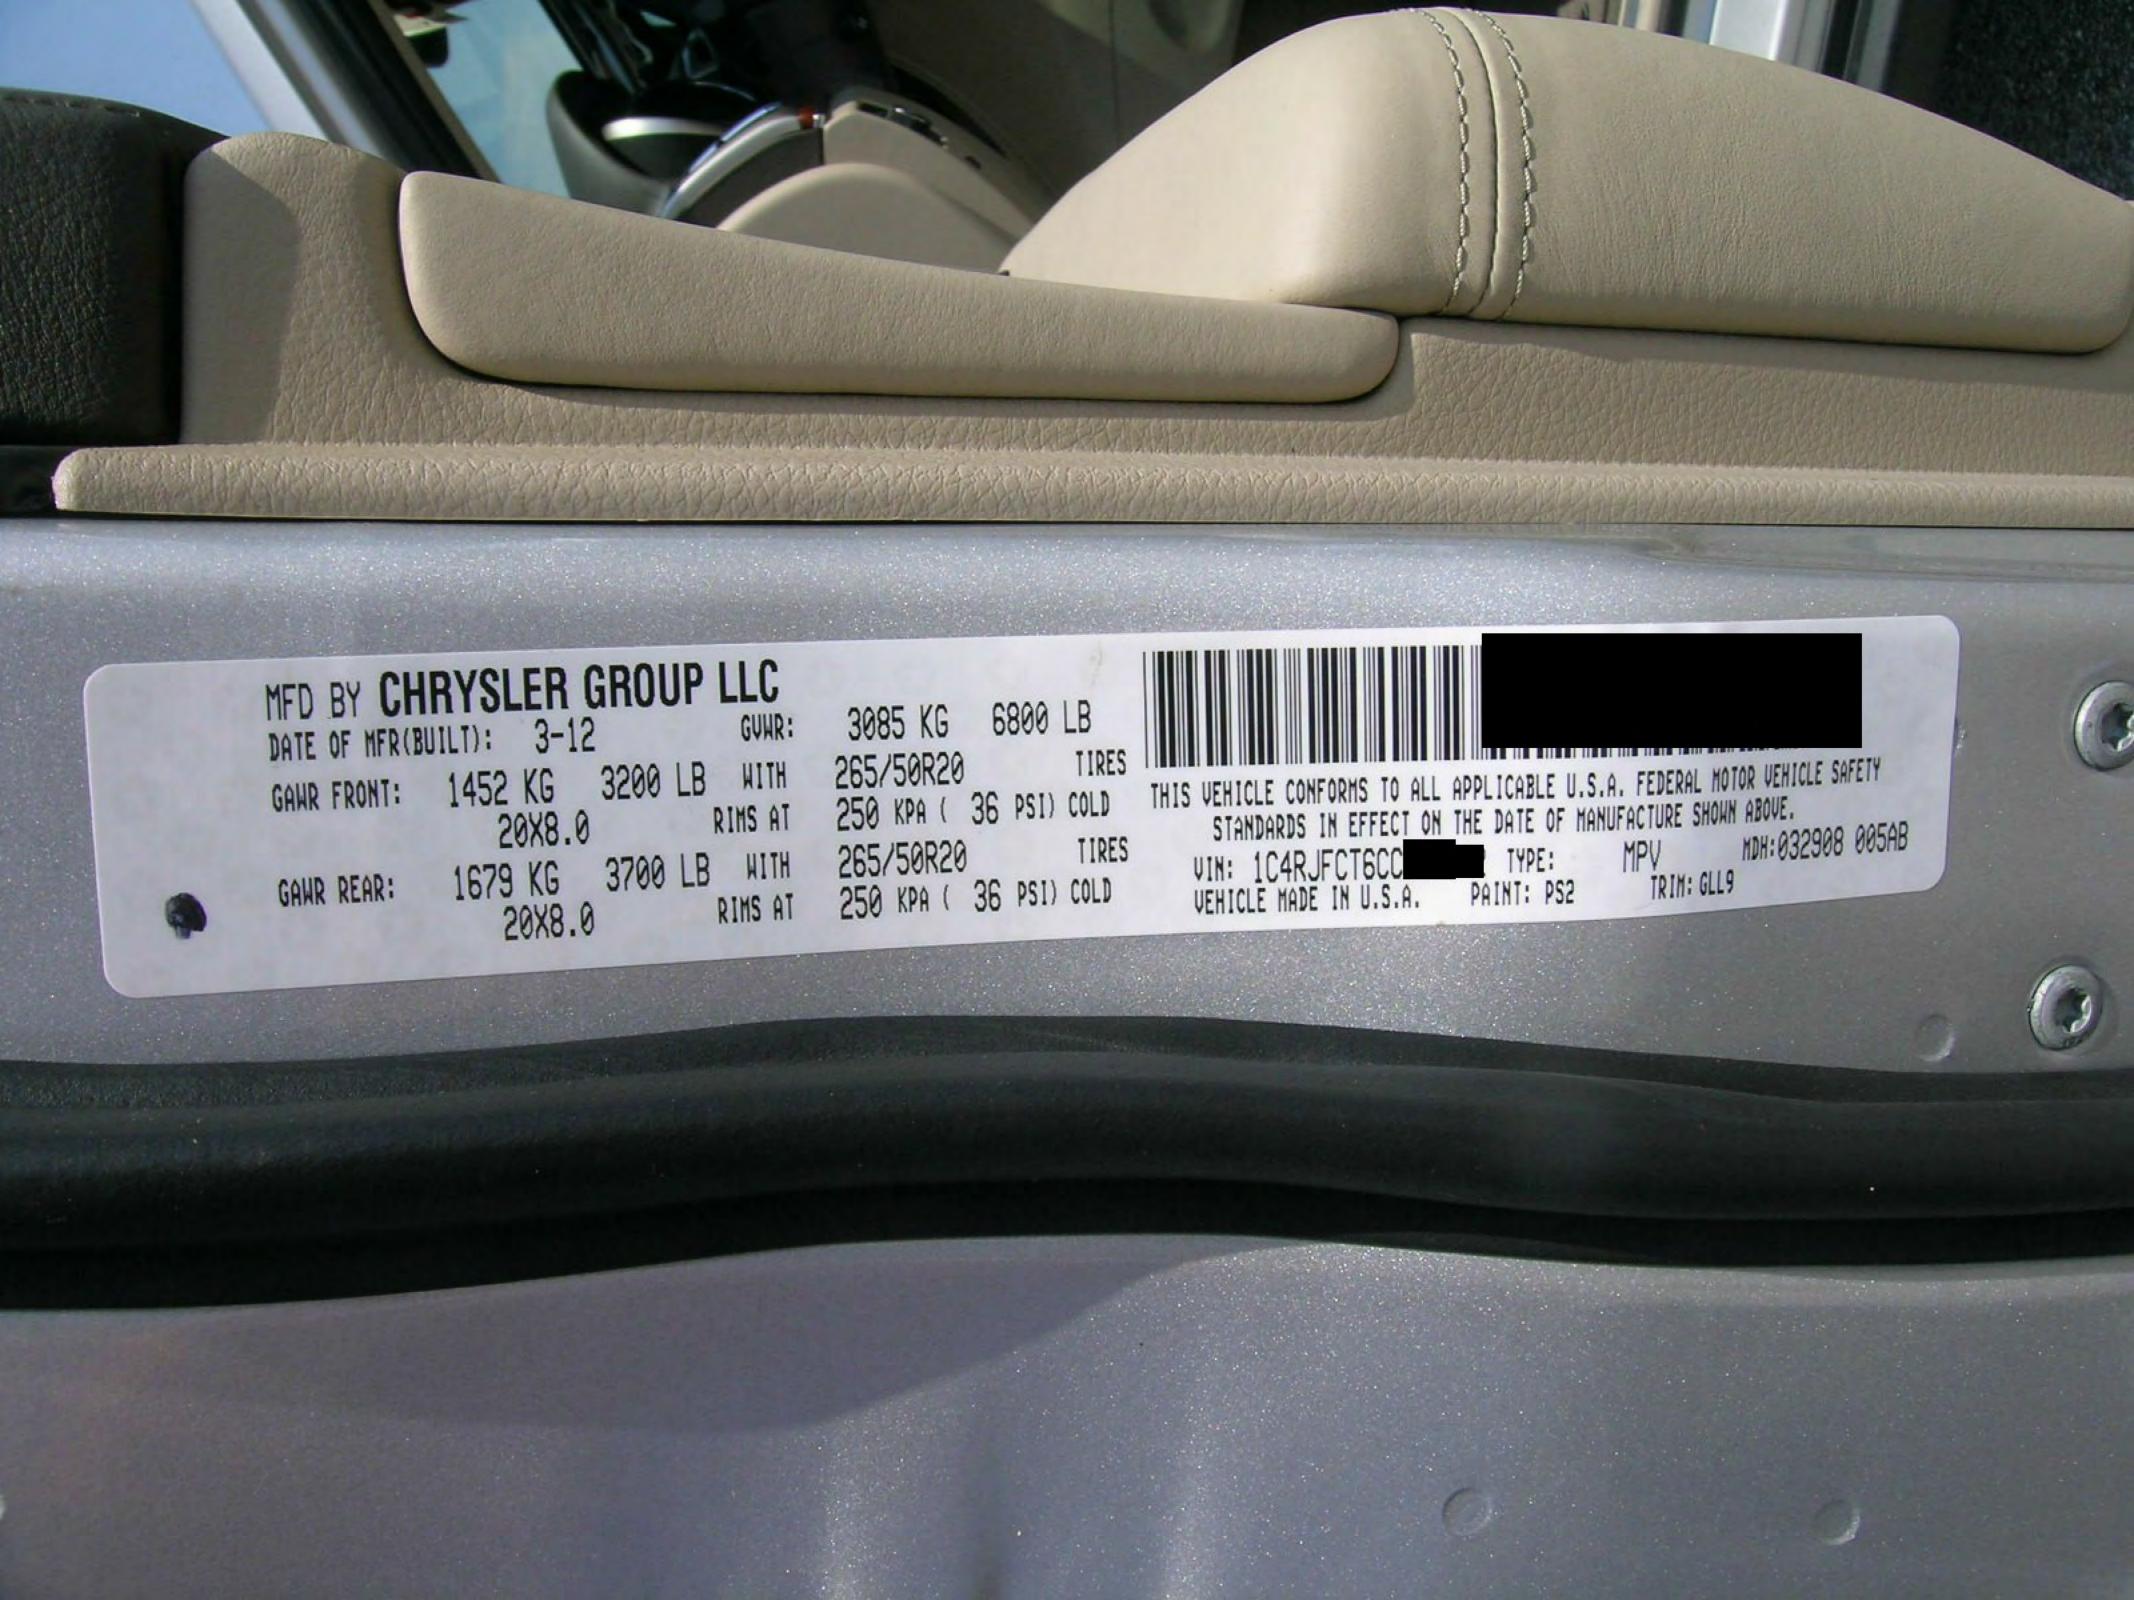



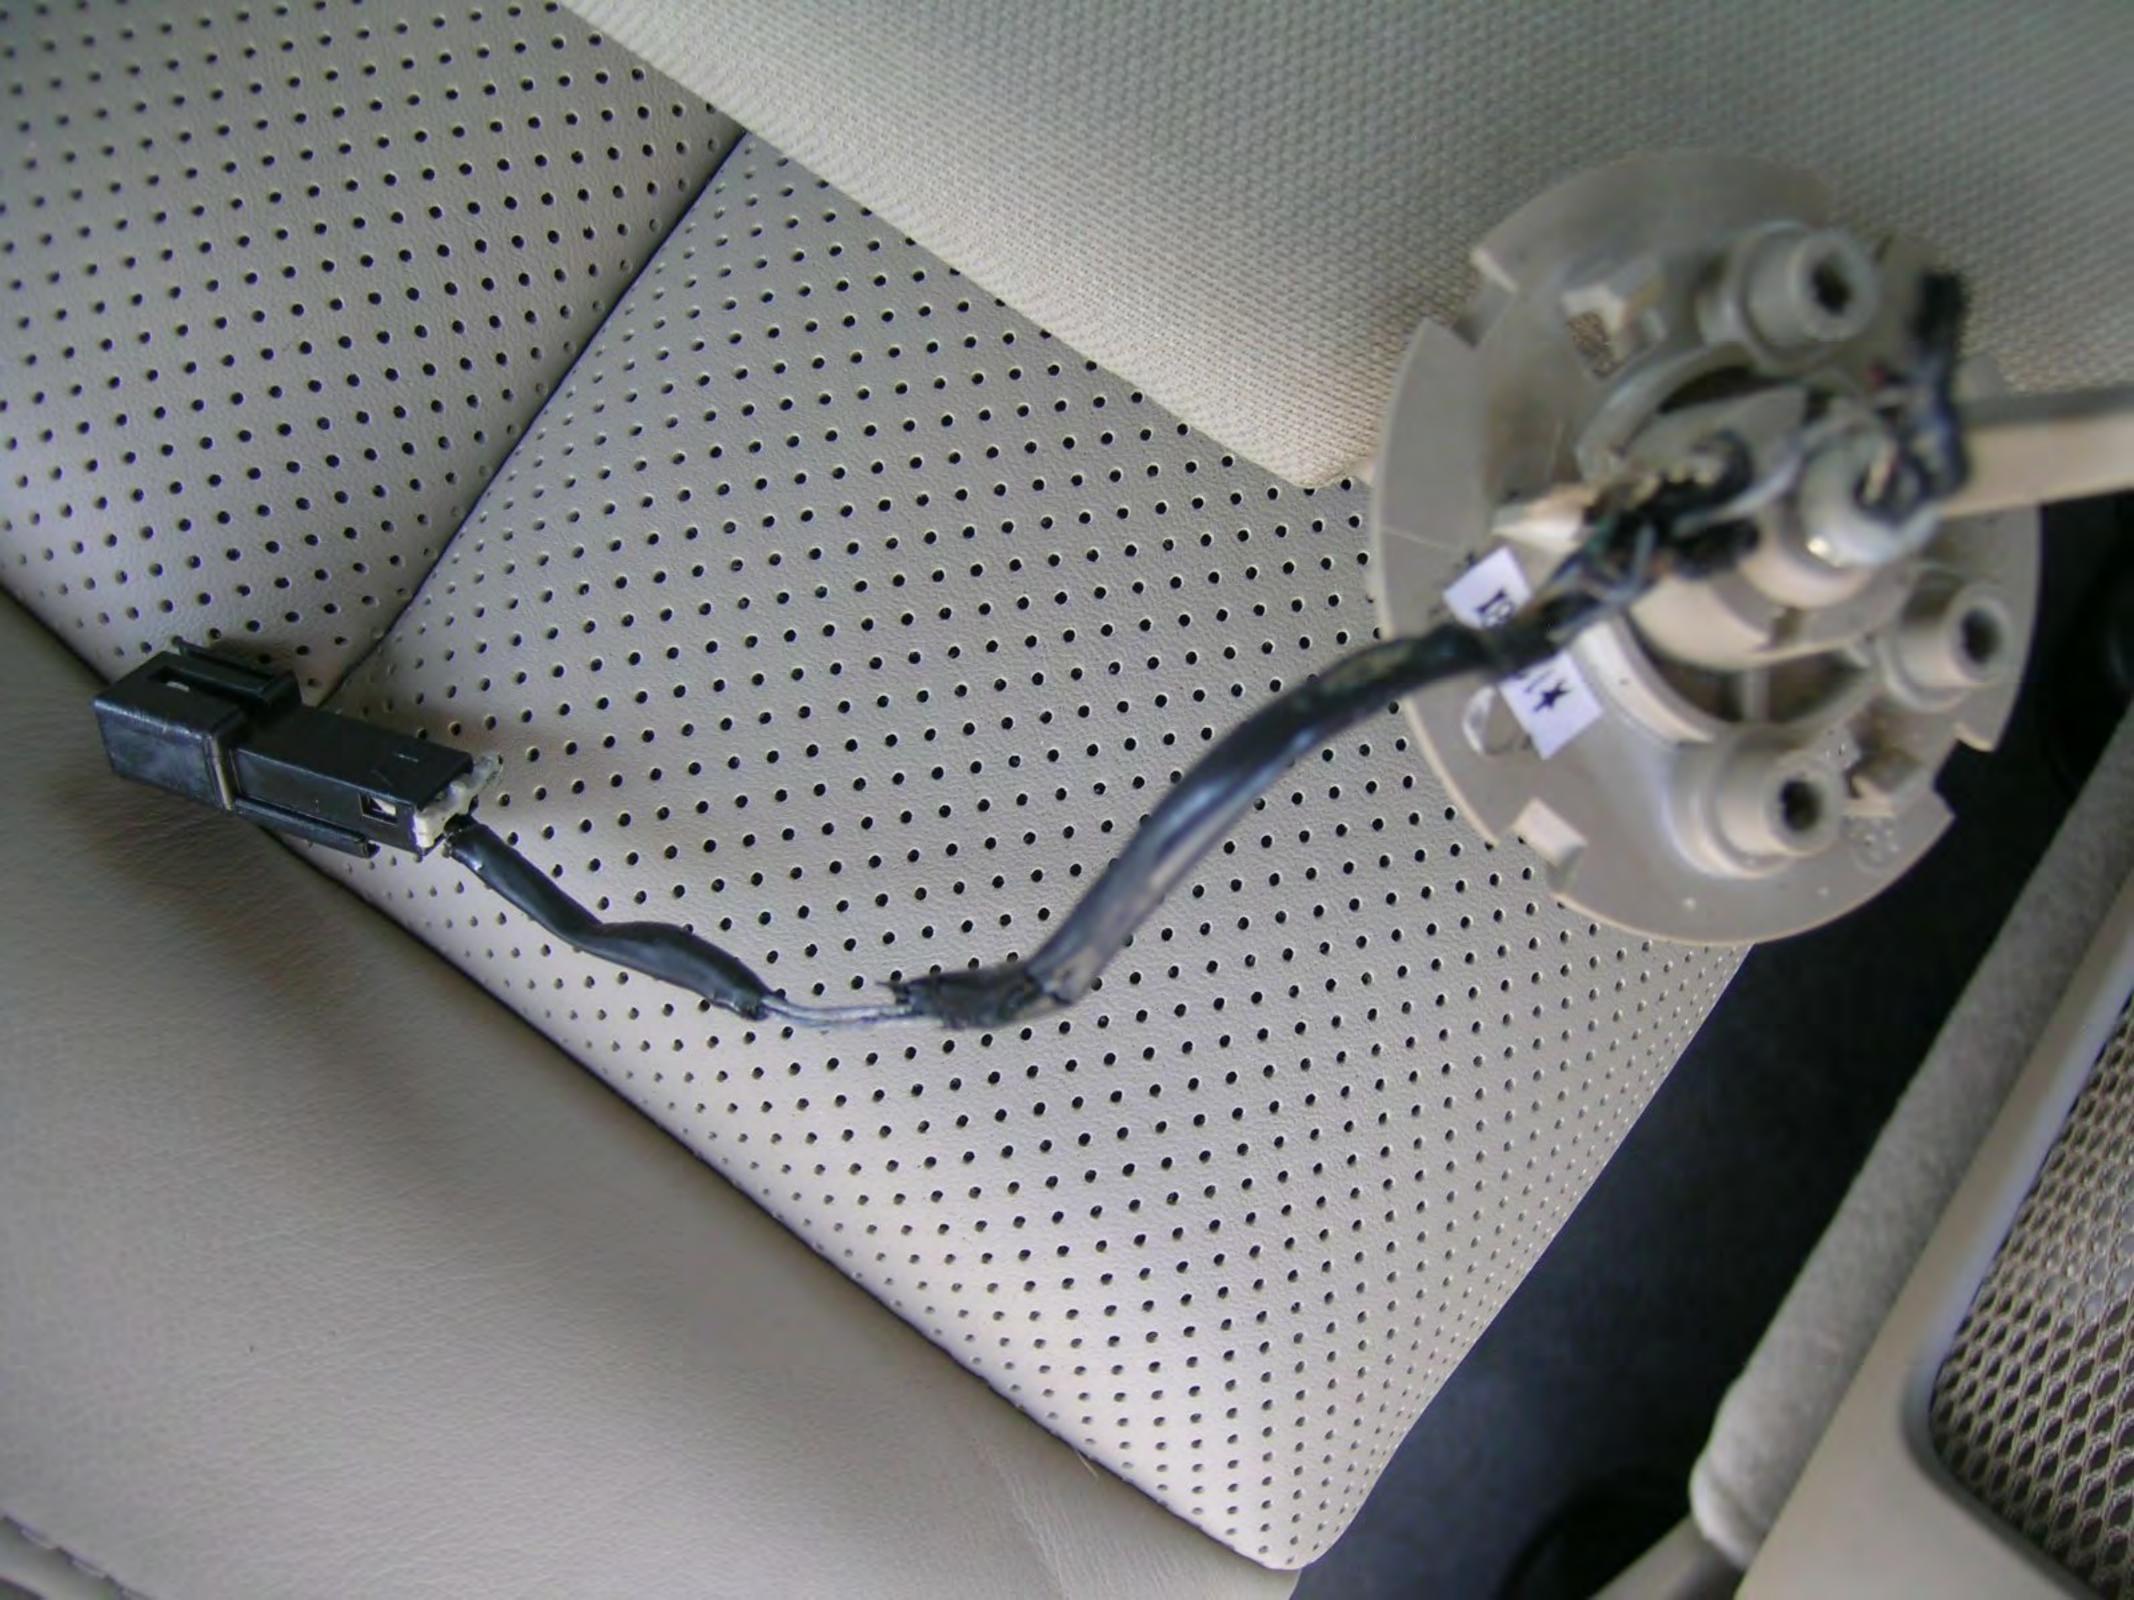












.

100

C 1/10 (100 100 100)

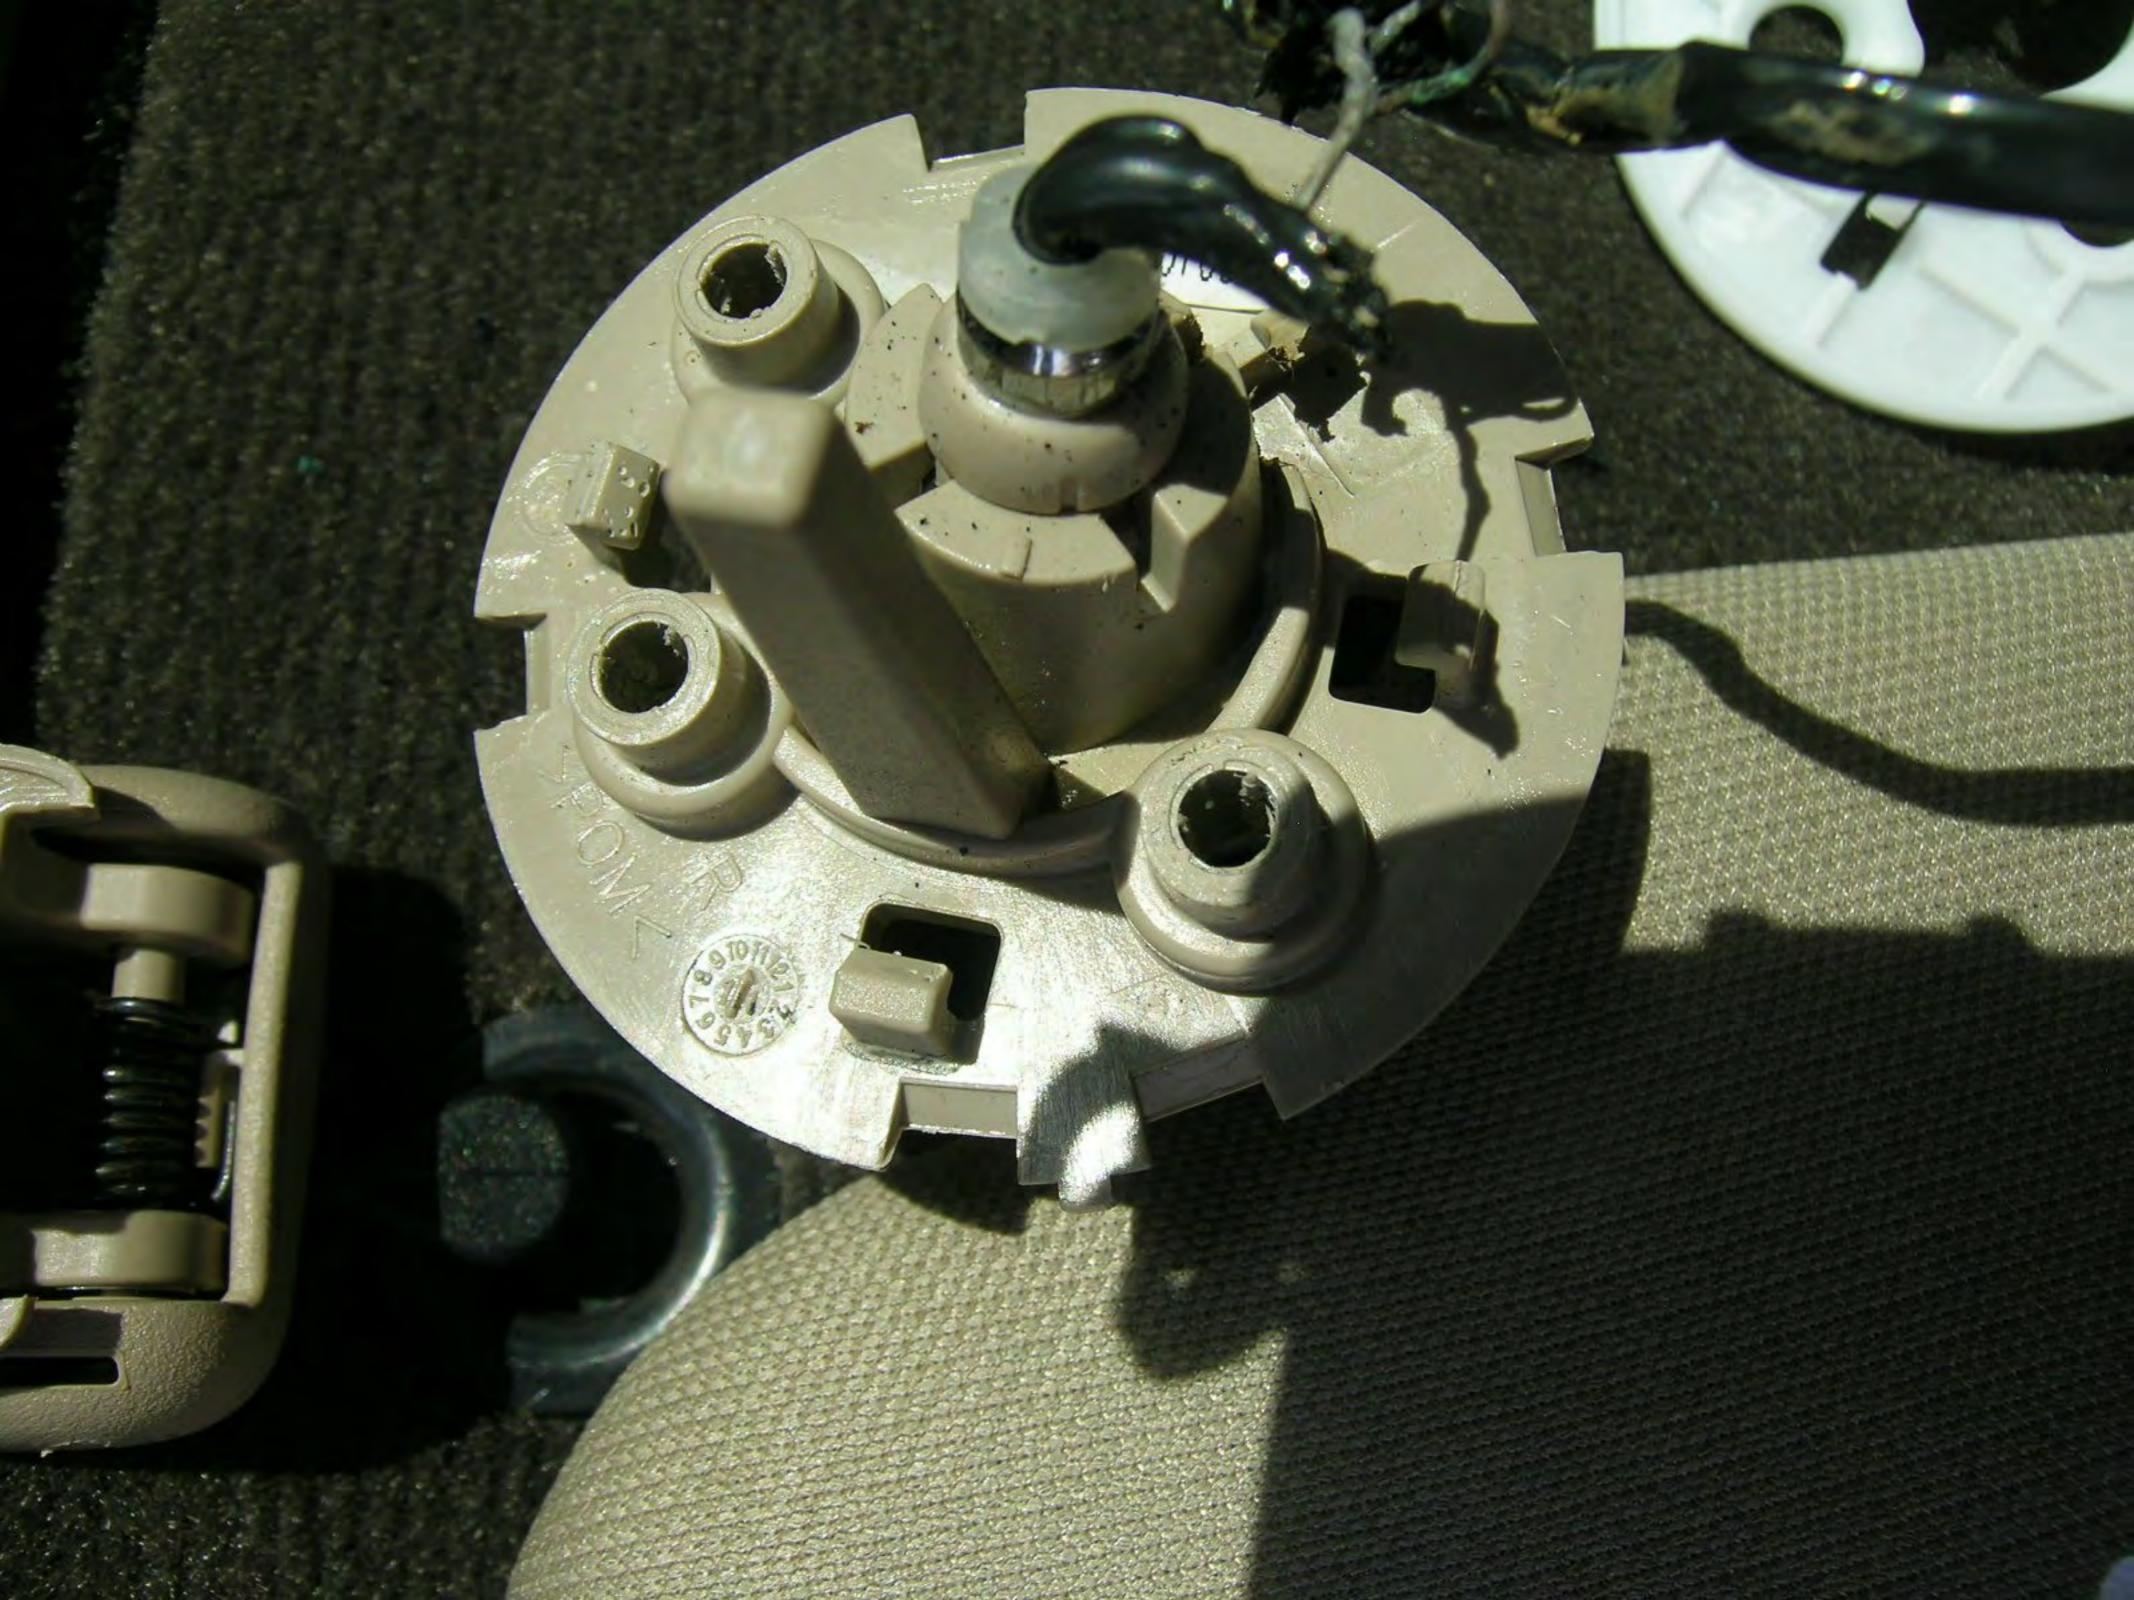






Ignition or Accessory ON 1679 mi **也**ACCY





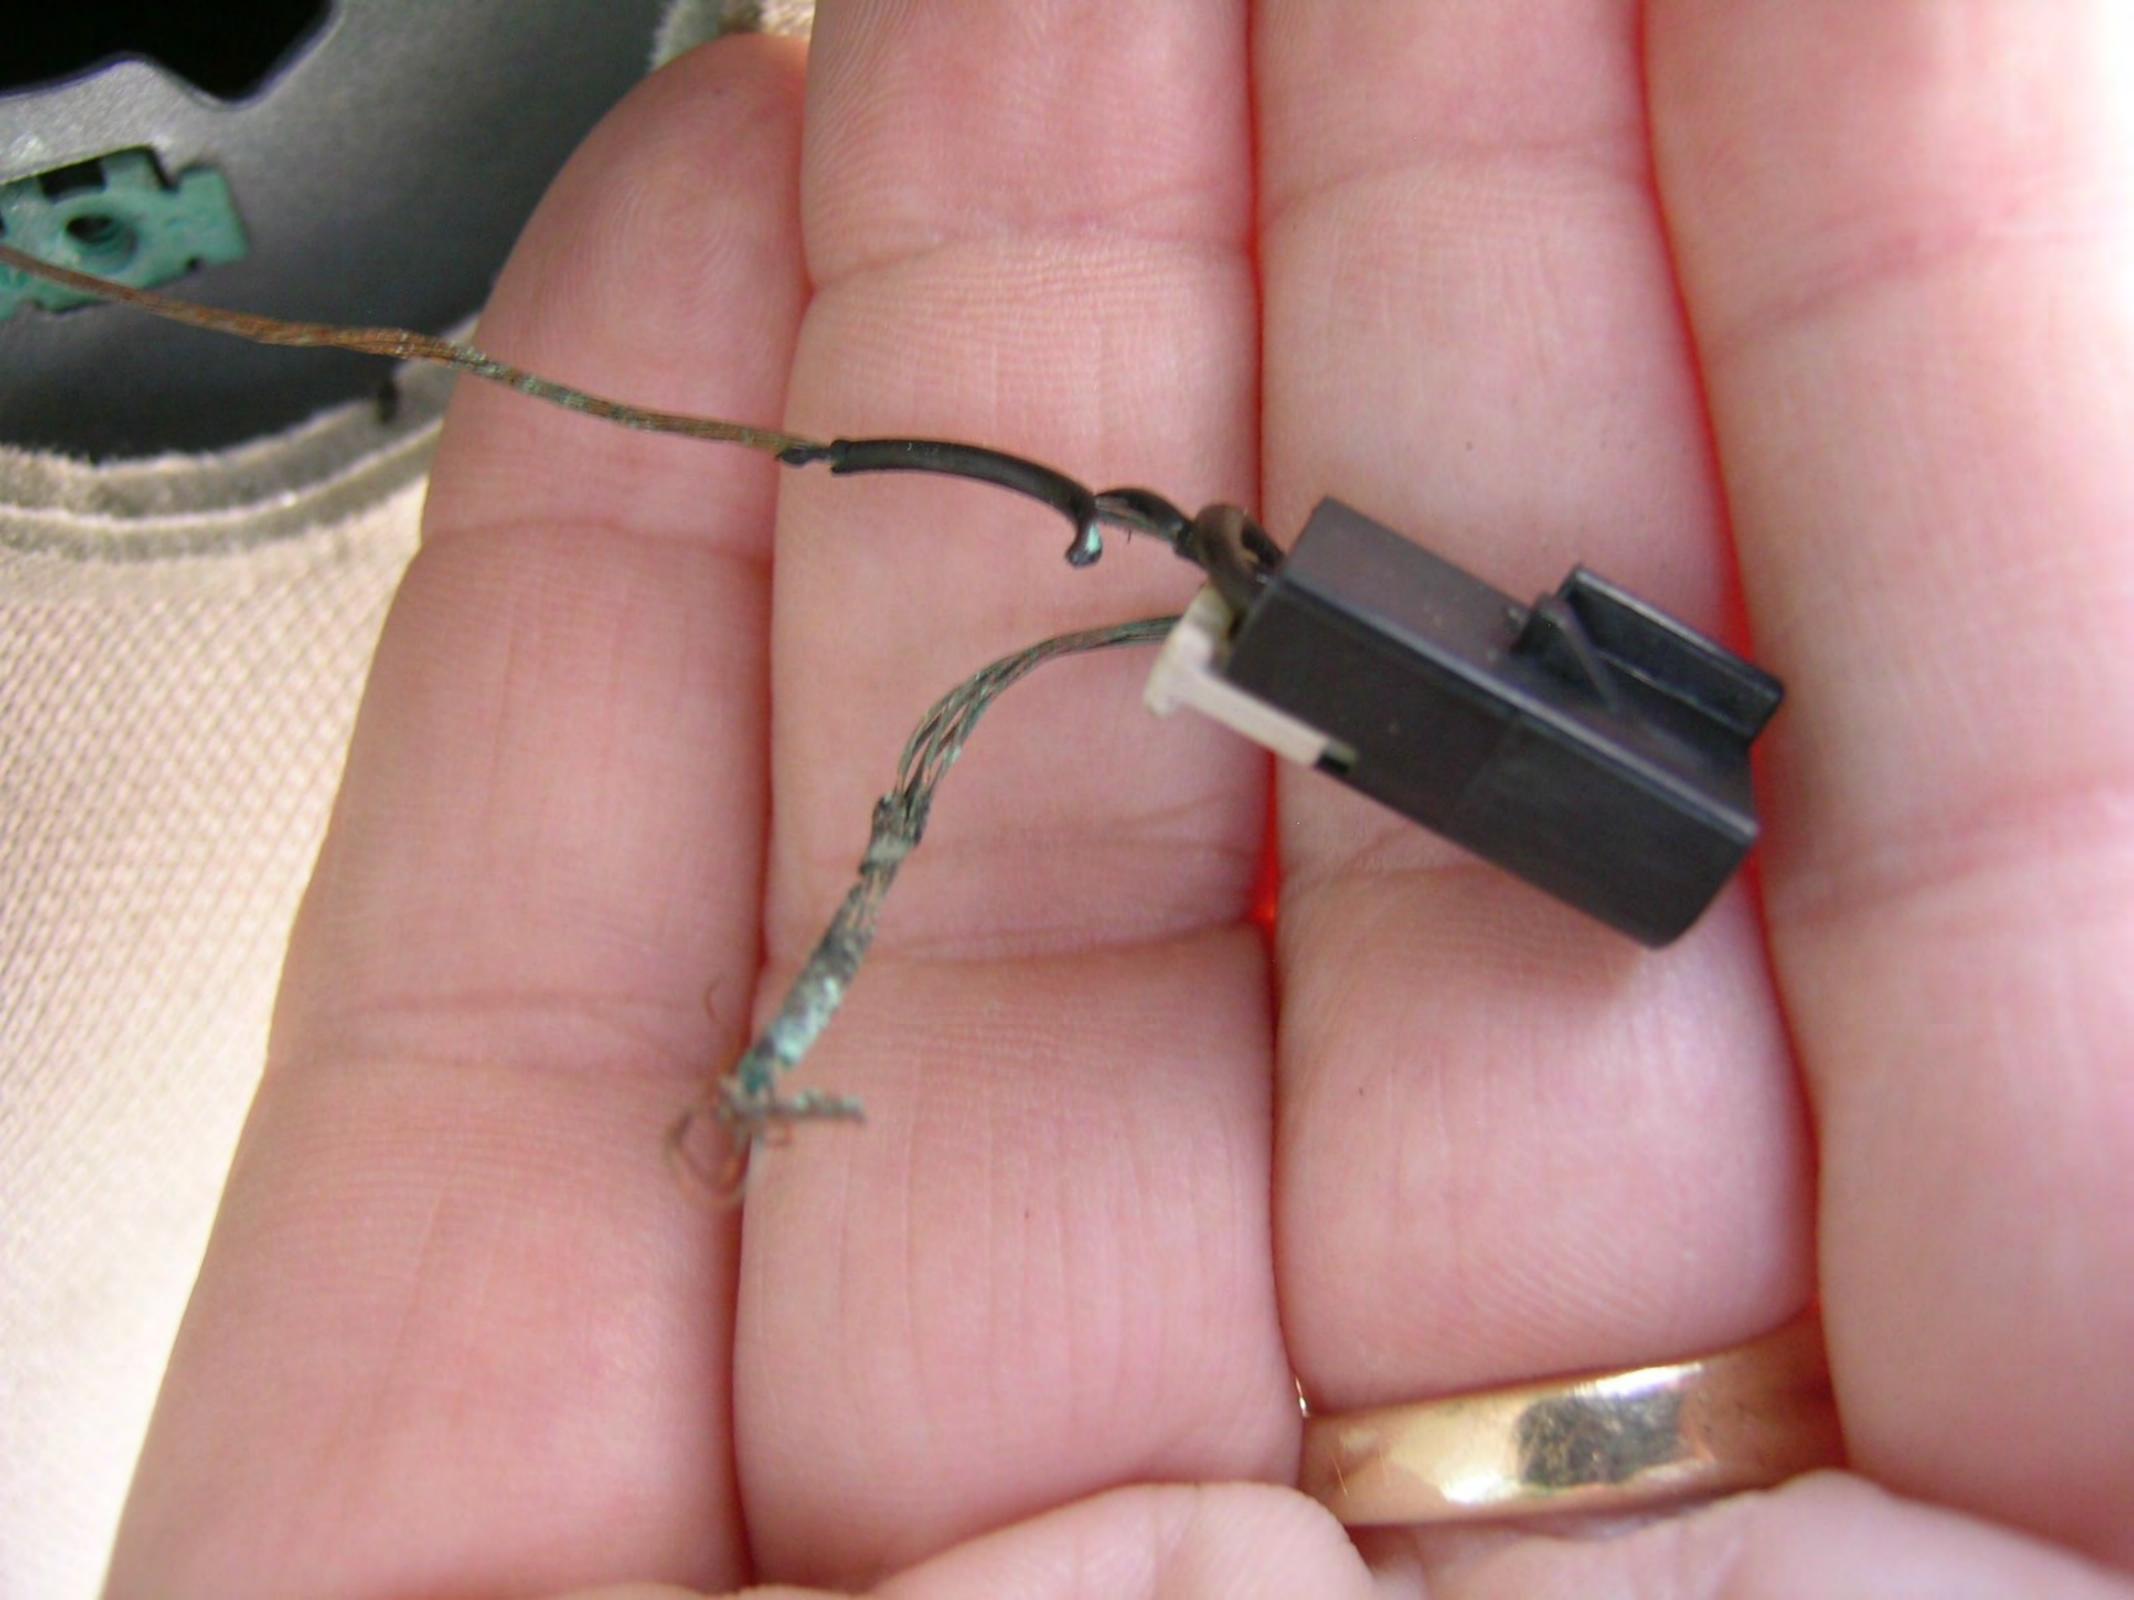


























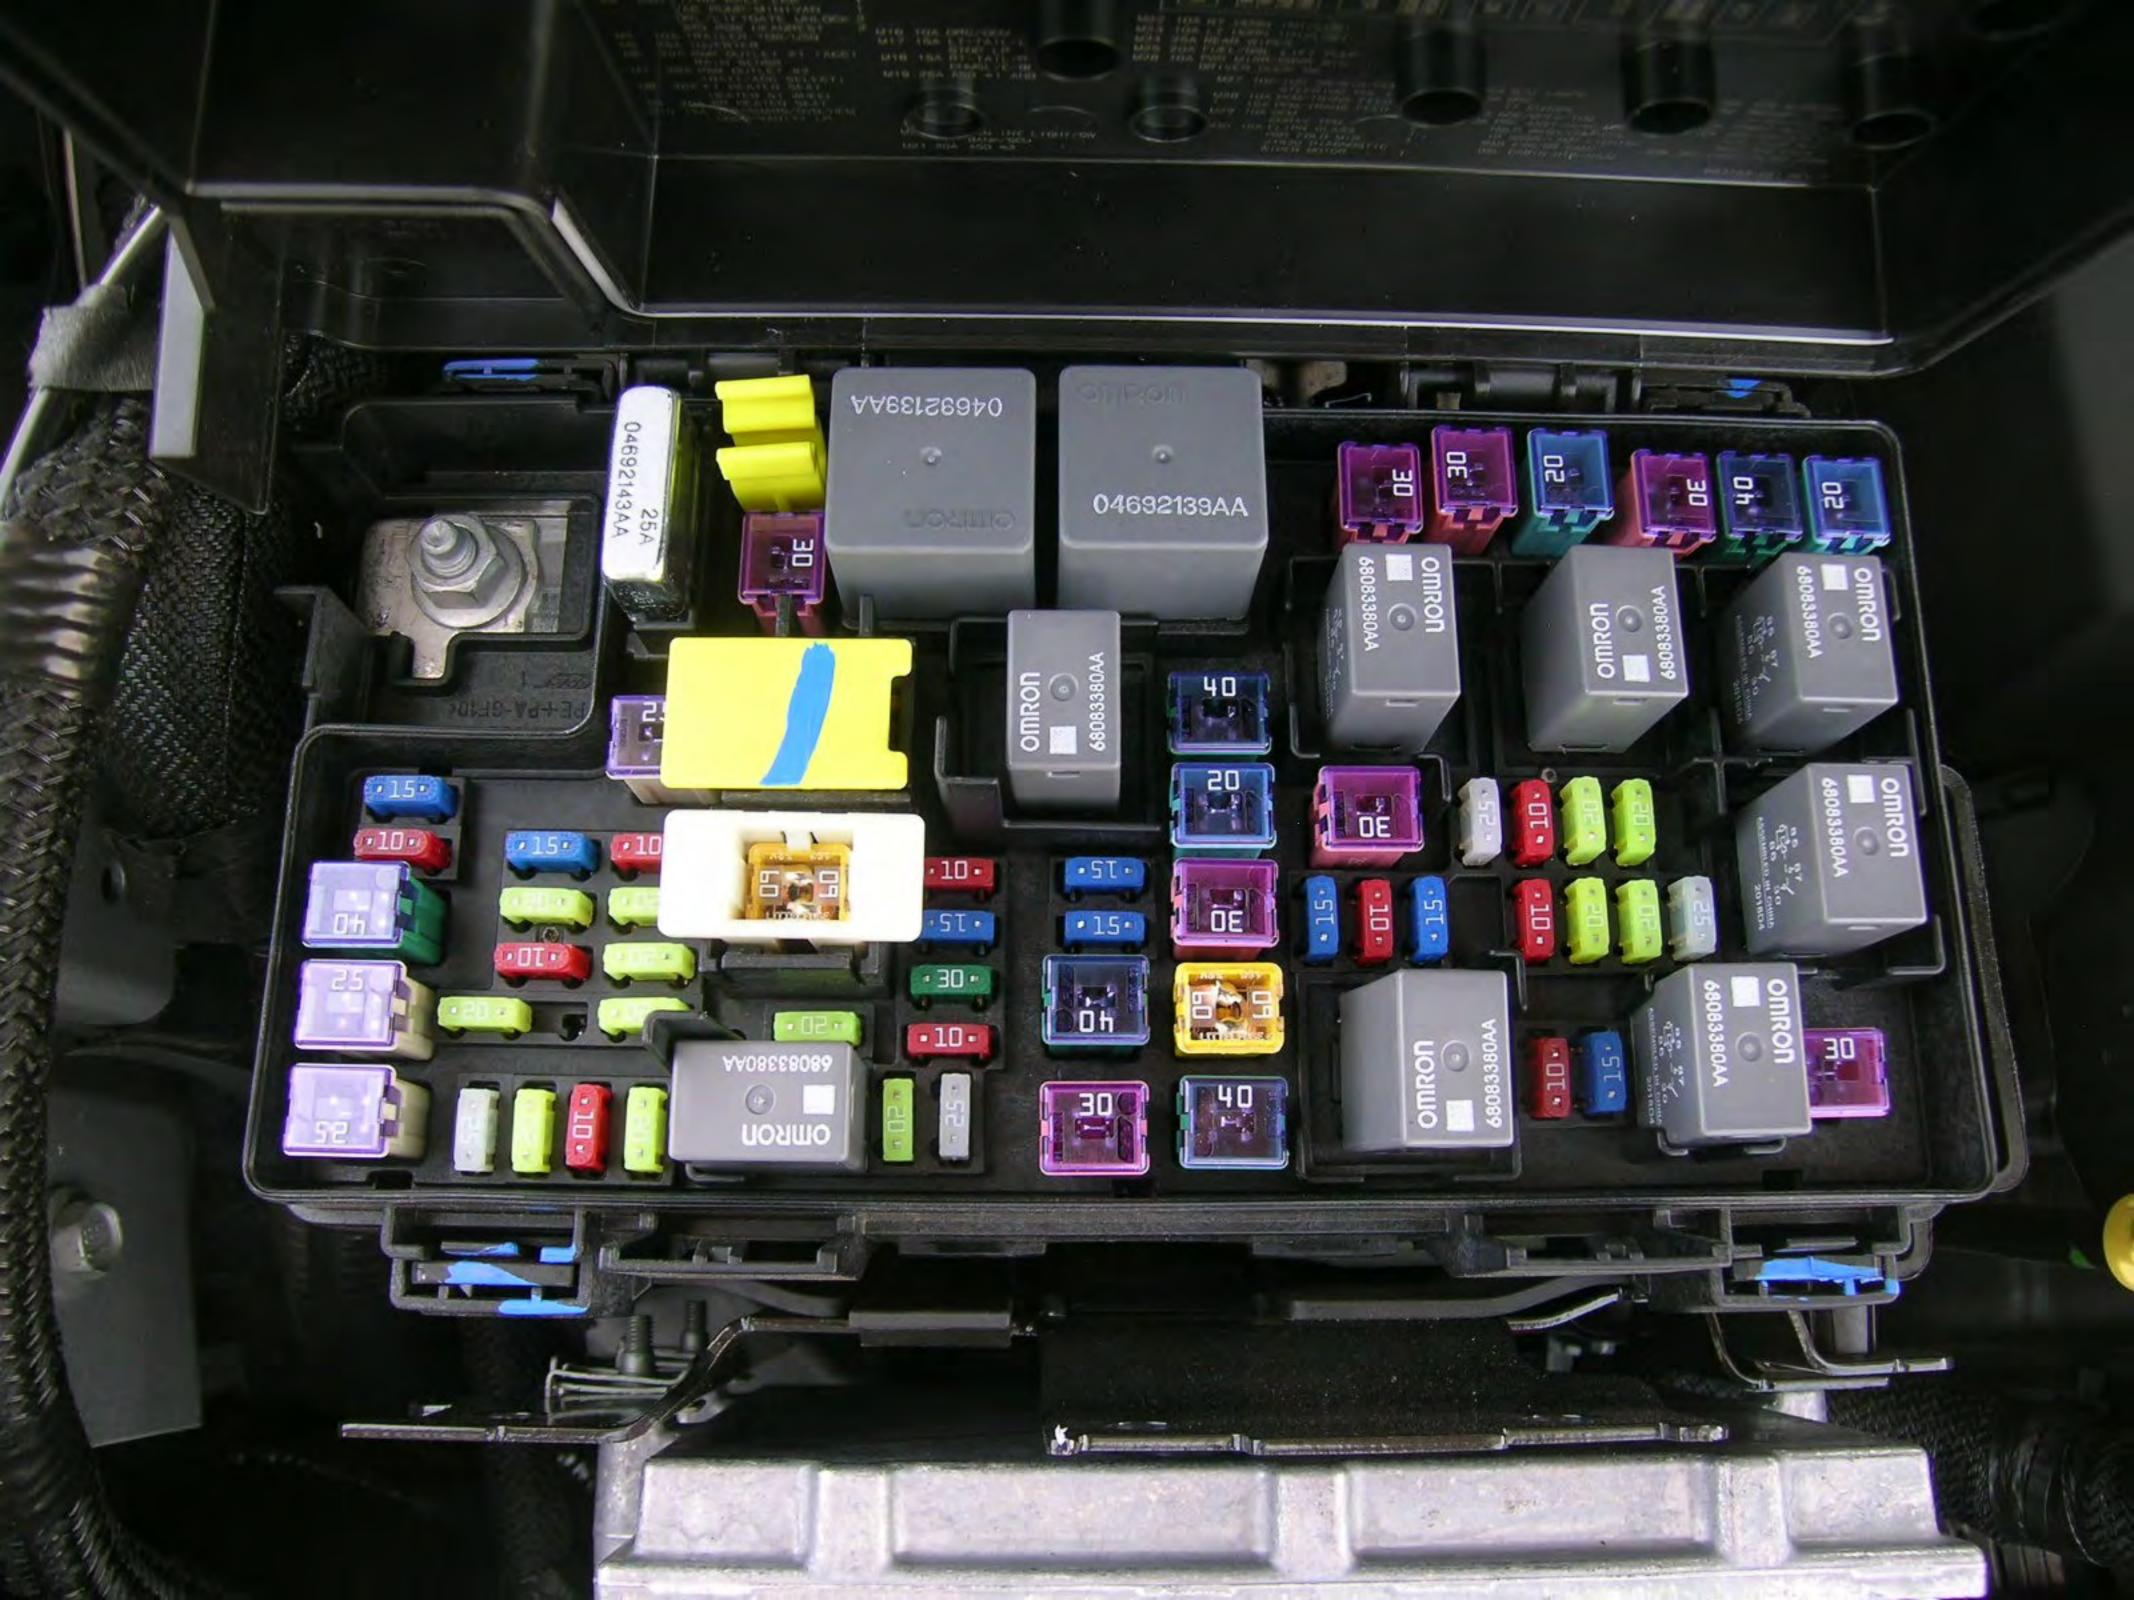



















CONFIDENTIAL

PRIOR APPROVAL IS REQUIRED BEFORE SHOWING OR PROVIDING THIS REPORT TO PERSONS NOT IN THE EMPLOY OF CHRYSLER CORPORATION

Vehicle Fire Investigation Report(VFIR)

CAIR	#	22302459										
YEAR	BRANI)			EHICLE IDI UMBER	ENT.	IFICATION	MO/DY HR	· OD	OMETER	SER\ DATE	
		GRAND CHEROKEE FUTILITY 4-DR	OVERLAND 4X4	1 10	C4RJFCT6C	CC		03-29 (08 16	79	08/1	1/2012
NAME	OF O	WNFR	ADDRESS/LO	CATI	ON		CITY			STATE	C	DUNTRY
							LEWISVILLE			TX	US	5A
ZIP		COLOR		M	ODEL	НΟ	ME PHONE		BUS:	NESS P	HONE	
		Bright Silver Meta	illic Clear Coat	W	KJ							
SELLI	NG DE	ALER NAME	ZONE		DLR. CO	DE	CITY		STATE		COUN	ITRY
HUFF)		CHRYSLER JEEP VIS	63		43290		LEWISVILLE		ΓX		USA	
INSPE	CTOR	- NAME LAST, FIR	RST,MIDDLE	INSF	ECTOR'S	COM	IPANY II	NSPECTO	R'S PH	HONE NO).	
Hartley William S			EAA	A 817-99		17-992-8	992-8163					
DAMAGE ESTIMATE						REPAIR ES	REPAIR ESTIMATE					
	NOR	MODERATE C	TOTAL LOSS		·		\$ 1312.36					·

INTERVIEW

NTERVIEW WITH: C DRIVER C OWNER C OTHER C DRIVER/OWNER										
** DRIVER ** OWNER ** DRIVER/OWNER										
NAME: LAST, FIRST,MIDDLE										
INTERVIEW DATE:	DATE OF FIRE:	TIME OF FIRE	INSPECTION DATE:							
06/11/2012	06/05/2012	04:00 C AM ® PM	06/11/2012							
1. DRIVER'S DESCRIPTION OF EVENT:	DESCRIPTION vehicle is a dealer demo assigned to the finance manager. He stated the finance									
2. WHERE WAS FIR ORIGIN)	ST NOTICED (GENERAL	ENGINE INSTRUMENT PANEL INTERIOR (NOT I/P) TRUNK UNDERBODY								
IN WHAT SPECIFIC LOCATION? (AS NOTED FROM DRIVER'S SEAT)		☐ LEFT FRONT ▼ RIGHT FRONT ☐ LEFT REAR ☐ RIGHT REAR ☐ CENTER								
3. HOW WAS THE V	3. HOW WAS THE VEHICLE BEING USED AT THE TIME OF THE FIRE?									
ORIVING WHAT SPEED? 45 HOW LONG? 10 ☐ IDLING. HOW LONG? ☐ IGNITION OFF. HOW LONG?										
4. ANY NOTICABLE EVENTS PRIOR TO FIRE? FUEL ODOR MISFIRE DIEOUT BACKFIRE FLUID LEAKS CHECK ENGINE(MIL) LIGHT LIGHTS DIMMING/FLASHING NOPERATIVE COMPONENT/SYSTEM WARNING LIGHTS/GAUGES OTHER EXPLAIN Smoke coming from sunroof opening in the headliner.										
	5. WHAT SYSTEMS WERE ON AT TIME OF FIRE? LIGHTS BLOWER MOTOR REAR DEFROSTER WIPERS A/C OTHER. DESCRIBE: radio									

E	6. HOW LONG DID FIRE BURN AND METHOD USED TO EXTINGUISH O MINUTES WATER SET EXTINGUISHED O MINUTES SET EXTINGUISHED							
7.	7. LIST RECENT REPAIRS AND DATES (INCLUDE OIL None CHANGES)							
8.	WERE ANY OCCUPANTS IN THE VEHICLE SI TO THE FIRE	MOKING PRIOR	C YES ♠ NO					
9.	ANY NON-FACTORY INSTALLED EQUIPMENT OR MODIFICATIONS MADE TO THE VEHICLE (I.E. CELL PHONE, RADAR DETECTOR, TRAILER WIRING, AFTER MARKET RADIO, ETC.)?	○ YES ⓒ NO	IF YES, DESCRIBE					
10.	ANY LOSS OF OR DAMAGE TO PERSONAL PROPERTY	C YES € NO	IF YES, DESCRIBE					
11.	ANY ALLEGED PERSONAL INJURIES?	C YES	IF YES, LIST NAME & NATURE OF INJURY					
	WAS TREATMENT REQUIRED	○ YES ⑤ NO	WHERE WAS TREATMENT SOUGHT?					
12.	DID OWNER NOTIFY HIS/HER AUTO INSURANCE CARRIER?	C YES € NO	NAME OF COMPANY:					

Next

The text, graphics and all other contents of this site are copyright 2002 Chrysler Corporation. All rights reserved.

CONFIDENTIAL Page 1 of 2

CONFIDENTIAL

PRIOR APPROVAL IS REQUIRED BEFORE SHOWING OR PROVIDING THIS REPORT TO PERSONS NOT IN THE EMPLOY OF CHRYSLER CORPORATION

	ST(CHECK OFF AND NOTE OBSERVATIONS WHERE APPLIC D ADDITIONAL COMMENTS BELOW)	CABLE TO DETERMINE POSSIBLE ORIGIN
	ICLE HISTORY FILE - WERE THERE ANY RECENT SERVICE (ES, ATTACH COPIES OF REPAIR ORDERS	None
	FLUID LEVELS I.E. ENGINE OIL, COOLANT, POWER BRAKE TRANSMISSION, WINDSHIELD WASHER FLUID	All correct and none involved
	OMBUSTIBLES WITH MOST DAMAGE - NOTE BURNT TED PLASTICS AND ALUMINIUM INDICATOR OF HOT	Last 8" of the wiring harness to the right visor vanity mirror and the headliner below it.
SHORT, ETC	HE MOST LIKELY METHOD OF IGNITION (HOT SURFACE,	It appears to be an electrical short.
IDENTIFY THUSE POINTE	HE FIRE'S PROGRESSION FROM THE AREA OF ORIGIN - ER METHOD	The damage is contained in the area of the right sun visor mounting bracket.
(ENGINE OI	ANIFOLD/PIPE - LOOK FOR: WITNESS OF FLUID LEAKS L, TRANS., POWER STEERING FLUID, COOLANT, ETC.) STS OR OTHER FOREIGN OBJECTS.	Not involved.
FUEL HOSES CONNECTIO	S AND TUBES - LOOK FOR PROPER ROUTING AND NS.	Intact and not involved.
	MPARTMENT AND INTERIOR FUSE CONDITION, CHECK AND COMPARE SIZE (RATING) WITH SPECIFICATIONS.	All of the fuses in the TIPM are of the correct size, and none were found open.
DEPOSITS, I SHORTED W	OOK FOR ENDS (STRAND WITH BALL ON END), COPPER BURN HOLES IN METAL - INDICATING ARCED OR /IRE - NOTE POSSIBLE CAUSE (PINCHED, CHAFED, OUGH WIRE, WELDED WIRES.)	The wires above the headliner are void of insulation from the mirror connector about 8" back and one is severed. The wires at the sun visor mounting bracket are twisted and void of insulation in two areas - see the photos. The wiring diagrams in Dealer Connect were consulted to determine which fuses to check for the mirror circuit. We were unable to locate the vanity mirror on any wiring circuit shown. A volt meter connected to the two bare vanity mirror wires showed 11.91V with the ignition off. Each fuse in the TIPM was pulled one at a time. Fuse M20 caused the mirror circuit to drop to 3.13V and fuse M13 caused it to drop to 2.24V, but none of the fuses caused the mirror circuit to shut off completely.
POWER STE	ERING PUMP AND HOSES - LOOK FOR HOSE TUBE	All intact and not involved.

CONFIDENTIAL Page 2 of 2

DAMAGE, HOSE ROUTII CAP (REMAINS IN PUMI	NG, EVIDENCE OF CHAFING, MISSING PUMP P), ETC.	
A	T VALVE COVER HEAD GASKET, LOOSE OR AP, OIL PAN, FILTER, SENDING UNIT, CAM	All intact and not involved.
P	MENT INSTALLATION - CHECK FOR PROPER TRE ROUTING TO POWER SOURCE.	None
ASHTRAYS - CHECK FO SEAT CUSHIONS AND (R CIGARETTES AND DEBRIS IN ASHTRAY, ON CARPETING.	None
	NITION AND ALL OTHER SWITCH POSITIONS CIRCUITS WERE ON AT TIME OF FIRE.	Ignition was on as was radio and HVAC.
ADDITIONAL COMMENTS:	48 digital photos were taken. The photo were uploaded to the Covisint website. Tauthorities were involved. The dealershi replace the headlining with wiring harne separately) and sun visor with vanity mi of the dealer RO that was FAXed to Chry	There is no police or fire report, as no poli
ATTACH:	POLICE OR FIRE REPORTS, IF AVAILABLE	E REPAIR ESTIMATES COTHER

INVESTIGATION (Inspect above items before proceeding)							
GENERAL ORIGIN (CHECK THE AREA WITH MOST DAMAGE)		ENGINE INSTRUMENT PANEL INTERIOR (NOT I/P) TRUNK UNDERBODY					
LOWEST POINT OF BURNING	3	TOP OF VEHICLE MIDDLE OF VEHICLE BOTTOM OF VEHICLE					
DETERMINATION OF ORIGIN AND POSSIBLE CAUSE							
ORIGN APPEARS TO BE IN THE AREA OF:	Above the headliner at the right front sun visor mounting area						
CAUSE APPEARS TO BE: Shorted		visor vanity mirror harness.					
REASONS FOR STATING ORIGIN AND CAUSE: The origin statement is based on the damage to the wiring harness and upper side of the headliner at the right front sun visor mounting area. The cause statement is based on the twisted damage to the wiring harness and the arc mark on the inner roof panel at the sun visor mounting location.							
Previous Form Approved Returned for Corrections							

 $The \ text, \ graphics \ and \ all \ other \ contents \ of \ this \ site \ are \ copyright \ 2002 \ Chrysler \ Corporation. \ All \ rights \ reserved.$



Chrysler Special Investigations Inspection Request EAA Project Number: CHRY-2011

Owner:	
Project No. CHRY-2011	CAIR No.: <u>22302459</u>
TO: Bill Hartley	FROM: EAA FC
Region: STW	Date Sent: 06/08/12
	DUE DATE: <u>06/15/12</u>
PLEASE ACKNOWLEDGE PROMPTLY BY EMAILE EAAFC@SERVICESOLUTIONS.SPX.COM	NG YOUR RESPONSE TO:
*Receipt of CAIR and Accepting case for inve	estigation? 🖂 Yes 🗌 No
*Closure Date: <u>6/11/12</u>	Date: 6/8/12
(Always send case closure date to EAA FC box upon	completion of case Thanks!)
Chrysler Special Investigations Fax No.: 2	248- 512-1322
 Please cmail all case acceptances, closures, de caafc@servicesolutions.spx.com Please upload photos and report to the Specia www.covisint.com 	l Investigations website at:
 Email Closure to <u>FAAFC@servicesolutions.sp</u>; and photos to Covisint. 	<u>x.com</u> upon uploading your report
For technical assistance related to Project CHRY-20 Chrysler Special Investigations contacts:	11, please call one of the following
☐ Maggie Gentry (248) 944-7084	
☑ Jay Susalla (248) 944-7149	
Comments: <u>FAX consists of 1 page photo log, 1 page cover sheet.</u>	ge dealer RO/estimate, and this

Case #: ame: Date: 5/11/12 1C4RJFCT6C Miles: 1,679 MDH: 032908 William Hartley, I.C. Inspector: EAA (817) 992-8163 No. Description The following is a list of photographs taken while investigating the above referenced case: 22302459- 1 22302459- 2 Build data label 22302459- 3 Instrument cluster showing edometer reading 22302459- 4 Front view 22302459- 5 Left front view 22302459- 6 Left side view 22302459- 7 Left rear view 22302459- 8 Rear view 22302459- 9 Right rear view 22302459- 10 Right side view 22302459- 11 Right front view 22302459- 12 Windshield from the front 22302459- 13 Interior and dash from the left side 22302459- 14 Front seats from the tell side 22302459- 15 Headliner and sun visor from the left side 22302459- 16 Dash from the left rear 22302459- 17 Interior and dash from the right side 22302459- 18 Front seats from the right side 22302459- 19 Right front door incide trim panel 22302459- 20 Right front sun visor averview 22302459- 21 Closer view of the right front sun visor mirror wiring harness damage 22302459- 22 Closer view of the right front sun visor mirror wiring harness damage 22302459- 23 Closer view of the right front sun visor mirror wiring harness damage 22302459- 24 Closer view of the right front sun visor mirror wiring harness damage 22302459- 25 Right front sun visor mounting spacer 22302459- 26 Right front sun visor mounting spacer 22302459- 27 Right front sun visor mounting bracket 22302459- 28 2 sun visor mounting screws 22302459- 29 Sun visor vanity mirror 22302459- 30 Right front sun visor mounting location in the headliner 22302459- 31 Right front vanity mirror harness at the headliner 22302459- 32 Right front vanity mirror namess at the headliner 22302459- 33 Right front vanity mirror harness at the headliner 22302459- 34 Overview of the right front sunroof mounting area in the inner roof panel 22302459- 35 Right front sun visor mounting hote in inner roof panel 22302459- 36 Right front sun visor mounting hole in inner roof panel 22302459- 37 Damage to the vanity mirror harness above the headliner 22302459- 38 Damage to the vanity mirror harness above the headliner 22302459- 39 Damage to the vanity mirror harness above the headliner 22302459- 40 Damage to the vanity mirror harness above the headliner 22302459- 41 Overview of the engine compartment from the front 22302459- 42 Overview of the engine compartment from the left side 22302459- 43 Overview of the engine compartment from the right side 22302459- 44 TIPM fuse panel 22302459- 45 TiPM fuse panel legend 22302459- 46 PCM and connectors 22302459- 47 Checking the voltage on the variity mirror harness 22302459- 48 DVOM showing voltage reading on the vanity mirror harness with the key off END

INVENTORY: 12GC1078		Home Phon	Ė	R₁O Open P: 6 / 0.5 /			3642
		Work Phan	¢ .	Tinic Receiv	ed	Time F	tomised.
				15:54	L		17:00
		Key Tag≠ 7585		Current Milea		Milea	ge Out
Year Make	2505 Bedy		1678 Engine Code		Service Advice		
2012 JEEP Vehicle Identification Number	GRAND CHEROKE	OVERLAND		EZH		Sean	Rear
1C4RJFCT60	BRIGHT SIL	License Num	per	Delivery Da	te	lu-zen	ice Date
12GC1078 1 - 800: ELECTRICAL							
VANITY MIRROR ON D ON PASSANGER SIDE FROM HEADIINER AT FUSE ON DRIVE	IS INOP AND SAW	SMOKE COMI	NG				
2 - 23P: 23 POINT INSP	ECTION		Est:	imate:	.00		. 0
3 - CL: CL DEMO - BILL MATSON			Est:	imate:	.00		. 0
		Origina	l Est:	imate:			.00
O# RO#Date	-MilesServic	e Writer			T	ime	-Tota
CI 6170804 4/24/12 W PDI16: PDI	5 jim wh Grand Cherokee	IDDON		130	1	.00	. 0
I ITI: NEW VEHI I WL: WHEEL LOC		ECTION		130 130		.30 .30	
1911/91		respond					
. , . (1.	فحدا يستوس					
221 44.19	10/ 1	5 1 3 7	#15	(5)			
J. 15 45 63	. 1 2	\$ 812 .	ħ !	a	_		
		-	7 (2)	<u> </u>			





























































