

PE16-017

Appendix F

2017-03-09

GCQIS Report Entry/Maintenance

GCQIS Technical Service Detail

[Close](#)[Print](#)[Help](#)

ArticleType : ISM **ArticleNumber :** 13-12-024 **Entered** **Times**
Date : 12/17/2013 **Recommended :** 161

Date is displayed in **MM/DD/CCYY** format

2006-2009 FUSION/MILAN/MKZ - BRAKE FADE OR LOCK-UP DURING ABS EVENT :

Some 2006-2009 Fusion/Milan/MKZ vehicles may experience brake pedal fade or the brakes locking up during an ABS activation event. During this event the pedal may remain low, and if the ignition is cycled the concern is corrected until the next ABS event. This is typically a result of a recent service where the Hydraulic Control Unit (HCU) was replaced and the brake lines were not connected to the HCU in their correct locations. Inspect the HCU for proper line installation and once corrected, re-evaluate the concern.

Note: Section 206-09 Anti-Lock Brake System (ABS) and Stability Control of the Online Workshop Manual, under HCU Removal and Installation identifies proper brake line locations is the exploded view.

Author: DPOULOS (313) 317-9370

Technical Service Detail

Ford Proprietary, Private

Retention: None

Server: FCVWS962

Copyright ©2013 Ford Motor Company | All rights reserved.