

## Quality Monitoring Report



<b>QMR Id</b> QMR1- [REDACTED]	<b>Created By</b> jshi9542	<b>Report Date</b> 03/28/2018	<b>Last Updated</b> 03/28/2018	<b>Reg- Zn- Dst</b> [REDACTED]	<b>Dealer</b> 401703
<b>Section</b> Electrical	<b>Sub Section</b> SRS Airbag & Pretentioners				
<b>VIN</b> JF2SJAJC5JH [REDACTED]	<b>Engine #</b> [REDACTED]	<b>Trans #</b> [REDACTED]	<b>Mileage</b> 8605		
<b>Failure Code</b> [REDACTED]	<b>Failure Date</b> 03/28/2018	<b>Failed Part #</b> 64139SG160VH	<b>Technician Duplicated Condition?</b> Y		
<b>R/O Number</b> [REDACTED]	<b>Rollover</b> N	<b>Fire</b> N	<b>Accident</b> N	<b>Injury</b> N	<b>Death</b> N
<b>Property Damage</b> N					
<b>DTC Code(s)</b> B1650					
<b>Reporter Name</b> [REDACTED]	<b>Reporter Email</b> [REDACTED]	<b>Reporter Phone Number</b> --			

### Customer's Description of Complaint

C/S PASSENGER SIDE AIRBAG LIGHT COMES ON AT TIMES WHILE DRIVING.

### Technician's Findings and Repair

TECH FOUND CODE B1650 AND REFERENCED TSB 07-108-16R. RAN DIAG TREE USING TEST HARNESS. STEP 3 MEASURED .5 OHMS FOR BOTH. STEP 4 MEASURED MORE THAN 1MOHM. STEP 4 MEASURED BATTERY VOLTAGE. STEP 6 DTC B1650 WHEN HISTORICAL THEN CAME BACK THE NEXT DAY. REPLACED PASSNGER SEAT BOTTOM. PLEASE UPDATE TSB TO REFLECT THE PART NUMBERS OF SPECIAL TOOLS (TEST HARNESSES). I LOST ABOUT 30 MINUTES HUNTING DOWN PART NUMBERS. ONE WAS IN THE AIRBAG SYSTEM THE OTHER WAS IN THE ODC SYSTEM.

### Attachments

No Attachments Found

<b>VIN Remainder</b> JF2SJAJC5JH [REDACTED]	<b>Warranty Start Date</b> 08/16/2017	<b>Production Date</b> 05/18/2017	<b>Car Line</b> Forester
<b>Original Engine #</b> [REDACTED]	<b>Trans. Type Desc</b> Continuously Variable Transmission	<b>Model Year</b> 2018	<b>Model Code</b> JFI
<b>Color</b> ISM	<b>Options</b> 21	<b>Emission Spec</b> C	<b>Turbo</b> N

**Engine Size**

**Original Trans #**

2.5

