

Quality Monitoring Report



QMR Id QMR1 [REDACTED]	Created By sdcjpyl	Report Date 07/06/2018	Last Updated 07/06/2018	Reg- Zn-Dst Dealer [REDACTED] 020166
Section Electrical	Sub Section SRS Airbag & Pretentioners			
VIN JF2SJAGC1HH [REDACTED]	Engine # [REDACTED]	Trans # [REDACTED]	Mileage 20134	
Failure Code [REDACTED]	Failure Date 07/06/2018	Failed Part # 64139SG060LL	Technician Duplicated Condition? N	
R/O Number [REDACTED]	Rollover N	Fire N	Accident Injury Death N N N	Property Damage N
DTC Code(s) B1650, B1760				

Reporter Name [REDACTED]	Reporter Email [REDACTED]	Reporter Phone Number --
------------------------------------	-------------------------------------	--

Customer's Description of Complaint

Customer states Air Bag lamp comes on intermittently

Technician's Findings and Repair

Retailer has inspected vehicle on multiple occasions with reoccurring DTCs B1650 and B1760 in history. Tech has followed diagnostic steps in technical bulletin 07-108-16R and B1760 with no faults found. Moisture could not be detected in passenger seat bottom and no faults could be found with connectors. Customer states no spills or cleaning occurred to passenger seat and electronic devices are not placed on seat. Due to repeat B1760 in history with no faults found, retailer has ordered a replacement cushion for the passenger seat.

Attachments

[REDACTED]

VIN Remainder JF2SJAGC1H [REDACTED]	Warranty Start Date 03/01/2017	Production Date 01/12/2017	Car Line Forester
Original Engine # [REDACTED]	Trans. Type Desc Continuously Variable Transmission	Model Year 2017	Model Code HFF
Color	Options	Emission Spec	Turbo

VRP

14

C

N

Engine Size

Original Trans #

2.5

