

## Quality Monitoring Report



<b>QMR Id</b> QMR1- [REDACTED]	<b>Created By</b> sdcrpaz	<b>Report Date</b> 09/06/2018	<b>Last Updated</b> 09/06/2018	<b>Reg- Zn-Dst</b> [REDACTED]	<b>Dealer</b> 020225
<b>Section</b> Electrical	<b>Sub Section</b> SRS Airbag & Pretentioners				
<b>VIN</b> JF2SJAEC3HH [REDACTED]	<b>Engine #</b> 423997	<b>Trans #</b> 709192	<b>Mileage</b> 32292		
<b>Failure Code</b> [REDACTED]	<b>Failure Date</b> 09/06/2018	<b>Failed Part #</b> --	<b>Technician Duplicated Condition?</b> N		
<b>R/O Number</b> --	<b>Rollover</b> N	<b>Fire</b> N	<b>Accident</b> N	<b>Injury</b> N	<b>Death</b> N
<b>Property Damage</b> N					

**DTC Code(s)**  
B1613, B1618, B1650

<b>Reporter Name</b> [REDACTED]	<b>Reporter Email</b> [REDACTED]	<b>Reporter Phone Number</b> --
------------------------------------	-------------------------------------	------------------------------------

### Customer's Description of Complaint

Airbag light comes on and off intermittently.

### Technician's Findings and Repair

SM asked for FSE's advice on this vehicle. Vehicle was involved in a frontal impact. Compared parts replaced by body shop to list of components to be replaced in the event of Driver AB deployment on SNET. Only component that seems that was not replaced according to the documents is the LH front SUB sensor. Vehicle has DTC's for both front sub sensors and a Occupant detection DTC. Advised the likelihood of damage to the Bulkhead harness is probable, Sub sensors wiring is contained in this harness. Advised to inspect harness properly for damage.

### Attachments

[REDACTED]

<b>VIN Remainder</b> JF2SJAEC3HH [REDACTED]	<b>Warranty Start Date</b> 10/04/2016	<b>Production Date</b> 08/08/2016	<b>Car Line</b> Forester
<b>Original Engine #</b> [REDACTED]	<b>Trans. Type Desc</b> Continuously Variable Transmission	<b>Model Year</b> 2017	<b>Model Code</b> HFF
<b>Color</b>	<b>Options</b>	<b>Emission Spec</b>	<b>Turbo</b>

IS1

13

C

N

**Engine Size**

**Original Trans #**

2.5

