

WARRANTY REPAIR ORDER

COLLEGE STATION, TX			Work Phone	R/O Open Date	R/O Number
			Home Phone	6/30/17	
			Body	R/O Close Date	Cross Reference #
			4DR CVT 2.5I	6/30/17	Original
			License Number	Mileage In	Mileage Out
				19952	19952
Year	Make	Model	Service Advisor		
2016	SUBARU	FORESTER	Mike Stuessy 8309		
Vehicle Identification Number		Color	Delivery Date	In-Service Date	
JF2SJAF7GH		BURNISHED	4/01/16	4/01/16	

DESCRIPTION OF SERVICE AND PARTS	COST	AMOUNT
----------------------------------	------	--------

Cell: [REDACTED] Email: [REDACTED]		
<p>#1 - MR AIRBAG: AIRBAG WARNING LAMP OR OPERATION CONCERN</p> <p>CUSTOMER STATES SRS WARNING LAMP COMES ON IN DASH INTERMITTANTLY, LIGHT OFF NOW, ADVISOR SHOWN PICTURE OF WARNING LAMP</p> <p>Cause: PERFORMED DIAGNOSTIC CHECK, RETREIVED FAULT CODE B1650, PASSENGER ODS MALFUNCTION . DIAGNOSED PASS SEAT SENSING MAT FAILURE, NO INDICATION OF FLUID INTRUSION.</p> <p>Tech: 306/3210 0.70hrs 14.00 73.36</p> <p>Part: 64139SG002VH :CUSHION AY OCPANTRH 1 480.01 685.73</p> <p>Sub-Total Labor: 14.00 73.36</p> <p>Sub-Total Parts: 480.01 685.73</p> <p>Sub-Total: 494.01 759.09</p> <p>SAVED DATA ON SSM4, REMOVED PASSENGER SIDE FRONT SEAT, REPLACED SEAT CUSHION AND SENSING MAT ASSY, REASSEMBLED AND REINSTALLED SEAT. CLEARED FAULT CODE AND RETESTED, ALL OKAY.</p> <p>B913411 0.2HR</p> <p>C913472 0.5HR</p>		

#2 - MR 24SUB1: SUBLET RENTAL									
Line	1	6/30/17	Tech 306	Start	8:30	End	8:31	Hours	.02
Line	1	6/30/17	Tech 306	Start	8:31	End	8:31	Hours	.00
Line	1	6/30/17	Tech 306	Start	9:19	End	10:06	Hours	.78
Line	1	6/30/17	Tech 306	Start	13:45	End	13:50	Hours	.08
Line	2	6/30/17	Tech 306	Start	8:32	End	8:32	Hours	.00

ACCOUNT #	LABOR	14.00	73.36
	PARTS	480.01	685.73
METHOD	SUBLET		.00
	SHOP SUPPLIES		.00
	SALES TAX OR TAX I.D.		.00
RECEIPT #	DEDUCTIBLE		.00
	TOTAL DUE	494.01	759.09