

Repair Order Detail - Customer Copy

RO Number: [REDACTED]

RO Status: CLOSED

INFORMATION REDACTED PURSUANT TO THE FREEDOM
OF INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6)

Customer: STANDARD FORWARDING

Phone(s): Contact: [REDACTED]

Main: [REDACTED]

Cell:

Vehicle: [REDACTED]

2013 CXU613

Mileage: 422,166

Payment type: CHG

Waiter: No

Service advisor: 210

Promised time: 05:00 PM

Estimate: 0.00

Tag number: [REDACTED]

Promised date: 04/03/2015

~~~~~  
A CSA Check 22 Inspection

|             |    |                            |      |
|-------------|----|----------------------------|------|
| 00-099-0002 | CP | CSA Check 22<br>Inspection | 0.00 |
|-------------|----|----------------------------|------|

Tech(s): 27

|      |      |      |      |        |      |               |      |
|------|------|------|------|--------|------|---------------|------|
| Pts: | 0.00 | Lbr: | 0.00 | Other: | 0.00 | Total Line A: | 0.00 |
|------|------|------|------|--------|------|---------------|------|

  
~~~~~D TRACTOR DOES NOT WANT TO STOP AND SURGES AT STOP SIGNS CHECK AND  
ADVISE POSSIBLE CLUTCH PR PROGRAM ISSUE

| | | | |
|-------------|----|---|----------|
| 99-000-0001 | CP | TRACTOR DOES NOT WANT
TO STOP AND SURGES AT
STOP SIGNS CHECK AND
ADVISE POSSIBLE
CLUTCH PR PROGRAM
ISSUE | 1,008.00 |
|-------------|----|---|----------|

Tech(s): 27

| | | |
|-------------|-------------------------------|---------|
| 21459173 | 1 CLUTCH | 723.36 |
| 21844678 | 1 DISC | 744.27 |
| 20512915 | 1 BEARING | 35.33 |
| 990818 | 2 STUD | 3.62 |
| 990951 | 2 FLANGE LOCK NUT | 0.66 |
| 85133971 | 2 KIT | 30.36 |
| 967343 | 2 O-RING | 12.68 |
| 630T | 2 3" COARSE ROLOC DISC | 2.22 |
| | BROWN | |
| 4710*05089* | 1 CRC BRAKLEEN BRAKE
PARTS | 3.09 |
| 21095721 | 1 GASKET | 6.88 |
| 21021852 | 1 V-BAND CLAMP | 18.20 |
| 21021850 | 1 V-BAND CLAMP | 20.25 |
| 21095726 | 1 GASKET | 10.86 |
| 990939 | 4 FLANGE NUT | 1.36 |
| 20515114 | 1 ELBOW NIPPLE | 13.49 |
| 25155806 | 6 CLAMP | 3.18 |
| 990971 | 4 HEXAGON NUT | 2.88 |
| 1672273 | 4 FLANGE SCREW | 10.68 |
| 20978469 | 1 RING | 1.74 |
| 21545619 | 1 V-BAND CLAMP | 25.78 |
| 21007187 | 1 GASKET | 7.20 |
| 990939 | 1 FLANGE NUT | 0.34 |
| 21844678 | -1 CORE RETURN | -150.00 |

| | | | | | | | |
|------|----------|------|----------|--------|------|---------------|----------|
| Pts: | 1,528.43 | Lbr: | 1,008.00 | Other: | 0.00 | Total Line D: | 2,536.43 |
|------|----------|------|----------|--------|------|---------------|----------|

Story: 422166 27 4/7 hook up gd and follow steps for inactive
trans codes psid 27 fmi 8 and 14. all tests ok. road test to
verify. lurches forward when approaching a stop. write an
eserve and wait for reply. 27 4/8 next step to remove trans

Repair Order Detail - Customer Copy

RO Number: [REDACTED]

RO Status: CLOSED

Customer: STANDARD FORWARDING

Phone(s): Contact: [REDACTED]

Main: [REDACTED]

Cell:

Vehicle: [REDACTED]

2013 CXU613

Mileage: 422,166

Payment type: CHG

Waiter: No

Service advisor: 210

Promised time: 05:00 PM

Estimate: 0.00

Tag number: [REDACTED]

Promised date: 04/03/2015

~~~~~

and inspect clutch. eserve stated to follow gd, move unit into shop and remove trans inspect clutch. all appears ok. will update eserve. 27 4/13 get parts list together for clutch replacement. 27 4/14 CLEAN FLYWHEEL AND REPLACE PILOT BEARING. CLEAN OUT TRANSMISSION HOUSING AND INSTALL CLUTCH. INSTALL TRANS AND ORDER BOLTS FOR FLANGE ON TRANS. 27 4/17 install drive line start to install flex can not get gasket cleaned off even with grinder. remove intermediate pipe and clean off surfaces. 27 4/18 remove diffuser pipe to clean and reclock pipes to get to line up properly. assemble exhaust install splash shields. take on short road test. all seems ok. done.

~~~~~

E POWER OUTLET TO RIGHT SIDE OF RADIO INOP

99-000-0001 CP POWER OUTLET TO RIGHT
SIDE OF RADIO INOP

72.00

Tech(s): 34, 27

25109313

4 FASTENER

8.60

Pts: 8.60 Lbr: 72.00 Other: 0.00 Total Line E: 80.60

Story: 422166 34 4/6/15 CHECKED FOR POWER HAVE NO POWER, REMOVED FUSE AND RELAY COVER THERE IS NO LEGEND OF FUSES. LOOKED UP AND FOUND FUSE 68 IS FOR LIGHTER AND FUSE IS BLOWN REPLACED FUSE AND HAVE POWER IN THE LOWER POWER OUTLETS BUT NOT THE ONE BY RADIO. AM STILL LOOKING FOR A LEGEND 27 4/18 check outlet for powers and grounds has neither. remove trim panel and found connector for outlet disconcerted. reconnect and recheck. install trim. done.

~~~~~

Customer Pay

Labor 1,080.00

Parts 1,537.03

Lube 0.00

Sublet 0.00

Miscellaneous/Shop Charge 110.91

Deductible 0.00

Total Charges 2,727.94

Less Insurance/Adjustment 0.00

Sales Tax 190.92

Total 2,918.86