



Service Bulletin


TECHNICAL

Subject: Airbag Malfunction Warning and Airbag Malfunction Indicator Illuminated with DTC B0001-1B or B0012-0D

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2020	2021	SOP	December 10, 2020	All	All
Chevrolet	Silverado 1500						
Chevrolet	Silverado 2500HD/3500HD						
Chevrolet	Suburban						
Chevrolet	Tahoe Models						
GMC	Sierra 1500						
GMC	Sierra 2500HD/3500HD						
GMC	Yukon Models						

Involved Region or Country	United States, Canada, Mexico, Middle East, Israel, Australia/New Zealand
Condition	Some customers may comment on an airbag malfunction warning and airbag malfunction indicator illuminated. During diagnosis a technician may find DTC B0001-1B or B0012-0D set.
Cause	 The cause of the condition may be rust particles in the connection terminal interface causing excessive resistance.
Correction	In order to correct the condition, both halves of the interface (Driver Side Airbag Module and the Steering Wheel Wiring Harness) must be replaced to restore a proper connection.

Service Procedure

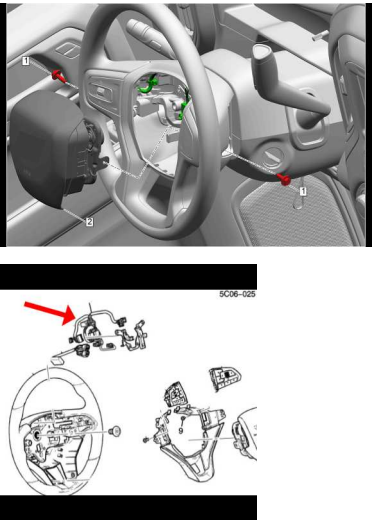

If you encounter a vehicle with the above concern, replace the steering wheel airbag and steering wheel harness. Refer to *Steering Wheel Airbag Replacement* in SI.

Parts Information

Use the VIN and refer to the GM Electronic Parts Catalog (EPC) to determine the proper part number to order.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
7486008*	Steering Wheel Airbag and Harness Replacement	0.8 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	Released March 18, 2021

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



Below the line - Internal only - Do not fax or email

Administrative Details: None

Revision Log:

Bulletin 21-NA-005 - Released on 03/18/21

Bulletin Source/Requestor - NAME/PHONE: Dave Mac Gillis , Brand Quality, 586-243-8772.

GM Liaison/Author: Matt Bunting, Bulletin Group, 248-534-3105

Publishing Staff Assistant: Bulletin Group

Publishing Notes: none

GM CONFIDENTIAL -- NOT TO BE REPRODUCED FOR DISTRIBUTION OUTSIDE OF GENERAL MOTORS CORPORATION

EOM
