

GPOP - Issue Review System

Part Number: 68347098A\$

Part Description: ABS Module

Issue When ordering 68347098AB as part of C0020-01 ABS Pump Diagnosis please ensure the HCU is at the latest level. If the etching on the side of the HCU starts with either KT or LN then the HCU (68143491AB, 68195569AB) is not the latest HCU and needs to be replaced first. the ABS Module is located just inboard of driver's fender closest to the plenum, etched surface is on inboard vertical wall at top edge above brake lines. After replacing the HCU then go through C0020-01 Diagnosis Procedure again and if still having issues then replace ABS Module (PN 68347098AB).