

 Technical Service Bulletin	GROUP RECALL	NUMBER 22-01-017G
	DATE FEBRUARY 2022	MODEL(S) GV80 (JX1) GV70 (JK1)
SUBJECT:	FRONT SEAT BELT PRETENSIONER REPLACEMENT (RECALL 009G)	

★ IMPORTANT

As required by federal law, dealer must not deliver new vehicle for sale or for lease to customers until all open recalls have been performed. Dealers should also perform all open recalls on used vehicles, demo, and rental vehicles prior to placing them into customer use and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the Service Department, access the "Vehicle Information" screen via WEBDCS to identify open Campaigns.

NOTICE

Important Note: When looking up the vehicle in the "Vehicle Information" screen, make sure to go to the 'Campaign Not Performed' section, and view the 'Campaign Description' field for the applicable op code for your vehicle. *The applicable op code will inform you if the left-hand (LH), right-hand (RH), or both sides (LH/RH) need to have the pretensioner replaced.* Please see example on page 2.

Description: The front seat pretensioner may deploy abnormally in the vehicles described below, causing the MMG (Micro Gas Generator) to detach from the assembly. This bulletin describes the procedure to replace the front seatbelt pretensioner to resolve the condition.



Applicable Vehicles:

- Certain 2021MY GV80 (JX1) vehicles produced from 3/9/2021 to 4/2/2021.
- Certain 2022MY GV70 (JK1) vehicles produced from 3/10/2021 to 6/17/2021.

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

SUBJECT: FRONT SEATBELT PRETENSIONER REPLACEMENT (RECALL 009G)**Parts Information:**

Model	Part Name	Part Number		Remarks
		LH	RH	
GV80 (JX1)	Front Seatbelt Pretensioner	888A0-T6500DUEQH	888B0-T6500DUEQH	Use op code in the WEBDCS 'Vehicle Information' screen to reference replacement of either LH, RH, or both sides. (See example below.)
			888B0-T6500VNBQH	
	Trim Fastener	85849-3X000QQH	85849-3X000QQH	4 Needed Per Side
GV70 (JK1)	Front Seatbelt Pretensioner	888A0-AR500LCRQH	888B0-AR500LCRQH	Use op code in the WEBDCS 'Vehicle Information' screen to reference replacement of either LH, RH, or both sides. (See example below.)
		888A0-AR500NNBQH	888B0-AR500NNBQH	
		888A0-AR500VNNQH	888B0-AR500VNNQH	
	Trim Fastener	82315-2W000QQH	82315-2W000QQH	2 Needed Per Side

NOTE 1: For both vehicles, you can also see the applicable op code to your specific VIN when accessing the "Vehicle Information" screen in WEBDCS, regarding to which side(s) to replace. Go to the 'Campaign Not Performed' section and look in the campaign description field. RH is for right hand ONLY, LH is for left hand ONLY, and RH/LH is for both sides. See example below.

NOTE 2: Please refer to the parts catalog for the applicable color for your vehicle. Parts for this recall have an additional 'QH' added to the part number found in the parts catalog.

Example:

Campaign Not Performed (1 Found)						-
Campaign Code	Recall	Campaign Description	Campaign Start Date	Vin Activation Date	Campaign Bulletins	
009G	Y	21D010R5 - GV70 - RH REPLACE ONLY	10/15/2021	10/15/2021	Q Inquiry	

Warranty Information:

Models	Op. Code	Operation	Op. Time	Causal Part	Nature Code	Cause Code
GV80 (JX1)	21D010R0	Front Seat Belt Pretensioner Replacement (LH ONLY)	0.4 M/H	888A0-T6500DUEQH	I11	ZZ3
	21D010R4	Front Seat Belt Pretensioner Replacement (RH ONLY)	0.4 M/H	888A0-T6500DUEQH		
	21D010R1	Front Seat Belt Pretensioner Replacement (LH & RH – BOTH)	0.6 M/H	888A0-T6500DUEQH		
GV70 (JK1)	21D010R2	Front Seat Belt Pretensioner Replacement (LH ONLY)	0.4 M/H	888A0-AR500LCRQH		
	21D010R5	Front Seat Belt Pretensioner Replacement (RH ONLY)	0.4 M/H	888A0-AR500LCRQH		
	21D010R3	Front Seat Belt Pretensioner Replacement (LH & RH – BOTH)	0.6 M/H	888A0-AR500LCRQH		

NOTE 1: Submit Claim on Campaign Claim Entry Screen.

NOTE 2: If a part that is not covered by this recall is in need of replacement while performing this recall, and the affected part is still under warranty, please submit a separate claim using the same repair order. If the affected part is out of warranty, submit a prior approval request for goodwill consideration prior to performing the work.

NOTE 3: The incident part(s) may be subject to callback through the Warranty Technical Center (WTC).




Refer to the QR code or link below for guided video information:
[Hyundai Service Learning - Recall 009G Service Procedure](#)

NOTICE

The procedure below is based on the LH seatbelt pretensioner. Due to symmetry, the RH seatbelt pretensioner procedure is the same.

Service Procedure:

1. Move the seat as far forward as possible by using the front/rear switch (A) and seat back switch (B).

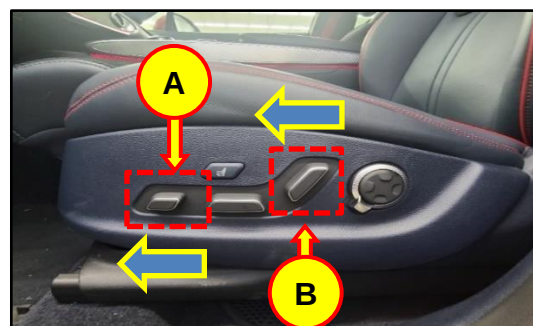

2. Record radio presets and disconnect the vehicle's negative (-) battery terminal.
3. Turn off the vehicle's ignition key before continuing.
4. Remove the front anchor seat belt (C).



NOTICE

Push the front anchor seat belt inward, towards the seat. Insert a flat tip screwdriver into the point of insertion (D) and pry it away from the seat to remove the front anchor seat belt.

NOTICE

Do not scratch the anchor cover while inserting the screwdriver into the point of insertion.

5. Partially remove the front door body side weather strip (E).

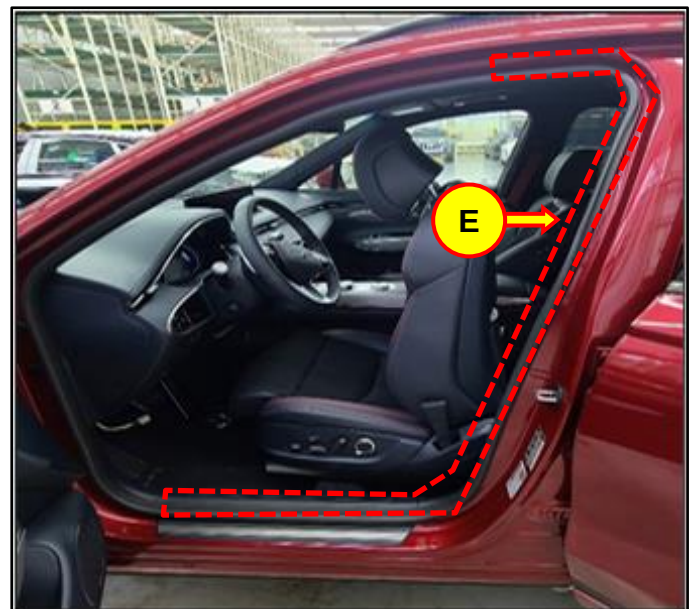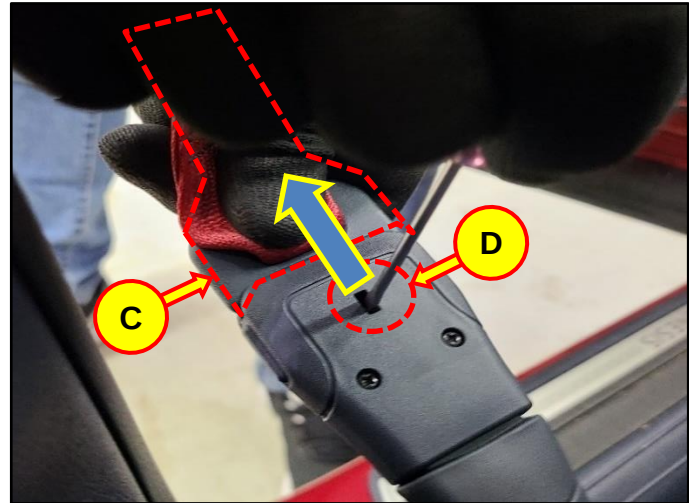

6. Remove the front door scuff trim (F) using a flat head screwdriver or plastic trim remover tool.

NOTICE

If using a screwdriver, be sure to wrap protective tape around the tip to prevent damage on the trim and panels.



7. Partially remove the rear door body side weather strip (G).



8. Remove the rear door scuff (H) using a flat head screwdriver or plastic trim remover tool.




9. Remove the center pillar lower trim (I). Be careful to not damage the plastic fasteners.

NOTICE



Replace existing fasteners with new ones.



10. Remove the center pillar upper trim (J).

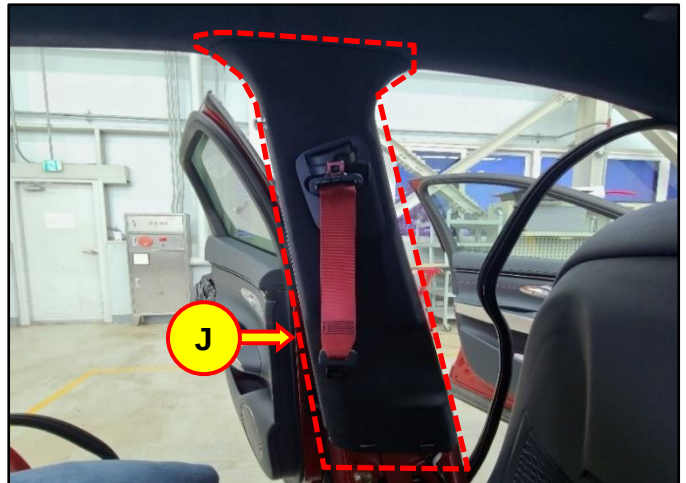

11. Press in the tabs for the locking pin (K) to disconnect the front seatbelt pretensioner connector and free active seatbelt connector (L).

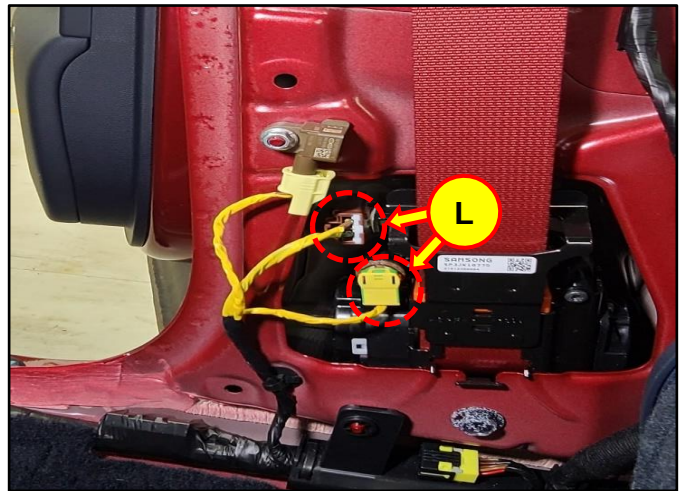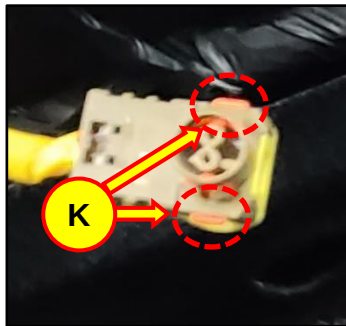

12. Loosen the front seat upper anchor mounting bolt (M) and remove the front seat belt upper anchor.

NOTICE

Tightening Torque:

28.9 – 39.8 lb-ft (39.2 – 53.9 Nm)




13. Loosen mounting bolts (N) and (O) and remove the front seat belt pretensioner.

NOTICE

Tightening Torque:

M: 5.8 – 8.7 lb-ft (7.7 – 11.8 Nm)

N: 28.9 – 39.8 lb-ft (39.2 – 53.9 Nm)

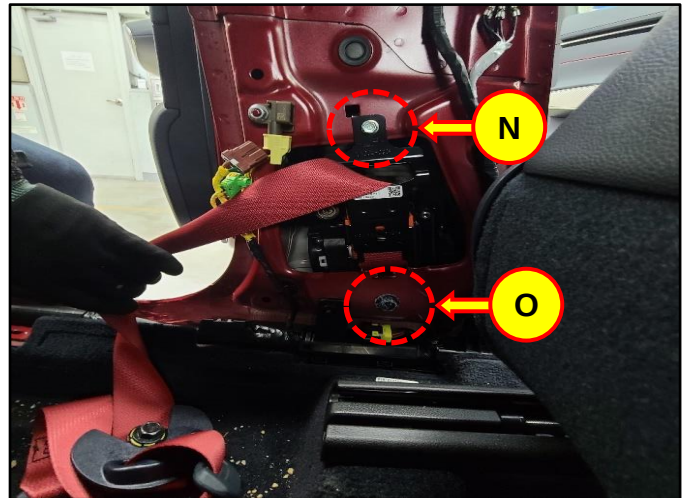

14. Install the newly supplied front seatbelt pretensioner.
15. Reinstall parts in reverse order of removal. Make sure to replace existing fasteners with new ones.

NOTICE

Move the height adjuster lever (P) to the highest point before reinstalling the upper center pillar trim.



16. After connecting the negative (-) battery terminal, be sure to reprogram radio presets.
17. The service procedure is complete.