



BOB FISHER CHEVROLET
 4111 POTTSVILLE PIKE
 READING, PA 19605
 PHONE: 610-921-0261 FAX: 610-921-2202
 WWW.BOBFISHERCHEV.COM

[REDACTED]		VEHICLE ID	MILES IN	MILES OUT	DATE/TIME IN	DATE OUT	INVOICE NO.
[REDACTED]		[REDACTED]	40938	40955	07/26/21 07:32	07/30/21	[REDACTED]
VEHICLE DESCRIPTION					TAG NO.	STATUS	
2018 CHEVROLET VOLT PREMI						PARTIAL-COMPLETE-P	
CONTROL NO.	LICENSE PLATE NO.	CUST. LABOR RATE	PROD. DATE	IN-SERV DATE	DELIV. DATE	DELIV. MILES	TERMS
[REDACTED]		VARY					No Charge
HOME PHONE	WORK PHONE	CELL PHONE	STOCK NO.	SERV. ADV.		RO COMMENT	
[REDACTED]				WALTER SHEEHAN (58)			

You may receive a customer satisfaction survey from Chevrolet in the next few weeks. If for any reason you cannot grade us "Completely Satisfied" with your service experience, please contact our consultant (See advisor box above) or your service manager immediately. Your "Complete Satisfaction" is our number 1 concern. Thank you!

All Bodyshop repairs done by Bob Fisher Chevrolet are covered by a National Limited Lifetime repair warranty for workmanship, including refinishing, for all completed repairs as long as the customer owns the vehicle.

Parts Designated with a "*" indicates lifetime guarantee. Applies for customer pay repairs.

Line	Op-Code	Fail Code	Tech	Hours	Type	Amount
A	5030310		A27	2.40	Warranty	
Concern	Customer states car will not start					
Cause	VERIFIED CUSTOMERS CONCERN - VEHICLE DOES NOT START SCANNED FOR CODES P0AFA - HYBRID SYSTEM LOW VOLTAGE BATTERY PACK TERMINAL 1 VOLTAGE IS 366VOLTS BATTERY CELLS 1-96 ARE READING 3.80-3.81 VOLTS ON ALL CELLS DISABLED THE HIGH VOLTAGE SYSTEM AND REMOVED THE MANUAL SERVICE DISCONNECT TESTED FOR LESS THAN 10 OHMS BETWEEN THE DISCONNECT FUSE TERMINALS - MEASURED O.L					
Correction	REPLACED MANUAL SERVICE DISCONNECT PERFORMED ALL HYBRID CONTROL RESET FUNCTIONS FOR A LATCHED DTC					

Part Number	Description	Qty.
24287708	LEVER	1

Customer Totals

Charge Description	Amount
Total Amount Due	\$0.00

PAID
 JUL 31 2021