

# Repair Order Detail - Customer Copy

RO No [REDACTED]

RO Status: OPENED

Customer [REDACTED]  
 Phone(s): [REDACTED]  
 Vehicle [REDACTED]

2017 VOLT

Mileage: 70,841  
 Service advisor: 299  
 Tag number: T2645

Payment type: CASH  
 Promised time: 05:30 PM  
 Promised date: 11/01/2022

Waiter: No  
 Estimate: 0.00

A CUSTOMER STATES NO START NO RUN.. N/C  
 RPR WPP CUSTOMER STATES NO START NO RUN..

Tech(s): 257  
 24296900 1 (S)MODULE N/C  
 12378390 1 COOLANT N/C

Pts: 0.00 Lbr: 0.00 Other: 0.00 Total Line A: 0.00

Story: 70849 Found codes U2603 00, U2604, U2604, U2605, U2606, U2617 and U32618 00 stored in HPCM2. Removed high voltage battery and replaced battery energy control module per bulletin #18-NA-261. Program BECM. (V [REDACTED] C) 5031010 Time: 4.9+ 1.0 diag.+ .4 smoke test= 6.3



B CERTIFIED SERVICE MULTI-POINT INSPECTION N/C  
 MPVI CQS CERTIFIED SERVICE MULTI-POINT INSPECTION

Tech(s):  
 Pts: 0.00 Lbr: 0.00 Other: 0.00 Total Line B: 0.00

C\*\* RENTAL N/C  
 Z7906 WPP RENTAL

Tech(s):  
 Pts: 0.00 Lbr: 0.00 Other: 0.00 Total Line C: 0.00

D\*\* CUSTOMER STATES SHIFT TO PARK LIGHT IS ON N/C  
 RPR WPP GENERAL REPAIR

Tech(s): 257  
 84733196 1 HARNESS N/C  
 84955382 1 (S)SWITCH N/C

Pts: 0.00 Lbr: 0.00 Other: 0.00 Total Line D: 0.00

Story: 70849 Shift to park message on when vehicle is in park Per bulletin 19-NA-206, replaced shifter microswitch and installed jumper assy. LOC: 5480908 Time: 1.0

E\*\* CUSTOMER STATES REPLACE RIGHT REAR TIRE PRESSURE MONITOR 100.00  
 RPR CDEF GENERAL REPAIR

Tech(s): 257  
 13540602 1 (S)SENSOR 41.94

Pts: 41.94 Lbr: 100.00 Other: 0.00 Total Line E: 141.94

Story: 70849 Found right rear TPM not transmitting. Replaced Right Rear tire pressure monitor and relearned sensors.

Customer Pay

# Repair Order Detail - Customer Copy

Labor	100.00
Parts	41.94
Lube	0.00
Sublet	0.00
Miscellaneous/Shop Charge	9.94
Deductible	0.00
Total Charges	151.88
Less Insurance/Adjustment	0.00
Sales Tax	10.64
Total	162.52