

A CUSTOMER STATES NO START NO RUN
RPR WPP CUSTOMER STATES NO START NO RUN


N/C
N/C
0.00

Tech(s): 257
24296900
12378390

1 (S)MODULE
1 COOLANT
0.00 Other:

0.00 Total Line A:

Story: 70849 Found codes U2603 00, U2604, U2604, U2605, U2606, U2617 and U2618 00 stored in HPCM2. Removed high voltage battery and replaced battery energy control module #18-NA-261. Program BECM. (S031010 Time: 4.9+ 1.0 diag + 4 smoke test= 6.3

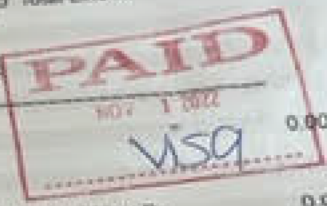

B CERTIFIED SERVICE MULTI-POINT INSPECTION
MPVI QQS CERTIFIED SERVICE MULTI-POINT INSPECTION

0.00

Tech(s): 0.00 Lbr: 0.00 Other: 0.00 Total Line B:

C** RENTAL WPP RENTAL
27906

N/C

Tech(s): 0.00 Lbr: 0.00 Other: 0.00 Total Line C:

0.00

D** CUSTOMER STATES SHIFT TO PARK LIGHT IS ON
RPR WPP GENERAL REPAIR

N/C

Tech(s): 257
84733196 1 HARNESS
84955382 1 (S)SWITCH
0.00 Other:

0.00 Total Line D:

N/C
N/C
0.00

Story: 70849 Shift to park message on when vehicle is in park. Per bulletin 19-NA-206, replaced shifter microswitch and installed jumper assy. LOC: 5480908 Time: 1.0

E CUSTOMER STATES REPLACE RIGHT REAR TIRE PRESSURE MONITOR
RPR CDEF GENERAL REPAIR

100.00

Tech(s): 257
13540602 1 (S)SENSOR
41.94 Lbr: 100.00 Other:

0.00 Total Line E:

41.94
141.94

Story: 70849 Found right rear TPM not transmitting. Replaced right Rear tire pressure monitor and relearned sensors.

Customer Pay

Repair Order Detail - Customer Copy

Labor	100.00
Parts	41.94
Lube	0.00
Sublet	0.00
Miscellaneous/Shop Charge	9.94
Deductible	0.00
Total Charges	151.88
Less Insurance/Adjustment	0.00
Sales Tax	10.64
Total	162.52