



CUSTOMER #: [REDACTED]



3400 AUTO PLAZA PARKWAY  
TRACY, CA 95304  
PHONE: 209-835-4500  
FAX: BUS. OFFICE 209-835-6248  
PARTS DEPT.(209) 229-7111  
EMAIL: www.tracychevrolet.com

INVOICE

PAGE 2

BRENTWOOD, CA [REDACTED]

HOME [REDACTED] CONT [REDACTED]

BUS: [REDACTED] CELL: [REDACTED] SERVICE ADVISOR: 76 TODD N TANNAHILL

BAR # ARD 254179  
EPA # CAL 000330423

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
BLACK	17	CHEVROLET VOLT	[REDACTED]	[REDACTED]	83908/83912	T6843
DEL DATE	PROD. DATE	WARR. EXP.	PROMISE	PONO.	PAYMENT	INV. DATE
01JAN17 DD		01JAN2020	18:00	15JUL21	0.00 CASH	13AUG21

R.O. OPENED [REDACTED] BOOKED [REDACTED] OPTIONS: DLR:06222

07:11 23JUN21 12:43 13AUG21

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	12684047	(S)	PIPE				(N/C)
1	12378390		COOLANT				(N/C)
12	88862156B		DEX6 ATF				(N/C)
1	12682143	(S)	GASKET				(N/C)
1	12649163	(S)	GASKET				(N/C)
1	12635752	(S)	GASKET				(N/C)
1	12642620	(S)	GASKET				(N/C)
1	FRGHT		FREIGHT/SHIPPING FEES				(N/C)
1	11588468	(S)	BOLT				(N/C)
2			CLAMP HOSE CLAMP \				(N/C)

CUSTOMER PAY DEDUCTIBLE FOR LINE B

5116.97

83912 verified that the check engine light is on checked for codes found current p0301 verified a missfire on cylinder 1. removed spark plug. noticed unburned fuel on spark plug. performed compression test cylinder 1 is excessively low measured 75 psi. found document 4630888 for possible excessive carbon on valves causing this. received approval to perform cleaning procedure. performed procedure. after performing carbon removal procedure found engine still runs rough. found the compression did not improve, it became worse measured 60 psi compression. performed inspection with a boroscope found piston on cylinder wall scoring. this is caused from piston starting to separate. recommend replacement of engine. at this point vehicle was changed from customer pay to warranty. continued with engine replacement. disabled high voltage systems. while replacing engine one of the torque converter /drive plate bolts rounded off. used dw time punch to drill out bolt and repair the threads in the drive plate/torque converter assembly. the c/v axle washer on right axle broke, replaced washer. noticed one of the heater hoses rubbing though replaced it with bulk hose to prevent customer from having the vehicle lose coolant and over heat, used dw time punch for this. old engine serial number [REDACTED] new serial number [REDACTED] used dw time punch to swap parts from old engine to new engine. installed in vehicle. assembled vehicle. charged a/c system using r134a. filled all 3 cooling systems. filled trans with fluid. enabled high voltage system. started



ORIGINAL ESTIMATE: \$			FINAL REVISED ESTIMATE: \$			DESCRIPTION	TOTALS
DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	LABOR AMOUNT	
						PARTS AMOUNT	
						GAS, OIL, LUBE	
						SUBLET AMOUNT	
						MISC. CHARGES	
						TOTAL CHARGES	
						ADJUSTMENTS	
						SALES TAX	
						PLEASE PAY THIS AMOUNT	

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE. I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.

WARNING: Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and parts and materials used to maintain vehicles, including but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and performance from 70 maintenance your repairs while servicing, handling or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and disposal in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq. For further information about Proposition 65, see www.p65.ca.gov or call 1-800-438-8861.

CUSTOMER COPY

CUSTOMER #: [REDACTED]



3400 AUTO PLAZA PARKWAY  
TRACY, CA 95304  
PHONE: 209-835-4500  
FAX: BUS. OFFICE 209-835-6246  
PARTS DEPT. (209) 229-7111  
EMAIL: www.tracychevrolet.com

INVOICE

PAGE 3

BRENTWOOD, CA [REDACTED]

HOME [REDACTED] CONT [REDACTED]  
BUS: [REDACTED] CELL: [REDACTED]

BAR # ARD 254179  
EPA # CAL 000330423

SERVICE ADVISOR: 76 TODD N TANNAHILL

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG
BLACK	17	CHEVROLET VOLT	[REDACTED]	[REDACTED]	83908/83912	T6843
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	FORM	PAYMENT	INV. DATE
01JAN17 DD		01JAN2020	18:00 15JUL21		0.00 CASH	13AUG21

R.O. OPENED BOOKED OPTIONS: DLR:06222

07:11 23JUN21 12:43 13AUG21

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

engine with vehicle in service mode and let it run for an extended period of time. no leaks found engine ran as designed. checked for codes none set at this time. test drove vehicle it drove ok other than the a/c not producing cold air. used dw time punch to perform iat update. a/c is now working as designed. assembled old engine as a core and placed it in the crate. plugged in vehicle to charge high voltage battery.

\*\*\*\*\*

EST: 259.99 23JUN21 07:11 SA: 76

CONTACT:

\*\*\*\*\*

Thank you for choosing TRACY CHEVROLET for your parts and service needs. If you are visiting for warranty concerns, the Factory may send you a survey. If for any reason you cannot answer completely satisfied, please call The Service Manager Sam Balanon @ 209-835-4500 x7119

<p>ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE</p>	ORIGINAL ESTIMATE: \$ _____			FINAL REVISED ESTIMATE: \$ _____			DESCRIPTION	TOTALS	
	DATE			TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	
	LABOR AMOUNT								0.00
	PARTS AMOUNT								0.00
	GAS, OIL, LUBE								0.00
	SUBLET AMOUNT								0.00
	MISC. CHARGES								5116.97
TOTAL CHARGES								5116.97	
ADJUSTMENTS								0.00	
SALES TAX								0.00	
PLEASE PAY THIS AMOUNT								5116.97	

WARNING: Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, antifreeze, brake fluid, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to these chemicals contained in used oil, waste and replacement fluids, filters, grease, brake fluid, shock absorbers, and other replacement parts, and particulates from combustion wear. When we service your car, we will follow strict procedures to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components.