

WARRANTY REPAIR ORDER

ELLETTSVILLE, [REDACTED]			Work Phone	R/O Open Date	R/O Number
			Home Phone	10/20/22	
[REDACTED]			Body	R/O Close Date	Cross Reference #
			5DR HB PREMIE		
[REDACTED]			License Number	Mileage In	Mileage Out
				62547	62547
Year	Make	Model	Service Advisor		
2017	CHEVROLET	VOLT	JOSH		
[REDACTED]			Delivery Date	In-Service Date	
[REDACTED]					

DESCRIPTION OF SERVICE AND PARTS	COST	AMOUNT
#1 - Customer Reports: Customer states it has P1E00 error Service High Voltage system: Propulsion Reduced Cause: found u2603 - u2606, and u2617 - u2624 stored in hpcm2 found bulletin #18-NA-261 found battery energy control module faulty Op: 5031010: (5031010) Tech: 15/ 6.30hrs @ 111.02 Part: 24296900:SL-N-MODULE (02210-C) 2429 1 Part: 24296900-C:SL-N-MODULE (02210-C) - C24 1 Part: 24296900-C:SL-N-MODULE (02210-C) - Cor -1 Part: 12378390:N-COOLANT (08800-BOPCKT) 1 Cost Difference: 1 replaced and programmed battery energy control module [REDACTED] Performed Rechargeable Energy Storage System Smoke Test, ok cleared high voltage codes cleared standard codes retested, ok at this time Sub-Total Labor: 195.30 699.43 Sub-Total Parts: 318.17 531.35 Sub-Total: 513.47 1230.78		

Line 1	10/20/22	Tech 15	Start 10:08	End 11:30	Hours	1.40
Line 1	12/19/22	Tech 15	Start 10:38	End 15:57	Hours	5.30

ACCOUNT #	LABOR	195.30	699.43
	PARTS	318.17	531.35
METHOD	SUBLET		.00
	SHOP SUPPLIES		.00
	SALES TAX OR TAX I.D.		.00
RECEIPT #	DEDUCTIBLE	513.47	1230.78

SIGNATURE [REDACTED]