

WARRANTY REPAIR ORDER			Work Phone	R/O Open Date	R/O Number
[REDACTED]			[REDACTED]	10/20/22	[REDACTED]
ELLETTSVILLE, [REDACTED]			Home Phone	R/O Close Date	Close Reason
[REDACTED]			[REDACTED]	[REDACTED]	[REDACTED]
[REDACTED]			Body	Mileage In	Mileage Out
[REDACTED]			5DR HB PREMIE	62547	62547
[REDACTED]			License Number	Service Advisor	
[REDACTED]			[REDACTED]	JOSH	
Year	Make	Model	Delivery Date		
2017	CHEVROLET	VOLT	[REDACTED]		
[REDACTED]			Color	In-Service Date	
[REDACTED]			[REDACTED]	[REDACTED]	

DESCRIPTION OF SERVICE AND PARTS	COST	AMOUNT
#1 - Customer Reports: Customer states it has P1E00 error Service High Voltage system: Propulsion Reduced Cause: found u2603 - u2606, and u2617 - u2624 stored in hpcm2 found bulletin #18-NA-261 found battery energy control module faulty Op: 5031010: (5031010) Tech: 15/ 6.30hrs @ 111.02 Part: 24296900:SL-N-MODULE (02210-C) 2429 1 Part: 24296900-C:SL-N-MODULE (02210-C) - C24 1 Part: 24296900-C:SL-N-MODULE (02210-C) - Cor -1 Part: 12378390:N-COOLANT (08800-BOPCKT) 1 Cost Difference: 1 replaced and programmed battery energy control module CD [REDACTED] Performed Rechargeable Energy Storage System Smoke Test, ok cleared high voltage codes cleared standard codes retested, ok at this time Sub-Total Labor: 195.30 699.43 Sub-Total Parts: 318.17 531.35 Sub-Total: 513.47 1230.78		
	195.30	699.43
	309.68	517.17
	50.00	50.00
	-50.00	-50.00
	8.49	14.18

Line	1	10/20/22	Tech 15	Start 10:08	End 11:30	Hours	1.40
Line	1	12/19/22	Tech 15	Start 10:38	End 15:57	Hours	5.30

ACCOUNT #	LABOR	195.30	699.43
	PARTS	318.17	531.35
METHOD	SUBLET		.00
	SHOP SUPPLIES		.00
	SALES TAX OR TAX I.D.		.00
RECEIPT #	DEDUCTIBLE	513.47	1230.78

SIGNATURE [REDACTED]