



ALLEN GWYNN CHEVROLET  
 1400 SOUTH BRAND BLVD.  
 GLENDALE, CA 91204  
 (818)240-0000 FAX (818)240-1625  
 WWW.LOVEMYCHEVY.COM

[REDACTED]		VEHICLE ID		MILES IN	MILES OUT	DATE/TIME IN	DATE OUT	INVOICE NO.
LOS ANGELES, CA		[REDACTED]		67809	67810	02/21/23 11:15	03/09/23	[REDACTED]
VEHICLE DESCRIPTION						TAG NO.	STATUS	
2018 CHEVROLET VOLT LT						06236	PARTIAL-COMPLETE-P	
CONTROL NO.	LICENSE PLATE NO.	CUST. LABOR RATE	PROD. DATE	IN-SERV DATE	DELIV. DATE	DELIV. MILES	TERMS	
[REDACTED]	[REDACTED]						Cash	
	WORK	OTHER	STOCK NO.	SERV. ADV.		RO COMMENT		
				RICK GUDINO (316)				

Line	Op-Code	Fail Code	Tech	Hours	Type	Amount
A	MPVI		A60		Internal	
Concern MPVI PERFORM GM MULTI POINT INSPECTION						
Correction Performed mpvi						

B	5031010		A60		Warranty	
Concern Customer states check engine warning indicator in dash cluster is on solid-check and advise						
Cause Verified customer concern. Scanned the vehicle for DTC's and retrieved DTC's U2603, U2604, U2605, U2606, U2617, U2619, U2620, U2621, U2622, U2623, U2624. Found bulletin #18-NA-261. Document ID: 5107213. Will need to replace and reprogram the battery energy control module and program it to the vehicle and verify repairs. becm covered through pzev extended warranty						
Correction Verified customer concern. Scanned the vehicle for DTC's and retrieved DTC's U2603, U2604, U2605, U2606, U2617, U2619, U2620, U2621, U2622, U2623, U2624. Found bulletin #18-NA-261. Document ID: 5107213. Will need to replace and reprogram the battery energy control module and program it to the vehicle and verify repairs.						
Replaced and reprogram the Battery Energy Control Module per SI. Disabled the vehicle High Voltage System. Drained the Drive Motor Battery cooling system. Removed the Drive Motor Battery Pack. Removed the Drive Motor Battery Cover. Referred to Document ID: 4163312 and replaced the Battery Energy Control Module. Installed the Drive Motor Battery Cover. Performed a smoke test on the rechargeable energy storage system. Installed the Drive Motor Battery Pack. Filled and bled Drive Motor Battery Cooling system. Enabled the vehicle High Voltage System. Programmed the Battery Energy Control Module.						
Battery Energy Control Module programming WCC [REDACTED]						

C	5480908		A60		Warranty	
Concern Customer states shift to park warning indicator in dash cluster appears after shifting transmission shifter lever into park-check and advise						

LOS ANGELES, CA	VEHICLE ID	MILES IN	MILES OUT	DATE/TIME IN	DATE OUT	INVOICE NO.
	[REDACTED]	67809	67810	02/21/23 11:15	03/09/23	[REDACTED]
VEHICLE DESCRIPTION				TAG NO.	STATUS	
2018 CHEVROLET VOLT LT				06236	PARTIAL-COMPLETE-P	

CONTROL NO.	LICENSE PLATE NO.	CUST. LABOR RATE	PROD. DATE	IN-SERV DATE	DELIV. DATE	DELIV. MILES	TERMS
[REDACTED]	[REDACTED]						Cash
	WORK	OTHER	STOCK NO.	SERV. ADV.		RO COMMENT	
				RICK GUDINO (316)			

Op-Code	Fail Code	Tech	Hours	Type	Amount
<b>C</b>	Continued				
Cause	Verified customer concern. Found bulletin #19-NA-206. Document ID: 5403533. According to bulletin #19-NA-206 the cause of the condition may be that the park switch in the transmission control (shifter) assembly is not pulling the BCM signal low to electronically show that the vehicle is in the Park position. To correct the issue R & R the transmission control, install a new shifter harness, then upon reinstalling the transmission control, install an In-line Shifter Wire Harness Jumper between the shifter base connector and the console harness connector Replaced the shifter harness and an In-line Shifter Wire Harness Jumper between the shifter base connector and the console harness connector verified repairs and all OK. repair covered through voltec extended warranty				
Correction	Replaced the shifter harness and an In-line Shifter Wire Harness Jumper between the shifter base connector and the console harness connector verified repairs and all Ok				

<b>D</b>	3013	A60		Customer	\$0.00
Concern	Customer states transmission will not engage into forward or reverse gears-check and advise				
Correction	Will replace the BECM and verify it fixes the issue, vehicle will also need a 12V battery to be replaced due to it being bad. Replaced the BECM and the 12V battery and the issue was resolved the vehicle drives as intended.				
<b>Line Total...</b>					<b>\$0.00</b>

<b>E</b>	9105392	A60		Warranty	
Concern	RECALLS-N202307990 increased customer notification				
Correction	Performed Campaign: N202307990: ZCSP - Customer Satisfaction Program - Increased Customer Notification. Updated software on the Hybrid Powertrain Control Module 2. WCC [REDACTED]				

<b>F +</b>	3016	A60		Customer	\$0.00																				
Concern	SUBLET-lyft																								
<table border="1"> <thead> <tr> <th>Misc. Code</th> <th>Description</th> <th>Qty.</th> <th>Unit Price</th> <th>Ext. Price</th> </tr> </thead> <tbody> <tr> <td>LYFT</td> <td>Lyft expense to customer</td> <td>1.0</td> <td>\$12.71</td> <td>\$12.71</td> </tr> <tr> <td colspan="4" style="text-align: right;"><b>Misc Total...</b></td> <td><b>\$12.71</b></td> </tr> <tr> <td colspan="4" style="text-align: right;"><b>Line Total...</b></td> <td><b>\$12.71</b></td> </tr> </tbody> </table>						Misc. Code	Description	Qty.	Unit Price	Ext. Price	LYFT	Lyft expense to customer	1.0	\$12.71	\$12.71	<b>Misc Total...</b>				<b>\$12.71</b>	<b>Line Total...</b>				<b>\$12.71</b>
Misc. Code	Description	Qty.	Unit Price	Ext. Price																					
LYFT	Lyft expense to customer	1.0	\$12.71	\$12.71																					
<b>Misc Total...</b>				<b>\$12.71</b>																					
<b>Line Total...</b>				<b>\$12.71</b>																					

[REDACTED]		VEHICLE ID	MILES IN	MILES OUT	DATE/TIME IN	DATE OUT	INVOICE NO.
LOS ANGELES, CA		[REDACTED]	67809	67810	02/21/23 11:15	03/09/23	[REDACTED]
VEHICLE DESCRIPTION					TAG NO.	STA	
2018 CHEVROLET VOLT LT					06236	PARTIAL-COMPLETE-P	
CONTROL NO.	LICENSE PLATE NO.	CUST. LABOR RATE	PROD. DATE	IN-SERV DATE	DELIV. DATE	DELIV. MILES	TERMS
[REDACTED]	[REDACTED]						Cash
	WORK	OTHER	STOCK NO.	SERV. ADV.		RO COMMENT	
				RICK GUDINO (316)			

Line	Op-Code	Fail Code	Tech	Hours	Type	Amount
G ^	3004		A60		Customer	\$164.00
Concern 12V battery Cause 12V battery Correction R&R 12V battery Replaced the 12V battery and erased DTC's.						

Part Number	Description	Qty.	Unit Price	Ext. Price
88866188	BATTERY EVLN2	1	\$266.82	\$266.82
	CLEAN CORE	1	\$12.25	\$12.25
	DIRTY CORE	-1	\$12.25	-\$12.25
<b>Parts Total...</b>				<b>\$266.82</b>
<b>Line Total...</b>				<b>\$430.82</b>

Special Order Parts					
SOR #	Part #	Description	Unit Price	Qty	Price
[REDACTED]	24296900	MODULE ASM-BAT ENGY CONT		1	

Authorized Estimates					
Date/Time	Amount	Authorized By	Authorization Method	Phone/Email	Adv. Username
02/22/2023 09:30	\$450.00	[REDACTED]	Phone	[REDACTED]	rickg
02/21/2023 11:15	\$205.00	[REDACTED]	Initial Estimate	[REDACTED]	rickg

**Customer Totals**

Charge Description	Amount
Parts	\$266.82
SalesTax	\$27.35
Labor	\$164.00
Misc.Chg	\$12.71
<b>Total Amount Due</b>	<b>\$470.88</b>

Credit Card/VMD	
CTR [REDACTED]	\$470.88
	---

Indebtedness is hereby acknowledge for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.

B.A.R. LICENSE # ARD00004535  
E.P.A. # CAD028246569

X

INVOICE

CUSTOMER COPY