



ALLEN GWYNN CHEVROLET
 1400 SOUTH BRAND BLVD.
 GLENDALE, CA 91204
 (818)240-0000 FAX (818)240-1625
 WWW.LOVELYMYCHEVY.COM

[REDACTED]		VEHICLE ID		MILES IN	MILES OUT	DATE/TIME IN	DATE OUT	INVOICE NO.
GLENDALE, CA		[REDACTED]		68108	68109	04/24/23 13:12	05/03/23	[REDACTED]
VEHICLE DESCRIPTION						TAG NO.	STATUS	
2017 CHEVROLET VOLT LT						06545	PARTIAL-COMPLETE-P	
CONTROL NO.	LICENSE PLATE NO.	CUST. LABOR RATE	PROD. DATE	IN-SERV DATE	DELIV. DATE	DELIV. MILES	TERMS	
[REDACTED]	[REDACTED]	[REDACTED]	[REDACTED]	06/29/16	06/29/16	8	No Charge	
HOME	PHONE 2	CELL	STOCK NO.	SERV. ADV.			RO COMMENT	
[REDACTED]	[REDACTED]	[REDACTED]	[REDACTED]	RICK GUDINO (316)			1.5L I4 F DOHC 16V	
Code	Code	Code	Code	Hours	Type	Amount		
A	MPVI		A60		Internal			
Concern	MPVI PERFORM GM MULTI POINT INSPECTION							
Correction	Performed mpvi							
B	TP		A60		Internal			
Concern	Complimentary Tire Pressure Check							
Cause	California State Required							
Correction	Completed							
C	3013		A60		Warranty			
Concern	Customer states check engine warning indicator in dash cluster is on solid-check and advise							
Correction	Verified customer concern. Scanned the vehicle for DTC's retrieving U2619, U2620, U2621, U2622, U2623, U2624. Found bulletin #18-NA-261: No Start, Malfunction Indicator Lamp (MIL) Illuminated - DTC U2603, U2604, U2605, U2606, U2617, U2618, U2619, U2620, U2621, U2622, U2623 and/or U2624 Set. Document ID: 5107213. Will need to remove the drive motor battery following Document ID: 4166092 & replace the Battery Energy Control Module. Replaced and reprogram the Battery Energy Control Module per SI. Disabled the vehicle High Voltage System. Drained the Drive Motor Battery cooling system. Removed the Drive Motor Battery Pack. Removed the Drive Motor Battery Cover. Referred to Document ID: 4163312 and replaced the Battery Energy Control Module. Installed the Drive Motor Battery Cover. Performed a smoke test on the rechargeable energy storage system. Installed the Drive Motor Battery Pack. Filled and bled Drive Motor Battery Cooling system. Enabled the vehicle High Voltage System. Programmed the Battery Energy Control Module. Battery Energy Control Module programming WCC: [REDACTED] repair covered through pzev extended warranty							
D	3013		A60		Warranty			
Concern	Customer states shift to park warning indicator in dash cluster appears after shifting transmission shifter into park-check and advise							

VEHICLE ID		MILES IN	MILES OUT	DATE/TIME IN	DATE OUT	INVOICE NO.
[REDACTED]		68108	68109	04/24/23 13:12	05/03/23	[REDACTED]
VEHICLE DESCRIPTION					TAG NO.	STATUS
2017 CHEVROLET VOLT LT					06545	PARTIAL-COMPLETE-P
CONTROL NO.	LICENSE PLATE NO.	CUST. LABOR RATE	PROD. DATE	IN-SERV DATE	DELIV. DATE	DELIV. MILES
[REDACTED]	[REDACTED]			06/29/16	06/29/16	8
HOME	PHONE 2	CELL	STOCK NO.	SERV. ADV.		TERMS
[REDACTED]	[REDACTED]	[REDACTED]	[REDACTED]	RICK GUDINO (316)		No Charge
					RO COMMENT	
					1.5L I4 F DOHC 16V	

Line	Op-Code	Fail Code	Tech	Hours	Type	Amount
------	---------	-----------	------	-------	------	--------

D	Continued					
Correction	<p>Verified customer concern. Found bulletin #19-NA-206. Document ID: 5403533. According to bulletin #19-NA-206 the cause of the condition may be that the park switch in the transmission control (shifter) assembly is not pulling the BCM signal low to electronically show that the vehicle is in the Park position. To correct the issue R & R the transmission control, install a new shifter harness, then upon reinstalling the transmission control, install an In-line Shifter Wire Harness Jumper between the shifter base connector and the console harness connector. Noticed when replacing the shift harness that the park switch is missing both legs. Replaced the shifter harness and an In-line Shifter Wire Harness Jumper between the shifter base connector and the console harness connector verified repairs and all OK. repair covered through pzev extended warranty</p>					

E	3013		A60		Warranty	
Concern	Customer states engine struggles to crank over when attempting to start vehicle-check and advise					
Correction	Could not verify customer concern. Replaced the Battery Energy Control Module & after repairs the engine starts and idles as intended. See line C for more details.					

Authorized Estimates						
Date/Time	Amount	Authorized By	Authorization Method	Phone/Email	Adv. Username	
04/24/2023 13:12	\$205.00		Initial Estimate		rickg	

Customer Totals	
Charge Description	Amount
Total Amount Due	\$0.00

Indebtedness is hereby acknowledge for the "Total Charges" being all or the balance owing to repairs, parts & accessories described in this work order.

B.A.R. LICENSE # ARD00004535
E.P.A. # CAD028246569

X _____