



Service Bulletin

File in Section: -

Bulletin No.: 18-NA-261

Date: August, 2018

TECHNICAL

Subject: No Start, Malfunction Indicator Lamp (MIL) Illuminated - DTC U2603, U2604, U2605, U2606, U2617, U2618, U2619, U2620, U2621, U2622, U2623 and/or U2624 Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Volt	2016	2018				

Involved Region or Country	North America, South Korea
Condition	<p>Some customers may comment on one or more of the following conditions:</p> <ul style="list-style-type: none"> • MIL Illuminated • No start <p>Some technicians may find one or more of the following DTCs set:</p> <ul style="list-style-type: none"> • U2603: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 1 • U2604: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 2 • U2605: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 3 • U2606: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 4 • U2617: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 5 • U2618: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 6 • U2619: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 7 • U2620: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 8 • U2621: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 9 • U2622: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 10 • U2623: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 11 • U2624: Battery Energy Control Module Lost Communication with Hybrid/EV Battery Interface Control Module 12
Cause	This condition may be caused by an internal issue within the Battery Energy Control Module.
Correction	Replace and reprogram the Battery Energy Control Module per SI.

Service Procedure

Important: Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install the EL-49642 SPS Programming Support Tool (GM Dealer Equipment Item #PSC-550) to maintain system voltage.

If not available, connect a fully charged 12 V jumper or booster pack disconnected from the AC voltage supply. DO NOT connect a battery charger.

Refer to *Battery Energy Control Module Replacement* in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	MODULE, BAT ENGY CONT	24294960	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
5031010	Battery Energy Control Module Replacement	Use Published Labor Operation Time

Version	1
Modified	Released August 24, 2018

