

Article Number: 50841
Article Type: S
Author:
Global Concern Number: 062-2018-0012
Market(s):

Area Code	Geo Sales Area	Date of Activation	Date of Deactivation
NA	***	06/08/2022	01/18/2023
WD	ABW	06/08/2022	01/18/2023
WD	AFG	06/08/2022	01/18/2023
WD	AGO	06/08/2022	01/18/2023
WD	AIA	06/08/2022	01/18/2023
WD	ANT	06/08/2022	01/18/2023
WD	ARE	06/08/2022	01/18/2023
WD	ATG	06/08/2022	01/18/2023
WD	BDI	06/08/2022	01/18/2023
WD	BEN	06/08/2022	01/18/2023
WD	BFA	06/08/2022	01/18/2023
WD	BHR	06/08/2022	01/18/2023
WD	BHS	06/08/2022	01/18/2023
WD	BLZ	06/08/2022	01/18/2023
WD	BMU	06/08/2022	01/18/2023
WD	BRB	06/08/2022	01/18/2023
WD	CAF	06/08/2022	01/18/2023
WD	CCK	06/08/2022	01/18/2023
WD	CIV	06/08/2022	01/18/2023
WD	CMR	06/08/2022	01/18/2023
WD	COD	06/08/2022	01/18/2023
WD	COG	06/08/2022	01/18/2023
WD	COM	06/08/2022	01/18/2023
WD	CPV	06/08/2022	01/18/2023
WD	CRI	06/08/2022	01/18/2023
WD	CUB	06/08/2022	01/18/2023
WD	CYM	06/08/2022	01/18/2023
WD	DJI	06/08/2022	01/18/2023
WD	DMA	06/08/2022	01/18/2023
WD	DOM	06/08/2022	01/18/2023
WD	ERI	06/08/2022	01/18/2023
WD	ETH	06/08/2022	01/18/2023
WD	GAB	06/08/2022	01/18/2023
WD	GHA	06/08/2022	01/18/2023
WD	GIN	06/08/2022	01/18/2023
WD	GMB	06/08/2022	01/18/2023
WD	GNB	06/08/2022	01/18/2023
WD	GNQ	06/08/2022	01/18/2023
WD	GRD	06/08/2022	01/18/2023
WD	GTM	06/08/2022	01/18/2023
WD	HND	06/08/2022	01/18/2023
WD	HTI	06/08/2022	01/18/2023
WD	IRN	06/08/2022	01/18/2023
WD	IRQ	06/08/2022	01/18/2023
WD	ISR	06/08/2022	01/18/2023

WD	JAM	06/08/2022	01/18/2023
WD	JOR	06/08/2022	01/18/2023
WD	KEN	06/08/2022	01/18/2023
WD	KNA	06/08/2022	01/18/2023
WD	KWT	06/08/2022	01/18/2023
WD	LBN	06/08/2022	01/18/2023
WD	LBR	06/08/2022	01/18/2023
WD	LCA	06/08/2022	01/18/2023
WD	MDG	06/08/2022	01/18/2023
WD	MLI	06/08/2022	01/18/2023
WD	MOZ	06/08/2022	01/18/2023
WD	MRT	06/08/2022	01/18/2023
WD	MSR	06/08/2022	01/18/2023
WD	MTQ	06/08/2022	01/18/2023
WD	MUS	06/08/2022	01/18/2023
WD	MWI	06/08/2022	01/18/2023
WD	MYT	06/08/2022	01/18/2023
WD	NER	06/08/2022	01/18/2023
WD	NGA	06/08/2022	01/18/2023
WD	NIC	06/08/2022	01/18/2023
WD	OMN	06/08/2022	01/18/2023
WD	PAK	06/08/2022	01/18/2023
WD	PAN	06/08/2022	01/18/2023
WD	PRI	06/08/2022	01/18/2023
WD	PSE	06/08/2022	01/18/2023
WD	QAT	06/08/2022	01/18/2023
WD	REU	06/08/2022	01/18/2023
WD	RWA	06/08/2022	01/18/2023
WD	SAU	06/08/2022	01/18/2023
WD	SDN	06/08/2022	01/18/2023
WD	SEN	06/08/2022	01/18/2023
WD	SHN	06/08/2022	01/18/2023
WD	SLE	06/08/2022	01/18/2023
WD	SLV	06/08/2022	01/18/2023
WD	SOM	06/08/2022	01/18/2023
WD	SPM	06/08/2022	01/18/2023
WD	STP	06/08/2022	01/18/2023
WD	SYC	06/08/2022	01/18/2023
WD	SYR	06/08/2022	01/18/2023
WD	TCA	06/08/2022	01/18/2023
WD	TCD	06/08/2022	01/18/2023
WD	TGO	06/08/2022	01/18/2023
WD	TTO	06/08/2022	01/18/2023
WD	TZA	06/08/2022	01/18/2023
WD	UGA	06/08/2022	01/18/2023
WD	UMI	06/08/2022	01/18/2023
WD	VCT	06/08/2022	01/18/2023
WD	VGB	06/08/2022	01/18/2023
WD	VIR	06/08/2022	01/18/2023
WD	YEM	06/08/2022	01/18/2023
WD	ZAR	06/08/2022	01/18/2023

WD	ZMB	06/08/2022	01/18/2023
WD	ZWE	06/08/2022	01/18/2023

Title:

2018-2022 F-150/Expedition/Navigator/Transit/Explorer/Aviator - Illuminated Malfunction Indicator Lamp With DTCs P0627, P025A, P025B, P00C6, P008A And/Or U0109

Text:

Some 2018-2022 F-150, Expedition, Navigator, Transit, Aviator and Explorer vehicles may exhibit an illuminated MIL with diagnostic trouble codes (DTCs) P0627, P025A, P025B, P00C6, P008A and/or U0109 stored in the powertrain control module (PCM). This may be due to an intermittent or partial disconnect of the harness to the fuel pump control module (FPCM) connector, connector pin push-outs, damaged pins/terminals, or loose/corroded grounds. Inspect FPCM connector, applicable grounds (F-150 - G401, Expedition/Navigator - G403, Transit - G401, 2018-2019 Explorer □ G302, 2020-2022 Explorer/Aviator - G407) and confirm FPCM connector (F-150 - C4336, Expedition/Navigator - C433, Transit - C433, 2018-2019 Explorer - C3239, 2020-2022 Explorer/Aviator - C4033) is fully seated prior to performing PC/ED diagnostics or replacing any components.

Vehicles:

- 2020-2022 Aviator (U611N) (TV)
- 2018-2022 Expedition (U553) (B8)
- 2018-2019 Explorer (U502) (UB)
- 2020-2022 Explorer (U625N) (TW)
- 2018-2020 F-150 (P552) (FC)
- 2021-2022 F-150 (P702) (FD)
- 2018-2022 Navigator (U554) (B9)
- 2018-2022 Transit (V363N) (TH)

Symptom Code:

- GP008A *****
- GP00C6 *****
- GP025A *****
- GP025B *****
- GP0627 *****
- GU0109 *****

Global Customer Symptom Codes:

Category	Q1	Q2	Q3	Full Code
Driver Aides and Information				2****
Driver Aides and Information	Warning Indicators/Messages/Chimes			227***
Driver Aides and Information	Warning Indicators/Messages/Chimes	Service Engine Soon (Engine Image)		227Q**
Driver Aides and Information	Warning Indicators/Messages/Chimes	Service Engine Soon (Engine Image)	Flashes	227Q30
Driver Aides and Information	Warning Indicators/Messages/Chimes	Service Engine Soon (Engine Image)	Stays On	227Q68
Driving Performance				5****
Driving Performance	Runs Rough			550***
Driving Performance	Runs Rough	Acceleration		5502**
Driving Performance	Runs Rough	Acceleration	Always	550202
Driving Performance	Idle Quality			551***
Driving Performance	Idle Quality	Rough		5519**
Driving Performance	Idle Quality	Rough	Always	551902
Driving Performance	Lack/Loss of Power			554***
Driving Performance	Lack/Loss of Power	Acceleration		5542**
Driving Performance	Lack/Loss of Power	Acceleration	Always	554202
Driving Performance	Hesitates/Stumble			557***
Driving Performance	Hesitates/Stumble	Acceleration		5572**
Driving Performance	Hesitates/Stumble	Acceleration	Always	557202

Audit Comments:

Area Code	Geo Sales Area	Comment	Old Date of Deactivation	New Date of Deactivation	CDSID
NA	***	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
NA	***	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	ABW	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH

WD	SLV	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	SLV	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	SOM	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	SOM	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	SPM	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	SPM	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	STP	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	STP	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	SYC	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	SYC	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	SYR	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	SYR	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	TCA	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	TCA	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	TCD	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	TCD	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	TGO	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	TGO	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	TTO	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	TTO	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	TZA	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	TZA	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	UGA	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	UGA	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	UMI	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	UMI	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	VCT	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	VCT	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	VGB	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	VGB	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	VIR	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	VIR	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	YEM	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	YEM	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	ZAR	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	ZAR	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	ZMB	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	ZMB	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH
WD	ZWE	GSMITH LOADED MESSAGE:076-2022-2423::ADD	01/01/1900	06/07/2032	GSMITH
WD	ZWE	THIS MESSAGE WAS SUPERCEDED BY 51306	06/07/2032	01/18/2023	GSMITH