

From: Henney, Travis (J.)
Sent: Friday, July 14, 2023 2:08 PM
To: Page, Kimberly (K.A.)
Subject: FW: 2021-2022 Econoline VOQs - Power Steering Assist
Attachments: 2021 E-350_ECI 884223_ODI 11471820.pdf; 2021 E-450_ECI 884222_ODI 11464223.pdf;
2021 E-450_ECI 884225_ODI 11487034.pdf; 2022 E-350_ECI 884224_ODI 11483429.pdf;
2022 E-450_ECI 884226_ODI 11496999.pdf

Kim – This is what I shared with Laura this week. I apologize I didn't check in with you or the team on history. I also was cluing in more the reports of loss of steering assist. I know this isn't much of a help/starting point, but just wanted to share what I sent and how I characterized theses.

Thanks for your help in rebuilding from the last stepping stone.

Best Regards,
Travis Henney
Automotive Safety Office-Senior Safety Engineer
thenney@ford.com
(313)-399-7256

From: Henney, Travis (J.)
Sent: Wednesday, July 12, 2023 1:18 PM
To: Beyer, Laura (L.D.) <lbeyer4@ford.com>
Subject: 2021-2022 Econoline VOQs - Power Steering Assist

Hi Laura,

We noted the following (5) VOQs with this week's load for 2021-2022 E-Series vehicles alleging a loss of power steering assist.

From PTS history, (4) of (5) previously were inspected and passed under 22S08, then subsequently appear to allege a leak from the PS hoses. Of the (4) inspected under 22S08, one has had the PS hose replaced after the recall after experiencing an additional leak.

Please let me know if there is anything else we can do to help.

Best Regards,
Travis Henney
Automotive Safety Office-Senior Safety Engineer
thenney@ford.com
(313)-399-7256



Concern Driven Reporting

Report Detail

Note: Field which are grayed (ghosted) are currently being mapped to the data warehouse. They are not presently being populated.

ECI Record		Source Code	VOQ Ford
------------	--	-------------	----------

Commodity Assignment

Commodity	chassis-service brakes-brake pedal—	Symptom	field service action
Commodity	chassis-service brakes-brake pedal—	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-brake pedal—	Symptom	function-steering/brake ineffective
Commodity	chassis-service brakes-brake pedal—	Symptom	high effort
Commodity	chassis-service brakes-brake pedal—	Symptom	mod-driving condition-while driving
Commodity	chassis-service brakes-brake pedal—	Symptom	mod-location-interior
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	field service action
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-steering/brake ineffective
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	high effort
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while driving
Significant Event		Verified	N

Tread Information

Report Details

Source Claim Key	015976278 ODI	Warranty Component Classification (WCC)	
Corporate Product Systems Classification (CPSC)		Time in Service	
Customer Concern Code		V Function Group (VFG)	
Source System Program Type		Repair/Report/Paid Date	18-Jun-2022
Version Series Code		Load Date	11-Jul-2023
Causal Part Prefix- Base - Suffix	-	Dealer Code	
Causal Part Name	NOT PROVIDED BY SOURCE	Dealer Name	
Non Causal Part Prefix-Base-Suffix		Dealer City	
Non Causal Part Numbers		Dealer State/Province	MI
Fault Code		Dealer Country	USA
CC-Condition Code		Dealer Phone Number	
Labor Operation Code		Attachment	
Communication Type		VOQ Component Description Code	SERVICE BRAKES, HYDRAULIC
Maintenance Date	11-Jul-2023	GCQIS Safety Flag	

Customer Comment The contact owns a 2022 Ford E 450 The contact stated that while driving at an undisclosed speed, the steering wheel became difficult to maneuver The contact then stated that he had to apply pressure to the brake pedal to stop the vehicle No warning light was illuminated The contact was able to maneuver the vehicle off the roadway The independent mechanic was notified and went out to diagnose the vehicle The contact was informed that the steering hose failed and needed to be replaced The vehicle was repaired Additionally, the contact stated that he received Manufacturer recall notification 22S08 (Hydroboost or Hydromax Power Steering Pressure Line Inspection) however, the vehicle was inspected, and the contact was informed that the hose did not need to be replaced The manufacturer was notified of the failure and the contact was provided a case number, but no additional assistance was provided The failure mileage was approximately 3,200

Technician Comment

CQIS Recommendations

Tire Information

Tire Manufacturer	Unknown	Tire Size	Unknown
Tire Brand Series		Wheel	
DOT Left Front		DOT Right Front	
DOT Left Rear		DOT Right Rear	
DOT Left Inner		DOT Right Inner	
DOT Spare			

Vehicle Information

VIN		Engine Serial Number	
Model Year	2022	Engine Description	Unknown
Transmission	Unknown	Vehicle Description	E 450
Body Cab Style	Unknown	Drive Line	Unknown
Production Date		Retail Sale Indicator Code	
Plant Description	Unknown	Required Vehicle	
Build Region		Warranty Start Date	
Build Country Code		Transmission Serial Number	
Mileage	3200	Vehicle Axle Ratio	Unknown
Vehicle Restraint Code			

Disclaimer:

This data is for use as one of several potential "awareness" indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer "word search" of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary.

[Contact ODR HELP](#)

Copyright 2018 Ford Motor Co. All Rights Reserved.



Concern Driven Reporting

Report Detail

Note: Field which are grayed (ghosted) are currently being mapped to the data warehouse. They are not presently being populated.

ECI Record		Source Code	VOQ Ford
------------	--	-------------	----------

Commodity Assignment

Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-steering/brake ineffective
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	leak-fluid
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-at cruise
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-on deceleration/braking
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while driving
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-vehicle towed in
Significant Event		Verified	N

Tread Information

Report Details

Source Claim Key	015976275 ODI	Warranty Component Classification (WCC)	
Corporate Product Systems Classification (CPSC)		Time in Service	
Customer Concern Code		V Function Group (VFG)	
Source System Program Type		Repair/Report/Paid Date	27-May-2022
Version Series Code		Load Date	11-Jul-2023
Causal Part Prefix- Base - Suffix	- -	Dealer Code	
Causal Part Name	NOT PROVIDED BY SOURCE	Dealer Name	
Non Causal Part Prefix-Base-Suffix		Dealer City	
Non Causal Part Numbers		Dealer State/Province	OH
Fault Code		Dealer Country	USA
CC-Condition Code		Dealer Phone Number	
Labor Operation Code		Attachment	
Communication Type		VOQ Component Description Code	SERVICE BRAKES, HYDRAULIC POWER ASSIST
Maintenance Date	11-Jul-2023	GCQIS Safety Flag	

Customer Comment	The contact owns a 2021 Ford E 350 The contact stated that the vehicle was included in NHTSA Campaign Number 22V089000 (Steering, Service Brakes, Hydraulic) and the vehicle was inspected During the inspection, there were no leaks found The contact stated while driving approximately 65 MPH after the inspection, the vehicle lost power steering functionality The contact coasted the vehicle off the highway The contact stated that while driving afterward and attempting to depress the brake pedal, the vehicle failed to respond as designed The contact pulled over and had the vehicle towed to the dealer where the recall repair was completed The manufacturer was made aware of the failure The approximate failure mileage was 10,800
Technician Comment	
CQIS Recommendations	

Tire Information

Tire Manufacturer	Unknown	Tire Size	Unknown
Tire Brand Series		Wheel	
DOT Left Front		DOT Right Front	
DOT Left Rear		DOT Right Rear	
DOT Left Inner		DOT Right Inner	
DOT Spare			

Vehicle Information

VIN		Engine Serial Number	
Model Year	2021	Engine Description	Unknown
Transmission	Unknown	Vehicle Description	E 350
Body Cab Style	Unknown	Drive Line	Unknown
Production Date		Retail Sale Indicator Code	
Plant Description	Unknown	Required Vehicle	
Build Region		Warranty Start Date	
Build Country Code		Transmission Serial Number	
Mileage	10800	Vehicle Axle Ratio	Unknown
Vehicle Restraint Code			

Disclaimer:

This data is for use as one of several potential "awareness" indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer "word search" of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary.

[Contact ODR HELP](#)

Copyright 2018 Ford Motor Co. All Rights Reserved.



Concern Driven Reporting

Report Detail

Note: Field which are grayed (ghosted) are currently being mapped to the data warehouse. They are not presently being populated.

ECL Record		Source Code	VOQ Ford
------------	--	-------------	----------

Commodity Assignment

Commodity	chassis-service brakes-booster/hydroboost -	Symptom	damage
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	field service action
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-steering/brake ineffective
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-at cruise
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-on grade
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while driving
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while towing
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	shift-will not shift/stuck in gear
Significant Event	Fatality;	Verified	N

Tread Information

Report Details

Source Claim Key	015976277 ODI	Warranty Component Classification (WCC)	
Corporate Product Systems Classification (CPSC)		Time in Service	
Customer Concern Code		V Function Group (VFG)	
Source System Program Type		Repair/Report/Paid Date	07-May-2022
Version Series Code		Load Date	11-Jul-2023
Causal Part Prefix- Base - Suffix	- -	Dealer Code	
Causal Part Name	NOT PROVIDED BY SOURCE	Dealer Name	
Non Causal Part Prefix-Base-Suffix		Dealer City	
Non Causal Part Numbers		Dealer State/Province	CA
Fault Code		Dealer Country	USA
CC-Condition Code		Dealer Phone Number	
Labor Operation Code		Attachment	
Communication Type		VOQ Component Description Code	SERVICE BRAKES, HYDRAULIC POWER ASSIST
Maintenance Date	11-Jul-2023	GCQIS Safety Flag	

Customer Comment Regarding the recall #22S08 Hydroboost or Hydromax power steering pressure line We took our Motorhome in to have the recall addressed and for service before a planned camping trip Apparently the recall was worded to inspect OR replace and our vehicle was only inspected On our ruined Mother's Day vacation, we were driving highway speeds at a downgrade coming into Nevada and lost all power steering which took our motorhome and trailer we were pulling off of the highway and dangerously close to falling off the highway and tumbling down a hill We went to exit at the next offramp to look at the power steering issue and found that we also had no brakes By downshifting, we were able to stop safely There were no warning lights or signals, and no warning signs what so ever The motorhome is currently being looked at and hopefully repaired at a Rush Truck Center in Las Vegas Ford Motor Company and the original dealership have been notified Our main concern is the word OR in the recall verbiage, which we blame Ford Motor Co The problem is clearly this part must be replaced, not just inspected A change in the verbiage literally will save lives We really should have been dead on the side of the road, but we were lucky and are contemplating hiring a lawyer, as we feel that the unacceptable recall wording by Ford unnecessarily put our lives at risk Our Ford Claim number is CAS

Technician Comment

CQIS Recommendation

Tire Information

Tire Manufacturer	Unknown	Tire Size	Unknown
Tire Brand Series		Wheel	
DOT Left Front		DOT Right Front	
DOT Left Rear		DOT Right Rear	
DOT Left Inner		DOT Right Inner	
DOT Spare			

Vehicle Information

VIN		Engine Serial Number	
Model Year	2021	Engine Description	Unknown
Transmission	Unknown	Vehicle Description	E 450
Body Cab Style	Unknown	Drive Line	Unknown
Production Date		Retail Sale Indicator Code	
Plant Description	Unknown	Required Vehicle	
Build Region		Warranty Start Date	
Build Country Code		Transmission Serial Number	
Mileage	0	Vehicle Axle Ratio	Unknown
Vehicle Restraint Code			

Disclaimer:

This data is for use as one of several potential "awareness" indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer "word search" of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary.

[Contact ODR HELP](#)

Copyright 2018 Ford Motor Co. All Rights Reserved.



Concern Driven Reporting

Report Detail

Note: Field which are grayed (ghosted) are currently being mapped to the data warehouse. They are not presently being populated.

ECI Record		Source Code	VOQ Ford
------------	--	-------------	----------

Commodity Assignment

Commodity	chassis-service brakes-booster/hydroboost -	Symptom	field service action
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	high effort
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	leak-fluid
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while driving
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while turning
Significant Event		Verified	N

Tread Information

Report Details

Source Claim Key	015976276 ODI	Warranty Component Classification (WCC)	
Corporate Product Systems Classification (CPSC)		Time in Service	
Customer Concern Code		V Function Group (VFG)	
Source System Program Type		Repair/Report/Paid Date	06-Sep-2022
Version Series Code		Load Date	11-Jul-2023
Causal Part Prefix- Base - Suffix	- -	Dealer Code	
Causal Part Name	NOT PROVIDED BY SOURCE	Dealer Name	
Non Causal Part Prefix-Base-Suffix		Dealer City	
Non Causal Part Numbers		Dealer State/Province	FL
Fault Code		Dealer Country	USA
CC-Condition Code		Dealer Phone Number	
Labor Operation Code		Attachment	
Communication Type		VOQ Component Description Code	SERVICE BRAKES, HYDRAULIC POWER ASSIST
Maintenance Date	11-Jul-2023	GCQIS Safety Flag	

Customer Comment	The contact owns a 2021 Ford E 450 The contact received notification of NHTSA Campaign Number 22V089000 (Steering, Service Brakes, Hydraulic) The contact stated that the vehicle was taken to the dealer where the vehicle was inspected however, while making a turn into a service station, the steering wheel became difficult to maneuver No warning lights were illuminated The contact then stated that she was directed to a leak coming from the vehicle The contact notified the dealer, and the vehicle was towed to an independent mechanic where it was diagnosed that the hydro boost power failed and needed to be replaced The vehicle was repaired The manufacturer was notified of the failure and covered the cost of the tow, but no further assistance was provided The failure mileage was 4,826
Technician Comment	
CQIS Recommendations	

Tire Information

Tire Manufacturer	Unknown	Tire Size	Unknown
Tire Brand Series		Wheel	
DOT Left Front		DOT Right Front	
DOT Left Rear		DOT Right Rear	
DOT Left Inner		DOT Right Inner	
DOT Spare			

Vehicle Information

VIN		Engine Serial Number	
Model Year	2021	Engine Description	Unknown
Transmission	Unknown	Vehicle Description	E 450
Body Cab Style	Unknown	Drive Line	Unknown
Production Date		Retail Sale Indicator Code	
Plant Description	Unknown	Required Vehicle	
Build Region		Warranty Start Date	
Build Country Code		Transmission Serial Number	
Mileage	4826	Vehicle Axle Ratio	Unknown
Vehicle Restraint Code			

Disclaimer:

This data is for use as one of several potential "awareness" indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer "word search" of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary.

[Contact ODR HELP](#)

Copyright 2018 Ford Motor Co. All Rights Reserved.



Concern Driven Reporting

Report Detail

Note: Field which are grayed (ghosted) are currently being mapped to the data warehouse. They are not presently being populated.

ECL Record		Source Code	VOQ Ford
------------	--	-------------	----------

Commodity Assignment

Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	high effort
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	leak-fluid
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-at cruise
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while driving
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-location-under hood
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	odor
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	pulls/drifts
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	repair-prior repair mentioned
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	separation
Significant Event		Verified	N

Tread Information

Report Details

Source Claim Key	015976268 ODI 1	Warranty Component Classification (WCC)	
Corporate Product Systems Classification (CPSC)		Time in Service	
Customer Concern Code		V Function Group (VFG)	
Source System Program Type		Repair/Report/Paid Date	06-Sep-2022
Version Series Code		Load Date	11-Jul-2023
Causal Part Prefix- Base - Suffix	- -	Dealer Code	
Causal Part Name	NOT PROVIDED BY SOURCE	Dealer Name	
Non Causal Part Prefix-Base-Suffix		Dealer City	
Non Causal Part Numbers		Dealer State/Province	VA
Fault Code		Dealer Country	USA
CC-Condition Code		Dealer Phone Number	
Labor Operation Code		Attachment	
Communication Type		VOQ Component Description Code	SERVICE BRAKES, HYDRAULIC POWER ASSIST
Maintenance Date	11-Jul-2023	GCQIS Safety Flag	

Customer Comment	The contact owns a 2022 Ford E 350 The contact stated that while driving approximately 65 MPH, the steering wheel became stiff and the vehicle would pull in either direction Additionally, there was an abnormal odor inside the cabin of the vehicle The contact then noticed that the brake pedal had to be pressed very hard in order to stop the vehicle After stopping to inspect under the hood, the contact discovered a power steering fluid leak in the engine compartment The vehicle was driven to the local dealer who diagnosed that the power steering pressure line had detached The vehicle was not yet repaired The manufacturer was not yet notified of the failure The contact indicated that the vehicle was previously repaired under the NHTSA Campaign Number 22V089000 (Steering, Service Brakes, Hydraulic) The failure mileage was 6,300
Technician Comment	
CQIS Recommendations	

Tire Information

Tire Manufacturer	Unknown	Tire Size	Unknown
Tire Brand Series		Wheel	
DOT Left Front		DOT Right Front	
DOT Left Rear		DOT Right Rear	
DOT Left Inner		DOT Right Inner	
DOT Spare			

Vehicle Information

VIN		Engine Serial Number	
Model Year	2022	Engine Description	Unknown
Transmission	Unknown	Vehicle Description	E 350
Body Cab Style	Unknown	Drive Line	Unknown
Production Date		Retail Sale Indicator Code	
Plant Description	Unknown	Required Vehicle	
Build Region		Warranty Start Date	
Build Country Code		Transmission Serial Number	
Mileage	6300	Vehicle Axle Ratio	Unknown
Vehicle Restraint Code			

Disclaimer:

This data is for use as one of several potential "awareness" indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer "word search" of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary.

[Contact ODR HELP](#)

Copyright 2018 Ford Motor Co. All Rights Reserved.

From: Henney, Travis (J.)
Sent: Thursday, February 1, 2024 4:41 PM
To: Beyer, Laura (L.D.)
Cc: Page, Kimberly (K.A.)
Subject: FW: 2021-2022 Econoline VOQs - Power Steering Assist
Attachments: 2021 E-350_ECI 884223_ODI 11471820.pdf; 2021 E-450_ECI 884222_ODI 11464223.pdf;
2021 E-450_ECI 884225_ODI 11487034.pdf; 2022 E-350_ECI 884224_ODI 11483429.pdf;
2022 E-450_ECI 884226_ODI 11496999.pdf

Hi Laura,

I think this was one. There may be others, still looking.

Best Regards,
Travis Henney
Automotive Safety Office-Senior Safety Engineer
thenney@ford.com
(313)-399-7256

From: Henney, Travis (J.)
Sent: Wednesday, July 12, 2023 1:18 PM
To: Beyer, Laura (L.D.) <lbeyer4@ford.com>
Subject: 2021-2022 Econoline VOQs - Power Steering Assist

Hi Laura,

We noted the following (5) VOQs with this week's load for 2021-2022 E-Series vehicles alleging a loss of power steering assist.

From PTS history, (4) of (5) previously were inspected and passed under 22S08, then subsequently appear to allege a leak from the PS hoses. Of the (4) inspected under 22S08, one has had the PS hose replaced after the recall after experiencing an additional leak.

Please let me know if there is anything else we can do to help.

Best Regards,
Travis Henney
Automotive Safety Office-Senior Safety Engineer
thenney@ford.com
(313)-399-7256



Concern Driven Reporting

Report Detail

Note: Field which are grayed (ghosted) are currently being mapped to the data warehouse. They are not presently being populated.

ECI Record		Source Code	VOQ Ford
------------	--	-------------	----------

Commodity Assignment

Commodity	chassis-service brakes-brake pedal—	Symptom	field service action
Commodity	chassis-service brakes-brake pedal—	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-brake pedal—	Symptom	function-steering/brake ineffective
Commodity	chassis-service brakes-brake pedal—	Symptom	high effort
Commodity	chassis-service brakes-brake pedal—	Symptom	mod-driving condition-while driving
Commodity	chassis-service brakes-brake pedal—	Symptom	mod-location-interior
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	field service action
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-steering/brake ineffective
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	high effort
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while driving
Significant Event		Verified	N

Tread Information

Report Details

Source Claim Key	015976278 ODI	Warranty Component Classification (WCC)	
Corporate Product Systems Classification (CPSC)		Time in Service	
Customer Concern Code		V Function Group (VFG)	
Source System Program Type		Repair/Report/Paid Date	18-Jun-2022
Version Series Code		Load Date	11-Jul-2023
Causal Part Prefix- Base - Suffix	-	Dealer Code	
Causal Part Name	NOT PROVIDED BY SOURCE	Dealer Name	
Non Causal Part Prefix-Base-Suffix		Dealer City	
Non Causal Part Numbers		Dealer State/Province	MI
Fault Code		Dealer Country	USA
CC-Condition Code		Dealer Phone Number	
Labor Operation Code		Attachment	
Communication Type		VOQ Component Description Code	SERVICE BRAKES, HYDRAULIC
Maintenance Date	11-Jul-2023	GCQIS Safety Flag	

Customer Comment The contact owns a 2022 Ford E 450 The contact stated that while driving at an undisclosed speed, the steering wheel became difficult to maneuver The contact then stated that he had to apply pressure to the brake pedal to stop the vehicle No warning light was illuminated The contact was able to maneuver the vehicle off the roadway The independent mechanic was notified and went out to diagnose the vehicle The contact was informed that the steering hose failed and needed to be replaced The vehicle was repaired Additionally, the contact stated that he received Manufacturer recall notification 22S08 (Hydroboost or Hydromax Power Steering Pressure Line Inspection) however, the vehicle was inspected, and the contact was informed that the hose did not need to be replaced The manufacturer was notified of the failure and the contact was provided a case number, but no additional assistance was provided The failure mileage was approximately 3,200

Technician Comment

CQIS Recommendations

Tire Information

Tire Manufacturer	Unknown	Tire Size	Unknown
Tire Brand Series		Wheel	
DOT Left Front		DOT Right Front	
DOT Left Rear		DOT Right Rear	
DOT Left Inner		DOT Right Inner	
DOT Spare			

Vehicle Information

VIN		Engine Serial Number	
Model Year	2022	Engine Description	Unknown
Transmission	Unknown	Vehicle Description	E 450
Body Cab Style	Unknown	Drive Line	Unknown
Production Date		Retail Sale Indicator Code	
Plant Description	Unknown	Required Vehicle	
Build Region		Warranty Start Date	
Build Country Code		Transmission Serial Number	
Mileage	3200	Vehicle Axle Ratio	Unknown
Vehicle Restraint Code			

Disclaimer:

This data is for use as one of several potential "awareness" indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer "word search" of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary.

[Contact ODR HELP](#)

Copyright 2018 Ford Motor Co. All Rights Reserved.



Concern Driven Reporting

Report Detail

Note: Field which are grayed (ghosted) are currently being mapped to the data warehouse. They are not presently being populated.

ECI Record		Source Code	VOQ Ford
------------	--	-------------	----------

Commodity Assignment

Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-steering/brake ineffective
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	leak-fluid
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-at cruise
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-on deceleration/braking
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while driving
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-vehicle towed in
Significant Event		Verified	N

Tread Information

Report Details

Source Claim Key	015976275 ODI	Warranty Component Classification (WCC)	
Corporate Product Systems Classification (CPSC)		Time in Service	
Customer Concern Code		V Function Group (VFG)	
Source System Program Type		Repair/Report/Paid Date	27-May-2022
Version Series Code		Load Date	11-Jul-2023
Causal Part Prefix- Base - Suffix	- -	Dealer Code	
Causal Part Name	NOT PROVIDED BY SOURCE	Dealer Name	
Non Causal Part Prefix-Base-Suffix		Dealer City	
Non Causal Part Numbers		Dealer State/Province	OH
Fault Code		Dealer Country	USA
CC-Condition Code		Dealer Phone Number	
Labor Operation Code		Attachment	
Communication Type		VOQ Component Description Code	SERVICE BRAKES, HYDRAULIC POWER ASSIST
Maintenance Date	11-Jul-2023	GCQIS Safety Flag	

Customer Comment	The contact owns a 2021 Ford E 350 The contact stated that the vehicle was included in NHTSA Campaign Number 22V089000 (Steering, Service Brakes, Hydraulic) and the vehicle was inspected During the inspection, there were no leaks found The contact stated while driving approximately 65 MPH after the inspection, the vehicle lost power steering functionality The contact coasted the vehicle off the highway The contact stated that while driving afterward and attempting to depress the brake pedal, the vehicle failed to respond as designed The contact pulled over and had the vehicle towed to the dealer where the recall repair was completed The manufacturer was made aware of the failure The approximate failure mileage was 10,800
Technician Comment	
CQIS Recommendations	

Tire Information

Tire Manufacturer	Unknown	Tire Size	Unknown
Tire Brand Series		Wheel	
DOT Left Front		DOT Right Front	
DOT Left Rear		DOT Right Rear	
DOT Left Inner		DOT Right Inner	
DOT Spare			

Vehicle Information

VIN		Engine Serial Number	
Model Year	2021	Engine Description	Unknown
Transmission	Unknown	Vehicle Description	E 350
Body Cab Style	Unknown	Drive Line	Unknown
Production Date		Retail Sale Indicator Code	
Plant Description	Unknown	Required Vehicle	
Build Region		Warranty Start Date	
Build Country Code		Transmission Serial Number	
Mileage	10800	Vehicle Axle Ratio	Unknown
Vehicle Restraint Code			

Disclaimer:

This data is for use as one of several potential "awareness" indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer "word search" of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary.

[Contact ODR HELP](#)

Copyright 2018 Ford Motor Co. All Rights Reserved.



Concern Driven Reporting

Report Detail

Note: Field which are grayed (ghosted) are currently being mapped to the data warehouse. They are not presently being populated.

ECI Record		Source Code	VOQ Ford
------------	--	-------------	----------

Commodity Assignment

Commodity	chassis-service brakes-booster/hydroboost -	Symptom	damage
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	field service action
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-steering/brake ineffective
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-at cruise
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-on grade
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while driving
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while towing
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	shift-will not shift/stuck in gear
Significant Event	Fatality;	Verified	N

Tread Information

Report Details

Source Claim Key	015976277 ODI	Warranty Component Classification (WCC)	
Corporate Product Systems Classification (CPSC)		Time in Service	
Customer Concern Code		V Function Group (VFG)	
Source System Program Type		Repair/Report/Paid Date	07-May-2022
Version Series Code		Load Date	11-Jul-2023
Causal Part Prefix- Base - Suffix	- -	Dealer Code	
Causal Part Name	NOT PROVIDED BY SOURCE	Dealer Name	
Non Causal Part Prefix-Base-Suffix		Dealer City	
Non Causal Part Numbers		Dealer State/Province	CA
Fault Code		Dealer Country	USA
CC-Condition Code		Dealer Phone Number	
Labor Operation Code		Attachment	
Communication Type		VOQ Component Description Code	SERVICE BRAKES, HYDRAULIC POWER ASSIST
Maintenance Date	11-Jul-2023	GCQIS Safety Flag	

Customer Comment Regarding the recall #22S08 Hydroboost or Hydromax power steering pressure line We took our Motorhome in to have the recall addressed and for service before a planned camping trip Apparently the recall was worded to inspect OR replace and our vehicle was only inspected On our ruined Mother's Day vacation, we were driving highway speeds at a downgrade coming into Nevada and lost all power steering which took our motorhome and trailer we were pulling off of the highway and dangerously close to falling off the highway and tumbling down a hill We went to exit at the next offramp to look at the power steering issue and found that we also had no brakes By downshifting, we were able to stop safely There were no warning lights or signals, and no warning signs what so ever The motorhome is currently being looked at and hopefully repaired at a Rush Truck Center in Las Vegas Ford Motor Company and the original dealership have been notified Our main concern is the word OR in the recall verbiage, which we blame Ford Motor Co The problem is clearly this part must be replaced, not just inspected A change in the verbiage literally will save lives We really should have been dead on the side of the road, but we were lucky and are contemplating hiring a lawyer, as we feel that the unacceptable recall wording by Ford unnecessarily put our lives at risk Our Ford Claim number is CAS

Technician Comment

CQIS Recommendation

Tire Information

Tire Manufacturer	Unknown	Tire Size	Unknown
Tire Brand Series		Wheel	
DOT Left Front		DOT Right Front	
DOT Left Rear		DOT Right Rear	
DOT Left Inner		DOT Right Inner	
DOT Spare			

Vehicle Information

VIN		Engine Serial Number	
Model Year	2021	Engine Description	Unknown
Transmission	Unknown	Vehicle Description	E 450
Body Cab Style	Unknown	Drive Line	Unknown
Production Date		Retail Sale Indicator Code	
Plant Description	Unknown	Required Vehicle	
Build Region		Warranty Start Date	
Build Country Code		Transmission Serial Number	
Mileage	0	Vehicle Axle Ratio	Unknown
Vehicle Restraint Code			

Disclaimer:

This data is for use as one of several potential "awareness" indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer "word search" of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary.

[Contact ODR HELP](#)

Copyright 2018 Ford Motor Co. All Rights Reserved.



Concern Driven Reporting

Report Detail

Note: Field which are grayed (ghosted) are currently being mapped to the data warehouse. They are not presently being populated.

ECI Record		Source Code	VOQ Ford
------------	--	-------------	----------

Commodity Assignment

Commodity	chassis-service brakes-booster/hydroboost -	Symptom	field service action
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	high effort
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	leak-fluid
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while driving
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while turning
Significant Event		Verified	N

Tread Information

Report Details

Source Claim Key	015976276 ODI	Warranty Component Classification (WCC)	
Corporate Product Systems Classification (CPSC)		Time in Service	
Customer Concern Code		V Function Group (VFG)	
Source System Program Type		Repair/Report/Paid Date	06-Sep-2022
Version Series Code		Load Date	11-Jul-2023
Causal Part Prefix- Base - Suffix	- -	Dealer Code	
Causal Part Name	NOT PROVIDED BY SOURCE	Dealer Name	
Non Causal Part Prefix-Base-Suffix		Dealer City	
Non Causal Part Numbers		Dealer State/Province	FL
Fault Code		Dealer Country	USA
CC-Condition Code		Dealer Phone Number	
Labor Operation Code		Attachment	
Communication Type		VOQ Component Description Code	SERVICE BRAKES, HYDRAULIC POWER ASSIST
Maintenance Date	11-Jul-2023	GCQIS Safety Flag	

Customer Comment	The contact owns a 2021 Ford E 450 The contact received notification of NHTSA Campaign Number 22V089000 (Steering, Service Brakes, Hydraulic) The contact stated that the vehicle was taken to the dealer where the vehicle was inspected however, while making a turn into a service station, the steering wheel became difficult to maneuver No warning lights were illuminated The contact then stated that she was directed to a leak coming from the vehicle The contact notified the dealer, and the vehicle was towed to an independent mechanic where it was diagnosed that the hydro boost power failed and needed to be replaced The vehicle was repaired The manufacturer was notified of the failure and covered the cost of the tow, but no further assistance was provided The failure mileage was 4,826
Technician Comment	
CQIS Recommendations	

Tire Information

Tire Manufacturer	Unknown	Tire Size	Unknown
Tire Brand Series		Wheel	
DOT Left Front		DOT Right Front	
DOT Left Rear		DOT Right Rear	
DOT Left Inner		DOT Right Inner	
DOT Spare			

Vehicle Information

VIN		Engine Serial Number	
Model Year	2021	Engine Description	Unknown
Transmission	Unknown	Vehicle Description	E 450
Body Cab Style	Unknown	Drive Line	Unknown
Production Date		Retail Sale Indicator Code	
Plant Description	Unknown	Required Vehicle	
Build Region		Warranty Start Date	
Build Country Code		Transmission Serial Number	
Mileage	4826	Vehicle Axle Ratio	Unknown
Vehicle Restraint Code			

Disclaimer:

This data is for use as one of several potential "awareness" indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer "word search" of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary.

[Contact ODR HELP](#)

Copyright 2018 Ford Motor Co. All Rights Reserved.



Concern Driven Reporting

Report Detail

Note: Field which are grayed (ghosted) are currently being mapped to the data warehouse. They are not presently being populated.

ECL Record		Source Code	VOQ Ford
------------	--	-------------	----------

Commodity Assignment

Commodity	chassis-service brakes-booster/hydroboost -	Symptom	function-malfunction/inoperative
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	high effort
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	leak-fluid
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-at cruise
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-driving condition-while driving
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	mod-location-under hood
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	odor
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	pulls/drifts
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	repair-prior repair mentioned
Commodity	chassis-service brakes-booster/hydroboost -	Symptom	separation
Significant Event		Verified	N

Tread Information

Report Details

Source Claim Key	015976268	OD		Warranty Component Classification (WCC)	
Corporate Product Systems Classification (CPSC)				Time in Service	
Customer Concern Code				V Function Group (VFG)	
Source System Program Type				Repair/Report/Paid Date	06-Sep-2022
Version Series Code				Load Date	11-Jul-2023
Causal Part Prefix- Base - Suffix	- -			Dealer Code	
Causal Part Name	NOT PROVIDED BY SOURCE			Dealer Name	
Non Causal Part Prefix-Base-Suffix				Dealer City	
Non Causal Part Numbers				Dealer State/Province	VA
Fault Code				Dealer Country	USA
CC-Condition Code				Dealer Phone Number	
Labor Operation Code				Attachment	
Communication Type				VOQ Component Description Code	SERVICE BRAKES, HYDRAULIC POWER ASSIST
Maintenance Date	11-Jul-2023			GCQIS Safety Flag	

Customer Comment The contact owns a 2022 Ford E 350 The contact stated that while driving approximately 65 MPH, the steering wheel became stiff and the vehicle would pull in either direction Additionally, there was an abnormal odor inside the cabin of the vehicle The contact then noticed that the brake pedal had to be pressed very hard in order to stop the vehicle After stopping to inspect under the hood, the contact discovered a power steering fluid leak in the engine compartment The vehicle was driven to the local dealer who diagnosed that the power steering pressure line had detached The vehicle was not yet repaired The manufacturer was not yet notified of the failure The contact indicated that the vehicle was previously repaired under the NHTSA Campaign Number 22V089000 (Steering, Service Brakes, Hydraulic) The failure mileage was 6,300

Technician Comment

CQIS Recommendations

Tire Information

Tire Manufacturer	Unknown	Tire Size	Unknown
Tire Brand Series		Wheel	
DOT Left Front		DOT Right Front	
DOT Left Rear		DOT Right Rear	
DOT Left Inner		DOT Right Inner	
DOT Spare			

Vehicle Information

VIN		Engine Serial Number	
Model Year	2022	Engine Description	Unknown
Transmission	Unknown	Vehicle Description	E 350
Body Cab Style	Unknown	Drive Line	Unknown
Production Date		Retail Sale Indicator Code	
Plant Description	Unknown	Requaired Vehicle	
Build Region		Warranty Start Date	
Build Country Code		Transmission Serial Number	
Mileage	6300	Vehicle Axle Ratio	Unknown
Vehicle Restraint Code			

Disclaimer:

This data is for use as one of several potential "awareness" indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer "word search" of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary.

[Contact ODR HELP](#)

Copyright 2018 Ford Motor Co. All Rights Reserved.

From: Buelow, Steve (S.E.)
Sent: Wednesday, August 9, 2023 8:04 AM
To: Beyer, Laura (L.D.)
Cc: Stanley, Daniel (D.J.); Boehk, Karen (K.S.); Willard, Jeremy (J.)
Subject: FW: E-Series recall 22S08
Attachments: 176340 04.05.22 Totem Ford.pdf; 176329 - Coastal Recall.pdf; 176329-Dearborn Ford LOF & brakes.pdf

Steve Buelow

Program Manager - Recall & Service Programs
313-390-2313 Cell 773-726-0808 sbuelow@ford.com

From: Spruytte, Terry (T.) <tspruytt@ford.com>
Sent: Wednesday, August 9, 2023 6:31 AM
To: Garbish, Ken (K. J.) <kgarbish@ford.com>
Cc: Catalano, Martino (M.) <mcatalan@ford.com>; Goettsch, David (D.) <dgoettsc@ford.com>; Shuttleworth, David (D.L.) <dshuttle@ford.com>; Buelow, Steve (S.E.) <sbuelow@ford.com>
Subject: FW: E-Series recall 22S08

Ken,

The Ford dealerships involved in these potential FSA related concerns should contact the SSSC with all the details in each case.

Terry Spruytte

Technical Service Support
Ford Motor Company of Canada, Oakville, Ont.
tspruytt@ford.com
Cell 226 971 2015

From: Garbish, Ken (K. J.) <kgarbish@ford.com>
Sent: August-08-23 10:48 PM
To: Catalano, Martino (M.) <mcatalan@ford.com>; Spruytte, Terry (T.) <tspruytt@ford.com>
Cc: Goettsch, David (D.) <dgoettsc@ford.com>
Subject: FW: E-Series recall 22S08

Gentlemen,

Driving force has encountered two E-Series that passed the HydroBoost 22S08 recall inspection but still had the lines fail later. Are you aware of any other occurrences?

Do we need attention brought to this concern and/or further investigation? Is this something for SSSC or should GCRs be entered?

Please advise, thanks.

Kenneth J. Garbish
Ford Motor Company of Canada, Limited
Fleet Service Manager – Ford Pro, Western Canada
Cell: (780) 499-2090
Email: kgarbish@ford.com



From: Mike Fisher <MFisher@drivingforce.ca>
Sent: August 8, 2023 12:38 PM
To: Garbish, Ken (K. J.) <kgarbish@ford.com>; Schofield, Denis (D.P.) <dschofi1@ford.com>
Subject: E-Series recall 22S08

WARNING: This message originated outside of Ford Motor Company. Use caution when opening attachments, clicking links, or responding.

Good afternoon, gentlemen.

I wanted to make you aware of a situation we've had with a customer that rented two E-Series vans from us recently. The customer (see full note below) had two situations – within about six weeks of each other - where his employees experienced brake and steering failure on units that we'd rented. With both vehicles, we'd taken the vehicles in to have the recall addressed (I've checked the Coastal Ford repair as it looks like they charged Driving Force for the recall – we DID NOT pay the dealer in this instance) in April 2022, and the vehicles were cleared. It appears from this sample size, that there is still a safety issue relating to the 22S08 recall. If pressed, I'll refer the customer to the Ford of Canada Customer Relationship Centre at 1-800-565-3673. I don't believe they are a major fleet customer – perhaps a small FHQ account, but I don't recognize the name from my days in fleet. VINs are below, and ROs are attached. The second unit is at Terrace Totem – I don't yet have an RO for the second warranty repair on this issue.



I'll leave it to your discretion on if, and how you escalate internally. Please feel free to share this note with the CRC if you feel the need to give them a heads up that they might be receiving a call.

Please let me know if there are any further recall actions coming on E-Series on this specific topic, as we'll want to be proactive with our fleet and get our vehicles repaired/inspected as the case may be. Denis – cc'ing you on this as I believe Ken is away and there may be some urgency from our customer's perspective.

Thanks.

From our customer:

Thanks for looking into this matter further.

The first incident occurred on 13 June while the second occurred on July 27. Both incidents involved a Ford 2022 E-450 cutaway with dual rear wheels, and in both cases there was a failure of a hose that caused the steering and brakes to fail. The first incident was a near-miss and the handbrake was applied to stop the truck immediately uphill of a sharp curve and steep hill.

While Driving Force has been good at responding to each incident to replace the vehicle and 'rescue' our staff, there is anger that this has occurred twice with the same model of vehicle. The anger is related both to the danger that staff were put in, as well as the extra burden on their time/resources to find alternate solutions and adjust plans.

We have independently determined that there is a US recall on this vehicle for this issue (link below) – was this known? Based on the existence of the US recall on this vehicle, we feel that the first incident was avoidable. That a second incident occurred indicates to us that there is a problem that should be addressed. We believe that the first incident should have triggered an internal review of the fleet, which was apparently not done, given the second incident.



We'd like to know what solution has been implemented in order to restore our trust with Driving Force.

The people we have been dealing with at Driving Force are noted below.

Mike Fisher

Sr. Manager, Supply Chain and Logistics

Ext: 108775
C: 780-263-3474
O: 780-409-8775
T: 800-936-9353

Driving Force

17631 - 103 Ave NW
Edmonton, AB, Canada, T5S 1N8



A division of The Driving Force Group of Companies

Coastal Ford Burnaby

A division of Coastal Ford Sales Limited

5750 Lougheed HWY

Burnaby, BC V5B 2Z9

Phone: 604-294-6525

www.coastalfordburnaby.com

SO #

Status

Printed 04/12/2022 5:45:57 PM

SERVICE ORDER CUSTOMER COPY

User cfbquand Page 1

Customer No 9356C

[REDACTED]

EDMONTON, AB [REDACTED]

Home [REDACTED] Bus [REDACTED]

Cell [REDACTED] Today [REDACTED]

Email [REDACTED]

Fleet Type
Term CASH

Advisor Doug Quan Promised 04/14/2022 12:00 PM Tag 2682
Shop S1 Opened 04/12/2022 1:08 PM Location
Priority Cashiered PO #

License No	Odometer In	Odometer Out	InServ Date	Stock No
	6121	6121	04/21/2021	
Year	Make	Model	Model No	Colour
2022	FORD	E-SERIES CUTAWAY	E4F	
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
[REDACTED]			04/21/2021	
Engine Size	7.3L V8 ECONOMY-RATED	Fleet #		

Request	Description
22S08A	RECALL 22S08 -HYDROBOOST INSPECTION
Labour	Description
22S08A	RECALL 22S08 -HYDROBOOST INSPECTION
Technician	15 -
Cause	22S08A
Correction	PERFORM 22S08A--0.3HR

Job	CSR	Status
1	85	Original
Type	Amount	
C	47.39	

Parts Total	0.00
Labour Total	47.39
Request Sub-total	47.39

Labour	47.39
Parts	0.00
Supplies	6.16
SUB-TOTAL	53.55
GST	2.68
PST	0.00
TOTAL INVOICE	56.23

Payment is required on invoice. No statement will be issued. No refunds or exchanges on electrical, glass or special order parts.

I agree that until payment in full of the within account, I hereby acknowledge the existence of a mechanic's lien in favour of the within dealer on the vehicle described herein in respect of the material supplied and services rendered under this work order for the full amount charged therefor. I further acknowledge that the said lien shall continue in force at all times, whether the vehicle is in my possession or possession of the dealer until the within account is paid in full. While the vehicle is in my possession it shall at all times be subject to repossession on the demand by the dealer until the within account is paid in full.

Indebtedness is hereby acknowledged in the sum of \$_____ being all or the balance owing for repairs, parts and accessories described on this Invoice. **Terms:** Net 30 days; interest of 2% per month (24.0% per annum) charged on all overdue accounts.

Customer Signature X _____ Date: _____

Thank you for your business!

RQ24-003 000026 ER



DEARBORN

Our Reputation is Riding With You



2555 East Trans Canada Hwy • Kamloops, BC V2C 4B1

Phn: 250-372-7101 • Fax: 250-314-5175

Toll Free: 1-800-566-7101 • www.dearbornford.com

SERVICE DEPARTMENT HOURS

Monday - Friday

7:30AM - 5:30PM

Saturday

8:00AM - 4:30PM

SO #

SERVICE ORDER

CUSTOMER COPY

Printed 07/19/2023 2:42:23 PM

User 104508 Page 1

Customer No	1041440	Advisor	Christi Armstrong	Promised	07/11/2023 5:00 PM	Tag	
		Shop	DS	Opened	07/11/2023 11:21 AM	Location	
		Priority	40	Cashiered		PO #	DF98325
LANGLEY, BC		License No		Odometer In	22901	Odometer Out	22911
		Year	2022	Make	FORD	Model	E-SERIES CUTAWAY
		Vehicle ID No		Selling Dealer		Model No	E4F
		Engine Size	7.3L V8	ECONOMY-RATED		Extended Warranty	
		Fleet #				Stock No	
Home		Bus				Colour	
Cell		Today				Delivery Date	
Email							
Term	CHARGE						

Request	Description	Job	CSR	Status
38	check and advise- the brakes failed, had to jump out of the truck to stop it drive shaft has been removed	1	104508	Original

Labour	Description	Type	Amount
38	check and advise- the brakes failed, had to jump out of the truck to stop it drive shaft has been removed	W	

Part	Description	Shp	Bin	Type	Price	Amount
164TP33201P6	DYE, WHITE FLOURESCENT 30ml	1	C01	W		
LC2Z 3A717 C	HOSE ASY	1		W		
4C2Z 3A719 B	HOSE ASY	1		W		
LC2Z 3A674 A	PUMP ASY - POWER STE	1		W		
CORE CHARGE	CORE CHARGE LC2Z 3A674 A	1		W		

Technician Spencer

Cause

Correction DIAG, CONFIRM NO BRAKE FEEL. HYDRO BOOST SYSTEM, PEDAL STAYS HARD AS ROCK WHEN DOING THE PEDAL TEST. POPPED HOOD TO CHECK FOR A BELT, BELT IS THERE, FLUID IS EMPTY. RE-INSTALLING DRIVE SHAFT IN THE PARKING LOT TO BRING IN, MT TIME. .6
DROVE INTO THE SHOP, NO P/S AND NO POWER ASSIST BRAKES. BUT THE BRAKES DO WORK.
PUT I THE AIR, I HAVE FLUID FROM THE HYDRO BOOST DOWN, CLEANING OFF AND RUNNING TO FIND THE LEAK WITH SOME ADDED DIE AND FLUID. LOOKS TO BE LEAKING FROM A HIGH PRESSURE LINE NEXT TO THE HYDRO BOOST AND POORING DOWN ON EVERYTHING. CHECKING PARTS. PARTS ORDERED FROM ED, BUT MISSED CUT OFF.
R&R SHORT STEEL LINE OFF THE HYDRO BOOST WITH UPDATED PARTS. R&R UPDATED HIGH PRESSURE LINE FROM PUMP TO THE STEEL LINE. FILLED AND RAN WITH NEW FLUID, I HAVE A LEAK FROM FRONT SEAL ON P/S PUMP, MOST LIKELY FROM RUNNING DRY. R&R P/S PUMP WITH NEW. SHAMPOO DOWN THE ENGINE, FILL WITH NEW FLUID AND BLEED OUT AIR IN SYSTEM. TAKE FOR A TEST DRIVE.

Request	Description	Job	CSR	Status
FPR	FORDPASS REWARDS BALANCE :	2	104508	Original
Labour	Description	Type	Amount	
FPR	FORDPASS REWARDS BALANCE :	C		0.00

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the opening and keeping of a maintenance and repair file and I also hereby authorize the dealer and his employees to collect, use and communicate to any third party, including the vehicle manufacturer and, if necessary, its affiliates and their providers of service, any personal or other information which is necessary to the constitution of the file. I further authorize, more specifically, but not limited to, the dealer and his employees, the vehicle manufacturer and, if necessary, its affiliates and their providers of service, to use said information for commercial purposes, safety recalls, surveys, customer profile updates, loyalty programs, statistics and service history and, to this end, I consent to receive phone calls, mailings, emails, or other electronic communication. This consent may be withdrawn by contacting the dealer. Moreover, I hereby authorize the repair work herein set forth and the use of the material necessary to the completion of said repair work. To the extent permitted by law you are not responsible for loss or damage to the vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by the unavailability of parts or delays in the shipment of parts by the supplier or transporter. I hereby grant you and your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing or inspection."

DISCLAIMER OF WARRANTIES: Any warranties on products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties, express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

PRIVACY STATEMENT: Personal Information is collected in accordance with applicable privacy legislation and is governed by DEARBORN FORD LTD. Privacy Policy. Ask us if you would like information about our Privacy Policy, including our service providers and their data processing in the U.S., which may be accessible to U.S. law enforcement and national security authorities. We provide this personal and transaction information to Ford Motor Company of Canada, Limited to enable Ford to administer your transaction, provide you with requested services, improve automotive related products and services by conducting customer surveys, and provide you with marketing material which may be of interest to you, as permitted by applicable laws. For the Ford Privacy Policy (www.ford.ca) including use of service providers and U.S. data storage or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

NO RETURNS ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

Customer Signature: _____ Date: _____

GST# 101309854 RT
RQ24-003 000027 ER



DEARBORN

Our Reputation is Riding With You



2555 East Trans Canada Hwy • Kamloops, BC V2C 4B1

Phn: 250-372-7101 • Fax: 250-314-5175

Toll Free: 1-800-566-7101 • www.dearbornford.com

SERVICE DEPARTMENT HOURS

Monday - Friday

7:30AM - 5:30PM

Saturday

8:00AM - 4:30PM

SO #

SERVICE ORDER

CUSTOMER COPY

Printed 07/19/2023 2:42:23 PM

User 104508 Page 2

Customer No	1041440	Advisor	Christi Armstrong	Promised	07/11/2023 5:00 PM	Tag	
		Shop	DS	Opened	07/11/2023 11:21 AM	Location	
		Priority	40	Cashiered		PO #	DF98325
LANGLEY, BC		License No		Odometer In	22901	Odometer Out	22911
		Year	2022	Make	FORD	Model	E-SERIES CUTAWAY
		Model No		Colour		Delivery Date	
		Vehicle ID No		Selling Dealer		Extended Warranty	
		Engine Size	7.3L V8	ECONOMY-RATED		Fleet #	
PST:	1014-4021						
Home		Bus					
Cell		Today					
Email							
Term	CHARGE						

Rate 164.00

Technician 999

Request	Description	Job	CSR	Status
156	NO CHARGE COURTESY SHUTTLE.** WE APOLOGIZE IN ADVANCE IF YOU HAVE TO WAIT FOR YOUR PICK UP OR DELIVERY, THIS SERVICE IS COMPLIMENTARY BUT IS ON A FIRST COME FIRST SERVE BASIS. THANK YOU FOR UNDERSTANDING.** LAST SHUTTLE LEAVES DEARBORN AT 4:30PM	3	104508	Original

Labour	Description	Type	Amount
156	NO CHARGE COURTESY SHUTTLE.** WE APOLOGIZE IN ADVANCE IF YOU HAVE TO WAIT FOR YOUR PICK UP OR DELIVERY, THIS SERVICE IS COMPLIMENTARY BUT IS ON A FIRST COME FIRST SERVE BASIS. THANK YOU FOR UNDERSTANDING.** LAST SHUTTLE LEAVES DEARBORN AT 4:30PM	C	0.00

Rate 164.00

Technician 999

Request	Description	Job	CSR	Status
MS2C	Maintenance Service Bundle #2 - Gas Engine	4	104508	Approved

Labour	Description	Type	Amount
MS2C	Maintenance Service Bundle #2 - Gas Engine	C	47.02

Part	Description	Shp	Bin	Type	Price	Amount
FL 820 S	FILTER ASY - OIL	1	N01	C1R	18.80	18.80
ENFILT	ENVIRO FEE	1	WW01	C1R	0.55	0.55
CXO 5W30 LSP6	MOTORCRAFT SAE 5W-30	8	WW01	C1R	8.31	66.48
ENOIL	ENVIRO FEE	8	WW01	C1R	0.23	1.84
FA 2042	ELEMENT ASY - AIR CL	1		C1R	45.16	45.16

stock

Rate 164.00

Technician Spencer

Cause

Parts Total 132.83

Labour Total 47.02

Request Sub-total 179.85

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the opening and keeping of a maintenance and repair file and I also hereby authorize the dealer and his employees to collect, use and communicate to any third party, including the vehicle manufacturer and, if necessary, its affiliates and their providers of service, any personal or other information which is necessary to the constitution of the file. I further authorize, more specifically, but not limited to, the dealer and his employees, the vehicle manufacturer and, if necessary, its affiliates and their providers of service, to use said information for commercial purposes, safety recalls, surveys, customer profile updates, loyalty programs, statistics and service history and, to this end, I consent to receive phone calls, mailings, emails, or other electronic communication. This consent may be withdrawn by contacting the dealer. Moreover, I hereby authorize the repair work herein set forth and the use of the material necessary to the completion of said repair work. To the extent permitted by law you are not responsible for loss or damage to the vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by the unavailability of parts or delays in the shipment of parts by the supplier or transporter. I hereby grant you and your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing or inspection."

DISCLAIMER OF WARRANTIES: Any warranties on products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties, express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

PRIVACY STATEMENT: Personal Information is collected in accordance with applicable privacy legislation and is governed by DEARBORN FORD LTD. Privacy Policy. Ask us if you would like information about our Privacy Policy, including our service providers and their data processing in the U.S., which may be accessible to U.S. law enforcement and national security authorities. We provide this personal and transaction information to Ford Motor Company of Canada, Limited to enable Ford to administer your transaction, provide you with requested services, improve automotive related products and services by conducting customer surveys, and provide you with marketing material which may be of interest to you, as permitted by applicable laws. For the Ford Privacy Policy (www.ford.ca) including use of service providers and U.S. data storage or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

NO RETURNS ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

Customer Signature: _____ Date: _____

GST# 101309854 RT
RQ24-003 000028 ER



DEARBORN

Our Reputation is Riding With You



2555 East Trans Canada Hwy • Kamloops, BC V2C 4B1

Phn: 250-372-7101 • Fax: 250-314-5175

Toll Free: 1-800-566-7101 • www.dearbornford.com

SERVICE DEPARTMENT HOURS

Monday - Friday

7:30AM - 5:30PM

Saturday

8:00AM - 4:30PM

SO #

SERVICE ORDER

CUSTOMER COPY

Printed 07/19/2023 2:42:23 PM

User 104508 Page 3

Customer No 1041440

LANGLEY, BC

PST: 1014-4021

Home

Bus

Cell

Today

Email

Term CHARGE

Advisor Christi Armstrong Promised 07/11/2023 5:00 PM Tag
Shop DS Opened 07/11/2023 11:21 AM Location
Priority 40 Cashiered PO # DF98325

License No	Odometer In	Odometer Out	InServ Date	Stock No
	22901	22911		
Year Make	Model	Model No	Colour	
2022 FORD	E-SERIES CUTAWAY	E4F		
Vehicle ID No	Selling Dealer	Extended Warranty	Delivery Date	
Engine Size	7.3L V8 ECONOMY-RATED	Fleet #		

Correction SERVICE BUNDLE 2 E450 DUALY CUBE VAN
TEST DRIVE
OIL CHANGE
INSPECTION
TOP UPS
WASHER FLUID
AIR FILTER
PRESSURES

Request	Description	Job	CSR	Status
154	DISPOSAL FEE	5	104508	Approved
Labour	Description		Type	Amount
154	DISPOSAL FEE		C	4.70
Rate	164.00			
Technician	999			
Labour Total				4.70
Request Sub-total				4.70

TOW-IN Ranveer Negi 236-259-2200 fleet manager

PLEASE REMEMBER TO HAVE YOUR TIRES RE-TORQUED

Labour	51.72
Parts	132.83
Supplies	11.00
Env Fee	5.35
SUB-TOTAL	200.90
GST	10.05
PST	0.00
TOTAL INVOICE	210.95

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the opening and keeping of a maintenance and repair file and I also hereby authorize the dealer and his employees to collect, use and communicate to any third party, including the vehicles manufacturer and, if necessary, its affiliates and their providers of service, any personal or other information which is necessary to the constitution of the file. I further authorize, more specifically, but not limited to, the dealer and his employees, the vehicles manufacturer and, if necessary, its affiliates and their providers of service, to use said information for commercial purposes, safety recalls, surveys, customer profile updates, loyalty programs, statistics and service history and, to this end, I consent to receive phone calls, mailings, emails, or other electronic communication. This consent may be withdrawn by contacting the dealer. Moreover, I hereby authorize the repair work herein set forth and the use of the material necessary to the completion of said repair work. To the extent permitted by law you are not responsible for loss or damage to the vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by the unavailability of parts or delays in the shipment of parts by the supplier or transporter. I hereby grant you and your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing or inspection."


DISCLAIMER OF WARRANTIES: Any warranties on products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties, express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

PRIVACY STATEMENT: Personal Information is collected in accordance with applicable privacy legislation and is governed by DEARBORN FORD LTD. Privacy Policy. Ask us if you would like information about our Privacy Policy, including our service providers and their data processing in the U.S., which may be accessible to U.S. law enforcement and national security authorities. We provide this personal and transaction information to Ford Motor Company of Canada, Limited to enable Ford to administer your transaction, provide you with requested services, improve automotive related products and services by conducting customer surveys, and provide you with marketing material which may be of interest to you, as permitted by applicable laws. For the Ford Privacy Policy (www.ford.ca) including use of service providers and U.S. data storage or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

NO RETURNS ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

Customer Signature: _____ Date: _____

GST# 101309854 RT
RQ24-003 000029 ER

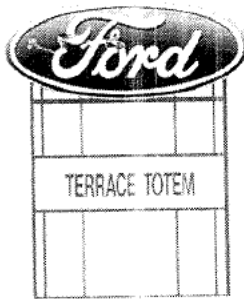

Terrace Totem Ford Sales Ltd

4631 Keith Avenue • Terrace, BC V8G 1K3
Phone: (250) 635-4984 - **Parts Direct:** (250) 635-4978
Toll Free: 1-800-463-1128 - Fax: (250) 635-2783
www.terracetotemford.ca • G.S.T. # R105178198



SO # [REDACTED]
Status

SERVICE ORDER CUSTOMER COPY

User 605 Page 1

Customer No 230051

Advisor Becky N Promised 04/05/2022 3:30 PM Tag 1ST ROW
Shop TT Opened 04/05/2022 1:23 PM Location
Priority Cashiered PO #

THORNHILL, BC [REDACTED]

License No Odometer In Odometer Out InServ Date Stock No
6841 6841
Year Make Model Model No Colour
2022 FORD E-SERIES CUTAWAY E4F
Vehicle ID No Selling Dealer Extended Warranty Delivery Date
Engine Size 7.3L V8 ECONOMY-RATED Fleet # 176340

Home Bus
Cell Today
Email
Fleet Type
Term CHARGE

Request	Description	Job	CSR	Status
RCL	RECALL 22S08 -HYDROBOOST OR HYDROMAX POWER STEERING PRESSURE LINE INSPECTION	1	605	Original
Labour	Description	Type	Hours	Amount
22S08A	RECALL 22S08 -Inspect power steering connection - PASS	W	0.00	
Technician	656 -			
Cause	Completed recall 22S08A- inspect pressure line- lines pass inspection			
Correction	656			

Parts Total	0.00
Labour Total	0.00
Request Total	0.00
Labour	0.00
Parts	0.00
Supplies	0.00
SUB-TOTAL	0.00
GST	0.00
PST	0.00
TOTAL INVOICE	0.00

****Wheels need to be retorqued after 100 km if they were removed during your service. Please return to us and we will do this at no charge****

PRIVACY STATEMENT: Privacy. Personal information is collected in accordance with the applicable privacy legislation and is governed by TERRACE TOTEM FORD privacy policy. Your privacy is important to us. Ask us if you would like information about our Privacy Policy, including our service providers and their data processing in the U.S., which may be accessible to U.S. law enforcement and national security authorities. We provide this personal and transaction information to Ford Motor Company of Canada, Limited to enable Ford to administer your transaction, provide you with requested services, improve automotive related products and services by conducting customer surveys, and provide you with marketing material which may be of interest to you, as permitted by applicable laws. For the Ford Privacy Policy (www.ford.ca) including use of service providers and U.S. data storage or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

Thank You For Allowing Us To Service Your Vehicle

Were you completely satisfied?* (Int'l) Customer Signature: Date:

From: Stanley, Daniel (D.J.)
Sent: Friday, March 11, 2022 1:38 PM
To: Beyer, Laura (L.D.); Ott, David (D.J.); Puleri, Michael (M.J.); Avila Magana, Luis Ricardo (LA.); Buelow, Steve (S.E.); Willard, Jeremy (J.); McCall, Kris (K.J.)
Cc: Boehk, Karen (K.S.)
Subject: RE: 21-282 (FSA 22S08) E-Series Hydroboost Line Leaks

Sensitivity: Private

Was a follow-up scheduled for this concern after Steve Buelow or Kris McCall had a chance to speak with the service technician's at the Delemonte Fleet?

Daniel J. Stanley

Critical Concern Engineering

Design Assurance

Vehicle Component & System Engineering (VCSE)

Ford Motor Company

Dstanle1@ford.com

PDC 2CE30

313.805.9717

-----Original Appointment-----

From: Beyer, Laura (L.D.) <lbeyer4@ford.com>

Sent: Thursday, March 3, 2022 3:17 PM

To: Beyer, Laura (L.D.); Ott, David (D.J.); Puleri, Michael (M.J.); Avila Magana, Luis Ricardo (LA.); Stanley, Daniel (D.J.); Buelow, Steve (S.E.); Willard, Jeremy (J.); McCall, Kris (K.J.)

Cc: Boehk, Karen (K.S.)

Subject: 21-282 (FSA 22S08) E-Series Hydroboost Line Leaks

When: Thursday, March 3, 2022 4:45 PM-5:15 PM (UTC-05:00) Eastern Time (US & Canada).

Where: WebEx

Importance: High

Sensitivity: Private

Discuss failures after inspection for 22S08.

Laura Beyer

Safety Investigations/CCRG - Truck Programs

Automotive Safety Office

Ford Motor Company

(313) 316-7026 (mobile)

~~~~~

-- Do not delete or change any of the following text. --

## Join Meeting

Meeting number (access code): 2332 677 8299 Meeting password: qEr9GV5T9rP

**Tap to join from a mobile device (attendees only)**

+1-313-248-3668,,23326778299## FordNet 248-3668 / Toll

**Join by phone**

+1-313-248-3668 FordNet 248-3668 / Toll

[Global call-in numbers](#) | [Toll-free calling restrictions](#)

**Join from a video system or application**

Dial [23326778299@ford.webex.com](mailto:23326778299@ford.webex.com)

You can also dial 173.243.2.68 and enter your meeting number.

If you are a host, [click here](#) to view host information.

**NOTICE: Protecting and Properly Using Company Assets: We are careful not to disclose Ford information, even accidentally. If we share non-public information outside of Ford, we follow applicable procedures and obtain proper approvals and ensure appropriate confidentiality agreements are in place. · We follow Ford's information and records retention protocols and programs. · We do not destroy information if there is a legal requirement to maintain it, such as a suspension order or other litigation hold .**

**For company policies on recording: [click here](#)**

For additional help with WebEx, Ford users can click on the Digital Worker link: [WebEx Support](#)

Can't join the meeting? [Contact support](#).

T32MC04

| EQ Record ID | Source Code | Commodity(ies)            | Symptoms                     | Significant Events     | Alleged Fire Type | Alleged Fire Location | Alleged Fire Damage | Verified | Source Claim Key | VOQ ODI Number | Warranty Component Classification (WCC) | Corporate Product Systems Classification (CPSC) | Time In Service | Customer Concern Code | V Function Group (VFG) | Version Series Code | Source System Program Type | Repair/Report/Paid Date |
|--------------|-------------|---------------------------|------------------------------|------------------------|-------------------|-----------------------|---------------------|----------|------------------|----------------|-----------------------------------------|-------------------------------------------------|-----------------|-----------------------|------------------------|---------------------|----------------------------|-------------------------|
|              | VOQ Ford    | chassis;service           | damage;field service         |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 5/7/2022                |
|              | VOQ Ford    | brakes;booster/hydroboo   | action;function-             |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 5/7/2022                |
|              | VOQ Ford    | chassis;steering;steering | damage;field service         |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 9/6/2022                |
|              | VOQ Ford    | chassis;service           | field service                |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 7/1/2022                |
|              | VOQ Ford    | brakes;booster/hydroboo   | action;function-             |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 5/7/2022                |
|              | VOQ Ford    | chassis;steering;steering | damage;field service         |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 9/6/2022                |
|              | VOQ Ford    | chassis;service           | field service                |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 7/10/2023               |
|              | VOQ Ford    | brakes;booster/hydroboo   | action;function-             |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 8/10/2022               |
|              | FMMS/LMMS   | chassis;service           | function-                    |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            |                         |
|              | FMMS/LMMS   | brakes;brake lines/hoses  | malfunction/inoperative;     | property damage; fire; | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 3/7/2020                |
|              | FMMS/LMMS   | chassis;steering;steering | fire                         |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     | H                          | 10/2/2020               |
|              | GQJIS Ford  | chassis;service           | damage;fire;function-        | fire;                  | Smoke             | Under Vehicle         | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 1/5/2021                |
|              | GQJIS Ford  | brakes;abs;brake          | operates too                 |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     | H                          | 4/8/2021                |
|              | GQJIS Ford  | chassis;service           | damage;drag;function-        |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 4/6/2022                |
|              | GQJIS Ford  | brakes;booster/hydroboo   | malfunction/inoperative;     |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     | L                          | 4/22/2021               |
|              | GQJIS Ford  | chassis;steering;steering | air in system ;function-     |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 12/3/2021               |
|              | GQJIS Ford  | gear/rack;steering        | malfunction/inoperative;     |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 5/16/2022               |
|              | GQJIS Ford  | chassis;service           | high effort;leak-            |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 1/27/2023               |
|              | GQJIS Ford  | brakes;brake              | fluid;pedal concerns-        |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 1               |                       |                        |                     |                            | 5/20/2022               |
|              | GQJIS Ford  | chassis;service           | field service action         |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 5/18/2022               |
|              | GQJIS Ford  | brakes;booster/hydroboo   | leak-fluid                   |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 5/30/2023               |
|              | GQJIS Ford  | chassis;steering;steering | lines/hoses                  |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 2               |                       |                        |                     |                            | 6/1/2021                |
|              | GQJIS Ford  | chassis;steering;steering | air in system ;damage-       |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 8               |                       |                        |                     |                            | 6/11/2021               |
|              | GQJIS Ford  | chassis;steering;steering | cracked/fractured/split;     |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 7/1/2021                |
|              | GQJIS Ford  | chassis;steering;steering | field service action         |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 27              |                       |                        |                     |                            | 7/8/2021                |
|              | GQJIS Ford  | brakes;booster/hydroboo   | field service action         |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 18              |                       |                        |                     |                            | 7/29/2021               |
|              | GQJIS Ford  | chassis;service           | misaligned/out of            |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 15              |                       |                        |                     |                            | 8/31/2022               |
|              | GQJIS Ford  | brakes;booster/hydroboo   | position/adjustment/poo      |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 15              |                       |                        |                     |                            | 9/29/2022               |
|              | GQJIS Ford  | chassis;service           | field service                |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 20              |                       |                        |                     |                            | 5/12/2023               |
|              | GQJIS Ford  | brakes;booster/hydroboo   | action;function-             |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 18              |                       |                        |                     |                            | 5/23/2022               |
|              | GQJIS Ford  | chassis;steering;steering | function-                    |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 8/4/2021                |
|              | GQJIS Ford  | brakes;abs;brake          | malfunction/inoperative;     |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 8/5/2021                |
|              | GQJIS Ford  | chassis;steering;steering | function-                    |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 8/6/2021                |
|              | GQJIS Ford  | chassis;service           | malfunction/inoperative;     |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 9/9/2021                |
|              | GQJIS Ford  | brakes;abs;brake          | malfunction/inoperative;     |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 10/22/2021              |
|              | GQJIS Ford  | chassis;steering;steering | damage-                      |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 12/1/2021               |
|              | GQJIS Ford  | lines/hoses;steering      | bent/buckled/kinked;dam      |                        | None of the Above | Unknown               | Unknown             | Y        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 2/2/2022                |
|              | GQJIS Ford  | chassis;steering;steering | function-                    |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 11/25/2022              |
|              | GQJIS Ford  | lines/hoses;steering      | malfunction/inoperative      |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 2/15/2023               |
|              | GQJIS Ford  | chassis;service           | air in system ;air in system |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 8/7/2020                |
|              | GQJIS Ford  | brakes;abs;brake          | damage-                      |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 10/16/2020              |
|              | GQJIS Ford  | chassis;steering;steering | administrative               |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 11/20/2020              |
|              | GQJIS Ford  | lines/hoses               | cost;damage-                 |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            | 12/1/2020               |
|              | GQJIS Ford  | chassis;service           | air in system                |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            |                         |
|              | GQJIS Ford  | brakes;brake              | contaminated/foreign;fu      |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            |                         |
|              | GQJIS Ford  | chassis;steering;steering | function-                    |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            |                         |
|              | GQJIS Ford  | lines/hoses               | malfunction/inoperative;l    |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            |                         |
|              | GQJIS Ford  | chassis;steering;steering | no keyword found             |                        | None of the Above | Unknown               | Unknown             | N        |                  |                |                                         |                                                 | 0               |                       |                        |                     |                            |                         |

|             |                                                 |                                                       |                   |            |                        |   |   |            |
|-------------|-------------------------------------------------|-------------------------------------------------------|-------------------|------------|------------------------|---|---|------------|
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | administrative cost;damage-                           | None of the Above | Unknown    | Unknown                | Y | 0 | 1/5/2021   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | appearance-scratches/nicks;damage-                    | None of the Above | Unknown    | Unknown                | N | 0 | 1/27/2021  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | cost;appearance-function-malfunction/inoperative;     | None of the Above | Unknown    | Unknown                | N | 0 | 4/1/2021   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | malfunction/inoperative; damage-                      | None of the Above | Unknown    | Unknown                | N | 0 | 4/2/2021   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses;steering  | damage-grooved/scored;field                           | None of the Above | Unknown    | Unknown                | N | 0 | 3/30/2021  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | damage;function-malfunction/inoperative;              | None of the Above | Unknown    | Unknown                | Y | 0 | 6/7/2021   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | function-malfunction/inoperative;                     | None of the Above | Unknown    | Unknown                | N | 0 | 4/15/2021  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses;steering  | administrative cost;air in system ;damage-            | None of the Above | Unknown    | Unknown                | Y | 0 | 6/16/2021  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses;steering  | administrative                                        | None of the Above | Unknown    | Unknown                | N | 0 | 6/22/2021  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses;steering  | cost;damage;damage-                                   | None of the Above | Unknown    | Unknown                | N | 0 | 7/6/2021   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses;steering  | damage-cracked/fractured/split;ej                     | None of the Above | Unknown    | Unknown                | Y | 0 | 5/24/2021  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses;steering  | appearance;appearance-scratches/nicks;damage;         | None of the Above | Unknown    | Unknown                | N | 0 | 8/2/2021   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses;steering  | administrative cost;damage;damage-                    | None of the Above | Unknown    | Unknown                | N | 0 | 7/1/2021   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | administrative cost;appearance-                       | None of the Above | Unknown    | Unknown                | Y | 0 | 8/5/2021   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses;steering  | administrative cost;corroded/rusted;da                | None of the Above | Unknown    | Unknown                | N | 0 | 8/19/2021  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | administrative cost;damage-                           | None of the Above | Unknown    | Unknown                | Y | 0 | 11/6/2021  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | cost;function-                                        | None of the Above | Unknown    | Unknown                | N | 0 | 12/29/2021 |
| GCCT\FMC360 | chassis;steering;steering gear/rack;steering    | field service action;function-                        | None of the Above | Unknown    | Unknown                | N | 0 | 11/22/2021 |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | administrative cost;damage-                           | None of the Above | Unknown    | Unknown                | N | 0 | 3/7/2022   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | field service action;function-                        | None of the Above | Unknown    | Unknown                | Y | 0 | 3/24/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | field service action;mod-driving condition-while      | None of the Above | Unknown    | Unknown                | N | 0 | 3/25/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | air in system ;damage-cracked/fractured/split;fi      | None of the Above | Unknown    | Unknown                | N | 0 | 4/1/2022   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | field service action;function-                        | None of the Above | Unknown    | Unknown                | N | 0 | 1/14/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | administrative cost;damage;function-                  | None of the Above | Unknown    | Unknown                | N | 0 | 4/1/2022   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | field service action;function-                        | None of the Above | Unknown    | Unknown                | N | 0 | 3/22/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | field service action;function-                        | None of the Above | Unknown    | Unknown                | N | 0 | 4/4/2022   |
| GCCT\FMC360 | powertrain;engine;chassis;service               | field service action;fluid level-insufficient         | None of the Above | Unknown    | Unknown                | N | 0 | 3/28/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | administrative cost;field service action;function-    | None of the Above | Unknown    | Unknown                | N | 0 | 4/11/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | field service action;function-                        | None of the Above | Unknown    | Unknown                | N | 0 | 5/4/2022   |
| GCCT\FMC360 | chassis;service brakes;booster/hydroboo         | damage;function-malfunction/inoperative;              | None of the Above | Unknown    | Unknown                | N | 0 | 4/12/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | field service action;function-                        | None of the Above | Unknown    | Unknown                | N | 0 | 5/5/2022   |
| GCCT\FMC360 | powertrain;engine;cylinder                      | damage;damage-grooved/scored;engine                   | None of the Above | Unknown    | Unknown                | N | 0 | 6/7/2022   |
| GCCT\FMC360 | unknown;chassis;service brakes;booster/hydroboo | field service action;function-                        | None of the Above | Unknown    | Unknown                | N | 0 | 6/27/2022  |
| GCCT\FMC360 | powertrain;engine;electrical;start-             | appearance-chipped;damage-                            | None of the Above | Unknown    | Unknown                | N | 0 | 5/31/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | appearance-scratches/nicks;field                      | None of the Above | Unknown    | Unknown                | Y | 0 | 6/9/2022   |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | administrative cost;field service action;fluid level- | None of the Above | Unknown    | Unknown                | N | 0 | 8/18/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | field service action;mod-driving condition-while      | None of the Above | Unknown    | Unknown                | N | 0 | 7/21/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | damage-grooved/scored;field                           | None of the Above | Unknown    | Unknown                | N | 0 | 7/21/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | damage-grooved/scored;field                           | None of the Above | Unknown    | Unknown                | N | 0 | 8/20/2022  |
| GCCT\FMC360 | unknown;chassis;service brakes;booster/hydroboo | field service action;mod-aftermarket                  | None of the Above | Unknown    | Unknown                | N | 0 | 8/23/2022  |
| GCCT\FMC360 | unknown;chassis;steering ;service               | field service action;function-                        | None of the Above | Unknown    | Unknown                | N | 0 | 8/24/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | field service action;mod-driving condition-while      | None of the Above | Unknown    | Unknown                | Y | 0 | 8/24/2022  |
| GCCT\FMC360 | unknown;chassis;driveshaft                      | administrative cost;field service action;function-    | None of the Above | Unknown    | Unknown                | Y | 0 | 8/10/2022  |
| GCCT\FMC360 | chassis;service brakes;brake lines/hoses        | administrative cost;field fire; service               | Melt / Burnt      | Under Hood | Localized to Component | Y | 0 | 9/8/2022   |
| GCCT\FMC360 | chassis;service brakes;brake lines/hoses        | damage-chafed/excessive                               | None of the Above | Unknown    | Unknown                | N | 0 | 10/12/2022 |
| GCCT\FMC360 | chassis;steering;steering lines/hoses           | damage-grooved/scored;field                           | None of the Above | Unknown    | Unknown                | N | 0 |            |

|             |                                                    |                                                          |                   |         |         |   |        |      |  |    |     |     |  |            |
|-------------|----------------------------------------------------|----------------------------------------------------------|-------------------|---------|---------|---|--------|------|--|----|-----|-----|--|------------|
| GCCT\FMC360 | chassis;steering;steering lines/hoses              | administrative cost;damage;damage-                       | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 12/9/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses              | field service action;leak-                               | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 12/13/2022 |
| GCCT\FMC360 | chassis;steering;steering lines/hoses;steering     | fluid;mod-driving mod-codes found;no                     | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 12/15/2022 |
| GCCT\FMC360 | lines/hoses;steering                               | keyword                                                  | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 12/2/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses              | circuit-poor contact;poor ground;circuit-                | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 12/7/2022  |
| GCCT\FMC360 | chassis;steering;steering lines/hoses              | damage- bent;buckled;kinked;field                        | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 3/22/2023  |
| GCCT\FMC360 | chassis;service                                    | administrative cost;circuit-poor                         | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 5/11/2023  |
| GCCT\FMC360 | brakes;abs;booster/hydr powertrain;transmission;   | damage- grooved/scored;field                             | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 5/24/2023  |
| GCCT\FMC360 | automatic;unknown;chas chassis;steering;steering   | damage- grooved/scored;field                             | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 7/11/2023  |
| GCCT\FMC360 | lines/hoses;steering                               | corroded/rusted;damage-                                  | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 8/3/2023   |
| GCCT\FMC360 | chassis;service                                    | chafed/excessive damage- grooved/scored;field            | None of the Above | Unknown | Unknown | Y |        |      |  | 0  |     |     |  | 8/10/2023  |
| GCCT\FMC360 | brakes;booster/hydroboo unknown;chassis;steering   | chafed/excessive administrative cost;damage-             | None of the Above | Unknown | Unknown | N |        |      |  | 0  |     |     |  | 7/27/2023  |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | function- malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 1  | L68 | V87 |  | 6/26/2020  |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | air in system ;damage;damage-                            | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 0  | L68 | V87 |  | 7/1/2020   |
| GSAR\AWS    | chassis;service                                    | air in system;air in system ;damage-                     | None of the Above | Unknown | Unknown | N | "5V05" |      |  | 1  | L63 | V21 |  | 7/7/2020   |
| GSAR\AWS    | brakes;abs;brake                                   | function- malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 0  | L68 | V87 |  | 7/9/2020   |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | damage- terminal/connector;field                         | None of the Above | Unknown | Unknown | N | " "    | "99" |  | 7  | *   | V00 |  | 5/5/2022   |
| GSAR\AWS    | brakes;booster/hydroboo chassis;steering;steering  | flaw in material ;function- malfunction/inoperative;     | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 5  | H50 | V87 |  | 7/24/2020  |
| GSAR\AWS    | lines/hoses                                        | fluid level-insufficient                                 | None of the Above | Unknown | Unknown | N | "5V05" |      |  | 0  | L63 | V21 |  | 7/29/2020  |
| GSAR\AWS    | chassis;service                                    | brakes;brake lines/hoses fluid;function-                 | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 1  | L68 | V87 |  | 8/4/2020   |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | air in system ;function- malfunction/inoperative;i       | None of the Above | Unknown | Unknown | N | " "    | "99" |  | 10 | *   | V00 |  | 11/11/2022 |
| GSAR\AWS    | body;llocks;latches;chassis;service                | field service action;latching- does not                  | None of the Above | Unknown | Unknown | N | "5Q02" | "05" |  | 7  | L63 | V21 |  | 8/14/2020  |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | administrative cost;function- damage-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 5  | L68 | V87 |  | 8/19/2020  |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | cracked/fractured/split;f                                | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 2  | L68 | V87 |  | 8/21/2020  |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | function- malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5V05" | "05" |  | 2  | L63 | V21 |  | 8/24/2020  |
| GSAR\AWS    | chassis;service                                    | function- malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 2  | L68 | V87 |  | 8/24/2020  |
| GSAR\AWS    | brakes;brake lines/hoses chassis;steering;steering | function- malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | " "    | "99" |  | 10 | *   | V00 |  | 11/14/2022 |
| GSAR\AWS    | lines/hoses                                        | calibration-issue/re-                                    | None of the Above | Unknown | Unknown | N | "5V07" |      |  | 1  | L63 | V21 |  | 8/27/2020  |
| GSAR\AWS    | chassis;service                                    | flash;field service flaw in material;function-           | None of the Above | Unknown | Unknown | N | " "    | "99" |  | 28 | *   | V00 |  | 12/1/2022  |
| GSAR\AWS    | brakes;booster/hydroboo chassis;steering;steering  | malfunction/inoperative;i                                | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 1  | L68 | V87 |  | 9/4/2020   |
| GSAR\AWS    | chassis;service                                    | field service action;function-                           | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 0  | L68 | V87 |  | 10/1/2021  |
| GSAR\AWS    | brakes;booster/hydroboo chassis;steering;steering  | function- malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 3  | L68 | V87 |  | 9/29/2020  |
| GSAR\AWS    | lines/hoses                                        | air in system ;damage- cracked/fractured/split;f         | None of the Above | Unknown | Unknown | N | " "    | "99" |  | 0  | *   | V00 |  | 3/21/2022  |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | fluid level-insufficient                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 7  | L68 | V87 |  | 2/14/2022  |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | damage- terminal/connector;field                         | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 10 | A99 | V99 |  | 5/19/2022  |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | function- malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 1  | L68 | V87 |  | 10/21/2020 |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | action;function- damage-                                 | None of the Above | Unknown | Unknown | N | "5Q02" | "05" |  | 3  | L68 | V87 |  | 10/26/2020 |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | terminal/connector;funct                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 3  | L68 | V87 |  | 10/29/2020 |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | fluid level-insufficient                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 4  | L68 | V87 |  | 11/6/2020  |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | fluid;function-                                          | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 4  | L68 | V87 |  | 11/10/2020 |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | fluid level-insufficient                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 1  | L68 | V87 |  | 11/10/2020 |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | flaw in material ;function- malfunction/inoperative;i    | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 0  | L68 | V87 |  | 11/11/2020 |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | air in system ;fluid level- insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5V05" | "05" |  | 4  | L68 | V87 |  | 11/14/2020 |
| GSAR\AWS    | chassis;service                                    | air in system ;circuit-poor contact/poor                 | None of the Above | Unknown | Unknown | N | "5V05" | "05" |  | 3  | L63 | V21 |  | 11/16/2020 |
| GSAR\AWS    | brakes;booster/hydroboo chassis;steering;steering  | function- malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 4  | L68 | V87 |  | 11/16/2020 |
| GSAR\AWS    | lines/hoses                                        | air in system ;air in system;fluid level-                | None of the Above | Unknown | Unknown | N | "5V05" | "05" |  | 3  | L63 | V21 |  | 11/16/2020 |
| GSAR\AWS    | chassis;service                                    | brakes;brake                                             | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 4  | L68 | V87 |  | 11/16/2020 |
| GSAR\AWS    | chassis;steering;steering lines/hoses              | function- malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      |  | 4  | L68 | V87 |  | 11/16/2020 |

|          |                           |                              |                   |         |         |   |        |    |      |     |            |
|----------|---------------------------|------------------------------|-------------------|---------|---------|---|--------|----|------|-----|------------|
| GSAR\AWS | chassis;service           | damage-                      | None of the Above | Unknown | Unknown | N | "5V07" | 3  | L63  | V21 | 11/16/2020 |
| GSAR\AWS | brakes;booster/hydroboo   | cut/torn/frayed;function-    | None of the Above | Unknown | Unknown | N | "5V07" | 5  | H20  | V21 | 11/23/2020 |
| GSAR\AWS | chassis;service           | function-                    | None of the Above | Unknown | Unknown | N | "5V07" | 22 | "99" | *   | 4/1/2022   |
| GSAR\AWS | brakes;booster/hydroboo   | malfunction/inoperative      | None of the Above | Unknown | Unknown | N | "5V07" | 17 | A99  | V99 | 4/25/2022  |
| GSAR\AWS | chassis;service           | field service action         | None of the Above | Unknown | Unknown | N | "5V07" | 1  | H19  | V21 | 12/7/2020  |
| GSAR\AWS | chassis;service           | field service                | None of the Above | Unknown | Unknown | N | "5Q02" | 1  | L68  | V87 | 12/8/2020  |
| GSAR\AWS | brakes;booster/hydroboo   | flash;mod-indicator          | None of the Above | Unknown | Unknown | N | "5Q02" | 2  | L68  | V87 | 12/10/2020 |
| GSAR\AWS | chassis;steering;steering | air in system ;function-     | None of the Above | Unknown | Unknown | N | "5Q02" | 3  | L68  | V87 | 11/9/2020  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    | None of the Above | Unknown | Unknown | N | "5Q02" | 8  | A99  | V99 | 12/5/2022  |
| GSAR\AWS | chassis;steering;steering | function-                    | None of the Above | Unknown | Unknown | N | "5V07" | 6  | H05  | V21 | 12/21/2020 |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    | None of the Above | Unknown | Unknown | N | "5V07" | 14 | "99" | *   | 11/2/2022  |
| GSAR\AWS | chassis;steering;steering | fluid level-insufficient     | None of the Above | Unknown | Unknown | N | "5Q02" | 3  | L68  | V87 | 12/29/2020 |
| GSAR\AWS | lines/hoses               | fluid;function-              | None of the Above | Unknown | Unknown | N | "5Q02" | 1  | L68  | V87 | 12/30/2020 |
| GSAR\AWS | chassis;suspension;servic | field service                | None of the Above | Unknown | Unknown | N | "5Q02" | 4  | L68  | V87 | 12/31/2020 |
| GSAR\AWS | e                         | action;function-             | None of the Above | Unknown | Unknown | N | "5Q02" | 7  | L68  | V87 | 1/7/2021   |
| GSAR\AWS | chassis;service           | damage-                      | None of the Above | Unknown | Unknown | N | "5Q02" | 10 | L68  | V87 | 1/8/2021   |
| GSAR\AWS | brakes;booster/hydroboo   | cut/torn/frayed;function-    | None of the Above | Unknown | Unknown | N | "5Q02" | 3  | L68  | V87 | 1/10/2021  |
| GSAR\AWS | chassis;service           | field service action         | None of the Above | Unknown | Unknown | N | "5Q02" | 0  | L63  | V21 | 1/11/2021  |
| GSAR\AWS | brakes;booster/hydroboo   | air in system ;fluid level-  | None of the Above | Unknown | Unknown | N | "5Q02" | 4  | L68  | V87 | 1/11/2021  |
| GSAR\AWS | chassis;steering;steering | insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5Q02" | 0  | L68  | V87 | 1/11/2021  |
| GSAR\AWS | lines/hoses               | damaged-                     | None of the Above | Unknown | Unknown | N | "5Q02" | 20 | L68  | V87 | 4/21/2023  |
| GSAR\AWS | chassis;steering;steering | cracked/fractured/split;l    | None of the Above | Unknown | Unknown | N | "5Q02" | 5  | L63  | V21 | 1/12/2021  |
| GSAR\AWS | lines/hoses               | damaged-                     | None of the Above | Unknown | Unknown | N | "5Q02" | 3  | L68  | V87 | 1/13/2021  |
| GSAR\AWS | chassis;steering;steering | cracked/fractured/split;l    | None of the Above | Unknown | Unknown | N | "5Q02" | 16 | "99" | *   | 9/16/2022  |
| GSAR\AWS | lines/hoses               | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" | 4  | H15  | V21 | 1/18/2021  |
| GSAR\AWS | chassis;steering;steering | malfunction/inoperative;     | None of the Above | Unknown | Unknown | N | "5Q02" | 1  | L68  | V87 | 1/19/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    | None of the Above | Unknown | Unknown | N | "5Q02" | 1  | L68  | V87 | 1/19/2021  |
| GSAR\AWS | chassis;steering;steering | terminal;connector;field     | None of the Above | Unknown | Unknown | N | "5Q02" | 4  | L63  | V21 | 1/20/2021  |
| GSAR\AWS | lines/hoses               | incorrect size;leak-failed   | None of the Above | Unknown | Unknown | N | "5Q02" | 5  | L68  | V87 | 1/20/2021  |
| GSAR\AWS | chassis;service           | gasket/seal/weatherstrip;    | None of the Above | Unknown | Unknown | N | "5Q02" | 0  | L68  | V87 | 1/26/2021  |
| GSAR\AWS | brakes;booster/hydroboo   | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" | 21 | "99" | *   | 6/15/2023  |
| GSAR\AWS | chassis;service           | malfunction/inoperative;l    | None of the Above | Unknown | Unknown | N | "5Q02" | 22 | L68  | V87 | 6/29/2023  |
| GSAR\AWS | brakes;booster/hydroboo   | field service                | None of the Above | Unknown | Unknown | N | "5Q02" | 0  | L63  | V21 | 2/2/2021   |
| GSAR\AWS | chassis;steering;steering | action;function-             | None of the Above | Unknown | Unknown | N | "5Q02" | 7  | H05  | V21 | 2/2/2021   |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    | None of the Above | Unknown | Unknown | N | "5Q02" | 1  | L68  | V87 | 2/3/2021   |
| GSAR\AWS | chassis;steering;steering | damaged-                     | None of the Above | Unknown | Unknown | N | "5Q02" | 18 | "99" | *   | 3/2/2022   |
| GSAR\AWS | lines/hoses               | gasket/seal/weatherstrip;    | None of the Above | Unknown | Unknown | N | "5Q02" | 7  | H50  | V87 | 2/9/2021   |
| GSAR\AWS | chassis;service           | field service                | None of the Above | Unknown | Unknown | N | "5Q02" | 18 | "99" | *   | 3/2/2022   |
| GSAR\AWS | brakes;booster/hydroboo   | action;function-             | None of the Above | Unknown | Unknown | N | "5Q02" | 7  | A99  | V99 | 6/8/2022   |
| GSAR\AWS | chassis;steering;steering | malfunction/inoperative;l    | None of the Above | Unknown | Unknown | N | "5Q02" | 7  | A99  | V99 | 6/8/2022   |
| GSAR\AWS | lines/hoses               | damaged-                     | None of the Above | Unknown | Unknown | N | "5Q02" | 13 | L68  | V87 | 2/18/2021  |
| GSAR\AWS | chassis;steering;steering | air in system ;function-     | None of the Above | Unknown | Unknown | N | "5Q02" | 4  | L68  | V87 | 2/22/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    | None of the Above | Unknown | Unknown | N | "5Q02" | 0  | L68  | V87 | 2/23/2021  |
| GSAR\AWS | chassis;steering;steering | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" | 3  | L68  | V87 | 2/24/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    | None of the Above | Unknown | Unknown | N | "5Q02" | 0  | L68  | V87 | 2/24/2021  |
| GSAR\AWS | chassis;steering;steering | air in system ;fluid level-  | None of the Above | Unknown | Unknown | N | "5Q02" | 0  | L68  | V87 | 2/24/2021  |
| GSAR\AWS | lines/hoses               | insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5Q02" | 0  | L68  | V87 | 2/24/2021  |

|          |                                         |                                                         |                   |         |         |   |        |        |      |     |     |            |           |
|----------|-----------------------------------------|---------------------------------------------------------|-------------------|---------|---------|---|--------|--------|------|-----|-----|------------|-----------|
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 2/24/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N |        | "5Q02" | 2    | L68 | V87 | 2/25/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;fl                       | None of the Above | Unknown | Unknown | N |        | "5Q02" | 3    | L68 | V87 | 2/26/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;d                        | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 2/25/2021  |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | air in system ;damage-cracked/fractured/split;f         | None of the Above | Unknown | Unknown | N |        | "5Q02" | 4    | L68 | V87 | 2/26/2021  |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action                                    | None of the Above | Unknown | Unknown | N | "** "  | "99"   | 13   | *   | V00 | 3/31/2022  |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | calibration-issue/re-flash;mod-codes                    | None of the Above | Unknown | Unknown | N |        | "5V07" | "05" | 6   | H19 | V21        | 3/1/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 3/2/2021   |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N |        | "5Q02" | 2    | L68 | V87 | 3/4/2021   |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;ejected/blown out under                  | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 3/5/2021   |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;f                        | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 3/5/2021   |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N |        | "5Q02" | "05" | 4   | L68 | V87        | 3/5/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 3/8/2021   |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;fluid level-insufficient fluid;function- | None of the Above | Unknown | Unknown | N |        | "5Q02" | 18   | L68 | V87 | 9/2/2022   |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | air in system ;fluid level-insufficient fluid;function- | None of the Above | Unknown | Unknown | N |        | "5V07" | 10   | L63 | V21 | 3/10/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage;damage-cracked/fractured/split;f                 | None of the Above | Unknown | Unknown | N |        | "5Q02" | 7    | L68 | V87 | 12/8/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N |        | "5Q02" | 2    | L68 | V87 | 3/10/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N |        | "5Q02" | 3    | L68 | V87 | 3/11/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage;damage-cracked/fractured/split;f                 | None of the Above | Unknown | Unknown | N |        | "5Q02" | "28" | 1   | L68 | V87        | 3/11/2021 |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action                                    | None of the Above | Unknown | Unknown | N | "** "  | "99"   | 15   | *   | V00 | 5/26/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N |        | "5Q02" | 5    | L68 | V87 | 3/11/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage;damage-cracked/fractured/split;f                 | None of the Above | Unknown | Unknown | N |        | "5Q02" | "28" | 3   | L68 | V87        | 3/12/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N |        | "5Q02" | "28" | 5   | L68 | V87        | 3/17/2021 |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action;function-                          | None of the Above | Unknown | Unknown | N | "** "  | "99"   | 7    | *   | V00 | 2/28/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;f                        | None of the Above | Unknown | Unknown | N |        | "5Q02" | 3    | L68 | V87 | 3/19/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;flaw in material ;fluid level-           | None of the Above | Unknown | Unknown | N |        | "5Q02" | 4    | L68 | V87 | 3/25/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 3/25/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;damage;fluid level-                      | None of the Above | Unknown | Unknown | N |        | "5Q02" | 6    | L68 | V87 | 2/28/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N |        | "5Q02" | "28" | 9   | L68 | V87        | 3/26/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-threads stripped/crossthreaded;fi                | None of the Above | Unknown | Unknown | N | "** "  | "99"   | 7    | *   | V00 | 4/28/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N |        | "5Q02" | 12   | L68 | V87 | 10/14/2022 |           |
| GSAR\AWS | chassis;service brakes;abs;brake        | damage-bent/buckled/kinked;func                         | None of the Above | Unknown | Unknown | N | "5G88" | "05"   | 0    | H05 | V21 | 3/30/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 3/30/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 3/30/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N |        | "5Q02" | 4    | L68 | V87 | 3/31/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N |        | "5Q02" | 4    | L68 | V87 | 3/31/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 4/1/2021   |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;damage-cracked/fractured/split;fl        | None of the Above | Unknown | Unknown | N |        | "5Q02" | 0    | L68 | V87 | 4/1/2021   |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;f                        | None of the Above | Unknown | Unknown | N |        | "5Q02" | 4    | L68 | V87 | 10/7/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N |        | "5Q02" | 3    | L68 | V87 | 4/2/2021   |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | adhesive/sealer failure/missing;air in                  | None of the Above | Unknown | Unknown | N |        | "5Q02" | 3    | L68 | V87 | 4/5/2021   |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N |        | "5Q02" | 1    | L68 | V87 | 4/7/2021   |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action                                    | None of the Above | Unknown | Unknown | N | "** "  | "99"   | 11   | *   | V00 | 4/21/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N |        | "5Q02" | "05" | 3   | L68 | V87        | 4/7/2021  |

|          |                                                    |                                                         |                   |         |         |   |        |      |    |     |     |            |
|----------|----------------------------------------------------|---------------------------------------------------------|-------------------|---------|---------|---|--------|------|----|-----|-----|------------|
| GSAR\AWS | chassis;steering;steering lines/hoses              | air in system ;damage;damage-                           | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 0  | L68 | V87 | 4/7/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses              | air in system ;function-malfunction/inoperative;l       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 4/9/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses              | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 4/9/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses;powertrain;e | field service action                                    | None of the Above | Unknown | Unknown | N | "* "   | "99" | 28 | *   | V00 | 6/30/2022  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | damage-cracked/fractured/split;fl                       | None of the Above | Unknown | Unknown | N | "5V07" | "05" | 4  | H19 | V21 | 4/12/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 4/13/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage-distorted/warped/wrinkle                         | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 4/13/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 4/14/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 6  | L68 | V87 | 4/15/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | calibration-issue/re-flash;field service                | None of the Above | Unknown | Unknown | N | "* "   | "99" | 28 | *   | V00 | 6/30/2022  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | field service action                                    | None of the Above | Unknown | Unknown | N | "* "   | "99" | 31 | *   | V00 | 10/26/2022 |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | field service action;function-                          | None of the Above | Unknown | Unknown | N | "* "   | "99" | 26 | A99 | V99 | 8/4/2022   |
| GSAR\AWS | chassis;steering;steering lines/hoses              | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 4  | L68 | V87 | 4/15/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | field service action                                    | None of the Above | Unknown | Unknown | N | "* "   | "99" | 18 | *   | V00 | 3/31/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage-cracked/fractured/split;f                        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 1  | L68 | V87 | 4/16/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | field service action                                    | None of the Above | Unknown | Unknown | N | "* "   | "99" | 8  | *   | V00 | 3/31/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 4/16/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 4/16/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | field service action                                    | None of the Above | Unknown | Unknown | N | "* "   | "99" | 2  | *   | V00 | 4/14/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 1  | L68 | V87 | 4/16/2021  |
| GSAR\AWS | chassis;service brakes;abs;brake                   | air in system;air in system ;function-                  | None of the Above | Unknown | Unknown | N | "7T03" |      | 5  | H19 | V21 | 4/16/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | field service action;function-                          | None of the Above | Unknown | Unknown | N | "* "   | "99" | 10 | *   | V00 | 4/14/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 1/12/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 2  | L68 | V87 | 3/8/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses              | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 0  | L68 | V87 | 3/8/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses              | air in system ;fluid level-insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 9/28/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 3/8/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses              | fluid;function-                                         | None of the Above | Unknown | Unknown | N | "* "   |      | 17 | *   | V00 | 9/6/2022   |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | field service action                                    | None of the Above | Unknown | Unknown | N | "5V07" |      | 9  | H20 | V21 | 3/10/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage-cut/corn/frayed;function-                        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 3/15/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 3/22/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 3  | L68 | V87 | 3/22/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 3/22/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 0  | L68 | V87 | 3/22/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | field service action                                    | None of the Above | Unknown | Unknown | N | "* "   | "99" | 11 | *   | V00 | 4/26/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 3/29/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 1  | L68 | V87 | 3/29/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 3  | L68 | V87 | 3/29/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 4  | L68 | V87 | 3/29/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 4  | L68 | V87 | 3/29/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 4/1/2021   |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | field service action                                    | None of the Above | Unknown | Unknown | N | "* "   | "99" | 11 | *   | V00 | 4/7/2022   |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 4/7/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage-chafed/excessive                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 12 | L68 | V87 | 5/16/2022  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo            | field service action                                    | None of the Above | Unknown | Unknown | N | "* "   | "99" | 13 | *   | V00 | 5/19/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses              | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 4  | L68 | V87 | 4/19/2021  |

|          |                                                  |                                                                    |                   |         |         |   |        |      |    |     |     |           |
|----------|--------------------------------------------------|--------------------------------------------------------------------|-------------------|---------|---------|---|--------|------|----|-----|-----|-----------|
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage;damage-battery acid/fluid damage;flaw in                    | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 0  | L68 | V87 | 4/19/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage;damage-battery acid/fluid damage;flaw in                    | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 4  | L68 | V87 | 4/19/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage;damage-battery acid/fluid damage;flaw in                    | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 2  | L68 | V87 | 4/19/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage;damage-battery acid/fluid damage;flaw in                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 4/19/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-cracked/fractured/split;f                                   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 4/19/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | ejected/blown out under pressure;fluid level-                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 4/19/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;function-malfunction/inoperative;l                  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 4/19/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;damage-cracked/fractured/split;f                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 1  | L68 | V87 | 4/20/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage;damage-battery acid/fluid damage;flaw in                    | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 0  | L68 | V87 | 4/20/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 4/20/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 4/20/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;function-malfunction/inoperative;                   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 4/21/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;                                  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 4/21/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 4/22/2021 |
| GSAR\AWS | chassis;steering;service brakes;booster/hydroboo | electrical;climate control;a/c                                     | None of the Above | Unknown | Unknown | N | "* "   | "99" | 13 | *   | V00 | 5/19/2022 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-terminal/connector;field                                    | None of the Above | Unknown | Unknown | N | "* "   | "99" | 23 | *   | V00 | 5/4/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | flaw in material ;function-malfunction/inoperative;                | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 4  | L68 | V87 | 4/23/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-cracked/fractured/split;f                                   | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 11 | L68 | V87 | 4/26/2021 |
| GSAR\AWS | electrical;climate control;a/c                   | mod-location-under hood;repair-mtime                               | None of the Above | Unknown | Unknown | N | "* "   | "99" | 23 | *   | V00 | 5/5/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;function-malfunction/inoperative;l                  | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 5  | L68 | V87 | 4/26/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 4/27/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;fluid level-insufficient fluid;function-leak-failed | None of the Above | Unknown | Unknown | N | "5Q02" |      | 11 | L68 | V87 | 4/27/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | gasket/seal/weatherstrip;                                          | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 0  | L68 | V87 | 4/27/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-terminal/connector;funct                                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 4/27/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;damage-cracked/fractured/split;f                    | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 9  | L68 | V87 | 4/27/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-bent/buckled/kinked;dam                                     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 4/27/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;function-malfunction/inoperative;                   | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 8  | L68 | V87 | 4/28/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 4/28/2021 |
| GSAR\AWS | chassis;service brakes;booster/hydroboo          | field service action                                               | None of the Above | Unknown | Unknown | N | "* "   | "99" | 17 | *   | V00 | 3/18/2022 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 18 | L68 | V87 | 4/13/2022 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;function-malfunction/inoperative;                   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 1  | L68 | V87 | 4/29/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 4/29/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage;function-malfunction/inoperative;                           | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 4/29/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 4/29/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                                 | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 3  | L68 | V87 | 4/30/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-cracked/fractured/split;fl                                  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 4/30/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-cut/torn/frayed                                             | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 4/30/2021 |
| GSAR\AWS | chassis;service brakes;booster/hydroboo          | function-malfunction/inoperative;                                  | None of the Above | Unknown | Unknown | N | "5V07" |      | 5  | H20 | V21 | 4/30/2021 |
| GSAR\AWS | chassis;service brakes;booster/hydroboo          | field service action;function-                                     | None of the Above | Unknown | Unknown | N | "* "   | "99" | 26 | *   | V00 | 8/7/2023  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo          | field service action                                               | None of the Above | Unknown | Unknown | N | "* "   | "99" | 0  | *   | V00 | 3/18/2022 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 5/3/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;damage-terminal/connector;funct                     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 5/3/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;i                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 5/3/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;i                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 5/3/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;function-malfunction/inoperative;l                  | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 1  | L68 | V87 | 5/4/2021  |

|  |          |                           |                              |                              |                             |                      |                   |         |         |        |      |      |     |           |           |
|--|----------|---------------------------|------------------------------|------------------------------|-----------------------------|----------------------|-------------------|---------|---------|--------|------|------|-----|-----------|-----------|
|  | GSAR\AWS | chassis;service           | field service action         | None of the Above            | Unknown                     | Unknown              | N                 |         | "* "    | "99"   | 10   | *    | V00 | 4/7/2022  |           |
|  | GSAR\AWS | brakes;booster/hydroboo   | chassis;service              | air in                       | None of the Above           | Unknown              | Unknown           | N       | "5V07"  | "05"   | 1    | L68  | V87 | 5/5/2021  |           |
|  | GSAR\AWS | brakes;booster/hydroboo   | system;ejected/blown         | chassis;steering;steering    | None of the Above           | Unknown              | Unknown           | N       | "5Q02"  |        | 4    | L68  | V87 | 5/5/2021  |           |
|  | GSAR\AWS | lines/hoses               | cracked/fractured/split;f    | chassis;service              | field service action        | None of the Above    | Unknown           | Unknown | N       | "* "   | "99" | *    | V00 | 4/8/2022  |           |
|  | GSAR\AWS | brakes;booster/hydroboo   | chassis;steering;steering    | function-                    | malfunction/inoperative;    | None of the Above    | Unknown           | Unknown | N       | "5Q02" |      | L68  | V87 | 5/6/2021  |           |
|  | GSAR\AWS | lines/hoses               | damage-                      | cracked/fractured/split;f    | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" |      | L68  | V87 | 5/7/2021  |           |
|  | GSAR\AWS | chassis;steering;steering | function-                    | malfunction/inoperative;     | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 15   | L68  | V87 | 5/7/2021  |           |
|  | GSAR\AWS | lines/hoses               | malfunction/inoperative;     | chassis;service              | field service action        | None of the Above    | Unknown           | Unknown | N       | "* "   | "99" | *    | V00 | 4/13/2022 |           |
|  | GSAR\AWS | brakes;booster/hydroboo   | chassis;service              | field service action         | None of the Above           | Unknown              | Unknown           | N       | "* "    | "99"   | 2    | *    | V00 | 4/15/2022 |           |
|  | GSAR\AWS | brakes;booster/hydroboo   | chassis;steering;steering    | damage-                      | cracked/fractured/split;fl  | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 4    | L68  | V87 | 5/10/2021 |           |
|  | GSAR\AWS | lines/hoses               | air in system ;function-     | malfunction/inoperative;l    | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 2    | L68  | V87 | 5/10/2021 |           |
|  | GSAR\AWS | chassis;steering;steering | air in system ;fluid level-  | insufficient fluid;function- | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 3    | L68  | V87 | 5/10/2021 |           |
|  | GSAR\AWS | lines/hoses               | insufficient fluid;function- | malfunction/inoperative;l    | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 3    | L68  | V87 | 5/4/2022  |           |
|  | GSAR\AWS | chassis;steering;steering | function-                    | malfunction/inoperative;     | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | "28" | 2    | L68 | V87       | 5/11/2021 |
|  | GSAR\AWS | lines/hoses               | fluid level-insufficient     | fluid;function-              | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | "05" | 15   | L68 | V87       | 5/11/2021 |
|  | GSAR\AWS | lines/hoses               | air in system ;fluid level-  | insufficient fluid;function- | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | "28" | 2    | L68 | V87       | 5/11/2021 |
|  | GSAR\AWS | chassis;service           | field service                | action;function-             | brakes;booster/hydroboo     | None of the Above    | Unknown           | Unknown | N       | "* "   | "99" | 17   | *   | V00       | 4/1/2022  |
|  | GSAR\AWS | brakes;booster/hydroboo   | chassis;steering;steering    | air in system ;function-     | malfunction/inoperative;    | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 3    | L68  | V87 | 5/12/2021 |           |
|  | GSAR\AWS | lines/hoses               | malfunction/inoperative;     | bulging/swollen line or      | chassis;service             | None of the Above    | Unknown           | Unknown | N       | "5V07" | 5    | H19  | V21 | 5/12/2021 |           |
|  | GSAR\AWS | brakes;booster/hydroboo   | hose;contaminated/forel      | chassis;steering;steering    | function-                   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | "28" | 10   | L68 | V87       | 5/12/2021 |
|  | GSAR\AWS | lines/hoses               | malfunction/inoperative;l    | chassis;steering;steering    | lines/hoses                 | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 2    | L68  | V87 | 5/13/2021 |           |
|  | GSAR\AWS | chassis;steering;steering | pinched/crimped;functio      | chassis;steering;steering    | function-                   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 6    | L68  | V87 | 5/13/2021 |           |
|  | GSAR\AWS | lines/hoses               | malfunction/inoperative;l    | chassis;steering;steering    | function-                   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 4    | L68  | V87 | 5/13/2021 |           |
|  | GSAR\AWS | chassis;steering;steering | malfunction/inoperative;l    | chassis;steering;steering    | function-                   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | "28" | 1    | L68 | V87       | 5/13/2021 |
|  | GSAR\AWS | lines/hoses               | malfunction/inoperative;     | chassis;service              | function-                   | None of the Above    | Unknown           | Unknown | N       | "5V07" | "05" | 1    | L68 | V87       | 5/17/2021 |
|  | GSAR\AWS | brakes;booster/hydroboo   | malfunction/inoperative;     | chassis;steering;steering    | malfunction/inoperative;    | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 0    | L68  | V87 | 5/17/2021 |           |
|  | GSAR\AWS | chassis;steering;steering | damage;function-             | chassis;steering;steering    | malfunction/inoperative;    | None of the Above    | Unknown           | Unknown | N       | "5V07" | "05" | 5    | H50 | V87       | 5/17/2021 |
|  | GSAR\AWS | lines/hoses               | function-                    | brakes;booster/hydroboo      | malfunction/inoperative     | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 0    | L68  | V87 | 5/18/2021 |           |
|  | GSAR\AWS | chassis;steering;steering | malfunction/inoperative      | chassis;steering;steering    | damage-                     | None of the Above    | Unknown           | Unknown | N       | "5Q02" |      | L68  | V87 | 5/18/2021 |           |
|  | GSAR\AWS | lines/hoses               | cracked/fractured/split;le   | chassis;steering;steering    | function-                   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 3    | L68  | V87 | 5/19/2021 |           |
|  | GSAR\AWS | chassis;steering;steering | function-                    | malfunction/inoperative;l    | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | "28" | 6    | L68 | V87       | 5/19/2021 |
|  | GSAR\AWS | lines/hoses               | air in system ;function-     | malfunction/inoperative;     | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" |      | 5    | L68 | V87       | 5/21/2021 |
|  | GSAR\AWS | chassis;steering;steering | damage-                      | cracked/fractured/split;f    | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | "05" | 4    | N58 | V87       | 5/21/2021 |
|  | GSAR\AWS | lines/hoses               | function-                    | malfunction/inoperative;l    | chassis;steering;steering   | None of the Above    | Unknown           | Unknown | N       | "5Q02" |      | 2    | L68 | V87       | 5/21/2021 |
|  | GSAR\AWS | chassis;steering;steering | air in system ;function-     | malfunction/inoperative;l    | chassis;service             | field service action | None of the Above | Unknown | Unknown | N      | "* " | "99" | *   | V00       | 4/28/2022 |
|  | GSAR\AWS | brakes;booster/hydroboo   | chassis;steering;steering    | damage;damage-               | terminal/connector;funct    | None of the Above    | Unknown           | Unknown | N       | "5Q02" | "28" | 0    | L68 | V87       | 5/24/2021 |
|  | GSAR\AWS | lines/hoses               | malfunction/inoperative;     | chassis;steering;steering    | damage-                     | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 1    | L68  | V87 | 5/24/2021 |           |
|  | GSAR\AWS | chassis;steering;steering | cracked/fractured/split;fl   | chassis;steering;steering    | air in system ;fluid level- | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 0    | L68  | V87 | 5/25/2021 |           |
|  | GSAR\AWS | lines/hoses               | insufficient fluid;function- | chassis;steering;steering    | function-                   | None of the Above    | Unknown           | Unknown | N       | "5Q02" | "28" | 5    | L68 | V87       | 5/26/2021 |
|  | GSAR\AWS | chassis;steering;steering | malfunction/inoperative;l    | chassis;steering;steering    | function-                   | None of the Above    | Unknown           | Unknown | N       | "5Q02" |      | 7    | L68 | V87       | 5/26/2021 |
|  | GSAR\AWS | lines/hoses               | malfunction/inoperative;l    | chassis;steering;steering    | air in system ;flaw in      | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 3    | L68  | V87 | 5/26/2021 |           |
|  | GSAR\AWS | lines/hoses               | material ;fluid level-       | chassis;steering;steering    | air in system ;function-    | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 10   | L68  | V87 | 5/27/2021 |           |
|  | GSAR\AWS | chassis;steering;steering | malfunction/inoperative;l    | chassis;steering;steering    | function-                   | None of the Above    | Unknown           | Unknown | N       | "5Q02" |      | 5    | L68 | V87       | 5/28/2021 |
|  | GSAR\AWS | lines/hoses               | malfunction/inoperative;     | chassis;steering;steering    | damage;flaw in material     | None of the Above    | Unknown           | Unknown | N       | "5Q02" | 3    | L68  | V87 | 5/28/2021 |           |
|  | GSAR\AWS | chassis;steering;steering | fluid level-insufficient     | chassis;steering;steering    | fluid level-insufficient    | None of the Above    | Unknown           | Unknown | N       | "5Q02" |      | 2    | L68 | V87       | 5/28/2021 |
|  | GSAR\AWS | lines/hoses               | fluid;function-              | chassis;steering;steering    | damage;damage-battery       | None of the Above    | Unknown           | Unknown | N       | "5Q02" | "28" | 3    | L68 | V87       | 5/28/2021 |
|  | GSAR\AWS | chassis;steering;steering | acid/fluid damage;flaw in    | lines/hoses                  |                             |                      |                   |         |         |        |      |      |     |           |           |

|          |                                                  |                                                         |                   |         |         |   |        |      |    |     |     |            |
|----------|--------------------------------------------------|---------------------------------------------------------|-------------------|---------|---------|---|--------|------|----|-----|-----|------------|
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-cracked/fractured/split;ej                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 11 | L68 | V87 | 6/22/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage;damage-battery acid;fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 0  | L68 | V87 | 5/31/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage;damage-battery acid;fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 7  | L68 | V87 | 5/31/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | leak-failed gasket/seal/weatherstrip;                   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 9  | L68 | V87 | 5/31/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 6/1/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;damage-pinchd/cripmed;fluid              | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 6/1/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;function-malfunction/inoperative;l       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 10 | L68 | V87 | 6/2/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 12 | L68 | V87 | 6/2/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;damage-cracked/fractured/split;d         | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 2/4/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;damage-cracked/fractured/split;d         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 4  | N58 | V87 | 6/3/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage;damage-battery acid;fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 0  | L68 | V87 | 6/3/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-threads stripped/crossthreaded;f                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 4/16/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo          | function-malfunction/inoperative                        | None of the Above | Unknown | Unknown | N | " "    | "99" | 18 | *   | *   | 3/8/2023   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 6  | L68 | V87 | 6/4/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 10 | L68 | V87 | 6/4/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 12 | L68 | V87 | 6/4/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 6/4/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 6/4/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 6/7/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-cracked/fractured/split;fl                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 6  | L68 | V87 | 6/7/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 1  | L68 | V87 | 6/7/2021   |
| GSAR\AWS | chassis;service brakes;booster/hydroboo          | field service action                                    | None of the Above | Unknown | Unknown | N | " "    | "99" | 20 | *   | V00 | 3/14/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 6/8/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 1  | L68 | V87 | 6/9/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 6/9/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | flaw in material ;function-malfunction/inoperative;     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 6/9/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;fluid level-insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 27 | L68 | V87 | 11/22/2022 |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 6/10/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 1  | L68 | V87 | 6/10/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 6/10/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 6/11/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo          | field service action                                    | None of the Above | Unknown | Unknown | N | " "    | "99" | 18 | *   | V00 | 4/6/2022   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-cracked/fractured/split;fl                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 6/11/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 6/14/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo          | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5V07" |      | 8  | L63 | V21 | 6/14/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | air in system ;damage;damage-                           | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 6/14/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | frozen/seized;function-malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5Q02" |      | 16 | L68 | V87 | 6/15/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | damage-cracked/fractured/split;ej                       | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 9  | L68 | V87 | 6/15/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 3  | L68 | V87 | 6/16/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 11 | L68 | V87 | 6/16/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 6/16/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 6/16/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 6/16/2021  |
| GSAR\AWS | chassis;steering;service brakes;booster/hydroboo | field service action                                    | None of the Above | Unknown | Unknown | N | " "    | "99" | 3  | *   | V00 | 3/1/2022   |
| GSAR\AWS | chassis;steering;steering lines/hoses            | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 6/16/2021  |

|          |                                            |                                                                                  |                   |         |         |   |  |  |      |        |      |     |     |            |           |
|----------|--------------------------------------------|----------------------------------------------------------------------------------|-------------------|---------|---------|---|--|--|------|--------|------|-----|-----|------------|-----------|
| GSAR\AWS | chassis;steering;steering lines/hoses      | air in system ;flaw in material ;fluid level-                                    | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 12   | L68 | V87 | 6/17/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-                                                                        | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 2    | L68 | V87 | 6/17/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | malfunction/inoperative; air in system ;fluid level-insufficient fluid;function- | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 2    | L68 | V87 | 6/17/2021  |           |
| GSAR\AWS | electrical;start-charge;chassis;steering;s | field service action;function-                                                   | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 14   | *   | V00 | 4/14/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | flaw in material ;fluid level-insufficient                                       | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | "05" | 5   | L68 | V87        | 6/17/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; air in system ;fluid level-                    | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 7    | L68 | V87 | 6/17/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | air in system ;fluid level-insufficient fluid;function-                          | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 6    | L68 | V87 | 6/17/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; field service action;mod-                      | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 6    | L68 | V87 | 6/18/2021  |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo    | aftermarket                                                                      | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 14   | *   | V00 | 4/15/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | flaw in material ;function-malfunction/inoperative; air in system ;damage-       | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 8    | L68 | V87 | 6/18/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | cracked/fractured/split;fl                                                       | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 2    | L68 | V87 | 6/21/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | fluid level-insufficient fluid;function-                                         | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 3    | L68 | V87 | 6/21/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; field service action;mod-                      | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 3    | L68 | V87 | 6/21/2021  |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo    | pre delivery                                                                     | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 25   | *   | V00 | 10/14/2022 |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo    | field service action                                                             | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 14   | *   | V00 | 7/8/2022   |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo    | field service action                                                             | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 6    | *   | V00 | 4/12/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; field service action                           | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 3    | L68 | V87 | 6/23/2021  |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo    | field service action                                                             | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 6    | *   | V00 | 4/13/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; air in system ;fluid level-                    | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 9    | L68 | V87 | 6/23/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | air in system ;fluid level-insufficient fluid;function-                          | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 14   | L68 | V87 | 12/30/2022 |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; field service action                           | None of the Above | Unknown | Unknown | N |  |  | "05" | "5Q02" | 12   | L68 | V87 | 6/24/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; field service action                           | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 12   | L68 | V87 | 6/24/2021  |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo    | field service action                                                             | None of the Above | Unknown | Unknown | N |  |  |      | "* "   | 17   | *   | V00 | 8/23/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; damage-                                        | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 3    | L68 | V87 | 6/24/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | cracked/fractured/split;f                                                        | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 8    | L68 | V87 | 6/24/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | damage-cracked/fractured/split;f                                                 | None of the Above | Unknown | Unknown | N |  |  | "05" | "5Q02" | 6    | L68 | V87 | 6/24/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | air in system ;function-malfunction/inoperative; air in system ;function-        | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 4    | L68 | V87 | 6/24/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | malfunction/inoperative; field service action                                    | None of the Above | Unknown | Unknown | N |  |  | "05" | "5Q02" | 3    | L68 | V87 | 6/25/2021  |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo    | field service action                                                             | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 17   | *   | V00 | 10/10/2022 |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; field service action                           | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 4    | L68 | V87 | 6/26/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; air in system ;fluid level-                    | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 3    | L68 | V87 | 6/28/2021  |           |
| GSAR\AWS | chassis;service brakes;brake lines/hoses   | air in system ;fluid level-insufficient fluid;function-                          | None of the Above | Unknown | Unknown | N |  |  | "05" | "5V05" | 0    | L63 | V21 | 6/28/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | damage-burned component (not                                                     | None of the Above | Unknown | Unknown | N |  |  | "05" | "5Q02" | 1    | L68 | V87 | 6/28/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; damage-                                        | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 4    | L68 | V87 | 6/28/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | malfunction/inoperative; damage-cracked/fractured/split;fl                       | None of the Above | Unknown | Unknown | N |  |  | "05" | "5Q02" | 6    | L68 | V87 | 6/28/2021  |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo    | damage-cracked/fractured/split;fi                                                | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 18   | *   | V00 | 11/14/2022 |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | fluid level-insufficient fluid;function-                                         | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 2    | L68 | V87 | 6/29/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; damage-                                        | None of the Above | Unknown | Unknown | N |  |  | "05" | "5Q02" | 12   | L68 | V87 | 6/29/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | malfunction/inoperative; damage-cracked/fractured/split;f                        | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 2    | L68 | V87 | 6/29/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | damage;damage-chafed/excessive                                                   | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 1    | L68 | V87 | 6/29/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | damage;flaw in material ;function-                                               | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 6    | L68 | V87 | 6/30/2021  |           |
| GSAR\AWS | chassis;service brakes;booster/hydroboo    | field service action                                                             | None of the Above | Unknown | Unknown | N |  |  | "99" | "* "   | 6    | *   | V00 | 4/12/2022  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; field service action                           | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 1    | L68 | V87 | 6/30/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; field service action                           | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 9    | L68 | V87 | 6/30/2021  |           |
| GSAR\AWS | chassis;steering;steering lines/hoses      | function-malfunction/inoperative; field service action                           | None of the Above | Unknown | Unknown | N |  |  |      | "5Q02" | 15   | L68 | V87 | 6/30/2021  |           |

|          |                                    |                                     |                   |            |           |   |        |    |     |     |            |
|----------|------------------------------------|-------------------------------------|-------------------|------------|-----------|---|--------|----|-----|-----|------------|
| GSAR\AWS | chassis;service                    | fluid level-insufficient            | None of the Above | Unknown    | Unknown   | N | "5V07" | 3  | L63 | V21 | 6/30/2021  |
| GSAR\AWS | brakes;booster/hydroboos           | fluid;function-                     | None of the Above | Unknown    | Unknown   | N | "5Q02" | 7  | L68 | V87 | 6/30/2021  |
| GSAR\AWS | chassis;steering;steering          | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 7  | L68 | V87 | 6/30/2021  |
| GSAR\AWS | lines/hoses                        | function-                           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 17 | L68 | V87 | 7/1/2021   |
| GSAR\AWS | chassis;steering;steering          | damage-                             | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 6/30/2021  |
| GSAR\AWS | lines/hoses                        | cracked/fractured/split;f           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 4  | L68 | V87 | 6/30/2021  |
| GSAR\AWS | chassis;steering;steering          | function-                           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 4  | L68 | V87 | 6/30/2021  |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 4  | L68 | V87 | 6/30/2021  |
| GSAR\AWS | chassis;service                    | field service action                | None of the Above | Unknown    | Unknown   | N | "* "   | 5  | *   | V00 | 4/14/2022  |
| GSAR\AWS | brakes;booster/hydroboos           | function-                           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 4  | L68 | V87 | 7/1/2021   |
| GSAR\AWS | chassis;steering;steering          | malfunction/inoperative;]           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 1  | L68 | V87 | 7/1/2021   |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;]           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 8  | L68 | V87 | 7/2/2021   |
| GSAR\AWS | chassis;steering;steering          | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 8  | L68 | V87 | 7/2/2021   |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "* "   | 8  | *   | V00 | 6/15/2022  |
| GSAR\AWS | chassis;service                    | field service action                | None of the Above | Unknown    | Unknown   | N | "* "   | 8  | *   | V00 | 6/15/2022  |
| GSAR\AWS | brakes;booster/hydroboos           | fluid level-insufficient            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/5/2021   |
| GSAR\AWS | chassis;steering;steering          | fluid;function-                     | None of the Above | Unknown    | Unknown   | N | "5Q02" | 8  | L68 | V87 | 7/4/2021   |
| GSAR\AWS | lines/hoses                        | fluid level-insufficient            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 0  | L68 | V87 | 7/5/2021   |
| GSAR\AWS | chassis;steering;steering          | air in system ;leak-failed          | None of the Above | Unknown    | Unknown   | N | "5Q02" | 7  | L68 | V87 | 7/5/2021   |
| GSAR\AWS | lines/hoses                        | gasket/seal/weatherstrip;           | Smoke             | Under Hood | No Damage | Y | "5Q02" | 7  | L68 | V87 | 7/5/2021   |
| GSAR\AWS | chassis;steering;steering          | fire-function-                      | Smoke             | Under Hood | No Damage | Y | "5Q02" | 7  | L68 | V87 | 7/5/2021   |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 8  | L68 | V87 | 7/6/2021   |
| GSAR\AWS | chassis;steering;steering          | damage;fluid level-                 | None of the Above | Unknown    | Unknown   | N | "5Q02" | 8  | L68 | V87 | 7/6/2021   |
| GSAR\AWS | lines/hoses                        | insufficient fluid;function-        | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/6/2021   |
| GSAR\AWS | chassis;steering;steering          | function-                           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/6/2021   |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/6/2021   |
| GSAR\AWS | chassis;steering;steering          | fluid level-insufficient            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/7/2021   |
| GSAR\AWS | lines/hoses                        | fluid;leak-failed                   | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/7/2021   |
| GSAR\AWS | chassis;steering;steering          | damage-                             | None of the Above | Unknown    | Unknown   | N | "5Q02" | 7  | L68 | V87 | 7/7/2021   |
| GSAR\AWS | lines/hoses                        | cracked/fractured/split;f           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 7  | L68 | V87 | 7/7/2021   |
| GSAR\AWS | chassis;steering;steering          | damage-                             | None of the Above | Unknown    | Unknown   | N | "5Q02" | 8  | L68 | V87 | 7/7/2021   |
| GSAR\AWS | lines/hoses                        | cracked/fractured/split;f           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 8  | L68 | V87 | 7/7/2021   |
| GSAR\AWS | chassis;steering;steering          | fluid level-insufficient            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/8/2021   |
| GSAR\AWS | lines/hoses                        | fluid;function-                     | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/8/2021   |
| GSAR\AWS | chassis;steering;steering          | function-                           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 17 | L68 | V87 | 7/8/2021   |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;]           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 17 | L68 | V87 | 7/8/2021   |
| GSAR\AWS | chassis;steering;steering          | malfunction/inoperative;]           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 7  | L68 | V87 | 7/9/2021   |
| GSAR\AWS | lines/hoses                        | damage;function-                    | None of the Above | Unknown    | Unknown   | N | "5Q02" | 7  | L68 | V87 | 7/9/2021   |
| GSAR\AWS | chassis;steering;steering          | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 9  | L68 | V87 | 6/17/2022  |
| GSAR\AWS | lines/hoses                        | damage-                             | None of the Above | Unknown    | Unknown   | N | "5Q02" | 9  | L68 | V87 | 6/17/2022  |
| GSAR\AWS | chassis;steering;steering          | chafed/excessive                    | None of the Above | Unknown    | Unknown   | N | "5Q02" | 9  | L68 | V87 | 6/17/2022  |
| GSAR\AWS | lines/hoses                        | field service action                | None of the Above | Unknown    | Unknown   | N | "* "   | 10 | *   | V00 | 6/27/2022  |
| GSAR\AWS | chassis;service                    | field service action                | None of the Above | Unknown    | Unknown   | N | "* "   | 10 | *   | V00 | 6/27/2022  |
| GSAR\AWS | brakes;booster/hydroboos           | fluid level-insufficient            | None of the Above | Unknown    | Unknown   | N | "5V05" | 0  | L63 | V21 | 7/9/2021   |
| GSAR\AWS | chassis;service                    | fluid;leak-fluid;loose              | None of the Above | Unknown    | Unknown   | N | "5V05" | 0  | L63 | V21 | 7/9/2021   |
| GSAR\AWS | brakes;brake lines/hoses           | air in system ;flaw in              | None of the Above | Unknown    | Unknown   | N | "5Q02" | 1  | L68 | V87 | 7/9/2021   |
| GSAR\AWS | chassis;steering;steering          | material ;fluid level-              | None of the Above | Unknown    | Unknown   | N | "5Q02" | 1  | L68 | V87 | 7/9/2021   |
| GSAR\AWS | lines/hoses                        | field service                       | None of the Above | Unknown    | Unknown   | N | "5Q02" | 20 | L68 | V87 | 5/23/2023  |
| GSAR\AWS | chassis;steering;steering          | action;function-                    | None of the Above | Unknown    | Unknown   | N | "5Q02" | 20 | L68 | V87 | 5/23/2023  |
| GSAR\AWS | lines/hoses                        | field service                       | None of the Above | Unknown    | Unknown   | N | "5Q02" | 20 | L68 | V87 | 5/23/2023  |
| GSAR\AWS | body;locks/latches;chassis;service | field service action;incorrect size | None of the Above | Unknown    | Unknown   | N | "* "   | 9  | *   | V00 | 4/19/2022  |
| GSAR\AWS | chassis;steering;steering          | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/12/2021  |
| GSAR\AWS | lines/hoses                        | damage-                             | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/12/2021  |
| GSAR\AWS | chassis;steering;steering          | chafed/excessive                    | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/12/2021  |
| GSAR\AWS | brakes;booster/hydroboos           | air in system ;damage-              | None of the Above | Unknown    | Unknown   | N | "5Q02" | 15 | L68 | V87 | 11/21/2022 |
| GSAR\AWS | chassis;steering;steering          | cracked/fractured/split;f           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 15 | L68 | V87 | 11/21/2022 |
| GSAR\AWS | lines/hoses                        | air in system ;function-            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 3  | L68 | V87 | 7/12/2021  |
| GSAR\AWS | chassis;steering;steering          | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 3  | L68 | V87 | 7/12/2021  |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 12 | L68 | V87 | 7/13/2021  |
| GSAR\AWS | chassis;steering;steering          | adhesive/sealer                     | None of the Above | Unknown    | Unknown   | N | "5Q02" | 12 | L68 | V87 | 7/13/2021  |
| GSAR\AWS | lines/hoses                        | failure/missing;function-           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/13/2021  |
| GSAR\AWS | chassis;steering;steering          | air in system ;field service        | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/13/2021  |
| GSAR\AWS | lines/hoses                        | action;flaw in material             | None of the Above | Unknown    | Unknown   | N | "5Q02" | 2  | L68 | V87 | 7/13/2021  |
| GSAR\AWS | chassis;steering;steering          | air in system ;damage-              | None of the Above | Unknown    | Unknown   | N | "5Q02" | 0  | L68 | V87 | 7/13/2021  |
| GSAR\AWS | lines/hoses                        | cracked/fractured/split;f           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 0  | L68 | V87 | 7/13/2021  |
| GSAR\AWS | chassis;steering;steering          | improper                            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 7/14/2021  |
| GSAR\AWS | lines/hoses                        | assembly;incorrect size             | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 7/14/2021  |
| GSAR\AWS | chassis;steering;steering          | function-                           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 7/14/2021  |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;]           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 7/14/2021  |
| GSAR\AWS | chassis;service                    | field service                       | None of the Above | Unknown    | Unknown   | N | "* "   | 26 | *   | V00 | 6/30/2023  |
| GSAR\AWS | brakes;booster/hydroboos           | action;function-                    | None of the Above | Unknown    | Unknown   | N | "* "   | 26 | *   | V00 | 6/30/2023  |
| GSAR\AWS | chassis;steering;steering          | function-                           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 11 | L68 | V87 | 8/9/2021   |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;]           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 11 | L68 | V87 | 8/9/2021   |
| GSAR\AWS | chassis;steering;steering          | function-                           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 7  | L68 | V87 | 7/15/2021  |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 7  | L68 | V87 | 7/15/2021  |
| GSAR\AWS | chassis;service                    | air in system;damage-               | None of the Above | Unknown    | Unknown   | N | "5V07" | 7  | L68 | V87 | 7/15/2021  |
| GSAR\AWS | brakes;booster/hydroboos           | cracked/fractured/split;f           | None of the Above | Unknown    | Unknown   | N | "5V07" | 7  | L68 | V87 | 7/15/2021  |
| GSAR\AWS | chassis;steering;steering          | damage;function-                    | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 7/15/2021  |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 7/15/2021  |
| GSAR\AWS | chassis;steering;steering          | flaw in material ;function-         | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 7/16/2021  |
| GSAR\AWS | lines/hoses                        | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 7/16/2021  |
| GSAR\AWS | chassis;steering;steering          | malfunction/inoperative;            | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 7/19/2021  |
| GSAR\AWS | lines/hoses                        | damage-                             | None of the Above | Unknown    | Unknown   | N | "5Q02" | 6  | L68 | V87 | 7/19/2021  |
| GSAR\AWS | chassis;steering;steering          | cracked/fractured/split;f           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 4  | L68 | V87 | 7/19/2021  |
| GSAR\AWS | lines/hoses                        | cracked/fractured/split;f           | None of the Above | Unknown    | Unknown   | N | "5Q02" | 4  | L68 | V87 | 7/19/2021  |

|          |                           |                              |                   |         |         |   |        |      |    |     |     |            |
|----------|---------------------------|------------------------------|-------------------|---------|---------|---|--------|------|----|-----|-----|------------|
| GSAR\AWS | chassis;service           | field service action         | None of the Above | Unknown | Unknown | N | "* "   | "99" | 18 | *   | V00 | 3/1/2022   |
| GSAR\AWS | brakes;booster/hydroboo   |                              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | damage;function-             | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 9  | L68 | V87 | 7/20/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;service           | field service action         | None of the Above | Unknown | Unknown | N | "* "   | "99" | 4  | *   | V00 | 4/13/2022  |
| GSAR\AWS | brakes;booster/hydroboo   |                              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 9  | L68 | V87 | 7/20/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | improper                     | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 8  | L68 | V87 | 7/21/2021  |
| GSAR\AWS | lines/hoses               | assembly;incorrect size      |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 6  | L68 | V87 | 7/21/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | fluid level-insufficient     | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 13 | L68 | V87 | 5/18/2022  |
| GSAR\AWS | lines/hoses               | fluid;function-              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 7/22/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | damage-                      | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 7  | L68 | V87 | 7/22/2021  |
| GSAR\AWS | lines/hoses               | cracked/fractured/split;f    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | fluid level-insufficient     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 7/23/2021  |
| GSAR\AWS | lines/hoses               | fluid;function-              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;service           | field service action         | None of the Above | Unknown | Unknown | N | "* "   | "99" | 13 | *   | V00 | 5/18/2022  |
| GSAR\AWS | brakes;booster/hydroboo   |                              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | air in system ;function-     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 7/23/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;service           | field service action         | None of the Above | Unknown | Unknown | N | "* "   | "99" | 12 | *   | V00 | 4/5/2022   |
| GSAR\AWS | brakes;booster/hydroboo   |                              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | damage-                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 7/26/2021  |
| GSAR\AWS | lines/hoses               | cracked/fractured/split;d    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | fluid level-insufficient     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 10/27/2021 |
| GSAR\AWS | lines/hoses               | fluid;function-              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 9  | L68 | V87 | 7/27/2021  |
| GSAR\AWS | lines/hoses               | air in system ;function-     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | malfunction/inoperative;     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 10/27/2021 |
| GSAR\AWS | lines/hoses               | fluid level-insufficient     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | fluid;function-              | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 7/27/2021  |
| GSAR\AWS | lines/hoses               | damage-                      |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | cracked/fractured/split;f    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 7/28/2021  |
| GSAR\AWS | lines/hoses               | air in system ;fluid level-  |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 10/27/2021 |
| GSAR\AWS | lines/hoses               | fluid level-insufficient     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | fluid;function-              | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 2  | L68 | V87 | 7/28/2021  |
| GSAR\AWS | lines/hoses               | air in system ;damage-       |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | cracked/fractured/split;f    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 1  | L68 | V87 | 7/29/2021  |
| GSAR\AWS | lines/hoses               | function-                    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | malfunction/inoperative;     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 10/27/2021 |
| GSAR\AWS | lines/hoses               | fluid level-insufficient     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | fluid;function-              | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 10/27/2021 |
| GSAR\AWS | lines/hoses               | fluid level-insufficient     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | fluid;function-              | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 10/27/2021 |
| GSAR\AWS | lines/hoses               | fluid level-insufficient     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | fluid;function-              | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 10/27/2021 |
| GSAR\AWS | lines/hoses               | field service action         |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;service           |                              | None of the Above | Unknown | Unknown | N | "* "   | "99" | 10 | *   | V00 | 5/24/2022  |
| GSAR\AWS | brakes;booster/hydroboo   |                              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 7/29/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 13 | L68 | V87 | 8/10/2022  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;service           | field service                | None of the Above | Unknown | Unknown | N | "* "   | "99" | 12 | *   | V00 | 4/30/2022  |
| GSAR\AWS | brakes;booster/hydroboo   | action;function-stays        |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | damage-                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 13 | L68 | V87 | 6/30/2022  |
| GSAR\AWS | lines/hoses               | cracked/fractured/split;f    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | damage;damage-battery        | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 8  | L68 | V87 | 7/30/2021  |
| GSAR\AWS | lines/hoses               | acid/fluid                   |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;service           | field service action         | None of the Above | Unknown | Unknown | N | "* "   | "99" | 14 | *   | V00 | 3/26/2022  |
| GSAR\AWS | brakes;booster/hydroboo   |                              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | damage-                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 9  | L68 | V87 | 7/30/2021  |
| GSAR\AWS | lines/hoses               | cracked/fractured/split;f    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;service           | field service                | None of the Above | Unknown | Unknown | N | "* "   | "99" | 3  | *   | V00 | 5/9/2022   |
| GSAR\AWS | brakes;booster/hydroboo   | action;function-             |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;service           | field service action         | None of the Above | Unknown | Unknown | N | "* "   | "99" | 15 | *   | V00 | 1/24/2023  |
| GSAR\AWS | brakes;booster/hydroboo   |                              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | fluid level-insufficient     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 7/30/2021  |
| GSAR\AWS | lines/hoses               | fluid;function-              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;service           | calibration-issue/re-        | None of the Above | Unknown | Unknown | N | "* "   | "99" | 15 | *   | V00 | 1/24/2023  |
| GSAR\AWS | brakes;booster/hydroboo   | flash;field service action   |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | damage-                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 7/30/2021  |
| GSAR\AWS | lines/hoses               | terminal;connector;funct     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;service           | field service action         | None of the Above | Unknown | Unknown | N | "* "   | "99" | 5  | *   | V00 | 4/14/2022  |
| GSAR\AWS | brakes;brake lines/hoses  |                              |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | damage-                      | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 4  | L68 | V87 | 7/30/2021  |
| GSAR\AWS | lines/hoses               | cracked/fractured/split;f    |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | air in system                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 7/30/2021  |
| GSAR\AWS | lines/hoses               | damage;function-             |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 7/30/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | function-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 7/31/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;     |                   |         |         |   |        |      |    |     |     |            |
| GSAR\AWS | chassis;steering;steering | damage-                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 17 | L68 | V87 | 7/31/2021  |
| GSAR\AWS | lines/hoses               | cracked/fractured/split;fr   |                   |         |         |   |        |      |    |     |     |            |

|          |                           |                            |                   |         |         |   |        |      |    |     |     |            |
|----------|---------------------------|----------------------------|-------------------|---------|---------|---|--------|------|----|-----|-----|------------|
| GSAR\AWS | chassis;service           | field service action       | None of the Above | Unknown | Unknown | N | "      | "99" | 9  | *   | V00 | 6/13/2022  |
| GSAR\AWS | brakes;booster/hydroboo   | field service              | None of the Above | Unknown | Unknown | N | "      | "99" | 22 | *   | V00 | 9/19/2022  |
| GSAR\AWS | powertrain;engine;chassi  | action;function-           | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 5  | L68 | V87 | 8/2/2021   |
| GSAR\AWS | s;service                 | damage-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 8/2/2021   |
| GSAR\AWS | chassis;steering;steering | cracked/fractured/split;hi | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/2/2021   |
| GSAR\AWS | lines/hoses               | function-                  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | *   | 8/3/2021   |
| GSAR\AWS | chassis;steering;steering | malfunction/inoperative;   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 8/3/2021   |
| GSAR\AWS | lines/hoses               | damage-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 8/3/2021   |
| GSAR\AWS | chassis;steering;steering | cracked/fractured/split;f  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 10 | L68 | V87 | 8/3/2021   |
| GSAR\AWS | lines/hoses               | air in system ;damage-     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 8/4/2021   |
| GSAR\AWS | chassis;steering;steering | terminal/connector;funct   | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 3  | L68 | V87 | 8/4/2021   |
| GSAR\AWS | lines/hoses               | function-                  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 1  | L68 | V87 | 8/5/2021   |
| GSAR\AWS | chassis;steering;steering | malfunction/inoperative;   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 6  | L68 | V87 | 8/5/2021   |
| GSAR\AWS | lines/hoses               | fluid level-insufficient   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 8/5/2021   |
| GSAR\AWS | chassis;steering;steering | fluid;function-            | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 8/5/2021   |
| GSAR\AWS | lines/hoses               | fluid level-insufficient   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 8/5/2021   |
| GSAR\AWS | chassis;steering;steering | damage;function-           | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | *   | V00 | 4/15/2022  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;   | None of the Above | Unknown | Unknown | N | "      | "99" | 11 | *   | V00 | 4/13/2022  |
| GSAR\AWS | chassis;steering;steering | air in system ;function-   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 4/15/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/7/2021   |
| GSAR\AWS | chassis;steering;steering | damage-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 18 | L63 | V21 | 8/9/2021   |
| GSAR\AWS | lines/hoses               | cracked/fractured/split;d  | None of the Above | Unknown | Unknown | N | "5V07" |      | 4  | L68 | V87 | 8/9/2021   |
| GSAR\AWS | chassis;service           | leak-failed                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 1  | L68 | V87 | 8/9/2021   |
| GSAR\AWS | brakes;booster/hydroboo   | gasket/seal/weatherstrip;  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/9/2021   |
| GSAR\AWS | chassis;steering;steering | damage-                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 7/10/2021  |
| GSAR\AWS | lines/hoses               | cracked/fractured/split;f  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 8/9/2021   |
| GSAR\AWS | chassis;steering;steering | cracked/fractured/split;f  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/9/2021   |
| GSAR\AWS | lines/hoses               | function-                  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/9/2021   |
| GSAR\AWS | chassis;steering;steering | malfunction/inoperative;   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 8/10/2021  |
| GSAR\AWS | lines/hoses               | fluid level-insufficient   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 8/9/2021   |
| GSAR\AWS | chassis;steering;steering | fluid;function-            | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/9/2021   |
| GSAR\AWS | lines/hoses               | fluid level-insufficient   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 8/10/2021  |
| GSAR\AWS | chassis;steering;steering | air in system ;damage-     | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 7  | L68 | V87 | 8/10/2021  |
| GSAR\AWS | lines/hoses               | bent/buckled/kinked;dam    | None of the Above | Unknown | Unknown | N | "      | "99" | 18 | *   | V00 | 10/31/2022 |
| GSAR\AWS | chassis;service           | field service              | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 8/10/2021  |
| GSAR\AWS | brakes;booster/hydroboo   | action;function-           | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 8/10/2021  |
| GSAR\AWS | chassis;steering;steering | function-                  | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 19 | L68 | V87 | 8/10/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 6  | L68 | V87 | 8/11/2021  |
| GSAR\AWS | chassis;steering;steering | cracked/fractured/split;fl | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/12/2021  |
| GSAR\AWS | lines/hoses               | function-                  | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 7  | L68 | V87 | 8/12/2021  |
| GSAR\AWS | chassis;steering;steering | malfunction/inoperative;l  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 8/12/2021  |
| GSAR\AWS | lines/hoses               | air in system              | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/13/2021  |
| GSAR\AWS | chassis;steering;steering | ;damage;function-          | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 8/13/2021  |
| GSAR\AWS | lines/hoses               | air in system ;function-   | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 17 | L68 | V87 | 2/1/2022   |
| GSAR\AWS | chassis;steering;steering | malfunction/inoperative;l  | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/13/2021  |
| GSAR\AWS | lines/hoses               | fluid level-insufficient   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 26 | *   | V00 | 10/10/2022 |
| GSAR\AWS | chassis;service           | field service action       | None of the Above | Unknown | Unknown | N | "      | "99" | 6  | L68 | V87 | 8/16/2021  |
| GSAR\AWS | brakes;booster/hydroboo   | ejected/blown out under    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 6  | L68 | V87 | 8/16/2021  |
| GSAR\AWS | chassis;steering;steering | pressure;function-         | None of the Above | Unknown | Unknown | N | "5Q02" |      | 6  | L68 | V87 | 8/16/2021  |
| GSAR\AWS | lines/hoses               | malfunction/inoperative;l  | None of the Above | Unknown | Unknown | N | "5Q02" |      |    |     |     |            |

|          |                                         |                                                         |                   |         |         |   |        |      |    |     |     |            |
|----------|-----------------------------------------|---------------------------------------------------------|-------------------|---------|---------|---|--------|------|----|-----|-----|------------|
| GSAR\AWS | chassis;steering;steering lines/hoses   | fluid level-insufficient fluid;frozen/seized;functi     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 1  | L68 | V87 | 8/16/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;fluid level-insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 8/17/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage;damage-battery acid/fluid                        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 14 | L68 | V87 | 8/17/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 12 | L68 | V87 | 9/15/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;f                        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 9  | L68 | V87 | 8/18/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | flaw in material ;function-malfunction/inoperative;i    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 8/18/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 8/18/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;f                        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 18 | L68 | V87 | 8/19/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 9  | L68 | V87 | 8/20/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage;damage-cracked/fractured/split;fr                | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 2  | L68 | V87 | 8/21/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action;function-                          | None of the Above | Unknown | Unknown | N | " "    | "99" | 18 | *   | V00 | 3/22/2022  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action                                    | None of the Above | Unknown | Unknown | N | " "    | "99" | 2  | *   | V00 | 4/8/2022   |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;fluid level-insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5Q02" |      | 20 | L68 | V87 | 10/18/2022 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 4  | L68 | V87 | 8/24/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 8/25/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action;function-                          | None of the Above | Unknown | Unknown | N | " " "  | "99" | 20 | *   | V00 | 10/18/2022 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/25/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | function-malfunction/inoperative                        | None of the Above | Unknown | Unknown | N | " " "  | "99" | 22 | *   | V00 | 3/9/2022   |
| GSAR\AWS | chassis;steering;steering lines/hoses   | flaw in material ;function-malfunction/inoperative;i    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 8/25/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage;damage-battery acid/fluid damage;flaw in         | None of the Above | Unknown | Unknown | N | "5Q02" |      | 14 | L68 | V87 | 8/25/2021  |
| GSAR\AWS | chassis;service brakes;brake            | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5G88" | "05" | 17 | H19 | V21 | 8/25/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | flaw in material ;leak-fluid                            | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 8/25/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/26/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | appearance;damage-cracked/fractured/split;f             | None of the Above | Unknown | Unknown | N | "5Q02" |      | 1  | L68 | V87 | 8/25/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | flaw in material ;function-malfunction/inoperative;i    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 8/26/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;ej                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 8/26/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action                                    | None of the Above | Unknown | Unknown | N | " " "  | "99" | 14 | *   | V00 | 6/24/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 8/27/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 12 | L68 | V87 | 8/27/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | flaw in material ;function-malfunction/inoperative;     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 6  | L68 | V87 | 8/27/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;damage-cracked/fractured/split;fl        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 18 | L68 | V87 | 11/20/2022 |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action                                    | None of the Above | Unknown | Unknown | N | " " "  | "99" | 20 | *   | V00 | 3/28/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 16 | L68 | V87 | 8/30/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | function-malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5V07" |      | 11 | L63 | V21 | 8/30/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 8/30/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 10 | L68 | V87 | 8/31/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 8/31/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-terminal/connector;funct                         | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 4  | L68 | V87 | 8/31/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 27 | L68 | V87 | 11/14/2022 |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5V07" |      | 6  | L63 | V21 | 8/31/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 16 | L68 | V87 | 8/31/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 13 | L68 | V87 | 11/26/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 11 | L68 | V87 | 9/1/2021   |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;fluid level-insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5Q02" |      | 0  | L68 | V87 | 9/1/2021   |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | damage-terminal/connector;field                         | None of the Above | Unknown | Unknown | N | " " "  | "99" | 16 | *   | V00 | 4/12/2022  |

|  |          |                                          |                                                                                                                                                                                                                                                                                                             |                   |         |         |   |  |  |        |    |     |     |            |
|--|----------|------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------|---------|---------|---|--|--|--------|----|-----|-----|------------|
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage-cracked/fractured/split;field service action                                                                                                                                                                                                                                                         | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 2  | L68 | V87 | 9/2/2021   |
|  | GSAR\AWS | chassis;service brakes;booster/hydroboos | function-malfunction/inoperative;field service action                                                                                                                                                                                                                                                       | None of the Above | Unknown | Unknown | N |  |  | "* "   | 24 | *   | V00 | 5/4/2022   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;field service action                                                                                                                                                                                                                                                       | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 31 | L68 | V87 | 12/18/2022 |
|  | GSAR\AWS | chassis;service brakes;booster/hydroboos | function-malfunction/inoperative;air in system ;damage-cracked/fractured/split;field service action                                                                                                                                                                                                         | None of the Above | Unknown | Unknown | N |  |  | "5V07" | 5  | H07 | V21 | 9/2/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage-terminal/connector;function-malfunction/inoperative;field service action                                                                                                                                                                                                                             | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 5  | L68 | V87 | 9/2/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;field service action                                                                                                                                                                                                                                                       | None of the Above | Unknown | Unknown | N |  |  | "* "   | 19 | *   | V00 | 3/22/2022  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;field service action                                                                                                                                                                                                                                                       | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 5  | L68 | V87 | 9/2/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage-cracked/fractured/split;fluid damage;damage-battery acid/fluid damage;flaw in fluid level-insufficient fluid;function-malfunction/inoperative;air in system;fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 8  | L68 | V87 | 9/2/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage-cracked/fractured/split;fluid damage;damage-battery acid/fluid damage;flaw in fluid level-insufficient fluid;function-malfunction/inoperative;air in system;fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 8  | L68 | V87 | 9/3/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | fluid level-insufficient fluid;function-malfunction/inoperative;air in system;fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                      | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 4  | L68 | V87 | 9/3/2021   |
|  | GSAR\AWS | chassis;service brakes;booster/hydroboos | insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                                                    | None of the Above | Unknown | Unknown | N |  |  | "5V07" | 11 | H20 | V21 | 9/6/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                                                    | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 2  | L68 | V87 | 9/7/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage-cracked/fractured/split;fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                     | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 14 | L68 | V87 | 9/7/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                   | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 11 | L68 | V87 | 9/8/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                    | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 7  | L68 | V87 | 9/9/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | field service action                                                                                                                                                                                                                                                                                        | None of the Above | Unknown | Unknown | N |  |  | "* "   | 21 | *   | V00 | 3/25/2022  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                   | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 9  | L68 | V87 | 9/9/2021   |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                   | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 3  | L68 | V87 | 12/21/2020 |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | air in system ;damage;damage-terminal/connector;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                   | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 18 | L68 | V87 | 9/12/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage;damage-terminal/connector;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                  | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 20 | L68 | V87 | 9/11/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage-terminal/connector;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                         | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 2  | L68 | V87 | 9/14/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage-cracked/fractured/split;ej                                                                                                                                                                                                                                                                           | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 7  | L68 | V87 | 9/14/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                   | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 7  | L68 | V87 | 9/14/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                   | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 12 | L68 | V87 | 9/14/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                   | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 31 | *   | V00 | 1/25/2023  |
|  | GSAR\AWS | chassis;service brakes;booster/hydroboos | field service action                                                                                                                                                                                                                                                                                        | None of the Above | Unknown | Unknown | N |  |  | "* "   | 24 | *   | V00 | 3/23/2022  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                    | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 8  | L68 | V87 | 9/14/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                    | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 2  | L68 | V87 | 2/26/2021  |
|  | GSAR\AWS | chassis;service brakes;abs               | calibration-issue/re-flash;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                        | None of the Above | Unknown | Unknown | N |  |  | "7T03" | 7  | H07 | V21 | 9/15/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                   | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 4  | L68 | V87 | 9/15/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage-bent/buckled/kinked;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                        | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 21 | L68 | V87 | 1/26/2022  |
|  | GSAR\AWS | chassis;service brakes;booster/hydroboos | damage-terminal/connector;field damage;damage-battery acid/fluid damage;fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                            | None of the Above | Unknown | Unknown | N |  |  | "* "   | 24 | *   | V00 | 3/23/2022  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage;damage-battery acid/fluid damage;fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                            | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 13 | L68 | V87 | 9/15/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                   | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 1  | L68 | V87 | 9/16/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                                                   | None of the Above | Unknown | Unknown | N |  |  | "5V07" | 20 | L68 | V87 | 9/17/2021  |
|  | GSAR\AWS | chassis;service brakes;booster/hydroboos | insufficient fluid;leak-fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                            | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 2  | L68 | V87 | 9/17/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                    | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 11 | L68 | V87 | 9/20/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage-cracked/fractured/split;fluid damage;damage-battery acid/fluid                                                                                                                                                                                                                                       | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 11 | L68 | V87 | 9/20/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                    | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 5  | L68 | V87 | 9/21/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                    | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 5  | L68 | V87 | 9/21/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                                    | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 13 | L68 | V87 | 9/21/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage;damage-battery acid/fluid damage;flaw in fluid in material ;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 16 | L68 | V87 | 9/21/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage;damage-battery acid/fluid damage;flaw in fluid in material ;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 15 | L68 | V87 | 9/21/2021  |
|  | GSAR\AWS | chassis;steering;steering lines/hoses    | damage;damage-battery acid/fluid damage;flaw in field service action                                                                                                                                                                                                                                        | None of the Above | Unknown | Unknown | N |  |  | "* "   | 21 | *   | V00 | 5/5/2022   |
|  | GSAR\AWS | chassis;service brakes;booster/hydroboos | air in system ;fluid level-insufficient fluid;function-malfunction/inoperative;insufficient fluid;function-malfunction/inoperative;field service action                                                                                                                                                     | None of the Above | Unknown | Unknown | N |  |  | "5Q02" | 5  | L68 | V87 | 9/22/2021  |

|          |                                         |                                                         |                   |         |         |   |        |      |    |     |     |            |
|----------|-----------------------------------------|---------------------------------------------------------|-------------------|---------|---------|---|--------|------|----|-----|-----|------------|
| GSAR\AWS | chassis;steering;steering lines/hoses   | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 5  | L68 | V87 | 9/23/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 9/23/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | field service action;function-                          | None of the Above | Unknown | Unknown | N | "5Q02" |      | 22 | L68 | V87 | 6/15/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;f                        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 9/23/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | leak-failed gasket/seal/weatherstrip;                   | None of the Above | Unknown | Unknown | N | "5Q02" |      | 16 | L68 | V87 | 12/23/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;e                        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 6  | L68 | V87 | 9/26/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 4  | L68 | V87 | 9/27/2021  |
| GSAR\AWS | chassis;service brakes;abs;brake        | air in system;air in system ;calibration-issue/re-      | None of the Above | Unknown | Unknown | N | "7T03" |      | 8  | H19 | V21 | 9/27/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 9  | L68 | V87 | 9/27/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 10 | L68 | V87 | 9/27/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action                                    | None of the Above | Unknown | Unknown | N | "*     | "99" | 15 | *   | V00 | 7/13/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 9  | L68 | V87 | 9/28/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" | "28" | 10 | L68 | V87 | 9/28/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-terminal/connector;funct                         | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 9/29/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-pinched/crimped;functio                          | None of the Above | Unknown | Unknown | N | "5Q02" |      | 3  | L68 | V87 | 9/28/2021  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | corroded/rusted;damage;                                 | None of the Above | Unknown | Unknown | N | "5V07" |      | 17 | H02 | V21 | 9/29/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-damage-threads                                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 12 | L68 | V87 | 9/29/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | stripped/crossthreaded;f                                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 10 | L68 | V87 | 9/30/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 11 | L68 | V87 | 9/30/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;fluid level-insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5Q02" |      | 5  | L68 | V87 | 9/30/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;l       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 10/1/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 6  | L68 | V87 | 10/1/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-terminal/connector;flaw                          | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 8  | L68 | V87 | 10/1/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-battery acid/fluid                               | None of the Above | Unknown | Unknown | N | "5Q02" |      | 22 | L68 | *   | 3/6/2023   |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;l       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 15 | L68 | V87 | 10/1/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | flaw in material ;function-malfunction/inoperative;l    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 18 | *   | V00 | 4/29/2022  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action                                    | None of the Above | Unknown | Unknown | N | "*     | "99" | 9  | L68 | V87 | 10/4/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 21 | L68 | V87 | 9/20/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 16 | L68 | V87 | 10/7/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-damage-battery acid/fluid                        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 7  | L68 | V87 | 10/8/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 10 | L68 | V87 | 10/8/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-damage-battery acid/fluid                        | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 10/10/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;fluid level-insufficient fluid;function- | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 10/12/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | air in system ;function-malfunction/inoperative;        | None of the Above | Unknown | Unknown | N | "5Q02" | "05" | 11 | L68 | V87 | 10/13/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "*     | "99" | 19 | *   | V00 | 3/21/2022  |
| GSAR\AWS | chassis;service brakes;booster/hydroboo | field service action                                    | None of the Above | Unknown | Unknown | N | "5Q02" |      | 17 | L68 | V87 | 10/14/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-cracked/fractured/split;fl                       | None of the Above | Unknown | Unknown | N | "5Q02" |      | 32 | L68 | V87 | 4/20/2023  |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-damage-cracked/fractured/split;f                 | None of the Above | Unknown | Unknown | N | "5Q02" |      | 9  | L68 | V87 | 10/14/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | flaw in material ;function-malfunction/inoperative;     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 8  | L68 | V87 | 10/14/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | damage-damage-chafed/excessive                          | None of the Above | Unknown | Unknown | N | "5Q02" |      | 13 | L68 | V87 | 10/15/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | flaw in material ;function-malfunction/inoperative;     | None of the Above | Unknown | Unknown | N | "5Q02" |      | 10 | L68 | V87 | 10/15/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | fluid level-insufficient fluid;function-                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 19 | L68 | V87 | 10/15/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | corroded/rusted;fluid level-insufficient                | None of the Above | Unknown | Unknown | N | "5Q02" |      | 2  | L68 | V87 | 10/15/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;l                      | None of the Above | Unknown | Unknown | N | "5Q02" |      | 12 | H19 | V21 | 10/15/2021 |
| GSAR\AWS | chassis;service brakes;abs;brake        | function-malfunction/inoperative;                       | None of the Above | Unknown | Unknown | N | "7T03" |      | 13 | L68 | V87 | 10/15/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses   | function-malfunction/inoperative;i                      | None of the Above | Unknown | Unknown | N | "5Q02" |      |    |     |     |            |

|          |                                       |                                  |                   |         |         |   |        |      |     |     |            |
|----------|---------------------------------------|----------------------------------|-------------------|---------|---------|---|--------|------|-----|-----|------------|
| GSAR\AWS | chassis;steering;steering lines/hoses | damage-cracked/fractured/split;f | None of the Above | Unknown | Unknown | N | "5Q02" | 9    | L68 | V87 | 10/18/2021 |
| GSAR\AWS | chassis;service                       | air in system;function-          | None of the Above | Unknown | Unknown | N | "5V07" | 10   | L63 | V21 | 10/19/2021 |
| GSAR\AWS | brakes;booster/hydroboo               | malfunction/inoperative;l        | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/19/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | damage-                          | None of the Above | Unknown | Unknown | N | "5Q02" | 11   | L68 | V87 | 10/19/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | cracked/fractured/split;fl       | None of the Above | Unknown | Unknown | N | "5Q02" | 4    | L68 | V87 | 10/20/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | air in system ;damage-           | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 11/9/2020  |
| GSAR\AWS | chassis;steering;steering lines/hoses | cracked/fractured/split;f        | None of the Above | Unknown | Unknown | N | "5Q02" | 5    | L68 | V87 | 1/28/2021  |
| GSAR\AWS | chassis;steering;steering lines/hoses | improperly routed;leak-          | None of the Above | Unknown | Unknown | N | "5Q02" | 12   | L68 | V87 | 10/20/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | fluid                            | None of the Above | Unknown | Unknown | N | "5Q02" | 13   | L68 | V87 | 10/20/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | function-                        | None of the Above | Unknown | Unknown | N | "5Q02" | 0    | L68 | V87 | 10/21/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5Q02" | 8    | L68 | V87 | 10/21/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | flaw in material ;function-      | None of the Above | Unknown | Unknown | N | "5Q02" | 1    | L68 | V87 | 10/22/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;l        | None of the Above | Unknown | Unknown | N | "5Q02" | 10   | L68 | V87 | 10/22/2021 |
| GSAR\AWS | chassis;service                       | fluid level-insufficient         | None of the Above | Unknown | Unknown | N | "5V05" | 11   | L63 | V21 | 10/22/2021 |
| GSAR\AWS | brakes;brake lines/hoses              | malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5V07" | 8    | L68 | V87 | 10/22/2021 |
| GSAR\AWS | chassis;service                       | leak-failed                      | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/24/2021 |
| GSAR\AWS | brakes;booster/hydroboo               | gasket/seal/weatherstrip;        | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/24/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | fluid level-insufficient         | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/24/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | fluid;function-                  | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/24/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | fluid level-insufficient         | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/24/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | fluid level-insufficient         | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/25/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | fluid;function-                  | None of the Above | Unknown | Unknown | N | "5Q02" | 17   | *   | V00 | 4/23/2022  |
| GSAR\AWS | chassis;service                       | field service action             | None of the Above | Unknown | Unknown | N | "* "   | "99" |     |     |            |
| GSAR\AWS | brakes;booster/hydroboo               |                                  | None of the Above | Unknown | Unknown | N | "5Q02" | 7    | L68 | V87 | 10/26/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | damage;ejected/blown             | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/26/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | out under pressure;fluid         | None of the Above | Unknown | Unknown | N | "5Q02" | 18   | L68 | V87 | 6/22/2022  |
| GSAR\AWS | chassis;steering;steering lines/hoses | fluid level-insufficient         | None of the Above | Unknown | Unknown | N | "5Q02" | 13   | L63 | V21 | 10/27/2021 |
| GSAR\AWS | chassis;service                       | fluid;function-                  | None of the Above | Unknown | Unknown | N | "5V07" | 2    | L68 | V87 | 10/26/2021 |
| GSAR\AWS | brakes;booster/hydroboo               | function-                        | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/26/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/26/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/26/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | function-                        | None of the Above | Unknown | Unknown | N | "5Q02" | 3    | L68 | V87 | 10/26/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/26/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | function-                        | None of the Above | Unknown | Unknown | N | "5Q02" | 13   | L68 | V87 | 10/27/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5Q02" | 1    | L68 | V87 | 10/27/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | damage;damage-battery            | None of the Above | Unknown | Unknown | N | "5Q02" | 21   | *   | V00 | 6/2/2022   |
| GSAR\AWS | chassis;steering;steering lines/hoses | acid/fluid damage;flaw in        | None of the Above | Unknown | Unknown | N | "5Q02" | 22   | *   | V00 | 4/5/2022   |
| GSAR\AWS | chassis;steering;steering lines/hoses | fluid level-insufficient         | None of the Above | Unknown | Unknown | N | "5Q02" | 27   | L68 | V87 | 8/16/2022  |
| GSAR\AWS | chassis;service                       | field service action             | None of the Above | Unknown | Unknown | N | "5Q02" | 6    | L68 | V87 | 8/31/2021  |
| GSAR\AWS | brakes;booster/hydroboo               | cracked/fractured/split;f        | None of the Above | Unknown | Unknown | N | "* "   | "99" |     |     |            |
| GSAR\AWS | chassis;steering;steering lines/hoses | field service action             | None of the Above | Unknown | Unknown | N | "5Q02" | 29   | *   | V00 | 7/17/2023  |
| GSAR\AWS | chassis;steering;steering lines/hoses | function-                        | None of the Above | Unknown | Unknown | N | "5Q02" | 6    | N58 | V87 | 8/6/2020   |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5Q02" | 9    | L68 | V87 | 10/27/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | function-                        | None of the Above | Unknown | Unknown | N | "5Q02" | 13   | L68 | V87 | 10/27/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5Q02" | 28   | *   | V00 | 5/11/2022  |
| GSAR\AWS | chassis;steering;service              | adhesive/sealer                  | None of the Above | Unknown | Unknown | N | "* "   | "99" |     |     |            |
| GSAR\AWS | brakes;booster/hydroboo               | failure/missing;air in           | None of the Above | Unknown | Unknown | N | "5Q02" | 12   | L68 | V87 | 10/28/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | field service action             | None of the Above | Unknown | Unknown | N | "5Q02" | 12   | L68 | V87 | 10/28/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | flaw in material ;function-      | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/28/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;l        | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/28/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | air in system ;flaw in           | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/28/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | material ;function-              | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/28/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/28/2021 |
| GSAR\AWS | chassis;steering;steering lines/hoses | malfunction/inoperative;         | None of the Above | Unknown | Unknown | N | "5Q02" | 2    | L68 | V87 | 10/28/2021 |

[illegible]

This investigation document contains the first fifty pages. You may request the full version through [NHTSA.ODI.CED@dot.gov](mailto:NHTSA.ODI.CED@dot.gov). Requests are answered as resources allow and in the order they are received

RQ24-003 000050 ER