

- ODI Comment: 'turning lane at a light and the Bronco died completely.'
- PD Analysis after CV data review: Possible LOMP event after 24S24 repair.

Detailed Vehicle Specification

GSAR Claim Key	Trx Code	Time In Service	Labor Hours	Dealership	DIST (Miles)	Repair Date	Prefix	Base	Suffix	Doc	
Details	13213079	E83	35	1.1	DAVE SMITH FORD, LLC	30385	09-SEP-2024	BAGM	48H6	760	23626701

Customer Comments	c/s that they just got gas and when they stopped at an intersection the veh showed 0 miles till E and then the autostart/stop kicked in and the veh then shut down and would not restart
Tech Comments	JUMP START VEHICLE, HOOK UP CHARGER, TEST WITH FDRS, LOTS OF CODES IN ALL MODULES. CODES U3003 PO607 PO600 PPT MONITOR TEST PIDS, QA, QE1-THRU QE-3 REPROGRAM PCM CHECK FOR SHORTED WIRING, OK. CHARGE AND TEST BATTERY FAILS DTC 8Q0 53FZ DTC FD00N. REPLACE BATTERY, RESET KAM TEST CHARGING SYSTEM 14.6 VOLTS

