

INFORMATION REDACTED PURSUANT TO THE FREEDOM OF INFORMATION ACT (FOIA), 5 U.S.C. 552(B)(6)



GREGG YOUNG CHEVROLET GMC OF COLUMBUS
615 23RD STREET E.
COLUMBUS, NE 68601
(402)564-2736
WWW.GREGGYOUNGAUTOGROUP.COM

CONTROL NO.	LICENSE PLATE NO.	CUST. LABOR RATE	PROD. DATE	IN-SERV DATE	DELIV. DATE	DELIV. MILES	RO COMMENT
				12/26/19	06/11/25	74361	
CELL	PHONE 2	PHONE 3	STOCK NO.	SERV. ADV. KIMBERLY HARVEY (005)			

Line **Op-Code** **Fail Code** **Tech** **Hours**

A * 4067490 A08 W

Concern C/S: customer states check engine light is on and vehicle is
Cause code p0300, cylinder #7 misfiring, found cylinder #7 lifter
found damage to camshaft, Found metal in oil from cutting
looking at the oil. Engine Replacement will be required.
Correction removed and replaced engine, transferred over parts, prime
and filter, bled and filled cooling system, test ran, all ok
Labor Op: 4067490
OLD: T1192059GNWX0838
NEW: 007507775

Pickup check
\$8,285.10

Part Number	Description	Quantity
12682391	SL-N-GASKET (01079-CT)	
12623437	SL-N-GASKET (00736-CKT)	
12626354	SL-N-GASKET (03270-CT)	
12679463	SL-N-PIPE (03163-CT)	1
12703596	SL-N-PIPE (03163-CT)	1
12679867	SL-N-GASKET (03901-CT)	1
12657093	SL-N-GASKET (03270-CKT)	2
11546600	N-BOLT (03275-BPCKT)	10
19459511	SL-N-SPARK PLUG (02270-CT)	8
85724972	HOSE	1
12658178	SL-N-BELT KIT (01066-CT)	1
12669858	SL-N-BELT (01066-CT)	1
12677002	SL-N-PIPE (03163-CT)	1
19432442	SL-N-SEAL KIT (03331-CKT)	2
20779890	N-CLAMP (03708-CT)	1
15035747	SL-N-SEAL (03611-CT)	1
15077362	SL-N-SEAL (03611-CT)	1
11569956	SL-N-BOLT (00669-BPCKT)	2
11588468	SL-N-BOLT (04115-BOPCKT)	6

INVOICE

CUSTOMER COPY

10/13/25 14:28