

CUSTOMER #

Perkins Chevrolet GMC
22 E. First Street
La Junta, CO 81050
Phone: (719) 384-4401
www.perkinsgm.com

6379 JOSHUA EVEATT

LICENSE	MILEAGE IN / OUT	TAG
	36116/36116	
RATE	PAYMENT	INV. DATE

01JAN21 DD 17:00 09JUN25 125.00 CASH 11JUN25

R.O. OPENED READY OPTIONS: ENG:6.2 LITER

11:28 09JUN25 16:24 11JUN25

LINE OPCODE TECH TYPE A/HRS S/HRS LIST NET TOTAL

A C/S THAT VEHICLE HAS A KNOCKING NOISE
CAUSE:

INFORMATION REDACTED
PURSUANT TO THE FREEDOM OF

CONCERN CODE:

INFORMATION ACT (FOIA), 5 U.S.C.

4062390 VALVE LIFTER REPLACEMENT - RIGHT SIDE	552(B)(6)	828.07	828.07
422 W 8.26 8.70 30450 82807			
8 12740071 0459BPCKT			
(S) LIFTER	37336 67952	0 84.94	84.94 679.52
2 12664915 0439CT			
(S) GUIDE	332 604	0 3.02	3.02 6.04
1 12619828 0426CKT (S) ROD	356 648	0 8.94	6.48 6.48
1 12688943 0289CT			
(S) GASKET	6452 11743	0 117.43	117.43 117.43
1 12619787 0423CKT			
(S) GASKET	421 766	0 7.66	7.66 7.66
10 11546959 0293CKT			
(S) BOLT	3400 6190	0 7.17	6.19 61.90
1 12679463 3163CT (S) PIPE	967 1760	0 19.32	17.60 17.60
1 12677002 3163CT (S) PIPE	4564 8306	0 93.57	83.06 83.06

PARTS: 979.69 LABOR: 828.07 OTHER: 0.00 TOTAL LINE A: 1807.76

VERSION 1 (EMP# 422,10JUN25 16:42): 36116 Found when starting engine it makes a very loud popping noise from upper front of engine. unable to determine if its left or right side. scanned for dtcs and found none. Removed both valve covers and cranked engine over and found all rockers moving and noise still present. removed intake and found cylinder 2 intake runner is very black. removed #2 intake rocker off and removed push rod and found it bent. removed all other rockers and push rods and found them all good. recomend repalcing all lifters on bank 2 and repalcing push rod. 8.70

Replaced all lifters on bank 2, and installed new push rod on #2 intake. changed oil and topped off coolant. test drove vehicle and

WARRANTY DISCLAIMER ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS IS. THE DEALERSHIP HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE AND NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF PARTS OR ACCESSORIES OR THE REPAIR. THE ONLY WARRANTIES ON PARTS AND ACCESSORIES OR REPAIRS ARE THOSE WHICH MAY BE OFFERED BY THE MANUFACTURER OR THE ORIGINAL PARTS DISTRIBUTOR AND ONLY SUCH MANUFACTURER OR DISTRIBUTOR SHALL BE LIABLE FOR PERFORMANCE UNDER SUCH WARRANTIES. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY DAMAGES FOR LOSS OF USE, LOSS OF TIME, LOSS OF PROFIT OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES.

*SHOP SUPPLY COSTS:
We have added a charge equal to 15% of the total cost of labor, not to exceed \$25.00, in the Misc. Charges amount for shop supplies used in connection with this repair.

ALL PARTS ARE NEW ORIGINAL EQUIPMENT MANUFACTURER PARTS UNLESS OTHERWISE INDICATED.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES *	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this Invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you. The vehicle is being returned to you in exchange for your payment of the Amount Due.

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

Section 30-20-1403, Colorado Revised Statutes, requires retailers to collect a waste tire fee set by the solid and hazardous waste commission on the sale of each new motor vehicle.