

INFORMATION REDACTED
PURSUANT TO THE FREEDOM OF
INFORMATION ACT (FOIA), 5 U.S.C.
552(B)(6)

Nimnich Buick GMC
Service NCA
11508 Phillips Hwy
Jacksonville, FL 32256
904-733-1616

256
351

STATE REG # MV46795

03/08/2024 15:52

Sale

32233

Trans #: 6 Batch #: 13

Model

CREDIT CARD

SIERRA 1500

AMEX CHIP READ

Entry Type: CONTACT

Invoice

Card Price / Cash Price

\$1052.07 \$1021.43

Cash Discount \$0.00

SUB TOTAL: \$1052.07

TOTAL AMT: USD \$1052.07

Resp: Transaction approved

Code: [REDACTED]

#: [REDACTED]

Name: AMERICAN

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

[REDACTED]

RIGHT - DIAGNOSIS
CHECK ENGINE LIGHT
ENDED UP GOING OFF
THE VEHICLE 4X. ENGI
OTHER GM SHOP.

Crankshaft Positic
Failed
Reference 1 Circuit
Failed
COLLINS (842)
COLLINS (842)

3093 :SL-N-SENSOR
2016 :N-WIRE (0252
8314 :SL-N-CONNECT
Circuits for 5 v refe
ned wiggle and pull

customer concern c
returned took for test dive and
codes returned suspected issue
sensor or engine wire harness r
returned then tested circuit 5
had 29 k ohms when hot ran new
x154 after that the code would

If paid with cash
You could've saved
\$30.64

No Cardholder Verification Method



Rockledge, FL 32256
 (407) 938-7321 Fax: (407) 737-2351
 gmccr@buickgmc.com

SERVICE DEPARTMENT HOURS
 7:00 a.m. to 7:00 p.m.
 Monday - Friday
 7:00 a.m. to 5:00 p.m. Saturday

R/O Open Date	R/O Number
02/14/24	6113551/2
R/O Close Date	Status
03/07/24	Pre-Invoice
Message In	Message Out
56567	56567
Service Advisor / Tag #	
MARIO BURGOS/4745	
Vehicle Identification Number	
1GTU9FELSKZ123718	
Delivery Date	In-Service Date
09/26/18	09/26/18
Color	License Number
WHITE FROS	

STATE REG #MVE076
 NOR, MATTHEW DEREK
 EAN BLVD
 IC BEACH, FL 32233

Work Phone
 917-691-2629
 Home Phone
 917-691-2629

Year	Make	Model	Body
2019	GMC	SIERRA 1500	4ND CREW CAB 147"
123718T			WHITE FROS

DESCRIPTION OF SERVICE AND PARTS
 found high resistance on circuit 5275
 code eventually returned tested circuit
 5275 again and while testing inspected connector
 x154 and found what looked like green grease
 inside under pin cap. restrung new wire 5275 and
 replaced connector x154
 Sub Total: 911.17

#2 - STEERING: STEERING CONCERN
 STEERING DIAGNOSIS - CUSTOMER STATES CUSTOMER STATE
 S DIC INDICATES POWER STEERING REDUCED. CHECK AND
 ADVISE
 Tech: SHANE COLLINS (842)
 See job 1
 Sub Total: .00

#3 - MPVI: MULTI POINT VEHICLE INSPECTION
 MULTI-POINT VEHICLE INSPECTION
 Sub Total: .00

Please Note: #4745 CREATED 2024-02-13 05:43:00PM TAKEN BY ARIAN
 NA GUEVARA POSSIBLE TOW IN (AG 2/13)

 * ATTENTION EFFECTIVE 6/12/2023 PAYMENT USING CREDIT/DEBIT *
 * CARD WILL INCUR A 3% FEE AT TIME OF PAYMENT CASH/CHECKS *
 * WILL NOT INCUR A FEE AT PAYMENT WE APOPOGIZE FOR ANY *
 * INCONVENIENCE THANK YOU

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
LABOR	
PARTS	
DEDUCTIBLE	
SUBLET	
SHOP SUPPLIES	
HAZARDOUS MATERIALS	
SALES TAX OR TAX I.D.	
SPECIAL ORDER DEPOSIT	
DISCOUNTS	
TOTAL DUE	

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS
 X

