

Jobs (3) Recommendations (2) MPI : 2. MPVIX 13% (4/51)

- [Add Job](#)
- 1. CONCERN, REC - CUSTOMER STATES THAT THE TRUCK LOST POWER WHILE DRIVING AND ...** Recommendation
 In Progress | **W** | 0.00 | 5.79 | 0.00 hrs | \$0.00 | \$0.00
 - 2. MPVIX - CUSTOMER AUTHORIZES GM VISUAL MULTI-POINT VEHICLE INSPECTION**
 Not Started | **I** | 0.30 | 0.00 | 0.00 hrs | \$0.00 | \$0.00
 - 3. AIRB - CA AIR PRESSURE INSPECTION.**
 Not Started | **I** | 0.00 | 0.00 | 0.00 hrs | \$0.00 | \$0.00
- Total** | **CP W I** | \$0.00 | \$0.00

AND ADVISE. ENGINE ASSEMBLY BATTERY FUSE BLOCK FOR STARTER FUSE

Cause Add Cause
 Type Cause here

Corrections

Pay Type* Technician Total Bill hrs Total Labor Price
 CP **W** I 0.00 \$0.00
 Manage Technician Assign Me
 SS SATWINDER SINGH

Opt. CONCERN - CUSTOMER STATES Edit

Labor Hrs*	Labor Rate*	Bill Rate*	Bill Hrs*	Labor Price*
0.00 hr	\$ 201.53 / hr WPE	\$ 201.53	0.00 hr	\$ 0.00

Tech story Add Story Line

verify customer concern. Check and verify the starter fuse on fuse block is burn. Push vehicle inside shop and verify engine not turning from crankshaft bolt. remove oil pan and verify the connecting rod bearing on cylinder #2 is spin cause engine oil contaminated with metal particles also crankshaft end has scoring. At this point recommend new engine and engine cooler lines along with new radiator and recheck again. Install steering rack and pinion and front differential on vehicle for now to remove it from rack

Billed Parts \$0.00

Part	Quantity	On Hand	ETA	Unit Price	Total price	Status
Mark as Complete Save						