

CUSTOMER #:

INFORMATION REDACTED
PURSUANT TO THE FREEDOM OF
INFORMATION ACT (FOIA), 5 U.S.C.
552(B)(6)

INVOICE



Cadillac

Cadillac of Memphis
5433 Poplar Avenue
Memphis, TN 38119
901-761-1900

www.landermemphis.com

PAGE 2

SERVICE ADVISOR: 349573 WILMAR COELHO

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
	21	CADILLAC ESCALADE			69534/69534		
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
29APR21 DD			18:00 08OCT25		0.00	CASH	09DEC25
R.O. OPENED		READY		OPTIONS: DLR:03820 ENG:6.2_Liter			
12:41 08OCT25		16:20 09DEC25					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	12623437	(S)	GASKET				(N/C)
6	15032594		NUT				(N/C)
1	12658178	(S)	BELT KIT				(N/C)
1	12346290		COOLANT				(N/C)
1	88864542		BATTERY				(N/C)
1	85015815	(S)	BLOCK				(N/C)
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A:							0.00

65000 Vehicle died while driving and was towed in 4067490 24.00
Vehicle engine was locked and would not turn over manually. I tried to
turn engine over manually with breaker bar and socket, but engine was
locked. I had to remove cylinder heads (Labor op codes 4061770 and
4061790) in order to turn engine over freely and remove torque
converter bolts. After successfully removing cylinder heads and getting
the old engine block out, I replaced old engine with
Remanufactured Engine. After replacement, I
refilled all fluids. I recharged a/c system. When I tried to start
vehicle, it would not start due to a dead battery. I performed a
battery test and was lead to replace battery (Labor op codes 4041512
and 4041510). After battery replacement, the vehicle would not start
due to a blown 400a fuse on the battery distribution fuse block. Once i
replaced the fuse block (Labor Op code 5430180), vehicle would start
up. All issues resolved

B ECM Software Update

CAUSE: F

9107810 Engine Control Module Reprogramming with
SPS

370758 WG

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: (N/C)
65000 Vehicle had open recall for ECM software update (N252510321)
9107810 0.30 I performed software update for engine control module.
WCC: [REDACTED] 0.00

**WARRANTY STATEMENT AND DISCLAIMER: PLEASE SEE THE
DEALERSHIP'S LIMITED WARRANTY ON THE REVERSE SIDE OF
THIS REPAIR INVOICE.**

By signing below, you acknowledge that you were notified of and
authorized the Dealership to perform the services/repairs itemized
in this Invoice and that you received (or had the opportunity to
inspect) any replaced parts as requested by you. The vehicle is
being returned to you in exchange for your payment of the Amount
Due.

DATE

AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

***SHOP SUPPLY COSTS:** We
have added a charge equal to
10% of the total cost of labor
and parts, not to exceed
\$19.95, to the Repair Order for
shop supplies used in connection
with this repair.

**ALL PARTS ARE NEW
UNLESS OTHERWISE
INDICATED.**

DESCRIPTION	TOTALS
LABOR AMOUNT	0.00
PARTS AMOUNT	0.00
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES *	0.00
TOTAL CHARGES	0.00
LESS INSURANCE	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	0.00