

INFORMATION REDACTED
PURSUANT TO THE FREEDOM OF
INFORMATION ACT (FOIA), 5 U.S.C.
552(B)(6)

2023 CHEVROLET SUBURBAN O
51127 51195 01/16/2026 PA

12/29/2025

07:13
13:46
01/16/2026

ADRIAN V2

(3) C/S VEHICLE WILL NOT START. CHECK & ADVISE

NOTE: VEHICLE TOWED IN!!
VERIFIED VEHICLE WILL NOT START. UPON
FURTHER TESTING FOUND MINI FUSE BLOWN.
ATTEMPTED TO TURN OVER THE ENGINE BY HAND
BUT FOUND IT LOCKED UP. REMOVED OIL COOLER
LINES AND FOUND THE OIL TO HAVE METAL DEBRIS.
REMOVED OIL FILTER ELEMENT AND FOUND METAL
DEBRIS ON BOTH SIDES. DUE TO THE FINDINGS
REPLACED THE WHOLE ENGINE ASSEMBLY AND
ALL NECESSARY COMPONENTS. FILLED ALL SYSTEMS
TO THE PROPER LEVEL. SEE LINE TWO FOR
FURTHER INFO.

4067490	752 192
12740076	(ENGINE)
12668858	(BELT)
12658178	(BELT KIT)
13575648	(SEAL)
13579649	(SEAL)
11549180	(BOLT)
23129010	(GASKET)
2258272	(RETAINER)
15035747	(SEAL)
15077362	(SEAL)
12624354	(GASKET)
12681391	(GASKET)
85639955	(SEAL)
11544600	(BOLT)
12657093	(GASKET)
12679463	(PIPE)
12703668	(PIPE)
12726902	(SEAL KIT)
19432442	(SEAL KIT)
12679867	(GASKET)
24504031	(SEAL)
12735811	(FILTER)
12346290	(COOLANT)
85724972	(HOSE)
85575818	(*RADIATOR)
11569956	(BOLT)
85015815	(BLOCK)
24288227	(SEAL)
19432866	(OIL)
12700664	(TUBE)
COLUSSY RE 16702 27901	

(Tech152) A

(2) REPLACED THE TOP BATTERY FUSE PANEL DUE TO
A 400 AMP FUSE BEING BLOWN BECAUSED OF THE
ENGINE BEING SEIZED. ROAD TESTED THE VEHICLE
FOR COUPLE OF MILES AND VERIFIED THE VEHICLE
IS OPERATING AS DESIGNED.

Labor 752

ON ENGINEERING/TAC WAS INVOLVED

Page 1 of 2 Reprint (1)

Job

Customer Copy