



PART OF THE
PRIETO AUTOMOTIVE FAMILY
1028 Academy Avenue • Sanger, CA 93657
(559) 399-4042 • chevroletbuickgmcofsanger.com

BAR # 292102
EPA # CAL0004392

CELL: [REDACTED]

CLOVIS, CA		ADVISOR CHARLES CHANTHAVIX	TAG NO. 428	INVOICE DATE 12/19/25	[REDACTED]
[REDACTED]		LABOR RATE	LICENSE NO.	MILEAGE 74,876	COLOR /
[REDACTED]		YEAR / MAKE / MODEL 21/GMC/YUKON XL/4DR 4WD			STOCK NO.
[REDACTED]		[REDACTED]			DELIVERY DATE
[REDACTED]		[REDACTED]			DELIVERY MILES
[REDACTED]		[REDACTED]			SELLING DEALER NO.
[REDACTED]		[REDACTED]			PRODUCTION DATE
[REDACTED]		F.T.E. NO.	P.O. NO.	R.O. DATE 11/12/25	[REDACTED]
RESIDENCE PHONE	BUSINESS PHONE	COMMENTS			MO: [REDACTED]

JOB# 1 CHARGES-----
LABOR-----
J# 1 10CVZ

DRIVEABILITY TECH(S):258 391 WARRANTY
CUSTOMER STATE AFTER RECALL WAS PERFORMED THE SERVICE ESC, SERVICE TRACTION CONTROL LIGHT THE FORWARD COLLISION SYSTEM UNAVAILABLE, CHECK ENGINE LIGHT IS ON AND THE VEHICLE IS RUNNING ROUGH. VEHICLE HAS EXCESSIVE SMOKE COMING OUT OF THE EXHAUST. PLEASE DO A VISUAL INSPECTION AND CHECK FOR RELATED TRUBLE CODES

GM CASE [REDACTED]
INSPECTED VEHICLE FOR CUSTOMER CONCERN FOR RUNNING ROUGH. VERIFIED. CHECK ENGINE LIGHT IS BLINKING. SCANNED FOR CODES AND FOUND P0300 AND P050D IN SYSTEM. COLD START MISFIRE AND MISFIRE DETECTED. PERFORMED RELATIVE COMPRESSION CHECK AND FOUND 2 CYLINDERS TO BE AT OR NEAR ZERO COMPRESSION. WENT ON GDS2 TO INSPECT MISFIRE COUNT AND FOUND CYLINDER #5 TO BE COMPLETELY DEAD. RECOMMEND TEAR TO INSPECT CAM LIFTER AND PUSH ROD. SEARCHED SI AND FOUND DOC# 5642225 STATING POSSIBLE ENGINE HEAD DEFORMITY. COULD SMELL BURNING COOLANT COMING FROM VEHICLE. VEHICLE'S ODD CYLINDER BANK WILL NEED TEAR DOWN. OPENED TAC CASE 11/13/2025. NUMBER 81946150 TAC STATED TO SEND VIDEO OF KNOCK, WHAT COLOR SMOKE, AND IF THERE IS METAL IN OIL WILL RESPOND TO TAC WITH ALL INFORMATION. NEW OIL AND NEW OIL FILTER CAN NOT GET A GOOD SAMPLE. TOOK VIDEO SAMPLE AND THERE IS BLUE AND WHITE SMOKE. PERFORMED PICOSCOPE L87 TEST AGAIN. HEARD NOTICEABLE KNOCKING NOISE. VEHICLE FAILED TEST. UPDATED TAC 11/26/25 4:22PM

PERFORMED ENGINE REMOVAL PROCEDURE AS STATED IN SI. RECOVERED 1,107 KG OF R-1234YF. DRAINED COOLANT AND REMOVED ENGINE FROM VEHICLE. PERFORMED ENGINE REPLACEMENT PROCEDURE. TRANSFERRED ALL COMPONENTS TO NEW ENGINE AND TORQUED TO SPEC. INSTALLED NEW WATER PUMP GASKETS, OIL LEVEL INDICATOR SEAL, INSTALLED NEW FUEL INJECTOR SEALS AND FUEL LINES. INSTALLED NEW EXHAUST MANIFOLD GASKETS. PERFORMED ENGINE INSTALLATION PROCEDURE. INSTALLED NEW MOTOR MOUNT BOLTS. INSTALLED EXHAUST NEW EXHAUST GASKETS. INSTALLED INTAKE MANIFOLD WITH NEW GASKETS. INSTALLED NEW A/C BELT AND SERPENTINE BELT. INSTALLED ALL HARNESS AND CONNECTORS. PRE LUBE VEHICLE. INSTALLED FAN, NEW RADIATOR. INSTALLED FRONT END COMPONENTS, PUT VEHICLE IN SERVICE MODE AND CLEARED DTC'S. STARTED VEHICLE AND VERIFIED NO LEAKS OR MISFIRES. CHARGED VEHICLE WITH 1,107 KG OF R-1234YF. 150 PSI ON HIGH SIDE, 30 PSI ON LOW SIDE, CENTER TEMPS AT 45 DEGREES. VACUUM FILLED COOLING SYSTEM, TEST DROVE VEHICLE AND NO MESSAGES OR CHECKING ENGINE LIGHT AFTER TEST DRIVE, NO LEAKS PRESENT AT THIS TIME.
OLD S/N ; N1212241CU8X0326
NEW S/N ; 007507775

Thank You

PARTS	QTY	FP-NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE	WARRANTY
	1	89022219	DYE 8.800			WARRANTY
	1	12669858	BELT 1.066			WARRANTY