

DAIMLERCHRYSLER

RECEIVED
2002 AUG -5 P 2 23
OFFICE OF
DEFECTS INVESTIGATION

DaimlerChrysler Corporation

Stephan J. Speth

Director

Vehicle Compliance & Safety Affairs

July 29, 2002


Mr. Kenneth N. Weinstein
Associate Administrator, Safety Assurance
National Highway Traffic Safety Administration
400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Mr. Weinstein:

Reference: NHTSA Identification Number 02V-076

Enclosed is a representative copy of an additional communication relating to the referenced recall. This completes DaimlerChrysler's package of information for this recall as required by the Defects Report Regulation.

Sincerely,

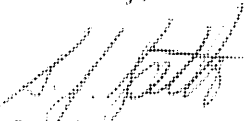

Stephan J. Speth, Director
Vehicle Compliance and Safety Affairs

Enclosure: UPDATE -- Safety Recall #B09 -- Seat Belt Assembly Part Numbers

cc: K. C. DeMeter

*To:dlrall\$1,dlrall\$2,dlrall\$3,dlrall\$4

UPDATE – Safety Recall #B09 – Seat Belt Assembly Part Numbers

Further review of the Dealer Service Instructions for Safety Recall #B09 – Rear Sound Barrier/Outboard Seat Belts has determined that the seat belt assembly part numbers listed in the table on Page 2 of the recall document are reversed – Right vs. Left.

The correct seat belt assembly part numbers may be determined using the table below:

Interior Color	Sales Code	Part Code	Belt Location	Part Number
Medium Quartz Or Agate	-C3 or	1	RIGHT	0SL701AZAA
	-AZ		LEFT	0SL711AZAA
Silverfern	-JK	2	RIGHT	0SL701JKAA
			LEFT	0SL711JKAA
Camel	-K5	3	RIGHT	0SL701K5AA
			LEFT	0SL711K5AA

Installation of a seat belt assembly in the incorrect location will cause the seat belt webbing to be difficult to extract from the retractor, both for the technician during installation and for the customer when using the seat belt. Dealers should contact any customers that may have had a seat belt assembly installed in an incorrect location as part of the recall service.

The Mopar Parts label on the seat belt package includes the correct location (LH = Left Hand or RH = Right Hand). The correct assembly can also be identified by the color of the retractor cover – Right (Passenger Side) – GREEN and Left (Driver Side) – BLUE or by verifying the part number on the retractor bar code label.

If a seat belt assembly requires replacement, dealers should file another claim using the recall LOP.

Please note the correct part number locations in all copies of Recall #B09. If you have any questions regarding this action, please contact your zone office.

Customer Services Field Operations
DaimlerChrysler Corporation